DATE: 24-2-64

SERVICE BULLETIN NO. 23

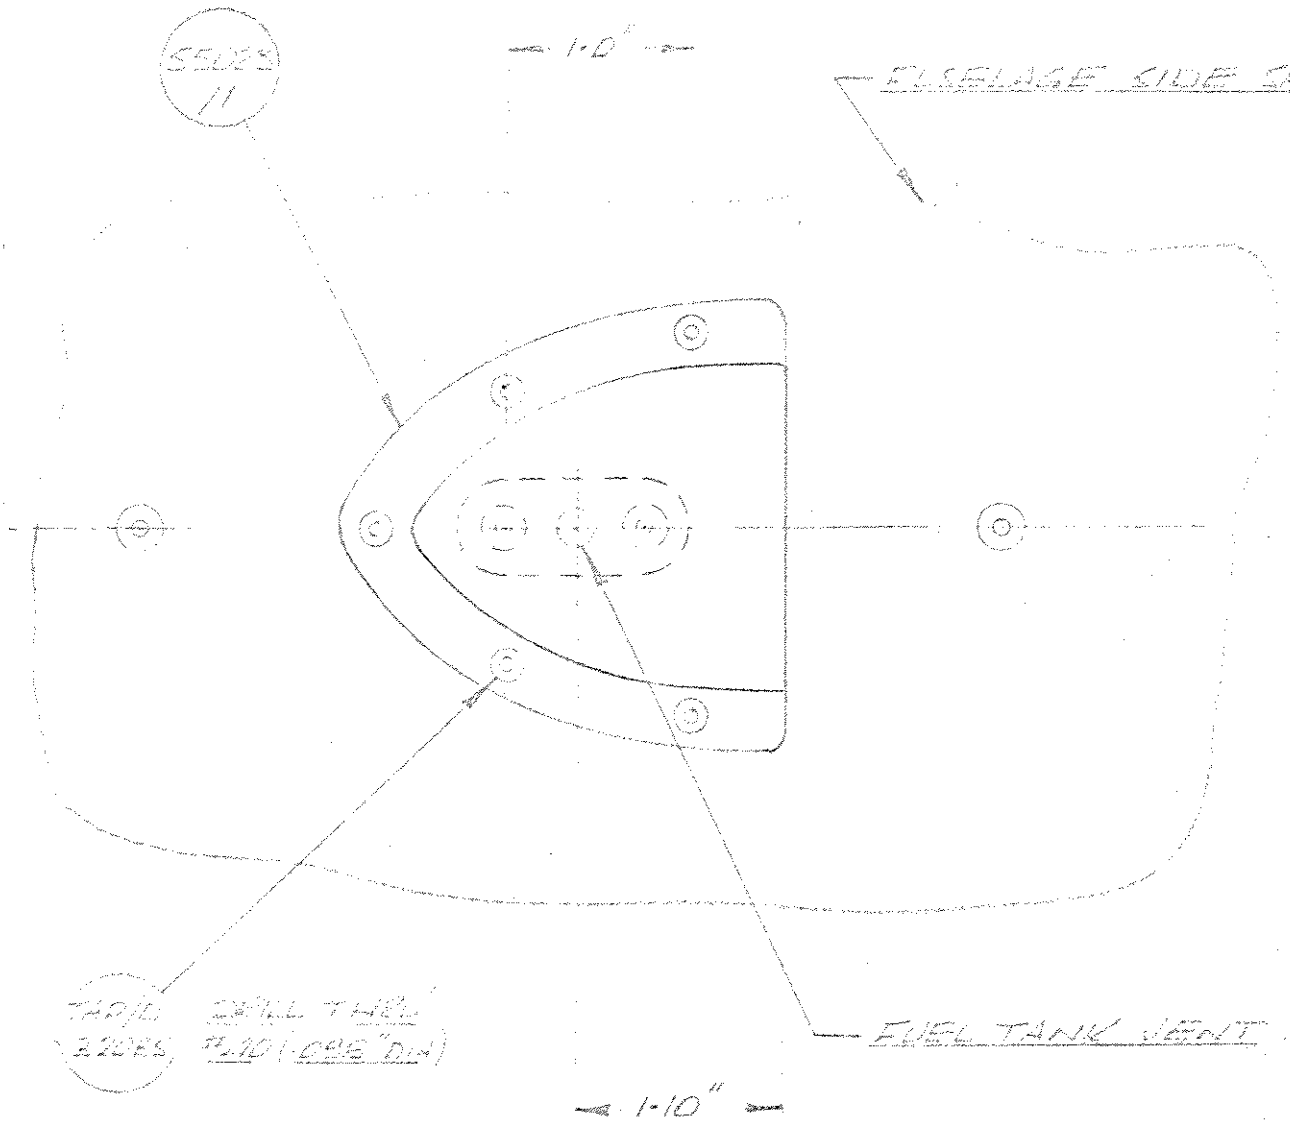

VIEW ON LHS OF REAR FUSELAGE AT APPROX STN SHOWING INSTALLATION OF SCOOP OVER FUEL TANK VENT

SCALE – FULL
DRAWN – [illegible]

AVIATION DIVISION HORSLEY ROAD, MILPERRA, N.S.W., AUSTRALIA.

DATE: 28/2/64

SERVICE BULLETIN NO. 29.

SUBJECT: Revised gust locks. Mod. No. B83.

PURPOSE: Improved design to ensure security of outer ends of gust lock.

REASON: To prevent outer ends of gust lock springing from location holes and causing possible injury to occupants.

EQUIPMENT AFFECTED: Airtourer 100 & 115 (all aircraft).

COMPLIANCE: Next 25 hourly inspection.

DETAILS: Attach clips (Part No. 02-31082) to port and starboard upper longeron as shown below:

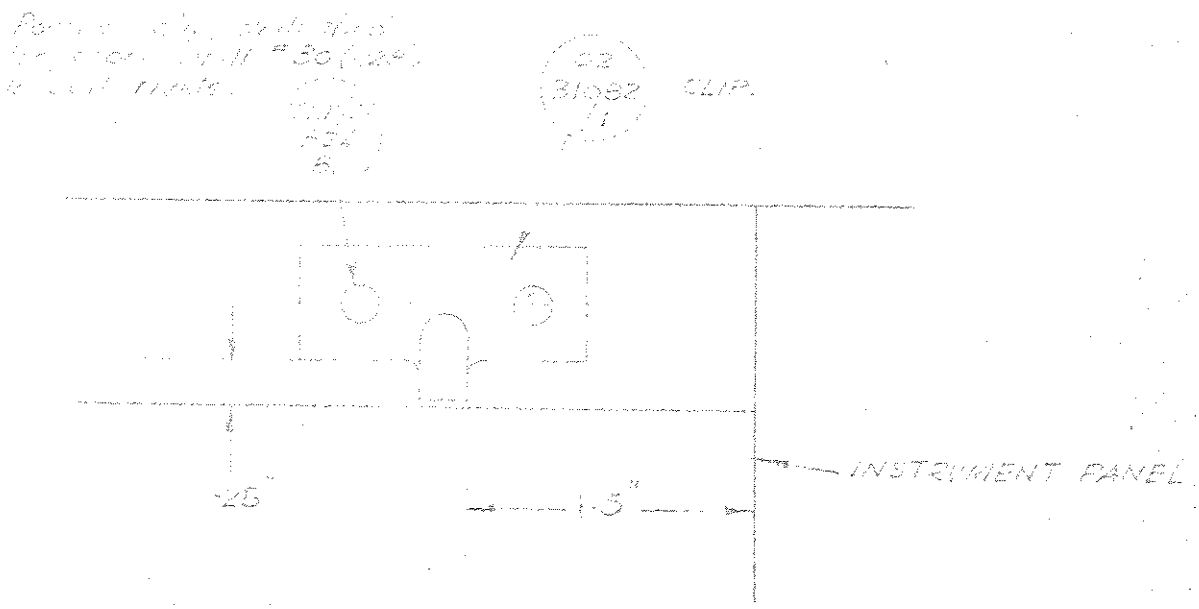

PARTS REQUIRED: Mod. Kit No. B83/1,
Consisting of:

PART NO.	DESCRIPTION	NO. OFF
02-73010	Gust lock assembly	1
02-31082	Clip	2
TLP/D 524 BS	Tucker "pop" rivet	4

PARTS REMOVED: 02-73004 - Gust Lock Assembly.

SPECIAL TOOLS REQUIRED: nil .

EFFECT ON WEIGHT & C.G. nil.

PUBLICATIONS AFFECTED: nil. D.C.A. APPROVED

AVIATION DIVISION KORSLEY ROAD, MILPERRA, N.S.W., AUSTRALIA

DATE: 28.2.64.

SERVICE BULLETIN NO. 30

SUBJECT: Elevator stop brackets on control column torque shaft. Mod.No.B.

PURPOSE: Redesigned to give positive up and down stops to elevator contro

REASON: Stops were found to be bending in service.

EQUIPMENT AFFECTED: Airtourer 100 & 115 (all aircraft).

COMPLIANCE: Next 25 hourly inspection.

DETAILS:

(a) Remove control column and torque shaft assembly (Refer to Maintenance Manual, Chapter 13, para. 19).

(b) Remove existing elevator stop brackets. Retain stop bolts and check nuts, discard brackets.

(c) Check new brackets (for correct application) with drawing.

(d) With the forward stop bracket in line with the rear edge of the front flange of the torque shaft, line A-A, match up the centre lines of the respective parts. Drill through from bracket into torque shaft with Drill No. 21 (.159") and rivet in position using "AVDEL" 402/510 rivets.

(e) Repeat for rear stop bracket in conjunction with rear edge of cut out, line B-B.

(f) Use retained stop bolts Pt. Nos. 52034 and 52135 in rear and forward stop brackets respectively.

(g) Replace control column and torque shaft assembly. (Refer to Maintanance Manual, Chapter 13, para. 19 k).

(h) Re-rig elevator control circuit to give the following elevato movement as measured from the streamline position:
AIRTOURER 100 - 17° UP and 15° DOWN
AIRTOURER 115 - 22° UP and 15° DOWN.

W A R N I N G

Following adjustment or replacement of any part of the flying control system, two independent inspections of the portion affected must be carried out and recorded prior to flight. The two inspections must be carried out independently by different persons licensed in the airframe category.

DATE: 28.2.64.

SERVICE BULLETIN NO. 30

PARTS REQUIRED: Mod. Kit No. B.87/1 consisting of:

PART NO.	DESCRIPTION	NO. off
03081/21	Forward Stop Bracket	1
52153/2	Aft stop bracket (Airtourer ~~100~~)/115	1
52155/2	Aft stop bracket (Airtourer ~~115~~)/100	1
402/510	"AVDEL" rivets	14

PARTS REMOVED: Elevator stop bracket, Pt. No. 52132/1 - 2 off.

SPECIAL TOOLS REQUIRED: Nil

EFFECT ON WEIGHT & C.G.: Nil

PUBLICATIONS AFFECTED: Maintenance, Overhaul and Repair Manual.

Airtourer 100

Chapter 13, page 13-5 -- amend the following:

Para. 14, line 5: "14°5'" to read "14°12' aft".

Para. 15 (d), line 2: add "measured from the streamline position"

Airtourer 115

Chapter 13, page 13-5 -- amend the following:

Para. 14, line 5: "14°5'" to read "18°23' aft".

Para. 15,(d), line 2: "17° upward" to read "22° upward".

Para. 15 (d), line 2: add "measured from the streamline position"

D.C.A. APPROVED

SERVICE BULLETIN NO. 30

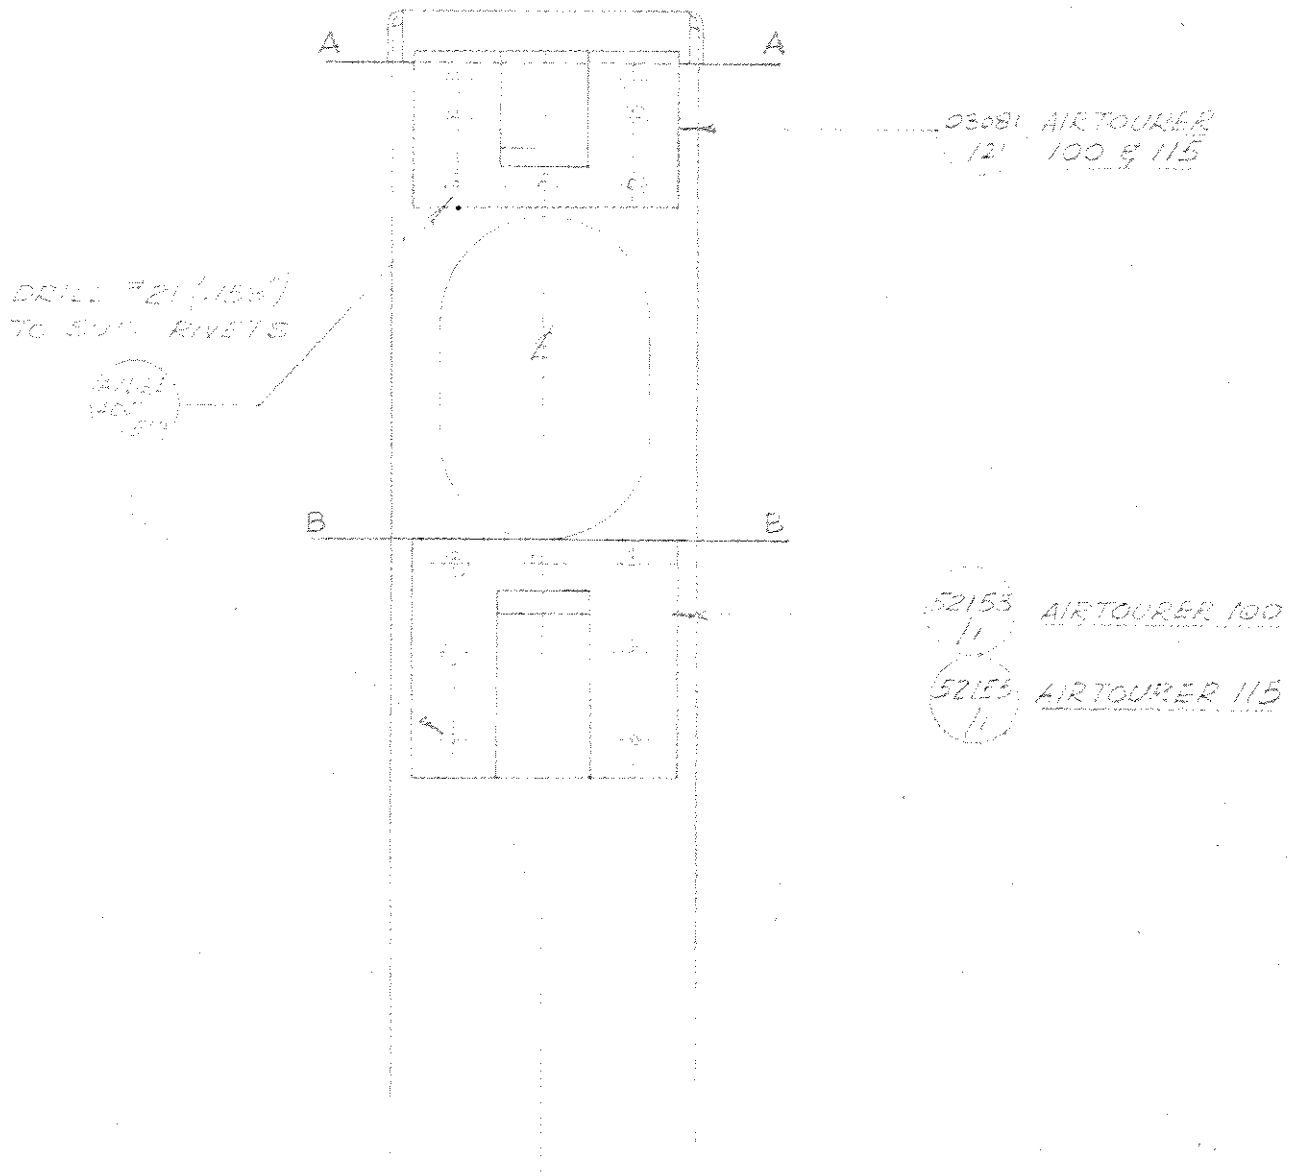

SERVICE BULLETIN NO. 31.

UPON COMPLIANCE OF THIS BULLETIN, ALERT BULLETIN A.26 - MANDATORY INSPECTION IS CANCELLED.

SUBJECT: Tailplane centre hinge bracket - Modification No. B.99.

PURPOSE: Bracket redesigned to give increased strength around pivot holes.

REASON: Cracking around pivot holes has occurred in service due to the presence of built-in stress concentration in this area.

EQUIPMENT AFFECTED: Airtourer 100 & 115 (all aircraft)

COMPLIANCE: Next 25 hourly inspection.

DETAILS:

1. Remove elevator (refer to Maintenance Manual, Chapter 22, para.
2. Remove centre hinge bracket from tailplane and discard.
3. Refer to attached drawing 02-03086, and fit new bracket to tailplane.
4. Pass a tight wire between the two outer hinge brackets and check alignment of centre hinge bracket to a tolerance of .040" fore and aft, .060" up and down.
5. Replace elevator (refer to Maintenance Manual, Chapter 22 para.
6. Re-rig elevator controls to give the following elevator moments as measufed from the streamline position:

   AIRTOURER 100 - 17° UP 15° DOWN
   AIRTOURER 115 - 22° UP 15° DOWN.

7. Inspect control circuit.

W A R N I N G

Following adjustment or replacement of any part of the flying control system, two independent inspections of the portion affected must be carried out and recorded prior to flight. The two inspections must be carried out independently, and by different persons licensed in the airframe category.

PARTS REQUIRED: Mod. Kit No. B.99/1, consisting of:

PART No.	DESCRIPTION	No. off
02-20035/1	Elevator, centre hinge bracket	1
02-20037/1	Washer	2
AN 960-10	Washer No. 1032, .064" thick	2
AN 3H-5A	Bolt, hex head, No. 1032, 21/32" long	2
AN 3H-15A	Bolt, hex head, No. 1032, 1-21/32" long	2
AN4-10	Bolt, hex head, 1/4-28, 1 1/32" long	1
02-03087/1	Washer, packing	4

SERVICE BULLETIN NO. 31.

PARTS REQUIRED: Centre Hinge bracket, Part No. 20010/1.

SPECIAL TOOLS REQUIRED: nil.

EFFECT ON WEIGHT & C.G.: nil.

PUBLICATIONS AFFECTED: nil.

DATE: 4.2.64.

SERVICE BULLETIN NO. 32.

SUBJECT: Introduction of 'O' ring in fuel cap. Mod. B.100.

PURPOSE: To ensure sealing of the fuel cap.

REASON: Service experience has shown that fuel stains progress back from the filler cap along the fuselage side. Investigation has shown that the leak is from behind the gasket pressure plate.

EQUIPMENT AFFECTED: Airtourer 100 and 115 (all aircraft).

COMPLIANCE: Next 25 hourly inspection.

DETAILS:

(a) Remove fuel filler cap and disconnect chain from filler neck.

(b) Wet 'O' ring with mineral hydraulic oil and stretch over centre cup of cap. Using thin blunt edge, push 'O' ring between cup and pressure plate as shown.

(c) Re-connect chain and instal cap.

PARTS REQUIRED:

Part No. 02-48113/23 'O' Ring, 7/8" I.D. x 1/16" 1 off required.

PARTS REMOVED: Nil

SPECIAL TOOLS: Nil

EFFECT ON WEIGHT & C.G.: Nil

PUBLICATIONS AFFECTED: Nil.

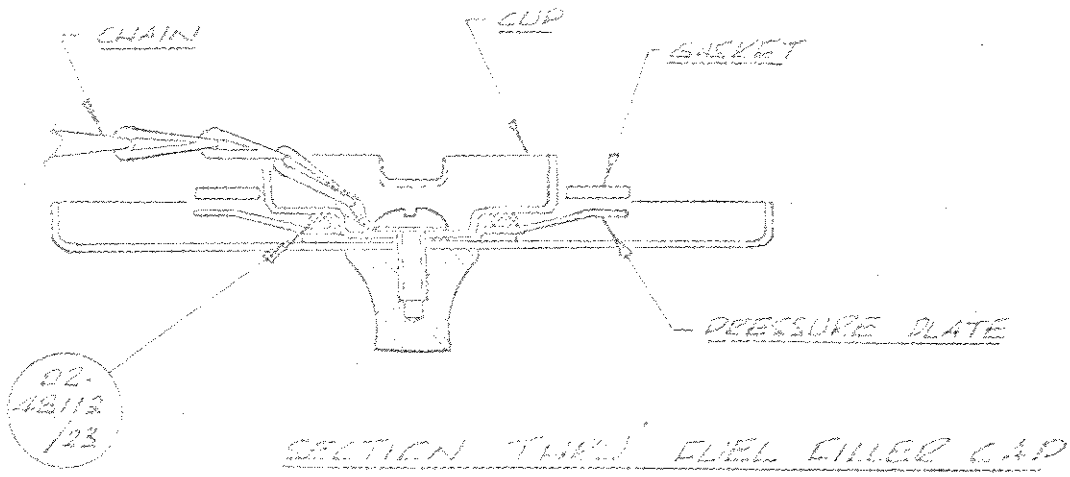

SECTION THRU FUEL FILLER CAP

D.C.A. APPROVED

AVIATION DIVISION HORSLEY ROAD, MILPERRA, N.S.W. AUSTRALIA.

DATE: 10.3.64.

SERVICE BULLETIN NO. A.33.

A L E R T B U L L E T I N

SUBJECT: MANDATORY INSPECTION OF FLYING CONTROL PUSH RODS

ALL AIRTOURER 100 & 115 AIRCRAFT

On or before next daily inspection check all end plugs - i.e., those supporting rod end bearings - for signs of loose rivets, on the following push rods:

Part No.	Description
52003	Push Rod Assy - Waggler/flap torque tube
52004	Push Rod Assy - Torque tube/fuselage flap
52005	Push Rod Assy - Flap lever/torque tube
52006	Push Rod Assy - Waggler/Flapperon.

If looseness is evident inform Victa Aviation Division, Service Department; quoting part number of suspect Push Rod Assembly. A replacement assembly will be forwarded immediately.

Return suspect rod to Victa Service Department.

D.C.A. APPROVED.

VICTA

DATE: 9/4/64

SERVICE BULLETIN NO. 34

SUBJECT: Limitation of Flap Movement Mod. B.129

PURPOSE: To improve controllability of aircraft in the landing configuration.

REASON: D.C.A. requirement.

EQUIPMENT AFFECTED: Airtourer 100 and 115 (all aircraft)

COMPLIANCE: Immediately.

DETAILS: Due to unfavourable flying characteristics with flaps fully down it is necessary to restrict the full flap down movement to 3/4 flap (3 notches).

To prevent any further use of the 4th notch of flap, a light alloy, 16 S.W.G. stop tag should be rivetted to flap quadrant as shown below.

Landing distance trials have been carried out by D.C.A. and Victa with restricted flap movement as above. They indicated landing distance from 50 ft. to be well within existing take-off distance indicated in Pilot's Handbook and Flight Manual. Hence this restriction does not limit the overall Airtourer short field performance.

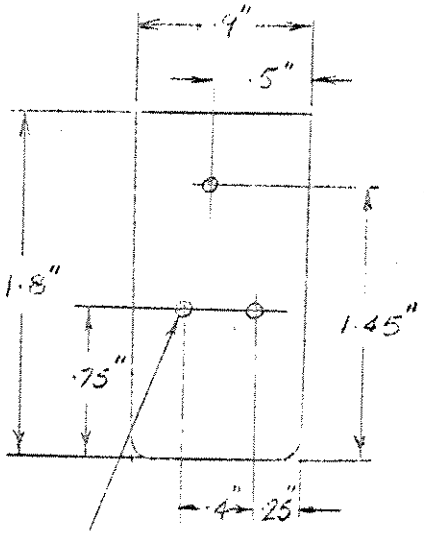

3 holes, No. 30 (.128") to suit rivets

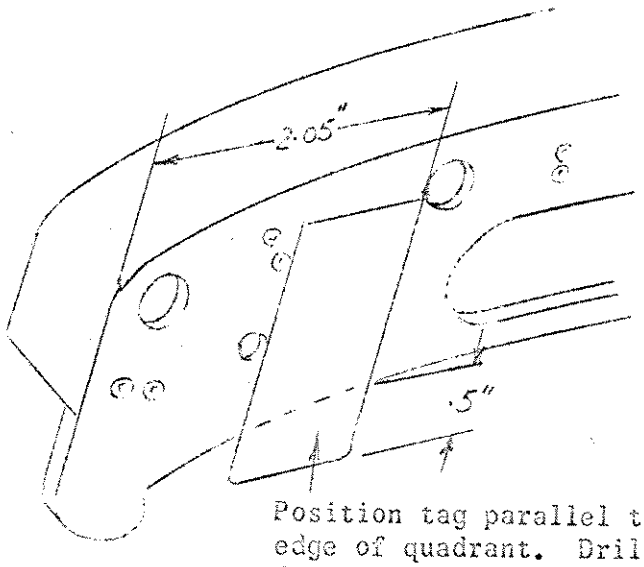

Position tag parallel to rear edge of quadrant. Drill through from tag and rivet using Tucker 'Pop' rivets TLP/D 435 BS.

D.C.A. APPROVED
BY E. BARDEN

VICTA

DATE: 2/7/64

SERVICE BULLETIN NO. 36

SUBJECT: Improved attachment - Aileron Mass Balance. Mods. B75 & B 118.

PURPOSE: To prevent cracking of attachment arms and provide improved attachment of arms to aileron nose ribs.

REASON: Cracking of attachment arms in vicinity of arm attachment rivets and mass balance attachment bolts has occurred in service.

EQUIPMENT AFFECTED: All ailerons fitted to Airtourer 100 and Airtourer 115 aircraft serial numbers 5 through 49, with the exception of those ailerons carrying the following serial numbers:

AS5	AS13	AS25
AP5	AP13	AP26
AP7	AS16	AS28
AS7	AP17	AP29
AP9	AP19	AS31
AS9	AS19	AP32
AP11	AP23	AS40
AS11	AS23	AP40
AP12	AP24	AS52
AS12		

The serial number is located between the mass balance arms on the leading edge of the aileron. It may be read by removal of the wing tip and with the aid of a torch directed through the rear lightening hole of wing end rib.

COMPLIANCE: This is not a mandatory requirement and can be carried out at the operator's convenience. However, until such time as this bulletin is incorporated, the operator must comply with ANO/DCA/VAT/9.

DETAILS: Rework ailerons as detailed on attached Drawing No. 03084.

../2

Service Bulletin No. 36 2/7/64

PARTS REQUIRED: (Per aileron) Mod. Kit B75/1 consisting of:

PART NO.	DESCRIPTION	NO. OFF
02-03096/1	Bracket - Balance Arm	2
02-03095/1	Doubler - "D" nose rib R/H	1
02-03095/2	Doubler - "D" nose rib L/H	1
02-03083/1	Patch - Aileron skin	1
02-15042/1	Washer plate	2
AN3 - 4A	Bolt	4
AN4H-5A	Bolt	4
AN960-416	Washer	4
TLP/D 419BS	Rivet - "Pop" $\frac{1}{8}$" Diam.	14
TLP/D 519BS	Rivet - "Pop" 5/32"	22
TLP/D 524BS	Rivet - "Pop" 5/32"	9

PARTS REMOVED:

PART NO.	DESCRIPTION	NO. OFF
02-15017/1	Bracket - Balance Arm	2

PUBLICATIONS AFFECTED: Nil.

D.C.A. APPROVED.

WICTA

DATE: 2/7/64

SERVICE BULLETIN NO. 37

SUBJECT: Adaptor, Oil Temperature Bulb Part No. 51404/1

PURPOSE: To replace suspect parts.

REASON: A failure in service has been reported.

EQUIPMENT AFFECTED: Airtourer 100 and 115, Aircraft Serial No. 1 to 51 inclusive.

COMPLIANCE: Next 25 hourly inspection.

DETAILS:

(a) Remove nut retaining oil temperature sensing bulb and withdraw bulb

(b) Remove adaptor and discard

(c) Replace with new adaptor. Part No. 51404/1, and a new gasket Part No. AN 900-10, if necessary. Tighten adaptor to 5 - 8 ft./lbs.

(d) Replace bulb and tighten nut to 10 - 20 ft./lbs. Hold adaptor with second spanner while tightening nut. Lockwire.

(e) Ground run engine and check for leaks.

PARTS REQUIRED: Part No. ~~51404/1~~ 51405/1 Adaptor 1 off

PARTS REMOVED: Part No. ~~51404/1~~ 51405/1 Adaptor 1 off

SPECIAL TOOLS REQUIRED: Nil

EFFECT ON WEIGHT & C.G. Nil

PUBLICATIONS AFFECTED: Tightening torques are to be incorporated into Maintenance Manuals.

D.C.A. APPROVED

AVIATION DIVISION MORSLEY ROAD, MILPERRA, N.S.W., AUSTRALIA.

VICTA

DATE:

SERVICE BULLETIN NO.

23.6.64

ALERT

A 38

THROTTLE CONTROL ROD BETWEEN TORQUE TUBE & ENGINE
ALL AIRTOURER 115 AIRCRAFT

On or before next daily inspection check the condition of the throttle control rod between the engine and the torque tube in the region of the braze about ⅜" from commencement of thread at upper end.

An incident has occurred in service where the above throttle rod snapped in two. The probable cause being interference, between the rod fork end and the torque tube lever arm, causing the control rod to bend when the occupant of the aircraft has endeavoured to obtain full rearward movement on the throttle control knob in the cockpit.

If, on inspection, signs of cracking or bending are evident, ground aircraft until faulty control rod has been replaced.

With throttle control knob pulled back as far as possible check for interference between fork end on throttle control rod and the centre lever arm on the torque tube. If interference is evident and the lever arm is restraining the full natural movement of the throttle, trim the edge of the lever arm in the area of interference until the full movement of the throttle is obtainable.

D.C.A. APPROVED.

E. D. BARDEN. 23.6.64.

VIATION DIVISION

MORSLEY ROAD, MILPERRA, N.S.W., AUSTRALIA.

VICTA

DATE: 3/7/64

SERVICE BULLETIN NO. 39

THIS SERVICE BULLETIN SUPERSEDES ALERT SERVICE BULLETIN NO. A.38

SUBJECT: Redesigned throttle rod, torque tube to engine, Pt. Nos. 43303/1, 43122/2. Modification B.164.

PURPOSE: To improve safety of throttle system.

REASON: One failure in service has occurred. Brazed insert pulled out of tube.

EQUIPMENT AFFECTED: All Airtourer 100 and 115 aircraft.

COMPLIANCE: Within next 25 hours flying time.

DETAILS: Rectification of the above fault has been achieved by redesigning the throttle rod as a one piece unit. The method of replacement is outlined below:-

(a) Disconnect the carburettor to torque shaft push rod from the torque shaft.

(b) Remove clevis end fitting 02-43133/1 and locknut. AN 316-4R.

(c) Disconnect rod from end fitting at carburettor (AN 276-6) leaving fitting attached to carburettor. Remove locknut AN 315-3.

(d) Remove tachometer and remove rod by sliding into cockpit. Discard this part.

(e) Replace rod with new rods

Airtourer 100 Pt. No. 02-43146/1
Airtourer 115 Pt. No. 02-43146/2

(f) Reattach rod to carburettor fitting, ensuring replacement of locknut AN315-3.

(g) Reassemble clevis end 02-43133/1 and Locknut AN 316-4R.

(h) Reattach rod to torque shaft and adjust system.

(i) Operate system so that throttle is in fully closed position. In this position the clevis end should not foul the operating lever. If any foul occurs, the operating lever should be reworked by filing to a minimum clearance of 1/16".

Also ensure that with the throttle fully open ¼" clearance is maintained between the face of the locknut on the throttle knob and the rear face of the friction nut.

AVIATION DIVISION HORSLEY ROAD, MILPERRA, N.S.W., AUSTRALIA.

NOTE: On Airtourer 100 aircraft it may be necessary to remove the carburettor air ducting to gain access to the end fitting.

PARTS REQUIRED:	Airtourer 100	02-43146/1
	Airtourer 115	02-43146/2
PARTS REMOVED:	Airtourer 100	43122/2 less end fittings
	Airtourer 115	43303/1

SPECIAL TOOLS REQUIRED: Nil.

EFFECT ON WEIGHT & C.G.: Nil.

PUBLICATIONS AFFECTED: Spare Parts Manual.

D. C. A. APPROVED.

VICTA

DATE: 2/7/64

SERVICE BULLETIN NO. 40

SUBJECT: Redesigned Throttle Friction Lock and Pivot. Mod. B.92.

PURPOSE: To provide more progressive throttle friction control.

REASON: Service experience has shown that the existing throttle friction device requires excessive effort by pilot to adjust to prevent creep and causes undue wear of throttle spindle.

EQUIPMENT AFFECTED: Airtourer Model 100 & 115. Aircraft 1 through 60.

COMPLIANCE: Within next 100 hours flying time.

DETAILS:

(a) Slacken check nut at fork end of port throttle spindle and screw out spindle from fork end, remove check nut then withdraw spindle rearwards from instrument panel mounting. Remove knob P/N 43105/2 from spindle and discard spindle.

(b) Remove circlip from end of friction lock and unscrew throttle friction nut. Discard nut and circlip.

(c) Remove one of the rivets from one of the two brackets supporting the pivot of the friction lock thereby allowing the bracket to turn and the friction lock to fall clear. Discard the friction lock.

(d) Fit new friction lock P/N 43142/1 between brackets and replace rivet.

(e) Assemble check nut - AN 316-4R and knob P/N 43105/2 onto new spindle P/N 43107/2 (short thread end).

(f) Slip throttle friction nut P/N 43143/1 on to spindle with large diameter toward knob, followed by rubber sleeve P/N 43144/1. Insert spindle through friction lock P/N 43142/1. Screw check nut AN 316-4R on to spindle and then screw spindle into fork end.

(g) Before tightening the check nut at the fork end of the spindle adjust the throttle control so that, with the throttle fully open there is ¼" clearance between the face of the check nut on the throttle knob and the rear face of the friction lock.

../2

VICTA

DATE:

SERVICE BULLETIN NO.

Service Bulletin No. 40 2/7/64

PARTS REQUIRED: Mod Kit B92/1 consisting of:

PART NO.	DESCRIPTION	NO. OFF
02-43107/2	Spindle	1
02-43142/1	Friction lock and pivot	1
02-43143/1	Nut-throttle friction	1
02-43144/1	Sleeve-throttle friction	1
AN316-4R	Nut-check	2

PARTS REMOVED:

PART NO.	DESCRIPTION	NO. OFF
02-43107/1	Spindle	1
02-43104/2	Friction lock and pivot	1
02-43106/1	Nut-throttle friction	1
SF02570	Circlip - "Apire"	1

EFFECT ON WEIGHT & C.G.: Nil.

PUBLICATIONS AFFECTED: Nil.

D.C.A. APPROVED

VICTA

DATE: 14/7/64.

SERVICE BULLETIN NO. 41.

SUBJECT: BATTERY RELAY, PART NO. REL 1 - 2. (MOD. B 167)

PURPOSE: To reverse battery relay mounting.

REASON: Service experience has shown that the present mounting position does not allow condensed moisture to drain from the unit. The resulting corrosion may cause an open circuit in the solenoid coil.

EQUIPMENT AFFECTED: All Airtpurer 100 & 115 aircraft fitted with Cutler-Hammer relay, C - H Part No. 604 1H192, Victa Part No. REL 1 - 2.

COMPLIANCE Within the next 100 flying hours.

DETAILS: Remove all cables from the battery relay, together with the jumper (Part No. 54115/2) and diode. Remove the relay from the firewall.

AIRTOURER 100 ONLY - Replace the relay on to the firewall with the solenoid coil uppermost. Secure, using original bolts, washers and nutplates. Reconnect cables, jumper and diode in accordance with figure 1.

AIRTOURER 115 ONLY - Drill two letter F (.257" dia.) holes 1.1" directly above existing mounting holes. Drill out pop rivets holding mutplates and re-rivet in place behind new holes, maintaining a centre to centre distance of 2 11/32". Position sealing plates (Part No. 31127/1) behind redundant holes and rivet as shown in fig. 2. Install relay with solenoid coil uppermost and reconnect cables, jumper, and diodes as shown in fig. 3.

AVIATION DIVISION • HORSLEY ROAD, MILPERRA, N.S.W., AUSTRALIA.

PARTS REQUIRED

Airtourer 100 - Nil

Airtourer 115 - Mod. Kit No. B167/1 consisting of

PART NO.	DESCRIPTION	NO. OFF
31127/1	Seal Plate	2
TAP/K329 BS	Rivet "Pop" 3/32 dia.	8

PARTS REMOVED - Nil

SPECIAL TOOLS REQUIRED - Nil

EFFECT ON WEIGHT & C.G. - Nil

PUBLICATIONS AFFECTED - Nil

D.C.A. APPROVED.

AVIATION DIVISION HORSLEY ROAD, MILPERRA, N.S.W., AUSTRALIA.

WIGTA

DATE: 14·1·64

SERVICE BULLETIN NO. 41

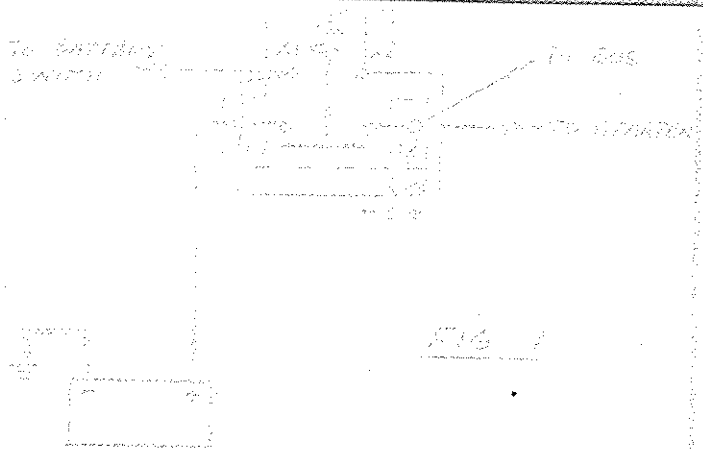

FIG 1

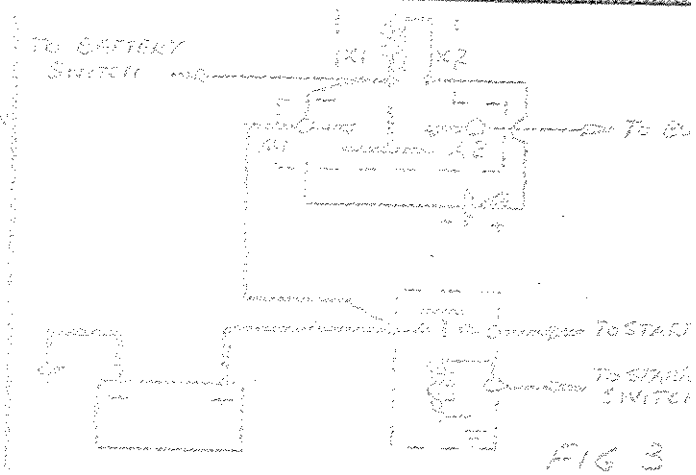

FIG 3

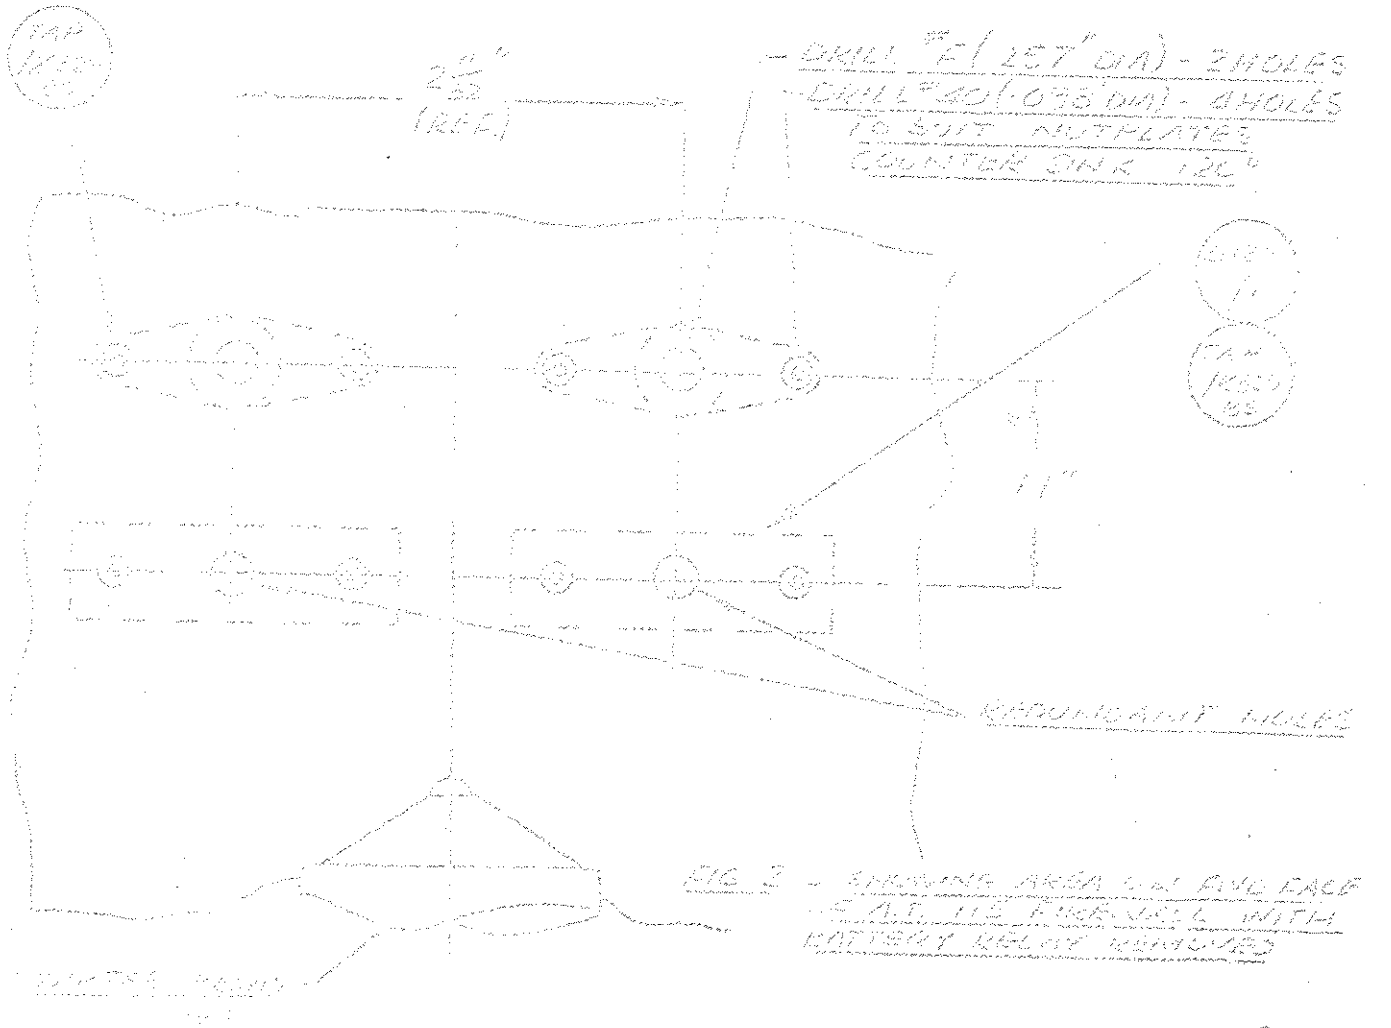

FIG 2 - MOUNTING AREA ON RHS CASE TO BE REMOVED WITH BATTERY RELAY MOUNTED

3-3