VICTA

DATE:

SERVICE BULLETIN NO. 42

Incorporation of this service bulletin supersedes Alert service bulletin No. A 35 (DCA/VAT/19).

SUBJECT: Replacement of exhaust muffler inner casing part No. 42339/1 by modified type part No. 42339/2 from which baffles have been deleted. MOD B 161.

PURPOSE: To obviate possible engine mal functioning due to portion of baffle obstructing exhaust outlet.

REASON: Cases have occurred of baffles cracking and becoming loose.

EQUIPMENT AFFECTED: All Airtourer 115 aircraft fitted with exhaust muffler inner casing part No. 42339/1.

NOTE: Positive identification of inner casing part No. 42339/1 may be made whilst installed on engine by inspecting end of muffler assembly. Mufflers which have weld marks as shown in Fig. 1 incorporate baffles. If no such weld marks are evident the inner casing conforms to the latest type Part No. 42339/2 and this service bulletin is not applicable.

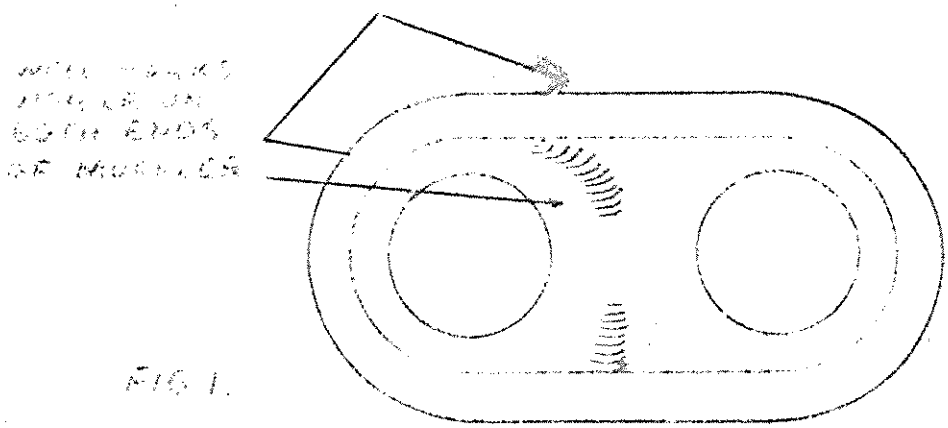

FIG 1.

COMPLIANCE: Within next 10 flying hours.

NOTE: Until muffler inner casing P/N 42339/1 changed DCA/VAT/19 must be complied with.

AVIATION DIVISION MORSLEY ROAD, MILPERRA, N.S.W., AUSTRALIA.

DETAILS: Method of replacement of muffler inner casing is as follows:-

(1) Remove propeller and engine cowl assembly.

(2) Remove cabin and carburettor heat flexible ducting from muffler assembly.

(3) Remove the exhaust pipe extension assemblies from bottom of muffler assembly.

(4) Undo 8 off flange units (2 per cylinder) and remove exhaust assembly as a unit.

(5) Slacken worm screw clamps and remove exhaust pipes from muffler assembly.

(6) Remove front and rear covers from muffler assembly and discard inner casing part No. 42339/1.

(7) Reassemble front and rear covers on new inner casing part No. 42339/2.

(8) Reassemble - exhaust pipes to muffler assembly, exhaust assembly to engine, etc. proceeding in the opposite sequence to dismantling.

PART REQUIRED: 1 off inner casing part No. 42339/2.

PARTS REMOVED: 1 off inner casing part No. 42339/1.

SPECIAL TOOLS REQUIRED: NIL

EFFECT ON WEIGHT & C.G: NIL

PUBLICATIONS AFFECTED: Amend spare parts catalogue page 88 42339/1 to read 42339/2.

D.C.A. APPROVED.

AVIATION DIVISION HORSLEY ROAD, MILPERRA, N.S.W., AUSTRALIA.

THIS BULLETIN CANCELS AND SUPERSEDES SERVICE BULLETIN NO. 41.

The circuit shown in Fig. 1 & 2 on page 3 of Service Bulletin No. 41 is incorrect. The lead from the battery switch is connected to X2, not to X1 as shown. On receipt of this bulletin, all copies of Service Bulletin No. 41 are to be destroyed.

SUBJECT: BATTERY RELAY, PART NO. REL 1 - 2. (MOD. B 167)

PURPOSE: To reverse battery relay mounting.

REASON: Service experience has shown that the present mounting position does not allow condensed moisture to drain from the unit. The resulting corrosion may cause an open circuit in the solenoid coil.

EQUIPMENT AFFECTED: All Airtourer 100 & 115 aircraft fitted with Cutler-Hammer relay, C - H Part No. 604 1H192, Victa Part No. REL 1 - 2.

COMPLIANCE: Within the next 100 flying hours.

DETAILS: Remove all cables from the battery relay, together with the jumper (Part No. 54115/2) and diode. Remove the relay from the firewall.

AIRTOURER 100 ONLY - Replace the relay on to the firewall with the solenoid coil uppermost. Secure, using original bolts, washers and nutplates. Reconnect cables, jumper and diode in accordance with Figure 1.

AIRTOURER 115 ONLY - Drill two letter F (.257" dia.) holes 1.1" directly above existing mounting holes. Drill out pop rivets holding nutplates and re-rivet in place behind new holes, maintaining a centre to centre distance of 2 11/32". Position sealing plates (Part No. 31127/1) behind redundant holes and rivet as shown in Fig. 2. Install relay with solenoid coil uppermost and reconnect cables, jumper, and diodes as shown in Fig. 3.

AVIATION DIVISION HORSLEY ROAD, MILPERRA, N.S.W., AUSTRALIA.

PARTS REQUIRED

Airtourer 100 - Nil

Airtourer 115 - Mod. Kit No. B167/1 consisting of:

PART NO.	DESCRIPTION	NO. OFF
31127/1	Seal Plate	2
TAP/K329 BS	Rivet "Pop" 3/32 dia.	8

PARTS REMOVED - Nil

SPECIAL TOOLS REQUIRED - Nil

EFFECT ON WEIGHT & C.G. - Nil

PUBLICATIONS AFFECTED - Nil

D.C.A. APPROVED.

WICTA

DATE:

SERVICE BULLETIN NO.

WICTA

DATE: 15/10/64.

SERVICE BULLETIN NO. 45.

SUBJECT: Carbon Monoxide Contamination - Cabin (Victa Mods. B117, B124, B132.)

PURPOSE: To minimise possible C.O.contamination of Cabin heating system.

REASON: Service experience has revealed cases of C.O. entry into cabin heat exchange muffler (port side only) and into cabin area via clearance around slide of hot air valve on firewall.

EQUIPMENT AFFECTED: For the purpose of clarity and priority of incorporation this bulletin is divided into four parts, namely:-

PART 1 - Sealing of heat exchange muffler, Mod. B124.

PART 2 - Sealing of exhaust studs and installation of packer - Mod. B124.

PART 3 - Sealing of cabin hot air valve slide, Mod. B117.

PART 4 - Installation of fairing - lower edge of firewall. Mod. B132.

These four parts are applicable to the two types of Airtourer aircraft as follows:-

Airtourer 100 - Parts 1-2-3-4.

Airtourer 115 - Part 3 only.

NOTE: Airtourer 100 aircraft S/n 58 and subsequent have parts 1 and 2 incorporated in production.

Airtourer 115 and 100 aircraft S/n 57 and subsequent have Part 3 incorporated in production.

Airtourer 100 aircraft S/n 62 and subsequent have Part 4 incorporated in production.

Some aircraft prior to the serial numbers referred to above have one or more parts of this bulletin incorporated.

Positive identification of incorporation of one or more parts of this bulletin may be made in the following manner.

PART 1 - No positive identification possible without opening of port muffler shroud.

PART 2 - Inspect the four exhaust stub clamp assemblies for inclusion of dural packer between the two halves of the clamps through which the clamp bolts pass. If the packer is fitted this part of the bulletin is not applicable.

PART 3 - Inspect cabin hot-air valve assembly on engine side of bulk head to ascertain if layer of felt is between slide and firewall, if so then this part of bulletin is not applicable.

PART 4 - Inspect lower edge of firewall in vicinity of dash cut out area for installation of curved fairings either side of lower nose leg bearing. If installed this part of bulletin is not applicable.

COMPLIANCE: Affect 100 hourly inspection.

DETAILS: PART 1.

(a) Remove propeller and cowls.

(b) Remove screws attaching shrouds P/N 02-42124/1 to port muffler welded assy P/N 02-42129/1 and open shroud off welded assembly.

(c) Wrap 2-3 turns of 3/16 asbestos yarn around welded assy inlet stub from No. 2 cylinder between shroud attachment channel and welded assy and retain in position with 2 twitches of lockwire (see Fig.1).

(d) Close shroud about welded assy and replace screws, refit cowls and propeller.

PART 2.

(a) Remove propeller and cowls.

(b) Remove port and stbd. muffler assemblies P/Nos. 02-42129/1 and 02-42130/1 by disconnecting flexible hoses and removing 2 off AN3 bolts and nuts on each cylinder exhaust stub clamp assy.

(c) Fit new clamp P/N 02-42137/1 over end of each exhaust stub (see Fig. 2).

(d) Reassemble port and stbd. exhaust muffler assemblies on to exhaust stubs and refit clamp assemblies on each stub.

(e) Before refitting AN3 bolts in clamp assemblies fit packer P/N 02-42136/1 in position between clamp lugs as shown in Fig. 2.

(f) Tighten all clamp bolts, replace flexible hoses for carburettor and cabin hot air.

(g) Refit cowls and propeller.

PART 3.

(a) Without disconnecting Bowden control cable from slide, drill out vertical row of rivets either side of valve, noting position of packing pieces.

(b) Attach felt packer P/N 02-55009/2 to firewall using Bear Contact Cement or similar in area as occupied by valve assembly. (see Fig. 3).

(c) After cement has set dust surface of felt with powdered graphite (NOTE: No other form of lubricant must be used, as the heat in the "OFF" position of the slide will produce smoke in the cabin.)

(d) Reassemble and rerivet valve assembly to firewall.

PART 4. AIRCRAFT S/N. 55 AND PREVIOUS.

(a) Remove 2nd and 3rd screws from either side along leading edge of under floor fairing.

(b) Locate fairings P/N 31124/3 port and P/N 31125/1 stbd. in position as shown in Fig. 4 and back mark the two screw holes in each of the fairings and drill No. 11 holes.

(c) Attach fairings.

AIRCRAFT S/N. 56 to 61 INCLUSIVE.

Locate and rivet fairings as per details Fig. 4.

VICTA

DATE: 15/10/64.

SERVICE BULLETIN NO.

PARTS REQUIRED:

	PART 1		
NPN NPN	3/16" Asbestos yarn Lock wire	12" approx. As rqd.	B124/1
	PART 2		
02-42137/1 02-42138/1	Sealing ring-Exhaust pipe joint Packer - Exhaust pipe joint	4 off 4 off	B124/1
	PART 3		
02-55009/2 02-55007/2 TLP/D/429	Packing - Hot air Valve Packer Rivets	1 off 2 off 14 off	B117/1
	PART 4		
02-31124/3 02-31125/1 TLP/D/429	Fairing-firewall bottom Port Fairing-firewall bottom Stbd. Rivets	1 off 1 off 7 off	B132/1

PARTS REMOVED: Nil

SPECIAL TOOLS REQUIRED: Nil

EFFECT ON WEIGHT & C of G: Nil

PUBLICATIONS AFFECTED: Spare Parts Catalogue.

APPROVED

DATE: 21/12/6

SERVICE BULLETIN NO. 47 ISSUE 2

ISSUE 2

THIS SERVICE BULLETIN NO. 47/ SUPERSEDES SERVICE BULLETIN No. 47 DATED 4/12/64 AND CALLS UP REMOVAL OF GAP TAPES FROM ELEVATORS.

SUBJECT: Elevator Up Travel Increase for Airtourer 100 Aircraft.

PURPOSE: To improve the Spinability of the Aircraft.

REASON: Some aircraft have shown reluctance to spin as a result of the fitment of rigid Elevator Stops.

EQUIPMENT AFFECTED: All Airtourer 100 Aircraft.

COMPLIANCE: At next 100 hourly inspection.

DETAIL: (1) Remove elevator gap tape - if fitted.
(2) Remove trim in region of control torque tube 52130/1.
(3) Slacken elevator up stop and increase elevator up travel to 19° (previously 17°) linear dimension 5¼".

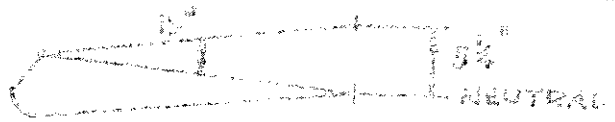

(4) Relock Stops.
(5) Refit trim.
(6) Elevator gap tape is not to be refitted.

WARNING: Following adjustment of the flying control system two independent inspections of the portion affected must be carried out and recorded prior to flight. The two inspections must be carried out independently by different persons licensed in the airframe category.

PARTS REQUIRED: NIL

PARTS REMOVED: NIL

SPECIAL TOOLS REQUIRED: NIL

EFFECT ON C. OF G.: NIL

PUBLICATIONS AFFECTED: AIRTOURER 100 MAINTENANCE MANUAL
AIRTOURER 100 PILOTS NOTES

THESE PUBLICATIONS WILL BE BROUGHT INTO LINE AT A LATER DATE.

AVIATION DIVISION HORSLEY ROAD, MILPERRA, N.S.W., AUSTRALIA.

PROCEDURE APPROVED:

SHEET OF

Victa

DATE: 11/12/64

SERVICE BULLETIN NO. 48

SUBJECT: Inspection of Undercarriage Nose Leg Strut.

PURPOSE: To inspect Nose Leg Strut at Steering Collar for fatigue cracks.

REASON: One case of Nose Leg failure due to fatigue crack emanating from Steering Collar rivet holes at approximately 1000 flying hours. The probable cause of this crack is thought to be an out of balance on the nosewheel which causes a resonant vibration of the strut immediately after take-off.

A second Service Bulletin will give further details on this matter and will be issued immediately sufficient information is to hand on a method of wheel balancing.

EQUIPMENT AFFECTED: All Airtourer 100 and 115 Aircraft.

COMPLIANCE:

(1) Nose Legs which have reached or exceeded 500 hours flying - within next 25 hours flying.

(2) Nose Legs with less than 500 hours flying - at 500 hours flying time.

(3) Subsequent inspections to be in accordance with Table 1 of this Bulletin.

DETAILS:

(1) Disconnect Nose Wheel Steering Arm Part No. 62011/1 at collar.

(2) Remove rivets from Nose Leg Strut Steering Collar Part No. 62006/1.

NOTE: Some early Nose Leg Struts may have the Steering Collar attached with four (4) $\frac{1}{8}$" Avdel Rivets. These should be carefully opened out to 5/32" prior to moving the steering collar on the strut in order to facilitate entry of the thickness checking tool.

(3) Slide steering collar up to the strut to expose area of strut normally covered by the steering collar.

(4) Check for fatigue cracks in the vicinity of rivet holes using both of the following methods:-

(a) Dye check inspection.

(b) Inspection with the aid of a 10 power magnifying glass.