Telephone: CHURCHDOWN 2388

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHI

GLOS AIR SERVICE BULLETIN No. I

VICTA IOO & II5 Spinners

It has come to notice that aircraft are sometimes operated without propeller spinners. It is desired to point out that where a spinner is part of the standard fitment of the aeroplane, it and the backplate form an essential part of the aeroplane under its certification requirements.
The spinner assembly is designed to suit the engine/propeller/aircraft airflow characteristics and assist in providing adequate cooling for the engine.
Removal of the Spinner/Backplate assembly constitutes a major modification which must be submitted for approval should it be considered that there is sufficient reason to operate without the assembly, and removal must not be effected unless approved.

---

VICTA IOO HAND BRAKE TORQUE TUBE ASSEMBLY
Pt. No. 63I20/I

Handbrake torque tube fractured and end pivot rivets had pulled out. Most likely due to rough handling.
New torque tube fitted. T. T. II3I hrs.

---

VICTA IOO WING REAR SPAR ATTACHMENT FITTINGS
Pt. No. IOOO9/I & 2

At special inspection in accordance with DCA/VIC/I55 port fitting found cracked. Removal of wing disclosed bushing Pt. No. IOOI4/I missing from attachment bolt hole.
Bushing probably omitted when wing fitted after previous accident repair at IO67hrs. T.T. 2567hrs.

---

VICTA IOO WING REAR SPAR SPLICE
Pt. No. III09/9

At overhaul, when fuel tanks were removed, corrosion found in wing rear spar bottom splices.
Splices renewed. T.T.3054 hrs.



DIRECTORS: SIR DERRICK BAILEY, Bt., D.F.C., C. A. POOLE.

VICTA 100 FUEL TANK

Fuel gauge readings incorrect when checked with dipstick. Investigation found tank securing buttons missing due bottom stems being cut by retaining hole edge.
Victa S.B. 56 & S.L.65/2 refer T.T. 2496 hrs.

---

VICTA 100 FUSELAGE

At overhaul, slight corrosion found on centre fuselage top skin Pt. No. 32013/I under polyurethene foam.
Also on frame Pt. No.33004/I where skin is attached.
Corrosion removed and area repainted.
Attributed to ingress of moisture through third canopy rail. T.T. 3000hrs.

---

VICTA 100 FUEL TANK

When tank dipped, bottom felt spongy. Inspection revealed two lower front securing buttons missing, having been cut through by edge of mounting holes.
Victa S.B. 56 & S.L. 65/2 refers. Two cases reported. T.T.990 &1816 hrs.

---

VICTA 100 FUEL TANK VENT LINE

At routine inspection, partial blockage of fuel tank plastic hose vent line found.
Deterioration of hose had caused crimp at ST 176 and hose had moved out of groove in foam lining. T.T. 2523 hrs.

---

VICTA 100 TAILPLANE

At routine inspection, cracks found at rivet holes in attachment of pivot plate assembly Pt.No. 20026/2 to No. 5 rib Pt. No. 2005/I.
End to end movement of was seen to impose a side load on the pivot plate and its supporting structure.
Removal of pivot plate revealed corresponding cracks in the gusset attaching the rib and plate to the spar.
It was noted thatbolt Pt. No. 24002/2 had been fitted with two extra AN 960-416 washers on each side of the pivot plate, Between pivot plate and bracket thus transmitting side loads to the plate. Washers were removed.
T.T.2434 hrs.

---

VICTA 100 - HEATER MUFFS

During an engine change both exhaust heater muffs were found cracked.
It is recommended that the cabin heater exhaust muff be pressure tested every 200 hours or Carbon Monoxide detector used in the cabin during engine run.

---

VICTA IOO - CONTROL COLUMN HOUSING ASSEMBLY
Pt.No. 3I7 IO/3

During check on flying controls further movement of control column noted after hitting rear stop. Inspectionfound the I/8"" dia.AVDEL rivets had failed in the attachment of the torque tube rear bearing spigot boss. Rivets replaced with 3/I6" dia. c/s solid rivets. Special inspection at each IOO hrs. until modification action taken.
Manufacturer advised. T.T. 2289 hrs

---

VICTA IOO - HANDBRAKE TORQUE TUBE
Pt. No. 63I23/I

Brakes reported inoperative while taxying. Inspection found the torque tube fractured through the six I/8" dia. rivet holes where port flange Pt. No. 63I06/I is attached. T.T. I349 hrs.

---

VICTA IOO - TAIL SKID SHOCK DAMAGE

The aircraft was seen to strike its tail skid on the ground during landing. Although there was no exterior evidence of any serious damage removal of the tail core revealed a badly wrinkled and split rear bulkhead.

---

VICTA IOO - Soft Noselog Action

Following pilot complaint of soft noselog action it was found that the top mounting of the noselog had broken away from the aircraft structure. Regular inspection should ensure that the defect is found before complete failure.

---

VICTA II5 - REAR FUSELAGE

At routine inspection, loose pop rivets found in rear fuselage at upper longeron and top skin joints, upper longeron to closing panel and in bottom skin to frame joints at ST 204. Rivets replaced T.T. I075 hrs.

---

VICTA II5 - FUEL FILLER MOUNTINGS DISH
Pt. No. 3I429/I

At routine inspection fuel filler mounting dish found cracked at bend radius.
Repaired by welding. T.T.762 hrs.

---

VICTA II5 - BRAKE DRIVE BLOCK

Right hand wheel locked on landing causing aircraft to ground loop. "UNBRAKO" screwfailed and allowed drive block Pt. No. DWII83 to fall and jam between disc and brake calliper. Frequent use of brakes during training may accelerate loosening of blocks in hub.Operator intends to check security of blocks

every 50 hrs. Other cases reported. T.T.2108 T.S.O. 320 hrs.

---

VICTA II5 - ELEVATOR END FLOAT

During routine inspection the elevator was found to have excessive end float. This was due to the Allen screw retaining the bearing at the centre hinge having backed off, allowing the bearing to move in its housing.

Telephone: CHURCHDOWN 3381

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSH

12 - 3 - 68

GLOS AIR SERVICE BULLETIN NO 2

Aircraft Affected: All Viota 100 and 115 Airtourers.

Compliance: Not later than 31st August 1968.

Classification: The Air Registration Board have classified this as MANDATORY.

Details:

This Service Bulletin requires the embodiment of Modification AE3/AIR/129 to overcome the aileron overbalance which is a feature of the subject aircraft.

The requisite parts with full information on the method of install and adjustment can be obtained on request at a cost of £45.

N.E.Wright (Chief Inspector)

DIRECTORS: SIR DERRICK BAILEY, Bt., D.F.C., C.A. POOLE.

Telephone: CHURCHDOWN 3388

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSH

19 - 3 - 68

GLOS - AIR SERVICE BULLETIN No 3

Aircraft Affected: All Vista 100 and 115 Airtourers.

Details: Following compliance with Service Bulletin No 2 the following amendments to the subject Maintenance and Repair Manuals are to be included under Amendment List 6.

ADD the following to Paragraph 2 of Page 1 of Chapter 13

Glos Air Modification AES/AIR/129 introduces a control column centralising system. The waggler lever operates between springs which bias the ailerons/flapperons to the neutral position.

ADD the following to sub-paragraph (a) of Paragraph 3 of Page 1 of Chapter 13.

Adjust waggler lever springs in accordance with instructions supplied with Modification AES/AIR/129.

ADD the following to sub-paragraph (d) of paragraph 8 of Page 7 of Chapter 8.

Inspect aileron centering springs and buffer bolts for wear, condition and security of attachment.

N.E.Wright (Chief Inspector)

Record the incorporation of this amendment on Page 1 of the Manual

DIRECTORS: SIR DERRICK BAILEY, Bt. D.F.C., C.A. POOLE.

Telephone: CHURCHDOWN 3288

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHI

13th May 1968

GLOS-AIR SERVICE BULLETIN No 4

Aircraft Affected  All Viota 100 and 115 Airtourers

It is apparent that due to a typing error there may be incorrect figures on some Weight Schedules.
It is requested that all Schedules are checked against the figures given below and amended as necessary

| | |
|---|---|
| Max AUW 1650lbs | |
| Aerobatic AUW 1550lbs | |
| Lever Arm of Pilot and Passenger | +90.2 |
| Lever Arm of Fuel | +98.0 |
| Lever Arm of Oil (AT 100) | +35.0 |
| Lever Arm of Oil (AT 115) | +32.0 |
| Lever Arm of Luggage | +111.0 |

N.E.Wright

Chief Inspector

DIRECTORS: SIR DERRICK BAILEY, BT., D.F.C., C.A. POOLE.

Telephone: CHURCHDOWN 3388

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSH.

Glos-Air Service Bulletin No 5

Date 17.7.68

Aircraft affected All Glos-Airtourer 115 Series

The following replacements are Mandatory at the periods stated.

1. Main Undercarriage legs Pt No 61002/2 - replace every 1000hrs
2. Main Undercarriage inboard Attachment Bolts Pt No 61033/1 - replace every 500hrs

N.E.H.

Chief Inspector

Cancelled see S/B 33.

DIRECTORS: SIR DERRICK BAILEY, Bt., D.F.C., C.A. POOLE.

Telephone: CHURCHDOWN 3363 GLOS·AIR LIMITED STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHI

GLOS - AIR SERVICE BULLETIN NO.6.

11th September 1968.

Aircraft Affected: All Victa 100, 115 and Glos-Airtourer 115 Aircraft.

Subject: Aileron overbalance AESL SB 001 and Glos-Air Mod GAL-54 refer.

Compliance: As soon as convenient but in any case not later than the next routine inspection.

Details: Owing to unforseen maintenance problems of the subject modifications it has been decided to cancel them, pending production of an improved version.

Any aircraft already having the modifications installed must at the next inspection have them removed and the aircraft aileron control system returned to its pre-modification standard.

A new modification will be available from Glos-Air Ltd., by November 1st to replace Mod - GAL - 43

Any aircraft owner who has already paid for the existing overbalance modification kit will receive full credit on return of the kit to Glos-Air Ltd..

The contents of the Service Bulletin are approved by the Air Registration Board.

Chief Inspector.
(N.E.Wright.)

DIRECTORS: SIR DERRICK BAILEY, Bt. D.F.C. C.A. POOLE.

Telephone: CHURCHDOWN 3388

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSH

29.12.69

Glos-Air Service Bulletin No7 (Issue2)

Aircraft Affected All Viota, Glos-Air & AESL Airtourers.

Compliance The requirements of New Zealand Leaflets 8.38.3 (Iss 1) and 8.38.1/1 (Iss1) are applicable to the subject aircraft.

Copies of these requirements are attached.

N.E.Wright

N.E.Wright

Engineering Manager

DIRECTORS: SIR DERRICK BAILEY, BT., D.F.C., [redacted],

Telephone: CHURCHDOWN 2285

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHI

26.9.68

Glos Air Service Bulletin No 8

AIRCRAFT AFFECTED All Glos Air Tourer 115 A/C S/No's 501 to 514(inc)

COMPLIANCE At the next routine inspection

DETAILS Remove control column box aft retaining spigot Pt.No. 31724/1 and check that the threads are within the limits for a Class 2A 5/16" UNF external thread.

Replace if necessary.

On re-assembly ensure that no excessive movement is apparent at this point.

This Service Bulletin has been classed as Mandatory by the Air Registration Board.

Chief Inspector

Telephone: CHURCHDOWN 3345

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHI

2.10.68

Glos Air Service Bulletin No 9

**Aircraft Affected** Viota 100, 115 and Glos-Airtourer 115 Series.

**Subject** Main Undercarriage Legs Pt.No 61002/2

**Details** The life of the subject legs may now be increased from the existing 1,000hrs to 2,000hrs.

At the completion of 2,000hrs the legs are to be replaced with new items.

Chief Inspector

Telephone: CHURCHDOWN 3383

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHI

12.1.70

Glos Air Service Bulletin No 10 Iss 2

**Aircraft Affected** All Glos-Airtourer & AESL Airtourer Aircraft

**Compliance** At next routine inspection

**Details** An isolated case of incorrect assembly of one of the Clevis Pins retaining the Link Assembly to the Rudder Pedal has been reported.

Inspect all Clevis Pins (Items 55 & 56 of Page 125 of Parts Catalogue are typical) and ensure that they are installed with the heads inboard of their respective pedal.

N.E.Wright
Engineering Manager.

DIRECTORS: SIR DERRICK BAILEY, Bt., D.F.C., [redacted]

Telephone: CHURCHDOWN 3345

GLOS·AIR LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHIRE

15.11.68

Glos Air Service Bulletin No 11

Aircraft Affected All Victa and Glos Airtourers.

We wish to draw operators attention to an Australian Airworthiness Advisory Circular which is reprinted below with which we recommend compliance.

In the event of modification action being taken application for approval should of course be to the Air Registration Board.

FUEL TANK VENT LINES – VICTA AIRTOURER

Nearly four years ago Victa issued Alert Service Bulletin No. A21 which called for an urgent inspection of fuel tank vent lines in Airtourer Aircraft to ensure the lines were correctly installed and free of kinks that could interfere with effective venting. It was stated that this action arose from a case of engine failure caused by fuel starvation. The Department has not received any further reports of engine failure caused by vent line blockage since that time, but there have been a number of reports of vent lines being found in a deteriorated and severely kinked condition. These lines, which consist of transparent PVC tubing, appear to be subject to a certain amount of shrinkage under the influence of fuel vapour, which results in the tubing being forced hard against the edges of lightening holes in the fuselage frames through which it passes, causing local flattening and eventual blockage.

We wish to emphasise the problem covered by Victa Alert Service Bulletin No. A21, drawing your attention to the need for suitable preventative maintenance, and strongly recommend that all Airtourer operators make a special feature of vent line inspections at each 100 hourly inspection. Any vent line found to be otherwise than in a fully serviceable condition should be replaced without delay. Alternatively, operators may find it advisable to eliminate any possibility of trouble by means of a suitable modification which should, of course, be referred to the Department for approval in the normal manner.

(AAC 23-4

N.H. Wright
Chief Inspector

DIRECTORS: SIR GODFREY BAILEY, BT. (CHAIRMAN) C. A. [illegible]

Telephone: CHURCHDOWN 2348

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHI

30.4.69.

Glos-Air Service Bulletin No.12.

Aircraft Affected: All Victa 100, 115 and Glos-Airtourer 115 aircraft.

Subject: Aileron Overbalance.

Details. As a result of further evaluation and test flying it has been found that no self-centering system in the aileron controls is necessary.

Service Bulletin No.6 is therefore cancelled.

The contents of this Service Bulletin are approved by the Air Registration Board.

Chief Inspector.
(N.E. Wright.)

Telephone: CHURCHDOWN 3381

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHI

1.7.69

Glos Air Service Bulletin No 13.

Subject:- Improvements to Airtourer Aircraft.

1. An improved weather seal for the canopy/windscreen is now available.
   Aircraft affected. Vista 100, 115.
   Glos-Airtourer 115.

2. A modification to split the engine cowl to allow removal without disturbing the propeller is now available.
   Aircraft affected. Vista 115.
   Glos-Airtourer 115.

Full details may be obtained on request from:
Airtourer Service Department,
Glos Air Ltd.

(W.E.Wright)
Engineering Manager.

Telephone: CHURCHDOWN 3305

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHIR

4.7.69

Glos-Air Service Bulletin No 14

Subject:- Fuel tank

Aircraft Applicability All Glos Airtourer 115 Aircraft except 503 & 507

Details

Two cases of fuel leaks from the top of the rubber bag tank have recently occurred.

These have been caused by the top of the fuel contents transmitter chafing against the fuel tank (see attached drawing).

At the next routine inspection carry out the following.

1. Drain fuel tank and remove sump assembly.

2. Inspect fuel tank for evidence of chafing immediately above the transmitter Pt No 48204/2. If any evidence of contact or wear is apparent remove the tank and repair in accordance with Victa Service Letter No 65/2.

3. Round off sharp corners on the fuel tank transmitter as per attached drawing and ensure that there is a minimum of ¼ inch clearance between the top of the transmitter and the fuel tank when the transmitter is installed and the float is at its highest position.

4. Re-assemble and record action in aircraft Log Book

N.E.Wright
Engineering Manager

DIRECTORS: SIR DERRICK BAILEY, BL, D.F.C., C.A. POOLE.

# CLOS-AIR SERVICE BULLETIN 14

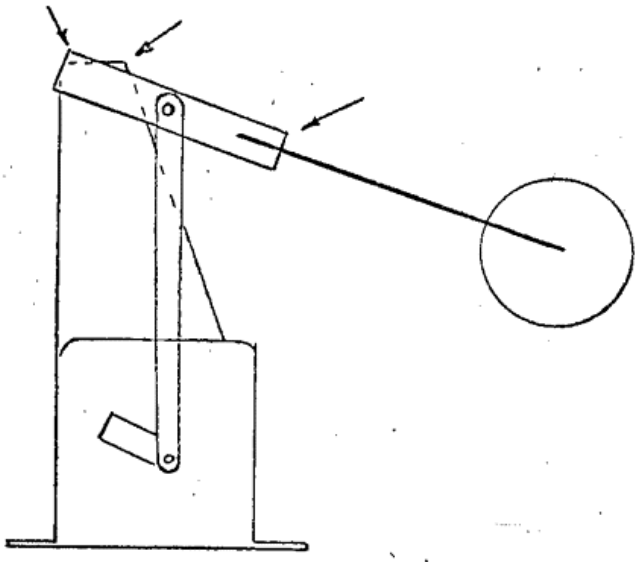

TRANSMITTER PT. No 48204/2

REMOVE SHARP CORNERS AS INDICATED BY ARROWS

Telephone: CHURCHDOWN 3388

GLOS·AIR LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSH

17.10.69

Glos-Air Service Bulletin No 15

Subject:- Control Torque Tube Assembly

Aircraft Applicability:- All Viota, Glos-Air and A.E.S.L. Airtourers

Details

1. Cracking has been reported in the upper and lower cut-outs in the control column torque tube.

2. Inspect both upper and lower cut-outs in the control column torque tube Pt.No. 52131/30 for cracking.

3. The area can be inspected by removing the arm rest front panel Pt.No. 53018/1

Compliance:- Within the next 100 hours flight time.

N.E. Wright
Engineering Manager

DIRECTORS: SIR DERRICK BAILEY, BT., D.F.C. [redacted]

Telephone: CHURCHDOWN 2268

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSH

17.10.69

Glos-Air Service Bulletin No 16

Subject:- Main undercarriage legs and attachment

Aircraft Applicability:-All Vista, Glos-Air & A.E.S.L. Airtourers

Details:-

The following replacements are Mandatory at the periods stated.

1. Main Undercarriage leg Pt.No. 61002/2 - replace every 2000 hours

2. Main Undercarriage inboard Attachment Bolts Pt.No. 61038/1 - replace every 500 hours

This Service Bulletin cancels Service Bulletins No. 5 and No 9.

cancelled

S/B 33

N.E.Wright
Engineering Manager

DIRECTORS: SIR DERRICK BAILEY, BT., D.F.C., [redacted]

GLOS·AIR LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHIRE

17.10.69

Glos-Air Service Bulletin No 17

Subject:- Wing/Fuselage [illegible] Attachment Fittings.

Applicability:- All Glos-Air and A.T.E.L. Airtourers.

Details:-

1. It has been reported that cracking has occured in the lug in the region of the steel bush of the Wing to Fuselage attachment bolts.

2. Within 200 hours after reaching 1500 hours flight time carry out the following inspection:-
Remove rear wing to fuselage attachment bolts and bushes and carry out a visual and dye penetrant inspection of the wing attachment fittings Pt.No. 10009-1 and -2 or Pt.No. 10009-3 and -4 for cracking in the lug in the region of the steel bush.

H.T.Wright
Engineering Manager.

Telephone: CHURCHDOWN 3281

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSH

14th March, 1972

Glos Air Service Bulletin No. 17, Issue 2.

The contents of this bulletin have been classified as Mandatory by the Air Registration Board.

**Subject** Wing /fuselage rear attachment fittings.

**Applicability** All Vista, A.E.S.L. and Glos Airtourers.

**Details** Issue 1 of this bulletin required the dye penetrant inspection of the above fitting. This issue amends the inspection and requirements as follows:

**Inspection**

1. Remove wing.
2. Inspect the rear wing to fuselage attachment bolts for corrosion and wear.
3. Inspect the lower fuselage longerons at the rear wing attachment points for elongation of bolt holes, cracks and corrosion.
4. a Remove the steel bushes from the wing attachment fittings part no. 10009-1-2 of 10009-3-4 and inspect all surfaces of the fittings in the area of the steel bush locations for cracks using an approved dye penetrant method.
   b Check bush holes for elongation.

**Compliance**

1. For aircraft inspected to the previous issue of this bulletin - not later than 500 hours time in service since last inspection, and thereafter at intervals not exceeding 1000 hours time in service or whenever wings are otherwise removed.
2. All other aircraft - within 1000 hours total time in service and thereafter at intervals not exceeding 1000 hours time in service or whenever wings are otherwise removed.

W. Ramsey
Engineering Manager

Telephone: CHURCHDOWN 3351

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHI

1.4.70

Glos Air Service Bulletin No 18

Subject:- Fuel Tanks

Applicability:- All Viota, AESL and Glos Airtourers

Details

Fuel tank Pt No DC1311 is no longer manufactured. Future orders will be satisfied by the supply of fuel tank Pt No DC3681. An installation drawing will be supplied with each tank although the differences are minor.

AESL S.B. 008 also refers.

N.E.Wright
Engineering Manager.

DIRECTORS: SIR DERRICK BAILEY, Bt., D.F.C., N. E. WRIGHT

Telephone: CHURCHDOWN 2361

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSH

7.7.70

Glos Air Service Bulletin No 19

Subject:- Push-pull control rods

Applicability:- All Viota, AESL and Glos-Airtourers

Details

1. An operator has reported the rivets securing the end plug in the elevator push-pull rod having worked loose in service.
2. Within 5 hours flight time or 7 days whichever is the sooner inspect all end plugs i.e. those supporting rod end bearings for signs of loose rivets, on all flying control push rods.
3. Report all cases of loose rivets and end plugs to Glos-Air Ltd., with details of total flying hours.

Background

This problem was originally highlighted by the requirements of Viota Service Bulletin A33 (Australian DCA Special Inspection VAT/64/4 also refers).

The contents of this Service Bulletin are approved by the Air Registration Board.

N.E.Wright
Engineering Manager

DIRECTORS: SIR DERRICK BAILEY, BT., D.F.C., N. E. WRIGHT

Telephone: CHURCHDOWN 3365

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHI

14.7.70



Glos Air Service Bulletin No 20

Subject:- Co Contamination

Applicability: All Viota, ABSL and Glos-Airtourer Series 115, 150 and Super 150.

Details:

1. Recent routine inspections have revealed cracks in the exhaust heater muff assembly Pt No 42339/2 - See Page 2 for location of cracks. This could possibly introduce Carbon Monoxide into the cabin heating system.
2. Within 5 hours flying time remove the outer casing from the muff assembly and inspect for cracks paying particular attention to the welded joints.
   Cracked assemblies should be replaced.
3. This inspection must be repeated every 100 hours elapsed flying time.
4. At 12 month intervals the assembly must be pressure tested to 1½ p.s.i. to check for leaks.
5. The attention of owners and operators is drawn to ARB Notice No 40.
6. The inspections required by this Bulletin have been made Mandatory by the Air Registration Board.

N.E. Wright
Engineering Manager.

DIRECTORS: SIR DERRICK BAILEY, Bt., D.F.C., N. E. WRIGHT

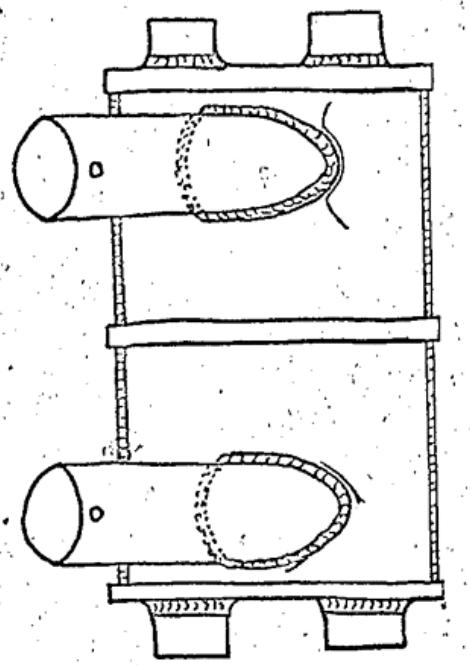

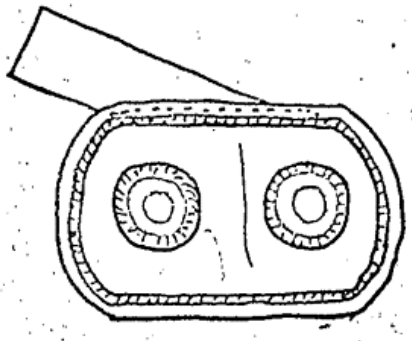

= WELD

= CRACK

Telephone: CHURCHDOWN 3365

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERS

7.12.70

Glos-Air Service Bulletin No 21

The requirements of this Bulletin have been classified MANDATORY by the Air Registration Board.

Subject — Top Rudder Hinge Spigot Pt No 23017/1

Applicability — All Viota, AESL and Glos Airtourers

Details — 1. The five Avdel Rivets which secure the Spigot Pt.No 23017/1 to the rudder have been found loose on one aircraft.

Compliance — Within 7 days of receipt of this Service Bulletin an Inspection must be made to ensure that the five Avdel Rivets are secure.
Should any loose rivets be detected, all five must immediately be replaced with solid rivets Pt. No SP 85/4; length to suit.

In any case not later than March 30th 1971, these Avdel Rivets must be replaced by solid rivets Pt. No SP 85/4; length to suit.

N.E.Wright
Engineering Manager.

DIRECTORS: SIR DERRICK BAILEY, Bt., D.F.C., N. E. WRIGHT

Telephone: CHURCHDOWN 3000

GLOS·AIR LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTER

5.3.71

Glos-Air Service Bulltin No 22

The requirements of this Bulletin have been classified as Mandatory by the Air Registration Board.

**Aircraft Affected:-** All Viota 100, 115 and Glos-Air 115, 150 and Super 150 Airtourers.

**Subject:-** Cabin Heater and Carburettor Heat Controls.

**Details:-** A recent accident in Australia has been attributed to mis-selection of the Cabin Heater Control in mistake for the Carburettor Heat Control.
Although these controls are clearly marked, the fact that they are identical could lead to an incorrect selection.
Therefore, the Carburettor Heat Control must be modified by filing notches around the periphery as per the drawing below to provide more positive identification.

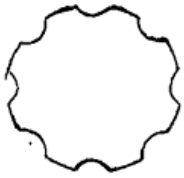

File smooth notches approximately 1/8 inch depth.

**Compliance:-** Not later than 1st May 1971

W. Ramsay
Engineering Manager.

DIRECTORS: SIR DERRICK BAILEY, Bt., D.F.C., N. S. WRIGHT

Telephone: CHURCHDOWN 3333

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHI

15th June 1971.

Glos-Air Service Bulletin No.23.

Subject:- Main Undercarriage Clamp Plates.

Applicability:- All Victa, A.E.S.L. and Glos-Airtourers

Details:- Service experience has shown that initial preload of main undercarriage attachment clamps decreases in the first 25-50 flying hours due to "bedding in" of the leg on the bronze inserts in the clamp plates.

It is recommended that checking of the clamp plate assembly for the loss of preload be carried out at 25 hourly intervals during the first 100 flying hours after initial fitment, or commencement of flying of a new aircraft, and at 100 hourly inspections, thereafter until it is establishe that no further loss of preload is evident. The inspection period may then be extended to 200 hourly intervals.

Refer to Maintenance Manual Chapter 16 for information on obtaining correct preload.

W.Ramsay.
Engineering Manager.

Telephone: CHURCHDOWN 2365

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHI

14th July 1971

Glos-Air Service Bulletin No 24

The requirements of this Bulletin have been classified MANDATORY by the Air Registration Board.

Subject:- Rudder Stop Peg Pt.No. 22023/1.

Applicability:- All Victa, AESL and Glos-Airtourers up to and including Ser. No. 521.

Details:- An operator has reported the four avdel rivets holding rudder stop peg Pt. No. 22023/1 failed in service.

Compliance:- Within 5 flying hours time, inspect stop peg avdel rivets to ensure they are secure.

Should any loose rivets be detected, all four must be replaced with solid rivets Pt.No. AN 426-AD4-4 or equivalant before further flight.

In any case not later than August 31st all rudder stop peg avdel rivets must be replaced with solid rivets.

W. Ramsay
Engineering Manager.

DIRECTORS: SIR DERRICK BAILEY, Bt., D.F.C., W. RAMSAY, J. MILLER.

Telephone: CHURCHDOWN 3365

GLOS·AIR LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHIR

14th March, 1972.

Glos Air Service Bulletin No. 24 Issue 2

The contents of this bulletin have been classified as mandatory by the Air Regis tration Board.

**Subject** Rudder stop peg part no. 22023/1.

**Applicability** All Vista, A.R.S.L and Glos Airtourers.

**Details** Issue 1 of the bulletin required the replacement of the four Avdel rivets securing the rudder stop peg part no. 22023/1 with solid rivets part no AN426-AD4-4 or equivalent for all Airtourer aircraft up to and including serial no. 521.
Further cases of rudder jamming have been reported involving complete failure of the rivets attaching the peg, rudder stop part no. 22023/1 to the fin structure and shearing of rivets attaching the rudder stop block to quadrant part no. 23022/2.

**Rectification** Requirement applicable to all aircraft prior to serial no. 576. The rudder stop peg part no. 22023/1 is to be repositioned in accordance with the following instructions:

1. Refer to Airtourer Maintenance and Parts Manual.
2. Remove tailcone.
3. Disconnect elevator and rudder controls.
4. Remove tailplane, Elevator and Rudder.
5. Drill out QTY 4 rivets attaching rudder stop peg part no. 22023/1 to bracket assy part no. 22015/1.
6. Remove and retain peg assy.
7. Using 1/16" pilot hole in bracket assy as centre, drill 1" diameter hole.
8. Cut reinforcing plate from suitable alclad sheet .048" thick to same size as base plate of peg part no. 22023/1. Drill 4 No 30 holes through plate.
9. Drill hole through peg assy and reinforcing plate to take AN 509-10-R16 screw.
10. Countersink one washer part no. AN 970-3.



contd ....

DIRECTORS: SIR DERRICK BAILEY, Bt., D.F.C., W. RAMSAY, J. MILLER.

11. Assemble by placing peg assy on underside of bracket with peg through 1" hole and QTY 2 washers on top of peg with countersunk washer uppermost. Use QTY 4 rivets AN470-AD4-5 and QTY 1 c/snk screw AN 509-10R-16, nut AN 365-1032 and QTY 2 washer AN 960-10.
12. Ensure dimension between face of upper washer and base of bracket is no greater than 0."340.
13. Reinstal rudder, tailplane and elevator.
14. Reconnect controls and check rigging.
15. Carry out duplicate inspection of controls.
16. Reinstal tailcone.

**Parts required:**

QTY -4- Rivet part no. AN470-AD4-5 or SP85.405
QTY -2- Washer part no. AN960-10
QTY -1- Screw part no. AN509-10R-16
QTY -1- Nut part no. AN365-1032
QTY Alclad x ."048
QTY -2- Washer part no. AN970-3

**Compliance** Not later than 30th November, 1972.

**Reason** Failure is attributed to incorrect ground handling. When pushing the aircraft backwards it is the practice of some operators to leave the nose wheel in full contact with the ground or have it slightly touching when the tail is lowered. The subsequent jarring during backward movement due to the rudder being held hard over against the stop is transmitted back through the rudder control circuit to the rudder stops causing hammering and ultimate failure.

**Note** Steering arms or a drawing for their manufacture can be obtained from Glos Air Ltd.

W. Ramsey
Engineering Manager

Telephone: CHURCHDOWN 3206

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHIRE

23-9-71



Glos-Air Service Bulletin No. 25

The requirements of this service bulletin have been classified as Mandatory by the Air Registration Board.

Subject: Fuel Pump Heat Deflector Modification.

Applicability: All Victa, A.E.S.L and Glos-Air 100, 115, 150, Super 150 and T6/24 Models.

Details: It has been reported that suspected cases of fuel vapourisation has occurred in Australia caused by the electric fuel pump being overheated by the exhaust of hot air from the cabin heater distribution box assembly.

Rectification: Install a deflector plate in accordance with Drawing on Page 2 to ensure that the exhaust of hot air from the cabin heater box assembly is deflected away from the electric fuel pump when the cabin heater is selected to the off position. Fitting of above Deflector plate satisfies the requirements of Australian Airworthiness Directive DCA/VAT/36

Compliance: Not later than 1st. of January 1972.

W. Ramsay

W. Ramsay
Engineering Manager.

DIRECTORS: SIR DERRICK BAILEY, Bt., D.F.C., W. RAMSAY, J. MILLER.

| HEAT TREATMENT | TREATMENT | when one part only | LATROBE VALLEY AERO CLUB | ELECTRIC FUEL PUMP HEAT DEFLECTOR | L.V.A.C. 111 |
|---|---|---|---|---|---|
| | | 2024-T3 ALCLAD. ·025" TO ·035" | | | Sheet 1 of 1 |

| LIMITS WHERE NOT STATED | | SURFACE FINISH | REPLACING PART No. | AIRCRAFT OR ENGINE TYPE | No. REQ'D PER A/C | NEXT ASSEMBLY |
|---|---|---|---|---|---|---|
| Fractional | ± | | — | AIRTOURER AIRCRAFT. | 1 ONLY. | — |
| Decimal | ± | | | | | |
| Angular | ± | | | | | |
| BREAK SHARP EDGES ·010 to ·015 | | BEND RADII | BEND RELIEF | SCALE | WEIGHT CHANGE | — |
| STAMP PART No. WHERE SHOWN ☒ | | ¼" | | ½ FULL SIZE | DIST. FROM A/c DATUM | — |

SCHEDULE OF ISSUES

| Alteration | Drawn | Ch'k'd | Auth'd | DATE |
|---|---|---|---|---|
| | JEB | | | |

SCHEDULE OF PARTS

| ITEM REF. | Description of Part | NUMBER OFF As Drawn | NUMBER OFF Dep. Note | Material | Part No. or Spec. |
|---|---|---|---|---|---|
| 1 | DEFLECTOR | 1 | 1 | ALCLAD. | 2024-T3 Or Equivalent |

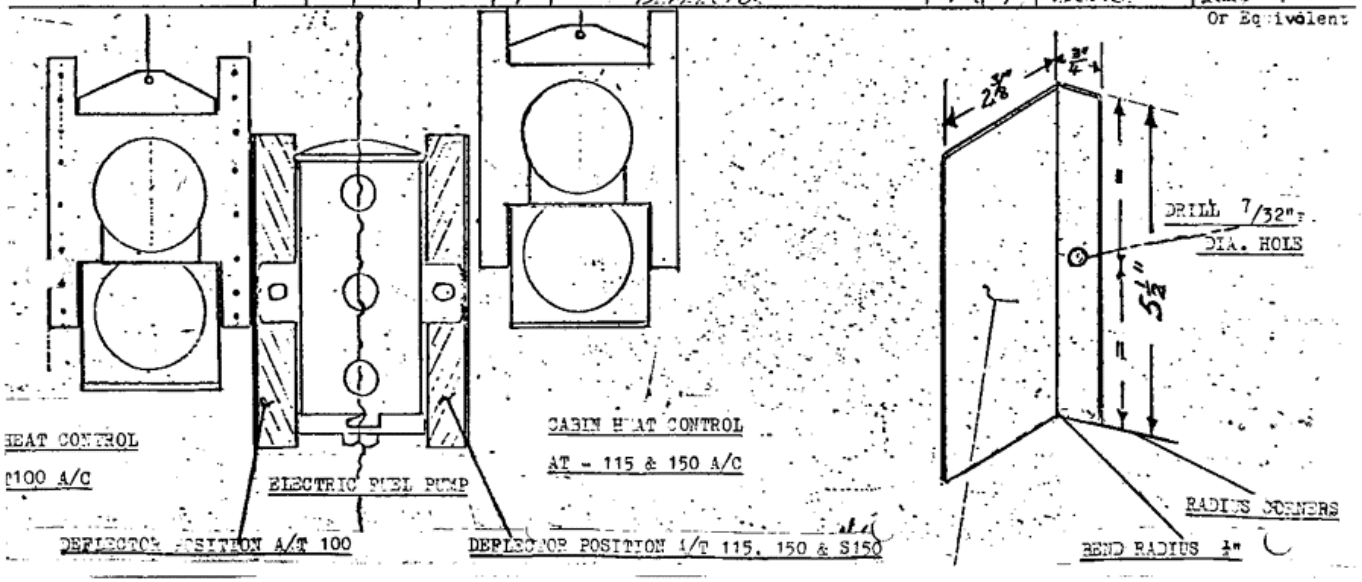

Telephone: CHURCHDOWN 3365

GLOS·AIR LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHIRE

23-9-71



Glos-Air Service Bulletin No. 26

Subject:- Flexible Fuel Tank Assembly.

Applicability:- All Glos-Air and A.E.S.L. Airtourer models.

Details:- It has been noted that it is possible for chafing to occur between the flexible fuel tank and exposed rivets and jigging holes in the tank bay.

Rectification:- Drain Fuel. Remove sump assembly and lubricate tank inner liner as instructed in A.E.S.L. Service Bulletin No. 005 then leave for 24 hours, after which remove tank and inspect for signs of chafing. Damaged tanks should be repaired in accordance with Victa Service Letter No. 65/2 which is available from the Airtourer Dept. of Glos-Air Ltd. If no damage is found the tank may be refitted, after first covering all exposed rivets and jigging holes in the tank bay with 1/16" Neoprene Rubber to prevent the possibility of chafing.

Compliance:- Within the next 200 hours after receipt of this Service Bulletin.

W Ramsay

W. Ramsay
ENGINEERING MANAGER

DIRECTORS: SIR DERRICK BAILEY, Bt., D.F.C., W. RAMSAY, J. MILLER.

Telephone: CHURCHDOWN 3301

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSH

13th. October, 1971.

Glos-Air Service Bulletin No.27

Subject:- Elevator Horn Control Assembly part no. 21009-2
Bearing part no. COM 4 and Setscrew part no 21028/1

Applicability:-All Glos-Air and A.E.S.L. Airtourers

Details:- A recent routine inspection revealed excessive end float of the elevator causing the mass balance attachment bolt to rub the end rib of the tailplane.

Rectification:-Inspect elevator for end float, if no end float is found check tighten bearing setscrew in horn control and return aircraft to service. Should end float be found remove horn assembly, remove setscrew and bearing from housing, inspect for damage then re-assemble using new items if needed.
Note: Setscrew should be installed using suitable grade Loctite.

Compliance:- To be satisfied upon receipt of this service bulletin and at every 100 hour inspection.
The contents of this service bulletin are recommended.

W. Ramsay
Engineering Manager.

DIRECTORS: SIR DERRICK BAILEY, Bt., D.F.C., W. RAMSAY, J. MILLER.

Telephone: CHURCHDOWN 3369

GLOS·AIR LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHIRE

29th March, 1972.

Glos Air Service Bulletin No. 28

Subject: Stall Warning System.

Applicability: All Airtourers

Details: After further test flying by the Air Registration Board it has been decided that there is insufficient aerodynamic stall warning in the flap up position. Rather than re-introduce the horn in the flap up position which causes annoyance during aerobatics, a flashing light is being introduced under Glos Air Modification No. 95. This will give a flashing light warning in the flap up position and horn and flashing light in all other flap positions. A kit to comply with the above modification is available from Glos Air Airtourer Service Dept. under part no. GAL 95/1 at a cost of £12.50. A flight manual amendment will be required for Glos Airtourer Aircraft using Flight Manuals Ref: RS 71, RS 72 and RS 73. A request for this amendment giving reference number should be made when ordering modification kit.

The contents of this service bulletin have been mandatory by the Air Registration Board.

Compliance: 1st September, 1972.

Compiled by: J. Eagles, Airtourer Service Engineer — Sig. ..... date 29-3-72

Approved by: W. Ramsay, Chief Inspector — Sig. ..... date 29-3-72

DIRECTORS: SIR DERRICK BAILEY, Bt., D.F.C., W. RAMSAY, J. MILLER.

Glos Air Limited.

Staverton Airport, Cheltenham, Glos.

Modification No. GAL 95.

Subject — Installation of light and flasher unit to provide stall warning when flaps are up and horn is isolated.

Applicability — All Airtourer Aircraft

Modification Installation Instruments

1. Remove luggage bay floor, front seat and control column trim.

2. Install flasher mounting block and flasher in accordance with sketch on Page 5.

3. Remove short cable from between micro-switch and horn.

4. Remove remaining cables from horn amd micro switch, keeping them clear of Airframe structure. Turn on master switch and ascertain which is the positive cable and mark it then turn off master switch.

5. Connect marked cable and new short cable SW1 from flasher to micro switch.

6. Re-fit short link between micro-switch and horn. (Note: Check wiring diagram on Page 3 to ensure micro-switch is wired correct way round.)

7. Cut off existing horn terminal close to horn. (Note: Do not disturb cable from micro-switch to horn.) Use new terminal supplied and connect existing horn and new cable SW2 to Horn.

8. Run new cables SW2 and SW3 from flasher and horn up to instrument panel following the same run as existing stall warning cable. (Note: Make sure cable is clipped in a manner that will prevent fouling flight controls.)

9. Drill instrument panel and facia panel if fitted in accordance with sketch on Page 4.

10. Fit light and stall warning notice.

11. Solder cable marked SW3 and one end of resistor to centre lamp terminal then cable marked SW2 and other end of resistor to tag on lamp.

12. Tape lift detector in the up position. Place flaps in the up position. Turn on master switch and check that light flashes. Move flaps to down position and check that horn sounds and light flashes.
To summarise, flashing light and horn must work in all positions except when flaps are fully up when only the light must work.

13. Remove tape from lift detector and check that horn and light stop. Turn off master switch.

14. Refit trim, seats and rear luggage bay floor.

15. Certify in Airframe Log Book that modification No. GAL 95 has been satisfied..

16. Ammend flight manual if required ( See Glos Air Service Bulletin No. 28 for applicability.

Affect of Weight and C of G.

Negligible.

New Items Used.

1 off Block, part no. 452-897.67
1 off Flasher, part no. 460-901.89
1 off Resistor, part no. 484-350. 34
1 off Bulb, red, part no. 472-334.12
1 off Stall Warning Notice.
Nyvin 22 Cable
2 off Terminals (Commercial Supply.)

Compiled By: R.W.Haines Sig. R.W. Haines ..... Date 8.
Airtourer Service Engineer

Approved by: W. Ramsay Sig. W Ramsay ... Date 8.1
Chief Inspector

Wiring Diagram fo[illegible] [illegible]lation of Flasher Unit in all Airtourer Aircraft to Provide Stall Warning Light in the Flap Up Position When Horn is Isolated.

Modification No. GAL 95.

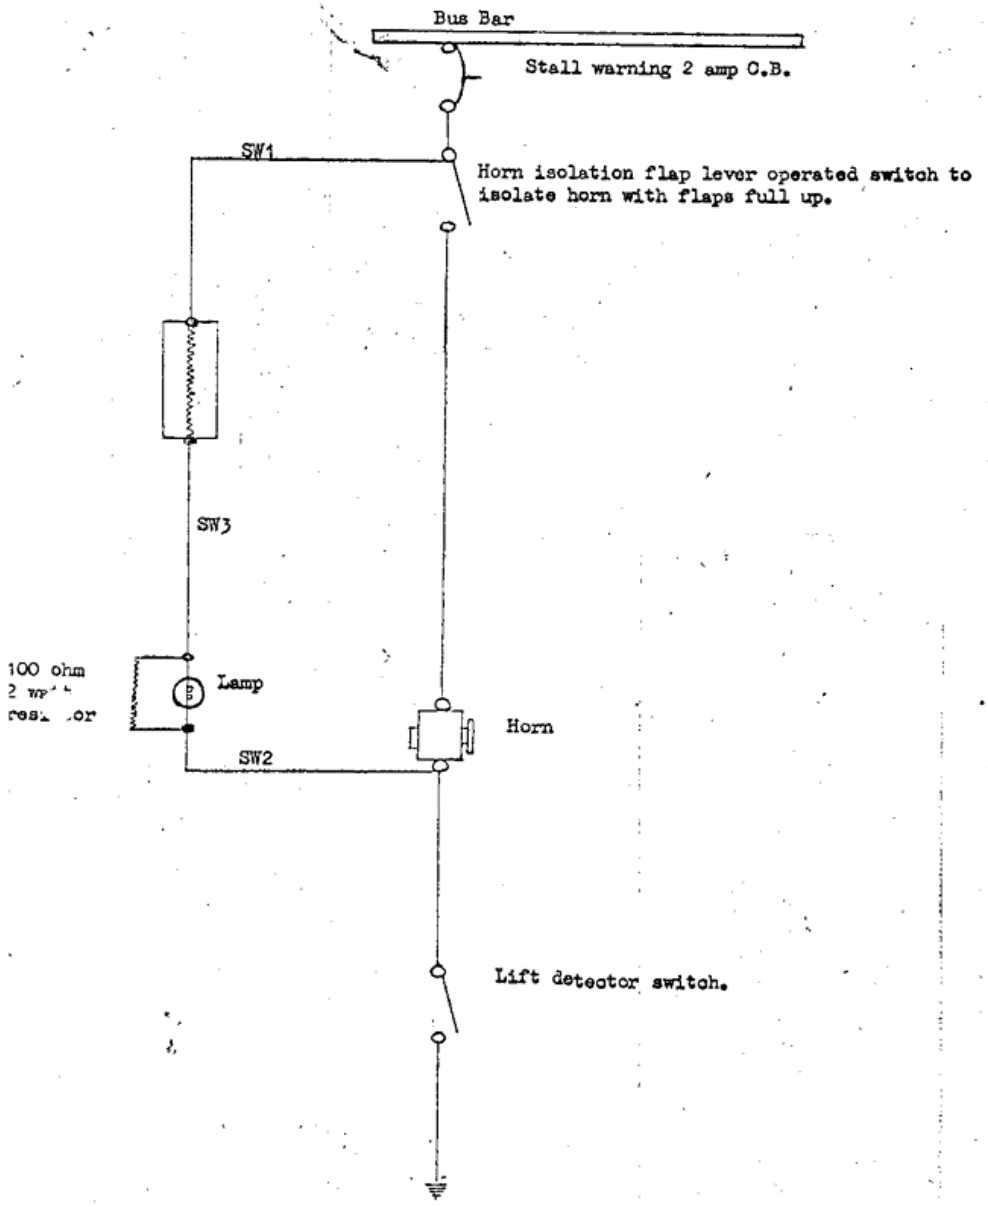

Modification No. GAL. 95

Mark off and drill ½" hole in fixed instrument panel as close as possible to the A.S.I. but not so high that it prevents it from being visible to the pilot.

Note: Care must be taken when drilling to prevent damage to priming lines.

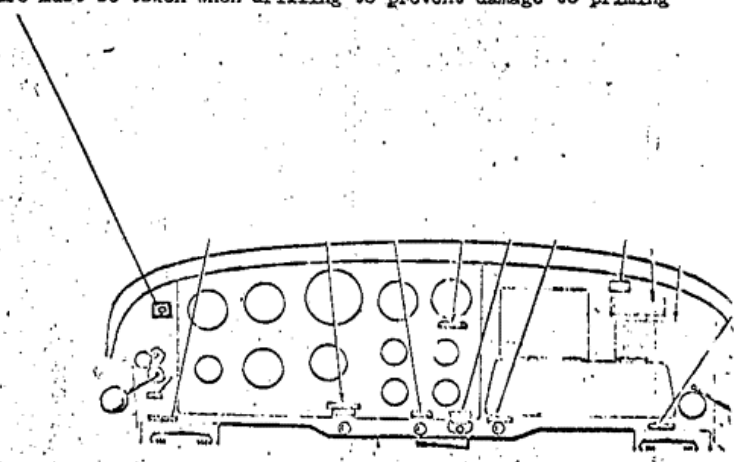

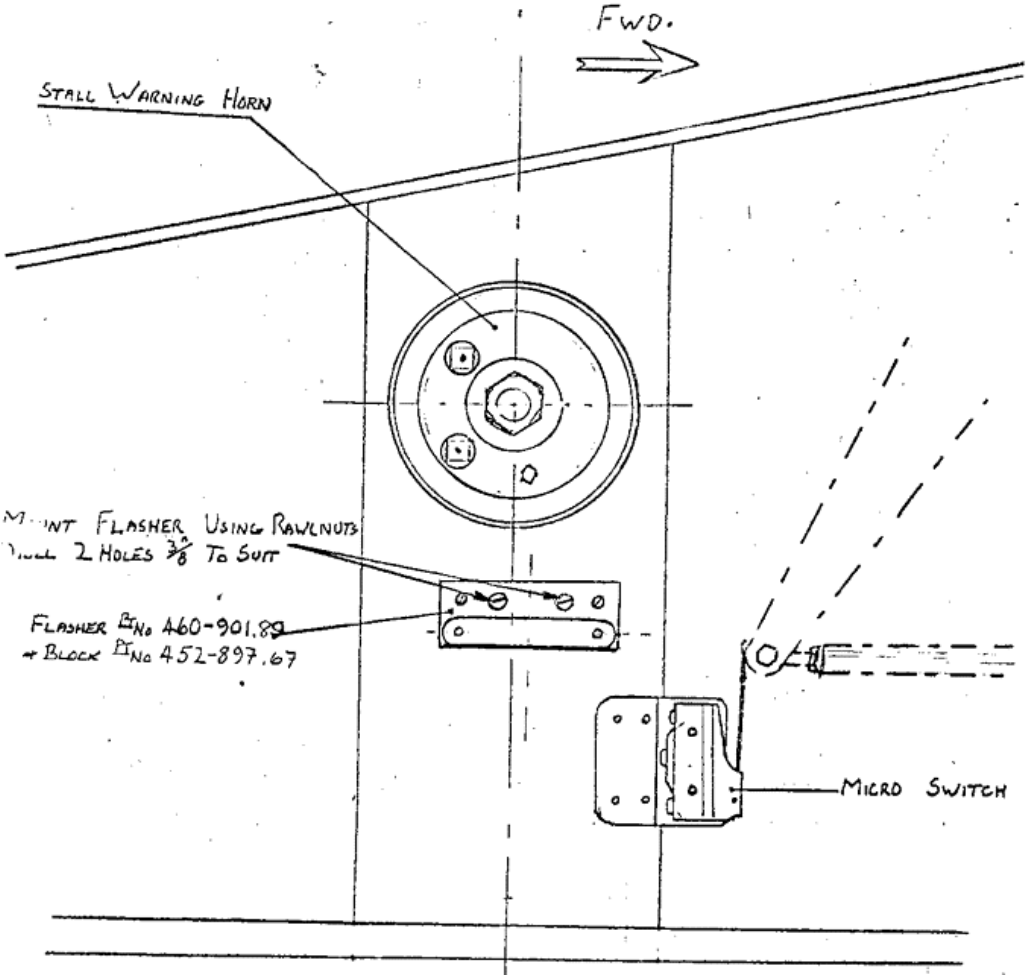


VIEW FROM AIRCRAFT CENTRE LINE LOOKING OUTBOARD PORT
AT APPROX STN 104 AND BELOW LUGGAGE BAY

| MOD GAL-95 | |
|---|---|
| DRAWN [illegible] | 2/12/71 |
| | |

Telephone: CHURCHDOWN 3385

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHIRE

15th May, 1972.

Glos Air Service Bulletin No. 29

The contents of this bulletin have been classified as mandatory by the Civil Aviation Authority.

Subject: Brake Torque Tube part number 63123/2.

Applicability: All Victa, Glos Air and A.E.S.L. Airtourers.

Details: A recent report has been received of the brake tube part no. 63123/2 coming adrift from its pivot mounts. An inspection revealed a crack running the whole circumference of the tube along the line of rivet holes beneath the flange part no. 63106/1 which in turn attaches the lever part no. 63121/1 to the tube.

Rectification: Replace aluminium alloy tube part no. 63123/2 with strengthened steel tube part no. 63123/3.
Accomplish as follows: Reference - Airtourer Parts Book Page 73. Fig. 18

1. Remove clevis pins items 52 Qty 3 connecting brake control rods to torque tube levers and master cylinder rod to torque tube lever.
2. Disconnect return spring (item 51).
3. Drill out 8 pop rivets (early models) or 12 Avdel rivets (late models) that secure spigot (item 34) bosses to torque tube.
4. Slide bosses into tube to facilitate removal of spigot items 34 from fuse bearing block and remove tube from cockpit.
5. Drill out rivets securing lever assys item 38 and 39 to original tube and remove.
6. Transfer lever assy rivet centre line dimension to new tube.
7. Position lever assys, flanges inboard on new tube and align existing rivet holes with centre lines previously marked on tube.
8. Ensure levers lie on same plane and drill rivet holes in tube using No. 30 drill. Rivet lever assys to tube after deburring and joint compound application.
9. Relocate bosses in original tube and measure overall length.
10. Remove bosses from original tube and position in new tube, align pilot holes in tube with holes in bosses, check overall length and drill No. 30 dia. rivet holes.

contd .....



DIRECTORS: SIR DERRICK BAILEY, Bt. D.F.C. W. RAMSAY. J. MILLER

10. On older models renew the bosses part no. 63128/1 which have eight holes. Remove bosses from tube, deburr holes and apply light coating of jointing compound to mating surfaces.
11. Position one boss in tube and rivet. (Note avdel rivet 12 off each end used.)
12. Slide other boss in tube, place tube in position in fuselage slide boss spigot into fuselage bearing until rivet holes align. Rivet in position.
(Note: This operation can be carried out by removing one rivet from a lever mounting flange and introducing compressed air to the internal surface of the tube. This will force the loose boss into position. Replace mounting flange rivet.)
13. Replace connecting clevis pins at levers and master cylinder rod and lock with split pins.
14. Reconnect return spring.

Parts Required:

Qty - 1 - Torque tube part no. 63123/3
Qty - 3 - Split pin " " AN 380-2-2
Qty -37 - Avdel Rivet " " 4002-0407
Qty - 2 - Pivot End " " 63128/1 (Required for Older Models Only)

Compliance: Not later than 1st November, 1972.
On receipt of this bulletin, inspect for lost movement and/or looseness between the tube part no. 63123/2 and port/stb'd levers, part no. 63121/1 and 63122/1 when the brake is applied. Continue this inspection at intervals of 25 flying hours until the tube replacement is accomplished.

Compiled by: R. Vincent. Deputy Chief Inspector.

Approved by: W. Ramsay
Engineering Manager .....W. Ramsay.....

Telephone: CHURCHDOWN 3365

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHI

10th October, 1972.

GLOS AIR SERVICE BULLETIN NO. 30

MANDATORY

**Subject:** Fuel Tank Water Drain Cock Part No. COC.2-1.

**Applicability:** All Victa, Glos-Air and A.E.S.L. Airtourers.

**Details:** It is suspected that the fuel tank water drain cock was inadvertently left open during a pre-flight inspection causing a loss of fuel with a subsequent forced landing.

**Rectification:** On or before the next 50 hr inspection after receipt of this bulletin remove sufficient material from the ends of the bent metal strip of the drain cock to prevent the cock being retained in the OPEN position by the points of the hexagon.

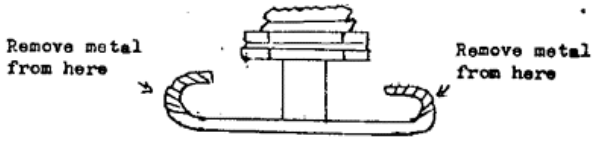


W. Ramsay,
Engineering Manager.

DIRECTORS: SIR DERRICK BAILEY, BL, D.F.C., W. RAMSAY, J. MILLER.

Telephone: CHURCHDOWN 3381

GLOS·AIR
LIMITED

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHIRE

10th October 1972.

GLOS AIR SERVICE BULLETIN NO 31 ISSUE 2

MANDATORY

| | |
|---|---|
| Subject | Fuel Gauges. |
| Applicability | All Victa, Glos-Air and A.E.S.L. Airtourers. |
| Details | Due to the characteristics of the fuel gauging system on Airtourer aircraft it is imperative that pilots use the dipstick to ascertain the quantity of fuel before flight. |
| Action | A placard to be affixed adjacent to the fuel gauge stating "Fuel Gauge Inaccurate Use Dipstick".<br>This placard should be fitted prior to or during the next 50 hour inspection after receipt of this bulletin.<br>The Civil Aviation Authority has decreed that this bulletin be classed as Mandatory, it is now raised to issue 2 and replaces bulletin No 31 dated July 1972. |

W. Ramsay,
Engineering Manager.

GLOS·AIR
LIMITED

BOURNEMOUTH (INTL) AIRPORT CHRISTCHURCH HANTS. BH23 6DX
TEL. NORTHBOURNE 6363

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHIRE GL51 6SP
TEL. CHURCHDOWN 713385

Please reply to

May 1973

Glos Air Service Bulletin No. 32

Recommended

Subject:- Articulated fuel dipstick.

Applicability:- All Victa, A.E.S.L. and Glos Airtourers.

Details:- The incorrect use of the articulated type type of fuel dipstick can give very inaccurate readings.

The following method of using this type of dipstick is recommended:-

Before attempting to dip fuel ensure the aircraft is standing on level ground. Insert the dipstick into the fuel filler pipe and collapse the dipstick only when resistance is felt. Allow tip of dipstic to rest on bottom of tank in rigid condition for approximately 10 seconds before removing to take reading. This procedure should be repeated three times and similar readings obtained each time.

C.J. Kay,
Deputy Chief Inspector.

DIRECTORS: SIR DERRICK BAILEY, Bt., D.F.C., W. RAMSAY, J. MILLER.

GLOS·AIR
LIMITED

BOURNEMOUTH (HURN) AIRPORT CHRISTCHURCH HANTS. BH23 6DU
TEL. NORTHBOURNE 6363

STAVERTON AIRPORT CHELTENHAM GLOUCESTERSHIRE GL51 6SF
TEL. CHURCHDOWN 71338

Please reply to

May, 1973.

Glos Air Service Bulletin No. 33

The contents of this Bulletin have been classified as Mandatory by the Civil Aviation Authority.

Subject:- Main undercarriage legs and attachment.

Aircraft Applicability:- All Victa, Glos-Air & A.E.S.L. Airtourers.

Details:-

The following replacement must be made at the periods stated.

1. Main Undercarriage legs P/No 61002/2 - replace every 2000 hours.

2. Main Undercarriage inboard Attachment Bolts P/No 61033/1 - replace every 350 hours. (AN6-17)

ON CONDITION

The life of bolt P/No 02-61033/1 has been reduced to 350 hours from 500 hours as quoted in Service Bulletin No. 16 because of recent cases of bolt failure.

This Service Bulletin is applicable forthwith and any bolt that has exceeded 350 hours must be replaced. It is essential that discarded lifed items are destroyed.

This Bulletin cancels Service Bulletins 5, 9 & 16.

C.J. Way,
Deputy Chief Inspector.

DIRECTORS: SIR DERRICK BAILEY, Bt., D.F.C., W. RAMSAY, J. MILLER.

Glos Air Aviation plc, Bournemouth-Hurn Airport, Christchurch, Dorset, BH23 6DQ.
Telephone: (0202) 578601. Telex: 417236.

Issue 2 9th February 1987

Glos Air Services Bulletin No.33

The contents of this bulletin have been classified as Mandatory by the Civil Aviation Authority.

Subject:- Main undercarriage legs and attachment.

Aircraft Applicability:- All Victa, Glos Air & A.E.S.L. Airtourers.

Details:-

The following replacement must be made at the periods stated.

1. Main undercarriage legs P/N 61002/2 - replace every 2000 hours.

OR

1a. as an acceptable alternative method of compliance carry out a Magnetic Particle Inspection on completion of the 2000 hours life and, thereafter repeat the inspection at intervals not exceeding 150 hours of operation. NO cracks are acceptable, cracked undercarriage legs must be replaced.

2. Main undercarriage inboard Attachment Bolts P/No 61033/1 - replace every 350 hours.

The life of bolt P/No 02-61033/1 has been reduced to 350 hours from 500 hours as quoted in Service Bulletin No.16 because of recent cases of bolt failure.

This Service Bulletin is applicable forthwith and any bolt that has exceeded 350 hours must be replaced. It is essential that discarded lifed items are destroyed.

This Bulletin cancels Service Bulletins 5, 9, & 16.

F. Underdown.
Deputy Chief Inspector

Registered in England No. 1689727. Registered Office: 1 East Street, Tonbridge, Kent, TN9 1HP.

SAFETY REGULATION GROUP

Aviation House
Gatwick Airport South
West Sussex
RH6 0YR
UNITED KINGDOM

Direct Dial +44(0)1293 573149
Direct Fax +44(0)1293 573993
E-mail ad.unit@srg.caa.co.uk

Switchboard +44(0)1293 567171
Fax +44(0)1293 573999
Telex 878753

CIVIL AVIATION AUTHORITY

Our ref 9/97/CtAw/10/216

20 August 2001

**CAA EMERGENCY AIRWORTHINESS DIRECTIVE 002-08-2001**
**AESL AIRTOURER, VICTA AIRTOURER AND GLOS AIR GLOS-AIRTOURER SERIES AIRCRAFT**
**INSPECTION OF TAILPLANE SUPPORT BRACKETS FOR CORROSION**

## BACKGROUND

During a 'Star' inspection of a Glos-Airtourer 115 aircraft, the tailplane support brackets were found with severe exfoliation corrosion in the vicinity of the attachment bolts. The corrosion had consumed more than 80% of the thickness of the bracket at the location of the two outer securing bolts.

## APPLICABILITY

Applicable to AESL Airtourer T3 aircraft, Victa Airtourer 100 and 115 aircraft and Glos-Airtourer 115, 150 and Super 150 aircraft.

## COMPLIANCE

Compliance is initially required not later than 10 flying hours or three months whichever is the sooner from the effective date of this Directive which is 24 August 2001.

## REQUIREMENT

Clean and visually inspect the left and right tailplane support brackets for corrosion. Any corrosion detected must be removed and the area re-protected, in accordance with the AESL Airtourer 100, 115, 150, super 150 & T6 Maintenance and Repair Manual dated June 1970 chapter 50 "Repair Manual - General Repair Procedures", before further flight. If corrosion is blended out the depth must be recorded in the aircraft log book. Brackets with corrosion which exceeds the limits stated in chapter 50 paragraph 2 (c) of the Maintenance and Repair Manual, must be replaced with Part Nos 20031/1 or 20031/2 or an alternative approved part. Repeat inspection of the tailplane support brackets must be carried out at intervals not exceeding 12 months.

IT IS RECOMMENDED THAT YOU FORWARD A COPY OF THIS AIRWORTHINESS DIRECTIVE TO THE ORGANISATION THAT MAINTAINS YOUR AIRCRAFT.

Enquiries regarding this Directive should be referred to Mrs J Barratt, Aircraft Certification Section (Telephone No 01293 573945) at the above address.

**R J TEW**
Applications and Certification Section

SERVICE BULLETIN

| NUMBER | ISSUE | DATE | SUBJECT |
|---|---|---|---|
| 1 | 1 | 12.3.68 | A/C Spinners and NZCAR extracts |
| 2 | 1 | 12.3.68 | Aileron Overbalance Mod |
| 3 | 1 | 19.3.68 | Control Column Centralising System |
| 4 | 1 | 13.5.68 | Weigh Schedule Typographical Error |
| 5 | 1 | 17.7.68 | Life of Legs and Attachment Belts See 33 |
| 6 | 1 | 11.9.68 | Aileron Overbalance - Remove |
| | 2 | 29.12.69 | Hole to release Exhaust System fluid steering and Rudder Push Rod inspection |
| 8 | 1 | 26.9.68 | Control Column Box Aft Retaining Spigot threads to be checked |
| 9 | 1 | 2.10.68 | Life of Legs See 33 |
| 10 | 2 | 12.1.70 | Incorrect Assembly of Clevis Pin - Inspection |
| 11 | 1 | 15.11.68 | Fuel Lines Inspection |
| 12 | 1 | 30.4.69 | Aileron Control Self Centering not necessary - cancelled. |
| 13 | 1 | 1.7.69 | Canopy/Windscreen weather seal split engine cowl |
| 14 | 1 | 4.7.69 | Fuel Tank Leaks |
| 15 | 1 | 17.10.69 | Control Torque Tube cracks |
| 16 | 1 | 17.10.69 | Life of Legs and Attachment bolts See 33 |
| 17 | 2 | 29.3.72<br>17.10.69 | Wing to Fuselage |
| 18 | 1 | 1.4.70 | Fuel tank part numbers |
| 19 | 1 | 7.7.70 | Push Pull Rod Inspection |
| 20 | 1 | 14.7.70 | Co-Contamination |
| 21 | 1 | 7.12.70 | Loose rivets in rudder hinge spigots |
| 22 | 1 | 5.3.71 | To eliminate confusion between carb heat and cab heater controls |

Continued.....

Service Bulletin (Continued)

| NUMBER | ISSUE | DATE | SUBJECT |
|---|---|---|---|
| 23 | 1 | 15.6.71<br>29.3.72 | Main undercarriage clamp plates |
| 24 | 2 | 14.7.71 | Rudder stop peg loose rivets |
| 25 | 1 | 23.9.71 | Fuel pump heat deflector Modification |
| 26 | 1 | 23.9.71 | Flexible fuel tank assembly |
| 27 | 1 | 13.10.71 | Elevator Horn control assembly |
| 28 | 1 | 29.3.72 | Stall Warning System |
| 2 | 1 | 15.5.71 | Brake Torque Tube |
| 30 | 1 | 10.10.72 | Fuel Tank Drain Cocl Part No. COC. 2-1 |
| 31 | 2 | 6.7.72 | Fuel Gauge |
| 32 | 1 | May 1973 | Articulated Fucl Dip Stick |
| 33 | | May 1973 | Main U/C Less 9 Attachments |