

PRELIMINARY PROJECT REPORT

**RESTORATION OF
ST. MARY'S CHURCH, AJMER,
RAJASTHAN**

MAY 2024



**Indian
National Trust
for Art and
Cultural Heritage**

**ARCHITECTURAL HERITAGE DIVISION
INDIAN NATIONAL TRUST FOR ART AND CULTURAL HERITAGE
(INTACH)
NEW DELHI**

PRELIMINARY PROJECT REPORT

RESTORATION OF
ST. MARY'S CHURCH, AJMER,
RAJASTHAN

MAY 2024



Architectural Heritage Division

**Indian National Trust for Art and
Cultural Heritage(INTACH)**

New Delhi

EXECUTIVE SUMMARY

Saint Mary's Church CNI, Ajmer, a historic colonial church constructed in 1887 CE, faced a tragic fire incident on April 15th, 2024, during routine maintenance activities, resulting in severe damage to its roof and rendering it non-functional.

Responding promptly to this crisis, the church administration sought assistance from the Indian National Trust for Art and Cultural Heritage (INTACH) to assess the structure's condition and devise a plan for urgent restoration. On April 27th and May 14th, 2024, INTACH team conducted site visits, conducting a preliminary evaluation of the damage, with a primary focus on the pitched roof and superstructure.

This subsequent Preliminary Project Report (PPR) encapsulates the structural assessment findings, highlighting the critical need for intervention. The proposed restoration plan is divided into three phases:

- **Immediate Measures: [to be undertaken by Church Trust]:** With the monsoon season approaching, it is crucial to implement immediate measures to protect the church from water ingress and maintain structural stability.
- **Urgent Repairs (Phase 1):** The first phase will address immediate concerns, focusing on structural consolidation, roof repairs, vegetation removal, and waterproofing. This phase aims to stabilize the structure and prevent further deterioration.
- **Necessary Restoration (Phase 2):** The second phase will prioritize surface conservation, treatment, and finishes, targeting issues such as algae deposits on terrace levels. Restoration efforts will extend to furniture and immovable artifacts, including the recreation of lost ornamental plaster profiles and edges. Plinth protection will be implemented to prevent water infiltration, while integration of electrical, fire safety, and universal design principles will enhance functionality.

The restoration of Saint Mary's Church, Ajmer, presents a multifaceted approach, combining urgent repairs with comprehensive restoration efforts to conserve its historical and cultural significance. Through collaboration between the Church Trust and INTACH, the project aims to safeguard this heritage structure for future generations while enhancing its functionality and usability.



INTACH Team

1. **Mrs Dharmendar Kanwar**
Co-Convener, INTACH Rajasthan Chapter

2. **Ms. A. Vijaya**
Director and HOD, AH Division

3. **Ms. Ipsita Acharya**
Conservation Architect, AH Division

4. **Ms. Debashrita Kundu**
Conservation Architect, AH Division

5. **Mr. Chandresh Kumar**
Architectural Assistant, AH Division


Special thanks to **Dr Pamela Erickson**
Secretary, St Mary's Church Ajmer



TABLE OF CONTENT

EXECUTIVE SUMMARY

1.	BACKGROUND.....	1
1.1.	INTRODUCTION.....	1
1.2.	HISTORICAL CONTEXT.....	2
2.	ARCHITECTURAL SIGNIFICANCE.....	3
2.1.	HISTORIC SITE AND SETTINGS.....	3
2.2.	PRESENT SITE AND SETTINGS.....	3
2.3.	ARCHITECTURAL ELEMENTS.....	7
3.	SUMMARY OF OBSERVATIONS AND RECOMMENDATIONS.....	12
3.1.	DAMAGE DUE TO FIRE INCIDENT.....	12
3.2.	STRUCTURAL ISSUES.....	20
3.3.	SURFACE DEPOSITS AND VEGETATION.....	21
3.4.	INCOMPATIBLE RENDERS.....	22
3.5.	DAMAGE TO IMMOVABLE ARTIFACTS AND ITEMS.....	23
4.	METHODOLOGY.....	26
4.1.	RESEARCH AND DOCUMENTATION.....	26
4.2.	ANALYSIS.....	26
4.3.	STRATEGY/PLANNING AND CONSERVATION.....	26
4.4.	DETAILED ESTIMATION.....	26
4.5.	PREPARATION OF DETAILED PROJECT REPORT.....	26
5.	PROPOSALS.....	27
5.1.	SITE VISIT.....	27
5.2.	PHASING OF INTERVENTIONS.....	27
5.3.	PRIORITIES OF ACTION.....	31
5.4.	PRELIMINARY ESTIMATE.....	32

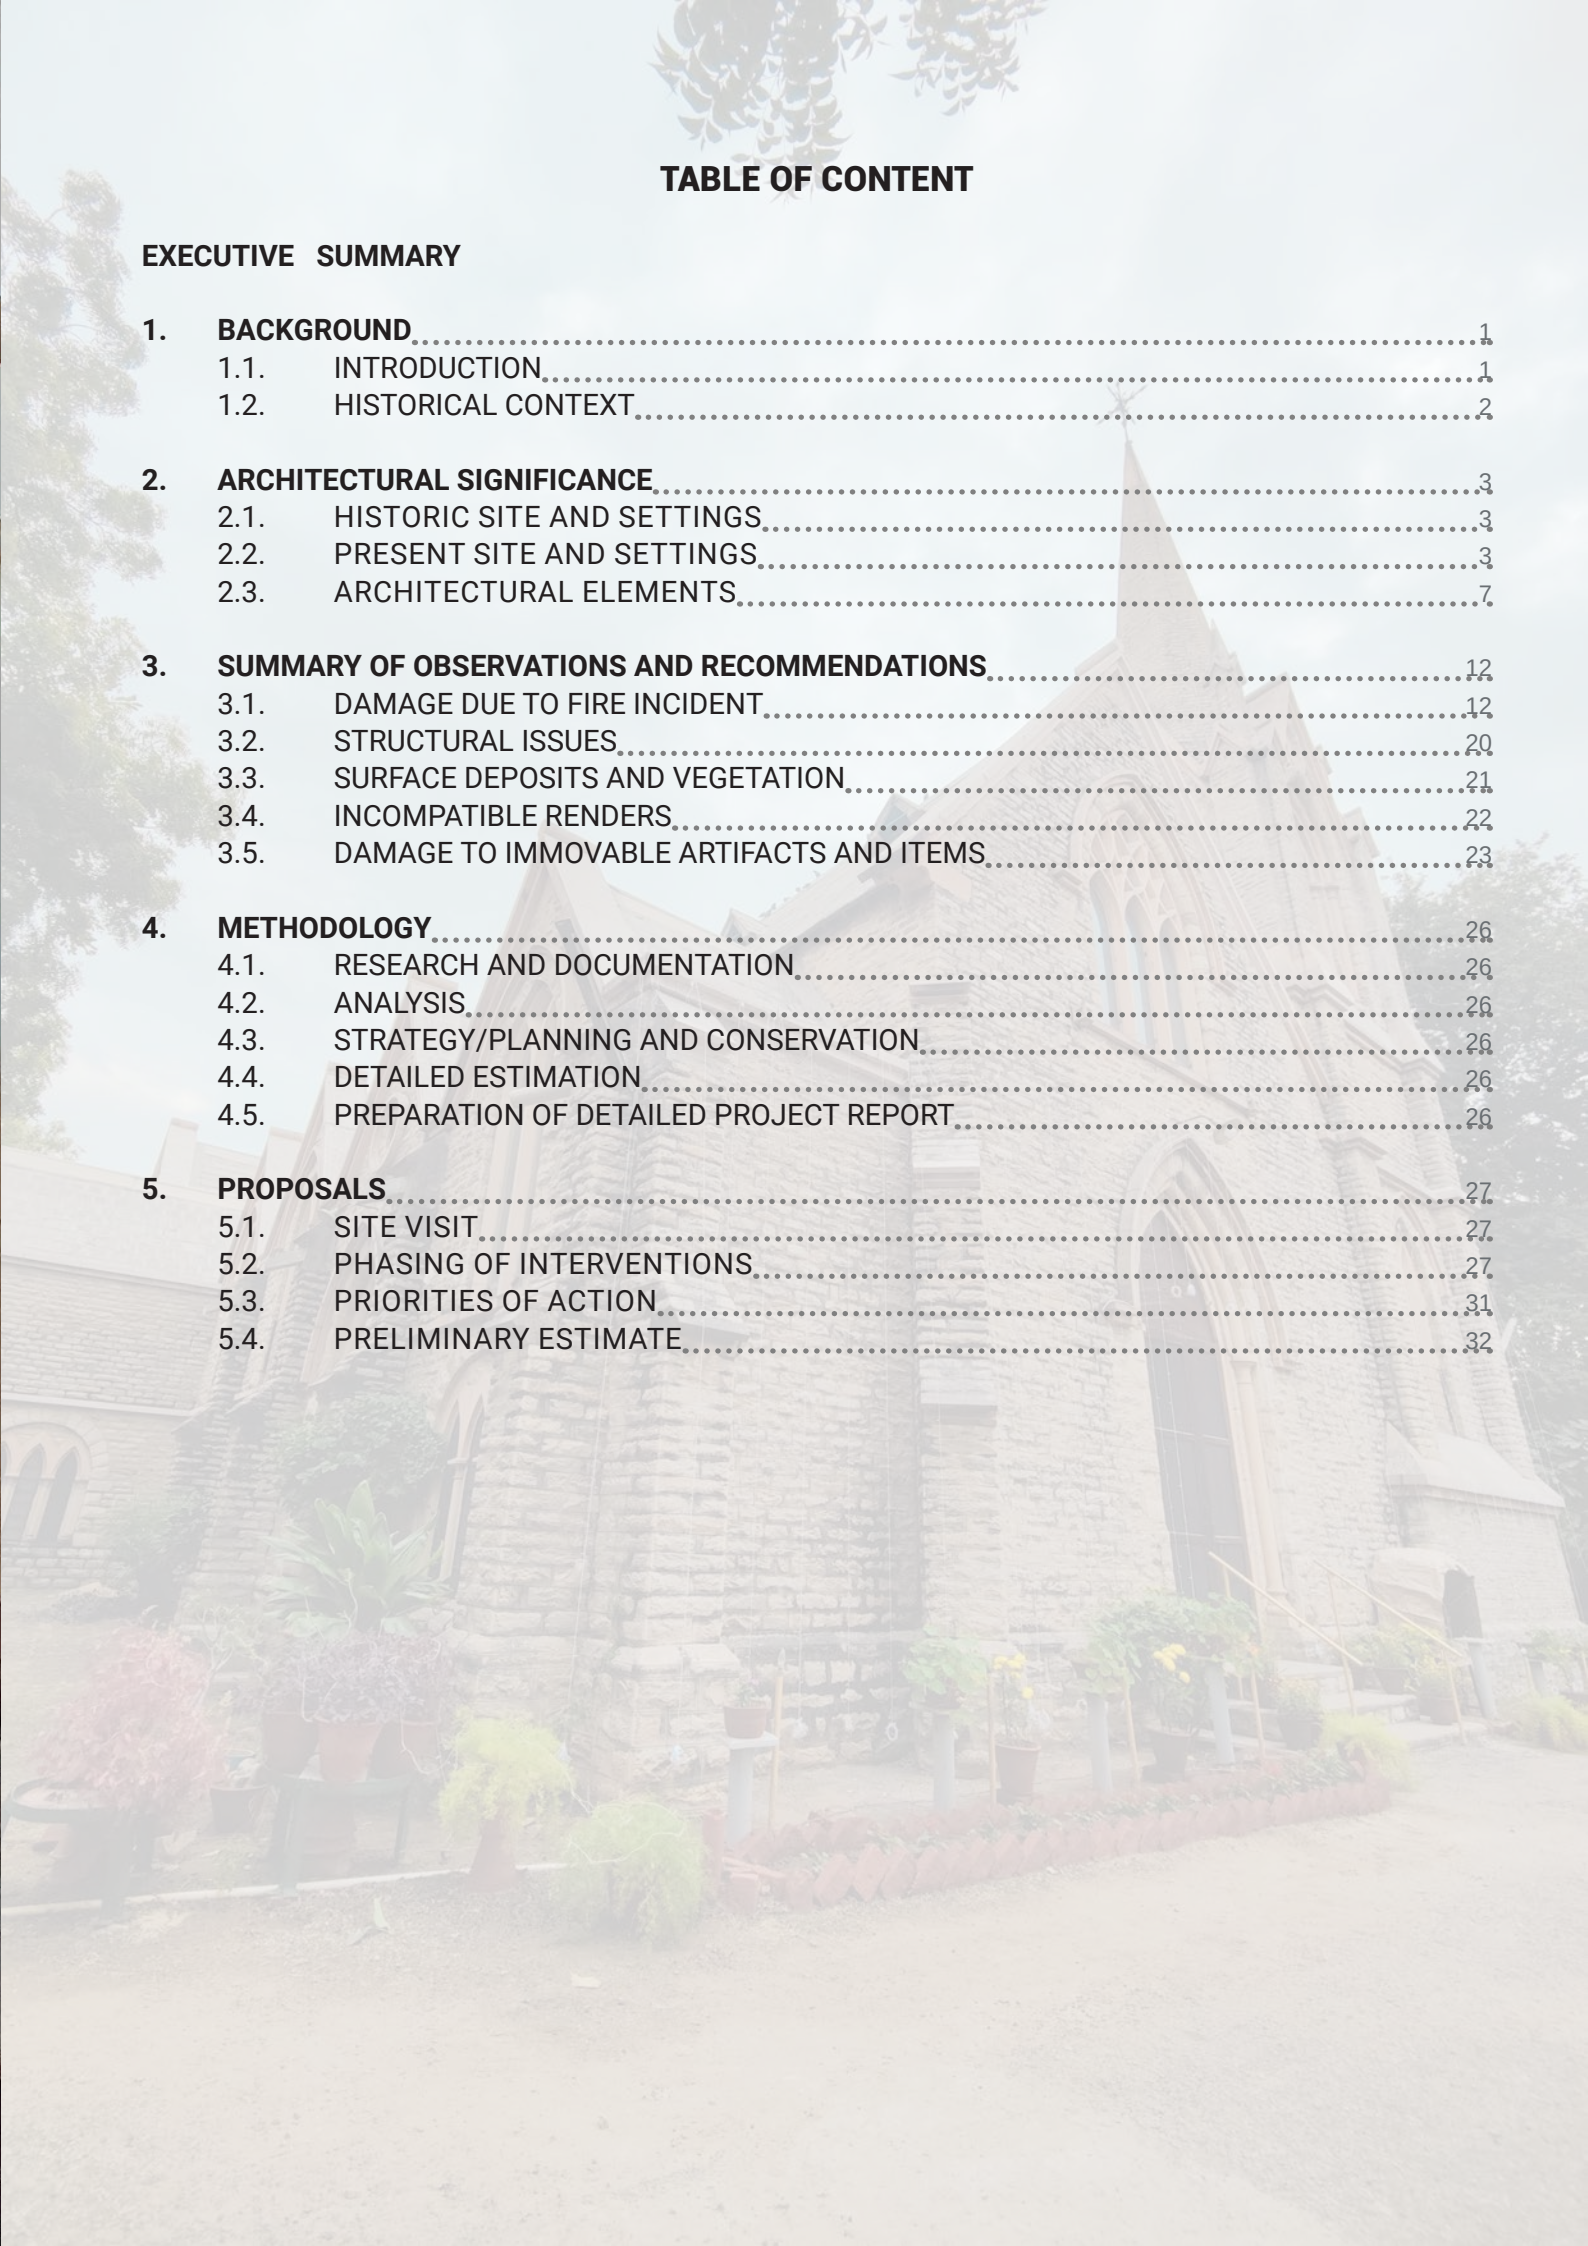



1. BACKGROUND

1.1. INTRODUCTION

St. Mary's Church (CNI), nestled near the picturesque Anasagar Lake in Ajmer, Rajasthan, stands as a testament to faith, resilience, and community spirit. With roots dating back to the post-1818 era this historic church has played a pivotal role in the religious and cultural landscape of the region. Originally known as "All Saint's Church" or the Station Church, it served as a spiritual haven for the small European Christian community under the jurisdiction of the Bishop of Bombay. Over the decades, St. Mary's Church has witnessed significant transformations, reflecting the evolving needs and aspirations of its congregation. From the decision to build a new church near the ancient Visla Lake in 1878 to its consecration as St. Mary's Church in 1889, each milestone marked a chapter in the rich tapestry of its history. Despite facing challenges such as the recent tragic fire incident during the waterproofing of the church roof on 13th April, 2024, St. Mary's Church continues to stand as a beacon of hope and inspiration for worshippers and visitors alike. As it approaches its sesquicentennial milestone, the church remains a symbol of enduring faith, community solidarity, and architectural grandeur.¹



Fig. 1 - The front facade of the St. Mary's Church, Ajmer
Source -St. Mary's Church Trust

¹ History compiled by Church Secretary Dr. Mrs. P. F. Erickson

1.2. HISTORICAL CONTEXT

Since the Marathas handed over Ajmer to the British in 1818, St. Mary's Church has been a cornerstone of religious life in the region. The construction of the small church near Anasagar Lake marked the beginning of its journey, under the jurisdiction of the Bishop of Bombay. In 1871, the consecration of the Church and Cemetery by Bishop Henry Alexander of Bombay solidified its status as a sacred place of worship.

Subsequent years saw significant developments, including Ajmer and Jaipur coming under the Diocese of Calcutta in 1874, and the decision to build a new church near the bund of the ancient Visla Lake in 1878. By 1889, St. Mary's Church was consecrated by Bishop Edward R. Johnson of Calcutta, marking a new chapter in its storied history.

Through the decades, St. Mary's Church has been a witness to numerous milestones, from the decision to dismantle All Saint's Church in 1894 to the celebration of its diamond jubilee in 1948 and centenary in 1987. Each event has left an indelible mark on the church's legacy, reflecting the enduring faith and dedication of its congregation.

Despite facing challenges such as the need for maintenance and repairs, St. Mary's Church has remained steadfast in its commitment to serving the community. Whether it's the installation of a tar road around the church premises in 2008 or the celebration of its 125th anniversary in 2013, the church continues to stand as a beacon of hope and inspiration for all who enter its hallowed halls.

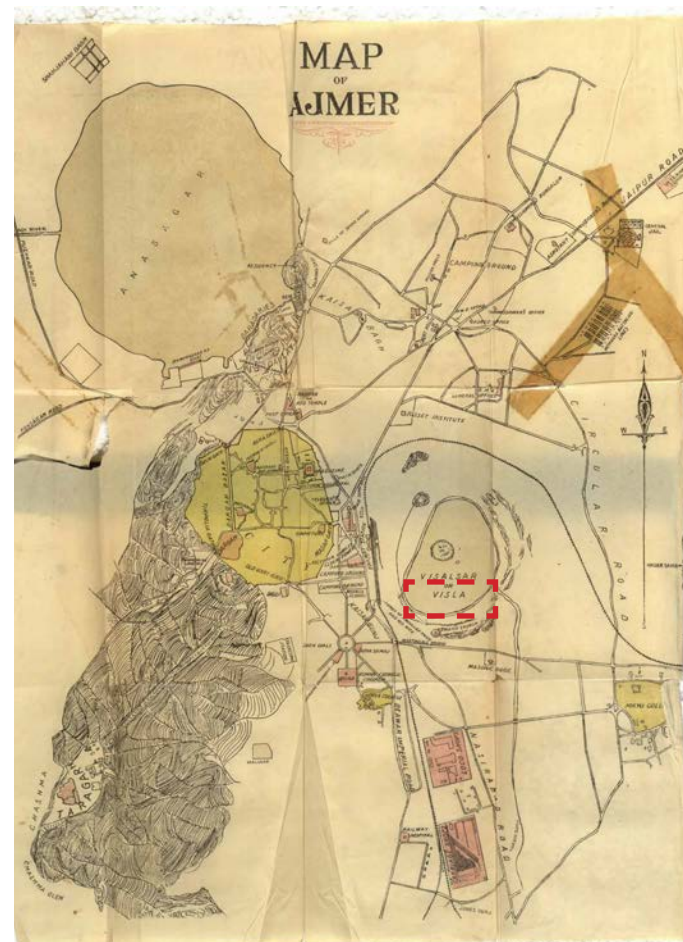


Fig. 2 - Archival image of Ajmer city dated 1904
Source- Ajmer Historical and Descriptive, 1904 by Har Bilas Sharda

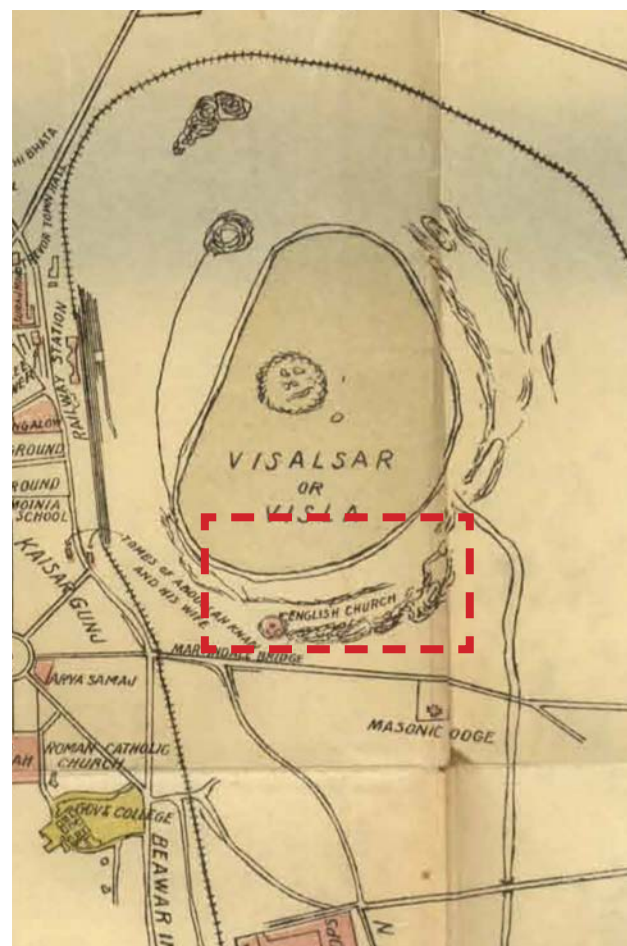


Fig. 3 - Mention of St. Mary's church as English Church in the archival image of Ajmer city dated 1904
Source- Ajmer Historical and Descriptive, 1904 by Har Bilas Sharda

2. ARCHITECTURAL SIGNIFICANCE

2.1. HISTORIC SITE AND SETTINGS

Initially, the European Christian community worshiped at All Saints Church, also known as the Station Church, near Anasagar Lake. This church fell under the jurisdiction of the Bishop of Bombay, with visiting chaplains from St. Paul's Church, Nasirabad.

The need for a larger church arose with the expansion of the European community and the arrival of the BB&CI Railway in 1875. Consequently, the decision to construct a new church was made in 1878. The chosen site for this new church was on the bund of the ancient Visla Lake, a historic site built by King Visaldev, an ancestor of the last Hindu emperor of India, Prithviraj Chauhan.

The planning phase for St. Mary's Church began earnestly in 1883, with significant contributions from the local European community and railway officials. Notable figures in this effort included Mr. Campbell Thomson, the Executive Engineer of Railways, and Mr. Blood, whose final design was carried forward by Mr. Macdonald. The church was completed in September 1887, though internal fittings continued to be added. The accompanying cemetery on Nasirabad Road, was consecrated by Bishop Johnson, became the final resting place for many members of the community, with the oldest known gravestone dating back to 1863.

2.2. PRESENT SITE AND SETTINGS

At present, the church sits on a mound, with an approach road from the southeast. The Church complex is adjacent to the Church Road, near the Ajmer Railway Station, making conveniently accessible by rail. Key landmarks around the church include the Abdullah Kha ka Makbara, Shahid Smarak, Clock Tower, Robson Memorial Cathedral CNI, Mayo College Ajmer etc. situated nearby, and the bustling Ajmer Railway Station to the west. The church's proximity to these landmarks makes it a notable site within the urban fabric of Ajmer. The church's cemetery, located on Nasirabad Road, adds to its historical significance, with graves that provide insights into the lives of those who were part of its congregation over the years.



Fig. 4 - Satellite image of St. Mary's Church at a macro level showing Anasagar Lake
Source - Google Earth

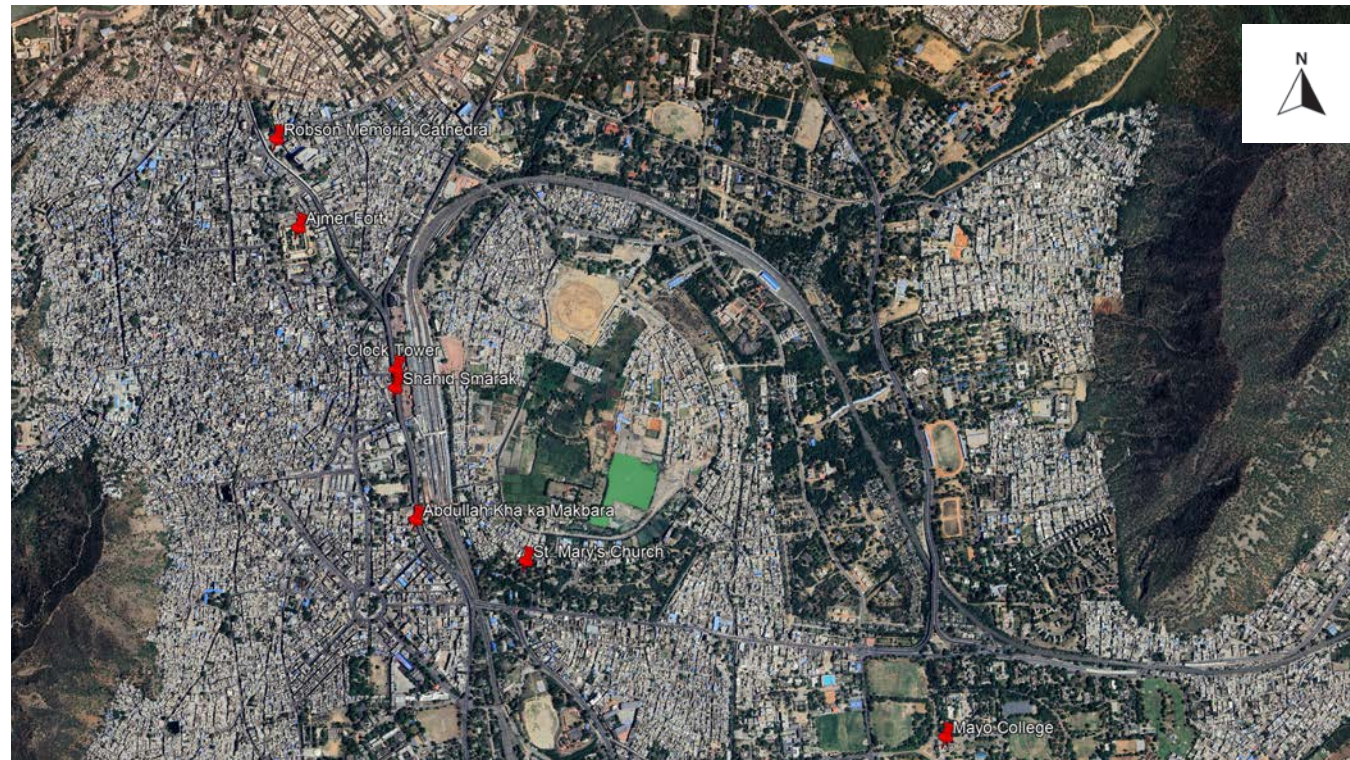


Fig. 5 - Satellite image of St. Mary's Church at a meso-level showing the prominent landmarks around the site
Source - Google Earth



Fig. 6- Present site plan of the site complex
Source -St. Mary's Church Trust

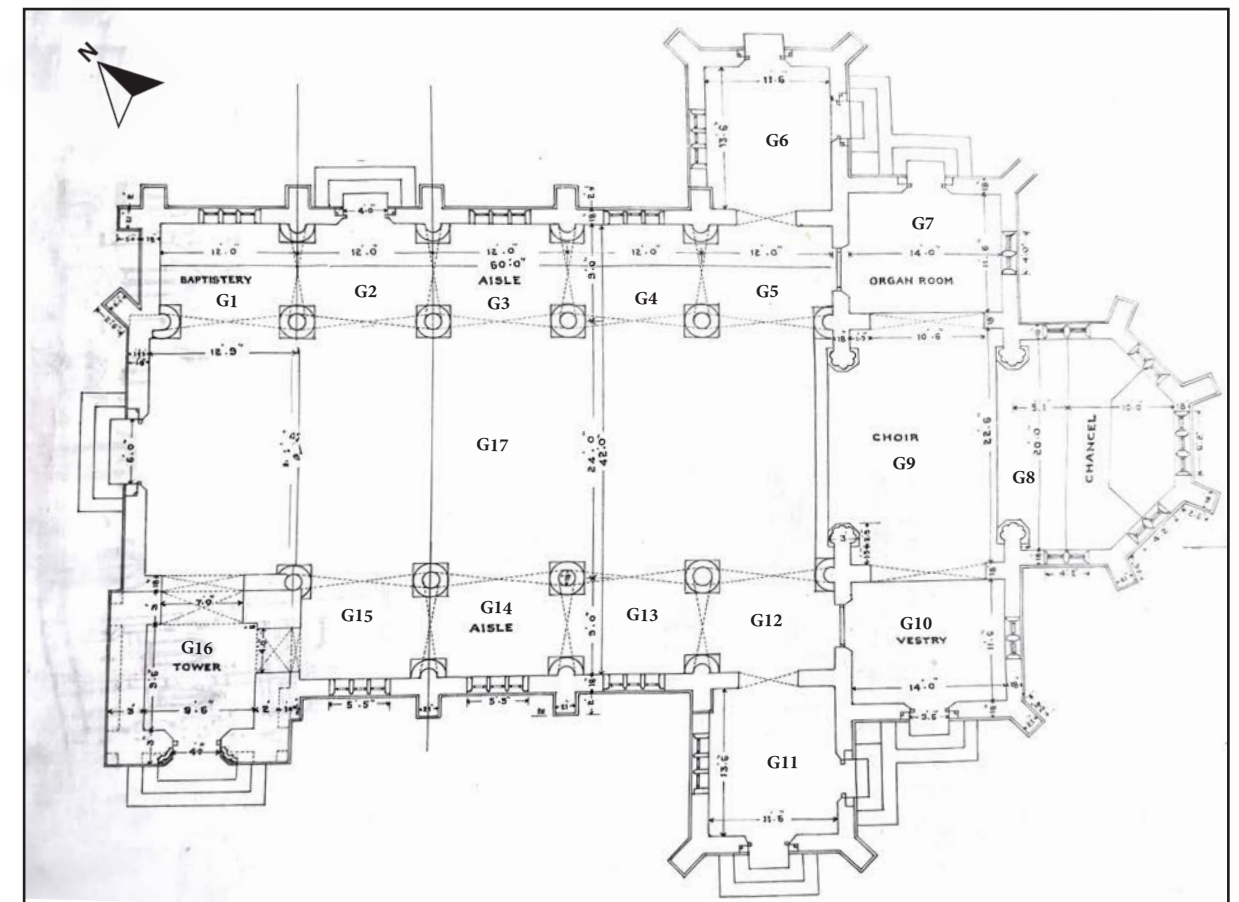


Fig. 7 - The floor plan of the Church
Source -St. Mary's Church Trust



Fig. 8- The front elevation of the Church
Source -St. Mary's Church Trust



Fig. 9- The South-west elevation of the Church
Source -St. Mary's Church Trust

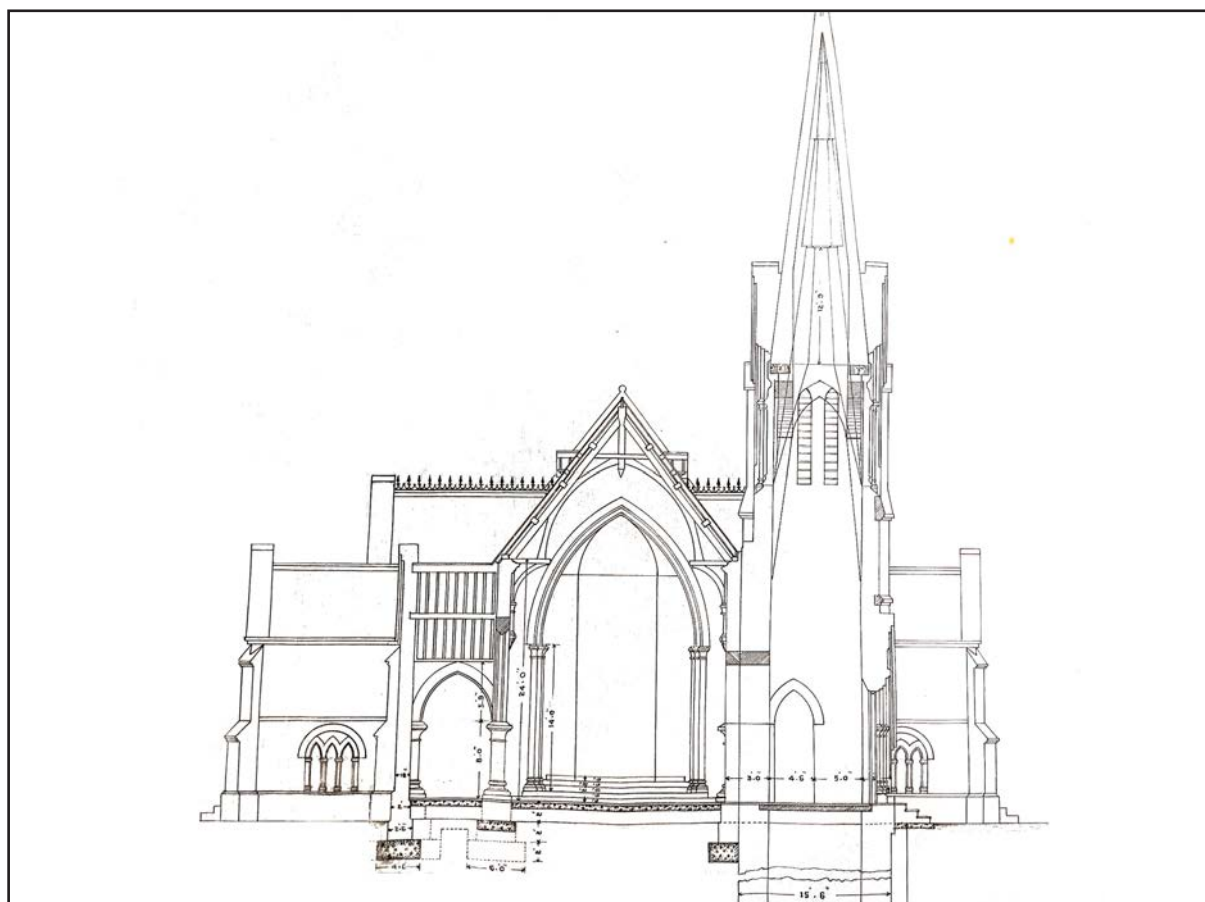


Fig. 10 - Cross section of the Church
Source -St. Mary's Church Trust

2.3. ARCHITECTURAL ELEMENTS

The Church exhibits a fine example of Gothic Revival architecture. This style, which gained popularity in the mid-19th century, is being characterized by several distinctive features visible in the church's design. Some of the salient features are as follows:

The spacious rectangular layout of the church is featuring a central nave flanked by two aisles, separated by columns. Notably, the church is boasting four transepts. Situated towards the east of the narthex is the baptistery room, while to the west stands the tower crowned with a striking spire. Within the central nave, wooden seating benches are being complemented by chandeliers and fans suspended from the wooden truss above. The first two larger transepts are seamlessly merging with the nave, while the remaining two smaller transepts are each being equipped with separate entrances. Progressing from the nave lies the inner chancel, featuring a raised marble dais within the pyramidal apse.

The use of rough-hewn stone facade contributes to the overall Gothic aesthetic. The windows and doorways are prominently featuring pointed arches, a hallmark of Gothic architecture, providing an elegant and vertical emphasis to the structure. The church is having a pitched roof with slate tiles laid above wooden trusses, a common feature in Gothic Revival buildings. It is said that these slate tiles were sourced from Bandor. The church is including various decorative elements such as lancet windows, finials, and tracery, which are integral to the Gothic Revival style. The stone spire rising from the church's roof is a classic Gothic feature. The spire is topped with a vane, emphasizing the religious importance of the building. The exterior is featuring clasping buttresses that provide structural support to the walls. Four pinnacles are found around the spire, masking the abrupt transition from the square tower to the polygonal spire. Another four pinnacles are placed on the four corners of the pyramidal roof of the apse. Along the roof line, gargoyle-styled spouts are projecting outwards, designed to divert rainwater away from the building's walls, thereby preventing water damage and erosion of the masonry.

The interior ceiling structure is showcasing exposed hammer beam wooden trusses, providing both support and decoration, and contributing to the church's grandeur. These trusses are painted dark, creating a striking contrast with the lighter tones of the walls and ceiling, and emphasizing the architectural framework. Below the slate tile roof lies the original wooden false ceiling, further enhancing the historical authenticity of the design. Gothic Revival ornamentation is evident throughout the church in the detailing around the arches, windows, and columns. This includes floral patterns, religious symbols, and other intricate designs that add depth and character to the church interior. Particularly notable are the stained glass windows above the altar, which depict various religious scenes.



Fig. 11 - Stone facade of the Church having pitched roof with slate tiles and stone spire
Source -St. Mary's Church Trust



Fig. 12 - Clasp buttress made of red sandstone on the exterior facade



Fig. 14- The wooden hammer beam truss above the nave



Fig. 13 - Gargoyle styled rainwater spouts

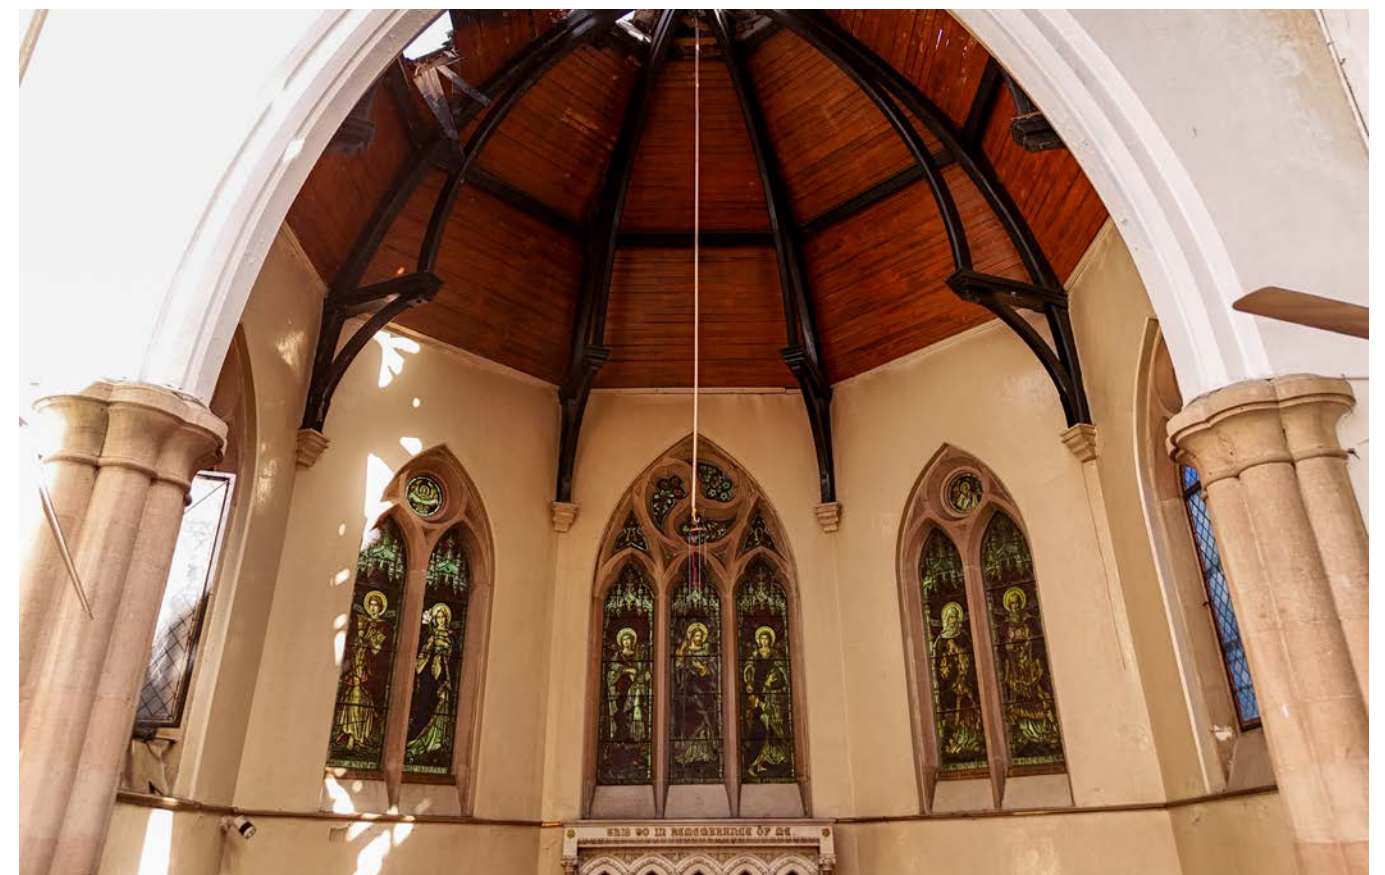


Fig. 15 - Stained glass window above the altar
Source -St. Mary's Church Trust

3. SUMMARY OF OBSERVATIONS AND RECOMMENDATIONS

Overall, the structure is in fair condition. Over the years maintenance repairs have been done to the structure by the Church Trust. Due to the fire incident caused on 13th April 2024 during waterproofing of the roof, the structure needs immediate attention.

3.1. DAMAGE DUE TO FIRE INCIDENT

The fire has caused extensive damage to the Church, with over 50% of the roof destroyed. Three out of four timber trusses are completely lost, and the collapse of the roof has severely damaged the items below, including historic furnitures, electrical fixtures and fittings. the fallen roof has shattered all the historic materials it contained, making them irreparable and unsuitable for reuse. Additionally, the fire has left deposits on the Church's interiors, including stained glass windows, compromising their historic and aesthetic value.



Fig. 16 - Drone view of site before fire incident
Source -St. Mary's Church Trust



Fig. 17 - Drone view of site after fire incident showing the damaged roof
Source -St. Mary's Church Trust



Fig. 18 - The wooden false ceiling before the fire incident
Source -St. Mary's Church Trust



Fig. 19 - The damaged wooden false ceiling before the fire incident
Source -St. Mary's Church Trust



Fig. 20 - Drone view of the damaged roof after fire incident
Source - St. Mary's Church Trust

The fire was detrimental to the church's overall condition. The fire have damaged the wooden trusses and beams of the roof, making the structure unstable. Signs of charred or cracked wood indicates compromised load-bearing capacity. Soot deposition is also visible on the walls and other elements. The church which is an important cultural center now stands non-functional due to the incident. The community's prayers is now being held outside the church under a temporary shed constructed as a gap area.



Fig. 21 - Before photo of the nave before the fire incident
Source -St. Mary's Church Trust



Fig. 22- After photo of the nave post the fire incident
Source -St. Mary's Church Trust



Fig. 23 - The damaged roof above the nave
Source - St. Mary's Church Trust

3.2. STRUCTURAL ISSUES

On visual inspection, cracks are only seen in the transept in the South eastern side. Some minor surface cracks can be seen on the lime plaster along with the peeling of the paint. The cracks need to be assessed in details to come up with consolidation plans. The structural members that are burnt, need scientific investigation to ensure their reuse back in the structure.

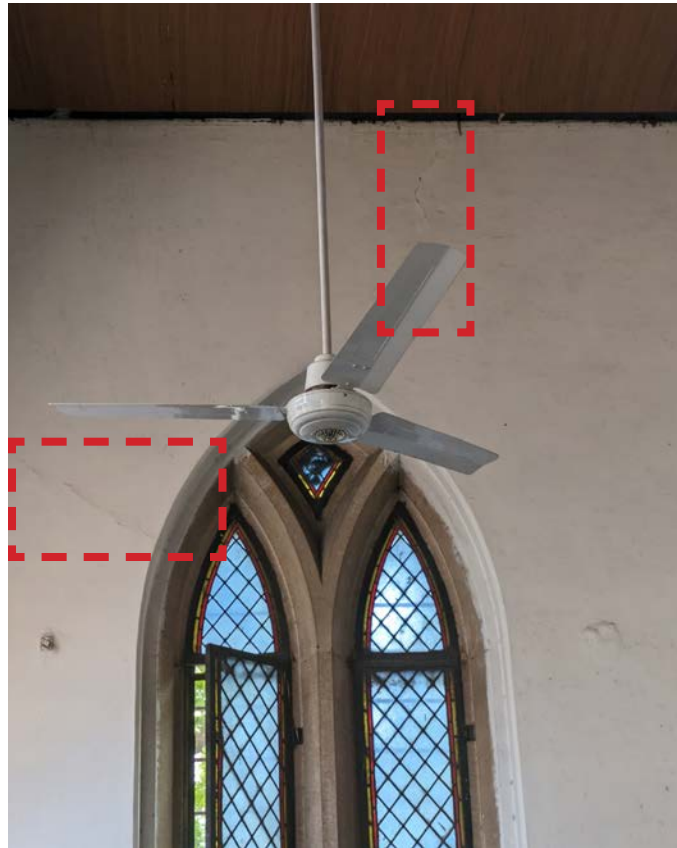


Fig. 24 - Cracks running diagonally along the wall

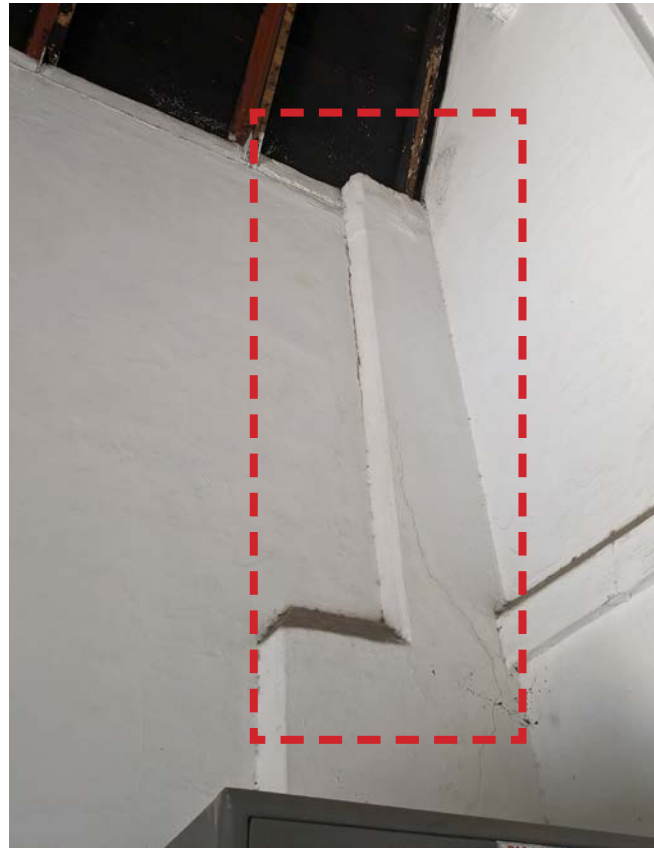


Fig. 25 - Cracks running vertically along the wall



Fig. 26 - Cracks running diagonally along the wall and the cornice

3.3. SURFACE DEPOSITS AND VEGETATION

Due to exposure to moisture and lack of maintenance, vegetation growth and blackening of stone can be seen on the exterior stone masonry at several places. These surfaces need to be treated with mild chemicals with a biological wash from preventing it to occur in future.



Fig. 27 - Deposition of algae on the stone masonry



Fig. 28 - Deposition of algae on the stone masonry

3.4. INCOMPATIBLE RENDERS

The past repair work on the exterior facade of the Church has involved ribbon re-pointing with cement, in areas where the original pointing on the stone masonry had deteriorated. This method of repair does not align with the historical character and architecture of the building since cement mortar does not allow the masonry to breathe as effectively as lime mortar, which can result in trapped moisture, leading to damp issues and possible biological growth, further compromising the structural integrity. The slate roof tiles are fixed using cement which has resulted in the loss of the historic look and methodology of the slate tile roof.



Fig. 29 - Repairs in cement mortar



Fig. 30- Slate tile roof fixed with cement

Various doors and windows have been painted over using brown emulsion paint. The application of enamel paint on wooden doors and windows is concealing the natural grain and texture of the wood, which is an essential aspect of the historical and aesthetic value of these elements. The emulsion paint is also covering the brass components and joineries, obscuring their metallic luster and intricate detailing.



Fig. 31- Brass emblem hidden below layers of paint



Fig. 32 - Painted wooden windows and brass joineries

3.5. DAMAGE TO IMMOVABLE ARTIFACTS AND ITEMS

The fire on 13th April caused the roof members to collapse, resulting in severe damage. The fallen roof sections have inflicted considerable harm to the furniture located below. The wooden benches, integral to the church's seating arrangement and historical ambiance, suffered irreversible damage due to the debris from the collapsed roof. The chandeliers and the ceiling-mounted fans, suspended from the wooden trusses, have also been damaged. The fire's intensity, coupled with the collapse of the roof, has either dislodged or destroyed them completely which need to be either repaired or replaced based on the extent of the damage. A detailed assessment is required to ascertain the degree of intervention and restoration approval. **"All the interventions should aim at minimum replacement and maximum reuse and restoration of historic fabric."**



Fig. 33 - Damaged wooden benches in the nave of the Church



Fig. 34- Debris from the roof damaging the benches and the floor



Fig. 35 - The damaged chandeliers and the ceiling mounted fans
Source -St. Mary's Church Trust

4. METHODOLOGY

4.1. RESEARCH AND DOCUMENTATION

Conservation process can only be initiated after a thorough understanding of the site in general and the building in particular. The critical analysis of the building both in terms of its tangible and intangible attributes and significance can give us a fair idea of what is required to be done for integrated conservation. This understanding can be achieved through research from both primary and secondary sources. The secondary sources can be; archival documents or reports on previous restoration work done by PWD. Books, personal journals, memoirs and other historical sources in archives or personal libraries of people and archival photographs and paintings. The primary source would be site study, which would include: Documentation: (includes measured drawing and photographic documentation). For Precinct Survey; detailed site survey has to be done locating all the structures within the complex, service lines and trees with respect to the contours.

4.2. ANALYSIS

The research and documentation work would help us in understanding its significance. It will also help in the assessment of the condition of the building. This will then enable identifying the issues. Along with the above-mentioned outputs, it is suggestive to have certain scientific investigative tests to be precise with the planned interventions.

- (a) Total station survey (TSS) for planning of site development
- (b) Structural assessment for overall stability and restoring roof including truss design
- (c) Nondestructive and Invasive Material test to ascertain the building materials and composition of the historic building materials used in the original design

4.3. STRATEGY/PLANNING AND CONSERVATION

After establishing the statement of significance and identifying the key issues related to the site a strategy has to be adopted for phasing out of the work, the aims and objectives of the proposals and ultimate goal of conservation initiative. It is pertinent to note here that repair measures in future should respect the principles of intervention in heritage structures, namely compatibility of interventions, reversibility of interventions and minimalistic nature of interventions.

4.4. DETAILED ESTIMATION

The tentative estimate will be detailed in this stage where all the areas against the items will be worked on with greater precision.

4.5. PREPARATION OF DETAILED PROJECT REPORT

Work done in all the above five stages would then be compiled together to prepare a Detailed Project Report which would act as a guideline for all conservation and development work.

5. PROPOSALS

5.1. SITE VISIT

A site visit was organized on 14th May, 2024 by INTACH officials based on which this preliminary project report and estimation for the restoration of the Church is made.



Fig. 36 - Meeting with INTACH at the site on 14th May



Fig. 37 - Meeting with INTACH at the site on 14th May

5.2. PHASING OF INTERVENTIONS

The conservation process of the project will commence with meticulous architectural documentation, complemented by a comprehensive condition assessment of the structure. The findings of these assessments will be analyzed and compiled into a detailed project report (DPR), which will include drawings and a precise estimation of the required tasks.

INTACH will be responsible for preparing the Conservation Plans, and to formalize this, a Memorandum of Understanding (MoU) will be signed between INTACH and the authorized personnel of the Church Trust. Phasing of the conservation work can be done in three phases:

1. **Immediate [to be undertaken by Church Trust]**
2. **Phase 1: Urgent**
3. **Phase 2: Necessary**

Please note: Proper propping of openings and structural members is recommended before any repair work.

Please note: Thoroughly document the condition and location of all items, both movable and immovable, before any work begins. This includes taking photographs and creating detailed inventory lists.

A. Immediate [to be undertaken by Church Trust]

With the monsoon season approaching, it is crucial to implement immediate measures to protect the church from water ingress and maintain structural stability. These actions, overseen by the church trust, should be prioritized as follows:

1. **Roof Protection:** Secure the roof using canvas (minimum 500 GSM), which should be tied and overlapped in a curtain style to provide comprehensive coverage.
2. **Structural Stabilization:** Ensure the structure is stable before applying the canvas. This involves carefully dismantling any loose building materials to prevent further damage.
3. **Artifact and Item Protection:**
 - Immovable Items:** Protect stained glass windows, marble pulpit, and other immovable artifacts with two layers of cushion bubble wrap.
 - Movable Items:** Relocate benches, electrical fixtures, and other movable items to a secure location.
4. **Rainwater Management:** Clear all rainwater pipes and ensure no parts of the roof have water logging to prevent potential damage.

B. Phase 1: Urgent

The first phase will focus on immediate repairs, including structural consolidation, roof repair, vegetation removal, and waterproofing the structure. The details of this phase are as follows:

- **Roof Repair and Waterproofing:**

1. **Scaffolding and Propping:** Erect necessary scaffolding and supports to ensure safety and stability during the roof repair process.
2. **Dismantling:** Carefully dismantle the entire roof, documenting and recording each layer to guide the restoration.
3. **Restoration and Structural Strengthening:** Reconstruct the roof based on the documented layers, including the truss. Add a waterproofing layer to enhance protection.
4. **Timber Treatment:** Treat Timber for termite and polish all timber members to restore their historic appearance and conserve their condition.
5. **Waterproofing:** Apply a layer of compatible waterproofing membrane to the restored roof to replace the historic lead-based sheeting.
6. **Rainwater Drainage:** Restore the rainwater drainage pipes using materials compatible with the historic structure.

- **Structural consolidation:**

There is visible distress in the southeast corner of the structure, indicated by displacement in the stone joints, suggesting settlement issues. A detailed assessment is necessary to determine how to prevent further damage. The following steps are to be taken:

1. **Assessment:** Conduct a thorough evaluation of the affected area to understand the extent and cause of the settlement.
2. **Stabilization:** Stitching and Grouting: Stabilize the arches by stitching and grouting any cracks or fractures.
3. **Masonry Reconstruction:** Reconstruct any loose masonry using materials that match the original composition, color, and finish to ensure compatibility.
4. **Repairing Cracks:** Stitching/Anchoring: Repair any major fractures or cracks by stitching or anchoring them with additional compatible elements for enhanced stability.

- **Careful removal of vegetation and façade cleaning**

1. **Chemical/Organic Treatment:** Carefully remove vegetation from the masonry, especially from the spire and other terrace structures, using an appropriate mixture of chemicals or organic substances.
2. **Root Removal:** Allow the roots to dry up and then gently pull them out of the masonry to ensure minimal damage.
3. **Post-Removal Procedures:** Drainage Improvement: Ensure proper drainage of water by de-clogging rainwater pipes and checking the terrace for correct grading. This will prevent water accumulation and potential damage to the structure.
4. Raking out of joints that are done by cement and are to be re-pointed by lime.
5. **Surface Deposits:** Areas showing blackening require targeted cleaning methods. Initially, a biological wash will be applied to remove stains caused by organic matter. If these stains persist, micro sand blasting may be necessary to delicately clean the affected surfaces without causing damage.
6. **Waterproofing coating:** The façade will undergo a waterproofing treatment using a coating specifically designed to be compatible with the stone material. This ensures effective water resistance and resistance towards surface deposits.

- **Other Items**

1. Minor in-situ floor repairs and cleaning of the marble stains of the ground floor are to be addressed.
2. Doors and windows painted with enamel paints will undergo a cleaning process to remove the existing paint layers. Following this, the natural finish of the doors will be restored, enhancing their original appearance and texture.
3. Lime plaster in certain areas is damaged, therefore minor spot repairs can be done.
4. Soot deposition has blackened the lime wash, a fresh coat of lime wash needs to be done.
5. Stained Glass painting restoration needs to be done on the window of entrance and at smaller sections of the aisle windows. The stain painting has hardened over time and needs to be taken out carefully and restored. Careful documentation is required to be done before starting any work on the stained glass.

C. Phase 2: Necessary

The second phase of the conservation project will prioritize surface conservation, treatment, and finishes, addressing issues such as algae deposits on terrace levels. Restoration work will extend to furniture and all immovable artifacts and items. Additionally, lost profiles of ornamental plaster and edges will be recreated during this phase.

Plinth protection around the main structure will be implemented to safeguard against water infiltration, serving as a crucial enhancement step in waterproofing.

Furthermore, this stage will incorporate the integration of electrical, fire safety, and universal design principles, enhancing the church's functionality for its intended use.

Despite the church's current state of maintenance, a Maintenance Manual will be developed to outline technical guidelines, including dos and don'ts for building care. This manual will ensure the longevity of the elements and provide the correct procedures for maintenance tasks.

Restoration of Saint Mary's Church, Ajmer : Phasing of interventions			
Interventions	Degree		
	Immediate	Urgent (P 1)	Necessary (P2)
Temporary rain protection (Canvas curtain style)	✓		
Propping unstable arches, trusses and other structural elements	✓		
Roof Repair (Dismantle and Restore including Waterproofing)		✓	
Vegetation Removal and stabilising loose masonry		✓	
Scaffolding, propping and safeguarding immovable artefacts	✓		
Doors and Windows [Paint removal, polish]		✓	
Lime plaster repair and Lime Wash		✓	
Structural Consolidation of Arches and openings		✓	
Stain Glass Restoration		✓	
Façade Restoration : Raking out of joints, micro sand blasting (selected areas) and repointing		✓	
Façade cleaning : Surface deposits, biological growth and waterproofing coating		✓	
Electrical (special lighting etc)			✓
Furniture restoration (in situ repair)			✓
Plinth Protection and site drainage			✓
Carpetting			✓
Flooring (in situ repair)			✓
Site Development (landscaping)			✓
Furnishings (seat covers, chandliers etc)			✓

5.3. PRIORITIES OF ACTION

The restoration of the Church is designed to be completed within a year, focusing first on structural integrity and then on interior and site enhancements. Phase 1 and Phase 2 cumulatively would take 12 months to finish. Firstly the enabling and preparatory work need to be finished in order to start the complex structural work. Roof repair is prioritized to protect the building from water damage. The timeline shows overlapping tasks to optimize efficiency and ensure comprehensive restoration of the historic building.

Saint Mary's Church, Ajmer : Estimated Timeline												
Interventions												
	Month 1	Month 2	Month 3	Month 4	Month 5	Month 6	Month 7	Month 8	Month 9	Month 10	Month 11	Month 12
Phase 1												
Roof Repair (Dismantle and Restore including Waterproofing)												
Vegetation Removal and stablising loose masonry												
Doors and Windows [Paint removal, polish]												
Lime plaster repair and Lime Wash												
Structural Consolidation of Arches and openings												
Stain Glass Restoration												
Façade Restoration : Raking out of joints, micro sand blasting (selected areas) and repointing												
Façade cleaning : Surface deposits, biological growth and waterproofing coating												
Phase 2												
Electrical (special lighting etc)												
Furniture restoration (in situ repair)												
Plinth Protection and site drainage												
Carpetting												
Flooring (in situ repair)												
Site Development (landscaping)												
Furnishings (seat covers, chandliers etc)												

5.4. PRELIMINARY ESTIMATE

The estimation is based on initial assessment is tentative. However, the detailed estimation will be a part of the Detailed Project Report(DPR) along with detailed documentation and condition assessment. The tentative estimation for Phase 1 is ₹ 1,76,17,431 and for Phase 2 is ₹ 1,25,34,658. The combined tentative estimation including Phase 1 and Phase 2 is ₹ 3,01,52,090 which includes 10% techno admin fees for INTACH consultancy.

Restoration of St. Mary's Church, Ajmer, Rajasthan			
ABSTRACT			
Sec.	Particulars	PHASE-I	PHASE-II
A	Enabling And Preparation work	₹ 8,77,367.20	
B	Dismantling & Removal	₹ 2,72,583.83	
C	Surface Cleaning	₹ 13,67,649.84	
D	Structural Consolidation and Repairs	₹ 1,41,652.97	
E	Flooring		₹ 37,84,417.25
F	Finishing	₹ 17,47,097.38	
G	Waterproofing	₹ 30,206.03	
H	Wood Strengthening & Repair Works	₹ 68,35,457.98	
I	Roofing	₹ 37,35,593.08	
J	Site Development including repair of ancillary structure		₹ 41,41,366.50
a	TOTAL (A+J)	₹ 1,50,07,608.31	₹ 79,25,783.75
b	Interior And Furniture Work (2%) on 'a'		₹ 4,58,667.84
c	Mechanical, Electrical and Plumbing (MEP) Work (10%) on 'a'		₹ 22,93,339.21
d	SUB TOTAL (a+b+c)	₹ 1,50,07,608.31	₹ 1,06,77,790.79
e	Contingencies (5% of SUB TOTAL) on 'd'	₹ 7,50,380.42	₹ 5,33,889.54
f	TOTAL (d+e)	₹ 1,57,57,988.73	₹ 1,12,11,680.33
g	INTACH's Techno Admin Charges 10% on 'f'	₹ 15,75,798.87	₹ 11,21,168.03
h	GST 18% on INTACH Techno Admin Charges on 'g'	₹ 2,83,643.80	₹ 2,01,810.25
	GRAND TOTAL (f+g+h)	₹ 1,76,17,431.40	₹ 1,25,34,658.61
1	Total estimated cost for Phase I	₹ 1,76,17,431.40	
2	Total estimated cost for Phase II	₹ 1,25,34,658.61	
3	TOTAL	₹ 3,01,52,090.01	
In words: Three Crore One Lacs Fifty Two Thousand and Ninety only			

LIST OF FIGURES

Fig. 1 - The front facade of the St. Mary's Church, Ajmer.....	1
Source -St. Mary's Church Trust.....	1
Fig. 2 - Archival image of Ajmer city dated 1904.....	2
Source- Ajmer Historical and Descriptive, 1904 by Har Bilas Sharda.....	2
Fig. 3 - Mention of St. Mary's church as English Church in the archival image of Ajmer city dated 1904.....	2
Source- Ajmer Historical and Descriptive, 1904 by Har Bilas Sharda.....	2
Fig. 4 - Satellite image of St. Mary's Church at a macro level showing Anasagar Lake.....	3
Source - Google Earth.....	3
Fig. 5 - Satellite image of St. Mary's Church at a meso-level showing the prominent landmarks around the site.....	4
Source - Google Earth.....	4
Fig. 6- Present site plan of the site complex.....	4
Source -St. Mary's Church Trust.....	4
Fig. 7 - The floor plan of the church.....	5
Source -St. Mary's Church Trust.....	5
Fig. 8- The front elevation of the church.....	5
Source -St. Mary's Church Trust.....	5
Fig. 9- The South-west elevation of the church.....	6
Source -St. Mary's Church Trust.....	6
Fig. 10 - Cross section of the church.....	6
Source -St. Mary's Church Trust.....	6
Fig. 11 - Stone facade of the church having pitched roof with slate tiles and stone spire.....	9
Source -St. Mary's Church Trust.....	9
Fig. 12 - Clasping buttress made of red sandstone on the exterior facade.....	10
Fig. 13 - Gargoyle styled rainwater spouts.....	10
Fig. 14- The wooden hammer beam truss above the nave.....	11
Fig. 15 - Stained glass window above the altar.....	11
Source -St. Mary's Church Trust.....	11
Fig. 16 - Drone view of site before fire incident.....	12
Source -St. Mary's Church Trust.....	12
Fig. 17 - Drone view of site after fire incident showing the damaged roof.....	12
Source -St. Mary's Church Trust.....	12
Fig. 18 - The wooden false ceiling panel before the fire incident.....	13
Source -St. Mary's Church Trust.....	13
Fig. 19 - The damaged wooden false ceiling before the fire incident.....	13
Source -St. Mary's Church Trust.....	13
Fig. 20 - Drone view of the damaged roof after fire incident.....	14
Source -St. Mary's Church Trust.....	14
Fig. 21 - Before photo of the nave before the fire incident.....	16
Source -St. Mary's Church Trust.....	16
Fig. 22- After photo of the nave post the fire incident.....	17
Source -St. Mary's Church Trust.....	17

Fig. 23 - The damaged roof above the nave.....18

Source -St. Mary’s Church Trust.....18

Fig. 24 - Cracks running diagonally along the wall.....20

Fig. 26 - Cracks running diagonally along the wall and the cornice.....20

Fig. 25 - Cracks running vertically along the wall.....20

Fig. 27 - Deposition of algae on the stone masonry.....21

Fig. 28 - Deposition of algae on the stone masonry.....21

Fig. 29 - Repairs in cement mortar.....22

Fig. 31- Brass emblem hidden below layers of paint.....22

Fig. 30- Slate tile roof fixed with cement.....22

Fig. 32 - Painted wooden windows and brass joineries.....22

Fig. 33 - Damaged wooden benches in the nave of the church.....23


Fig. 34- Debris from the roof damaging the benches and the floor.....23

Fig. 35 - The damaged chandeliers and the ceiling mounted fans.....24

Source -St. Mary’s Church Trust.....24

Fig. 36 - Meeting with INTACH at the site on 14th May.....27

Fig. 37 - Meeting with INTACH at the site on 14th May.....27

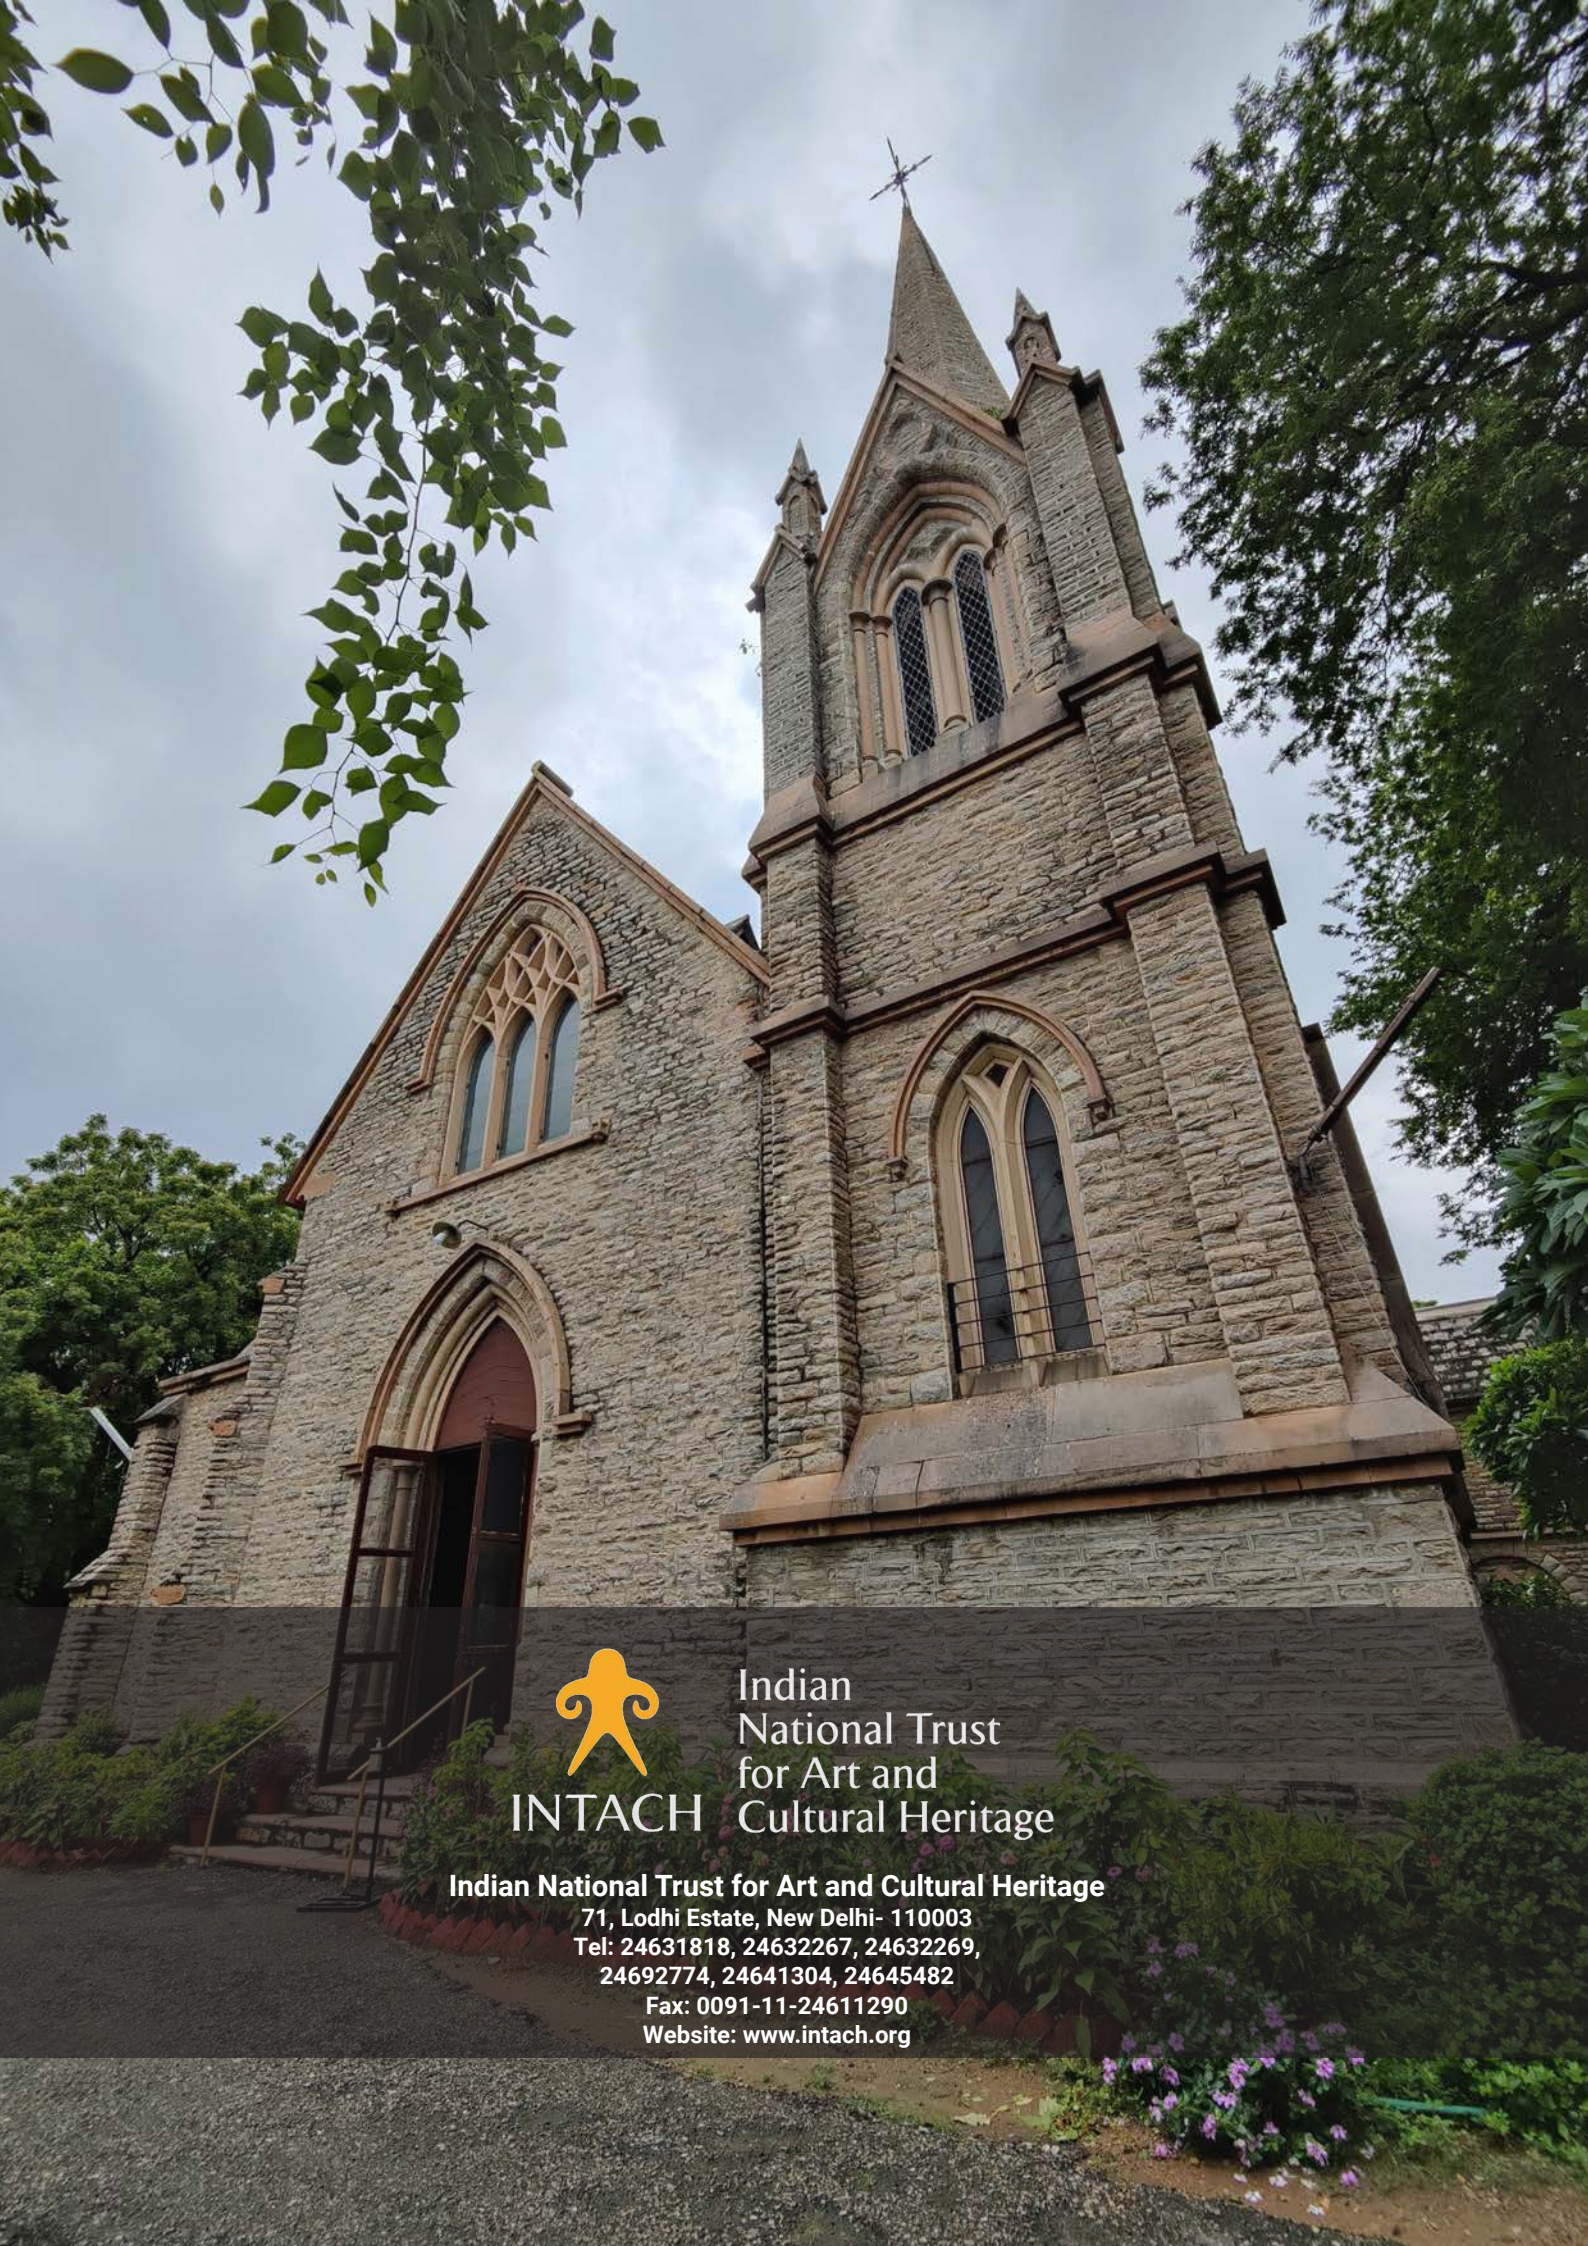

INTACH

Indian
National Trust
for Art and
Cultural Heritage

Indian National Trust for Art and Cultural Heritage

71, Lodhi Estate, New Delhi- 110003

Tel: 24631818, 24632267, 24632269,
24692774, 24641304, 24645482

Fax: 0091-11-24611290

Website: www.intach.org