



nqymby – Outlet 1

- Sustained **temperature** increase above 10K across several months.
- Loose contact inside plug, likely from cable bending or stress.
- Cable near handle torn / bent, possibly pulling conductors inward.
- Result: unstable electrical contact and localized overheating.


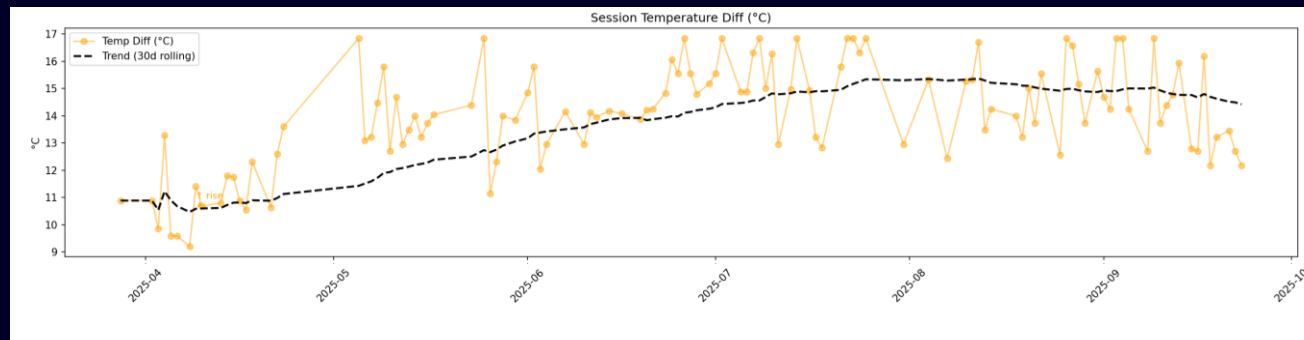


- around 2 weeks later
- Stabilized situation

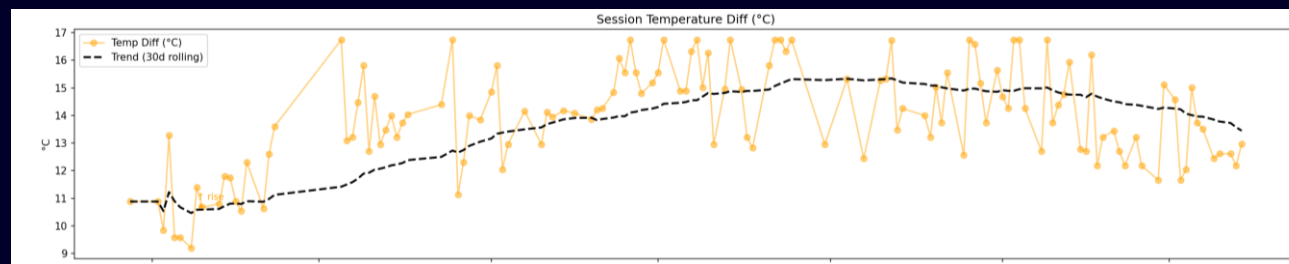


28juh – Outlet 1


- Gradual temperature rise from 2K → 7K over several months.
 - Connector heating up, poor heat transfer over time.
 - Field inspection: DC pins partly pushed back inside the housing.
 - Reduced contact area → early-stage contact degradation confirmed.
-
- around 2 weeks later
 - Stabilized situation

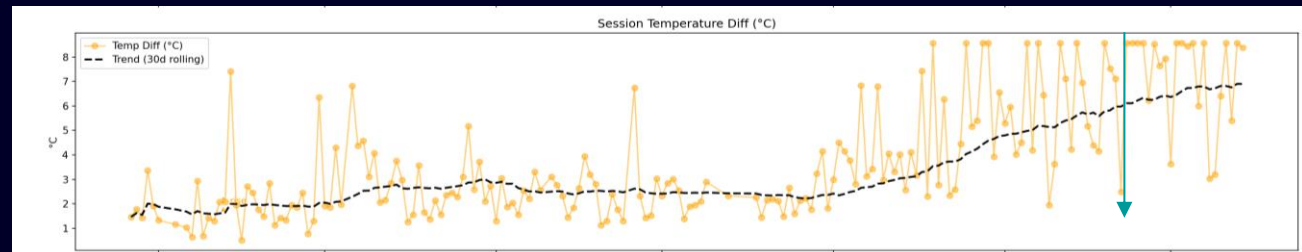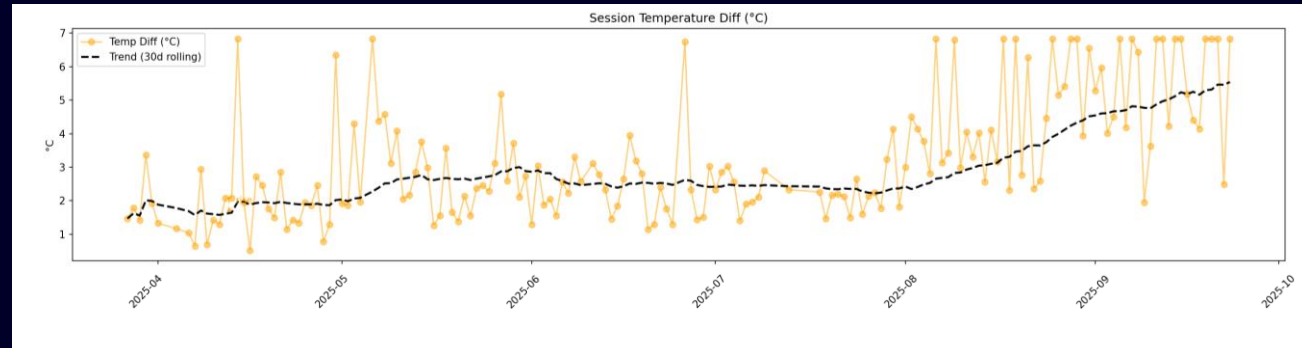


28juhb – Outlet 1

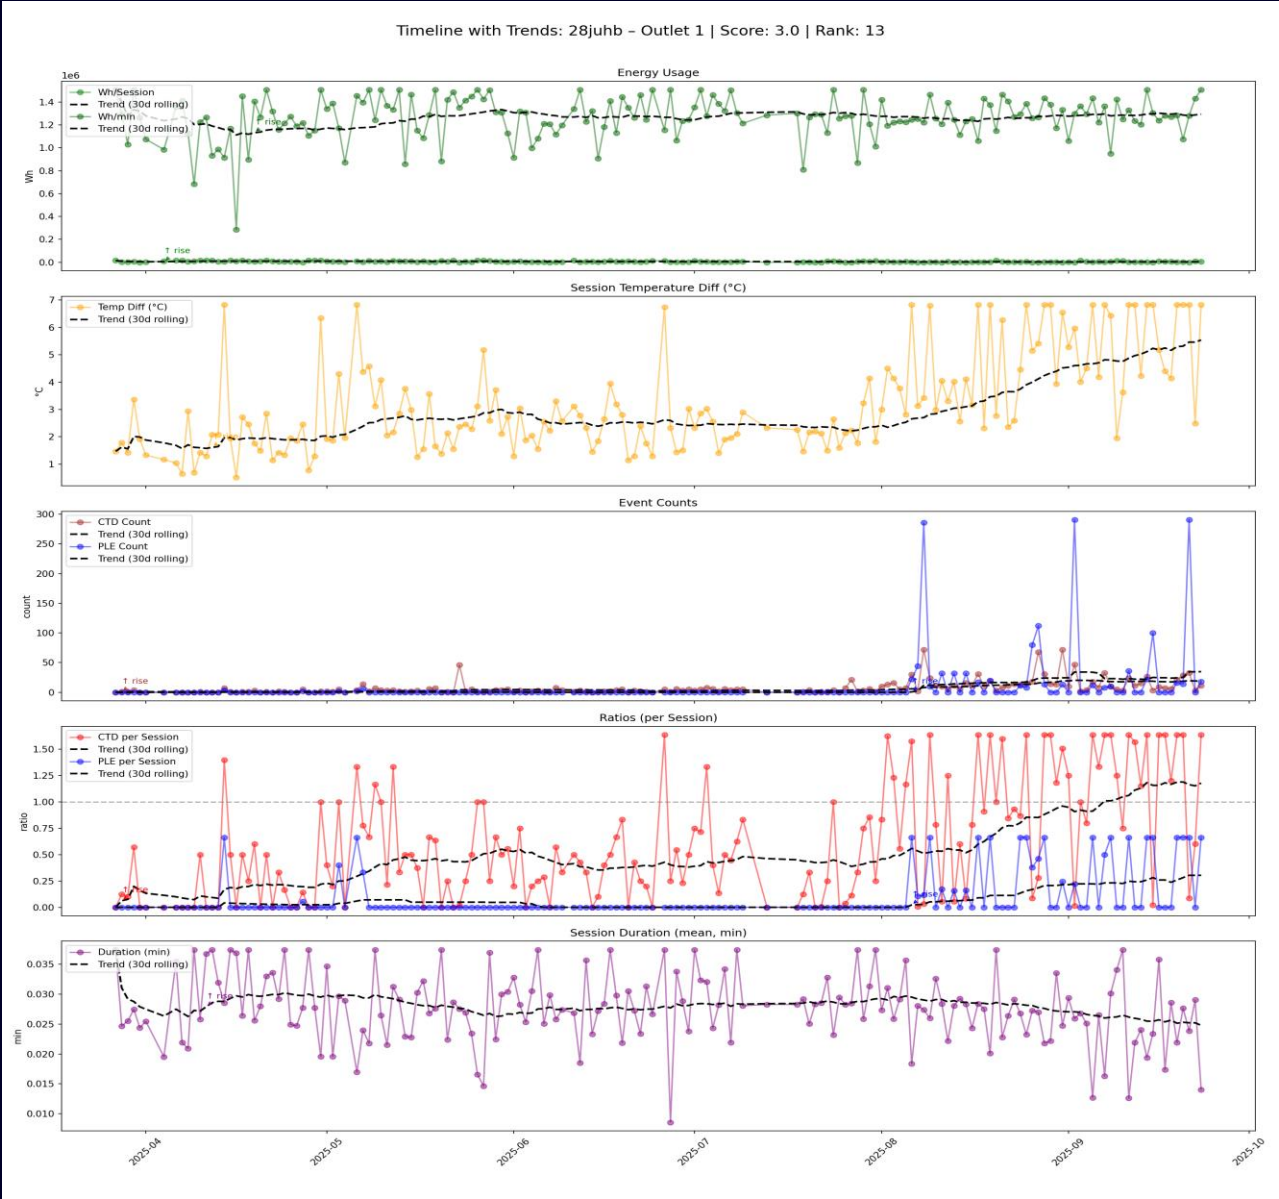

28juhb – Outlet 1- updated

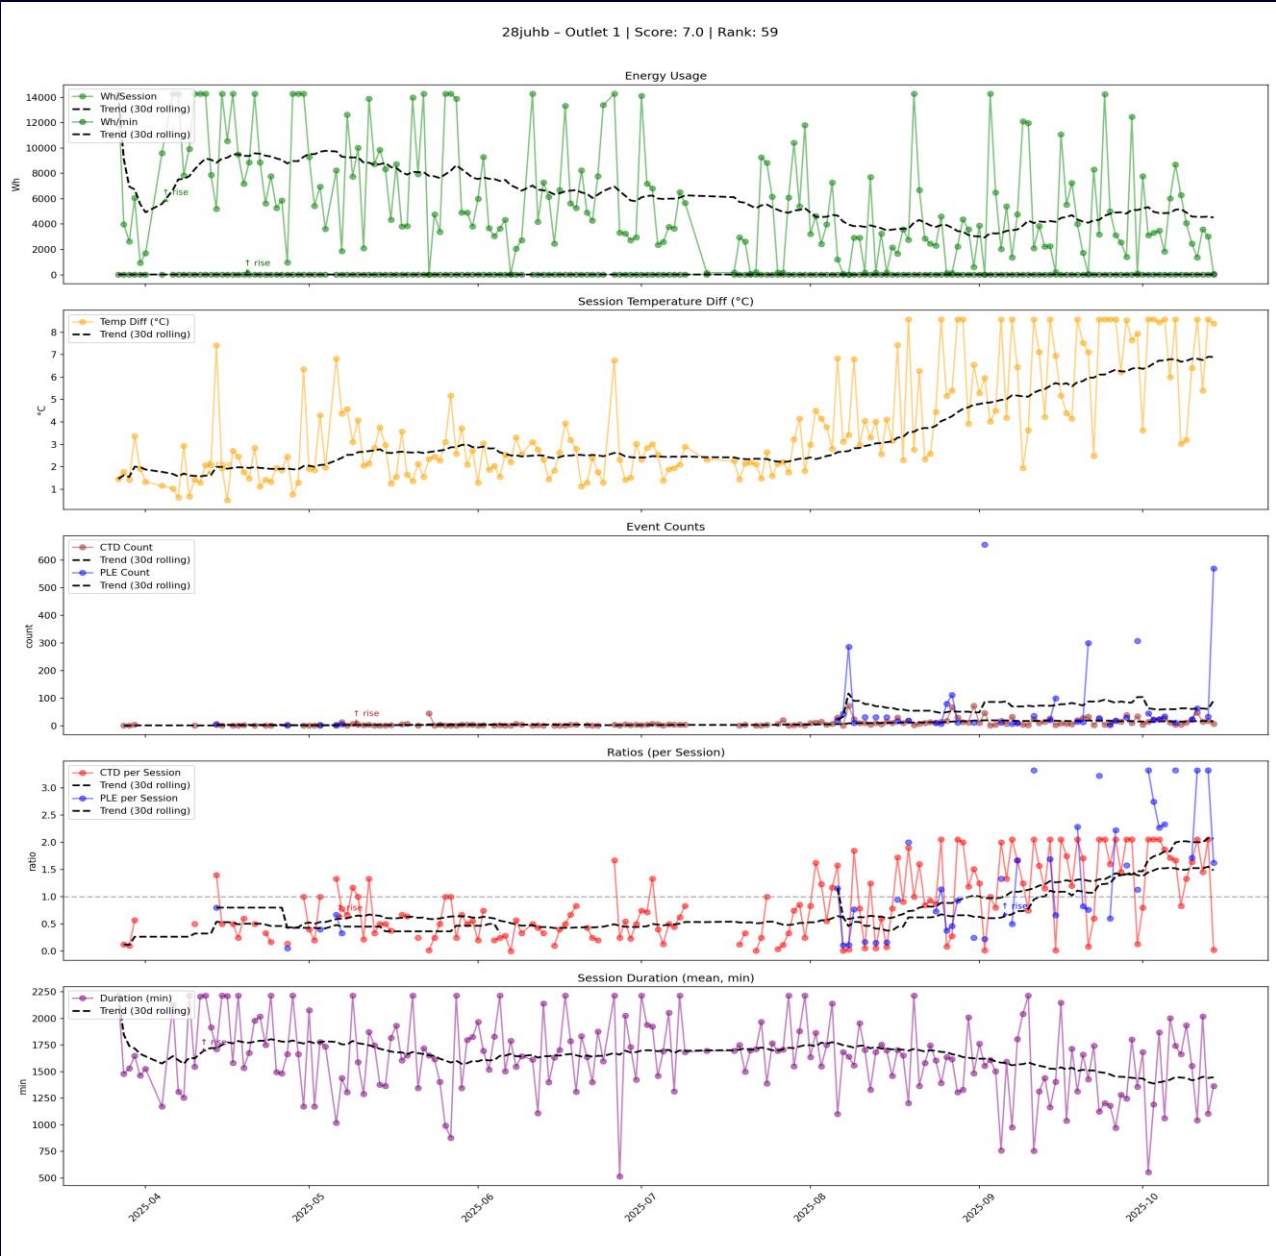

nqymby – Outlet 1

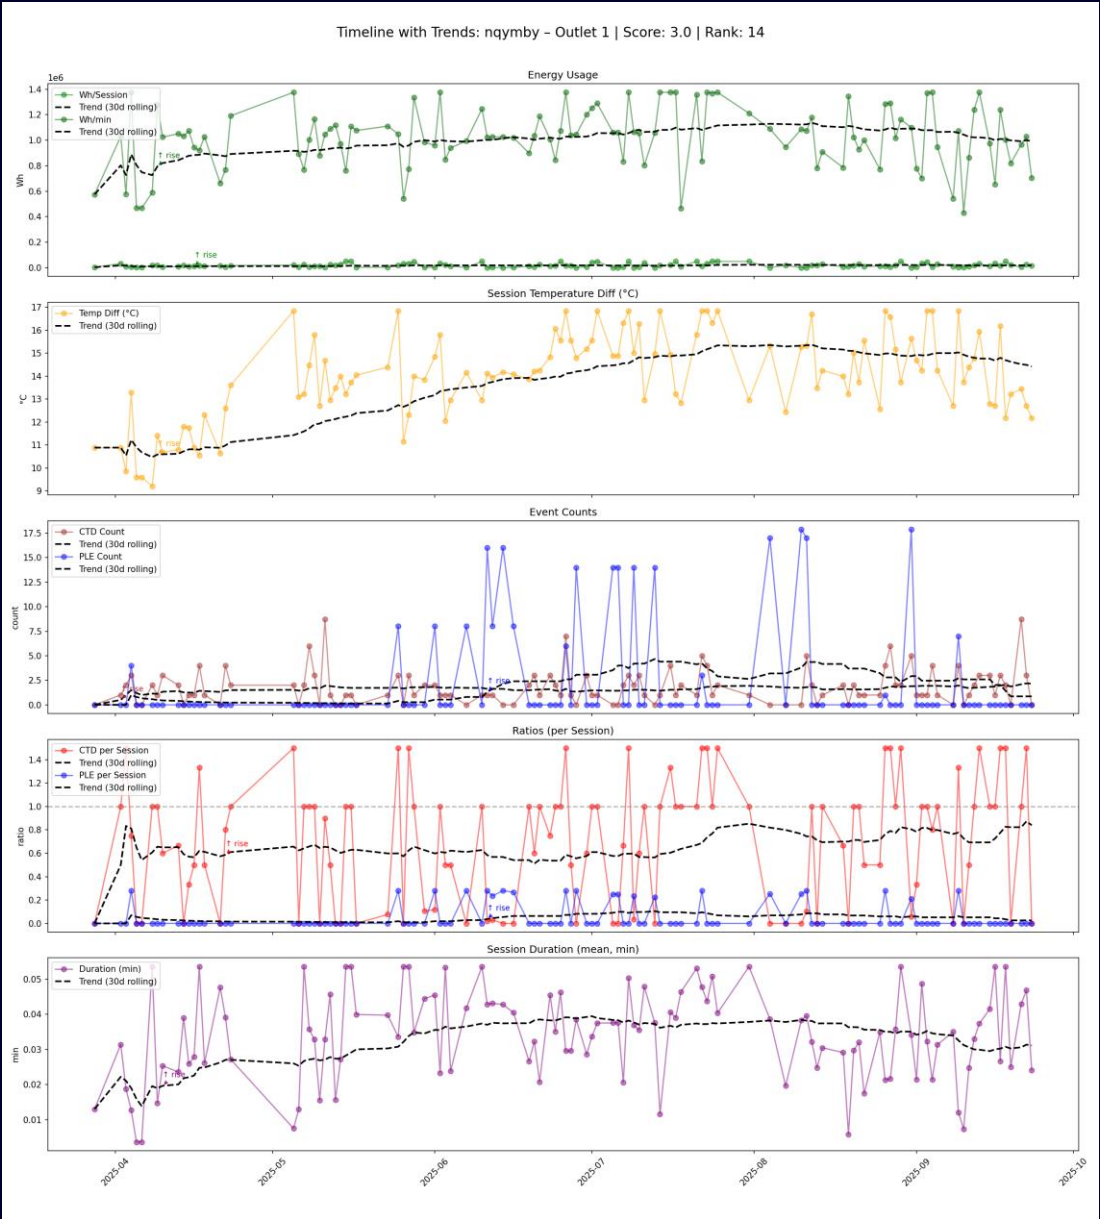

nqymby – Outlet 1 - Updated

