SERVICE BULLETIN REVISION TRANSMITTAL SHEET

AIRBUS
CUSTOMER SERVICES DIRECTORATE
1 Rond Point Maurice Bellonte
31707 BLAGNAC CEDEX
FRANCE

Tel: (33) 5 61 93 33 33 Telex: AIRBU 530526F Fax: (33) 5 61 93 42 51

ATA SYSTEM: 21

TITLE: AIR CONDITIONING - PRESSURE CONTROL AND MONITORING -

INTRODUCE MODIFIED PRESSURE CONTROLLER

MODIFICATION No.: 39674K12828

This page transmits Revision No.01 of Service Bulletin No.A320-21-1189

ADDITIONAL WORK

**CONF ALL

REASON

The Revision No. 01 issued to:

update the effectivity.

CHANGES

FRONT MATTER		
AIR CONDITIONING - PRESSURE CONTROL AND MONITORING - INTRODUCE MODIFIED PRESSURE CONTROLLER	CONFIGURATION UPDATED	R
SUMMARY		
EFFECTIVITY	OPERATOR LIST UPDATED	R
PLANNING INFORMATION		
EFFECTIVITY	EFFECTIVITY RELATED INFORMATION UPDATED	R
Configuration definition		
CONF 001	CONFIGURATION DEFINITION UPDATED	R
CONF 002	CONFIGURATION DEFINITION UPDATED	R
APPROVAL	APPROVAL UPDATED	R
REFERENCES	REFERENCED DOCUMENTATION UPDATED	R
	REFERENCED DOCUMENTATION UPDATED	R
	REFERENCED DOCUMENTATION UPDATED	R
MATERIAL INFORMATION		
MATERIAL - PRICE AND AVAILABILITY		
Procurement Addresses	PROCUREMENT ADDRESSES UPDATED	R
Price and Availability	PRICE AND AVAILABILITY UPDATED	R

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN REVISION TRANSMITTAL SHEET

INDUSTRY SUPPORT INFORMATION	INDUSTRY SUPPORT INFORMATION UPDATED	R
ACCOMPLISHMENT INSTRUCTIONS		
TASK 211189- 831-848-001-	TASK SOLUTION UPDATED	R
MODIFICATION	CAUTION UPDATED	
Subtask 211189-910-201-001	SUBTASK SOLUTION UPDATED	R
	REFERENCED DOCUMENTATION UPDATED	
Subtask 211189-839-201-001	SUBTASK SOLUTION UPDATED	R
Subtask 211189-910-201-001	SUBTASK SOLUTION UPDATED	R
	REFERENCED DOCUMENTATION UPDATED	
Subtask 211189-839-201-001	SUBTASK SOLUTION UPDATED	R
Subtask 211189-910-201-001	SUBTASK SOLUTION UPDATED	R
	REFERENCED DOCUMENTATION UPDATED	
Subtask 211189-839-201-001	SUBTASK SOLUTION UPDATED	R
Subtask 211189-941-201-001	SUBTASK SOLUTION UPDATED	R
	REFERENCED DOCUMENTATION UPDATED	
	REFERENCES UPDATED	
Subtask 211189-941-201-001	SUBTASK SOLUTION UPDATED	R
	REFERENCED DOCUMENTATION UPDATED	
	REFERENCES UPDATED	
Subtask 211189-941-201-001	SUBTASK SOLUTION UPDATED	R
	REFERENCED DOCUMENTATION UPDATED	
	REFERENCES UPDATED	
Subtask 211189-831-201-001	SUBTASK SOLUTION UPDATED	R
	REFERENCED DOCUMENTATION UPDATED	
	REFERENCES UPDATED	
Subtask 211189-831-203-001	SUBTASK SOLUTION UPDATED	R
	REFERENCED DOCUMENTATION UPDATED	
	REFERENCES UPDATED	
Subtask 211189-831-201-004	SUBTASK SOLUTION UPDATED	R
	REFERENCED DOCUMENTATION UPDATED	
	REFERENCES UPDATED	
Subtask 211189-831-203-002	SUBTASK SOLUTION UPDATED	R
	REFERENCED DOCUMENTATION UPDATED	
0.1.1.0.1.1.00.001.005	REFERENCES UPDATED	
Subtask 211189-831-201-005	SUBTASK SOLUTION UPDATED	R
	REFERENCED DOCUMENTATION UPDATED	
0 51-1 044400 004 000 000	REFERENCES UPDATED	-
Subtask 211189-831-203-003	SUBTASK SOLUTION UPDATED REFERENCED DOCUMENTATION UPDATED	R
	REFERENCES UPDATED	
Cubtook 011100 700 001 001	SUBTASK SOLUTION UPDATED	R
Subtask 211189-700-201-001	REFERENCED DOCUMENTATION UPDATED	lu
	REFERENCES UPDATED	
Subtask 211189-700-201-001	SUBTASK SOLUTION UPDATED	R
Jubiask 211103-700-201-001	REFERENCED DOCUMENTATION UPDATED	'`
	REFERENCES UPDATED	
Subtask 211189-700-201-001	SUBTASK SOLUTION UPDATED	R
Sustasit 211103 700-201-001	REFERENCED DOCUMENTATION UPDATED	''
	REFERENCES UPDATED	

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN REVISION TRANSMITTAL SHEET

FILLING INSTRUCTIONS

This Service Bulletin has been generated electronically and is reissued as a complete document. Replace the complete document.

Put this Revision Transmittal Sheet in front of the Service Bulletin.

HISTORY OF PREVIOUS REVISIONS

No previous revision

REVISION SEQUENCE

ORIGINAL: May 25/10

REVISION No.: 01 - Mar 27/13

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN REVISION TRANSMITTAL SHEET

This Page Intentionally Left Blank

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN SUMMARY

AIRBUS
CUSTOMER SERVICES DIRECTORATE
1 Rond Point Maurice Bellonte
31707 BLAGNAC CEDEX
FRANCE

Tel: (33) 5 61 93 33 33 Telex: AIRBU 530526F Fax: (33) 5 61 93 42 51

This summary is for information only and is not approved for modification of the aircraft.

ATA SYSTEM: 21

TITLE: AIR CONDITIONING - PRESSURE CONTROL AND MONITORING -

INTRODUCE MODIFIED PRESSURE CONTROLLER

**CONF ALL

MODIFICATIONS

MODIFICATION CLASSIFICATION					
MAJOR	None				
MINOR	39674K12828				

NOTE:

As per EASA IR 21, a minor change is one that has no appreciable effect on the mass, balance, structural strength, reliability, operational characteristics affecting the airworthiness of the product. All other changes are major changes.

REASON/DESCRIPTION/OPERATIONAL CONSEQUENCES

Some operators have reported that sometimes the pressure port protective caps, used during storage and shipment, have not been removed after installation of the Cabin Pressure Controller (CPC), 11HL and 12HL, in the aircraft. If the protective caps are not removed from the pressure transducer and the back-up sensor the correct operation of the CPC is impeded. Also for the identification of the CPC in the aircraft and to change FC43 from class 3 to class 1, a software update is required.

This Service Bulletin is published to advise all operators of the issue of the NORD-MICRO Service Bulletin No. 20791-21-002 (20791-21-003 and 15702-21-007 as necessary). The Vendor Service Bulletin (VSB) details the replacement of the pressure port protective caps with a new design of pressure port protection, and the software upgrade.

The accomplishment of this Service Bulletin will make sure that the specific maintenance mishandling of the pressure port protective caps is avoided.

GENERAL EVALUATION

EVALUATION TABLE						
COMPLIANCE	RECOMMENDED (1)	CANCELS INSPECTION SB	NO			
POTENTIAL AD	NO	A/C OPERATION AFFECTED	NO			
RELIABILITY AFFECTED	NO	PAX COMFORT AFFECTED	NO			
COST SAVING	NO	ETOPS AFFECTED	NO			
STRUCTURAL LIFE EXTN	NO	VENDOR SB INVOLVED	YES			
KIT PRICE (USD)	SEE SB					

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN SUMMARY

NOTE (1): Service Bulletin recommended to be accomplished to prevent significant operational

disruptions.

MATERIAL PRICE INFORMATION

**CONF 001

No Material

**CONF 002

No Material

**CONF 003

No Material

EFFECTIVITY

**CONF ALL

This Service Bulletin is applicable to this (these) operator(s):

	03X	14S	15S	15T	17S	17W	19R	26S	29S	31V	31X	35U	36V
Ī	39S	46U	47Y	52T	53Z	55T	56W	59Z	62X	66X	69X	73W	74T
Ī	78X	80X	85T	86W	86Z	87R	89T	91X	95V	95W	96S	98W	98X
Ī	99W	AAF	AAR	AAW	AAY	ABL	ABQ	ABY	ACA	ACI	ADH	ADR	AEE
Ī	AFL	AFR	AGC	AHY	AIJ	AJM	ALK	AMC	AMU	ANA	ANZ	AOL	ART
Ī	ARU	AUA	AUH	AVA	AWM	AWW	AXM	AZA	AZI	AZW	B2V	BAB	BAL
Ī	BAW	BEC	BEL	BER	BGF	BGH	BGY	BHP	BIE	BJN	BKP	BRS	BTV
_	C9G	CCA	CCM	CEB	CEF	CES	CHH	CIB	CQH	CQN	CSA	CSC	CSN
I	CSZ	CTN	CYP	D2F	DAL	DCS	DKH	DLH	DNV	DQA	DRK	EAA	EDW
Ī	EIN	ETD	ETJ	EZD	EZY	F2I	FFT	FGE	FHY	FIN	FPY	G2X	G4I
Ī	G8E	GAP	GFA	GIA	GLG	GMI	GMR	GOW	GWI	HAY	HCC	HDA	HKJ
Ī	HRM	HVN	I2L	I2T	IAC	IBE	IBS	IGO	IRA	IRM	ISS	JAV	JBU
Ī	JSA	JST	JZR	KAC	KFR	KGL	KHO	KHV	KKK	KMF	KNE	KOM	KZR
Ī	LAN	LBT	LBY	LFO	LLM	LLP	LMJ	LMU	LZB	M2I	MAU	MEA	MJN
I	MLD	MLM	MLR	MMA	MML	MON	MSC	MSR	MXA	MYX	NIA	NKS	NLV
I	NLY	NMA	NMB	NVD	NVR	NWS	OAL	OHY	ONE	ORF	OZW	PAL	PIC
I	PTR	PVJ	QAF	QTR	R1T	RAM	RBA	RBG	RFJ	RJA	RKM	RLU	RNV
I	ROT	RYW	RZO	SAA	SAI	SAS	SBI	SDM	SFJ	SFW	SGG	SGX	SHJ
Ī	SHY	SKU	SLK	SMX	SND	SNX	SOL	SUD	SVR	SVW	SWM	SWR	SYR
	TAE	TAI	TAK	TAM	TAP	TAR	TBJ	TBZ	TCW	TCX	TGW	THY	TNA
	TOM	TWJ	TXP	UAL	UDC	UEA	UKN	ULG	USA	VIM	VJC	VKG	VLE
	VLG	VLK	VOI	VRD	VRE	VVC	WAU	WGT	WHT	WRC	WTJ	WZZ	XLF

CONCURRENT REQUIREMENTS

None

REFERENCES / REPERCUSSIONS

TFU	None
OEB	None

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN SUMMARY

AOT	None
SIL	None
LINE MAINTENANCE AFFECTED	No
LIFE LIMIT	None
OTHER	None

NATURE OF THE WORK

AIRCRAFT	NO
EQUIPMENT	YES
HARD	YES
SOFT	YES
OBRM	NO

MANPOWER

**CONF 001

Task 211189-831-848-001: MODIFICATION					
TOTAL MANHOURS	1.50				
ELAPSED TIME (HOURS)	1.50				
Additional manhours related to Vendor SB; refer to:					
Modify the Cabin Pressure Controller (CPC)	NORD-MICRO Service Bulletin No. 15702-21-007				

**CONF 002

Task 211189-831-848-001: MODIFICATION					
TOTAL MANHOURS	1.50				
ELAPSED TIME (HOURS)	1.50				
Additional manhours related to Vendor SB; refer to:					
Modify the Cabin Pressure Controller (CPC)	NORD-MICRO Service Bulletin No. 20791-21-002				

**CONF 003

Task 211189-831-848-001: MODIFICATION					
TOTAL MANHOURS	1.50				
ELAPSED TIME (HOURS)	1.50				
Additional manhours related to Vendor SB; refer to:					
Modify the Cabin Pressure Controller (CPC)	NORD-MICRO Service Bulletin No. 20791-21-003				

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN SUMMARY

APPENDICES

**CONF ALL

None

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN SUMMARY

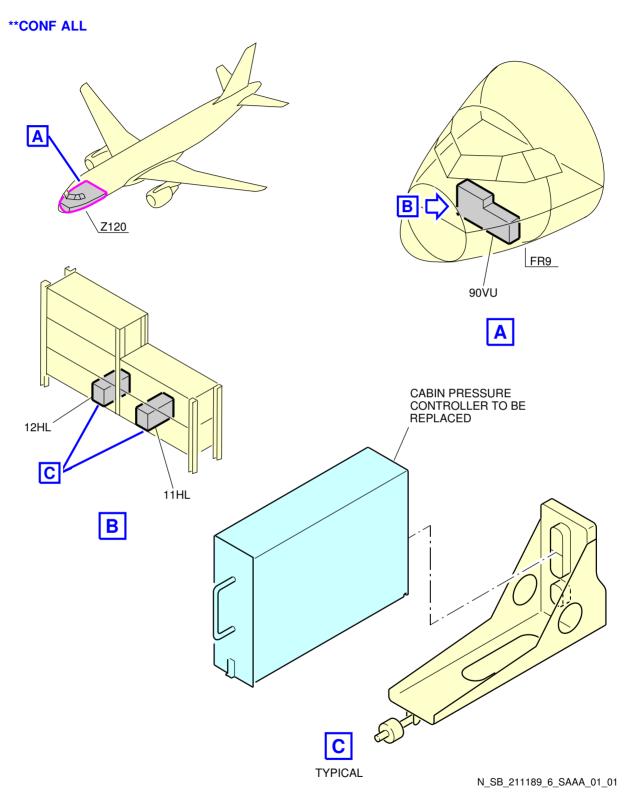


Figure A-GSAAA - Sheet 01

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN SUMMARY

This Page Intentionally Left Blank

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

AIRBUS
CUSTOMER SERVICES DIRECTORATE
1 Rond Point Maurice Bellonte
31707 BLAGNAC CEDEX
FRANCE

Tel: (33) 5 61 93 33 33 Telex: AIRBU 530526F Fax: (33) 5 61 93 42 51

ATA SYSTEM: 21

TITLE: AIR CONDITIONING - PRESSURE CONTROL AND MONITORING - INTRODUCE MODIFIED PRESSURE CONTROLLER

MODIFICATION No.: 39674K12828

This document contains AIRBUS PROPRIETARY INFORMATION and shall at all times remain the property of AIRBUS; no intellectual property right or licence is granted by AIRBUS in connection with any information contained in it. It is delivered on the express condition that said document and the information contained in it shall be treated as confidential, shall not be used for any purpose other than that for which it is hereby delivered. It shall not be disclosed in whole or in part to third parties and shall not be duplicated in any manner (except for the purposes of performing the tasks described hereunder and provided that any recipient of such document shall comply with the conditions herein), without AIRBUS prior written consent.

1. PLANNING INFORMATION

**CONF ALL

A. <u>EFFECTIVITY</u>

(1) Models

318-111	318-112	318-121	318-122	319-111	319-112	319-113	319-114
319-115	319-131	319-132	319-133	320-211	320-212	320-214	320-216
320-231	320-232	320-233	321-111	321-112	321-131	321-211	321-212
321-213	321-231	321-232					

(2) Effectivity by MSN

```
0029 0044-0059 0061 0063-0078 0080-0090 0093-0097 0099 0103-0104 0109-0127 0135-0138 0140-0150 0152-0155 0157-0162 0164-0176 0178-0179 0181-0183 0185-0187 0189-0190 0192 0194-0195 0197-0224 0227 0229-0237 0239-0246 0248-0256 0258-0270 0272-0279 0281-0285 0287 0289-0293 0295-0303 0306-0312 0314 0316-0326 0328-0335 0339-0343 0345-0351 0353-0362 0364 0366-0373 0375-0396 0398-0432 0434-0436 0438-0452 0454-0466 0468-0480 0482-0535 0537-0546 0548-0601 0603-0614 0616-0627 0629-0631 0633-0707 0709-0752 0754-0788 0790-0955 0957-1043 1045-1185 1187-1217 1219-1277 1279-1373 1375-1812 1814-1821 1823-1829 1831-1918 1920-1929 1931-1984 1986-1991 1993-2024 2026-2050 2052-2110 2112-2423 2425-2499 2501-2721 2723-3091 3093-3109 3111-3162 3164-3697 3699-3724 3726 3729 3731-3732 3734 3739 3741 3743
```

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

(3) Effectivity by Operator

The Operator/MSN relationship is provided for information only and is correct at the time of issue in accordance with the information available to AIRBUS. Any future changes resulting from transfer of an aircraft from one operator to another will not be reflected in this list unless the Service Bulletin is revised for another reason.

OPERATOR	MSN
03X	2421
14S	0283
15S	1589
15T	0764 1494 2910 3164
17S	3333
17W	3046
19R	0781
26S	0368 0424 0438
29S	0291 0292
31V	0164 0332 0420 0436
31X	2192
35U	0088
36V	0136
39S	1300 1353
46U	2906 2952 2982 3275 3296 3332 3674 3734
47Y	0394
52T	1599
53Z	1468
55T	2224
56W	0250 0335
59Z	1556
62X	3402
66X	1283 1305
69X	0219 0357 0588 0888 2214 2249 2522 2634
73W	0087
74T	2165
78X	0138 0148 0758 1048
80X	2748
85T	0234
86W	0384
86Z	0143 0466 0497 1843 2011
87R	0421
89T	3356
91X	2837
95V	3379
95W	2949
96S	1068 1145 2176
98W	0103 0109 0120
98X	0590 0601
99W	1333 3038

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

AAF	MSN
/ \/ \(\)	0244 0639 0808 0823 1006 1451 1846 2870
AAR	0802 1174 1356 1511 1636 1670 1734 2041 2045 2110 2226 2247
	2290 2397 2459 2808 2840 3244 3297 3437 3483 3496 3641
AAW	3224 3236 3615 3657
AAY	1229 1255 2319 2387
ABL	1227 1970 2943
ABQ	1467 3364 3385 3388 3403
ABY	3218 3246 3444 3476 3626
ACA	0059 0068 0073 0084 0122 0126 0127 0141 0149 0150 0154 0159
71071	0174 0175 0183 0210 0231 0232 0233 0242 0248 0253 0254 0255
	0265 0277 0284 0290 0309 0324 0330 0341 0378 0403 0404 0546
	0572 0634 0656 0670 0672 0682 0688 0691 0693 0695 0697 0711
	0719 0721 0728 0732 0736 0740 0742 0752 0757 0769 0773 0779
	0785 0800 0813 0817 0829 0831 0840 0845 1562 1577 1602 1611
	1623 1632 1638 1673 1719 1726 1742 1748 1772 1783 1811 1853
	1864 1874 1940 2018 2145
ACI	2152
ADH	3138 3161 3328 3343 3502 3515 3532 3643 3666 3695
ADR	0444
AEE	1727 2468 3033 3066 3074 3162 3365 3392 3423 3439 3462 3478
	3526 3527 3709 3714
AFL	2052 2069 2072 2091 2093 2106 2116 2133 2144 2151 2163 2179
	2222 2233 2243 2330 2337 2342 2875 2903 2912 2920 2947 2957
	2965 3052 3063 3157 3191 3267 3281 3298 3334 3336 3373 3410
	3511 3545 3574 3627 3631 3640 3644 3699 3711
AFR	0044 0061 0063 0115 0144 0145 0155 0186 0187 0214 0227 0236
	0237 0239 0270 0278 0285 0287 0377 0491 0498 0509 0521 0529
	0544 0598 0600 0608 0618 0625 0637 0777 0796 0938 0985 0998
	1000 1020 1025 1036 1133 1151 1169 1176 1190 1201 1216 1267
	1271 1299 1344 1404 1415 1444 1449 1471 1476 1502 1505 1524
	1616 1622 1640 1645 1658 1677 1691 1699 1733 1859 1873 1879
	1885 1894 1900 1924 1938 1949 2035 2059 2071 2081 2100 2109
	2140 2317 2344 2350 2456 2582 2601 2686 2705 2716 2721 2750
	2918 2938 2951 2961 2967 2972 3008 3009 3051 3098 3372 3399 3401 3419 3420 3441 3470
AGC	0190
AHY	0331 2487 2516 2588 2685 2788 2846 2853 2865 2991 3006
AlJ	0169 0707 1132 1162 1179 1244 1259 1308 1322 1747 1780 2048
	2189 2227 2539 3021 3123 3149 3160 3286 3304 3312 3374 3508 3514 3667 3690
A 1N4	
AJM	0624 0626
ALK	2345 2564 2584 2908
AMC	2113 2122 2142 2186 2291 2332 2382 2665 2768 3056 3068
	0557 0597 0620 0631 0805 0908 0928 1758 1790 1850 1893 1912
AMU	1926 1962
ANA	0167 0170 0212 0245 0300 0328 0383 0413 0482 0501 0507 0531

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

OPERATOR	MSN
AOL	0407
ART	0142 0279 0310 0311 0333 0359 0426 0533 0724
ARU	0573 0582
AUA	0552 0570 0581 0768 0776 0797 0920 0935 1137 1150 1189 1385
	1387 1458 1478 1504 1553 1678 1735 1931 1937 2009 2131 2174
	2262 2416 2494 2547 2652
AUH	2403
AVA	1612 1618 1634 2066 2328 2333 2358 2367 2377 2394 2523 2544
	2552 2575 2662 3408 3467 3518 3647 3664 3691
AWM	0765
AWW	0446 2457
AXM	1286 2612 2633 2656 2683 2699 2760 2816 2826 2842 2881 2885
	2926 2944 2956 2989 3000 3018 3064 3117 3140 3154 3173 3182
	3194 3201 3223 3232 3261 3277 3291 3299 3327 3338 3353 3370
	3394 3404 3427 3448 3477 3486 3489 3505 3521 3536 3549 3568
A 7 A	3576 3582 3610 3628 3648 3679 3701 3715 3729
AZA	0434 0477 0488 0494 0495 0513 0514 0515 0516 0524 0526 0532
	0576 0583 0586 0593 0599 0819 0848 0940 0951 0959 0999 1138 1168 1217 1220 1448 1457 1473 1480 1489 1722 1740 1745 1770
	1779 2033 2057 2074 2083 2086 2101 2127 2869 2932 3076 3079
	3080 3115 3178 3213 3295 3362 3412 3464 3482 3563 3598 3609
	3732
AZI	0527
AZW	0630 1973
B2V	0185
BAB	2700 2763
BAL	2335 3492
BAW	1014 1082 1115 1118 1142 1177 1193 1197 1222 1225 1232 1236
DAW	1239 1258 1261 1279 1295 1329 1338 1380 1384 1418 1423 1424
	1440 1445 1466 1510 1513 1529 1537 1558 1574 1590 1594 1604
	1606 1661 1665 1687 1689 1690 1696 1708 1711 1754 1760 1782
	1814 1829 1871 1883 1899 1907 1910 1958 1987 2038 2040 2098
	2188 2190 2194 2305 2320 2323 2324 2351 2363 2389 2429 2441
	2466 2536 2653 2694 2697 2720 2799 2981 3049 3081 3235 3254
	3290 3301 3314 3351 3468 3499 3512 3550 3607 3649 3697 3703
	3721 3726
BEC	3199
BEL	0644 1086 1102 1160 1336 1388 1441 1493 1797 1838 1963 2196
	2230 2392 2400 2810 3255
BER	1629 1966 1988 1994 2005 2619 3055 3093 3121 3242 3289 3516
	3708
BGF	3188
BGH	0349 1087 2844 2863 3139
BGY	2118 2645
BHP	2968 3245 3422 3604
BIE	0519 0827 0891 2707
BJN	3617
BKP	2254 2310 2417 2509 2531 2648 2660 3421 3424 3454 3694

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

OPERATOR	MSN
BRS	2263
BTV	0168 0441 0449 0460 0461 1017
C9G	0246 0425 0710 0772 1624 1676 1778
CCA	0876 0921 1296 2000 2007 2015 2172 2202 2205 2237 2269 2285
	2293 2298 2454 2499 2508 2525 2532 2545 2551 2559 2614 2643
	2805 2819 2839 2847 2890 3195 3200 3215 3221 3226 3250 3307
	3329 3337 3461 3506 3523 3601 3623 3653 3655 3665 3678 3722
CCM	0936
CEB	2556 2586 2625 2638 2786 2790 2821 2831 2852 2876 2994 3048
	3272 3433 3472 3487 3646
CEF	2801 3085
CES	0665 0754 0828 0838 0854 0883 0897 0909 0914 0925 0939 0967
	0984 0986 1005 1028 1030 1041 1070 1072 1093 1108 1285 1303
	1312 1316 1330 1345 1357 1361 1377 1386 1532 1541 1542 1551
	1601 1603 1639 1906 1911 1964 1981 2022 2034 2036 2049 2056
	2068 2155 2171 2182 2199 2212 2219 2221 2235 2239 2244 2274
	2309 2315 2437 2451 2478 2493 2498 2543 2549 2562 2591 2606
	2627 2693 2757 2825 2882 2895 3168 3170 3186 3197 3233 3247
	3249 3262 3471 3481 3559 3593 3611 3612 3613 3639 3650 3677
	3682 3692 3716
CHH	2557 2561 2581 2611 2617 2644 2733 2746 2849 2891 2985 3285
	3520 3548 3561 3578 3580 3638
CIB	0774 0809 0884 0894 0905 0957 0971 1381 1402 1416 1437 1607 1968
CQH	0978 1686 1769 1852 1920 2939 3014 3023
CQN	0696 0698 0704 0705
CSA	0674 0684 1450 2719 2758 2789 3031 3043 3060 3094 3097 3406
	3436 3452 3660
CSC	0540 0550 0551 0556 0591 0878 0902 0912 0915 0919 1007 1013
	1060 1293 1500 2313 2348 2396 2431 2510 2534 2597 2639 3114
	3116 3124 3158 3167 3196 3210 3386 3449 3583 3591 3680
CSN	0709 0712 0718 0720 0722 0849 0859 0881 0895 0900 0950 0966
	1035 1039 1057 1596 1614 1776 1788 1971 1974 1986 1995 2004
	2008 2067 2080 2200 2203 2232 2273 2354 2361 2371 2408 2426
	2435 2484 2505 2506 2511 2519 2521 2530 2541 2546 2554 2555
	2558 2574 2579 2637 2667 2680 2689 2701 2708 2713 2714 2741
	2743 2759 2767 2770 2772 2796 2809 2815 2824 2834 2855 2861
	2877 2899 2901 2915 2936 2940 2948 2950 2960 2969 2971 2986
	3020 3067 3075 3112 3144 3217 3241 3251 3258 3269 3311 3342
	3459 3493 3507 3552 3566 3587 3645 3681
CSZ	2672 2684 2841 2905 2909 2935 2973 2980 3131 3132 3153 3206
	3366 3383 3435 3440 3456 3528 3599 3696
CTN	0258 0767 0833 1009 1029 1237 1252
CYP	0256 1729 1768 2108 2275 2334 2343 2359 2383 2718 2730 2793
D2F	0243 0251 0326 0411 0478 0949

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

OPERATOR	MSN
DAL	0118 0121 0125 0152 0153 0160 0171 0192 0197 0206 0208 0213
	0262 0263 0272 0273 0281 0282 0297 0298 0306 0307 0318 0319
	0329 0339 0340 0355 0358 0360 0367 0372 0380 0381 0387 0388
	0399 0408 0410 0417 0418 0766 0778 0786 0801 0807 0818 0830
	0832 0846 0903 0907 0911 0923 0962 0964 0981 0988 0996 1011
	1037 1058 1062 1191 1230 1249 1324 1325 1346 1392 1414 1434
	1453 1456 1483 1498 1501 1520 1535 1543 1549 1567 1570 1582
	1633 1641 1646 1659 1662 1683 1685 1693 1709 1714 1738 1746
	1752 1766 1774 1789 1796 1800 1810 1812 1815 1820 1824 1828
	1833 1839 1875 1897 1923 1959 1976 1982 1990 2002 2013 2026
	2039 2047 2082 2087 2092 2095
DCS	1053 3243 3513 3632
DKH	2975 3027 3234 3268 3368 3485 3596 3605
DLH	0069 0070 0071 0072 0078 0083 0086 0093 0094 0104 0110 0111
	0116 0117 0135 0137 0147 0161 0162 0172 0200 0201 0202 0209
	0216 0217 0218 0267 0268 0269 0346 0382 0401 0412 0458 0468
	0473 0474 0484 0493 0502 0505 0518 0560 0563 0564 0567 0595
	0609 0610 0616 0623 0627 0636 0641 0646 0651 0652 0654 0679
	0689 0692 0694 0699 0700 0717 0723 0729 0738 0744 0794 0853
	0860 0875 0887 0901 1016 1080 1161 1172 1188 1214 1260 1273
	1337 1365 1367 3265 3339 3360 3387 3434 3592 3625
DNV	1630 1805 1808 3065
DQA	2347
DRK	2306 2346
EAA	0386 0445
EDW	0942 0947 1026 2024
EIN	0926 1023 1094 1242 1394 1443 2191 2206 2217 2250 2256 2272
	2294 2364 2374 2399 2409 2411 2432 2486 2542 2583 2635 3054
	3129 3136 3169 3318 3345 3377 3501
ETD	0350 1944 1945 1947 1955 2167 3004 3050 3676 3693 3713
ETJ	0325 0428
EZD	0667 0743 0872 0874 1074 2137 2141 2147 2576 3621
EZY	2037 2043 2050 2053 2062 2120 2170 2181 2184 2245 2265 2271
	2289 2300 2353 2360 2370 2385 2398 2402 2412 2420 2427 2436
	2450 2463 2471 2477 2481 2492 2495 2503 2512 2514 2527 2528
	2538 2565 2578 2605 2636 2646 2677 2681 2691 2702 2709 2715
	2727 2729 2735 2742 2744 2754 2765 2769 2777 2779 2782 2795
	2803 2812 2818 2827 2829 2854 2860 2866 2873 2884 2923 2946
	2959 3003 3036 3041 3053 3059 3061 3082 3084 3088 3090 3118
	3122 3134 3137 3176 3184 3411 3413 3426 3432 3442 3466 3537
	3544 3555 3569 3571 3608 3634 3675 3683 3702 3720
F2I	0085 0204 0215 0249 0373 0391
FFT	1515 1579 1583 1615 1660 1684 1759 1781 1786 1803 1806 1841
	1860 1939 1943 1980 1991 1997 2010 2012 2017 2019 2030 2103
	2198 2209 2236 2240 2241 2253 2258 2260 2287 2318 2325 2406
	2448 2483 2518 2751 2806 2836 2857 3389 3431
FGE	1429 1439
FHY	0580 0771 0855 2524 2804

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

OPERATOR	MSN
FIN	0941 0961 1073 1107 1184 1185 1241 1309 1352 1364 1405 1470
	1544 1588 1712 1913 1916 1978 1989 2065 2124 2146 2154 2208
	2266
FPY	0112 0189 0342 0395
G2X	0347
G4I	1157 1795 2507
G8E	0221 0222 0348 0369 0594 1113 1464 1983 2001 2218 2276
GAP	2162 2183
GFA	1884 1901
GIA	0839 0892 1635 2598 2692 3147 3148
GLG	1866 1872 1882 1925 2078 2126
GMI	3019 3202 3407 3589
GMR	1407
GOW	3256 3306 3597 3616
GWI	1077 1084 1089 1136 1147 1155 1170 1209 1277 2607 2628 2632
	2813 2833 2976 3011 3128 3172 3193 3352 3358 3375 3500 3534
HAY	0716 2745 3533 3560
HCC	2180
HDA	0633 0756 0784 0812 0930 0993 1024 1253 1695 1721 1984 2021
	2229 2238 2428
HKJ	2706 3073
HRM	0293 0517 0535 0642
HVN	0605 0617 0619 0648 0650 2255 2261 2267 2303 2974 3005 3013
	3022 3198 3315 3355 3600
I2L	0371 0443 0542 0647 0660 0816 0877 0973 3120
I2T	1631 1682
IAC	0045 0046 0047 0048 0049 0050 0051 0056 0057 0058 0074 0075
	0080 0089 0090 0095 0096 0097 0396 0398 0416 0423 0431 0432
	0451 0469 0486 0490 0492 0499 1668 1718 2593 2624 2629 2907 3130 3146 3212 3271 3288 3300 3305 3326 3340 3344 3367 3498
	3551 3557 3573 3619 3620 3687
IBE	0173 0223 0274 0356 1021 1027 1047 1099 1119 1154 1180 1208
	1247 1262 1288 1292 1318 1347 1362 1554 1572 1655 1674 1681
	1716 1793 1809 1836 2115 2220 2225 2242 2248 2264 2270 2311
	2357 2365 2381 2391 2472 2488 2563 2599 2736 2756 2776 2843
	2889 2996 3078 3102 3179 3209 3320 3380 3443 3651
IBS	0158 0176 0207 0224 0266 0323 1059 1067 1101 1516 1530 2104
	2143 2807
IGO	3086 3159 3192 3227 3335 3357 3414 3453 3457 3497 3541 3618
IRA	0303 0312 0345 0530 0575 0857 2054
IRM	1202
ISS	0737 0749 1125 1198 1823 1896 2102
JAV	0029 2061

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

OPERATOR	MSN
JBU	1123 1156 1173 1235 1240 1257 1270 1280 1302 1327 1398 1446
	1452 1506 1528 1546 1557 1610 1650 1705 1739 1784 1785 1849
	1861 1898 1904 1915 1917 1927 1948 2006 2020 2031 2042 2063
	2075 2099 2125 2132 2136 2149 2150 2159 2160 2177 2201 2215
	2231 2246 2259 2280 2284 2286 2307 2314 2336 2352 2368 2384
	2386 2415 2447 2449 2461 2489 2491 2504 2520 2535 2577 2580 2640 2647 2671 2710 2725 2755 2781 2802 2814 2832 2848 2871
	2880 2900 2945 2970 2977 2992 3029 3039 3072 3091 3119 3150
	3190 3228 3263 3287 3348 3381 3416 3451 3479 3488 3517 3554
	3572 3622 3659 3707 3724
JSA	2156 2164 2316 2356 2395 2401 2423 2453 2604
JST	1195 1408 2169 2185 2197 2292 2299 2322 2329 2338 2455 2475
001	2515 2526 2537 2573 2587 2600 2608 2642 2651 2703 2717 2766
	2787 3474 3495 3547 3668 3717 3743
JZR	2569 2792 2822
KAC	0181 0182 0195 2046
KFR	2366 2376 2443 2621 2650 2664 2817 2856 2874 2916 2919 2922
13.11	2933 3012 3089 3105 3270 3302 3322
KGL	0663 0668 0787 0954 2029 2077
KHO	0354 0361 0376 0393 0414
KHV	2480
KKK	0604 0614 0675 0761 0968 0974 1124 1438 1503 1730 1878 1950
Tala	1953 2747 2753
KMF	0480
KNE	1886 2123 3238 3361 3396 3425 3475 3530
KOM	0409
KZR	1042 1204 2128 2828 2987 3141 3484 3519 3614
LAN	1304 1332 1351 1355 1491 1512 1526 1548 1568 1626 1854 1858
	1877 1903 2089 2096 2295 2304 2321 2572 2585 2845 2858 2864
	2872 2886 2887 2892 2894 3264 3280 3319 3330 3535 3556 3663
	3671
LBT	0301 0400 0793 0937 0970 0995 1121 1175 1597 1744 3480
LBY	0558 0561 1098 2277
LFO	0659
LLM	1054 1918 1969 1993 2413 2419 2439
LLP	0739 1411 2016
LMJ	1868
LMU	0666 0932 0943 0977 1366
LZB	2540 2596 3028 3309 3564
M2I	1715 1723
MAU	1592 1936
MEA	1956 1967 1977 2055
MJN	3723
MLD	0622 0741
MLM	2592 3363
MLR	1946 2731 3106
IVI∟I l	110-10 2701 0100

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

OPERATOR	MSN
MML	1706 1750
MON	0379 0389 0392 0864 0983 1015 1045 1081 1153 1207 1320 1370
	1428 1433 1571 1637 1707 1763 1794 1941 2105 2234 3546 3575
MSC	2937 2966 3282 3323
MSR	0165 0166 0178 0194 0198 0322 0351 0366 0680 0687 0715 0725
	2070 2073 2079 2088 2094
MXA	0252 0259 0260 0261 0275 0276 0296 0320 0321 0353
MYX	0566
NIA	3183 3219
NKS	2433 2470 2473 2476 2485 2490 2560 2567 2590 2603 2622 2673
	2679 2698 2704 2711 2723 2797 2893 2898 2929 2942 2963 2978
NII V	2983 3007 3017 3026 3165 3393 3395
NLV	1998 2157 2210 2496 2502
NLY	2529 2668 2749 2867 2902 3415 3447 3504 3661 3689
NMA	1697 1732 2676
NMB	3346 3586
NVD	0211 0299 0375 0415 0419 0528 1263
NVR	2211 2216 2410
NWS	1219 1233 1276 2927 3034
OAL	3316
OHY	0364 0385 0455 0471 0496 0543 0640 0661 0676 0792 0806 0810
ONE	0811 0835 0916 0963 1004 1008 1421 1482 1509 2571 2688
ONE	3001 3030 3062 3214 3216 3371 3390 3438 3469 3509 3585 3602 3606 3635 3642
ORF	2566
OZW	0429 1922
PAL	0706 0745 2878 2925 2954 3087 3107 3108 3187 3205 3273 3310
FAL	3455 3553 3579 3652 3731
PIC	0990 2331 2340 2670
PTR	0459 0537
PVJ	3542
QAF	0927 1335
QTR	1487 1566 1648 1656 1773 1895 1928 1957 2097 2107 2121 2138
QIII	2161 2288 2341 3071 3274 3369 3397 3636 3669
R1T	1908
RAM	2064 2076 2726 3070
RBA	2023 2032 2135 2139 2195
RBG	2764 3152
RFJ	0814
RJA	2649 2953 3428 3522 3685
RKM	2158
RLU	2442 2446
RNV	0229 0913
ROT	2931 2955 3220 3225
RYW	0569 3458
RZO	0795 2390 2425
SAA	2268 2281 2308 2326 2355 2375 2379 2418 2438 2469 2501

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

OPERATOR	MSN
SAI	1497 2027
SAS	1183 1383 1587 1619 1642 1675 1798 1807 1817 1848 2850 2883 2888 2911 2958 2990 3231 3292
SBI	1071 1078 1090 1091 1126 1129 1131 1149 1164 1167 1819 1870 2028 2279 2369 2373 2464 2474 2618 2623 2641 3446 3473 3490 3494
SDM	0427 0525 0649 1130 1488 1560 1578 1654 1657 1679 1743 1753 1761 1767 1851 1863 1876 1890 2465 2497 2879 2913 2930 2964 3044
SFJ	2620 2658 2695 3025
SFW	0671 0994
SGG	0799 0879 1390
SGX	1605
SHJ	0910
SHY	1194
SKU	0179 0406 0447 1400 1523 2119 2129 2251 2283 2378 2380 2460 2548
SLK	0899 0969 1228 1422 1561 1698 2058 2252 2517 2568 2775 3104 3570
SMX	2995
SND	1880 1999
SNX	0289
SOL	0302
SUD	3040
SVR	0140 0157 0203 0220 0735 0775 0815 0841 0991 1012 1063 1152 1199 1484 1720 1751 1777 1905 2117 2166 2175 2187 2278 2327 2349 2998 3099 3189
SVW	2921 3100 3133
SWM	0430 0476
SWR	0520 0522 0541 0545 0553 0559 0562 0574 0577 0578 0585 0596 0603 0612 0621 0635 0643 0664 0673 0681 0701 0703 0713 0727 0734 0782 0987 1018 1144 1762 1951 2134
SYR	0886 0918 1032 1076 1085 1117
TAE	0657 0934 0946 1368 1934 2084 2659
TAI	1066 1334 1598 1625 1952 2282 2301 2339 2434 2444 2553 2610 2687 2791 2862 2917 3042 3057 3103 3113 3248 3276 3378 3418 3510 3538 3577 3581
TAK	3171 3331
TAM	0334 0440 0976 1010 1092 1096 1103 1139 1143 1158 1215 1246 1251 1339 1376 1459 1486 1518 1575 1580 1591 1593 1595 1608 1613 1628 1652 1663 1672 1692 1703 1717 1757 1771 1775 1801 1802 1804 1818 1825 1826 1827 1831 1832 1835 1837 1855 1857 1888 1891 2014 2044 2372 2393 2467 2513 2602 2661 2734 2737 2783 2784 2838 2859 2896 2904 2924 3002 3032 3035 3047 3058 3111 3156 3180 3211 3222 3229 3240 3266 3278 3284 3294 3313
	3325 3391 3540 3565 3588 3594 3595 3630 3658 3662 3710

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

OPERATOR	MSN
TAP	0629 0750 0755 0763 0790 0821 0837 0870 0906 0917 0933 0945
	0960 0979 0982 1034 1100 1106 1120 1127 1165 1181 1206 1231
	1307 1399 1667 1713 1756 1765 1799 1816 2178
TAR	0119 0123 0124 0205 0370 0390 0402 0511 0869 0880 0958 0975
	1187 1479 1700 3096
TBJ	1485
TBZ	0362 0405
TCW	0653 1787 1929 1975 2362
TCX	0677 1238 1250 1942 1961 1965 2003 2060 2114
TGW	2724 2728
THY	1002 1856 1909 1996 2404 2414 2452 2609 2626 2631 2655 2738
	2739 2823 2868 2928 2934 2941 2984 2999 3010 3015 3126 3142
	3185 3207 3208 3239 3257 3259 3283 3303 3308 3341 3350 3382
	3405 3429 3525 3539 3558 3567 3603 3637 3654 3673 3688 3718
	3719
TNA	0538 0555 0606 0731 0746 0791 0822 2914
TOM	0852
TWJ	2550
TXP	0607 0611
UAL	0435 0439 0442 0450 0452 0454 0456 0457 0462 0463 0464 0465
	0470 0472 0475 0479 0483 0485 0487 0489 0500 0503 0504 0506
	0508 0510 0512 0523 0539 0568 0571 0587 0589 0592 0613 0638
	0655 0678 0683 0686 0690 0702 0748 0751 0759 0780 0783 0788
	0798 0804 0820 0824 0825 0826 0834 0836 0842 0843 0847 0850
	0851 0858 0862 0865 0867 0871 0873 0882 0893 0898 0944 0948
	0952 0955 0965 0980 0989 1001 1022 1031 1104 1105 1128 1146 1163 1192 1211 1243 1248 1266 1272 1282 1290 1291 1321 1341
	1343 1359 1363 1401 1409 1420 1426 1427 1432 1435 1460 1469
	1474 1475 1477 1495 1507 1508 1514 1522 1533 1538 1545 1555
	1559 1569 1573 1581 1584 1585 1586 1600 1609 1617 1620 1627
	1647 1649 1653 1664 1669 1671 1680 1688 1702 1728 1731 1737
	1741 1755 1821 1840 1842 1845 1847 1865
UDC	0230 0662 0733 0747
UEA	2654 2696 2762 2774 2820 2835 3024 3706
UKN	3260
ULG	0308 0314

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

OPERATOR	MSN
USA	0052 0053 0054 0055 0064 0065 0066 0067 0076 0077 0081 0082
	0099 0317 0448 0565 0584 0762 0770 0803 0844 0856 0861 0863
	0866 0868 0885 0889 0890 0896 0904 0922 0924 0929 0931 0953
	0972 0997 1003 1019 1033 1038 1040 1043 1046 1049 1050 1051
	1052 1055 1056 1061 1064 1065 1069 1075 1079 1083 1088 1095
	1097 1109 1110 1111 1112 1114 1116 1122 1134 1135 1141 1148
	1166 1178 1182 1196 1203 1205 1223 1224 1234 1245 1254 1264
	1265 1268 1269 1274 1275 1281 1284 1287 1289 1294 1297 1298
	1301 1310 1311 1313 1314 1315 1317 1319 1323 1326 1328 1331
	1340 1342 1348 1350 1354 1358 1360 1369 1371 1373 1375 1378
	1382 1389 1391 1393 1395 1397 1403 1406 1410 1412 1417 1419
	1425 1431 1436 1442 1447 1455 1462 1463 1465 1472 1481 1490
	1492 1496 1499 1517 1519 1521 1525 1527 1531 1534 1536 1539
	1547 1552 1563 1565 1576 1621 1643 1644 1651 1666 1701 1704
	2458 2482 2570 2595 2613 2615 2630 2669 2690 3584 3629 3633
	3712
VIM	2732 3125
VJC	2712 3739
VKG	1881 1887 1889 1921 1932 1954 1960 1972
VLE	1226
VLG	0146 0199 0240 0241 0264 0992 1171 1210 1221 1349 1372 1396
	1413 1430 1461 1540 1550 1694 1736 1749 1862 1914 1933 1979
	2168 2207 2223 2388 2407 2479 2589 2678 2761 2785 2794 2798
	2897 2962 2988 3083 3095 3109 3145 3151 3174 3203 3237 3293
	3321 3376 3400 3529 3700 3704
VLK	0422 0714 0730 1200 1213 1379
VOI	1140 1159 2204 2296 2657 2666 2771 2780 2979 2997 3045 3069
	3077 3175 3252 3253 3279 3317 3450 3463 3491 3524 3543 3590
	3624 3672 3705
VRD	2616 2674 2740 2773 2778 2800 2811 2830 2851 2993 3016 3037
	3101 3135 3155 3181 3204 3230 3324 3347 3349 3359 3398 3417
VDE	3445 3460 3465 3503 3656 3670 3684 3686
VRE	2213 2228
VVC	1306 1454 1564 1725 1867
WAU	3531 3741
WGT	1212
WHT	0726 1256 2440 2675
WRC	0235 0579 0645 0760 1869 2462 2682
WTJ	0548
WZZ	1834 1892 1902 2752 3127 3143 3166 3177 3354 3384 3409 3430 3562
XLF	0343
	.l

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

(4) Configuration by MSN

					MS	SN SN					CONFIGURATION
0029	0044	0045	0046	0047			0050	0051	0052	0053	001
	0055										
	0068										
0078	0080	0081	0082	0083	0084	0085	0086	0087	0088	0089	
0090	0093	0094	0095	0096	0097	0099	0103	0104	0109	0110	
0111	0112	0113	0114	0115	0116	0117	0118	0119	0120	0121	
0122	0123	0124	0125	0126	0127	0135	0136	0137	0138	0140	
0141	0142	0143	0144	0145	0146	0147	0148	0149	0150	0152	
0153	0154	0155	0157	0158	0159	0160	0161	0162	0164	0165	
0166	0167	0168	0169	0170	0171	0172	0173	0174	0175	0176	
0178	0179	0181	0182	0183	0185	0186	0187	0189	0190	0192	
0194	0195	0197	0198	0199	0200	0201	0202	0203	0204	0205	
0206	0207	0208	0209	0210	0211	0212	0213	0214	0215	0216	
0217	0218	0219	0220	0221	0222	0223	0224	0227	0229	0230	
0231	0232	0233	0234	0235	0236	0237	0239	0240	0241	0242	
0243	0244	0245	0246	0248	0249	0250	0251	0252	0253	0254	
0255	0256	0258	0259	0260	0261	0262	0263	0264	0265	0266	
0267	0268	0269	0270	0272	0273	0274	0275	0276	0277	0278	
0279	0281	0282	0283	0284	0285	0287	0289	0290	0291	0292	
0293	0295	0296	0297	0298	0299	0300	0301	0302	0303	0306	
0307	0308	0309	0310	0311	0312	0314	0316	0317	0318	0319	
0320	0321	0322	0323	0324	0325	0326	0328	0329	0330	0331	
0332	0333	0334	0335	0339	0340	0341	0342	0343	0345	0346	
0347	0348	0349	0350	0351	0353	0354	0355	0356	0357	0358	
0359	0360	0361	0362	0364	0366	0367	0368	0369	0370	0371	
0372	0373	0375	0376	0377	0378	0379	0380	0381	0382	0383	
0384	0385	0386	0387	0388	0389	0390	0391	0392	0393	0394	
0395	0396	0398	0399	0400	0401	0402	0403	0404	0405	0406	
0407	0408	0409	0410	0411	0412	0413	0414	0415	0416	0417	
0418	0419	0420	0421	0422	0423	0424	0425	0426	0427	0428	
0429	0430	0431	0432	0434	0435	0436	0438	0439	0440	0441	
0442	0443	0444	0445	0446	0447	0448	0449	0450	0451	0452	
0454	0455	0456	0457	0458	0459	0460	0461	0462	0463	0464	
0465	0466	0468	0469	0470	0471	0472	0473	0474	0475	0476	
0477	0478	0479	0480	0482	0483	0484	0485	0486	0487	0488	
0489	0490	0491	0492	0493	0494	0495	0496	0497	0498	0499	
0500	0501	0502	0503	0504	0505	0506	0507	0508	0509	0510	
0511	0512	0513	0514	0515	0516	0517	0518	0519	0520	0521	
0522	0523	0524	0525	0526	0527	0528	0529	0530	0531	0532	
0533	0534	0535	0537	0538	0539	0540	0541	0542	0543	0544	
0545	0546	0548	0549	0550	0551	0552	0553	0554	0555	0556	
	0558										
	0569										
0579	0580	0581	0582	0583	0584	0585	0586	0587	0588	0589	
	0591										
	0603										
	0614										
	0626										
	0639										

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

MSN	CONFIGURATION
0649 0650 0651 0652 0653 0654 0655 0656 0657 0658 0659	001
0660 0661 0662 0663 0664 0665 0666 0667 0668 0669 0670	
0671 0672 0673 0674 0675 0676 0677 0678 0679 0680 0681	
0682 0683 0684 0685 0686 0687 0688 0689 0690 0691 0692	
0693 0694 0695 0696 0697 0698 0699 0700 0701 0702 0703	
0704 0705 0706 0707 0709 0710 0711 0712 0713 0714 0715	
0716 0717 0718 0719 0720 0721 0722 0723 0724 0725 0726	
0727 0728 0729 0730 0731 0732 0733 0734 0735 0736 0737	
0738 0739 0740 0741 0742 0743 0744 0745 0746 0747 0748	
0749 0750 0751 0752 0754 0755 0756 0757 0758 0759 0760	
0761 0762 0763 0764 0765 0766 0767 0768 0769 0770 0771	
0772 0773 0774 0775 0776 0777 0778 0779 0780 0781 0782	
0783 0784 0785 0786 0787 0788 0790 0791 0792 0793 0794	
0795 0796 0797 0798 0799 0800 0801 0802 0803 0804 0805	
0806 0807 0808 0809 0810 0811 0812 0813 0814 0815 0816	
0817 0818 0819 0820 0821 0822 0823 0824 0825 0826 0827	
0828 0829 0830 0831 0832 0833 0834 0835 0836 0837 0838	
0839 0840 0841 0842 0843 0844 0845 0846 0847 0848 0849	
0850 0851 0852 0853 0854 0855 0856 0857 0858 0859 0860	
0861 0862 0863 0864 0865 0866 0867 0868 0869 0870 0871	
0872 0873 0874 0875 0876 0877 0878 0879 0880 0881 0882	
0883 0884 0885 0886 0887 0888 0889 0890 0891 0892 0893	
0894 0895 0896 0897 0898 0899 0900 0901 0902 0903 0904	
0905 0906 0907 0908 0909 0911 0912 0913 0914 0915 0916	
0917 0918 0919 0920 0921 0922 0923 0924 0925 0926 0927	
0928 0929 0930 0931 0932 0933 0934 0935 0936 0937 0938	
0939 0940 0942 0943 0944 0945 0946 0947 0948 0949 0950	
0951 0952 0953 0954 0955 0957 0958 0959 0960 0962 0963	
0964 0965 0966 0967 0968 0969 0970 0971 0972 0973 0974	
0975 0976 0977 0978 0979 0980 0981 0982 0983 0984 0985	
0986 0987 0988 0989 0990 0991 0992 0993 0994 0995 0996	
0997 0998 0999 1000 1001 1003 1004 1005 1006 1007 1008	
1009 1010 1011 1012 1013 1014 1015 1016 1017 1018 1019	
1020 1021 1022 1023 1024 1025 1026 1027 1028 1029 1030	
1031 1032 1033 1034 1035 1036 1037 1038 1039 1040 1041	
1042 1043 1045 1046 1047 1048 1049 1050 1051 1052 1054	
1055 1056 1057 1058 1059 1060 1061 1062 1063 1064 1065	
1066 1067 1068 1069 1070 1071 1072 1074 1075 1076 1077	
1078 1079 1080 1081 1082 1083 1084 1085 1086 1087 1088	
1089 1090 1091 1092 1093 1094 1095 1096 1097 1098 1099	
1100 1101 1102 1103 1104 1105 1106 1108 1109 1110 1111	
1112 1113 1114 1115 1116 1117 1118 1119 1120 1121 1122	
1123 1124 1125 1126 1127 1128 1129 1130 1131 1132 1133	
1134 1135 1136 1137 1138 1139 1140 1141 1142 1143 1144	
1145 1146 1147 1148 1149 1150 1151 1152 1153 1154 1155	
1156 1158 1159 1160 1161 1162 1163 1164 1165 1166 1167	
1168 1169 1170 1171 1172 1173 1174 1175 1176 1177 1178	
1179 1180 1181 1182 1183	

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

MON	CONFIGURATION
MSN	CONFIGURATION
0910 1002 1053 1157 1185 1187 1188 1189 1190 1191 1192	002
1193 1194 1195 1196 1197 1198 1199 1200 1201 1202 1203	
1204 1205 1206 1207 1208 1209 1210 1211 1212 1213 1214	
1215 1216 1217 1219 1220 1221 1222 1223 1224 1225 1226	
1227 1228 1229 1230 1231 1232 1233 1234 1235 1236 1237	
1238 1239 1240 1241 1242 1243 1244 1245 1246 1247 1248	
1249 1250 1251 1252 1253 1254 1255 1256 1257 1258 1259	
1260 1261 1262 1263 1264 1265 1266 1267 1268 1269 1270	
1271 1272 1273 1274 1275 1276 1277 1279 1280 1281 1282	
1283 1284 1285 1286 1287 1288 1289 1290 1291 1292 1293	
1294 1295 1296 1297 1298 1299 1300 1301 1302 1303 1304	
1305 1306 1307 1308 1309 1310 1311 1312 1313 1314 1315	
1316 1317 1318 1319 1320 1321 1322 1323 1324 1325 1326	
1327 1328 1329 1330 1331 1332 1333 1334 1335 1336 1337	
1338 1339 1340 1341 1342 1343 1344 1345 1346 1347 1348	
1349 1350 1351 1352 1353 1354 1355 1356 1357 1358 1359	
1360 1361 1362 1363 1364 1365 1366 1367 1368 1369 1370	
1371 1372 1373 1375 1376 1377 1378 1379 1380 1381 1382	
1383 1384 1385 1386 1387 1388 1389 1390 1391 1392 1393	
1394 1395 1396 1397 1398 1399 1400 1401 1402 1403 1404	
1405 1406 1407 1408 1409 1410 1411 1412 1413 1414 1415	
1416 1417 1418 1419 1420 1421 1422 1423 1424 1425 1426	
1427 1428 1429 1430 1431 1432 1433 1434 1435 1436 1437	
1438 1439 1440 1441 1442 1443 1444 1445 1446 1447 1448	
1449 1450 1451 1452 1453 1454 1455 1456 1457 1458 1459	
1460 1461 1462 1463 1464 1465 1466 1467 1468 1469 1470	
1471 1472 1473 1474 1475 1476 1477 1478 1479 1480 1481	
1482 1483 1484 1485 1486 1487 1488 1489 1490 1491 1492	
1504 1505 1506 1507 1508 1509 1510 1511 1512 1513 1514	
1515 1516 1517 1518 1519 1520 1521 1522 1523 1524 1525	
1526 1527 1528 1529 1530 1531 1532 1533 1534 1535 1536	
1537 1538 1539 1540 1541 1542 1543 1544 1545 1546 1547	
1548 1549 1550 1551 1552 1553 1554 1555 1556 1557 1558	
1559 1560 1561 1562 1563 1564 1565 1566 1567 1568 1569	
1570 1571 1572 1573 1574 1575 1576 1577 1578 1579 1580	
1581 1582 1583 1584 1585 1586 1587 1588 1589 1590 1591	
1592 1593 1594 1595 1596 1597 1598 1599 1600 1601 1602	
1603 1604 1605 1606 1607 1608 1609 1610 1611 1612 1613	
1614 1615 1616 1617 1618 1619 1620 1621 1622 1623 1624	
1625 1626 1627 1628 1629 1630 1631 1632 1633 1634 1635	
1636 1637 1638 1639 1640 1641 1642 1643 1644 1645 1646	
1647 1648 1649 1650 1651 1652 1653 1654 1655 1656 1657	
1658 1659 1660 1661 1662 1663 1664 1665 1666 1667 1668	
1669 1670 1671 1672 1673 1674 1675 1676 1677 1678 1679	
1680 1681 1682 1683 1684 1685 1686 1687 1688 1689 1690	
1691 1692 1693 1694 1695 1696 1697 1698 1699 1700 1701	
1702 1703 1704 1705 1706 1707 1708 1709 1710 1711 1712	
1713 1714 1715 1716 1717 1718 1719 1720 1721 1722 1723	
1724 1725 1726 1727 1728 1729 1730 1731 1732 1733 1734	
1735 1736 1737 1738 1739 1740 1741 1742 1743 1744 1745	

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

	MSN	CONFIGURATION
Ī		002
•	1757 1758 1759 1760 1761 1762 1763 1764 1765 1766 1767	
	1768 1769 1770 1771 1772 1773 1774 1775 1776 1777 1778	
	1779 1780 1781 1782 1783 1784 1785 1786 1787 1788 1789	
	1790 1791 1792 1793 1794 1795 1796 1797 1798 1799 1800	
	1801 1802 1803 1804 1805 1806 1807 1808 1809 1810 1811	
	1812 1814 1815 1816 1817 1818 1819 1820 1821 1823 1824	
	1825 1826 1827 1828 1829 1831 1832 1833 1834 1835 1836	
	1837 1838 1839 1840 1841 1842 1843 1844 1845 1846 1847	
	1848 1849 1850 1851 1852 1853 1854 1855 1856 1857 1858	
	1859 1860 1861 1862 1863 1864 1865 1866 1867 1868 1869	
	1870 1871 1872 1873 1874 1875 1876 1877 1878 1879 1880	
	1881 1882 1883 1884 1885 1886 1887 1888 1889 1890 1891	
	1892 1893 1894 1895 1896 1897 1898 1899 1900 1901 1902	
	1903 1904 1905 1906 1907 1908 1909 1910 1911 1912 1913	
	1914 1915 1916 1917 1918 1920 1921 1922 1923 1924 1925	
	1926 1927 1928 1929 1931 1932 1933 1934 1935 1936 1937	
	1938 1939 1940 1941 1942 1943 1944 1945 1946 1947 1948	
	1949 1950 1951 1952 1953 1954 1955 1956 1957 1958 1959	
	1960 1961 1962 1963 1964 1965 1966 1967 1968 1969 1970	
	1971 1972 1973 1974 1975 1976 1977 1978 1979 1980 1981	
	1982 1983 1984 1986 1987 1988 1989 1990 1991 1993 1994	
	1995 1996 1997 1998 1999 2000 2001 2002 2003 2004 2005	
	2006 2007 2008 2009 2010 2011 2012 2013 2014 2015 2016	
	2017 2018 2019 2020 2021 2022 2023 2024 2026 2027 2028	
	2029 2030 2031 2032 2033 2034 2035 2036 2037 2038 2039	
	2040 2041 2042 2043 2044 2045 2046 2047 2048 2049 2050	
	2052 2053 2054 2055 2056 2057 2058 2059 2060 2061 2062	
	2063 2064 2065 2066 2067 2068 2069 2070 2071 2072 2073	
	2074 2075 2076 2077 2078 2079 2080 2081 2082 2083 2084	
_	2085 2086 2087 2088 2089 2090 2091 2092 2093 2094 2095	
Ţ	2096 2097 2098 2099 2100 2101 2102 2103 2104 2105 2106	
	2107 2108 2109 2110 2112 2113 2114 2115 2116 2117 2118	
	2119 2120 2121 2122 2123 2124 2125 2126 2127 2128 2129	
	2130 2131 2132 2133 2134 2135 2136 2137 2138 2139 2140	
	2141 2142 2143 2144 2145 2146 2147 2148 2149 2150 2151	
	2152 2153 2154 2155 2156 2157 2158 2159 2160 2161 2162	
	2163 2164 2165 2166 2167 2168 2169 2170 2171 2172 2173 2174 2175 2176 2177 2178 2179 2180 2181 2182 2183 2184	
	2185 2186 2187 2188 2189 2190 2191 2192 2193 2194 2195	
	2196 2197 2198 2199 2200 2201 2202 2203 2204 2205 2206	
	2207 2208 2209 2210 2211 2212 2213 2214 2215 2216 2217	
	2218 2219 2220 2221 2222 2223 2224 2225 2226 2227 2228	
	2229 2230 2231 2232 2233 2234 2235 2236 2237 2238 2239	
	2240 2241 2242 2243 2244 2245 2246 2247 2248 2249 2250	
	2251 2252 2253 2254 2255 2256 2257 2258 2259 2260 2261	
	2262 2263 2264 2265 2266 2267 2268 2269 2270 2271 2272	
1	2273 2274 2275 2276 2277 2278 2279 2280 2281 2282 2283	
•	2284 2285 2286 2287 2288 2289 2290 2291 2292 2293 2294	
	2295 2296 2297 2298 2299 2300 2301 2302 2303 2304 2305	
	2306 2307 2308 2309 2310 2311 2312 2313 2314 2315 2316	
	2010 211 2010 2010 2010 2010 2010 2010	

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

				MS	N					CONFIGURATION
2317 2318	2319	2320	2321	2322	2323	2324	2325	2326	2327	002
2328 2329	2330	2331	2332	2333	2334	2335	2336	2337	2338	
2339 2340	2341	2342	2343	2344	2345	2346	2347	2348	2349	
2350 2351	2352	2353	2354	2355	2356	2357	2358	2359	2360	
2361 2362	2363	2364	2365	2366	2367	2368	2369	2370	2371	
2372 2373	2374	2375	2376	2377	2378	2379	2380	2381	2382	
2383 2384	2385	2386	2387	2388	2389	2390	2391	2392	2393	
2394 2395	2396	2397	2398	2399	2400	2401	2402	2403	2404	
2405 2406	2407	2408	2409	2410	2411	2412	2413	2414	2415	
2416 2417	2418	2419	2420	2421	2422	2423	2425	2426	2427	
2428 2429	2430	2431	2432	2433	2434	2435	2436	2437	2438	
2439 2440	2441	2442	2443	2444	2445	2446	2447	2448	2449	
2450 2451	2452	2453	2454	2455	2456	2457	2458	2459	2460	
2461 2462	2463	2464	2465	2466	2467	2468	2469	2470	2471	
2472 2473	2474	2475	2476	2477	2478	2479	2480	2481	2482	
2483 2484										
2494 2495										
2506 2507										
2517 2518										
2528 2529										
2539 2540										
2550 2551										
2561 2562										
2572 2573										
2583 2584										
2594 2595										
2605 2606										
2616 2617										
2627 2628										
2638 2639										
2649 2650										
2660 2661										
2671 2672										
2682 2683										
2693 2694										
2704 2705										
2715 2716										
2727 2728										
2738 2739										
2749 2750										
2760 2761										
2771 2772										
2782 2783										
2793 2794										
2804 2805										
2815 2816										
2826 2827										
2837 2838										
2848 2840				_000	_00+	_000	_000	_007	2000	
2848 2849 2859 2860				2864	2865	2866	2867	2868	2869	

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

MSN	CONFIGURATION
2881 2882 2883 2884 2885 2886 2887 2888 2889 2890 2891	002
2892 2893 2894 2895 2896 2897 2898 2899 2900 2901 2902	002
2903 2904 2905 2906 2907 2908 2909 2910 2911 2912 2913	
2914 2915 2916 2917 2918 2919 2920 2921 2922 2923 2924	
2925 2926 2927 2928 2929 2930 2931 2932 2933 2934 2935	
2936 2937 2938 2939 2940 2941 2942 2943 2944 2945 2946	
2947 2948 2949 2950 2951 2952 2953 2954 2955 2956 2957	
2958 2959 2960 2961 2962 2963 2964 2965 2966 2967 2968	
2969 2970 2971 2972 2973 2974 2975 2976 2977 2978 2979	
2980 2981 2982 2983 2984 2985 2986 2987 2988 2989 2990	
2991 2992 2993 2994 2995 2996 2997 2998 2999 3000 3001	
3002 3003 3004 3005 3006 3007 3008 3009 3010 3011 3012	
3013 3014 3015 3016 3017 3018 3019 3020 3021 3022 3023	
3024 3025 3026 3027 3028 3029 3030 3031 3032 3033 3034	
3035 3036 3037 3038 3039 3040 3041 3042 3043 3044 3045	
3046 3047 3048 3049 3050 3051 3052 3053 3054 3055 3056	
3057 3058 3059 3060 3061 3062 3063 3064 3065 3066 3067	
3068 3069 3070 3071 3072 3073 3074 3075 3076 3077 3078	
3079 3080 3081 3082 3083 3084 3085 3086 3087 3088 3089	
3090 3091 3093 3094 3095 3096 3097 3098 3099 3100 3101	
3102 3103 3104 3105 3106 3107 3108 3109 3111 3112 3113 3114 3115 3116 3117 3118 3119 3120 3121 3122 3123 3124	
3125 3126 3127 3128 3129 3130 3131 3132 3133 3134 3135	
3136 3137 3138 3139 3140 3141 3142 3143 3144 3145 3146	
3147 3148 3149 3150 3151 3152 3153 3154 3155 3156 3157	
3158 3159 3160 3161 3162 3164 3165 3166 3167 3168 3169	
3170 3171 3172 3173 3174 3175 3176 3177 3178 3179 3180	
3181 3182 3183 3184 3185 3186 3187 3188 3189 3190 3191	
3192 3193 3194 3195 3196 3197 3198 3199 3200 3201 3202	
3203 3204 3205 3206 3207 3208 3209 3210 3211 3212 3213	
3214 3215 3216 3217 3218 3219 3220 3221 3222 3223 3224	
3225 3226 3227 3228 3229 3230 3231 3232 3233 3234 3235	
3236 3237 3238 3239 3240 3241 3242 3243 3244 3245 3246	
3247 3248 3249 3250 3251 3252 3253 3254 3255 3256 3257	
3258 3259 3260 3261 3262 3263 3264 3265 3266 3267 3268	
3269 3270 3271 3272 3273 3274 3275 3276 3277 3278 3279	
3280 3281 3282 3283 3284 3285 3286 3287 3288 3289 3290	
3291 3292 3293 3294 3295 3296 3297 3298 3299 3300 3301	
3302 3303 3304 3305 3306 3307 3308 3309 3310 3311 3312	
3313 3314 3315 3316 3317 3318 3319 3320 3321 3322 3323	
3324 3325 3326 3327 3328 3329 3330 3331 3332 3333 3334	
3335 3336 3337 3338 3339 3340 3341 3342 3343 3344 3345	
3346 3347 3348 3349 3350 3351 3352 3353 3354 3355 3356	
3357 3358 3359 3360 3361 3362 3363 3364 3365 3366 3367	
3368 3369 3370 3371 3372 3373 3374 3375 3376 3377 3378	
3379 3380 3381 3382 3383 3384 3385 3386 3387 3388 3389	
3390 3391 3392 3393 3394 3395 3396 3397 3398 3399 3400	
3401 3402 3403 3404 3405 3406 3407 3408 3409 3410 3412	
3414 3416 3418 3420 3422 3423 3425 3427 3430 3431 3433	
3435 3437 3439 3440 3444 3446 3448 3449 3451 3453 3455	
3456 3457 3460 3461 3464 3465 3468	
	l

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

MSN	CONFIGURATION
0941 0961 1073 1107 1184	001 002
3411 3413 3415 3417 3419 3421 3424 3426 3428 3429 3432	003
3434 3436 3438 3441 3442 3443 3445 3447 3450 3452 3454	
3458 3459 3462 3463 3466 3467 3469 3470 3471 3472 3473	
3474 3475 3476 3477 3478 3479 3480 3481 3482 3483 3484	
3485 3486 3487 3488 3489 3490 3491 3492 3493 3494 3495	
3496 3497 3498 3499 3500 3501 3502 3503 3504 3505 3506	
3507 3508 3509 3510 3511 3512 3513 3514 3515 3516 3517	
3518 3519 3520 3521 3522 3523 3524 3525 3526 3527 3528	
3529 3530 3531 3532 3533 3534 3535 3536 3537 3538 3539	
3540 3541 3542 3543 3544 3545 3546 3547 3548 3549 3550	
3551 3552 3553 3554 3555 3556 3557 3558 3559 3560 3561	
3562 3563 3564 3565 3566 3567 3568 3569 3570 3571 3572	
3573 3574 3575 3576 3577 3578 3579 3580 3581 3582 3583	
3584 3585 3586 3587 3588 3589 3590 3591 3592 3593 3594	
3595 3596 3597 3598 3599 3600 3601 3602 3603 3604 3605	
3606 3607 3608 3609 3610 3611 3612 3613 3614 3615 3616	
3617 3618 3619 3620 3621 3622 3623 3624 3625 3626 3627	
3628 3629 3630 3631 3632 3633 3634 3635 3636 3637 3638	
3639 3640 3641 3642 3643 3644 3645 3646 3647 3648 3649	
3650 3651 3652 3653 3654 3655 3656 3657 3658 3659 3660	
3661 3662 3663 3664 3665 3666 3667 3668 3669 3670 3671	
3672 3673 3674 3675 3676 3677 3678 3679 3680 3681 3682	
3683 3684 3685 3686 3687 3688 3689 3690 3691 3692 3693	
3694 3695 3696 3697 3699 3700 3701 3702 3703 3704 3705	
3706 3707 3708 3709 3710 3711 3712 3713 3714 3715 3716	
3717 3718 3719 3720 3721 3722 3723 3724 3726 3729 3731	
3732 3734 3739 3741 3743	

(5) Configuration definition

**CONF 001

Config. 001 is valid for all the aircraft given in the effectivity of this Service Bulletin with MOD No. 28009K5801 embodied or Service Bulletin No. A320-21-1116 accomplished.

**CONF 002

Config. 002 is valid for all the aircraft given in the effectivity of this Service Bulletin with MOD No. 26229K4438 embodied or Service Bulletin No. A320 21-1146 accomplished.

**CONF 003

Config. 003 is valid for all the aircraft given in the effectivity of this Service Bulletin with MOD No. 38652K11807 embodied.

(6) Material Effectivity

**CONF 001

MATERIAL	QTY PER A/C	SEE NOTES
Reidentified part set REIDD01	1	
Consumable CMLD01	1	

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BUILLETIN

**CONF 002

MATERIAL	QTY PER A/C	SEE NOTES
Reidentified part set REIDD02	1	
Consumable CMLD01	1	

**CONF 003

MATERIAL	QTY PER A/C	SEE NOTES
Reidentified part set REIDD03	1	
Consumable CMLD01	1	

**CONF ALL

B. CONCURRENT REQUIREMENTS

None

C. REASON

(1) History

Some operators have reported that sometimes the pressure port protective caps, used during storage and shipment, have not been removed after installation of the Cabin Pressure Controller (CPC), 11HL and 12HL, in the aircraft. If the protective caps are not removed from the pressure transducer and the back-up sensor the correct operation of the CPC is impeded. Also for the identification of the CPC in the aircraft and to change FC43 from class 3 to class 1, a software update is required.

(2) Objective/Action

This Service Bulletin is published to advise all operators of the issue of the NORD-MICRO Service Bulletin No. 20791-21-002 (20791-21-003 and 15702-21-007 as necessary). The Vendor Service Bulletin (VSB) details the replacement of the pressure port protective caps with a new design of pressure port protection, and the software upgrade.

(3) Advantages

The accomplishment of this Service Bulletin will make sure that the specific maintenance mishandling of the pressure port protective caps is avoided.

(4) Operational/Maintenance Consequences

None

D. DESCRIPTION

To accomplish this Service Bulletin it is necessary to:

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BUILLETIN

**CONF 001

Task 211189-831-848-001: MODIFICATION

- (1) Remove the Cabin Pressure Controller (CPC)
- (2) Modify the Cabin Pressure Controller (CPC)
- (3) Install the Cabin Pressure Controller (CPC), FIN 11HL and FIN 12HL.

**CONF 002

Task 211189-831-848-001: MODIFICATION

- (1) Remove the Cabin Pressure Controller (CPC)
- (2) Modify the Cabin Pressure Controller (CPC)
- (3) Install the Cabin Pressure Controller (CPC), FIN 11HL and FIN 12HL.

**CONF 003

Task 211189-831-848-001: MODIFICATION

- (1) Remove the Cabin Pressure Controller (CPC)
- (2) Modify the Cabin Pressure Controller (CPC)
- (3) Install the Cabin Pressure Controller (CPC), FIN 11HL and FIN 12HL.

**CONF ALL

E. COMPLIANCE

(1) Classification

RECOMMENDED: Service Bulletin recommended to be accomplished to prevent significant operational disruptions.

(2) Accomplishment Timescale

Accomplishment of this Service Bulletin is recommended at the earliest opportunity where manpower and facilities are available.

F. APPROVAL

The technical content of this document is approved under the authority of Design Organisation Approval No. EASA.21J.031.

If an aircraft listed in the effectivity has a modification or repair embodied that is not of AIRBUS origin, and which affects the content of this Service Bulletin, the operator is responsible for obtaining approval by its airworthiness authority for any adaptation necessary before incorporation of the Service Bulletin.

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

G. MANPOWER

The manpower estimates given in this Service Bulletin are based on the direct labor cost to do the work. These estimates assume that the work will be done by experienced personnel, and may need to be revised upwards to suit operator's circumstances. The estimates do not include the time to prepare, plan or inspect the work. Manufacture and procurement of parts and tools, drying times for paints, sealants, etc., and general administration work are also not included.

**CONF 001

Task 211189-831-848-001: MOD	DIFICATION
Get Access	0.25
On Aircraft	
Remove the Cabin Pressure Controller (CPC)	0.25
Install the Cabin Pressure Controller (CPC), FIN 11HL and FIN 12HL.	0.25
Tests	0.50
Close-Up	0.25
TOTAL MANHOURS	1.50
ELAPSED TIME (HOURS)	1.50
Additional manhours related to Vendor SB; refer to:	
Modify the Cabin Pressure Controller (CPC)	NORD-MICRO Service Bulletin No. 15702-21-007

**CONF 002

Task 211189-831-848-001: MOD	IFICATION
Get Access	0.25
On Aircraft	
Remove the Cabin Pressure Controller (CPC)	0.25
Install the Cabin Pressure Controller (CPC), FIN 11HL and FIN 12HL.	0.25
Tests	0.50
Close-Up	0.25
TOTAL MANHOURS	1.50
ELAPSED TIME (HOURS)	1.50
Additional manhours related to Vendor SB; refer to:	
Modify the Cabin Pressure Controller (CPC)	NORD-MICRO Service Bulletin No. 20791-21-002

**CONF 003

Task 211189-831-848-001: MODIFICATION				
Get Access 0.25				
On Aircraft				

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

Task 211189-831-848-001: MODIFICATION				
Remove the Cabin Pressure Controller (CPC)	0.25			
Install the Cabin Pressure Controller (CPC), FIN 11HL and FIN 12HL.	0.25			
Tests	0.50			
Close-Up	0.25			
TOTAL MANHOURS	1.50			
ELAPSED TIME (HOURS)	1.50			
Additional manhours related to Vendor SB; refer to:				
Modify the Cabin Pressure Controller (CPC)	NORD-MICRO Service Bulletin No. 20791-21-003			

**CONF ALL

H. WEIGHT AND BALANCE

Not Changed

I. ELECTRICAL LOAD DATA

Not Changed

J. REFERENCES

**CONF 001

Aircraft Maintenance Manual (AMM) 06-20-00 06-31-53 06-40-00 12-34-24 20-16-00 21-31-00 21-31-34 24-42-00 52-41-00 Consumable Material List (CML) ATA Common Support Data Dictionary (CSDD), Chapter 2 Elec. Std. Practices Manual (ESPM) 20-55-00 Vendor Service Bulletin (VSB) NORD-MICRO Service Bulletin No. 15702-21-007

**CONF 002

Aircraft Maintenance Manual (AMM) 06-20-00 06-31-53 06-40-00 12-34-24 20-16-00 21-31-00 21-31-34 24-42-00 52-41-00 Consumable Material List (CML) ATA Common Support Data Dictionary (CSDD), Chapter 2 Elec. Std. Practices Manual (ESPM) 20-55-00 Vendor Service Bulletin (VSB) NORD-MICRO Service Bulletin No.

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

REVISION No.: 01 - Mar 27/13 Page: 23

20791-21-002

SERVICE BULLETIN

**CONF 003

Aircraft Maintenance Manual (AMM) 06-20-00 06-31-53 06-40-00 12-34-24 20-16-00 21-31-00 21-31-34 24-42-00 52-41-00 Consumable Material List (CML) ATA Common Support Data Dictionary (CSDD), Chapter 2 Elec. Std. Practices Manual (ESPM) 20-55-00 Vendor Service Bulletin (VSB) NORD-MICRO Service Bulletin No. 20791-21-003

**CONF ALL

K. PUBLICATION AFFECTED

Illustrated Parts Catalog (IPC)	21-31-08

L. INTERCHANGEABILITY/MIXABILITY

**CONF 001

DESCRIPTION	OLD PART N°	NEW PART N°	INT		SEE NOTES
Controller-Pressure	9022-15702-10	9022-15702-11	01	YES	(1)

NOTE: For definitions of interchangeability codes in column INT., refer to ATA

Common Support Data Dictionary (CSDD), Chapter 2.

NOTE: Only the mixability configuration(s) and condition(s) stated in this Service

Bulletin are approved.

NOTE (1): Post modification PN 9022-15702-11 can replace pre-modification PN

9022-15702-10 on none modified aircraft without condition.

Pre-modification PN 9022-15702-10 can replace post modification PN 9022-15702-11 on a modified aircraft if the protection cap of the static pressure port on pre-modification PN 9022-15702-10 has been removed

before installation on the aircraft.

**CONF 002

DESCRIPTION	OLD PART N°	NEW PART N°	INT		SEE NOTES
Controller-Pressure	20791-02AB	20791-12AC	01	YES	(1)

NOTE: For definitions of interchangeability codes in column INT., refer to ATA

Common Support Data Dictionary (CSDD), Chapter 2.

NOTE: Only the mixability configuration(s) and condition(s) stated in this Service

Bulletin are approved.

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

NOTE (1):

Post modification PN 20791-12AC can replace pre-modification PN 20791-02AB on none modified aircraft without condition.

Pre-modification PN 20791-02AB can replace post modification PN 20791-12AC on a modified aircraft if the protection cap of the static pressure port on pre-modification PN 20791-02AB has been removed before installation on the aircraft.

**CONF 003

DESCRIPTION	OLD PART N°	NEW PART N°	INT	MIXABILITY	SEE
					NOTES
Controller-Pressure	20791-03AB	20791-13AC	01	YES	(1)

NOTE: For definitions of interchangeability codes in column INT., refer to ATA

Common Support Data Dictionary (CSDD), Chapter 2.

NOTE: Only the mixability configuration(s) and condition(s) stated in this Service

Bulletin are approved.

NOTE (1): Post modification PN 20791-13AC can replace pre-modification PN

20791-03AB on none modified aircraft without condition.

Pre-modification PN 20791-03AB can replace post modification PN 20791-13AC on a modified aircraft if the protection cap of the static pressure port on pre-modification PN 20791-03AB has been removed before installation

on the aircraft.

**CONF ALL

M. SPARES

Controller-Pressure 20791-02AB
Controller-Pressure 20791-03AB
Controller-Pressure 9022-15702-10

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

This Page Intentionally Left Blank

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

2. MATERIAL INFORMATION

**CONF ALL

A. MATERIAL - PRICE AND AVAILABILITY

(1) Procurement Addresses

Modification of removed equipment should be negotiated directly with NORD-MICRO as per instructions given in NORD-MICRO Service Bulletin No. 20791-21-002 or 20791-21-003 or 15702-21-007 as necessary.

(2) Price and Availability

Refer to the NORD-MICRO Service Bulletin No. 20791-21-002 or 20791-21-003 or 15702-21-007 as necessary for the equipment modification sales terms.

B. INDUSTRY SUPPORT INFORMATION

Refer to the NORD-MICRO Service Bulletin No. 20791-21-002 or 20791-21-003 or 15702-21-007 as necessary for the industry support terms of the Vendor Service Bulletin parts and labor.

C. LIST OF COMPONENTS

No Kit

D. <u>LIST OF MATERIALS - OPERATOR SUPPLIED</u>

(1) Consumable Materials

Consumable CMLD01

ITEM	DESCRIPTION	REFERENCE TO CML MAT. No.		SEE NOTES
	Solvent General Purpose	11-026	As required	
	Lint-Free Cotton Cloth	19-003	As required	

(2) Components

None

(3) Equipment

None

E. PARTS TO BE RE-IDENTIFIED BY OPERATOR

Reidentified part set REIDD01

ITEM	NEW PART N°	KEYWORD	ITEM	OLD PART N°	SEE NOTES
1	9022-15702-11	CPC	(1)	9022-15702-10	

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

Reidentified part set REIDD02

ITEM	NEW PART N°	KEYWORD	ITEM	OLD PART N°	SEE NOTES
1	20791-12AC	CPC	(1)	20791-02AB	

Reidentified part set REIDD03

ITEM	NEW PART N°	KEYWORD	ITEM	OLD PART N°	SEE NOTES
1	20791-13AC	CPC	(1)	20791-03AB	

F. TOOLING

None

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

REVISION No.: 01 - Mar 27/13

Page: 28

SERVICE BULLETIN

3. ACCOMPLISHMENT INSTRUCTIONS

Task 211189-831-848-001 - MODIFICATION

WARNING: MAKE SURE THAT YOU OBEY ALL THE WARNINGS AND ALL THE CAUTIONS

INCLUDED IN THE REFERENCED PROCEDURES

CAUTION: ALWAYS OBEY THE PRECAUTIONS THAT FOLLOW TO KEEP ELECTRICAL

WIRING IN A SATISFACTORY CONDITION (ELECTRICALLY AND

MECHANICALLY SERVICEABLE).

WHEN YOU DO MAINTENANCE WORK, REPAIRS OR MODIFICATIONS, ALWAYS KEEP ELECTRICAL WIRING, COMPONENTS AND THE WORK AREA AS CLEAN AS POSSIBLE. TO DO THIS:

- PUT PROTECTION, SUCH AS PLASTIC SHEETING, CLOTHS, ETC; AS NECESSARY ON ELECTRICAL WIRING AND COMPONENTS
- REGULARLY REMOVE ALL SHAVINGS, UNWANTED MATERIAL AND OTHER CONTAMINATION.

THESE PRECAUTIONS WILL DECREASE THE RISK OF CONTAMINATION AND DAMAGE TO THE ELECTRICAL WIRING INSTALLATION.

IN CASE OF CONTAMINATION, REFER TO ESPM 20-55-00.

Task Associated Data

**CONF 001

	Zone				
120					
	Modified FIN				
11HL 12HL					
	Access				
Door	811				
	Manpower				
TOTAL MANHOURS		1.50			
ELAPSED TIME (HO	URS)	1.50			
Additional manhours related to Vendor SB; refer to:					
NORD-MICRO Service	e Bulletin No. 15702-21-007				

**CONF 002

		Zone			
120	120				
	Modified FIN				
11HL 12HL					
Access					
Door	811				

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

Manpower				
TOTAL MANHOURS	1.50			
ELAPSED TIME (HOURS)	1.50			
Additional manhours related to Vendor SB; refer to:				
NORD-MICRO Service Bulletin No. 20791-21-002				

**CONF 003

Zone				
120				
	Modified FIN			
11HL 12HL				
	Access			
Door	811			
	Manpower			
TOTAL MANHOURS		1.50		
ELAPSED TIME (HO	ELAPSED TIME (HOURS) 1.50			
· ·				
Additional manhours related to Vendor SB; refer to:				
NORD-MICRO Service	e Bulletin No. 20791-21-003			

**CONF ALL

A. **GENERAL**

**CONF 001

(1) Subtask 211189-910-201-001 - Standard Practices

Work Zones and Access Panels				
Zone Access/Work location				
	120			

	Manpower Resources	
Skills		NON SPECIFIC

Material necessary to do the job	
----------------------------------	--

Consi	Consumable CMLD01					
ITEM	DESCRIPTION	REFERENCE TO CML MAT. No.	QTY PER A/C	SEE NOTES		
	Solvent General Purpose	11-026	As required			
	Lint-Free Cotton Cloth	19-003	As required			

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

References		
Aircraft Maintenance Manual (AMM)	06-20-00, Page Block 001	
	06-31-53, Page Block 001	
	06-40-00, Page Block 001	
	Task 20-16-00-912-001	
Consumable Material List (CML)		

- (a) For the specification of materials (Mat. No.) given in this Service Bulletin refer to Consumable Materials List (CML).
- (b) For the Frame (FR) identification (Refer to AMM 06-31-53, Page Block 001).
- (c) For the identification of Zones (Refer to AMM 06-20-00, Page Block 001).
- (d) For the location of access panels (Refer to AMM 06-40-00, Page Block 001).
- (e) For circuit breaker safety practices (Refer to AMM Task 20-16-00-912-001).
- (f) Clean the component interface and adjacent work area with:

Solvent General

11-026

As required

Purpose

Lint-Free Cotton

19-003

As required

Cloth

(2) Subtask 211189-839-201-001 - Administrative

	Manpower Resources	3
Skills		NON SPECIFIC

(a) Write in the applicable aircraft records that you have done all the work given in this Service Bulletin.

**CONF 002

(1) Subtask 211189-910-201-001 - Standard Practices

			Work Zones and Access Panels
Zone Access/Work location			
		120	

	Manpower Resources	
Skills		NON SPECIFIC

Material necessary to do the job

Cons	Consumable CMLD01				
ITEM	DESCRIPTION	REFERENCE TO CML MAT. No.	QTY PER A/C	SEE NOTES	
	Solvent General Purpose	11-026	As required		

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

ITEM	DESCRIPTION	REFERENCE TO CML MAT. No.	QTY PER A/C	SEE NOTES
	Lint-Free Cotton Cloth	19-003	As required	

References		
Aircraft Maintenance Manual (AMM)	06-20-00, Page Block 001	
	06-31-53, Page Block 001	
	06-40-00, Page Block 001	
	Task 20-16-00-912-001	
Consumable Material List (CML)		

- (a) For the specification of materials (Mat. No.) given in this Service Bulletin refer to Consumable Materials List (CML).
- (b) For the Frame (FR) identification (Refer to AMM 06-31-53, Page Block 001).
- (c) For the identification of Zones (Refer to AMM 06-20-00, Page Block 001).
- (d) For the location of access panels (Refer to AMM 06-40-00, Page Block 001).
- (e) For circuit breaker safety practices (Refer to AMM Task 20-16-00-912-001).
- (f) Clean the component interface and adjacent work area with:

Solvent General

11-026

As required

Purpose

Lint-Free Cotton

19-003

As required

Cloth

(2) Subtask 211189-839-201-001 - Administrative

	Manpower Res	sources
Skills		NON SPECIFIC

(a) Write in the applicable aircraft records that you have done all the work given in this Service Bulletin.

**CONF 003

(1) Subtask 211189-910-201-001 - Standard Practices

Work Zones and Access Panels		
Zone Access/Work location		
	120	

Manpower Resources	
Skills	NON SPECIFIC

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

Material necessary to do the job

Consi	Consumable CMLD01				
ITEM	DESCRIPTION	REFERENCE TO	QTY PER A/C	SEE	
		CML MAT. No.		NOTES	
	Solvent General Purpose	11-026	As required		
	Lint-Free Cotton Cloth	19-003	As required		

Re	eferences
Aircraft Maintenance Manual (AMM)	06-20-00, Page Block 001
	06-31-53, Page Block 001
	06-40-00, Page Block 001
	Task 20-16-00-912-001
Consumable Material List (CML)	

- (a) For the specification of materials (Mat. No.) given in this Service Bulletin refer to Consumable Materials List (CML).
- (b) For the Frame (FR) identification (Refer to AMM 06-31-53, Page Block 001).
- (c) For the identification of Zones (Refer to AMM 06-20-00, Page Block 001).
- (d) For the location of access panels (Refer to AMM 06-40-00, Page Block 001).
- (e) For circuit breaker safety practices (Refer to AMM Task 20-16-00-912-001).
- (f) Clean the component interface and adjacent work area with:

Solvent General 11-026

Purpose

Lint-Free Cotton

40.000

As required

19-003 As required

Cloth

(2) Subtask 211189-839-201-001 - Administrative

	Manpower Resou	ırces
Skills		NON SPECIFIC

(a) Write in the applicable aircraft records that you have done all the work given in this Service Bulletin.

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

**CONF ALL

B. PREPARATION

**CONF 001

(1) Subtask 211189-941-201-001 - Job Set-up

	Work Zones and Access Panels			
		Zone	Access/Work location	
I	·	120	Access	Door 811

	Manpower Resource	es
Skills		NON SPECIFIC

F	References
Aircraft Maintenance Manual (AMM)	Task 12-34-24-869-002
	Task 21-31-34-000-001
	Task 24-42-00-861-001
	Task 52-41-00-010-002

- (a) Make sure that the aircraft is electrically grounded (Refer to AMM Task 12-34-24-869-002).
- (b) Energize the ground service network (Refer to AMM Task 24-42-00-861-001).
- (c) Open, safety and tag the applicable circuit breaker(s) (Refer to AMM Task 21-31-34-000-001).
- (d) Put an access platform in position at the access door 811.
- (e) Open access door 811 (Refer to AMM Task 52-41-00-010-002).

**CONF 002

(1) Subtask 211189-941-201-001 - Job Set-up

	Work Zones and Access Panels			
		Zone	Access/Work location	
I	·	120	Access	Door 811

	Manpower Resources	
Skills		NON SPECIFIC

Ref	ferences
Aircraft Maintenance Manual (AMM)	Task 12-34-24-869-002
	Task 21-31-34-000-001
	Task 24-42-00-861-001
	Task 52-41-00-010-002

(a) Make sure that the aircraft is electrically grounded (Refer to AMM Task 12-34-24-869-002).

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

- (b) Energize the ground service network (Refer to AMM Task 24-42-00-861-001).
- (c) Open, safety and tag the applicable circuit breaker(s) (Refer to AMM Task 21-31-34-000-001).
- (d) Put an access platform in position at the access door 811.
- (e) Open access door 811 (Refer to AMM Task 52-41-00-010-002).

**CONF 003

(1) Subtask 211189-941-201-001 - Job Set-up

Work Zones and Access Panels			
	Zone	Access/Work location	
	120	Access	Door 811

Ma	anpower Resources
Skills	NON SPECIFIC

R	leferences
Aircraft Maintenance Manual (AMM)	Task 12-34-24-869-002
	Task 21-31-34-000-001
	Task 24-42-00-861-001
	Task 52-41-00-010-002

- (a) Make sure that the aircraft is electrically grounded (Refer to AMM Task 12-34-24-869-002).
- (b) Energize the ground service network (Refer to AMM Task 24-42-00-861-001).
- (c) Open, safety and tag the applicable circuit breaker(s) (Refer to AMM Task 21-31-34-000-001).
- (d) Put an access platform in position at the access door 811.
- (e) Open access door 811 (Refer to AMM Task 52-41-00-010-002).

**CONF ALL

C. PROCEDURE

**CONF 001

(1) Subtask 211189-831-201-001 - Remove the Cabin Pressure Controller (CPC)

	Work Zones and Access Panels
Zone	Access/Work location
120	

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

Manpower Resources					
Manhours 0.25					
Minimum number of person	1				
Subtask elapsed time	0.25				
Skills	NON SPECIFIC				

References
Aircraft Maintenance Manual (AMM)
Task 21-31-34-000-001
Fig. A-GBAAA
Removal and Installation of the Modified
Cabin Pressure Controller

References

Sheet 01

- (a) Remove the Cabin Pressure Controller (CPC), FIN 11HL and FIN 12HL
 - Remove the Cabin Pressure Controller (CPC), FIN 11HL and FIN 12HL (Refer to AMM Task 21-31-34-000-001).

Refer to Fig. A-GBAAA Sheet 01

a Remove:

FIN 11HL

1 Controller-Pressure 9022-15702-10 Item (1) Retain

FIN 12HL

1 Controller-Pressure 9022-15702-10 Item (1) Retain

(2) Subtask 211189-831-204-001 - Modify the Cabin Pressure Controller (CPC)

Material necessary to do the job

Reidentified part set REIDD01					
ITEM	NEW PART N°	KEYWORD	ITEM	OLD PART N°	SEE NOTES
1	9022-15702-11	CPC	(1)	9022-15702-10	

References		
Vendor Service Bulletin (VSB)	NORD-MICRO 15702-21-007	

- Modify and reidentify the Cabin Pressure Controller (Refer to NORD-MICRO Service Bulletin No. 15702-21-007).
 - a Modify:

FIN 11HL

1 Controller-Pressure 9022-15702-10 Item (1) Retained at removal

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

REVISION No.: 01 - Mar 27/13 Page: 36

Printed in FRANCE © AIRBUS S.A.S. 2007. All rights reserved.

SERVICE BULLETIN

FIN 12HL

1 Controller-Pressure 9022-15702-10 Item (1) Retained at removal

b Reidentify:

FIN 11HL

1 Cabin Pressure 9022-15702-11 Item 1

Controller

FIN 12HL

1 Cabin Pressure 9022-15702-11 Item 1

Controller

(3) Subtask 211189-831-203-001 - Install the Cabin Pressure Controller (CPC), FIN 11HL and FIN 12HL.

Work Zones and Access Panels					
Zone Access/Work location					
	120				

Manpower Resources					
Manhours 0.25					
Minimum number of person	1				
Subtask elapsed time	0.25				
Skills	NON SPECIFIC				

Material necessary to do the job

Reide	Reidentified part set REIDD01				
ITEM	NEW PART N°	KEYWORD	ITEM	OLD PART N°	SEE NOTES
1	9022-15702-11	CPC			

References			
Aircraft Maintenance Manual (AMM)	Task 21-31-34-400-001		
Fig. A-GBAAA	Sheet 01		
Removal and Installation of the Modified			
Cabin Pressure Controller			

Install the Cabin Pressure Controller (CPC), FIN 11HL and FIN 12HL (Refer to AMM Task 21-31-34-400-001).

Refer to Fig. A-GBAAA Sheet 01

a Install:

FIN 11HL

1 Cabin Pressure 9022-15702-11 Item 1

Controller

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

FIN 12HL

1 Cabin Pressure 9022-15702-11 Item 1

Controller

**CONF 002

(1) Subtask 211189-831-201-004 - Remove the Cabin Pressure Controller (CPC)

	Work Zones and Access Panels					
Zone Access/Work location						
	120					

Manpower Resources				
Manhours 0.25				
Minimum number of person	1			
Subtask elapsed time	0.25			
Skills	NON SPECIFIC			

References		
Aircraft Maintenance Manual (AMM)	Task 21-31-34-000-001	
Fig. A-GBAAA	Sheet 01	
Removal and Installation of the Modified		
Cabin Pressure Controller		

- (a) Remove the Cabin Pressure Controller (CPC), FIN 11HL and FIN 12HL
 - Remove the Cabin Pressure Controller (CPC), FIN 11HL and FIN 12HL (Refer to AMM Task 21-31-34-000-001).

Refer to Fig. A-GBAAA Sheet 01

<u>a</u> Remove:

FIN 11HL

1 Controller-Pressure 20791-02AB Item (1) Retain

FIN 12HL

1 Controller-Pressure 20791-02AB Item (1) Retain

(2) Subtask 211189-831-204-002 - Modify the Cabin Pressure Controller (CPC)

Material necessary to do the job

Reide	Reidentified part set REIDD02				
ITEM	NEW PART N°	KEYWORD	ITEM	0	SEE NOTES
1	20791-12AC	CPC	(1)	20791-02AB	

References		
Vendor Service Bulletin (VSB)	NORD-MICRO 20791-21-002	

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

Modify and reidentify the Cabin Pressure Controller (CPC) (Refer to NORD-MICRO Service Bulletin No. 20791-21-002).

a Modify:

FIN 11HL

1 Controller-Pressure 20791-02AB Item (1) Retained at

removal

FIN 12HL

Controller-Pressure 20791-02AB Item (1) Retained at

removal

b Reidentify:

FIN 11HL

Cabin Pressure 20791-12AC Item 1

Controller

FIN 12HL

1 Cabin Pressure 20791-12AC Item 1

Controller

(3) Subtask 211189-831-203-002 - Install the Cabin Pressure Controller (CPC), FIN 11HL and FIN 12HL.

Work Zones and Access Panels				
	Zone	Access/Work location		
	120			

Manpower Resources	
Manhours	0.25
Minimum number of person	1
Subtask elapsed time	0.25
Skills	NON SPECIFIC

Material necessary to do the job

Reide	Reidentified part set REIDD02				
ITEM	NEW PART N°	KEYWORD	ITEM	OLD PART N°	SEE NOTES
1	20791-12AC	CPC			

Ref	erences
Aircraft Maintenance Manual (AMM)	Task 21-31-34-400-001
Fig. A-GBAAA	Sheet 01
Removal and Installation of the Modified	
Cabin Pressure Controller	

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

Install the Cabin Pressure Controller (CPC), FIN 11HL and FIN 12HL (Refer to AMM Task 21-31-34-400-001).

Refer to Fig. A-GBAAA Sheet 01

a Install:

FIN 11HL

1 Cabin Pressure 20791-12AC Item 1

Controller

FIN 12HL

1 Cabin Pressure 20791-12AC Item 1

Controller

**CONF 003

(1) Subtask 211189-831-201-005 - Remove the Cabin Pressure Controller (CPC)

Work Zones and Access Panels				
	Zone	Access/Work location		
	120			

Manpower Resources				
Manhours	0.25			
Minimum number of person	1			
Subtask elapsed time	0.25			
Skills	NON SPECIFIC			

References		
Aircraft Maintenance Manual (AMM)	Task 21-31-34-000-001	
Fig. A-GBAAA	Sheet 01	
Removal and Installation of the Modified		
Cabin Pressure Controller		

- (a) Remove the Cabin Pressure Controller (CPC), FIN 11HL and FIN 12HL
 - Remove the Cabin Pressure Controller (CPC), FIN 11HL and FIN 12HL (Refer to AMM Task 21-31-34-000-001).

Refer to Fig. A-GBAAA Sheet 01

a Remove:

FIN 11HL

1 Controller-Pressure 20791-03AB Item (1) Retain

FIN 12HL

1 Controller-Pressure 20791-03AB Item (1) Retain

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

(2) Subtask 211189-831-204-003 - Modify the Cabin Pressure Controller (CPC)

Material necessary to do the job

	material resources, to the first					
Reide	entified part set REIDD0	3				
ITEM	NEW PART N°	KEYWORD	ITEM	OLD PART N°	SEE NOTES	
1	20791-13AC	CPC	(1)	20791-03AB		
	References					
Vendo	Vendor Service Bulletin (VSB)			ICRO 20791-21-003		

Modify and reidentify the Cabin Pressure Controller (Refer to NORD-MICRO Service Bulletin No. 20791-21-003).

<u>a</u> Modify:

FIN 11HL

1 Controller-Pressure 20791-03AB Item (1) Retained at removal

FIN 12HL

1 Controller-Pressure 20791-03AB Item (1) Retained at removal

b Reidentify:

FIN 11HL

1 Cabin Pressure 20791-13AC Item 1

Controller

FIN 12HL

1 Cabin Pressure 20791-13AC Item 1

Controller

(3) Subtask 211189-831-203-003 - Install the Cabin Pressure Controller (CPC), FIN 11HL and FIN 12HL.

Work Zones and Access Panels				
Zone	Access/Work location			
120				

Manpower Resources	
Manhours	0.25
Minimum number of person	1
Subtask elapsed time	0.25
Skills	NON SPECIFIC

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

Material necessary to do the job

Reide	Reidentified part set REIDD03				
ITEM	NEW PART N°	KEYWORD	ITEM	OLD PART N°	SEE NOTES
1	20791-13AC	CPC			

Ref	erences
Aircraft Maintenance Manual (AMM)	Task 21-31-34-400-001
Fig. A-GBAAA	Sheet 01
Removal and Installation of the Modified	
Cabin Pressure Controller	

Install the Cabin Pressure Controller (CPC), FIN 11HL and FIN 12HL (Refer to AMM Task 21-31-34-400-001).

Refer to Fig. A-GBAAA Sheet 01

a Install:

FIN 11HL

1 Cabin Pressure 20791-13AC Item 1

Controller

FIN 12HL

1 Cabin Pressure 20791-13AC Item 1

Controller

**CONF ALL

D. TEST

**CONF 001

(1) Subtask 211189-700-201-001 - Testing

	Manpower Resource	es
Skills		NON SPECIFIC

References		
Aircraft Maintenance Manual (AMM)	Task 21-31-00-710-002 Task 21-31-34-400-001	

- (a) Make sure that the work area(s) are clean and clear of tools and other items of equipment.
- (b) Remove the safety clip(s) and the tag(s) and close the circuit breaker(s) (Refer to AMM Task 21-31-34-400-001).
- (c) Do an operational test of the pressure control and monitoring (Refer to AMM Task 21-31-00-710-002).

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

**CONF 002

(1) Subtask 211189-700-201-001 - Testing

Manpov	ver Resources
Skills	NON SPECIFIC

References		
Aircraft Maintenance Manual (AMM)	Task 21-31-00-710-002	
	Task 21-31-34-400-001	

- (a) Make sure that the work area(s) are clean and clear of tools and other items of equipment.
- (b) Remove the safety clip(s) and the tag(s) and close the circuit breaker(s) (Refer to AMM Task 21-31-34-400-001).
- (c) Do an operational test of the pressure control and monitoring (Refer to AMM Task 21-31-00-710-002).

**CONF 003

(1) Subtask 211189-700-201-001 - Testing

N	lanpower Resources	
Skills		NON SPECIFIC

	References
Aircraft Maintenance Manual (AMM)	Task 21-31-00-710-002
	Task 21-31-34-400-001

- (a) Make sure that the work area(s) are clean and clear of tools and other items of equipment.
- (b) Remove the safety clip(s) and the tag(s) and close the circuit breaker(s) (Refer to AMM Task 21-31-34-400-001).
- (c) Do an operational test of the pressure control and monitoring (Refer to AMM Task 21-31-00-710-002).

**CONF ALL

E. CLOSE-UP

**CONF 001

(1) Subtask 211189-942-201-001 - Close-up

Work Zones and Access Panels			
	Zone	Access/Work location	
	120	Access Door 811	

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

N	Manpower Resources
Skills	NON SPECIFIC

References		
Aircraft Maintenance Manual (AMM)	Task 52-41-00-410-002	

- (a) Make sure that the work areas are clean and clear of tools and other items of equipment.
- (b) Close access door 811 (Refer to AMM Task 52-41-00-410-002).
- (c) Remove the access platform(s).

**CONF 002

(1) Subtask 211189-942-201-001 - Close-up

Work Zones and Access Panels				
	Zone	Access/Work location		
	120	Access Door 811		

Manpower Resources	
Skills	NON SPECIFIC

References	
Aircraft Maintenance Manual (AMM)	Task 52-41-00-410-002

- (a) Make sure that the work areas are clean and clear of tools and other items of equipment.
- (b) Close access door 811 (Refer to AMM Task 52-41-00-410-002).
- (c) Remove the access platform(s).

**CONF 003

(1) Subtask 211189-942-201-001 - Close-up

	Work Zones and Access Panels				
	Zone	Access/Work location			
I	120	Access	Door 811		

Manpower Resources				
Skills		NON SPECIFIC		

References				
Aircraft Maintenance Manual (AMM)	Task 52-41-00-410-002			

(a) Make sure that the work areas are clean and clear of tools and other items of equipment.

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

- (b) Close access door 811 (Refer to AMM Task 52-41-00-410-002).
- (c) Remove the access platform(s).

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN

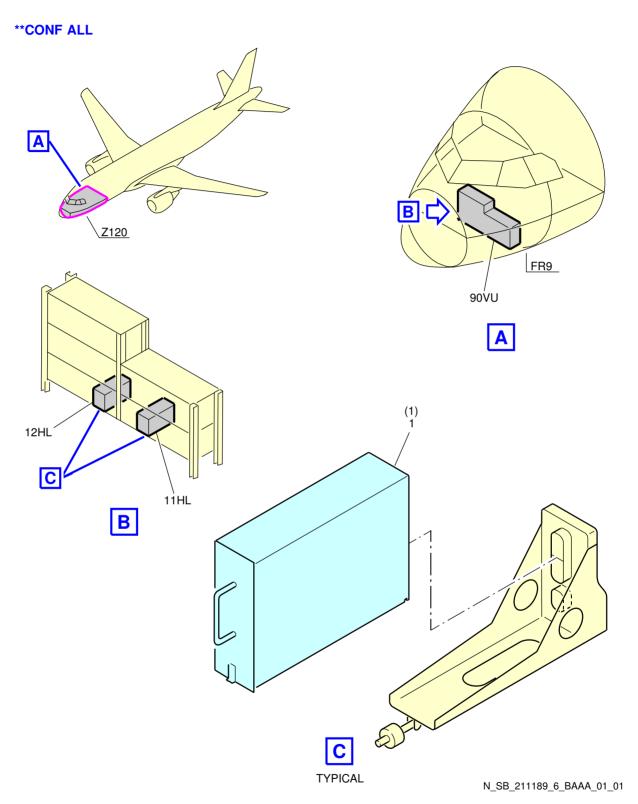


Figure A-GBAAA - Sheet 01
Removal and Installation of the Modified Cabin Pressure Controller

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN REPORTING SHEET

TITLE: AIR CONDITIONING - PRESSURE CONTROL AND MONITORING - INTRODUCE MODIFIED PRESSURE CONTROLLER

MODIFICATION No.: 39674K12828

Please complete the appropriate item (A or B):

A - SB WILL BE embodied YES/NO (if NO please comment)

If YES, aircraft concerned (as per SB effectivity by default) and planned dates (month/year) of embodiment:

B - SB <u>HAS BEEN</u> embodied on aircraft:

Operator comments:

From Airline: Name/Title: Signature:

Date:

If operational documentation is affected (see Paragraph 1.K of this SB): If information is needed prior to next normal revision or prior to SB embodiment, please indicate required service(s):

Either: Modification Operational Impact (MOI), if available

YES/NO

Or: Intermediate revision

YES/NO

<u>Important Information:</u> This SB will only be incorporated in your maintenance and operational documentation if this sheet is returned to Airbus and signed by a duly authorised representative. With the next feasible revision, this will result in

- Updating of maintenance documentation to show pre and post SB data.
- Updating of maintenance and operational documentation to show post SB data after embodiment.

If this SB requires previous or simultaneous accomplishment of other SBs, Airbus shall automatically include them in the manual revisions. Refer to SIL 00-037 for detailed information.

Please return this completed sheet to:

AIRBUS
CUSTOMER SERVICES DIRECTORATE
1 Rond Point Maurice Bellonte
31707 BLAGNAC CEDEX FRANCE

Attn: SDC32 Technical Data and Documentation Services

FAX: (+33) 5 61 93 28 06 e-mail: sb.reporting@airbus.com

or via your Resident Customer Support Office.

Alternatively, SB lists via letters or fax are also accepted.

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189

SERVICE BULLETIN QUALITY PERCEPTION FORM

Use this form to tell us what is your perception of the quality of this Service Bulletin. The reported data that you provide us will be used to analyse areas of difficulties and to take corrective action to further improve the quality of our Service Bulletins.

We thank you for the time you have taken in completing this form.

(Please rate on a scale of 1 to 4, with 4 being the highest score)

- Quality rating of this SB	4	3	2	1
- Quality rating of the Accomplishment Instructions	4	3	2	1
- Quality rating of the Illustrations	4	3	2	1
- Is this SB easy to understand ?	Y / N			

If you have had difficulties in the accomplishment of this SB please quote below the area(s) and give a short description of the issue.

	Planning		Material		Instructions		
Х	Effectivity	Χ	Kit content	Χ	Preparation		
Χ	Reason	Χ	List of Materials Operator Supplied	Χ	Mod/Inspection		
Χ	Manpower	Χ	Industry support	Χ	Test		
Χ	References	Χ	Re-identification	Χ	Close-Up		
Χ	Publication	Χ	Tooling	Χ	Illustrations		
<u>Co</u>	Comments:						
Operator: Date:							
Name/Title:							
Please return this form to:							
AIRBUS CUSTOMER SERVICES DIRECTORATE							

Attn : SEM4 Service Bulletins Management

FAX: (33) 5 61 93 42 51

1 Rond Point Maurice Bellonte 31707 BLAGNAC CEDEX FRANCE

Or via your Resident Customer Support Office.

6 DATE: May 25/10 SERVICE BULLETIN No.: A320-21-1189