

Main DDR

Detailed Diagnostic Report

Prepared from the provided Inspection Report and Thermal Images Report. This report uses only details available in the source documents. Missing or unclear items are marked as Not Available.

Property type	Flat
Inspection date/time	27.09.2022 14:28 IST
Inspected by	Krushna & Mahesh
Flat referenced in observations	Flat No. 103 and Flat No. 203
Floors	11
Previous structural audit	No
Previous repair work	No
Customer/contact/address/property age	Not Available

1. Property Issue Summary

The inspection identifies dampness, leakage, tile joint gaps, plumbing issues, and external wall cracks affecting Hall, Bedroom, Kitchen, Master Bedroom, Parking Area, and Common Bathroom areas. The thermal report provides temperature readings for supporting thermal images, but it does not clearly label which thermal image belongs to which room or defect. Therefore, thermal pages are used as supporting evidence only and the exact area-to-thermal-image mapping is marked unclear.


2. Area-wise Observations

1. Hall, Flat No. 103

Inspection finding	Dampness observed at skirting level of Hall.
Possible source side	Gaps observed between tile joints of Common Bathroom.
Thermal reading	Hotspot: 28.8 deg C; Coldspot: 23.4 deg C; Thermal image file: RB02380X.JPG
Source reference	Inspection summary points 1 and 1.1



Inspection image from source report

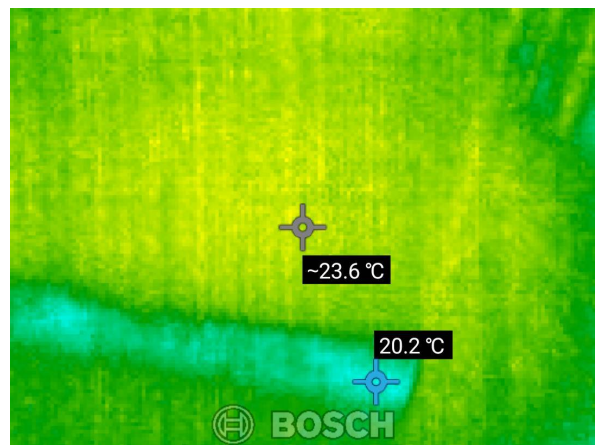


Thermal image from page 1

2. Common Bedroom, Flat No. 103

Inspection finding	Dampness observed at skirting level of Common Bedroom.
Possible source side	Gaps observed between tile joints of Common Bathroom.
Thermal reading	Hotspot: 27.4 deg C; Coldspot: 22.4 deg C; Thermal image file: RB02386X.JPG
Source reference	Inspection summary points 2 and 2.1



Inspection image from source report

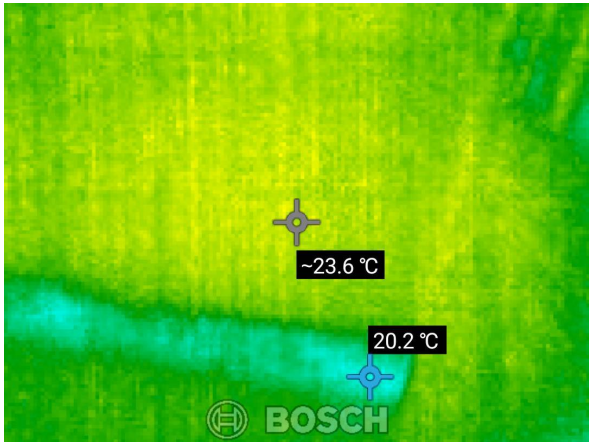


Thermal image from page 2

3. Master Bedroom, Flat No. 103

Inspection finding	Dampness observed at skirting level of Master Bedroom.
Possible source side	Gaps observed between tile joints of Master Bedroom Bathroom.
Thermal reading	Hotspot: 27 deg C; Coldspot: 22 deg C; Thermal image file: RB02395X.JPG
Source reference	Inspection summary points 3 and 3.1



Inspection image from source report

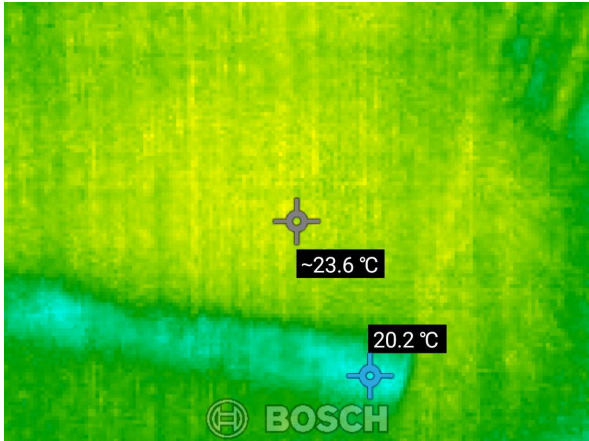


Thermal image from page 3

4. Kitchen, Flat No. 103

Inspection finding	Dampness observed at skirting level of Kitchen.
Possible source side	Gaps observed between tile joints of Master Bedroom Bathroom.
Thermal reading	Hotspot: 25.7 deg C; Coldspot: 20.7 deg C; Thermal image file: RB02402X.JPG
Source reference	Inspection summary points 4 and 4.1



Inspection image from source report

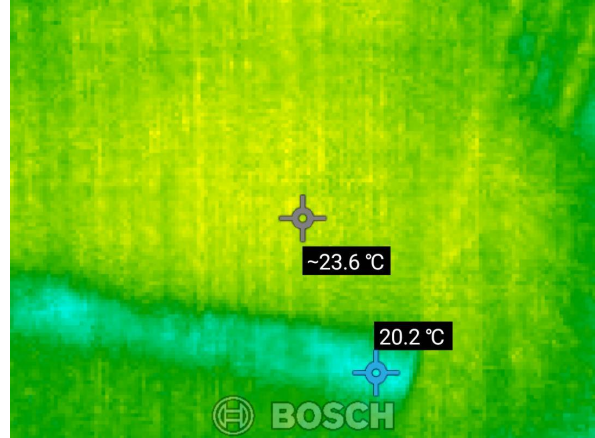


Thermal image from page 4

5. Master Bedroom Wall / External Wall, Flat No. 103

Inspection finding	Dampness and efflorescence observed on Master Bedroom wall surface.
Possible source side	Cracks observed on external wall of building near Master Bedroom.
Thermal reading	Hotspot: 25.5 deg C; Coldspot: 20.5 deg C; Thermal image file: RB02403X.JPG
Source reference	Inspection summary points 5 and 5.1



Inspection image from source report

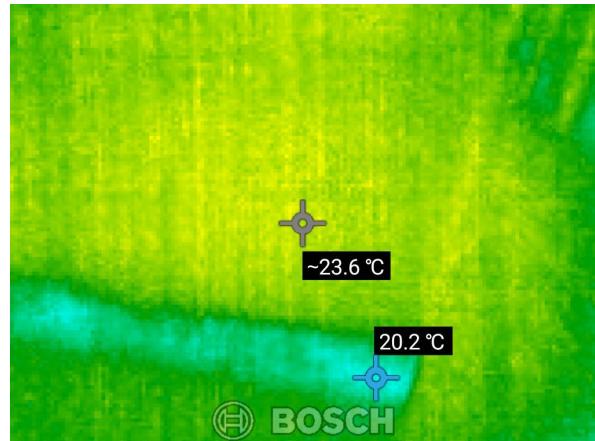


Thermal image from page 5

6. Parking Ceiling below Flat No. 103

Inspection finding	Leakage observed at parking ceiling below Flat No. 103.
Possible source side	Common Bathroom has plumbing issue and gaps between tile joints.
Thermal reading	Hotspot: 25.8 deg C; Coldspot: 20.8 deg C; Thermal image file: RB02404X.JPG
Source reference	Inspection summary points 6 and 6.1



Inspection image from source report

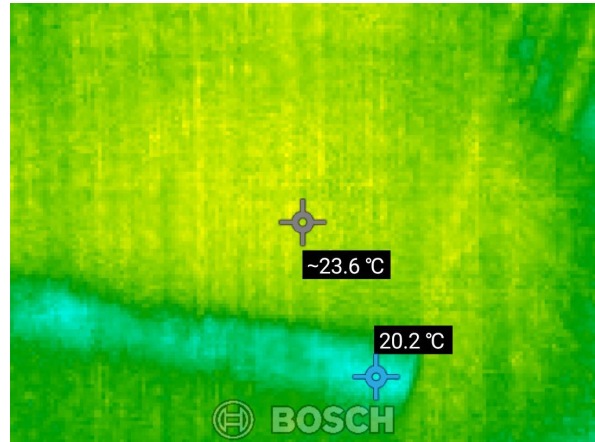


Thermal image from page 6

7. Common Bathroom Ceiling, Flat No. 103

Inspection finding	Mild dampness observed at ceiling of Common Bathroom.
Possible source side	Gap between tile joints of Common and Master Bedroom Bathrooms of Flat No. 203; outlet leakage is mentioned in detailed observation.
Thermal reading	Hotspot: 26.2 deg C; Coldspot: 21.2 deg C; Thermal image file: RB02405X.JPG
Source reference	Inspection summary points 7 and 7.1



Inspection image from source report

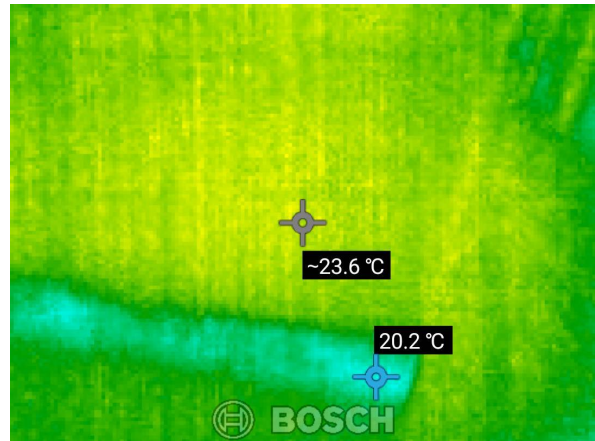

Thermal image from page 7

3. Probable Root Cause

- Concealed plumbing leakage is marked Yes in the inspection checklist.
- Damage in Nahani trap/brickbat coba under tile flooring is marked Yes.
- Gaps around Nahani trap joints and gaps/blackish dirt in tile joints are marked Yes.
- External wall cracks and moderate external wall condition may contribute to dampness near the Master Bedroom wall.

4. Severity Assessment

Overall severity is assessed as Moderate. Reason: the inspection checklist explicitly records moderate RCC/external wall crack condition and moderate algae/fungus on external wall, while the affected areas include multiple rooms and parking ceiling. Some observations are described as mild, such as Common Bathroom ceiling dampness, so those individual items may be lower severity than the overall property condition.

5. Recommended Actions

- Repair tile joint gaps in Common Bathroom and Master Bedroom Bathroom.
- Check and repair concealed plumbing joints and bathroom outlet leakage mentioned in the inspection report.
- Inspect Nahani trap/brickbat coba below bathroom tiles and repair if leakage is confirmed.
- Treat damp affected skirting and wall areas only after the leakage source is repaired.
- Repair external wall cracks near Master Bedroom and check wall pipe openings/grouting where applicable.
- Recheck affected rooms and parking ceiling after repair completion to confirm that dampness/leakage has stopped.

6. Additional Notes

- The thermal report provides temperature readings and images but does not include room names or issue descriptions in the extracted text.
- Temperature readings across sampled thermal pages range approximately from 20.5 deg C to 28.8 deg C for the pages used in this DDR.
- Duplicate inspection points were merged where the same bathroom tile joint gap was repeated for multiple affected rooms.

7. Missing or Unclear Information

- Customer name: Not Available
- Mobile number: Not Available
- Email: Not Available
- Address: Not Available
- Property age: Not Available
- Exact mapping between each thermal image and each inspected area: Not Available
- Exact repair history details beyond Yes/No fields: Not Available
- Conflict check: No direct conflict found between inspection findings and thermal readings; thermal labels are unclear rather than conflicting.