


Bambu Lab P1 Series

HMS Error Code Quick Reference

Scan QR codes to access troubleshooting guides

Generated: 2/3/2026 by Antony Rinaldi

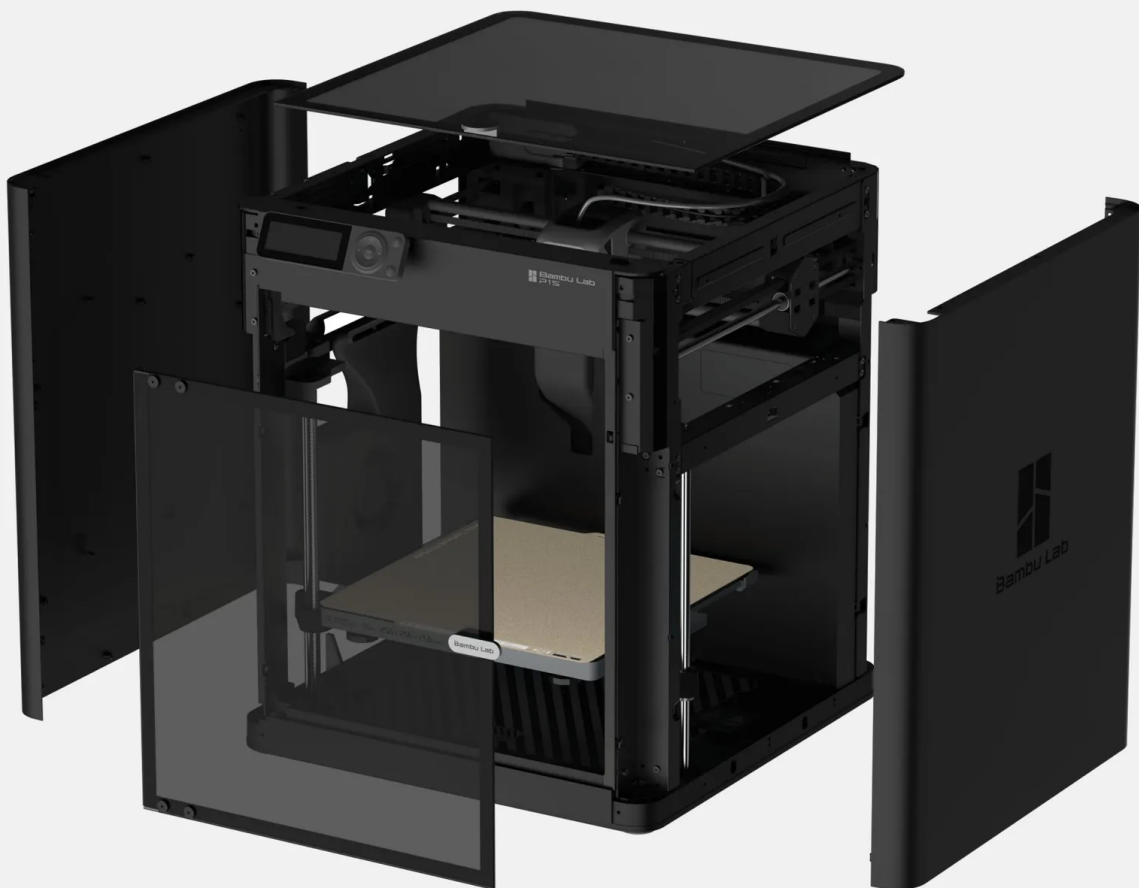


What is HMS

The Health Management System (HMS) is responsible for the collection & monitoring of the whole system status which includes:

1. Hardware connections and working status, for example, the hotend fan's speed is too low.
2. Mechanical status such as the belt tension;
3. Printing issues such as first layer scan failure and spaghetti.

Once an abnormal event occurs, HMS will notify the user what the problem is. Users can then take the proper action.

HMS Code Definition

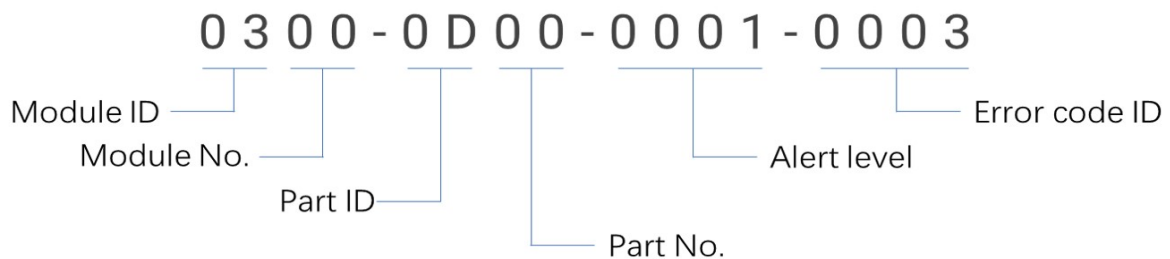

1. Module ID

Module ID	Module Abbreviation	Module Name
03	MC	Motion Controller
05	AP	Main Board
07	AMS	Automated Material System
08	TH	Tool Head
0C	XCAM	Bambu Micro Lidar
10	Studio	Studio
11	APP	Handy
12	AMS Lite	Automated Material System Lite
18	AMS HT	Automated Material System Heater

2. Module No.

The number of modules. Usually it is 0, but it could be more than 0 if there are multiple modules connected to/in the printer, like the AMS.

3. Part ID

The id of part in specific module.

4. Part No.

The number of part in specific module.

5. Alert level

Level Definition

0000 Invalid alert

0001 Error (Printing task stopped, alert must be eliminated before starting a task)

0002 Warning (Printing task pause, alert must be eliminated before resuming the task)

0003 Info (Information only)

6. Error code ID

The ID of HMS alert algorithm.

Error Code: 0300-0100-0001-000A

HMS_0300-0100-0001-000A: The heatbed temperature control is abnormal, the AC board may be broken.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0100_0001_000A



Scan for article

Error Code: 0300-0100-0001-0003

The heatbed temperature is abnormal; the heater is over temperature.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0100_0001_0003



Scan for article

Error Codes: 0300-1000-0002-0001, 0300-1100-0002-0001

The 1st order mechanical resonance mode of X axis is low.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_1000_0002_0001



Scan for article

Error Codes: 0300-1000-0002-0002, 0300-1100-0002-0002

The resonance frequency of the X axis differs greatly from last calibration. Please clean the carbon rod and rerun the machine calibration afterward

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_1000_0002_0002



Scan for article

Error Code: 0300-0F00-0001-0001

HMS_0300-0F00-0001-0001: Abnormal accelerometer data detected. Please try to restart the printer.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0F00_0001_0001



Scan for article

Error Code: 0300-0D00-0001-000B

HMS_0300-0D00-0001-000B: The Z axis motor seems to be stuck when moving. Please check if there is any foreign matter on the Z sliders or Z timing belt wheels.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0D00_0001_000B



Scan for article

**Error Codes: 0300-0D00-0001-0003,
0300-0D00-0001-0004, 0300-0D00-0001-0005,
0300-0D00-0001-0006, 0300-0D00-0001-0007,
0300-0D00-0001-0008, 0300-0D00-0001-0009,
0300-0D00-0001-000A, 0300-0D00-0002-0003,
0300-0D00-0002-0004, 0300-0D00-0002-0005,
0300-0D00-0002-0006, 0300-0D00-0002-0007,
0300-0D00-0002-0008, 0300-0D00-0002-0009,
0300-0D00-0002-000A**

HMS_0300-0D00-0001-0003: The build plate may not be properly placed. If this message appears repeatedly, please check the Wiki for more reasons.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0D00_0001_0003



Scan for article

**Error Codes: 0300-0A00-0001-0005,
0300-0B00-0001-0005, 0300-0C00-0001-0005**

HMS_0300-0A00-0001-0005: Force sensor 1 detected unexpected continuous force. The heatbed may be stuck, or the analog front end may be broken.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0A00_0001_0005



Scan for article

**Error Codes: 0300-0A00-0001-0004,
0300-0B00-0001-0004, 0300-0C00-0001-0004**

HMS_0300-0A00-0001-0004: An external disturbance was detected on force sensor 1. The heatbed plate may have touched something outside the heatbed.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0A00_0001_0004



Scan for article

**Error Codes: 0300-0A00-0001-0003,
0300-0B00-0001-0003, 0300-0C00-0001-0003**

HMS_0300-0A00-0001-0003: The sensitivity of heatbed force sensor 1/2/3 is too low.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0A00_0001_0003



Scan for article

**Error Codes: 0300-0A00-0001-0002,
0300-0B00-0001-0002, 0300-0C00-0001-0002**

HMS_0300-0A00-0001-0002: The sensitivity of heatbed force sensor 1/2/3 is low.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0A00_0001_0002



Scan for article

**Error Codes: 0300-0A00-0001-0001,
0300-0B00-0001-0001, 0300-0C00-0001-0001**

HMS_0300-0A00-0001-0001: The sensitivity of heatbed force sensor 1/2/3 is too high.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0A00_0001_0001



Scan for article

Error Code: 0300-0300-0002-0002

The speed of hotend fan is slow.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0300_0002_0002



Scan for article

Error Code: 0300-0300-0001-0001

The hotend cooling fan speed is too slow or stopped

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0300_0001_0001



Scan for article

Error Code: 0300-0400-0002-0001

The Part Cooling Fan speed is too slow or stopped. It may be stuck, or the connector may not be plugged in properly.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0400_0002_0001



Scan for article

Error Codes: 0300-0600-0001-0001, 0300-0700-0001-0001, 0300-0800-0001-0001

Motor-A has an open-circuit. There may be a loose connection, or the motor may have failed.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0600_0001_0001



Scan for article

**Error Codes: 0300-0600-0001-0002,
0300-0700-0001-0002, 0300-0800-0001-0002**

Motor-A has a short-circuit. It may have failed.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0600_0001_0002



Scan for article

Error Code: 0300-0600-0001-0003

The resistance of Motor-A is abnormal, the motor may have failed.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0600_0001_0003



Scan for article

Error Code: 0300-0100-0001-0007

The heatbed temperature is abnormal; the sensor may have an open circuit.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0100_0001_0007



Scan for article

Error Code: 0300-0100-0001-0006

The heatbed temperature is abnormal; the sensor may have a short circuit.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0100_0001_0006



Scan for article

**Error Codes: 0300-1300-0001-0001,
0300-1400-0001-0001, 0300-1500-0001-0001**

The current sensor of Motor-A is abnormal. This may be caused by a failure of the hardware sampling circuit.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_1300_0001_0001



Scan for article

Error Code: 0300-4000-0002-0001

Data transmission over the serial port is abnormal; the software system may be faulty.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_4000_0002_0001



Scan for article

Error Code: 0300-4100-0001-0001

The system voltage is unstable; triggering the power failure protection function.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_4100_0001_0001



Scan for article

Error Code: 0300-0100-0001-0008

An abnormality occurs during the heating process of the heatbed.
The heating modules may be broken.

https://wiki.bambulab.com/en/a1/troubleshooting/hmscode/0300_0100_0001_0008



Scan for article

Error Code: 0300-0100-0003-0008

The temperature of the heated bed exceeds the limit and automatically adjusts to the limit temperature.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0100_0003_0008



Scan for article

Error Code: 0300-9000-0001-0001

Chamber heating failed. The chamber heater may be failing to blow hot air.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_9000_0001_0001



Scan for article

Error Code: 0300-9000-0001-0002

Chamber heating failed. The chamber may not be enclosed, or the ambient temperature may be too low, or the heat dissipation vent of the power supply may be blocked.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_9000_0001_0002



Scan for article

Error Code: 0300-9000-0001-0003

Chamber heating failed. The temperature of power supply may be too high.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_9000_0001_0003



Scan for article

Error Code: 0300-9000-0001-0004

Chamber heating failed. The speed of the heating fan is too low.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_9000_0001_0004



Scan for article

Error Code: 0300-9000-0001-0005

Chamber heating failed. The thermal resistance is too high.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_9000_0001_0005



Scan for article

Error Code: 0300-9100-0001-000C

HMS_0300-9100-0001-000C: The chamber heater 1 works at full load for a long time. Temperature control system may be abnormal.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_9100_0001_000C



Scan for article

Error Codes: 0300-9100-0001-0008, 0300-9200-0001-0008

Chamber heater 1 failed to rise to target temperature.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_9100_0001_0008



Scan for article

Error Codes: 0300-9100-0001-000A, 0300-9200-0001-000A

HMS_0300-9100-0001-000A: The temperature of chamber heater 1 is abnormal. The AC board may be broken.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_9100_0001_000A



Scan for article

Error Codes: 0300-9100-0001-0003, 0300-9200-0001-0003

The temperature of chamber heater 1 is abnormal. The heater is over temperature.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_9100_0001_0003



Scan for article

Error Codes: 0300-9100-0001-0001, 0300-9200-0001-0001

The temperature of chamber heater 1 is abnormal. The heater may have a short circuit.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_9100_0001_0001



Scan for article

Error Codes: 0300-9100-0001-0002, 0300-9200-0001-0002

The temperature of chamber heater 1 is abnormal. The heater may have an open circuit or the thermal fuse may have taken effect.

<https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300-9100-0001-0002>



Scan for article

Error Codes: 0300-9100-0001-0006, 0300-9200-0001-0006

The temperature of chamber heater 1 is abnormal. The sensor may have a short circuit.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_9100_0001_0006



Scan for article

Error Codes: 0300-9100-0001-0007, 0300-9200-0001-0007

The temperature of chamber heater 1 is abnormal. The sensor may have an open circuit.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_9100_0001_0007



Scan for article

Error Code: 0300-9300-0001-0003

Chamber temperature is abnormal. The chamber heater's temperature sensor at the air outlet may have a short circuit.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_9300_0001_0003



Scan for article

Error Code: 0300-9300-0001-0004

Chamber temperature is abnormal. The chamber heater's temperature sensor at the air outlet may have an open circuit.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_9300_0001_0004



Scan for article

Error Code: 0300-9300-0001-0007

Chamber temperature is abnormal. The temperature sensor at the power supply may have a short circuit.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_9300_0001_0007



Scan for article

Error Code: 0300-9300-0001-0008

Chamber temperature is abnormal. The temperature sensor at power supply may have an open circuit.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_9300_0001_0008



Scan for article

Error Code: 0300-9300-0001-0001

HMS_0300_9300_0001_0001: The chamber temperature sensor at heater is short circuited

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_9300_0001_0001



Scan for article

Error Code: 0300-9300-0001-0002

Chamber temperature is abnormal. The chamber heater's temperature sensor may have an open circuit.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_9300_0001_0002



Scan for article

Error Code: 0300-9300-0001-0005

Chamber temperature is abnormal. The chamber heater's temperature sensor at the air inlet may have a short circuit.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_9300_0001_0005



Scan for article

Error Code: 0300-9300-0001-0006

Chamber temperature is abnormal. The chamber heater's temperature sensor at the air inlet may have an open circuit.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_9300_0001_0006



Scan for article

Error Code: 0300-9400-0003-0001

Chamber cooling may be too slow. You can open the chamber to help cooling if the gas in chamber is non-toxic.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_9400_0003_0001



Scan for article

Error Code: 0300-0200-0001-0001

The nozzle temperature is abnormal, the heater may be short circuit.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0200_0001_0001



Scan for article

Error Code: 0300-0200-0001-0002

The nozzle temperature is abnormal,the heater may be open circuit.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0200_0001_0002



Scan for article

Error Code: 0300-0200-0001-0003

The nozzle temperature is abnormal, the heater is over temperature.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0200_0001_0003



Scan for article

Error Code: 0300-0200-0001-0006

The nozzle temperature is abnormal, the sensor may be short circuit.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0200_0001_0006



Scan for article

Error Code: 0300-0200-0001-0007

The nozzle temperature is abnormal, the sensor may be open circuit.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_0200_0001_0007



Scan for article

Error Code: 0300-1200-0002-0001

The front cover of the toolhead fell off.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_1200_0002_0001



Scan for article

Error Code: 0300-1D00-0001-0001

HMS_0300-1D00-0001-0001: The position sensor of extrusion motor is abnormal. The connection to sensor may be loose.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0300_1D00_0001_0001



Scan for article

Error Code: 0C00-0100-0001-0001

HMS_0C00-0100-0001-0001: Micro Lidar camera is offline.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0100_0001_0001



Scan for article

Error Code: 0C00-0100-0002-0002

HMS_0C00-0100-0002-0002: Micro Lidar camera is malfunctioning.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0100_0002_0002



Scan for article

Error Code: 0C00-0100-0001-0003

HMS_0C00-0100-0001-0003: Micro Lidar Synchronization abnormal.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0100_0001_0003



Scan for article

Error Code: 0C00-0100-0001-0004

HMS_0C00-0100-0001-0004: Micro Lidar Lens dirty.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0100_0001_0004



Scan for article

Error Code: 0C00-0100-0001-0005

HMS_0C00-0100-0001-0005: Micro Lidar OTP parameter abnormal.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0100_0001_0005



Scan for article

Error Code: 0C00-0100-0002-0006

HMS_0C00-0100-0002-0006: Micro Lidar extrinsic parameter abnormal.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0100_0002_0006



Scan for article

Error Code: 0C00-0100-0002-0007

HMS_0C00-0100-0002-0007: Micro Lidar laser parameter drifted.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0100_0002_0007



Scan for article

Error Code: 0C00-0100-0002-0008

HMS_0C00-0100-0002-0008: Failed to get image from chamber camera. Spaghetti and waste chute pileup detection is not available for now..

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0100_0002_0008



Scan for article

Error Code: 0C00-0100-0001-0009

HMS_0C00-0100-0001-0009: Chamber camera dirty.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0100_0001_0009



Scan for article

Error Code: 0C00-0100-0001-000A

HMS_0C00-0100-0001-000A: The Micro Lidar LED may be broken.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0100_0001_000A



Scan for article

Error Code: 0C00-0100-0001-000B

HMS_0C00-0100-0001-000B: Failed to calibrate Micro Lidar.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0100_0001_000B



Scan for article

Error Code: 0C00-0200-0001-0001

HMS_0C00-0200-0001-0001: The horizontal laser is not lit. Please check if it's covered or hardware connection has a problem.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0200_0001_0001



Scan for article

Error Code: 0C00-0200-0002-0002

HMS_0C00-0200-0002-0002: Laser too thick

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0200_0002_0002



Scan for article

Error Code: 0C00-0200-0002-0003

HMS_0C00-0200-0002-0003: Laser not bright enough.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0200_0002_0003



Scan for article

Error Code: 0C00-0200-0002-0004

HMS_0C00-0200-0002-0004: Nozzle height seems too low.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0200_0002_0004



Scan for article

Error Code: 0C00-0200-0001-0005

HMS_0C00-0200-0001-0005: A new micro lidar is detected.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0200_0001_0005



Scan for article

Error Code: 0C00-0200-0002-0006

HMS_0C00-0200-0002-0006: Nozzle height seems too high.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0200_0002_0006



Scan for article

Error Code: 0C00-0300-0002-0001

HMS_0C00-0300-0002-0001: Filament exposure metering failed.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0300_0002_0001



Scan for article

Error Code: 0C00-0300-0002-0002

HMS_0C00-0300-0002-0002: First layer inspection terminated due to abnormal lidar data.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0300_0002_0002



Scan for article

Error Code: 0C00-0300-0002-0004

HMS_0C00-0300-0002-0004: First layer inspection not supported for current print job.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0300_0002_0004



Scan for article

Error Code: 0C00-0300-0002-0005

HMS_0C00-0300-0002-0005: First layer inspection timeout.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0300_0002_0005



Scan for article

Error Code: 0C00-0300-0003-0006

HMS_0C00-0300-0003-0006: Purged filaments piled up.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0300_0003_0006



Scan for article

Error Code: 0C00-0300-0003-0007

HMS_0C00-0300-0003-0007: Possible first layer defects.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0300_0003_0007



Scan for article

Error Code: 0C00-0300-0003-0008

HMS_0C00-0300-0003-0008: Possible spaghetti defects.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0300_0003_0008



Scan for article

Error Code: 0C00-0300-0001-0009

HMS_0C00-0300-0001-0009: First layer inspection module rebooted.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0300_0001_0009



Scan for article

Error Code: 0C00-0300-0003-000B

HMS_0C00-0300-0003-000B: Inspecting first layer.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0300_0003_000B



Scan for article

Error Code: 0C00-0300-0002-000C

HMS_0C00-0300-0002-000C: Build plate marker not detected.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0C00_0300_0002_000C



Scan for article

Error Code: 0500-0100-0002-0001

The media pipeline is malfunctioning.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0100_0002_0001



Scan for article

Error Code: 0500-0100-0002-0002

USB camera is not connected.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0100_0002_0002



Scan for article

Error Code: 0500-0100-0002-0003

USB camera is malfunctioning.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0100_0002_0003



Scan for article

Error Code: 0500-0100-0003-0004

Not enough space in SD Card.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0100_0003_0004



Scan for article

Error Code: 0500-0100-0003-0005

Error in SD Card.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0100_0003_0005



Scan for article

Error Code: 0500-0100-0003-0006

Unformatted SD Card.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0100_0003_0006



Scan for article

Error Codes: 0500-0200-0002-0001, 0500-0200-0002-0003, 0500-0200-0002-0005

Failed to connect internet, please check the network connection.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0200_0002_0001



Scan for article

Error Code: 0500-0200-0002-0002

Failed to login device.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0200_0002_0002



Scan for article

Error Code: 0500-0200-0002-0004

Unauthorized user.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0200_0002_0004



Scan for article

Error Code: 0500-0200-0002-0006

Liveview service is malfunctioning.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0200_0002_0006



Scan for article

Error Code: 0500-0200-0002-0008

HMS_0500-0200-0002-0008 Time synchronization failed.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0200_0002_0008



Scan for article

Error Code: 0500-0300-0001-0001

The MC module is malfunctioning. Please restart the device.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0300_0001_0001



Scan for article

Error Code: 0500-0300-0001-0002

The toolhead is malfunctioning. Please restart the device.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0300_0001_0002



Scan for article

Error Code: 0500-0300-0001-0003

The AMS module is malfunctioning. Please restart the device.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0300_0001_0003



Scan for article

Error Code: 0500-0300-0001-0004

The Filament Buffer module is malfunctioning. Please restart the device.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0300_0001_0004



Scan for article

Error Code: 0500-0300-0001-000A

HMS_0500-0300-0001-000A: System state is abnormal. Please restore factory settings.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0300_0001_000A



Scan for article

Error Code: 0500-0300-0001-000B

HMS_0500-0300-0001-000B: The screen is malfunctioning.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0300_0001_000B



Scan for article

Error Code: 0500-0300-0001-0021

Hardware incompatible, please check the laser.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0300_0001_0021



Scan for article

Error Code: 0500-0300-0002-000C

HMS_0500-0300-0002-000C: Wireless hardware error: please turn off/on WiFi or restart the device.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0300_0002_000C



Scan for article

**Error Codes: 0500-0300-0002-000E,
0500-0500-0001-000E, 0500-0500-0001-000F,
0500-0500-0001-0011, 0500-0500-0001-0012,
0500-0400-0001-0046, 0500-0400-0001-0047,
0500-0400-0001-0048, 0500-0400-0001-0044,
0501-0400-0001-0044, 0502-0400-0001-0044,
0503-0400-0001-0044, 0500-0500-0001-0010,
0501-0500-0001-0010, 0502-0500-0001-0010,
0503-0500-0001-0010, 0580-0500-0001-0010,
0581-0500-0001-0010, 0582-0500-0001-0010,
0583-0500-0001-0010, 0584-0500-0001-0010,
0585-0500-0001-0010, 0586-0500-0001-0010,
0587-0500-0001-0010, 0580-0400-0001-0045,
0581-0400-0001-0045, 0582-0400-0001-0045,
0583-0400-0001-0045, 0584-0400-0001-0045,
0585-0400-0001-0045, 0586-0400-0001-0045,
0587-0400-0001-0045**

HMS_0500-0300-0002-000E: Some modules are incompatible with the printer's firmware version, which may affect use. Please go to the "Firmware" page to update after connected to the internet, or you may update offline according to wiki.

Error Code: 0500-0400-0001-0001

https://wiki.bambulab.com/en/h2/troubleshooting/hmscode/0500_0300_0002_000E
Failed to download print job. Please check your network connection.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0400_0001_0001



Scan for article



Scan for article

Error Code: 0500-0400-0001-0002

Failed to report print state. Please check your network connection.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0400_0001_0002



Scan for article

Error Code: 0500-0400-0001-0003

The content of print file is unreadable. Please resend the print job.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0400_0001_0003



Scan for article

Error Code: 0500-0400-0001-0004

The print file is unauthorized.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0400_0001_0004



Scan for article

Error Code: 0500-0400-0001-0006

Failed to resume previous print.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0400_0001_0006



Scan for article

Error Code: 0500-0400-0002-0007

The bed temperature exceeds the filament's vitrification temperature, which may cause a nozzle clog.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0400_0002_0007



Scan for article

Error Code: 0500-0500-0001-0007

MQTT Command verification failed, please update Studio or Handy.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0500_0500_0001_0007



Scan for article

Error Code: 0700-0100-0001-0001

The AMS assist motor has slipped. The extrusion wheel may be worn down, or the filament may be too thin.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_0100_0001_0001



Scan for article

Error Code: 0700-0100-0001-0003

The AMS assist motor torque control is malfunctioning. The current sensor may be faulty.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_0100_0001_0003



Scan for article

Error Code: 0700-0100-0001-0004

The AMS assist motor speed control is malfunctioning. The speed sensor may be faulty.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_0100_0001_0004



Scan for article

Error Codes: 0700-0100-0002-0002, 0701-0100-0002-0002, 0702-0100-0002-0002, 0703-0100-0002-0002

The AMS assist motor is overloaded, The filament may be tangled or stuck.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_0100_0002_0002



Scan for article

Error Code: 0700-0200-0001-0001

AMS filament speed and length error.The filament odometry may be faulty.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_0200_0001_0001



Scan for article

Error Code: 0700-1000-0001-0001

The AMS slot1 motor has slipped. The extrusion wheel may be malfunctioning,or the filament may be too thin.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_1000_0001_0001



Scan for article

Error Code: 0700-1000-0001-0003

HMS_0700_1000_0001_0003: The AMS slot1 motor torque control is malfunctioning.The current sensor may be faulty.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_1000_0001_0003



Scan for article

Error Code: 0700-1000-0002-0002

The AMS slot1 motor is overloaded.The filament may be tangled or stuck.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_1000_0002_0002



Scan for article

Error Codes: 0700-2000-0002-0001,
0700-2100-0002-0001, 0700-2200-0002-0001,
0700-2300-0002-0001, 0701-2000-0002-0001,
0701-2100-0002-0001, 0701-2200-0002-0001,
0701-2300-0002-0001, 0702-2000-0002-0001,
0702-2100-0002-0001, 0702-2200-0002-0001,
0702-2300-0002-0001, 0703-2000-0002-0001,
0703-2100-0002-0001, 0703-2200-0002-0001,
0703-2300-0002-0001, 0704-2000-0002-0001,
0704-2100-0002-0001, 0704-2200-0002-0001,
0704-2300-0002-0001, 0705-2000-0002-0001,
0705-2100-0002-0001, 0705-2200-0002-0001,
0705-2300-0002-0001, 0706-2000-0002-0001,
0706-2100-0002-0001, 0706-2200-0002-0001,
0706-2300-0002-0001, 0707-2000-0002-0001,
0707-2100-0002-0001, 0707-2200-0002-0001,
0707-2300-0002-0001

AMS1 Slot1 filament has run out.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_2000_0002_0001 -----



Scan for article

Error Codes: 0700-2000-0002-0002,
0700-2100-0002-0002, 0700-2200-0002-0002,
0700-2300-0002-0002, 0701-2000-0002-0002,
0701-2100-0002-0002, 0701-2200-0002-0002,
0701-2300-0002-0002, 0702-2000-0002-0002,
0702-2100-0002-0002, 0702-2200-0002-0002,
0702-2300-0002-0002, 0703-2000-0002-0002,
0703-2100-0002-0002, 0703-2200-0002-0002,
0703-2300-0002-0002, 0704-2000-0002-0002,
0704-2100-0002-0002, 0704-2200-0002-0002,
0704-2300-0002-0002, 0705-2000-0002-0002,
0705-2100-0002-0002, 0705-2200-0002-0002,
0705-2300-0002-0002, 0706-2000-0002-0002,
0706-2100-0002-0002, 0706-2200-0002-0002,
0706-2300-0002-0002, 0707-2000-0002-0002,
0707-2100-0002-0002, 0707-2200-0002-0002,
0707-2300-0002-0002

The AMS A slot 1 is empty.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_2000_0002_0002



Scan for article

**Error Codes: 0700-2000-0002-0003,
0700-2100-0002-0003, 0700-2200-0002-0003,
0700-2300-0002-0003, 0701-2000-0002-0003,
0701-2100-0002-0003, 0701-2200-0002-0003,
0701-2300-0002-0003, 0702-2000-0002-0003,
0702-2100-0002-0003, 0702-2200-0002-0003,
0702-2300-0002-0003, 0703-2000-0002-0003,
0703-2100-0002-0003, 0703-2200-0002-0003,
0703-2300-0002-0003, 0704-2000-0002-0003,
0704-2100-0002-0003, 0704-2200-0002-0003,
0704-2300-0002-0003, 0705-2000-0002-0003,
0705-2100-0002-0003, 0705-2200-0002-0003,
0705-2300-0002-0003, 0706-2000-0002-0003,
0706-2100-0002-0003, 0706-2200-0002-0003,
0706-2300-0002-0003**



Scan for article

The AMS A Slot 1 filament may be broken in AMS.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_2000_0002_0003

**Error Codes: 0700-2000-0002-0004,
0700-2100-0002-0004, 0700-2200-0002-0004,
0700-2300-0002-0004, 0701-2000-0002-0004,
0701-2100-0002-0004, 0701-2200-0002-0004,
0701-2300-0002-0004, 0702-2000-0002-0004,
0702-2100-0002-0004, 0702-2200-0002-0004,
0702-2300-0002-0004, 0703-2000-0002-0004,
0703-2100-0002-0004, 0703-2200-0002-0004,
0703-2300-0002-0004, 0704-2000-0002-0004,
0704-2100-0002-0004, 0704-2200-0002-0004,
0704-2300-0002-0004, 0705-2000-0002-0004,
0705-2100-0002-0004, 0705-2200-0002-0004,
0705-2300-0002-0004, 0706-2000-0002-0004,
0706-2100-0002-0004, 0706-2200-0002-0004,
0706-2300-0002-0004, 0707-2000-0002-0004,
0707-2100-0002-0004, 0707-2200-0002-0004,
0707-2300-0002-0004**



Scan for article

The AMS slot1's filament may be broken in the toolhead.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_2000_0002_0004

Error Codes: 0700-2000-0002-0005,
0700-2100-0002-0005, 0700-2200-0002-0005,
0700-2300-0002-0005, 0701-2000-0002-0005,
0701-2100-0002-0005, 0701-2200-0002-0005,
0701-2300-0002-0005, 0702-2000-0002-0005,
0702-2100-0002-0005, 0702-2200-0002-0005,
0702-2300-0002-0005, 0703-2000-0002-0005,
0703-2100-0002-0005, 0703-2200-0002-0005,
0703-2300-0002-0005, 0704-2000-0002-0005,
0704-2100-0002-0005, 0704-2200-0002-0005,
0704-2300-0002-0005, 0705-2000-0002-0005,
0705-2100-0002-0005, 0705-2200-0002-0005,
0705-2300-0002-0005, 0706-2000-0002-0005,
0706-2100-0002-0005, 0706-2200-0002-0005,
0706-2300-0002-0005, 0707-2000-0002-0005,
0707-2100-0002-0005, 0707-2200-0002-0005,
0707-2300-0002-0005



Scan for article

AMS1 Slot1 filament has run out, and purging the old filament went abnormally; please check whether the filament is stuck in the tool head.

Error Codes: 0700-2000-0002-0006,
https://wiki.saini3d.com/en/x17/problems/shooting/filamentcode/0700_2000_0002_0005
0700-2100-0002-0006, 0700-2200-0002-0006,
0700-2300-0002-0006, 0701-2000-0002-0006,
0701-2100-0002-0006, 0701-2200-0002-0006,
0701-2300-0002-0006, 0702-2000-0002-0006,
0702-2100-0002-0006, 0702-2200-0002-0006,
0702-2300-0002-0006, 0703-2000-0002-0006,
0703-2100-0002-0006, 0703-2200-0002-0006,
0703-2300-0002-0006, 0704-2000-0002-0006,
0704-2100-0002-0006, 0704-2200-0002-0006,
0704-2300-0002-0006, 0705-2000-0002-0006,
0705-2100-0002-0006, 0705-2200-0002-0006,
0705-2300-0002-0006, 0706-2000-0002-0006,
0706-2100-0002-0006, 0706-2200-0002-0006,
0706-2300-0002-0006, 0707-2000-0002-0006,
0707-2100-0002-0006, 0707-2200-0002-0006,
0707-2300-0002-0006

PTFE tube detached during the feeding process. Please check if the PTFE tube is connected from AMS to extruder.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_2000_0002_0006



Scan for article

**Error Codes: 0700-2000-0003-0001,
0700-2100-0003-0001, 0700-2200-0003-0001,
0700-2300-0003-0001, 0701-2000-0003-0001,
0701-2100-0003-0001, 0701-2200-0003-0001,
0701-2300-0003-0001, 0702-2000-0003-0001,
0702-2100-0003-0001, 0702-2200-0003-0001,
0702-2300-0003-0001, 0703-2000-0003-0001,
0703-2100-0003-0001, 0703-2200-0003-0001,
0703-2300-0003-0001**



Scan for article

AMS1 Slot1 filament has run out. Please wait while old filament is purged.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_2000_0003_0001

**Error Codes: 0700-2000-0003-0002,
0700-2100-0003-0002, 0700-2200-0003-0002,
0700-2300-0003-0002, 0701-2000-0003-0002,
0701-2100-0003-0002, 0701-2200-0003-0002,
0701-2300-0003-0002, 0702-2000-0003-0002,
0702-2100-0003-0002, 0702-2200-0003-0002,
0702-2300-0003-0002, 0703-2000-0003-0002,
0703-2100-0003-0002, 0703-2200-0003-0002,
0703-2300-0003-0002**



Scan for article

AMS1 Slot1 filament has run out and automatically switched to the slot with the same filament.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_2000_0003_0002

Error Code: 0700-4000-0002-0001

The filament buffer signal lost,the cable or position sensor may be malfunctioning.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_4000_0002_0001



Scan for article

Error Code: 0700-4000-0002-0002

The filament buffer position signal error,the position sensor may be malfunctioning.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_4000_0002_0002



Scan for article

Error Code: 0700-4000-0002-0003

The AMS Hub communication is abnormal,the cable may be not well connected.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_4000_0002_0003



Scan for article

Error Code: 0700-4000-0002-0004

The filament buffer signal is abnormal,the spring may be stuck or the filament may be tangle.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_4000_0002_0004



Scan for article

Error Code: 0700-4500-0002-0001

The filament cutter sensor is malfunctioning. The sensor may be disconnected or damaged.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_4500_0002_0001



Scan for article

Error Code: 0700-4500-0002-0002

The filament cutter's cutting distance is too large. The XY motor may lose steps.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_4500_0002_0002



Scan for article

Error Code: 0700-4500-0002-0003

The filament cutter handle has not been released. The handle or blade may be jammed, or there could be an issue with the filament sensor connection.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_4500_0002_0003



Scan for article

Error Codes: 0700-5000-0002-0001, 0701-5000-0002-0001, 0702-5000-0002-0001, 0703-5000-0002-0001

AMS1 communication is abnormal; please check the connection cable.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_5000_0002_0001



Scan for article

Error Code: 0700-5100-0003-0001

AMS is disabled; please load filament from spool holder.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_5100_0003_0001



Scan for article

Error Code: 0700-6000-0002-0001

The AMS1 slot1 is overloaded. The filament may be tangled or the spool may be stuck.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_6000_0002_0001



Scan for article

**Error Codes: 0700-7000-0002-0001,
0701-7000-0002-0001, 0702-7000-0002-0001,
0703-7000-0002-0001**

Failed to pull out the filament from the extruder. Please check whether the extruder is clogged or whether the filament is broken inside the extruder.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_7000_0002_0001



Scan for article

**Error Codes: 0700-7000-0002-0006,
0701-7000-0002-0006, 0702-7000-0002-0006,
0703-7000-0002-0006**

Timeout purging old filament. Please check if the filament is stuck or the extruder/nozzle is clogged.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_7000_0002_0006



Scan for article

**Error Codes: 0700-7000-0002-0007,
0701-7000-0002-0007, 0702-7000-0002-0007,
0703-7000-0002-0007**

AMS filament ran out. Please put a new filament into AMS and click the "Retry" button.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_7000_0002_0007



Scan for article

**Error Codes: 0700-7000-0002-0008,
0701-7000-0002-0008, 0702-7000-0002-0008,
0703-7000-0002-0008, 0704-7000-0002-0008,
0705-7000-0002-0008, 0706-7000-0002-0008,
0707-7000-0002-0008, 07FE-7000-0002-0008,
07FF-7000-0002-0008**

Failed to get AMS mapping table; please click "Resume" to retry.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/0700_7000_0002_0008



Scan for article

Error Code: 07FF-2000-0002-0001

HMS_07FF-2000-0002-0001: External filament has run out; please load a new filament.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/07FF_2000_0002_0001



Scan for article

Error Code: 07FF-2000-0002-0002

HMS_07FF-2000-0002-0002: External filament is missing; please load a new filament.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/07FF_2000_0002_0002



Scan for article

Error Code: 07FF-2000-0002-0004

HMS_07FF-2000-0002-0004: Please pull out the filament on the spool holder from the extruder.

https://wiki.bambulab.com/en/x1/troubleshooting/hmscode/07FF_2000_0002_0004



Scan for article