Collision Telemetry Exhibit

Detected Collision — Farmington Ave SE at Co Rd 33, Buffalo, MN — September 30, 2026, 8:22 AM CDT

Collision detection	Geotab "Alert: Collision limit for acceleration exceeded" device fault at 08:22:16.300 CDT; Collision Reconstruction (BETA) report generated
Client	Arvig
Vehicle	20-V73 F350, VIN 1FD8W3HN0LED61010 — 2020 Ford F-350
Driver	Gbenga Olorunsogbon (Geotab Drive pairing on the trip record)
Trip	Departed 12776 Rolling Ridge Rd, Becker, MN 7:50 AM; trip ended at the incident site (5445 Co Rd 33, Buffalo, MN) 8:43 AM — 19 mi
Location	Southbound on Farmington Ave SE, Buffalo, MN; recorded pulse at 45.1414, -93.7763; vehicle at rest ~48 ft beyond the pulse location
Reported event	Front of the F-350 struck the side of a third-party vehicle (T-bone configuration), per scene evidence; the third party is not visible to this vehicle's telemetry
Conditions	Dense fog documented in the 09:18 AM scene photograph
Speed	Recorded pulse occurred at ~15–18 mph, at the end of a 18-second deceleration from 57 mph (Geotab-stated accuracy ±2.2 mph; GPS ±8.2 ft)
Data sources	MyGeotab GO device records (GPS log, accelerometer, engine status and fault data) via MyGeotab API; Geotab Collision Reconstruction (BETA)
Prepared	October 14, 2026 by GPS Fleet Management Solutions from unaltered system records

Point-of-Impact Discrepancy — Reconstruction vs. Physical Evidence


Geotab's Collision Reconstruction depicts the vehicle receiving a passenger-side impact. Scene evidence shows a different configuration: frontal. The reconstruction's estimate derives from accelerometer values present at its 08:22:16.000 trigger timestamp (-0.23 g longitudinal / -2.23 g lateral, the ft/s² figures printed in the report) — approximately 0.9 seconds after the recorded peak, when the longitudinal signal had already decayed; the residual sample reads to the algorithm as a broadside load. The full high-rate capture shows a single pulse at 08:22:15.120–08:22:15.410 with peaks of -2.19 g longitudinal / -2.23 g lateral / +2.42 g vertical. Near-equal longitudinal and lateral peaks with a pronounced vertical excursion — a tri-axial pulse. This pattern arises from terrain traversal or from a frontal strike into a crossing vehicle with front-end override of the struck vehicle's structure; scene evidence decides which. Geotab's own report notes the point of impact is an accelerometer-derived estimate that may vary; its impact graphic should not be relied upon for this event.

Event Timeline

7:50:54 AM	Ignition on; departs 12776 Rolling Ridge Rd, Becker, MN, southbound toward the incident location.
8:21:48 AM	1-second forensic GPS buffering begins; 56 mph southbound, ~0.3 mi before the recorded pulse location.
8:21:57 AM	Deceleration begins from 57 mph — gentle (~1.1 mph/s) through 8:22:05 AM, then firm (~3.2 mph/s, ~0.14 g) through 8:22:15 AM. No impact signature anywhere in this phase.


8:22:15.1 AM	RECORDED IMPACT PULSE at ~15–18 mph: peak -2.23 g lateral, -2.19 g longitudinal, +2.42 g vertical over ~0.3 s. Near-equal longitudinal and lateral peaks with a pronounced vertical excursion — a tri-axial pulse. This pattern arises from terrain traversal or from a frontal strike into a crossing vehicle with front-end override of the struck vehicle's structure; scene evidence decides which.
8:22:16.3 AM	Geotab "Alert: Collision limit for acceleration exceeded" fault logs; Collision Reconstruction trigger timestamp.
8:22:22 AM	Vehicle at rest ~48 ft past the pulse location (5445 Co Rd 33, Buffalo, MN), 7 s after the pulse.
8:23:14 AM	Brief low-speed repositioning (1–7 mph, within ~53 ft); vehicle remains at the rest location.
8:43:30 AM	TPMS fault - electric fault fault logs (Telematics device) — post-event.
8:43:31 AM	Ignition switched off — engine had been left running ~21 minutes post-event.
10:15:22 AM	No further movement through the end of the data (10:15:22 AM).

Impact Pulse — High-Rate Accelerometer Capture

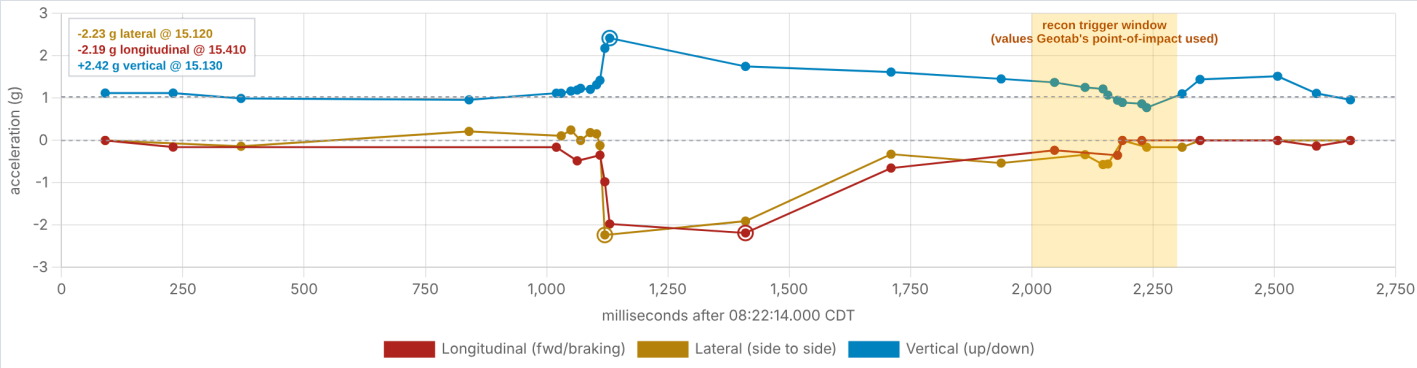


Vertical-axis baseline is 1.0 g (gravity). The shaded band marks the reconstruction's trigger timestamp (08:22:16.000–16.300), ~0.9 s after the recorded peak — by then the primary signal had decayed and the sample Geotab's point-of-impact estimate was computed from no longer reflects the pulse. Samples are the device's curve-logged accelerometer capture around the detected event; lines connect consecutive logged samples.

Speed Profile — Final Approach (GPS-logged, 1 Hz forensic buffer)

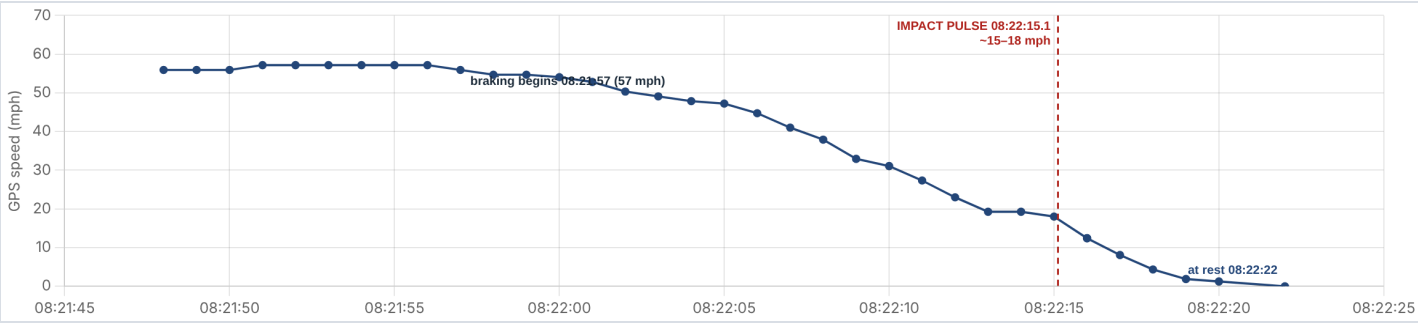

GPS-logged speed from the 1 Hz forensic accident buffer (08:21:48–08:22:22). Deceleration from 57 mph begins 8:21:57 AM — gentle (~1.1 mph/s), then firm (~3.2 mph/s) from 8:22:05 AM.

Collision Site — Satellite View

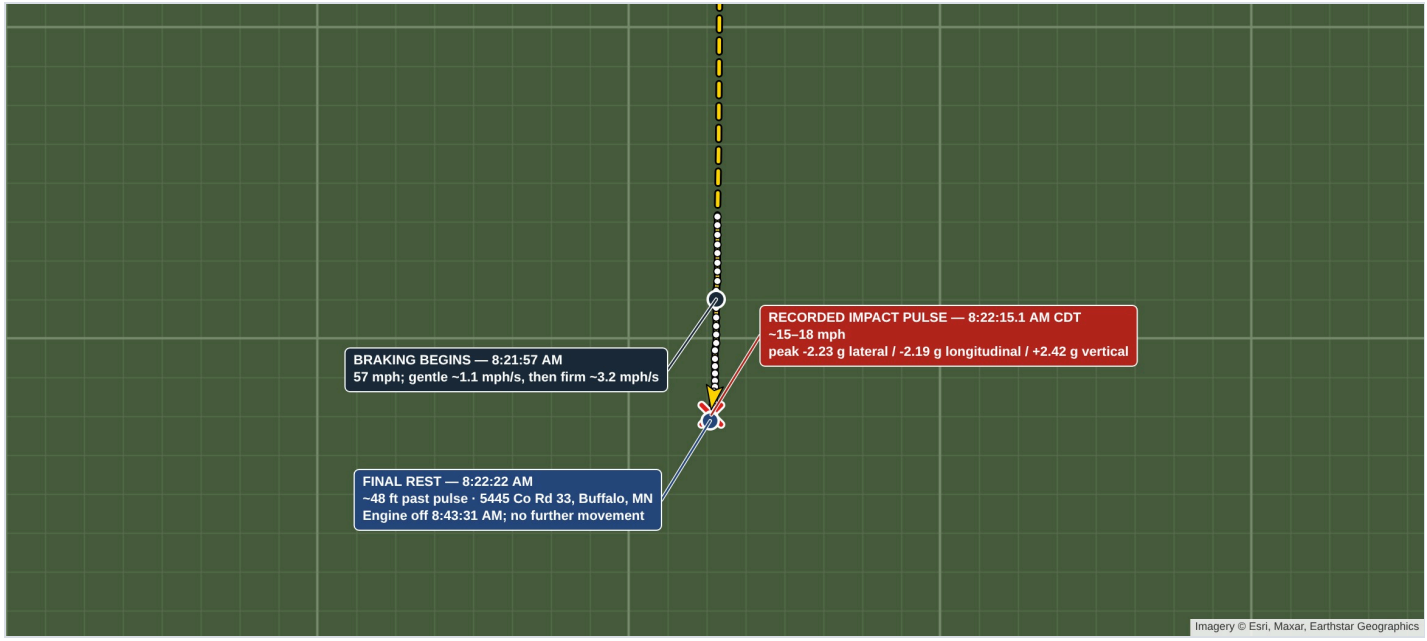

Base map: Esri World Imagery satellite tiles. Trip trail (dashed) and 1 Hz forensic breadcrumbs (solid, white dots) are plotted directly from logged GPS coordinates; the pulse marker is placed at the position interpolated between the bracketing 1 Hz fixes and the rest marker at the logged rest fix — no screenshot georeferencing is involved.

Device Event Log Summary

Metric	20-V73 F350 recorded value
Collision fault	"Alert: Collision limit for acceleration exceeded" at 08:22:16.300
Peak accelerometer readings	-2.233 g lateral (08:22:15.120) / -2.186 g longitudinal (08:22:15.410) / +2.418 g vertical (08:22:15.130), in one ~0.3 s pulse
Reconstruction sample vs. peak	Recon report values (-7.43 ft/s² longitudinal / -71.84 ft/s² lateral = -0.23 g / -2.23 g) reflect the trigger-time sample ~0.9 s after the peak; the longitudinal peak was missed
Pulse interpretation	Near-equal longitudinal and lateral peaks with a pronounced vertical excursion — a tri-axial pulse. This pattern arises from terrain traversal or from a frontal strike into a crossing vehicle with front-end override of the struck vehicle's structure; scene evidence decides which. Scene evidence indicates a frontal configuration. The other party, if any, is not observable in this device's telemetry.
Other impact signatures	None — no additional accelerometer excursion anywhere in the 27-second pre-event buffer or the remainder of the trip
Pre-event driver input	Progressive braking from 57 mph beginning 8:21:57 AM — gentle then firm, ~18 s total; no panic spike, no swerve excursion recorded before the pulse
Post-event	At rest 7 s after pulse; minor repositioning 8:23 AM; engine off 8:43:31 AM (TPMS fault - electric fault logged 8:43:30 AM — evaluate for crash-related sensor/wiring damage); no movement through export end 10:15 AM
Axis orientation check	No accelerometer excursions were curve-logged elsewhere in the trip, so device axis orientation could not be independently verified from this export; the vertical axis read ~1 g at baseline, indicating correct vertical alignment

Driver identification	Gbenga Olorunsogbon per Geotab Drive pairing on the trip record; device names carry operator labels and do not by themselves prove who was driving

Appendix — Forensic GPS Buffer, 08:21:48–08:22:22 CDT (1-second accident log)

Time (CDT)	Speed (mph)	Latitude	Longitude	Note
08:21:48.000	55.9	45.14630	-93.77610	
08:21:49.000	55.9	45.14608	-93.77611	
08:21:50.000	55.9	45.14585	-93.77612	
08:21:51.000	57.2	45.14562	-93.77612	
08:21:52.000	57.2	45.14539	-93.77613	
08:21:53.000	57.2	45.14516	-93.77613	
08:21:54.000	57.2	45.14493	-93.77614	
08:21:55.000	57.2	45.14470	-93.77614	
08:21:56.000	57.2	45.14447	-93.77615	
08:21:57.000	55.9	45.14424	-93.77615	Deceleration begins
08:21:58.000	54.7	45.14402	-93.77616	
08:21:59.000	54.7	45.14380	-93.77617	
08:22:00.000	54.1	45.14358	-93.77618	
08:22:01.000	52.8	45.14337	-93.77618	
08:22:02.000	50.3	45.14316	-93.77618	
08:22:03.000	49.1	45.14296	-93.77619	
08:22:04.000	47.8	45.14277	-93.77620	
08:22:05.000	47.2	45.14257	-93.77621	
08:22:06.000	44.7	45.14240	-93.77621	
08:22:07.000	41.0	45.14223	-93.77621	
08:22:08.000	37.9	45.14207	-93.77622	
08:22:09.000	32.9	45.14193	-93.77624	
08:22:10.000	31.1	45.14180	-93.77625	
08:22:11.000	27.3	45.14169	-93.77625	
08:22:12.000	23.0	45.14159	-93.77628	
08:22:13.000	19.3	45.14151	-93.77629	
08:22:14.000	19.3	45.14143	-93.77631	
08:22:15.000	18.0	45.14136	-93.77633	Pulse at 08:22:15.120 (between this record and next)

08:22:16.000	12.4	45.14130	-93.77633	Reconstruction trigger timestamp
08:22:16.003	12.4	45.14130	-93.77633	Reconstruction trigger timestamp
08:22:17.000	8.1	45.14127	-93.77634	
08:22:18.000	4.3	45.14124	-93.77637	
08:22:19.000	1.9	45.14124	-93.77637	
08:22:20.000	1.2	45.14124	-93.77637	
08:22:22.000	0.0	45.14123	-93.77637	At rest — 5445 Co Rd 33, Buffalo, MN

Source: MyGeotab GO device records (GPS log including the 1 Hz forensic accident buffer, accelerometer capture, engine status and fault data) retrieved via the MyGeotab API on 10/14/26; Geotab Collision Reconstruction (BETA) report. Records are reproduced as logged; no values have been modified. Geotab states GPS accuracy of ±8.2 ft and speed accuracy of ±2.2 mph for this event, notes the point of impact is an accelerometer-derived estimate that may vary, and does not authenticate the Collision Reconstruction report for litigation purposes. This device's telemetry records only the equipped vehicle's own motion; any other party's position, speed, or actions are not observable from it. This exhibit presents recorded telematics data and documented physical evidence only and does not constitute a determination of fault.