

THESE PRECAUTIONS WILL DECREASE THE RISK OF CONTAMINATION AND DAMAGE TO THE ELECTRICAL WIRING INSTALLATION.
IF THERE IS CONTAMINATION, REFER TO Ref. ESPM 20-55-00.

 NOTE

NOTE: The accomplishment instructions of this Service Bulletin include procedures given in other documents or in other sections of the Service Bulletin. When the words “refer to” are used and the operator has a procedure accepted by the local authority he belongs to, the accepted alternative procedure can be used. When the words “in accordance with” are used then the given procedure must be followed.

NOTE: Manual titles given in the accomplishment instructions are referred to by acronyms. Refer to paragraph 1.J., References, for the definition of acronyms.

NOTE: The purpose of flowcharts is to supplement the information given in the Procedure and Compliance paragraphs and not to serve as the primary source for tasks or compliance times given in this Service Bulletin.

NOTE: This Service Bulletin is classified mandatory or expected to be classified mandatory by an Airworthiness Directive (AD). The paragraphs 3.C. and 3.E. in these accomplishment instructions are Required for Compliance (RC) and must be done to comply with the AD.

To allow more flexibility, the rule "refer to" and "in accordance with" will apply to these paragraphs 3.C. and 3.E. Other paragraphs are recommended and may be deviated from, done as part of other actions or done with accepted methods different from those given in the Service Bulletin, as long as the RC paragraphs can be done and the aircraft can be put back into a serviceable condition.

NOTE: This Service Bulletin contains the instructions for the on-aircraft maintenance necessary to ensure the continued airworthiness of the aircraft. For any deviations to the instructions, including Required for Compliance paragraph contained herein, contact AIRBUS for further instructions and approval.

NOTE: Discarded parts must be managed at the operator's discretion.

JOB SET-UP

TaskA320-A-53-XX-1195-01001-540A-A(A320-A-53-XX-1195-01ZZZ-540Z-A)

NOTE: For the basic Aircraft configuration, refer to AMM Chapter "Introduction - Aircraft status for maintenance" in Manual

Front Matter section.

(a) Make sure that the aircraft is electrically grounded, refer to Ref. AMM Task 12-34-24-869-002.

(b) Energize the aircraft electrical circuits, refer to Ref. AMM Task 24-41-00-861-002.

(c) Open the MLG doors, refer to Ref. AMM Task 32-12-00-010-001.

NOTE: Make sure that the appropriate MLG door safety-equipment is installed.

(d) Do the job set-up procedure as specified in the removal of the flexible hose assembly, refer to Ref. AMM Task 32-31-39-000-001.

(e) Put an access platform in position of work area at Door 734 and Door 744.

(f) Open, safety/lock and tag the applicable circuit breaker(s), refer to Ref. AMM Task 32-31-35-000-001.

(g) Put the warning notices in position to tell persons not to operate the Green hydraulic system:

- On the Electrical Panel 40VU in the cockpit
- On the ground service panel of the Green hydraulic system.

(h) Put the warning notices in the flight compartment to tell persons not to operate the landing gear doors.

Description Step 3

MOHAMOUD MOAMEN (13009645), 17.May.2026

DISCONNECT THE MLG DOOR ACTUATOR FROM ACTUATOR FITTING ON LH AND RH

TaskA320-A-53-XX-1195-02001-540A-A(A320-A-53-XX-1195-02ZZZ-540Z-A)

(a) Standard Practices given in this procedure:

- 1- For the identification of zones, refer to Ref. AMM 06-20-00, Page Block 001.
- 2- Remove and install fasteners in accordance with Ref. SRM 51-42-00.
- 3- Tag all the parts you must remove and retain to make the subsequent installation easier.
- 4- Put all the retained hardware in identified plastic bags and attach the bags to the related unit.

CAUTION: HOLD OR SUPPORT THE ACTUATING-CYLINDER DURING INSPECTION IN ORDER TO AVOID DAMAGING THE HYDRAULIC PIPES AND HOSES FIN: 2765GM, 2766GM, 2767GM, 2768GM. THIS CAN CAUSE INCREASED STRAIN ON THE HOSE AND POSSIBLE HOSE DAMAGE.

(b) Disconnect the flexible hose assembly from the door actuator, item (4), refer to Ref. AMM Task 32-31-39-000-001.

(c) Hold and secure the door actuator to prevent any damage.



CAUTION: HOLD OR SUPPORT THE ACTUATING-CYLINDER DURING INSPECTION IN ORDER TO AVOID DAMAGING THE CYLINDER AND THE STRUCTURE AND SYSTEMS AROUND AND ALSO TO AVOID PERSONAL INJURIES.

(d) Disconnect the actuator from the actuator fitting without disconnecting hydraulic pipes, refer to Ref. Fig.BA Removal of the MLG Door Actuator.

1 Remove per side:

1 ACTUATING-CYLINDER Item (4) Retain
attached with:

1 COTTER PIN Item (9) Discard

1 NUT Item (7) Retain

1 WASHER Item (6) Retain

1 SPACER Item (5) Retain

1 BOLT Item (1) Retain

If installed, remove:

1 SHIM WASHER Item (8) Discard

NOTE: Make sure that the shim washer does not fall.

Description Step 4

MOHAMOUD MOAMEN (13009645), 17.May.2026

SDI OF THE KEEL BEAM MLG DOOR ACTUATOR FITTINGS ON LH AND RH SIDES

TaskA320-A-53-XX-1195-01001-300A-A(A320-A-53-XX-1195-01ZZZ-300Z-A)

Procedure

(a) Standard Practices given in this procedure:

- 1- For the specification of Material application codes given in this Service Bulletin, refer to Ref. CML.
- 2- For the identification of zones, refer to Ref. AMM 06-20-00, Page Block 001.
- 3- Repair the paint coating in accordance with Ref. SRM 51-75-12.

(b) At the threshold , refer to Ref. Fig.FB Flowchart.

1- Remove the sealant and clean the inspection area with:

Textile-Lint free-Cotton 14SBA1

Non Aqueous Cleaner- General 08BAA9

2- Do a HFEC and ultrasonic inspection on the keel beam actuator-fittings LH/RH for crack(s) in accordance with Ref. NTM 53-31-54.

Do a detailed visual inspection for fretting/wear and condition of bearing.

NOTE: It is not necessary to remove MLG door and not necessary to disconnect hydraulic pipes from MLG door actuator to do the HFEC and Ultrasonic inspection. Refer to Ref. Fig.BB Inspection Area.

Description Step 5

MOHAMOUD MOAMEN (13009645), 17.May.2026

TaskA320-A-53-XX-1195-01001-300A-A(A320-A-53-XX-1195-01ZZZ-300Z-A)

a- If crack is found:

<1> Replace the MLG door actuator fitting in accordance with Ref.Task A320-A-53-XX-1195-01ZZZ-920Z-A.

<2> Send TQ to ENG-CON-STR with the completed Inspection Report sheet in accordance with Ref. ISI 00.00.00179 and refer to Ref. Fig.RB Inspection Report.

OR

<3> Contact engineering and follow their repair instructions.

Description Step 6 MOHAMOUD MOAMEN (13009645), 17.May.2026

TASK A320-A-53-XX-1195-01001-300A-A (A320-A-53-XX-1195-01ZZZ-300Z-A)

b- If no crack is found:

Perform the 4 inspections (<1>,<2>,<3> and <4>)

Inspection <1>:

<1> Do a DET for plain bush axial migration on the actuator fitting, refer to Ref. Fig.BE Check of the Plain Bush Migration, Flanged Bush Axial loose and Wear Marks.

<A> If the plain bush axial migration is found to be more than 0.80 mm (0.032 in.):

NOTE

Do not apply a repair before completing the 4 inspections, check if the repair is possible following the criteria included in the 3 RIs (R53370502; R53370506; R53370510).

Check according to RI Ref. R53370502 all sheets if the damage can be repaired within its limits.

[1] If the damage can be repaired within its limits according to RI Ref. R53370502 all sheets:

[a] Do the repairs in accordance with Ref. Task A320-A-53-XX-1195-01ZZZ-690Z-A.

[b] If the damage is eliminated:

- Send the completed Inspection Report sheet in accordance with Ref. ISI 00.00.00179 and refer to Ref. Fig.RB Inspection Report.

[c] If the damage is not eliminated:

- Contact Engineering and follow their instructions.

OR

- Do the replacement of the MLG door actuator fitting on aircraft in accordance with Ref. Task A320-A-53-XX-1195-01ZZZ-920Z-A.

- Send the completed Inspection Report sheet in accordance with Ref. ISI 00.00.00179 and refer to Ref. Fig.RB Inspection Report.

[2] If the damage cannot be repaired within its limit according to RI Ref. R53370502 all sheets:

[a] Contact engineering and follow their instructions.

OR

[b] Do the replacement of the MLG door actuator fitting on aircraft in accordance with Ref. Task A320-A-53-XX-1195-01ZZZ-920Z-A.

[c] Send the completed Inspection Report sheet in accordance with Ref. ISI 00.00.00179 and refer to Ref. Fig.RB Inspection Report.

 If plain bush axial migration is not found or plain bush axial migration is less than 0.80 mm (0.032 in.):

[1] Send the completed Inspection Report sheet in accordance with Ref. ISI 00.00.00179 and refer to Ref. Fig.RB Inspection Report.

Description Step 7 MOHAMOUD MOAMEN (13009645), 17.May.2026

INSPECTION

Inspection <2>:

<2> Do a DET for flanged bush axial loose on the actuator fitting, refer to Ref. Fig.BE Check of the Plain Bush Migration, Flanged Bush Axial loose and Wear Marks.

<a> If loose flanged bush is found:

NOTE

Do not apply a repair before completing the 4 inspections, check if the repair is possible following the criteria included in the 3 RIs (R53370502; R53370506; R53370510).

Check according to RI Ref. R53370510 all sheets if the damage can be repaired within its limits.

[1] If the damage can be repaired within its limits according to RI Ref. R53370510 all sheets:

[a] Do the repairs in accordance with Ref. Task A320-A-53-XX-1195-02ZZZ-690Z-A.

[b] If the damage is eliminated:

- Send the completed Inspection Report sheet in accordance with Ref. ISI 00.00.00179 and refer to Ref. Fig.RB Inspection Report.

[c] If the damage is not eliminated:

- Contact engineering and follow their instructions.

OR

- Do the replacement of the MLG door actuator fitting on aircraft in accordance with Ref. Task A320-A-53-XX-1195-01ZZZ-920Z-A.
- Send the completed Inspection Report sheet in accordance with Ref. ISI 00.00.00179 and refer to Ref. Fig.RB Inspection Report.

[2] If the damage cannot be repaired within its limit according to RI Ref. R53370510 all sheets:

[a] Contact engineering and follow their instructions.

OR

[b] Do the replacement of the MLG door actuator fitting on aircraft in accordance with Ref. Task A320-A-53-XX-1195-01ZZZ-920Z-A.

[c] Send the completed Inspection Report sheet in accordance with Ref. ISI 00.00.00179 and refer to Ref. Fig.RB Inspection Report.

 If loose flanged bush is not found:

[1] Send the completed Inspection Report sheet in accordance with Ref. ISI 00.00.00179, refer to Ref. Fig.RB Inspection Report.

Description Step 8 MOHAMOUD MOAMEN (13009645), 17.May.2026

INSPECTION 3

Inspection <2>:

Inspection <3>:

<3> Do a DET for wear marks underneath the bolt head on the actuator fitting, refer to Ref. Fig.BE Check of the Plain Bush Migration, Flanged Bush Axial loose and Wear Marks.

<a> If wear marks are found:

NOTE

Do not apply a repair before completing the 4 inspections, check if the repair is possible following the criteria included in the 3 RIs (R53370502; R53370506; R53370510).

Following the criteria included in the 3 RIS (R53370502; R53370506; R53370510).

Check according to RI Ref. R53370506 all sheets if the damage can be repaired within its limits.

[1] If the damage can be repaired within its limits according to RI Ref. R53370506 all sheets:

[a] Do the repairs in accordance with Ref. Task A320-A-53-XX-1195-03ZZZ-690Z-A.

[b] If the damage is eliminated:

- Send the completed Inspection Report sheet in accordance with Ref. ISI 00.00.00179 and refer to Ref. Fig.RB Inspection Report

[c] If the damage is not eliminated:

- Contact engineering and follow their instructions.

OR

- Do the replacement of the MLG door actuator fitting on aircraft in accordance with Ref. Task A320-A-53-XX-1195-01ZZZ-920Z-A

- Send the completed Inspection Report sheet in accordance with Ref. ISI 00.00.00179 and refer to Ref. Fig.RB Inspection Report.

[2] If the damage cannot be repaired within its limit according to RI Ref. R53370506 all sheets:

[a] Contact engineering and follow their instructions.

OR

[b] Do the replacement of the MLG door actuator fitting on aircraft in accordance with Ref. Task A320-A-53-XX-1195-01ZZZ-920Z-A.

[c] Send the completed Inspection Report sheet in accordance with Ref. ISI 00.00.00179 and refer to Ref. Fig.RB Inspection Report.

 If wear marks are not found:

[1] Send the completed Inspection Report sheet in accordance with Ref. ISI 00.00.00179 and refer to Ref. Fig.RB Inspection Report.

Description Step 9

MOHAMOUD MOAMEN (13009645), 17.May.2026

INSPECTION 4

Inspection <4>:

<4> Do a DET for other damage(s):

<a> If other damage(s) is(are) found:

Check if the damage can be repaired in accordance with Ref. SRM 51-73-00.

[1] If damage cannot be repaired:

[a] Do the replacement of the MLG door actuator fitting on aircraft in accordance with Ref. Task A320-A-53-XX-1195-01ZZZ-920Z-A.

[b] Send the completed Inspection Report sheet in accordance with Ref. ISI 00.00.00179 and refer to Ref. Fig.RB Inspection Report.

OR

[c] Contact engineering and follow their instructions.

[2] If damage can be repaired:

[a] Do a repair for other damages found on LH and RH sides in accordance with Ref. Task A320-A- 53-XX-1195-04ZZZ-690Z-A.

[b] If the part thickness remains within the tolerance of negligible damage in accordance with Ref. SRM 51-73-11 and there are no findings after HFEC inspection:

- Restore the surface protection in accordance with Ref. SRM 51-75-12

- Send the completed Inspection Report sheet in accordance with Ref. ISI 00.00.00179 and refer to Ref. Fig.RB Inspection Report.

[c] If the part thickness is outside the tolerance of the negligible damage in accordance with Ref. SRM 51-73-11 or there are findings after HFEC

inspection:

- Do the replacement of the MLG door actuator fitting on aircraft in accordance with Ref. Task A320-A-53-XX-1195-01ZZZ- 920Z-A

- Send the completed Inspection Report sheet in accordance with Ref. ISI 00.00.00179 and refer to Ref. Fig.RB Inspection Report.

OR

- Contact AIRBUS and follow their instructions.

 If other damage(s) not found:

[1] Send the completed Inspection Report sheet in accordance with Ref. ISI 00.00.00179 and refer to Ref. Fig.RB Inspection Report.

[2] Renew the protective finish in accordance with Ref. SRM 51-75-12.

Description Step 10MOHAMOUD MOAMEN (13009645), 17.May.2026

DEPENDING ON INSP RESULT REPLACE THE MLG DOOR ACTUATOR FITTING

TaskA320-A-53-XX-1195-01001-920A-~~AA320-A-53-XX-1195-01ZZZ-920Z-A~~

Depending on the Inspection Results, Replace the MLG Door Actuator Fitting on LH and RH sides

Procedure

(a) Standard Practices given in this procedure:

1- For the identification of zones, refer to Ref. AMM 06-20-00, Page Block 001.

(b) Replace the affected actuator fitting in accordance with RI Ref. R53370501 all sheets.

NOTE

NOTE: LH and RH procedures are independent from each other. If cracks/ damage are found on one side only, the corrective actions on the other side are not necessary.

Description Step 11MOHAMOUD MOAMEN (13009645), 17.May.2026

DEPENDING ON THE INSP RESULT, REPAIR THE PLAIN BUSH MIGRATION

TaskA320-A-53-XX-1195-01001-690A-~~AA320-A-53-XX-1195-01ZZZ-690Z-A~~

Depending on the Inspection Results, Repair the Plain Bush Migration on LH and RH sides.

Procedure

(a) Standard Practices given in this procedure:

1- For the identification of zones, refer to Ref. AMM 06-20-00, Page Block 001.

(b) Repair the plain bush of the affected actuator in accordance with RI Ref. R53370502 all sheets.

If necessary, use:

2 BUSH R5307111620000

or

2 BUSH R5307111620200

Use:

1 KIT LUG REPAIR REAMER 98D53308001000

NOTE

LH and RH procedures are independent from each other, findings detected only on one side do not trigger corrective actions on the other side.

In case both actuators are affected, two bushes are necessary, one for LH and one for RH.

Description Step 12

MOHAMOUD MOAMEN (13009645), 17.May.2026

DEPENDING ON THE INSP RESULT, REPAIR THE FLANGED BUSH AXIAL LOOSE

Task ~~A320-A-53-XX-1195-02001-690A-AA320-A-53-XX-1195-02ZZZ-690Z-A~~

Depending on the Inspection Results, Repair the Flanged Bush Axial Loose on LH and RH sides.

Procedure

(a) Standard Practices given in this procedure:

1- For the identification of zones, refer to Ref. AMM 06-20-00, Page Block 001.

(b) Repair the flanged bush of the affected actuator in accordance with RI Ref. R53370510 all sheets.

If necessary, use:

2 BUSH R5307111620400

or

2 BUSH R5307111620600

Use:

1 KIT LUG REPAIR REAMER 98D53308002000

NOTE

NOTE: LH and RH procedures are independent from each other, findings detected only on one side do not trigger corrective actions on the other side.

NOTE: In case both actuators are affected, two bushes are necessary, one for LH and one for RH.

Description Step 13

MOHAMOUD MOAMEN (13009645), 17.May.2026

DEPENDING ON THE INSP RESULTS, REPAIR THE WEAR MARKS UNDERNEATH BOLT

Task ~~A320-A-53-XX-1195-03001-690A-AA320-A-53-XX-1195-03ZZZ-690Z-A~~

Depending on the Inspection Results, Repair the wear marks underneath Bolt head on LH and RH Sides.

Procedure

(a) Standard Practices given in this procedure:

1- For the identification of zones, refer to Ref. AMM 06-20-00, Page Block 001.

(b) Repair the wear marks underneath bolt head in accordance with RI Ref. R53370506 all sheets.

 NOTE

NOTE: LH and RH procedures are independent from each other, findings detected only on one side do not trigger corrective actions on the other side.

Description Step 14

MOHAMOUD MOAMEN (13009645), 17.May.2026

DEPENDING ON THE INSP RESULTS, REPAIR THE OTHER DAMAGES

Task ~~A320-A-53-XX-1195-04001-690A-A~~ **A320-A-53-XX-1195-04ZZZ-690Z-A)**

Depending on the Inspection Results, Repair the Other Damages on LH and RH sides.

Procedure

(a) Standard Practices given in this procedure:

- 1- For the identification of zones, refer to Ref. AMM 06-20-00, Page Block 001.
- (b) Do a blend out in accordance with Ref. SRM 51-73-00.
- (c) Do a HFEC inspection in accordance with Ref. NTM 51-10-08.
- (d) Measure the remaining thickness in accordance with Ref. NTM 51-10-04.

 NOTE

NOTE: LH and RH procedures are independent from each other, findings detected only on one side do not trigger corrective actions on the other side.

Description Step 15

MOHAMOUD MOAMEN (13009645), 17.May.2026

CONNECT THE MLG DOOR ACTUATOR TO THE ACTUATOR FITTING

Task ~~A320-A-53-XX-1195-01001-331A-A~~ **A320-A-53-XX-1195-01ZZZ-331Z-A)**

Connect the MLG Door Actuator to the Actuator Fitting on LH and RH Sides.

Procedure

(a) Standard Practices given in this procedure:

- 1- For the identification of zones, refer to Ref. AMM 06-20-00, Page Block 001.
- 2- For the specification of Material application codes given in this Service Bulletin, refer to Ref. CML.
- 3- Remove and install fasteners in accordance with Ref. SRM 51-42-00.

(b) Connect the MLG door actuator on actuator fittings, on the LH and RH side, refer to Ref. Fig.BD Installation of the MLG Door Actuator and Ref. AMM Task 32-31-35- 400-001 in accordance with Ref. SRM 51-24-00.

1- Clean the component with:

Non Aqueous Cleaner- Acetone 08BBH1

 السعودية Saudia 	Saudia Aerospace Engineering Industries W/O P.O. Box 167 CC 808 Jeddah 21231	31674595 Copy	Barcode  WO31674595R3	Registration HZ-ASP 321
---	---	-------------------------	--	--------------------------------------

- 2- Do an inspection of the component interface and/or the adjacent area.
- 3- Make sure that the parts retained from the removed component are clean and in the correct condition.
- 4- Install the upper actuator attachment LH/RH, refer to Ref. AMM Task 32-31- 35-400-001 and Ref. Fig.BD Installation of the MLG Door Actuator:
 - 1 BOLT Item (1) Retained
 - 1 NUT Item (7) Retained
 - 1 WASHER Item (6) Retained
 - 1 SPACER Item (5) Retained.

! NOTE

NOTE: The head of the bolt (1) must be installed on the same side as the flanged bush, refer to Ref. Fig.BD Sol.AA SHEET 3 Installation of the MLG Door Actuator

Refer to Ref. Fig.BD Sol.AA SHEET 3 Installation of the MLG Door Actuator

- 5- Torque the nuts, item (7) to between 2.75 m.daN and 5.50 m.daN (20.28 lbf.ft and 40.56 lbf.ft).
- 6- If the gap A is less than 0.1 mm (0.004 in.), install the actuator with:
 - 1 WASHER NAS1149C1016R Item 8

! NOTE

NOTE: After installing the washer item 8, if the gap is still less than 0.1 mm (0.004 in.), please contact AIRBUS for further support.

- 7- Install the pin-cotter, item 9, refer to Ref. Fig.BD Installation of the MLG Door Actuator SHEET 2.
 - 1 PIN-COTTER MS24665-300 Item 9
- 8- Lubricate the bearings at each end of the actuating-cylinder, item (4) through the lubrication fittings, item (2), refer to Ref. AMM Task 12-22-32-640-001.
- 9- Apply to the head of the bolt, item (1) and the nut, item (7) in accordance with Ref. SRM 51-24-00. Polysulfide Sealant - General Purpose Fillet 06AAB.

Description Step 16

MOHAMOUD MOAMEN (13009645), 17.May.2026

CONNECT THE MLG DOOR ACTUATOR TO THE ACTUATOR FITTING - PART 2

(a) Reconnect the flexible hose assembly to the actuator, item (4), refer to Ref. AMM Task 32-31-39-400-001 and following below instructions.

- Flexible Hose Assembly 2765GM, 2766GM, 2767GM, 2768GM

1. When you connect the flexible hoses (1) and (6) to the swivel joints (4) and (3), the swivel joint must be aligned parallel to the aircraft axis. A swivel joint that is not aligned correctly can decrease the bend radius of the flexible hose. This can cause increased strain on the hose and possible hose damage.

2. Perform GVI to inspect rupture of braids and/or wires of the hydraulic hose and replace if found damaged. Upload picture of the removed hose with close up picture showing the damage.

(b) Remove the safety clip(s) and/or tag(s) and close/unlock the applicable circuit breaker(s), refer to Ref. AMM Task 32-31-35-400-001.

(c) Remove the access platform(s) from the work area Door 734 LH MLG and/or Door 744 RH MLG.

TEST

Task A320-A-53-XX-1195-01001-390A-A (A320-A-53-XX-1195-01ZZZ-390Z-A)

Test

Procedure

(a) Do the test as specified after the reconnection of the flexible hose assembly, refer to Ref. AMM Task 32-31-39-400-001.

(b) Do the opening and closing procedure of the MLG doors, refer to Ref. AMM Task 32-12-00-010-001 and Ref. AMM Task 32-12-00-410-001.

(c) Do the operational test of the MLG doors, refer to Ref. AMM Task 32-31-00-710-002.

CLOSE-UP

Task A320-A-53-XX-1195-02001-740A-A (A320-A-53-XX-1195-02ZZZ-740Z-A)

Close-up

Procedure

(a) Make sure that the work areas are clean and clear of tools and other items of equipment.

(b) Do the close-up procedure as specified in the installation of the flexible hose assembly, refer to Ref. AMM Task 32-31-39-400-001.

(c) Close the MLG doors, refer to Ref. AMM Task 32-12-00-410-001.

(d) Remove the warning notice(s).

(e) Remove the access platform(s).

(f) De-energize the ground service network, refer to Ref. AMM Task 24-42-00-862-001.

(g) Put the aircraft back to its initial configuration.

CONNECT THE MLG DOOR ACTUATOR TO THE ACTUATOR FITTING - PART 2

(a) Reconnect the flexible hose assembly to the actuator, item (4), refer to Ref. AMM Task 32-31-39-400-001 and following below instructions.

- Flexible Hose Assembly 2765GM, 2766GM, 2767GM, 2768GM

1. When you connect the flexible hoses (1) and (6) to the swivel joints (4) and (3), the swivel joint must be aligned parallel to the aircraft axis. A swivel joint that is not aligned correctly can decrease the bend radius of the flexible hose. This can cause increased strain on the hose and possible hose damage.


2. Perform GVI to inspect rupture of braids and/or wires of the hydraulic hose and replace if found damaged. Upload picture of the removed hose with close up picture showing the damage.

Copyright of Saudia Technic - Regeneration is not allowed without prior approval by Saudia Technic.



Perform GVI to inspect rupture of braids and/or wires of the hydraulic hose will induce a loss of stability of the outer braid, and subsequently cracking of the inner PTFE tube.

Note : As the timeframe between first wire rupture and PTFE tube cracking is hardly predictable, we recommend to replace any hoses with wires broken in accordance with AMM TASK 20-23-11-200-003-A "Permitted Damage and Defects on Flexible Hydraulic Hoses" requirements. The identified failure mode (wire braid damage) allows to detect in advance of the hose rupture and make these inspections effective.

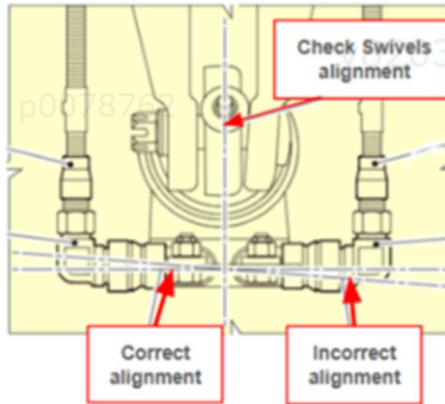

(b) Remove the safety clip(s) and/or tag(s) and close/unlock the applicable circuit breaker(s), refer to Ref. AMM Task 32-31-35-400-001.

(c) Remove the access platform(s) from the work area Door 734 LH MLG and/or Door 744 RH MLG.