

Customer Complaint _ Visit report

Customer Name: M/s. Sunrack

Location: Bangalore- Karnataka

Segment: OEM

Supplied Plant: Hazira

Visit Date: 11/06/2026

Visited By: Mr. Aswath

Visit report: M/s. JLM Automative, Bangalore


Process Flow:

AMNS (Coil) -> Sunrack (Rack Manufacturer) -> Suntrop Solar (Solar Installation) -> JLM Automatics (End Customer)

1. Suntrop has installed solar structures at JLM Auto, Kachohalli, Bangalore on 23.02.2026.
2. Structures procured from Sunrack on 16.02.2026.
3. After 2 months, rust has been observed in few components.




Rusting accompanied by liquid stains is evident in all rusted trays

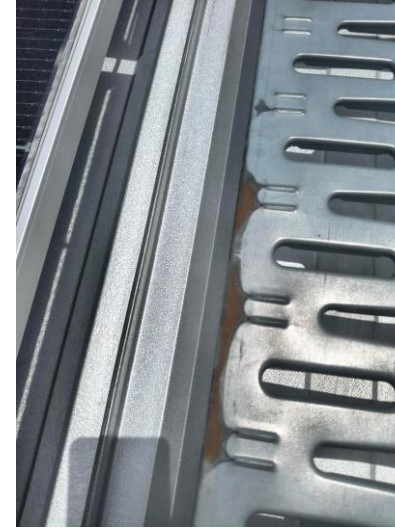

Shoe marks with some
liquid stain evident



Liquid stains is evident in some rusted trays

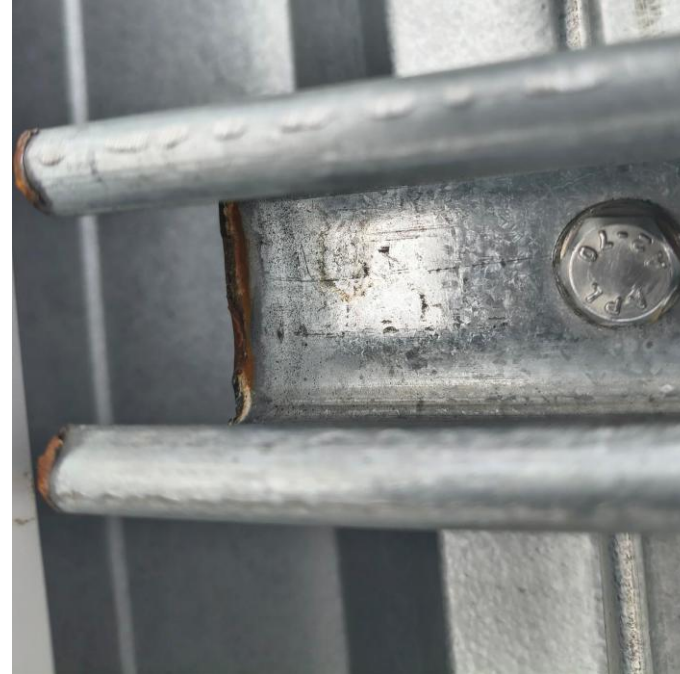

Excess Forming Flash was noticed in support frame edges which has led to the red rust in edges

Visit Observations:

- Site visit conducted on 11.06.2026 jointly with Suntrop team.
- Total 75 walk trays (total length ~150 m) installed; out of which 10 trays found with rust.
- Supporting frame edges also observed with red rust.

Points Concluded

- Supplied material to Sunrack is of acceptable quality and free from inherent defects. No complaints received from sunrack during processing.
- Rusting limited to 10 out of 75 components and localized liquid spillage observed; likely due to improper handling, storage or transportation leading to coating damage and corrosion.
- Excess forming flash observed at supporting frame edges, identified as primary cause for red rust.
- Self-healing is applicable only for scratches or properly sheared edges over time; coating damage areas due to improper handling or craftsmanship are not guaranteed for protection.

AM/NS INDIA

ArcelorMittal Nippon Steel India

Thank You !

**BANAUNGA MAIN,
BANEGA BHARAT.**



SMARTER STEELS
BRIGHTER FUTURES



**AM/NS
INDIA**
ArcelorMittal Nippon Steel India

#BMBB

**SMARTER STEELS
BRIGHTER FUTURES**