

MAINT SAV

SOTRAL INDUSTRIE SAS

p.riviere@sotral-industrie.fr

Tel. 04 78 55 44 33

Service report 21/09/2026

Your contact:

Julien DURAND

Technicien SAV

j.durand@bfr-systems.fr

Tel. 06 12 34 56 78

Accompanied by : Thomas BERNARD

In Blyes, on 21/09/2026,

For the attention of M. Pascal Rivière,

SERVICE CALL		No. 260921-01	
Machine 1 : Presse hydraulique 120 T Model : PH-120/4D Serial number : PH1204D-2011-0387			
Machine 2 : Convoyeur d'évacuation C40 Model : C40-MOD Serial number : SN-CONV-0492			
Subject / request Full mechanical audit requested by maintenance: abnormal noise and increasing vibration on the hydraulic power unit, output down by about 15%.		Location Atelier 2 — ligne d'emboutissage 4	
On-site contact M. Pascal Rivière — Responsable maintenance		Customer phone / e-mail 04 78 55 44 33 / p.riviere@sotral-industrie.fr	
Service date 21/09/2026 au 22/09/2026		On-site times 2 Service days	
Time on site 15 h 00 (15,00 h)		Outward journey 06:45 - 08:15 (1 h 30)	
Return journey (est.) ~15:40 - ~17:10 (1 h 30 [estimated])		Total travel time 3 h 00 (3,00 h)	
Grand total (site + travel) 18 h 00 (18,00 h)			
On-site technician(s) Julien DURAND [Lead technician] · Thomas BERNARD			

SERVICE DAYS BREAKDOWN				2 Service days
Date	On-site times	Break	Time on site	Activity / Work
21/09/2026	08:15 - 17:00	45 min	8 h 00 (8,00 h)	Mechanical audit of hydraulic power u...
22/09/2026	08:00 - 15:45	45 min	7 h 00 (7,00 h)	Belt replacement, oil change, tuning a...
Cumulative total			15 h 00 (15,00 h)	

1. SUMMARY OF THE SERVICE CALL

1 Safety issue	1 Urgent	1 High priority	2 Low priority	1 Informational
-------------------	-------------	--------------------	-------------------	--------------------

Mechanical 3 event(s)
Electrical 2 event(s)
Automation 1 event(s)
Hours spent on site 15 h 00 (15,00 h)
Attached photos 5
Safety / urgent points 2

Technician's summary

Full audit of the hydraulic power unit as requested. The loss of output is explained by slippage of the slack belt (estimated slip 8 to 10%) and by the thermal drift of the oil (68 C), which lowers the volumetric efficiency of the pump. The noise and vibration come from the main shaft bearing at end of life. After the work, the machine returned to its rated output; two outstanding items remain: the main bearing and the leak at the discharge fitting.

Customer's subject / request

Full mechanical audit requested by maintenance: abnormal noise and increasing vibration on the hydraulic power unit, output down by about 15%.

2. SAFETY AND EMERGENCIES

Évènement 1 / 2

Mechanical — [Presse hydraulique 120 T]

09:20

URGENT

Main shaft bearing at end of life: axial play measured with a dial gauge 0.18 mm (0.05 mm max.), temperature rise recorded at 81 C and characteristic noise at 1,450 rpm. Replacement to be scheduled within 48 h - risk of seizure within 250 production hours.

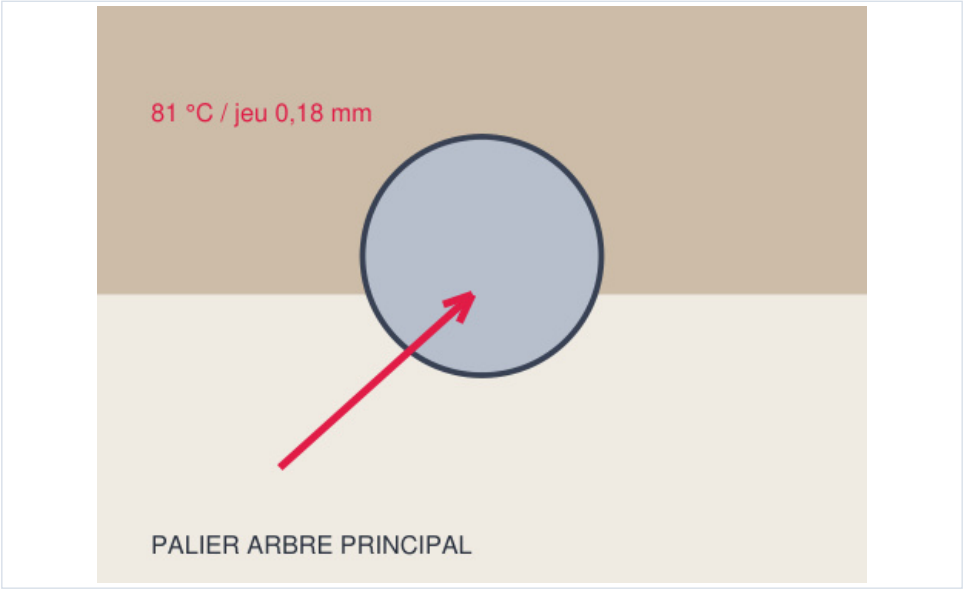


Photo 1

2. SAFETY AND EMERGENCIES

Évènement 2 / 2

Electrical

14:30

SAFETY ISSUE

No drip tray under the hydraulic power unit and oil marks on the floor in front of the cabinet: slip risk reported to the maintenance manager, area cordoned off pending compliance work. To be addressed before production resumes on 3 shifts.

3. HIGH-PRIORITY POINTS

Mechanical — [Presse hydraulique 120 T]	10:05	HIGH PRIORITY
---	-------	---------------

Pump drive V-belt slack: measured deflection 12 mm against a maximum of 8 mm. Visible cracking and rubber deposits in the pulley groove. Belt replaced (XPB 2360) and tension set to 7 mm.

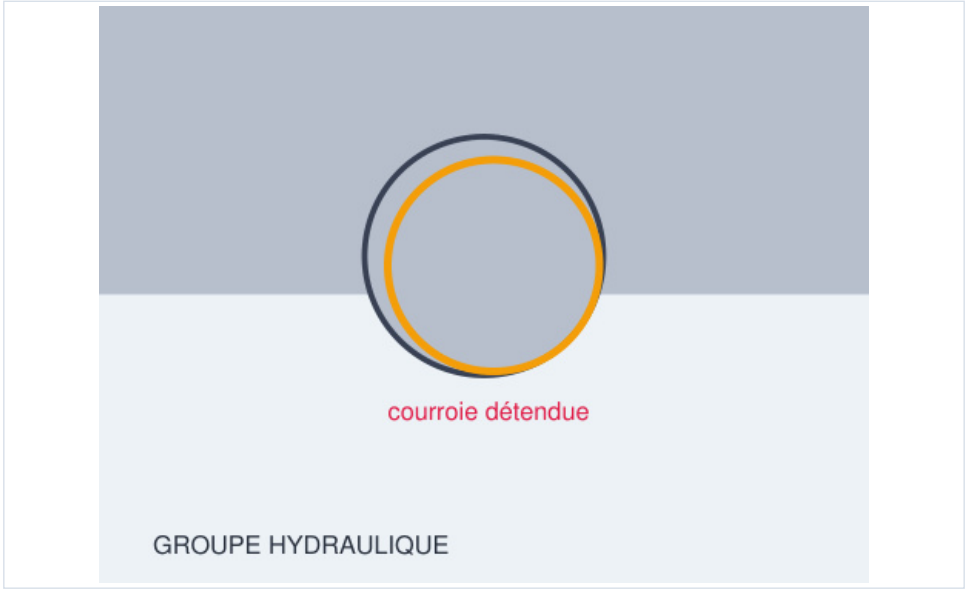


Photo 2

4. LOW-PRIORITY POINTS

Évènement 1 / 2

Electrical — [Convoyeur d'évacuation C40]

11:10

LOW PRIORITY

Electrical cabinet: ventilation filter clogged with dust and two cable glands loose at the bottom. Filter vacuumed, glands retightened. No insulation fault found on the motor and control circuits.

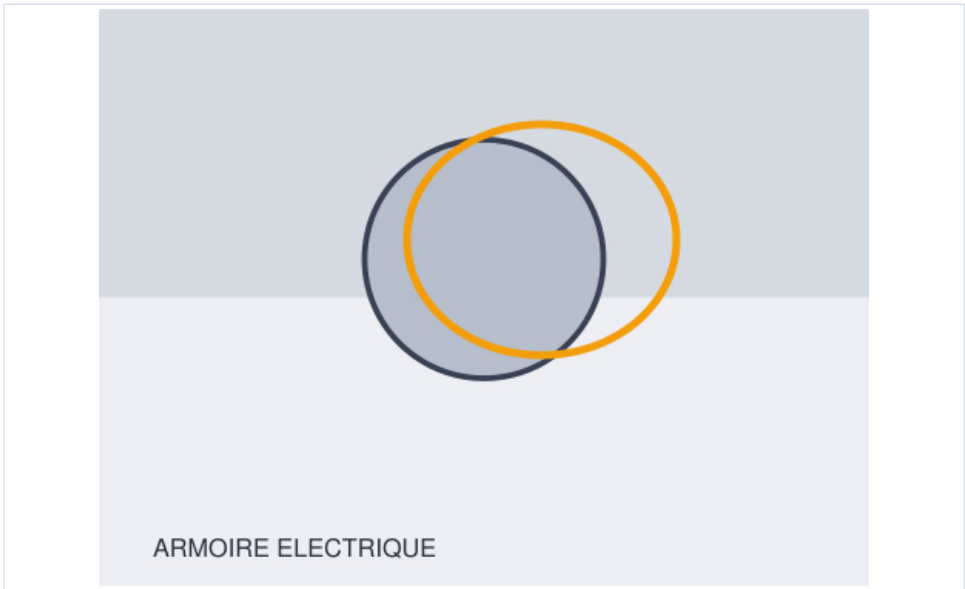


Photo 3

4. LOW-PRIORITY POINTS

Évènement 2 / 2

Mechanical	13:40	LOW PRIORITY
------------	-------	--------------

Four cracked motor mounting bushes (visible deformation) and two bearing lubrication points not done for over 6 months. Full lubrication completed, bushes to be replaced within 1 month.

5. ADDITIONAL INFORMATION

Automation — [Convoyeur d'évacuation C40]	14:05	INFORMATIONAL
---	-------	---------------

S7-300 PLC: HMI parameters correct, program backup verified on the memory card. Cycle counter reads 1,942,000 cycles against a recommended preventive maintenance at 2,000,000: to be scheduled at the next shutdown.

6. WORK PERFORMED

Replacement of the V-belt and cleaning of the pulley groove; tension set to 7 mm. Full lubrication of the bearings and the connecting-rod head. Torque retightening of the frame bolts and motor mountings. Cleaning of the oil cooler core and of the cabinet filter. Check and refurbishment of the cartridge filtration. No-load then on-load test: rated output restored, oil temperature stabilised at 61 C.

7. WORK TO BE PLANNED

- 1) Replace the main shaft bearing within 48 h (part ref. 63-2216-C3) - estimated labour 4 h, machine downtime 1 day.
- 2) Replace the 4 motor bushes within 1 month.
- 3) Fit a drip tray and an absorbent mat under the hydraulic power unit (safety).
- 4) Schedule replacement of the hydraulic power unit at 2,000,000 cycles.
- 5) Set up a periodic lubrication schedule and a monthly vibration reading.

8. SPARE PARTS

2 spare part(s)

Description	Part number	Quantity
V-belt XPB 2360	BFR-8820-XPB	1
Hydraulic filter cartridge 10 µm	HYD-FILT-010	2

The customer's signature constitutes acceptance of the final quote and validation of the spare parts listed above.

9. ADDITIONAL PHOTOS

2 photo(s)

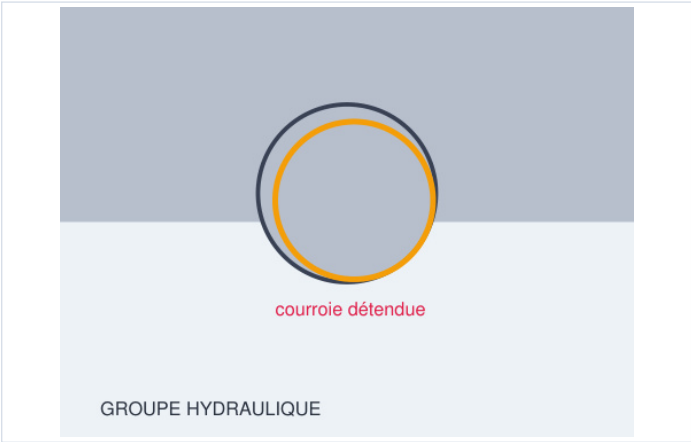


Photo 4 — Overall view of the hydraulic power unit

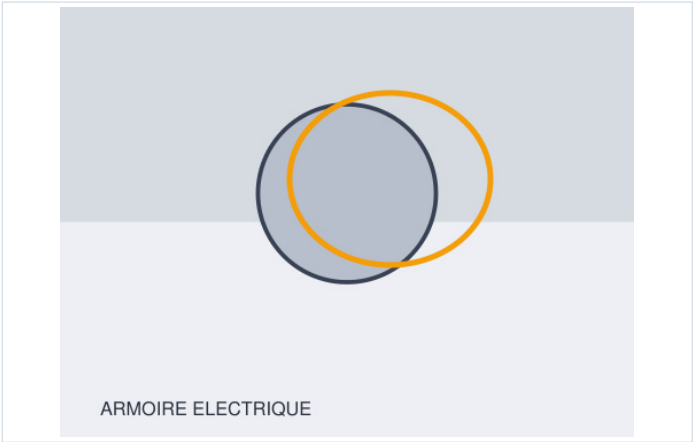


Photo 5 — Electrical cabinet - general condition

10. VALIDATION

The customer acknowledges having read this report, having received the technician's explanations, and accepts the findings and the work described.
La signature du client vaut pour acceptation du devis final et validation des pièces de rechange ci-dessus. La durée du trajet retour est estimée sur la base du trajet aller constaté.

The customer (approved)

Pascal RIVIÈRE
Responsable maintenance
Date: 21/09/2026 at 15:35



Accompanied by : Thomas BERNARD

The technician

Julien DURAND
Technicien SAV — 06 12 34 56 78 · j.durand@bfr-systems.fr
Date: 21/09/2026 at 15:40

