

# **Application note:** Parameterization of spreadCycle™

TRINAMIC® Motion Control GmbH & Co. KG GERMANY

#### www.trinamic.com

This application note is meant to be a practical guideline for parameterization of the TRINAMIC ICs with spreadCycle™ chopper, as well as for evaluation boards and module products using these ICs. In order to understand *where* to find the parameters mentioned, and how to set them, please refer the specific product documentation.

# 1 Table of contents

1	T	ABLE OF CONTENTS	1
2	O	PTIMIZING CHOPPER SETTINGS	2
	2.1	UNDERSTANDING RELEVANT MOTOR SETTINGS	2
3 S		QUALITATIVE APPROACH TO OPTIMIZE CHOPPER SETTINGS FOR A TWO PHASE PER	3
	3.1	Preparations	3
	3.2	LOW AND MEDIUM VELOCITY OPTIMIZATION	
	3	2.1 Optimize chopper settings – behavioral approach	5
	3.	2.2 Optimize chopper settings – measure with oscilloscope	
	3.3	USING HYSTERESIS DECREMENT	
	3.4	STAND STILL OPTIMIZATION	8
	3.5	HIGH VELOCITY OPTIMIZATION	9
4	O	PTIMIZING CHOPPER SETTINGS FOR CLASSIC CHOPPER OPERATION	11
5 S		QUALITATIVE APPROACH TO OPTIMIZE CHOPPER SETTINGS FOR A THREE PHASE	
	5.1	Preparations	13
	5.2	LOW AND MEDIUM VELOCITY OPTIMIZATION	
	5.3	HIGH VELOCITY OPTIMIZATION	
6	RI	EVISION HISTORY	15
	6.1	DOCUMENTATION REVISION	15

# 2 Optimizing chopper settings

Chopper settings can easily be optimized by watching the motor axis behavior and feeling motor vibration with your finger tips, and by optionally measuring the motor current with an oscilloscope. The following description shall give a guideline to come to good chopper settings for your application with a minimum time-effort.

#### 2.1 Understanding relevant motor settings

As a first step, you should understand which parameters have a direct or indirect influence on the chopper settings, and thus should be selected before starting optimization.

Parameter	Description	Setting		
Motor type	Each motor type has unique characteristics like torque curve, inductivity, back-EMF, microstep quality and coil resistance.	Choose a motor fitting your requirements based on the motor torque curve, cost, current, etc. Generally a higher current winding will bring higher velocity limits.		
Driver supply voltage	Motors cannot operate well below or above their specific voltage limits.	As a guideline, satisfy:  R <sub>COIL</sub> * I <sub>COIL</sub> << VS < 25 * R <sub>COIL</sub> * I <sub>COIL</sub>		
Motor coil current	Normally, stepper motors work best at their nominal current, as they provide the highest torque and lowest relative torque ripple. However, factors which might lead to operation at reduced current levels are 1. Reduction of power dissipation 2. Standby operation	As a guideline operate a stepper at 50% to 100% of nominal current. A short time increase using coolStep™ will provide for extra torque, while the nominal current can be reduced. In standby, current can be reduced down to zero, depending on mechanics and application.		
Velocity	<ol> <li>There are three basic ranges:         <ol> <li>Low velocity (slow, a few microsteps per second) – here the microstep performance is most important for equidistant steps</li> <li>Medium velocity (motor turning faster) – the optimum sine waveform can be reached, because the back EMF voltage is still below the supply voltage V<sub>S</sub></li> <li>High velocity (motor at several rounds per second) – the sinusoidal target waveform cannot be reached any more. The waveform becomes distorted and motor torque drops with increasing velocity.</li> </ol> </li> </ol>	The motor behavior can be optimized for all of these velocity ranges. Range 1 (slow) and 2 (medium) can be optimized together. Range 3 (fast) might profit from fullstepping and thus can be optimized separately, in case the optimization for range 1 and 2 does not prove sufficient for the application.		
Chopper frequency	The chopper frequency is determined by many parameters. Basically, it usually should be outside the audible range, i.e. above 16 to 20kHz, but not too high, i.e. below 50kHz, in order to limit switching losses in the motor and the power driver.	Try to keep chopper frequency low, but above the audible range. For highest velocity operation, a higher frequency may be beneficial.		
Waveform	For most stepper motors a sinusoidal waveform is a good approach. Specific applications requiring most equidistant microsteps may profit from an adapted microstep waveform.	when using a high resolution encoder or		

table 1: Parameters which should be considered before optimizing chopper settings

# 3 A qualitative approach to optimize chopper settings for a two phase stepper

We will optimize motor settings for the required velocities sequentially; however one or more iterations might be taken in case a single set of settings is desired.

#### 3.1 Preparations

Take you motor into operation at nominal conditions. Attach an oscilloscope with current probe to one of the motor coils, if possible. You might measure the coil voltage to assess the chopper frequency. In case you have access to the sense resistors, measure the voltage over one or both sense resistors. This way, you do not need a current probe.

- 1. Select proper hardware settings like blank time *TBL*.

  Hint: A too low *TBL* will lead to distorted sine waves, but the value should not be unnecessarily high. 1-2µs (*TBL*= 1 or 2 at 16MHz clock frequency) is a good starting point.
- 2. Switch on spreadCycle chopper mode (*chm*=0)
- 3. Choose an off-time setting  $t_{OFF}$  in the range of 5µs to 20µs

$$TOFF = \left| t_{OFF} * \frac{f_{CLK}}{32} - \frac{12}{32} \right|$$

4. Choose a hysteresis end value of 5 to 12, e.g. 10, and write it to HEND (HSTART=0, HEND=13). Remember, that HEND uses an offset of -3, HSTART uses an offset of +1.

### 3.2 Low and medium velocity optimization

In the low and medium velocity range, the motor is to work with equidistant steps, lowest possible vibration, and low chopper noise. Use highest possible microstep resolution for your tests.

Operate your motor at a medium velocity. Try feeling motor vibrations at different velocities with your fingertips. Try seeing and feeling microstep equidistance at very low velocities.

Hint: A long pointer attached to the motor axis will help checking microstep performance at lowest velocity.

You might want to check the current waveform using an oscilloscope. The oscilloscope should show a pure sine wave as shown in figure 1. In case, the sine wave is distorted like shown in figure 2, the motor velocity is too fast, or the supply voltage is not high enough. A distortion as shown in figure 3 is a hint for a too low blank time setting. Increase *TBL* by one. Other distortions are a hint to a layout problem.

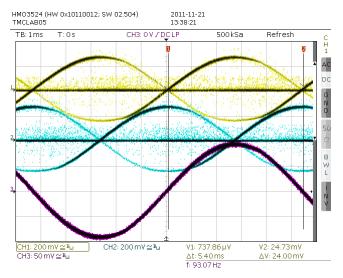


figure 1: Current waves: CH1 & CH2: Sense resistor voltages, CH3: Current probe on coil A

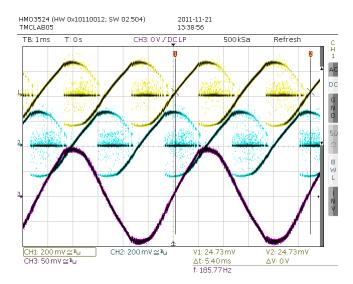


figure 2: Velocity too high – motor current cannot follow

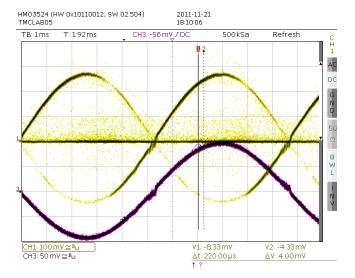


figure 3: Distortion caused by too low blank time setting TBL

#### 3.2.1 Optimize chopper settings – behavioral approach

1. Now, reduce hysteresis to 0 (e.g. *HSTART*=0; *HEND*=2). You should perceive increased motor noise and less equidistant microsteps. Vary the motor velocity, if you do not perceive any difference in motor vibration between hysteresis 0 and the previous hysteresis value. When observing microstep equidistance at very low velocity, the motor will make a few shorter steps in intervals matching to the microstep resolution – this will look like the motor pausing and continuing rotation once at each halfstep position.

Increase the *HEND* hysteresis setting, until motor vibration does not reduce further or microstep equidistance does not benefit anymore from a further increase. Do one or two additional increments if in doubt, to compensate for stray of analog parameters, like supply voltage, etc. If you reach the limit of *HEND* setting (*HEND*=15), you can increment *HSTRT* up to *HSTRT*=3.

- 2. In case, you end up with a hysteresis setting higher than 15, or the chopper frequency becomes audible (high pitch chirping), reduce off-time (*TOFF*) and go back to step 1.
- 3. Try increasing off time (*TOFF*) and find the value where audible chopper noise occurs. Go back by some steps again and go back to step 1 with the new setting. This way, the chopper frequency becomes reduced, in case it was higher than necessary.

#### 3.2.2 Optimize chopper settings – measure with oscilloscope

1. Stop the motor at a position, where one coil current has a medium value, e.g. at a fullstep position. Attach the oscilloscope probe and measure sense resistor voltage to GND. Take a single shot of one or a few chopper cycles as shown in figure 4 (showing a chopper operating at 40kHz).

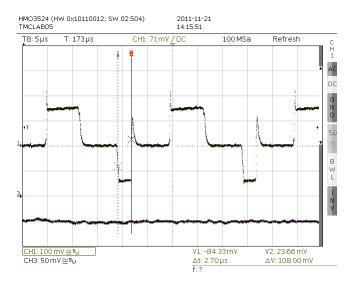


figure 4: Measure the duration of the fast decay state (2.7μs): CH1: sense resistor voltage, CH3: coil current

2. Check the duration of the fast decay cycle as shown – the duration will vary slightly from cycle to cycle. Its (estimated) medium duration should be slightly larger than the blank time t<sub>BLANK</sub> (see table). In case, the duration is too short, increase the *HEND* hysteresis setting. If you reach the limit of *HEND* setting (*HEND*=15), you can increment *HSTRT* up to *HSTRT*=3. In case the duration is much longer than t<sub>BLANK</sub>, reduce the hysteresis.

Parameter	Description	Setting	Comment
TBL	Selects the comparator blank time t <sub>BLANK</sub> .	0	16 t <sub>CLK</sub>
		1	24 t <sub>CLK</sub>
		2	36 t <sub>CLK</sub>
		3	54 t <sub>CLK</sub>

table 2: Blank time setting

3. Measure the chopper frequency. A frequency between 20kHz and 50kHz is a reasonable value. Increase *TOFF* in case the frequency is too low, decrement *TOFF* in case the frequency is too high. Go back to step 1, after changing *TOFF*.

#### 3.3 Using hysteresis decrement

The hysteresis decrementer will stabilize the chopper frequency in low voltage situations and when the motor back EMF comes near to the supply voltage at increased motor velocity. Therefore, two additional steps are required:

- 1. Now distribute the hysteresis value you determined to *HSTART* and *HEND* value. As a thumb rule, we will put 20%-30% of the hysteresis value to hysteresis start setting.
  - Example: In case you determined a hysteresis value of 10, set HSTART=2; HEND=10. Taking into account the offsets of +1 for HSTRT and -3 for HEND, this results in hysteresis start = 3+7 and hysteresis end = 7.
- Choose hysteresis decrement speed if your driver allows it. In case you target high chopper frequencies (≥40kHz), use 16 clocks (HDEC=0) setting. In case you target lower chopper frequencies (25 - 40kHz), you can increase to 32 clocks (HDEC=1), or for lower frequencies a higher setting. If hysteresis decrement shall not be used, put most of the value to HEND or use highest HDEC setting.

#### 3.4 Stand still optimization

In standstill, chopper noise and position maintenance are the main targets of optimization. In case the current can be reduced to zero (driver off), chopper noise is zero, but the motor position must be maintained by mechanical friction. In order to keep the microstep target position, or in case increased holding torque is required, the motor current cannot be reduced to zero, but typically to 25% to 75% of operating current.

Put the motor to very slow motion but use the stand still current settings. One or a few microsteps per second will fit, in order to assess stand still chopper noise at different positions, as it will randomly occur at some microstep positions.

In case, stand still chopper noise is not an issue or is already good, you can skip this step.

Hint: Stand still chopper noise often can only be assessed in a quiet environment, as it should be barely audible

1. Try increasing the chopper frequency by reducing *TOFF* setting to reduce audible noise at noisy positions. You might also try reducing the chopper frequency, as mechanics transmits different frequencies with different quality.

*Hint:* After modifying *TOFF*, you might need to optimize low and medium velocity chopper settings again.

- 2. Try switching on random off time (*rndtf*). This will spread the spectrum of noise.
- 3. In case your driver supports chopSync<sup>™</sup>, switch on chopSync<sup>™</sup> alternatively to *rndtf*. Use a frequency f<sub>SYNC</sub> near your target chopper frequency. Reduce *TOFF* by a few decrements to ensure that the native chopper frequency is lower than the chopSync<sup>™</sup> frequency.

$$SYNC = \left[ \frac{f_{CLK}}{64 * f_{SYNC}} \right]$$

In case switching on chopSync™ leads to half the desired chopper frequency becoming audible, reduce *TOFF* or increase SYNC.

Additionally, select a velocity threshold VHIGH at low or medium operating velocity, above which chopSync<sup>TM</sup> becomes switched off, as it will lead to worse motor noise at increased velocity.

*Hint:* After switching on chopSync™, you might need to optimize low and medium velocity chopper settings again.

4. Try reducing motor current further, if feasible.

Attention: Excessive standstill chopper noise often is a hint to a bad PCB layout.

#### 3.5 High velocity optimization

At high velocity, the motor resonance must be kept low, in order to maintain torque as high as possible. Microstep waveforms play a reduced role, as the waveform cannot be maintained in this velocity range anymore (see figure 2), getting worse with each increase in velocity. Fullstepping sometimes brings a few percent increased motor torque. For high velocity behavior, it is more important to operate the motor with its application specific load or in its application environment, but you can do first tests by braking the motor with your fingers, in order to assess its torque before it stalls.

You can test high velocity behavior by slowly accelerating the motor to the target velocity. In case, your motor has high resonances or even stalls, before it reaches the target velocity, retry with a faster acceleration, and try to make sure that you skip the critical velocity in your later application. At extremely high velocities, the impact of mechanical motor load and mounting conditions is larger, as the driver cannot control the current waveform anymore (compare figure 7).

1. You might decide to increase chopper frequency for high velocity operation by reducing *TOFF* setting. A higher chopper frequency reduces the response time of the chopper.

*Hint:* After modifying *TOFF*, you might need to optimize low and medium velocity chopper settings again.

- 2. Try switching the motor to fullstepping, if your driver supports it. Make sure, that the driver coils see a fixed current. Therefore it is important to switch to fullstep at or near the fullstep positions (TMC26x based drivers) compare figure 5. Set *vhighfs* (for TMC562 based drivers).
- 3. As fullstepping does not require high precision chopper operation, you can try to switch to slow decay only chopper compare figure 6, e.g. by setting *vhighchm* (for TMC562 based drivers).
- 4. Figure out a velocity threshold *VHIGH* for switching to fullstepping. The threshold can be determined using an oscilloscope and finding the velocity, above which the microstep sine wave cannot be maintained, as shown in figure 2, or, by assessing motor noise and vibration.

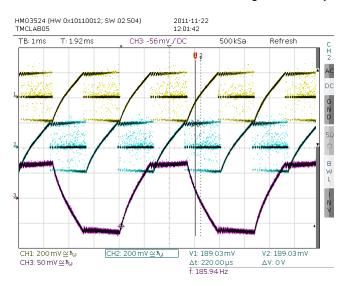


figure 5: Motor in fullstep operation (CHM=0); CH1 & CH2: Sense resistor voltages, CH3: Current probe coil A

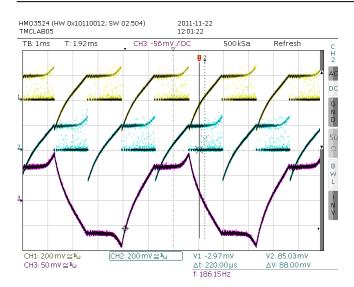


figure 6: Motor operation in fullstep with slow decay only (CHM=1)

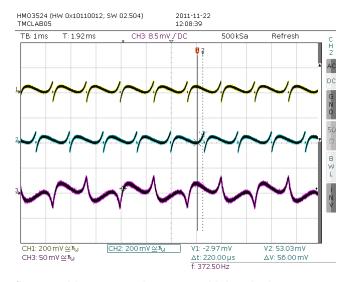


figure 7: Motor operation at very high velocity

### 4 Optimizing chopper settings for classic chopper operation

The classic chopper mode can be used instead of spread cycle chopper, in case you want to try operation in this mode. For most motors it will be inferior to spreadCycle™. Similar to the descriptions on spreadCycle™, *TBL*, *TOFF*, *TFD* and wave offset (*OFFSET*) can be determined for *chm*=1 based on motor resonance and microstep quality. The following scope shots are meant to give some hints on good and bad settings. The scope shots show: CH1 & CH2: Sense resistor voltages, CH3: Current probe on coil A.

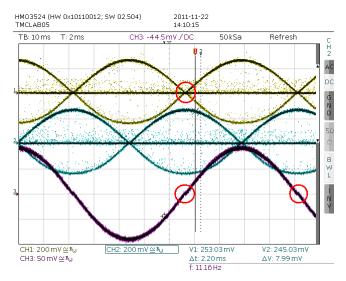


figure 8: Offset too low (plateau in current zero crossing) – increase OFFSET

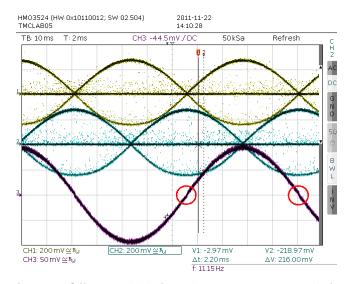


figure 9: Offset too high (step in current zero crossing) – decrease OFFSET

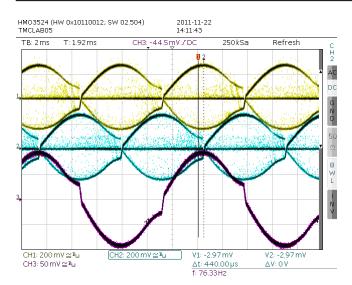


figure 10: Fast decay portion insufficient at increased velocity (increase TFD or reduce TOFF)

# 5 A qualitative approach to optimize chopper settings for a three phase stepper

A three phase motor differs from the two phase motor in one main aspect: Its coils have an internal interconnection. Thus, the chopper scheme differs. However, having taken into operation a two phase motor with spreadCycle™ chopper will allow you to get a three phase motor parameterized quickly.

We will optimize motor settings for the required velocities sequentially; however one or more iterations might be taken in case a single set of settings is desired.

#### 5.1 Preparations

Take you motor into operation at nominal conditions. Attach an oscilloscope with current probe to one of the motor coils, if possible. You might measure the coil voltage to assess the chopper frequency. In case you have access to the sense resistor, measure the voltage over the single sense resistor, too. This way, you do not even need a current probe.

- 1. Select proper hardware settings like blank time *TBL* and motor current scale. *Hint:* A too low *TBL* will lead to distorted sine waves, but the value should not be unnecessarily high. 1.5-2.5µs (*TBL*= 2 or 3 at 16MHz clock frequency) is a good starting point.
- 2. Choose an off-time setting  $t_{OFF}$  of two: TOFF = 2. Set the flag *nosd* in order to skip off time. Most motors will not need an additional off time in each chopper cycle.
- 3. As we will work with Step/Dir input, choose chopper direction UVW (*cdir*=1). This will always chop the coils in the same order as the motor runs, which is optimum. Let the chopper synchronization switched off (*csync*=0), as it is not needed unless you want to turn the motor quickly.
- 4. Choose a hysteresis end value of 5 to 12, e.g. 10, and write it to HYST.

#### 5.2 Low and medium velocity optimization

In the low and medium velocity range, the motor is to work with equidistant steps, lowest possible vibration, and low chopper noise. Use highest possible microstep resolution for your tests.

Operate your motor at a low to medium velocity. Try feeling motor vibrations at different velocities with your fingertips. Try seeing and feeling microstep equidistance at very low velocities.

Hint: A long pointer attached to the motor axis will help checking microstep performance at lowest velocity.

You might want to check the current waveform using an oscilloscope. The oscilloscope should show a pure sine wave as shown in figure 11 In case, the sine wave is distorted like shown in figure 12 or figure 13, the motor velocity is too fast, or the supply voltage is not high enough. A completely distorted waveform at a low velocity is a hint for a too low blank time setting. Increase *TBL* by one.

For a three phase stepper motor operated with spreadCycle chopper, tuning of the hysteresis setting is most important – it trades chopper noise against accuracy. At the optimum setting, the motor runs smoothly. When increasing the hysteresis, chopper noise increases, but the motor does not benefit.

Tuning *HYST* setting:

- 1. Increase *HYST* coming from a low setting like 5. Stop as soon as the motor is not turning more smoothly with an additional increment. If checked with an oscilloscope, you will see the sine wave becoming more smoothly, but it is very hard to see distortion in the wave.
- 2. In case chopper noise becomes audible, increase supply voltage if possible, or decrease motor current. If there is no good setting, you will need to use a lower inductivity motor.

#### 5.3 High velocity optimization

In the high velocity range (see figure 12 or figure 13), the motor is to work with low resonance. Best setting is typically with a synchronized chopper. Switching on *csync* will also not harm at low velocities, but you will see a little disturbance in current zero crossing when checking with an oscilloscope.

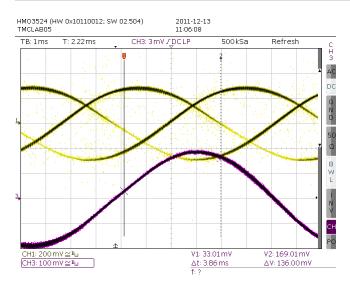


figure 11: Three phase motor operating optimally - ch1: sense resistor, ch3: current probe

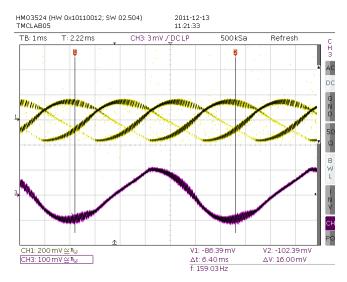


figure 12: Thee phase motor operating slightly above back EMF voltage limit velocity

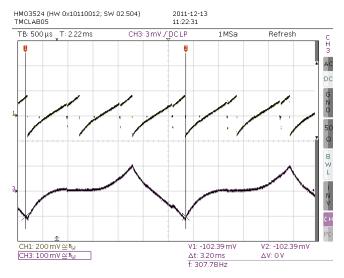


figure 13: Three phase motor operating at high velocity with synchronized chopper (csync=1)

6 Revision history

## 6.1 Documentation revision

Version	Date	Author BD=Bernhard Dwersteg	Description
0.1	2011-NOV-24	BD	First version
0.2	2011-DEC-13	BD	Added 3 phase motor

table 3: Documentation revisions