




HP LaserJet Enterprise MFP M631, M632, M633

HP LaserJet Enterprise MFP M634, M635, M636, M637

HP LaserJet Managed MFP E62555, E62565, E62575

HP LaserJet Managed MFP E62655, E62665, E62675

Control Panel Message Document (CPMD)

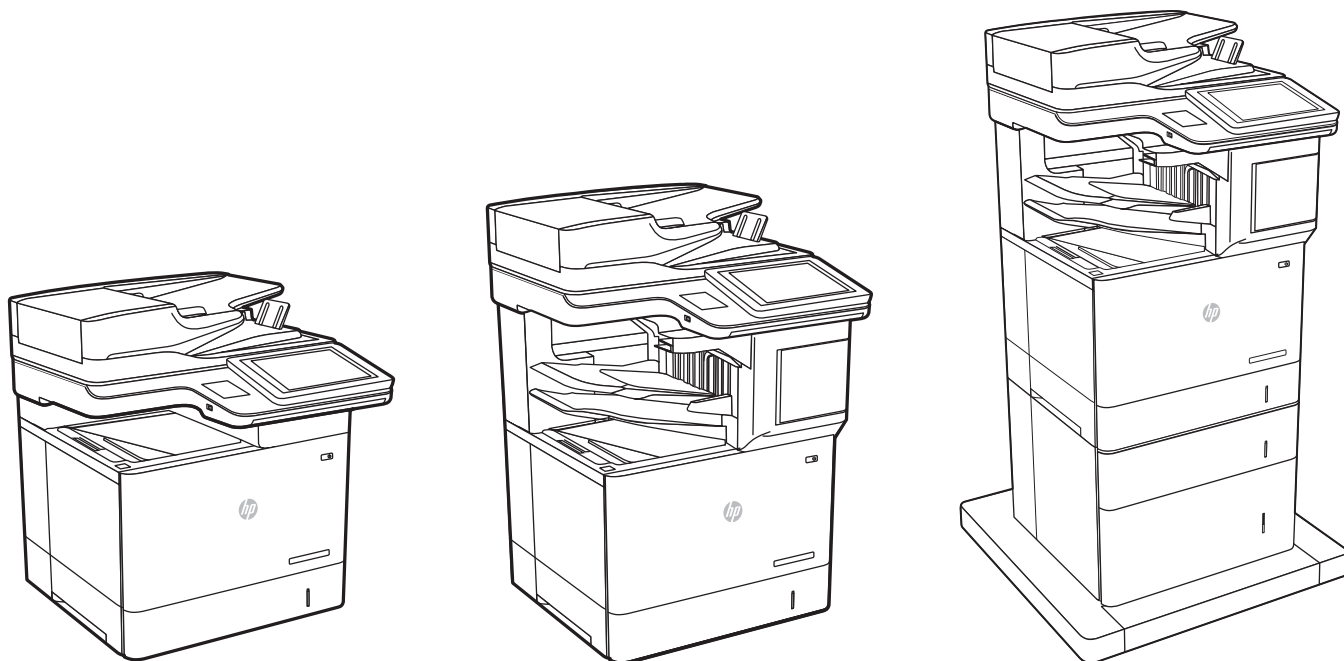

www.hp.com/support/ljM631MFP

www.hp.com/support/ljM632MFP

www.hp.com/support/ljM633MFP

www.hp.com/support/ljM634MFP

www.hp.com/support/ljM635MFP

www.hp.com/support/ljM636MFP

www.hp.com/support/ljM637MFP

www.hp.com/support/ljE62555mfp

www.hp.com/support/ljE62565mfp

www.hp.com/support/ljE62575mfp

www.hp.com/support/ljE62655mfp

www.hp.com/support/ljE62665mfp

www.hp.com/support/ljE62675mfp





HP LaserJet MFP M631, M632, M633,
M634, M635, M636, M637, E62555,
E62565, E62575, E62655, E62665, E62675
- Control Panel Message Document
(CPMD)

SUMMARY

This document provides error-code troubleshooting information

Legal information

Copyright and License

© Copyright 2023 HP Development Company, L.P.

Reproduction, adaptation, or translation without prior written permission is prohibited, except as allowed under the copyright laws.

The information contained herein is subject to change without notice.

The only warranties for HP products and services are set forth in the express warranty statements accompanying such products and services. Nothing herein should be construed as constituting an additional warranty. HP shall not be liable for technical or editorial errors or omissions contained herein.

Edition 6, 3/2025

Trademark Credits

Adobe®, Adobe Photoshop®, Acrobat®, and PostScript® are trademarks of Adobe Systems Incorporated.

Apple and the Apple logo are trademarks of Apple Inc., registered in the U.S. and other countries.

macOS is a trademark of Apple Inc., registered in the U.S. and other countries.

AirPrint is a trademark of Apple Inc., registered in the U.S. and other countries.

Google™ is a trademark of Google Inc.

Microsoft®, Windows®, and Windows Server® are U.S. registered trademarks of Microsoft Corporation.

UNIX® is a registered trademark of The Open Group.

Table of contents

1 Document last updated	1
2 About this document.....	2
3 Control-panel message types.....	3
Error-code and control-panel-message troubleshooting overview.....	4
Error codes (types and structure)	4
4 How to search for printer documentation	7
WISE - How to access and use.....	8
Accessing WISE.....	8
Using WISE to search for error codes	11
Using WISE to access repair and replace videos for FRUs	14
5 Printer service information.....	18
6 Numerical control panel messages.....	19
10.WX.YZ error messages	20
10.wx.yz error messages	20
10.00.00 e-label Memory Error	21
10.00.10 e-label Missing Memory Error	23
10.00.15 Install Toner Cartridge	25
10.00.30 Used Supply In Use	26
10.00.35 Toner Cartridge Incompatible	26
10.00.59.....	26
10.00.60 Toner Cartridge low	26
10.00.69 Toner Cartridge very low	26
10.00.70 Printing past very low	27
10.23.15 Install Fuser kit	27
10.23.60 Fuser Kit low	33
10.23.70 Replace Fuser Kit	34
10.39.60 Document feeder kit low	36
10.39.70 Document feeder kit very low	43
10.99.31 Non-HP supply in use.	50
10.99.34 Used supply in use.	50
10.99.40 Genuine HP supplies installed	50
10.99.41 Unsupported Supply in use	50
11.WX.YZ error messages	51
11.* errors.....	51

11.00.01 or 11.00.02 Internal clock error	51
13.WX.YZ error messages	56
13.* errors	56
13.00.EE	62
13.00.FF	62
13.A3.Dz	63
13.A4.Dz	69
13.A5.D5	75
13.A3.FF	80
13.AA.EE Left door open	82
13.AB.EE Right door Open	83
13.B2.Az Jam in right door	84
13.B2.D1 Jam in right door	87
13.B2.D2 Jam in right door	89
13.B2.DX Jam in right door	105
13.B2.FF Jam in right door	110
13.B4.FF Jam in right door	111
13.B9.Az Fuser jam	113
13.B9.Cz	115
13.B9.Dz	117
13.B9.FF	120
13.D3.Dz	121
13.D3.FF	123
13.E1.D3 Fuser Area Jam.....	124
13.E1.Dz	126
13.E1.D2	127
13.FF.FF	137
13.60.5z	138
13.60.6z	139
13.60.F0	140
13.80.Az	141
13.80.D1 Paper jam in stapler/stacker	142
13.80.Dz	142
13.80.F0	143
13.83.Az	144
13.83.Dz	145
13.83.FO.....	146
20.WX.YZ error messages	148
20.* errors	148
20.00.00 Insufficient memory <device>	148
21.00.00 Page Too ComplexEvent log error message 21.00.00	148
30.WX.YZ error messages	149
30.* errors	149
30.01.01	149
30.01.08 Home position error	156
30.01.14 Scan system EEPROM error	162
30.01.41 Scanner error	164
30.01.43 SCB memory failure	169

30.01.44	172
30.01.46 Scanner Error	177
30.01.54.....	179
30.01.57	180
30.03.14	183
30.03.20	184
30.03.22 Scanner failure	187
30.03.23 Scanner failure	191
30.03.30 Scanner Failure	195
30.03.45 Scanner Error To continue turn off then on	199
30.04.01 Flatbed Sensor Cable Not Detected	203
30.04.02 Flatbed FFC Cable Not Detected	207
30.04.03 ADF FFC Cable Disconnected	210
30.04.04 ADF Motor Cable Disconnected	214
30.04.05 ADF Sensor Cable Disconnected	218
31.WX.YZ error messages	223
31.* errors	223
31.01.47 Document feeder not detected	223
31.03.14	225
31.03.20 Backside scanner not detected	225
31.03.22 Scanner calibration failure	229
31.03.30 Document feeder pick motor error	231
31.03.31 Document feeder motor stall	233
31.03.33 Backside scanner calibration area dirty	235
31.13.00 Document feeder multi-pick error	239
31.13.01	258
31.13.02	277
31.13.13	296
31.13.14	297
32.WX.YX error messages	300
32.* errors	300
32.08.A1, 32.08.A2, 32.08.A3	300
32.1C.05	300
32.1C.06 (event code).....	300
32.1C.07 (event code)	301
32.1C.08 (event code).....	301
32.1C.09 (event code).....	301
32.1C.0A (event code)	301
32.1C.0D (event code).....	302
32.1C.11 (event code)	302
32.1C.13, 32.1C.14	302
32.1C.15	302
32.1C.2E	302
32.1C.2F	303
32.1C.40	303
32.1C.41	303
32.1C.42	303
32.1C.43	303

32.1C.44	303
32.1C.45	304
32.1C.46	304
32.1C.47	304
32.1C.48	304
32.1C.49	304
32.1C.4A	305
32.1C.56	305
32.1C.57	305
32.1C.58	305
32.1C.60	305
32.1C.61	306
32.1C.62	306
32.1C.68	306
32.1C.69	306
32.1C.6A	306
32.1C.6D	307
33.WX.YZ error messages	308
33.* errors	308
33.01.xx	309
33.02.01 Used board/disk installed	310
33.02.02	310
33.03.02	310
33.03.03 Incompatible formatter installed.	312
33.03.05 EFI Boot error	312
33.03.06	314
33.04.01 Missing TPM.....	314
33.04.02 Missing TPM	315
33.04.03 Unknown TPM	315
33.04.05.....	315
33.05.0z SureStart errors	317
33.05.1x Whitelisting errors	318
33.05.2x Intrusion detection errors	318
33.05.5z Intrusion detection errors	319
33.06.01.....	320
40.WX.YZ error messages	322
40.* errors	322
40.00.01 USB I/O buffer overflow To continue, touch “OK”	322
40.00.02 Embedded I/O buffer overflow To continue, touch “OK”	322
40.00.03 EIO [x] buffer overflow To continue, touch “OK”	322
40.00.04 EIO [x] bad transmission To continue, touch “OK”	322
40.00.05 Embedded I/O bad transmission To continue, touch OK	323
40.08.0x USB storage accessory removed	323
40.0x.05 USB storage accessory removed	323
40.80.04 Failed to read NVRAM	323
41.WX.YZ error messages	324
41.01.YZ	324
41.02.00 Error	326

41.03.FZ Unknown Misprint Error	329
41.03.YZ Unexpected size in tray <X>	330
41.04.YZ Printer Error	332
42.WX.YZ error messages	335
42.* errors	335
44.WX.YZ error messages	336
44.* errors	336
44.01.xx Error Event log message	336
44.02.xx Error Event log message (Multifunction product only.)	337
44.03.xx Error Event log message	337
44.04.xx Error Event log message (Multifunction product only.)	337
44.05.xx Error Event log message (Multifunction product only.)	337
44.07.xx Error Event log message (Multifunction product only.)	338
44.08.xx Error Event log message (Multifunction product only.)	338
44.10.xx Error Event log message (Multifunction product only.)	338
44.11.0E Error Event log message (Multifunction product only.)	338
44.11.xx Error Event log message (Multifunction product only.)	338
44.12.0E Error Event log message (Multifunction product only.)	339
44.12.xx Error Event log message (Multifunction product only.)	339
44.16.01 Error Event log message (Multifunction product only.)	339
44.16.02 Error Event log message (Multifunction product only.)	340
44.16.03 Error Event log message (Multifunction product only.)	340
44.16.04 Error Event log message (Multifunction product only.)	340
44.16.05 Error Event log message (Multifunction product only.)	340
44.16.06 Error Event log message (Multifunction product only.)	341
44.16.07 Error Event log message (Multifunction product only.)	341
44.16.08 Error Event log message (Multifunction product only.)	341
44.16.09 Error Event log message (Multifunction product only.)	341
44.16.0A Error Event log message (Multifunction product only.)	342
44.16.0B Error Event log message (Multifunction product only.)	342
44.16.0D Error Event log message (Multifunction product only.)	342
44.16.0E Error Event log message (Multifunction product only.)	342
44.16.0F Error Event log message (Multifunction product only.)	343
44.16.10 Error Event log message (Multifunction product only.)	343
44.16.FF Error Event log message (Multifunction product only.)	343
44.34.xx Error Event log message	343
44.34.03 Fax Modem Failure	344
44.34.E5 Fax Modem Failure	344
44.92.YZ Error Event log message	345
44.90.xx, 44.91.xx, 44.92.xx Error Event log message	345
46.WX.YZ error messages	346
46.* error messages	346
46.21.52	347
47.WX.YZ error messages	348
47.* errors	348
47.00.xx	348
47.01.xx	349
47.02.xx	349

47.03.xx	350
47.04.xx	350
47.05.xx	351
47.06.xx	351
47.FC.yz Printer Calibration Failed To continue, touch "OK"	352
48.WX.YZ error messages	354
48.* errors	354
49.WX.YZ error messages	355
49.XX.YY Error To continue turn off then on	355
49.21.52	356
49.38.0C	356
49.38.07	357
50.WX.YZ error messages	359
50.* errors	359
50.1x.yz	359
50.2X.YZ	362
50.3X.YZ	365
50.4X.YZ	368
50.6X.YZ	370
50.7F.00	374
50.8X.YZ	377
50.9X.YZ	379
50.AX.YZ	382
50.BX.YZ	384
51.WX.YZ, 52.WX.YZ error messages	387
51.* errors	387
51.00.yz	387
52.00.00/52.00.20 Scanner Startup/Rotation error	388
53.WX.YZ error messages	389
53.A0.y0	389
53.A0.y1	389
53.A1.y0 Enter error message	390
53.A1.y1	390
53.A2.y0	391
53.A2.y1	392
53.B0.0z	392
53.B1.0z	393
53.B2.0z	394
53.B3.0z	394
53.C1.0z Tray "Z" size mismatch.	395
54.WX.YZ error messages	396
54.* errors	396
54.00.01 / 54.00.03	397
55.WX.YZ, 56.WX.YZ error messages	398
55.* errors	398
55.00.01, 55.00.03 or 55.00.04 DC Controller Error	398
55.00.05 Engine Firmware RFU Error	400

55.01.06, 55.02.06 DC controller error To continue turn off then on	401
56.00.YZ	403
56.00.01 Illegal Input Printer Error	403
57.WX.YZ error messages	404
57.* errors.....	404
57.00.01 Fan failure	404
57.00.02 Fan failure	405
57.00.03 Fan failure	405
57.00.04 Fan failure	407
58.WX.YZ error messages.....	409
58.* errors.....	409
58.00.02 Error	409
58.00.03 Error	410
58.00.04 Error	411
58.01.04 Error	411
58.02.04 Error	412
59.WX.YZ error messages	414
59.* errors.....	414
59.00.30 or 59.00.40: Fuser error	414
59.00.50 or 59.00.60	418
59.00.90	419
59.00.C0	420
60.00.0Y, 62.00.00 error messages.....	422
60.* errors.....	422
60.01.02	422
60.01.03.....	425
60.01.04	426
60.01.05	428
60.01.06	429
62.* errors.....	430
62.00.00 No system To continue turn off then on	431
65.X0.AZ error messages.....	432
65.* errors.....	432
66.WX.YZ error messages.....	433
66.* errors.....	433
66.00.77 Output accessory failure	433
66.00.0A Output accessory failure	433
66.80.01 and 66.80.02 device failure	434
66.80.03, 66.80.19, 66.80.20 or 66.80.35 device failure	434
66.80.17 device failure	435
66.80.21, 66.80.22, 66.80.23, and 66.80.33 device failure	436
70.WX.YZ error messages.....	437
70.* errors.....	437
70.00.00 Error To continue turn off then on	437
80.WX.YZ, 81.WX.YZ, 82.WX.YZ error messages.....	439
80.OX.YZ Embedded Jetdirect Error	439

81.WX.YZ EIO Error To continue turn off then on	441
81.09.00 Error	443
82.* errors	444
82.0x.YZ Internal disk device failure	446
82.73.45 Disk Successfully cleaned	449
82.73.46, 82.73.47	449
90.WX.YZ error messages	451
90.* errors	451
90.0F.06	451
90.15.00	453
90.15.01	453
98.0X.0Y error messages	454
98.00.0c	454
98.00.01 or 98.01.00 Corrupt data in firmware volume	457
98.00.02 Corrupt data in the solutions volume	458
98.00.03 Corrupt data in the configuration volume	461
98.00.04 Corrupt data in the job data volume	462
98.03.11	462
99.WX.YZ error messages	463
99.* errors	463
99.00.01 Upgrade not performed file is corrupt	463
99.00.02 Upgrade not performed timeout during receive	464
99.00.03 Upgrade not performed error writing to disk	464
99.00.04 Upgrade not performed timeout during receive	468
99.00.05 Upgrade not performed timeout during receive	468
99.00.06 Upgrade not performed error reading upgrade	468
99.00.07 Upgrade not performed error reading upgrade	472
99.00.08 Upgrade not performed error reading upgrade	475
99.00.09 Upgrade canceled by user	479
99.00.10 Upgrade canceled by user	479
99.00.11 Upgrade canceled by user	479
99.00.12 Upgrade not performed the file is invalid	479
99.00.13 Upgrade not performed the file is invalid	480
99.00.14 Upgrade not performed the file is invalid	480
99.00.2x	480
99.01.xx	481
99.02.01	481
99.02.09	482
99.07.YZ Firmware install error	482
99.07.22 Firmware install error	483
99.09.60 Unsupported disk	485
99.09.61 Unsupported disk	485
99.09.62 Unknown disk	486
99.09.63 Incorrect disk	487
99.09.64 Disk Nonfunctional	487
99.09.65 Disk data error	490
99.09.66 No boot device.	491
99.09.67 Disk is not bootable please download firmware	498

99.39.64 eMMC Nonfunctional	502
99.39.67 eMMC Not Bootable	503
7 Alphabetical control panel messages.....	504
Alphabetical messages	505
Accept bad signature	505
Authentication required	505
Bad optional tray connection	505
Canceling...<jobname>	505
Cartridge low	506
Cartridge Memory Abnormal	506
Cartridge out	506
Checking engine	506
Checking paper path	506
Chosen personality not available To continue touch "OK"	506
Cleaning	507
Clearing activity log	507
Clearing paper path	507
Close left door	507
Close right door	508
Communication lost	510
Data received To print last page press "OK"	514
Event log is empty	514
Expected drive missing	514
External device initializing	515
Fuser Kit low	515
Fuser Kit very low To continue, touch "OK"	515
Gateways failed	515
Genuine HP supply installed	515
Incompatible <Supply>	516
Incompatible supplies	516
Initializing... ..	516
Install fuser unit	516
Install supplies	517
Internal disk device failure To clear touch "OK"	517
Internal disk file operation failed	518
Internal disk file system is full	518
Internal disk is write protected	518
Internal disk not found	518
Internal disk not functional	518
Internal disk not initialized	519
Internal disk spinning up	519
Load Tray <X>: [Type], [Size] To use another tray, press "OK"	519
Loading program <XX> Do not power off	520
Manually feed output stack Then touch "OK" to print second side	520
Manually feed: <Type><Size>	520
No job to cancel	520
No USB drive or files found.....	521
NON HP Supply Installed	523

Output Bin Full	523
Paused... ..	523
Performing Paper Path Test	523
Please Wait... ..	524
Printing Cleaning Page... ..	524
Printing Configuration... ..	524
Printing engine test... ..	524
Printing Event Log... ..	524
Printing File Directory... ..	524
Printing Font List... ..	525
Printing Help Page... ..	525
Printing Menu Map... ..	525
Printing Registration Page	525
Printing stopped... ..	525
Printing Supplies Status Page... ..	525
Printing Usage Page... ..	526
Processing duplex job Do not grab paper until job completes	526
Processing job from tray <x>... Do not grab paper until job completes	526
Processing... ..	526
Processing... copy <x> of <y>	526
RAM disk device failure To clear press "OK"	527
RAM disk file operation failed To clear press "OK"	527
RAM disk file system is full To clear press "OK"	527
RAM disk not initialized	527
RAM disk is write protected To clear press "OK"	527
Ready	527
Ready <IP Address>	528
Receiving Upgrade	528
Remove USB accessory	528
Replace <Supply>	528
Resend external accessory firmware	529
Resend Upgrade	529
Restore Factory Settings	529
RFU Load Error Send full RFU on <X> Port	529
ROM disk device failed To clear press "OK"	529
ROM disk file operation failed To clear press "OK"	529
ROM disk file system is full To clear press "OK"	530
ROM disk is write protected To clear press "OK"	530
ROM disk not initialized To clear press "OK"	530
Sanitizing disk <X> complete Do Not power off	530
Size mismatch in Tray <X>	530
Sleep mode on	531
Supplies low	531
Supply memory warning	531
Too many jobs in queue	531
Tray <X> empty: [Type], [Size]	532
Tray 2 empty: [Type], [Size]	532
Tray <X> lifting	534
Tray <X> open	534

Tray <X> [type] [size]	534
Tray 2 overfilled or roller issue	534
Type mismatch Tray <x>	541
The unit has corrupt data	541
Unsupported drive installed To continue, touch "OK"	542
Unsupported tray configuration	542
Unsupported USB accessory detected Remove USB accessory	542
USB accessory not functional	542
USB hubs are not fully supported Some operations may not work properly	542
USB is write protected To clear press "OK"	543
USB needs too much power Remove USB and then turn off and on	543
USB not initialized	543
USB storage accessory removed Clearing any associated data	544
USB storage device failure To clear press "OK"	544
USB storage file operation failed To clear press "OK"	544
USB storage file operation failed To clear press "OK"	544
USB storage file system is full To clear press "OK"	544
Verifying, Please Wait	544
Waiting for tray <x> to lift	545
Windows Login Required to Use this Feature	545

Index.....	546
------------	-----

1 Document last updated

The following is the last time this document was updated:

Last update: March 12, 2025

2 About this document

This document provides error-code troubleshooting information.



IMPORTANT: Procedures and part numbers change. For current information, use the browser-based format.

Verify PDF is the most current before use. PDF part numbers must be verified with web-based error code information or parts look-up before parts are ordered.

Choose the format that best meets your needs.

Table 2-1 Content format types

Format	Document title example	Recommended use
Web-based	Go to: Product Detail page > Error Code Look-up	Quick access to individual web-based error code troubleshooting TIP: Save Product Detail page URL location in favorites
Web-Base	Go To: WISE default Search page > Enter [Product] and error code	- Access to individual web-based error code troubleshooting - Web-based: Most up-to-date information available
PDF	[Product] - Control Panel Message Document (CPMD) PDF	- Use when support portals are NOT accessible at time of service - Use when a printable document is needed NOTE: Always refer to the printer service manual for removal and replacement procedures NOTE: For current information, use the Web-based format.

3 Control-panel message types

The control-panel messages and event code entries indicate the current printer status or situations that might require action.



NOTE: Event log errors do not appear on the control-panel display. Open the event log to view or print the event log errors.

A control-panel message displays temporarily and might require you (or the applicable user) to acknowledge the message by touching the **OK** button to resume printing or by touching the **Stop** button to cancel the job.

With certain messages, the job might not finish printing, or the print quality might be affected. If the message is related to printing and the auto-continue feature is on, the printer will attempt to resume printing after the message has appeared for 10 seconds without acknowledgement.

For some messages, restarting the printer might fix the problem. If a critical error persists, the printer might require service.

Error-code and control-panel-message troubleshooting overview

This section provides information on error codes and searching for information.

Error codes (types and structure)

Error codes and control-panel messages display on the printer control panel to indicate the current printer status or situations that might require action. Error codes are numerical, or alphanumerical, and have a set structure with six characters (example: 13.WX.YZ).

- The first two characters are numeric and represent the system component that is causing the error. For example, in error code 10 . 22 . 15, **10** = **Supplies** for HP LaserJets.
- The remaining four characters (W, X, Y, and Z values) further define the error.

HP LaserJet and HP PageWide Enterprise error codes are documented in the control panel message document (CPMD) for each printer.

The CPMD is a comprehensive list of error codes, diagnostic and troubleshooting steps to clear or resolve the error, and other helpful information such as service mode pins and part numbers.

The CPMD is continually updated and republished with the latest information for the following error codes.

Table 3-1 ERROR CODES: The first two characters

Error code	System Component	System Error Description
10.WX.YZ	Supplies (LaserJet)	Supply error or supply memory error.
11.WX.YZ	Real-time clock	Internal error with the clock on the formatter.
13.WX.YZ	Jam (LaserJet)	Paper jam or open door jam error.
15.WX.YZ	Jam (PageWide)	Paper jam or open door jam error.
17.WX.YZ	Supplies (PageWide)	Supply error or supply memory error.
20.WX.YZ	Printer memory	Insufficient memory or buffering error.
21.WX.YZ	Page	Page complexity causing a decompression error when trying to process job.
30.WX.YZ	Scanner	Flatbed scanner error occurring inside the unit.
31.WX.YZ	Document feeder	Document feeder, scanner, or jam error.
32.WX.YZ	Backup, restore, or reset	Backup, restore, or reset notification or error.
33.WX.YZ	Security	Backup, Disk, EFI BIOS, Firmware integrity (SureStart), or Trusted Platform Module (TPM) notification or error.
40.WX.YZ	Input/Output (I/O)	Partition manager, secure erase, or USB accessory error.
41.WX.YZ	Fuser, Laser scanner, or Paper path	Miscellaneous error including general and misprint or mismatch errors typically involving (but not limited to) the fuser, the laser scanner, or the paper path.
42.WX.YZ	Firmware	Firmware failure involving the Event Log, Shell, System Manager, or other component.

Table 3-1 ERROR CODES: The first two characters (continued)

Error code	System Component	System Error Description
44.WX.YZ	Firmware	Firmware failure involving a digital sending component.
45.WX.YZ	OXPd/Web Kit (PageWide)	Informational notifications involving the OXPd Web Kit (communications log).
46.WX.YZ	Engine (LaserJet)	Engine communication error.
47.WX.YZ	Firmware	Job parser or printer calibration error.
48.WX.YZ	Firmware	PJA job accounting, job management, or job pipeline error.
49.WX.YZ	Firmware	Firmware communication error.
50.WX.YZ	Fuser (LaserJet)	Fuser error.
51.WX.YZ	Laser scanner (LaserJet)	Laser scanner beam error.
52.WX.YZ	Laser scanner (LaserJet)	Laser scanner startup error.
54.WX.YZ	Sensor	Sensor error (not jam related).
55.WX.YZ	DC controller (LaserJet)	DC controller communication error.
56.WX.YZ	Paper handling (LaserJet)	Paper input/output or accessory error.
57.WX.YZ	Fan	Fan error.
58.WX.YZ	Sensor	Engine sensor failure.
59.WX.YZ	Motor (LaserJet)	Motor error.
60.WX.YZ	Tray motor error (LaserJet)	Tray lifting or pick up error.
61.WX.YZ	Engine (PageWide)	Print engine error with the 8-bit data package.
62.WX.YZ	System (LaserJet)	LaserJet internal system error.
	Print bar (PageWide)	PageWide print system error.
63.WX.YZ	Engine (LaserJet)	General engine error (electrical, communication, etc.).
65.WX.YZ	Connector	Output accessory connection error.
66.WX.YZ	Output accessory	Output accessory error.
67.WX.YZ	Input accessory	Input accessory connection error
69.WX.YZ	Duplexer	Duplexer error.
70.WX.YZ	DC controller (LaserJet)	DC controller firmware error.
76.WX.YZ	DC controller (LaserJet)	Power supply fluctuations causes formatter and DC controller communication issue and results them not to be in synchronization.
80.WX.YZ	Managed device	Embedded Jetdirect error.
81.WX.YZ	Near Field Communication (NFC)	Wireless, Bluetooth or internal EIO error.
82.WX.YZ	Memory (hard disk, EMMC, etc.)	Disk hardware error.
90.WX.YZ	Internal diagnostics	Internal test of systems (i.e. disk, CPB, display) or interconnection error.

Table 3-1 ERROR CODES: The first two characters (continued)

Error code	System Component	System Error Description
98.WX.YZ	Hard disk	Hard disk partition error.
99.WX.YZ	Firmware installer	Remote Firmware Upgrade (RFU), firmware install (engine or accessory), or disk error.

4 How to search for printer documentation

The CPMD, error codes, and other support documentation for each printer is available on the HP portals.

For HP internal access to WISE, go to [WISE](#).

For HP channel partners access WISE, see [Accessing WISE for HP channel partners \(HP Partner Portal\) on page 8](#) or [Accessing WISE for HP channel partners \(CSDP\)](#).

WISE is available to call agents, service technicians, and HP internal users. The level of detail available depends on your access credentials. To learn how to find support content in WISE, [watch the video here](#).

WISE - How to access and use

Learn how to access and use Web-based Interactive Search Engines (WISE) to locate available support information. WISE is a repository of technical support documentation including service manuals, user guides, videos, and general support information.

Accessing WISE

Learn how to access Web-based Interactive Search Engines (WISE) if you are an HP channel partner or an internal HP user.

Accessing WISE for HP channel partners (HP Partner Portal)

Learn how to access WISE by accessing the HP Partner Portal if you are an HP Channel Partner.




NOTE: If this is your first visit to the HP Partner Portal, you will be asked to create an account. Follow the setup directions using your HP Partner credentials.



[View a video of how to access WISE for HP channel partners](#)


1. Sign-in to the HP Partner Portal (click <https://partner.hp.com> to access the sign-in page).

Figure 4-1 HP Partner Portal sign-in page

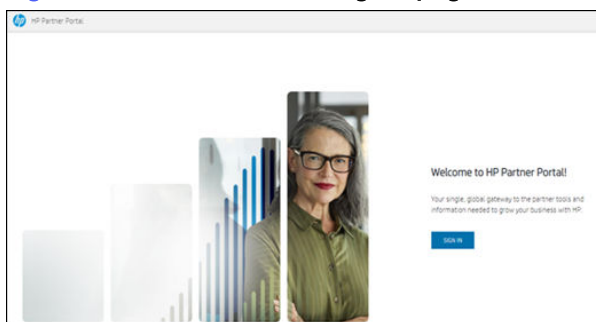


2. On the HP Partner Portal home page, click the **Services & Support** item.

Figure 4-2 HP Partner Portal home page

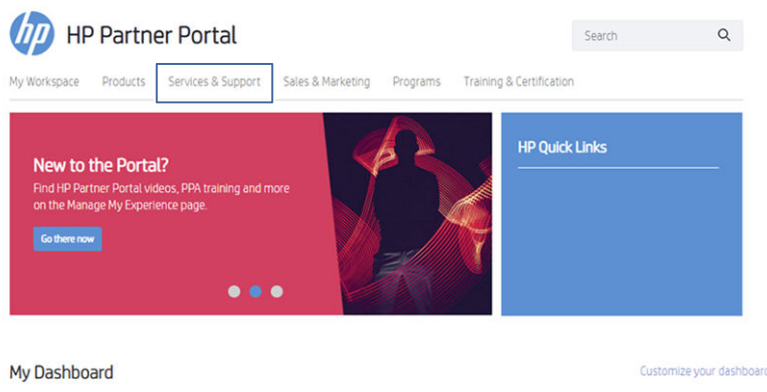


3. Select the **Technical Support (WISE)** item.

Figure 4-3 HP Partner Portal Service & Support page

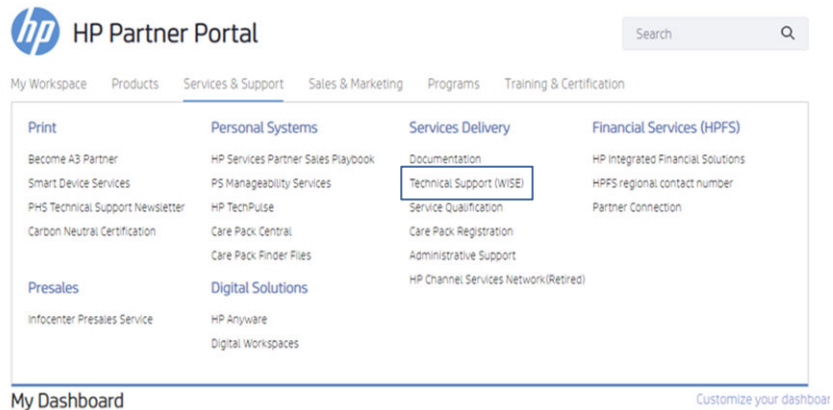


4. Select the **Technical Documentation** item.

Figure 4-4 HP Partner Portal Technical Support (WISE)page

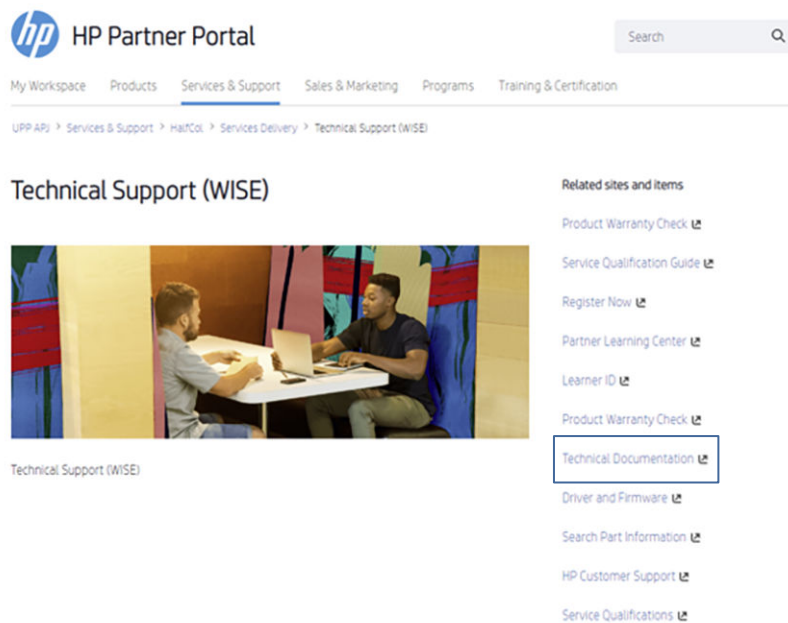

5. Use the WISE portal to search for printer information.

Figure 4-5 WISE portal home page

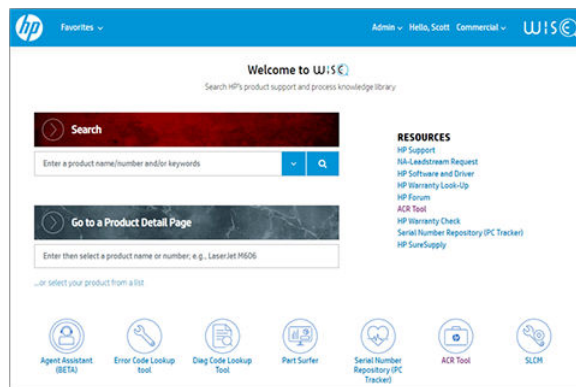

Accessing WISE for internal HP users

Learn how to access WISE if you are an internal HP user.

1. Open one of the Web-based Interactive Search Engines (WISE) URLs listed below.

Americas (AMS)

- [WISE - English](#)
- [WISE - Spanish](#)
- [WISE - Portuguese](#)
- [WISE - French](#)

Asia Pacific / Japan (APJ)


- [WISE - English](#)
- [WISE - Japanese](#)
- [WISE - Korean](#)
- [WISE - Chinese \(simplified\)](#)
- [WISE - Chinese \(traditional\)](#)
- [WISE - Thai](#)

Europe / Middle East / Africa (EMEA)


- [WISE - English](#)

2. Select **Commercial** from the drop-down menu.

Figure 4-6 Choose an experience

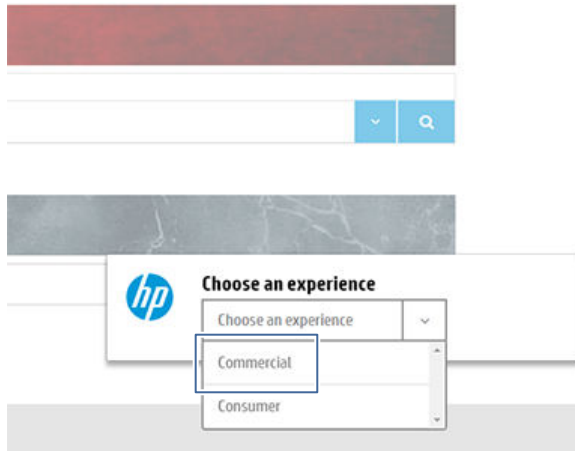

3. The WISE home page appears.

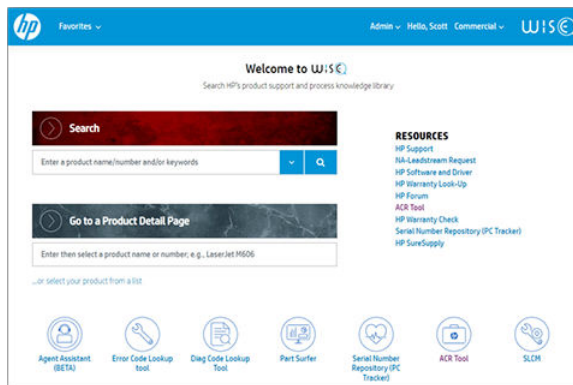

Play the video:



[View a video of how access WISE \(internal HP users\)](#)

Using WISE to search for error codes

Learn how to use WISE to look up error codes.



NOTE: The model used in the instructional videos is an example. The same steps apply to all printer models.

You will need the printer type (e.g. HP LaserJet), model number (e.g. M607), and bundle option (e.g. dn, dh, z).

Search for error codes using the lookup widget

Learn how to search for a specific error code using the WISE Error Code Lookup widget.

1. Enter a printer model number (for example, M606) in the **Go to a Product Detail page** dialog box.



TIP: To find a Product Detail Page (PDP) from a list of products by product type, select the **...or select your product from a list** item just below the dialog box.

2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.



NOTE: Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

3. Type the error code (for example, 13.E1.D3) in the **Error Code Lookup** field, and then select the search icon.

4. The error code troubleshooting content displays in the **All Search Results** area.

All Search Results

13.E1.D3 Fuser Area Jam
Last Modified Date: "2022/03/11"
ish_1686515-1408419-16
Public

Click on the article to see the full content.

Recommended action for customers

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size...

13.* errors
Last Modified Date: "2022/11/30"
ish_1690706-842345-16
Public

Click on the article to see the full content.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open....

HP LaserJet Enterprise M607, M608, M608nk, M609, M610, M611, M612, HP LaserJet Managed E60055-E60075, E60155-E60175 printers - Control Panel Messages Document (CPMD)
Last Modified Date: "2022/11/22"
pdf_3366820_en-US-6
For HP And Channel Partner Internal Use

Play the video:



[View a video of how to search for error codes using the Product Detail Page \(PDP\) or the Error Code Lookup tool.](#)

Search for error codes from the WISE home page

Learn how to search for a specific error code from the WISE home page.

1. On the WISE home page, enter a printer model number (for example, M606) in the **Search** dialog box.

Search

Enter a product name/number and/or keywords

Go to a Product Detail Page


Enter then select a product name or number; e.g., LaserJet M606

...or select your product from a list

2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.




NOTE: Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

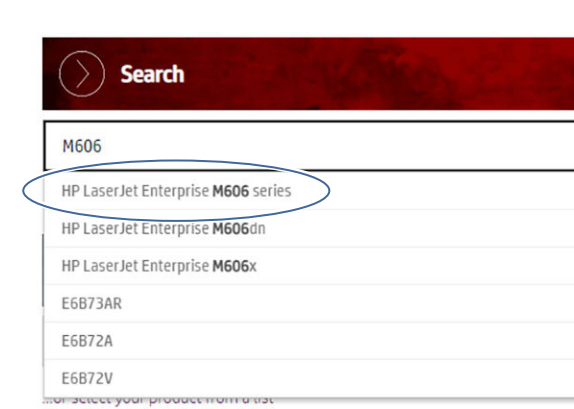

3. Type the error code (for example, 13.E1.D3) in the **Search** keyword field, and then select the search icon.



4. The error code troubleshooting content displays in the **All Search Results** area.

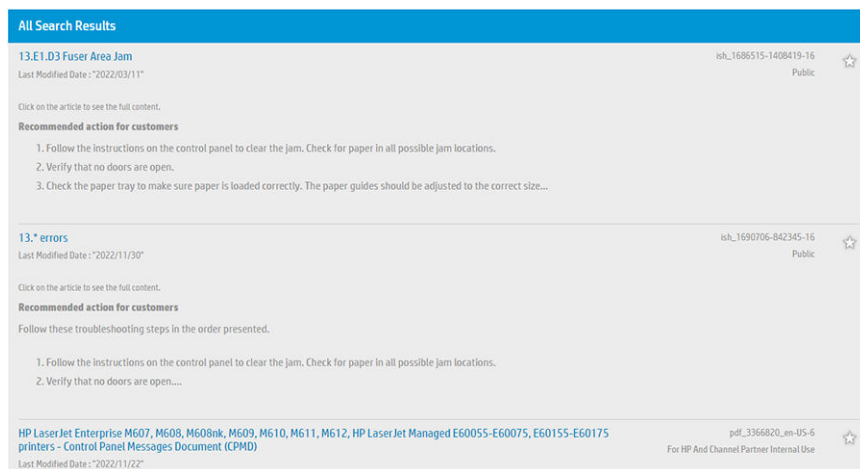

Using WISE to access repair and replace videos for FRUs

Learn how to use WISE to access repair and replace videos for FRUs.



NOTE: The model used in the instructional videos is an example. The same steps apply to all printer models.


You will need the printer type (e.g. HP LaserJet), model number (e.g. M607), and bundle option (e.g. dn, dh, z).

Search for videos using the Product Detail Page (PDP)

Learn how to search WISE for product specific information. Quickly review the steps and then play the video.


1. Enter a printer model number (for example, M606) in the **Go to a Product Detail** page dialog box.

 **TIP:** To find a Product Detail Page (PDP) from a list of products by product type, select the **...or select your product from a list** item just below the dialog box.

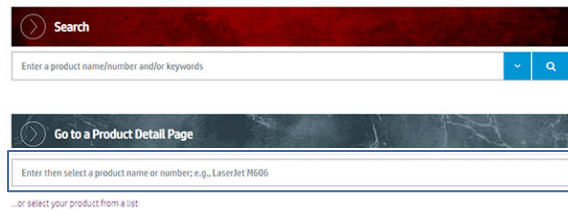

2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.

 **NOTE:** Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

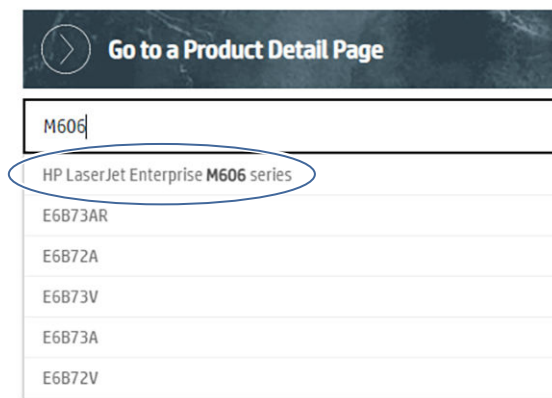

3. Select the link to **Videos** in the **Other Content** menu at the bottom-right of the screen.

HP LaserJet Enterprise M606 series

Commercial



[View More Images](#)

Specifications
[Go to SKU Product Detail Page \(PDP\)](#)
for release date and model specifications

Functions
Print
Number of print ca...
1 (2400)

Memory
512 MB

Maximum Memory
1.5 GB

Media sizes supported
Multipurpose: 100, 11, letter, legal, executive...

Quick Reference
[Product Specifications](#)
[Front Panel Guide](#)
[Test Pages](#)
[Accessories](#)
[Orderable supplies](#)
[Software Included](#)
[Replacement cartridges](#)
[Manufacturer Warranty](#)

Error Code Lookup
Enter a specific error code in the field below, e.g. 13.02.02

Other Content
[Advisories \(0\)](#)
[Bulletins \(2\)](#)
[Guides, Manuals, etc. \(76\)](#)
[Notices \(1\)](#)
[Product Change Not... \(0\)](#)
[Software Drivers &...](#)
[Top Issues \(7\)](#)
[Videos \(127\)](#)

4. Select the desired video from the list of videos.

 **TIP:** Select the **Add Or Remove Hardware & Customer Self Repair** filter under **Troubleshooting** to limit the search results to repair and replace videos.

HP LaserJet Enterprise M606 series

Enter a product name/number and/or keywords

Showing results for : ""
and for product(s) : "HP LaserJet Enterprise M606 series"

Product Detail Pages (PDP)

HP LaserJet Enterprise M606 series

Most Relevant

Videos

HP Trusted Platform Module (TPM) PCA
Customer self-repair (CSR) A parts and assemblies
Last Modified Date : "2023/01/30"
Length : 01:27

How to Install and Remove the HP Color LaserJet Managed Tray Lock Kit
No audio. Learn how to remove and replace the paper guide lock for HP Color LaserJet Managed Tray Lock Kit.
Last Modified Date : "2023/01/11"
Length : 02:20

Torque limiter (trays 2-6 and 1,500-sheet high-capacity input feeder)
Customer self-repair (CSR) A parts and assemblies
Last Modified Date : "2023/01/30"
Length : 02:06

Filter

TROUBLESHOOTING

☒ Add Or Remove Hardware & Customer Self Repair (10)

☐ Software & Apps (3)

HOW TO

☐ Fax (3)

☐ Ink Or Toner, Paper & Accessories (12)

☐ Print (18)

☐ Printer Setup, Installation & Updates (20)

[+ Show More](#)

PRODUCT INFORMATION

☐ Product Specifications (4)

DISCLOSURE LEVEL

☐ For HP And Channel Partner Internal Use (43)

☐ Public (84)

Play the video:

 [View a video of how to search for the printer's Product Detail Page \(PDP\)](#)

Search for videos using the WISE search function

Learn how to search WISE using the model number. Quickly review the steps and then play the video.

1. On the WISE home page, enter a printer model number (for example, M606) in the **Search** dialog box.

Search

Enter a product name/number and/or keywords

Go to a Product Detail Page

Enter then select a product name or number; e.g., LaserJet M606

...or select your product from a list

2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.

 **NOTE:** Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

Search

M606

HP LaserJet Enterprise M606 series

HP LaserJet Enterprise M606dn

HP LaserJet Enterprise M606x


E6B73AR

E6B72A


E6B72V

...or select your product from a list


3. Select the search icon.

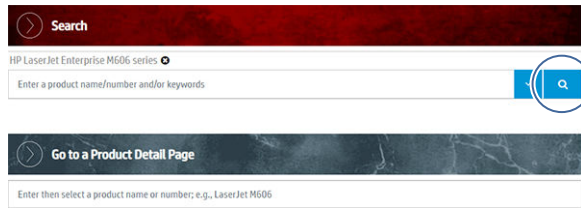

4. To refine the search results, select the radio button labeled **Videos** in the upper-right portion of the screen.

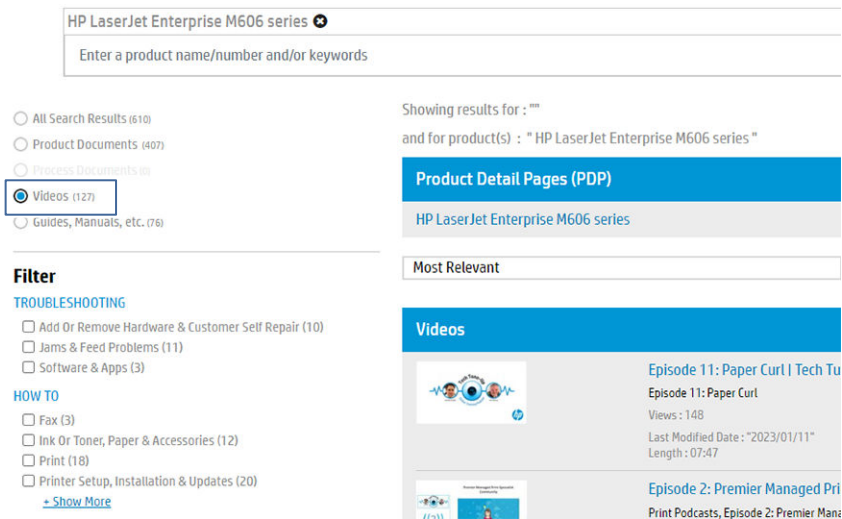

TIP: To refine video search results, type a part name in the keyword search bar, and then select the search icon. For example, entering the word **fuser** to the keyword search bar returns videos related to repair and replacement of the fuser.

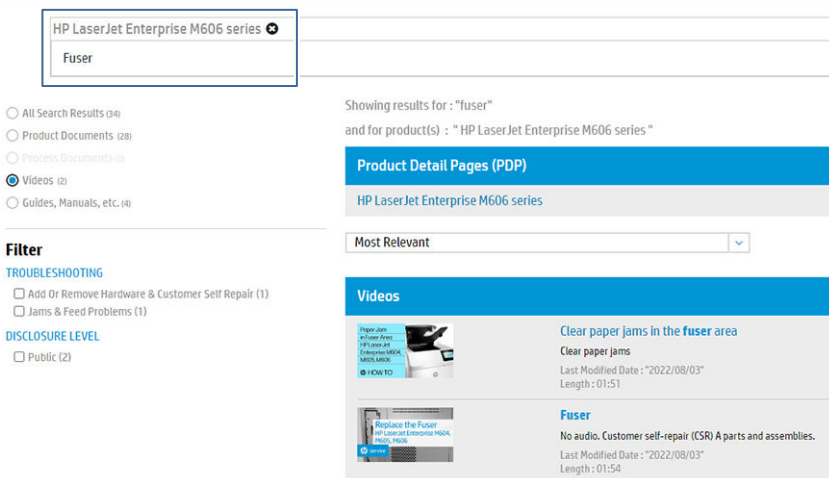

Play the video:



[View a video of how to perform a model number search](#)

5 Printer service information

The following information provides the document's last updated date and the printer service PIN.

Last update: March 12, 2025

Service mode PIN number:

M631, M632, M633, M634, M635, M636, M637, E62555, E62565, E62575, E62655, E62665, E62675:
05063117



NOTE: When possible, always update the printer firmware to the latest available version at [HP.com](https://www.hp.com) as part of the troubleshooting performed for any of the following errors.

6 Numerical control panel messages

Use the following numerical error message troubleshooting to resolve your issue.

10.WX.YZ error messages

10.wx.yz error messages

Errors in the 10.* family are related to toner cartridges and other supply items that require regular replacement as part of routine printer maintenance.

Order replacement supplies and install them as necessary. To order parts, go to <https://www.hp.com/buy/parts>.

Use the following list to identify the supply item affected:



NOTE: Not all printers have all of these supplies.

- 10.00.XX = Black toner cartridge
- 10.01.XX = Cyan toner cartridge
- 10.02.XX = Magenta toner cartridge
- 10.03.XX = Yellow toner cartridge
- 10.10.XX = Transfer roller
- 10.22.XX = Transfer Belt
- 10.23.XX = Fuser kit
- 10.31.XX = Toner collection unit
- 10.39.XX = Document feeder kit
- 10.99.XX = One or more supply items have been installed

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

To order parts, go to <https://www.hp.com/buy/parts>.

1. For toner cartridges:
 - a. Remove and reinstall the cartridge.
 - b. Check the electronic chip on the cartridge if it is visible. If the chip is damaged, replace the toner cartridge.
 - c. If print quality is unacceptable, or if printing cannot continue, replace the toner cartridge.
2. For the transfer kit:
 - a. Remove and then reinstall the transfer unit.
 - b. If print quality is unacceptable, or if printing cannot continue, replace the transfer kit.

3. For the fuser kit:
 - a. Remove and then reinstall the fuser.

 **CAUTION:** The fuser might be hot.

 - b. If print quality is unacceptable, or if printing cannot continue, replace the fuser kit.
4. For the toner collection unit:
 - a. Remove the toner collection unit and reinstall it.
 - b. If the toner collection unit is nearly full, replace it with a new one. Using a toner collection unit until it is overfilled can damage the printer.
5. For the document feeder kit:
 - a. Open the document feeder top cover and inspect the rollers for obvious dirt or wear. Clean the rollers if necessary.
 - b. Install a new roller kit.

10 . 00 . 00 e-label Memory Error


An e-label Memory Error on toner cartridge.

The printer is unable to read the toner cartridge data. The toner cartridge is present but defective.

When this error occurs, a question mark appears on the gas gauge of the supply or supplies with the error.

Recommended action for customers


1. Check the toner cartridge.
 - a. Open the left door.
 - b. Slide out the toner tray.
 - c. Pull out and then up on the toner cartridge to remove it.
 - d. Check and clean the e-label connection. If it is damaged, replace the toner cartridge.

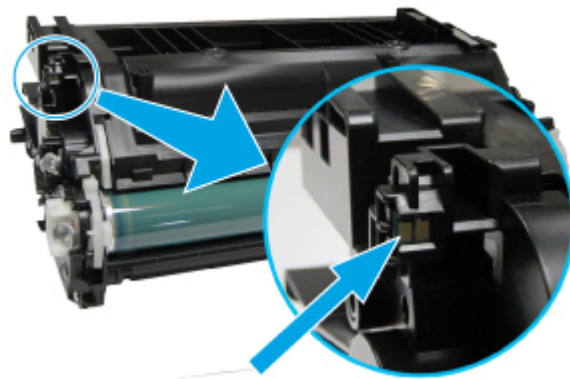

- e. Reinstall the toner cartridge and close the left door.
 2. If the message displays again, turn the printer off, and then on.
 3. If the error persists, replace the toner cartridge.
 4. If the error persists, please contact customer support.


Recommended action for call-center agents and onsite technicians

1. Check the toner cartridge.
 - a. Open the left door.
 - b. Slide out the toner tray.
 - c. Pull out and then up on the toner cartridge to remove it.
 - d. Check and clean the e-label connection. If it is damaged, replace the toner cartridge.

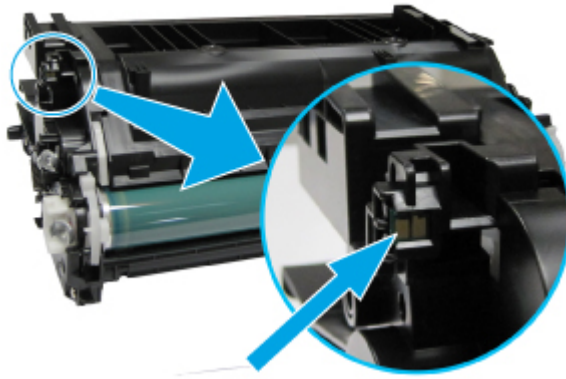

- e. Reinstall the toner cartridge and close the left door.
 2. If the message displays again, turn the printer off, and then on.
 3. Test the printer with another toner cartridge. Replace the toner cartridge as needed.

4. If the error persists, check the e-label contact in the printer. If the contact is damaged, elevate the issue using the Standard Support Process.

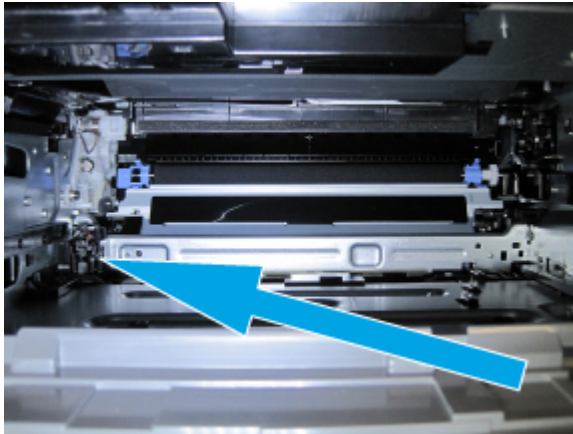

5. Turn the printer off. Disconnect and reconnect J501 on the DC controller to ensure it is seated correctly.
6. Turn the printer on. If the error persists, elevate the issue using the Standard Support Process.

10 . 00 . 10 e-label Missing Memory Error

The printer is unable to detect the e-label.


This message indicates that the printer has determined that the e-label is missing.

When this error occurs, a question mark appears on the gas gauge of the supply or supplies with the error.

Recommended action for customers

1. Check the toner cartridge.
 - a. Open the left door.
 - b. Slide out the toner tray.
 - c. Pull out and then up on the toner cartridge to remove it.


- d. Check and clean the e-label connection. If it is damaged, replace the toner cartridge.

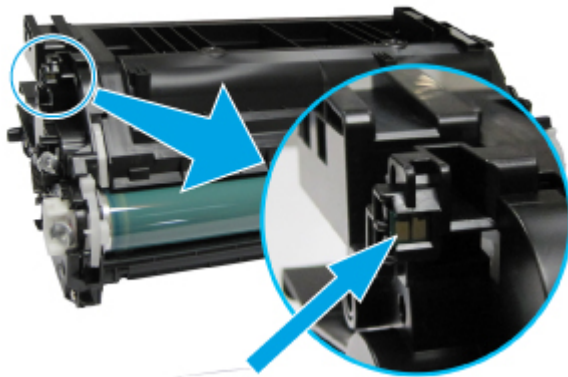

- e. Reinstall the toner cartridge and close the left door.
2. If the message displays again, turn the printer off, and then on.
 3. If the error persists, replace the toner cartridge.
 4. If the error persists, please contact customer support.


Recommended action for call-center agents and onsite technicians

1. Check the toner cartridge.
 - a. Open the left door.
 - b. Slide out the toner tray.
 - c. Pull out and then up on the toner cartridge to remove it.
 - d. Check and clean the e-label connection. If it is damaged, replace the toner cartridge.

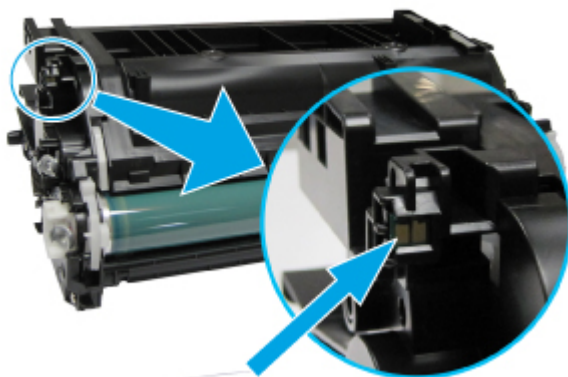

- e. Reinstall the toner cartridge and close the left door.
2. If the message displays again, turn the printer off, and then on.
 3. Test the printer with another toner cartridge. Replace the toner cartridge as needed.

4. If the error persists, check the e-label contact in the printer. If the contact is damaged, elevate the issue using the Standard Support Process.

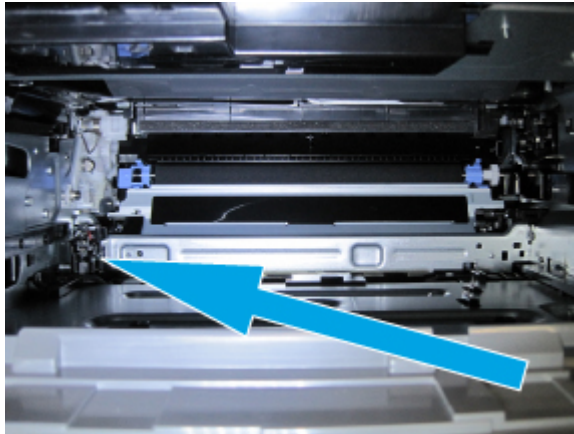

5. Turn the printer off. Disconnect and reconnect J501 on the DC controller to ensure it is seated correctly.
6. Turn the printer on. If the error persists, elevate the issue using the Standard Support Process.

10 . 00 . 15 Install Toner Cartridge

A supply is either not installed or not correctly installed in the printer.

The 10.00.15 is an event log only message, it will not show on the control panel. The only message to display will be **Install Toner Cartridge**.

Recommended action for customers

- Replace or reinstall the toner cartridge correctly to continue printing.

Recommended action for call-center agents and onsite technicians

1. Replace or reinstall the toner cartridge correctly to continue printing.
2. Test printer with a new toner cartridge.
3. If the error persists with a new toner cartridge check the toner cartridge contacts inside the printer.
 - a. Remove the toner cartridge.
 - b. Check the contacts inside the printer.
 - c. Ensure the contacts are clean and aligned correctly.
 - d. If the contacts are damaged and cannot be realigned, elevate the issue using the Standard Support Process.
 - e. If the contacts are in good condition and clean and the error persists, replace the high voltage power supply.

HVPS part number: RM2-9335-000CN

For instructions: See the Repair Service Manual for this product.

HVPS LCD models “ONLY” part number: RM2-9336-000CN

For instructions: See the Repair Service Manual for this product.

10.00.30 Used Supply In Use

A used supply is in use (end of life).

Recommended action

- No action necessary.

If you believe this is a genuine HP supply, go to www.hp.com/go/antcounterfeit.

Using a cartridge that is near its end-of-life can cause this event code.

10.00.35 Toner Cartridge Incompatible

The printer displays this message when the indicated supply is not compatible with this printer.

The 10.00.35 is an event log only message, it will not show on the control panel. The only message to display will be **Toner Cartridge Incompatible**.

Recommended action

- Install a supply that is designed for this printer.

10.00.59

Black cartridge has been replaced with non-new cartridge

This is an **Event Log Only** message.

Recommended action

There is no action needed for this message.

- No action necessary.

10.00.60 Toner Cartridge low

The printer indicates when a supply level is low. Actual toner cartridge life might vary. You do not need to replace the toner cartridge at this time unless print quality is no longer acceptable.

The 10.00.60 is an event log only message, it will not show on the control panel. The only message to display will be **Toner Cartridge low**.

Recommended action

- If the print quality is no longer acceptable, replace the toner cartridge.



NOTE: Advise the customer that HP recommends that they have replacement supplies available to install when the print quality is no longer acceptable.

10.00.69 Toner Cartridge very low

The printer indicates when a supply level is very low. Actual toner cartridge life might vary. You do not need to replace the toner cartridge at this time unless the print quality is no longer acceptable.

The 10.00.69 is an event log only message, it will not show on the control panel. The only message to display will be **Toner Cartridge very low**.

Recommended action

- If the print quality is no longer acceptable, replace the toner cartridge.



NOTE: Advise the customer that HP recommends that they have replacement supplies available to install when the print quality is no longer acceptable.

10 . 00 . 70 Printing past very low

The printer indicates when one of the supplies is very low. The actual remaining supply life might vary. You do not need to replace the toner cartridge at this time unless the print quality is no longer acceptable.

The 10.00.70 is an event log only message, it will not show on the control panel. The only message to display will be a warning message **Printing past very low**.

Recommended action

- If the print quality is no longer acceptable, the customer must order and pay for a new toner cartridge.



NOTE: Advise the customer that HP recommends that they have replacement supplies available to install when the print quality is no longer acceptable.

10 . 23 . 15 Install Fuser kit

The fuser is either not installed, or not correctly installed in the printer.

Recommended action for customers


Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove, and then reinstall the fuser.




CAUTION: The fuser might be hot.


- a. Open the right door or rear door.

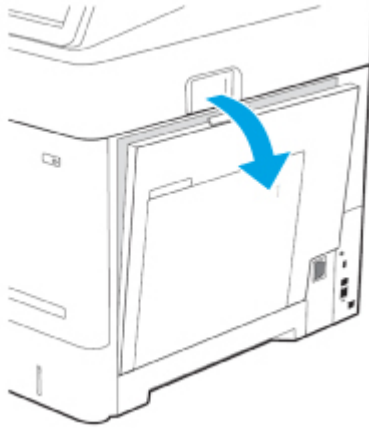

- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

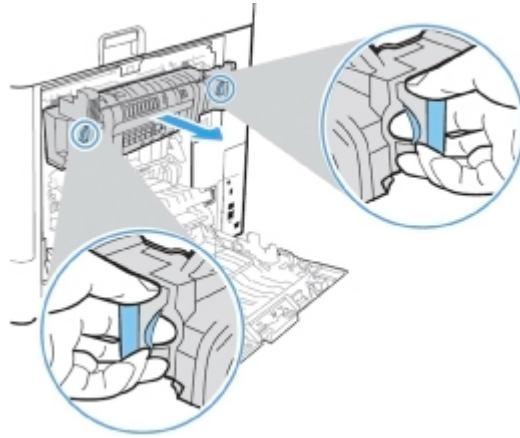

- c. Reseat the fuser, or install a new fuser.

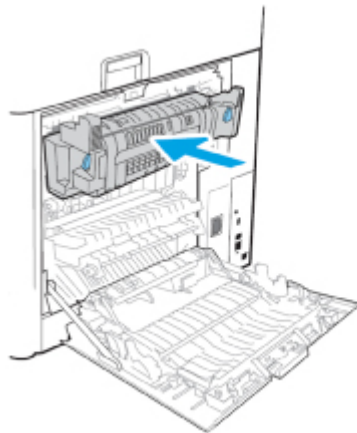

- d. Close the right door or rear door.

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.


Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.


1. Turn the printer off.
2. Remove, and then reinstall the fuser.

⚠ CAUTION: The fuser might be hot.


- a. Open the right door or rear door.

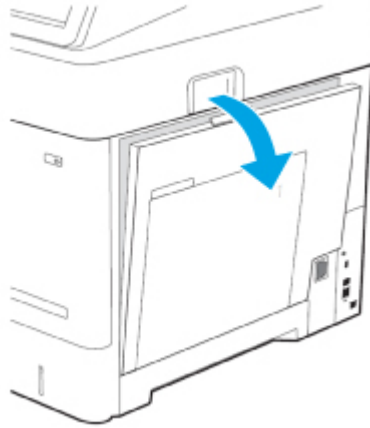


- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

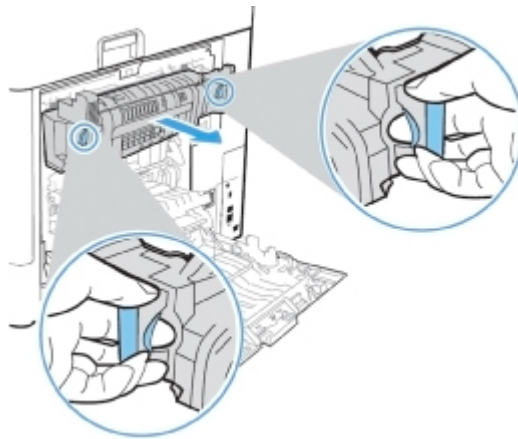

- c. Reseat the fuser, or install a new fuser.

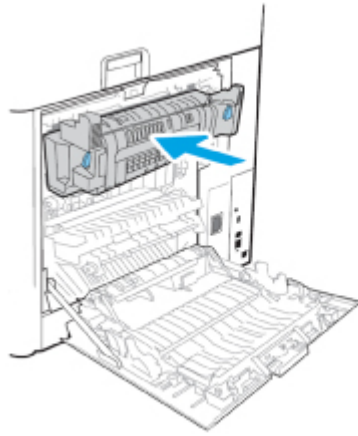

- d. Close the right door or rear door.
- 3. If the error persists, check the fuser connections.
 - a. Remove the fuser.
 - b. Check the connection on the fuser.

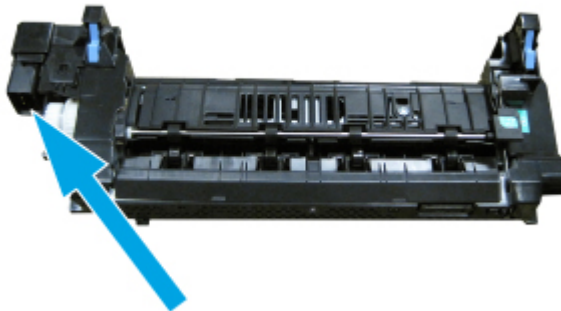

- c. If the fuser connector is damaged, elevate the case using the Standard support process.

Table 6-1 Fuser assembly part numbers

Description	Part number
110V Fuser assembly	RM2-1256-020CN
220V Fuser assembly	RM2-1257-020CN

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians


Follow these troubleshooting steps in the order presented.

- 1. Turn the printer off.


2. Remove, and then reinstall the fuser.

⚠ CAUTION: The fuser might be hot.


- a. Open the right door or rear door.

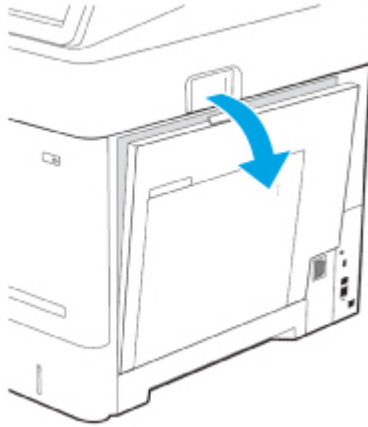

- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

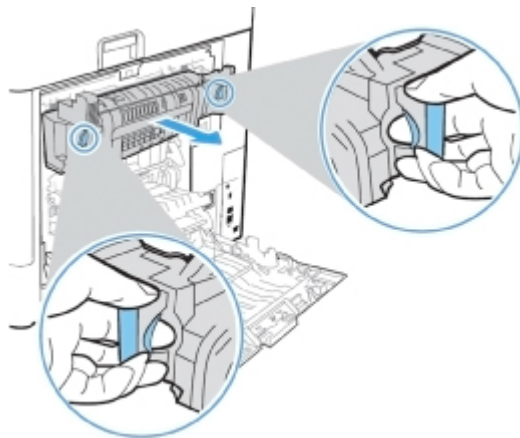


- c. Reseat the fuser, or install a new fuser.

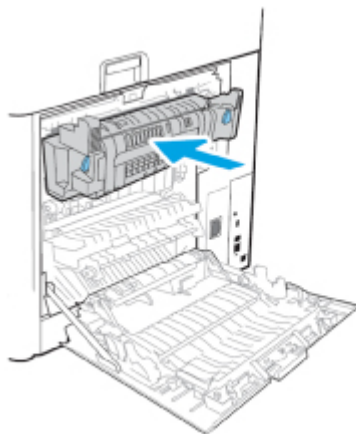

- d. Close the right door or rear door.

3. If the error persists, check the fuser connections.
 - a. Remove the fuser.
 - b. Check the connection on the fuser.

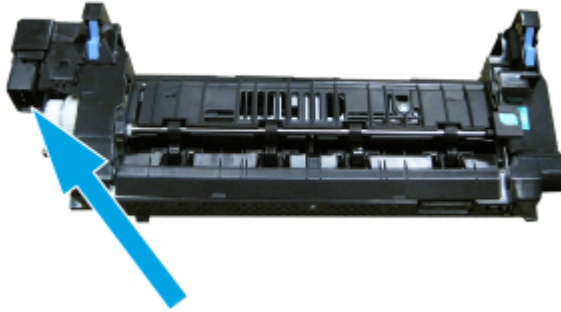

- c. If the fuser connector is damaged, replace the fuser.
110V part number: RM2-1256-020CN
For instructions: See the Repair Service Manual for this product.
220V part number: RM2-1257-020CN
For instructions: See the Repair Service Manual for this product.
- d. Check the connection to the fuser in the printer.



- e. If the connector is damaged, elevate the issue using the Standard Support Process.
 - f. Disconnect and reconnect the cables at connectors J401 and J402 on the DC controller PCA.
4. If all connections are seated correctly, replace the DC Controller based on the specific product.
DC Controller part numbers:
RM2-9493-000CN (M631, M632, M633, E62555, E62565, E62575)
RM3-7621-000CN (E62655, E62665, E62675 only)

RM3-8458-000CN (M634, M635, M636, M637)

For instructions: See the Repair Service Manual for this product.

10 . 23 . 60 Fuser Kit low

The printer indicates when a supply level is low.

Recommended action

1. The fuser kit is nearing its end of life. Be ready to replace the fuser kit in the near future.



NOTE: The printer indicates when the supply is very low. The actual remaining life might vary with printing.



NOTE: HP recommends having replacement supplies available to install when the supply reaches the end of life.

2. A new fuser kit should be ordered before the printer reaches a hard stop.

HP LaserJet 110v Maintenance Kit (Fuser): J8J87A

HP LaserJet 220v Maintenance Kit (Fuser): J8J88A

For instructions: See the Repair Service Manual for this product.

Service part numbers:

110V part number: RM2-1256-000CN


220V part number: RM2-1257-000CN

3. To remove and reinstall the fuser follow these steps.




CAUTION: The fuser might be hot.


- a. Open the right door.

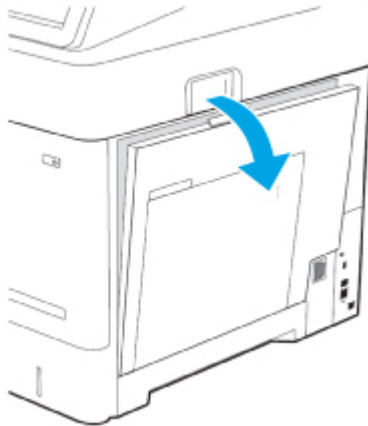

- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

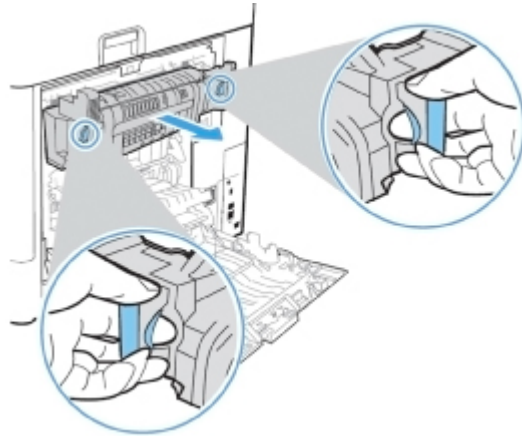

- c. Install a new fuser.

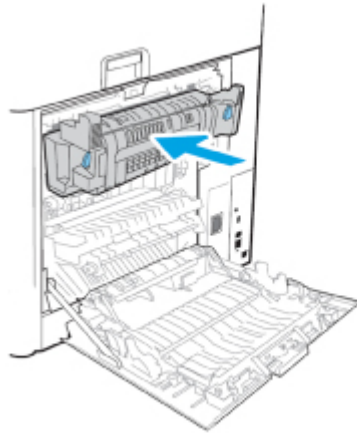

- d. Close the right door.

10.23.70 Replace Fuser Kit

The 10.23.70 is an event log only message, it will not show on the control panel. The only message to display will be a warning message **Replace Fuser Kit**.

The printer indicates when the fuser kit is at its estimated end of life. The actual life remaining might be different than the estimation.

The fuser kit does not need to be replaced now unless the print quality is no longer acceptable.



NOTE: After an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer is responsible for replacing the supply.

Recommended action

1. If the print quality is no longer acceptable, the customer must order and pay for a replacement fuser kit.



NOTE: After an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer is responsible for replacing the supply.

HP LaserJet 110v Maintenance Kit (Fuser): J8J87A

HP LaserJet 220v Maintenance Kit (Fuser): J8J88A

For instructions: See the Repair Service Manual for this product.

Service part numbers:


110V part number: RM2-1256-000CN

220V part number: RM2-1257-000CN


2. To remove and reinstall the fuser follow these steps.

 **CAUTION:** The fuser might be hot.


- a. Open the right door.

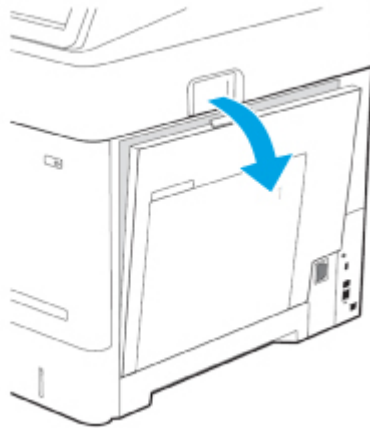

- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

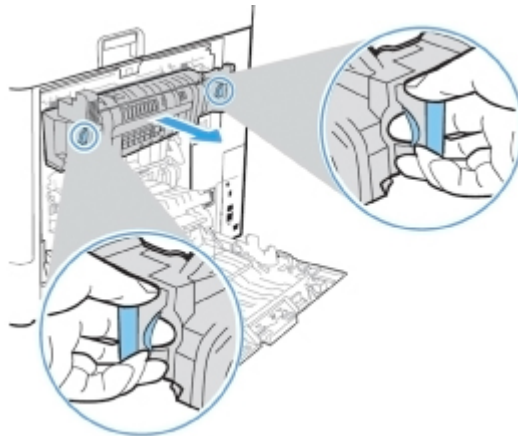

- c. Install a new fuser.

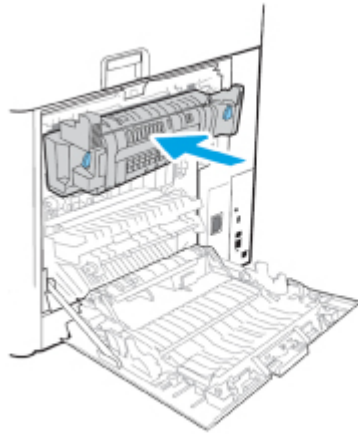

- d. Close the right door.

10 . 39 . 60 Document feeder kit low

The printer indicates when a supply level is low.

Recommended action


1. Replace the document feeder kit.
2. Remove the document feeder rollers.
 - a. Open the document feeder cover.

Figure 6-1 Open the document feeder cover




- b. Rotate the blue locking lever down.

Figure 6-2 Rotate the blue locking lever down

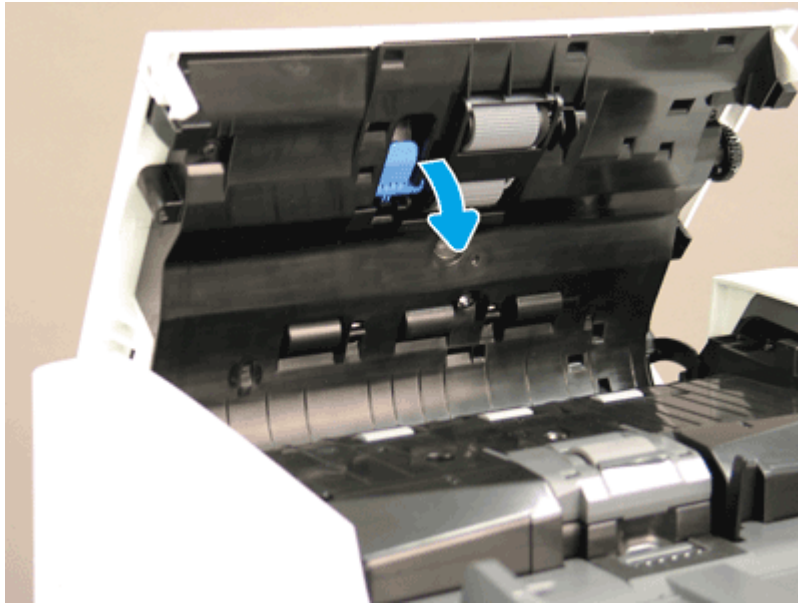


- c. Slide the locking lever toward the front of the printer, in the direction indicated by the arrow.

Figure 6-3 Slide the locking lever toward the front

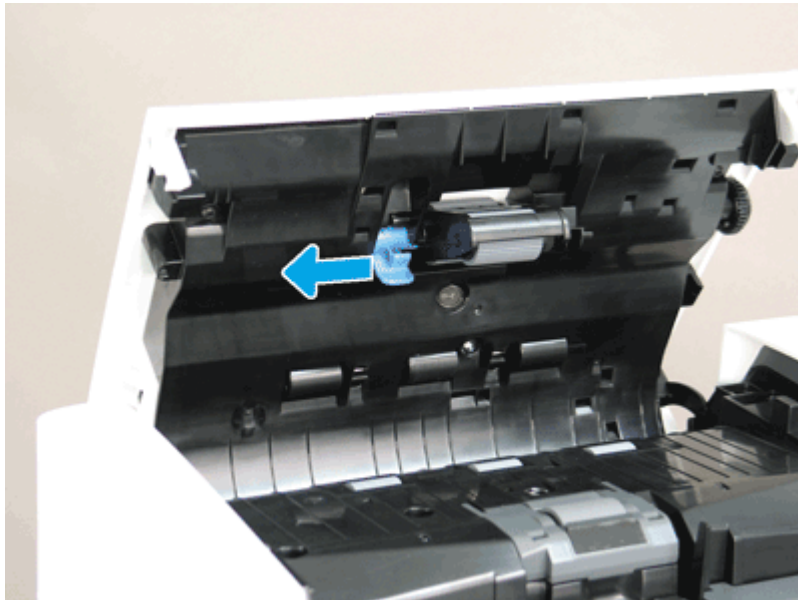


- d. Grasp both sides of the document feeder pick roller (callout 1), and then remove the roller assembly in the direction indicated by the arrow (callout 2).

Figure 6-4 Remove the pick roller

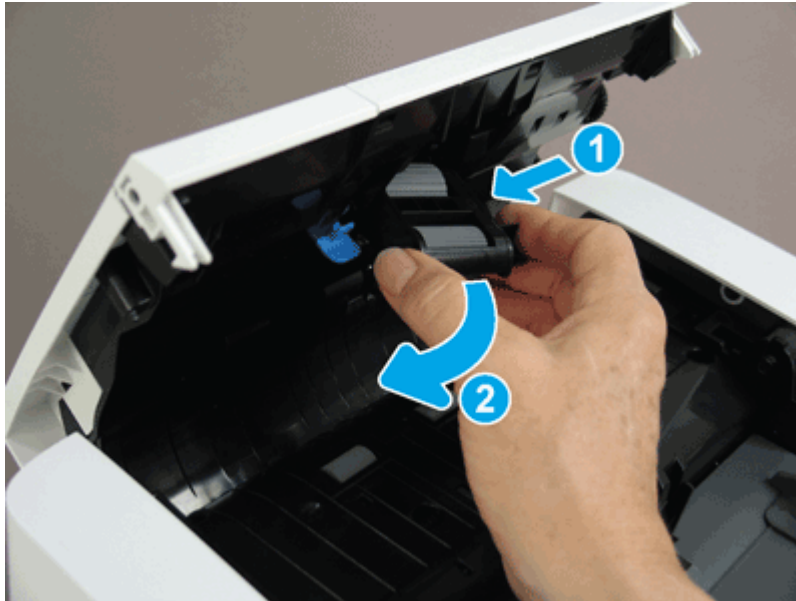


- e. Open the document feeder separation roller cover in the direction indicated by the arrow.

Figure 6-5 Open the separation roller cover

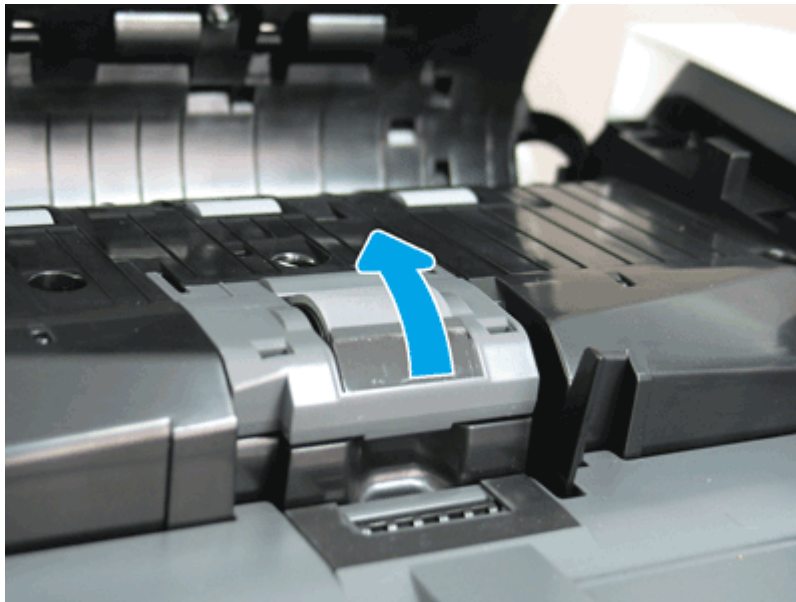

- f. Lift the document feeder separation roller (callout 1), and then remove the roller assembly in the direction indicated by the arrow (callout 2).


Figure 6-6 Remove the separation roller

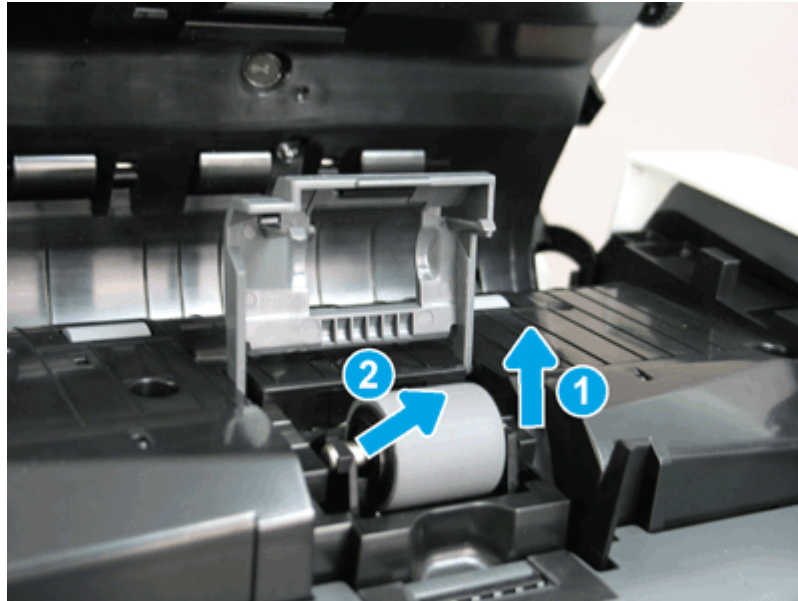

- 3. Install the new document feeder kit.


- a. Insert the left end of the replacement separation roller into the document feeder location (callout 1), and then press the roller assembly down as indicated by the arrow (callout 2).

Figure 6-7 Install the separation roller

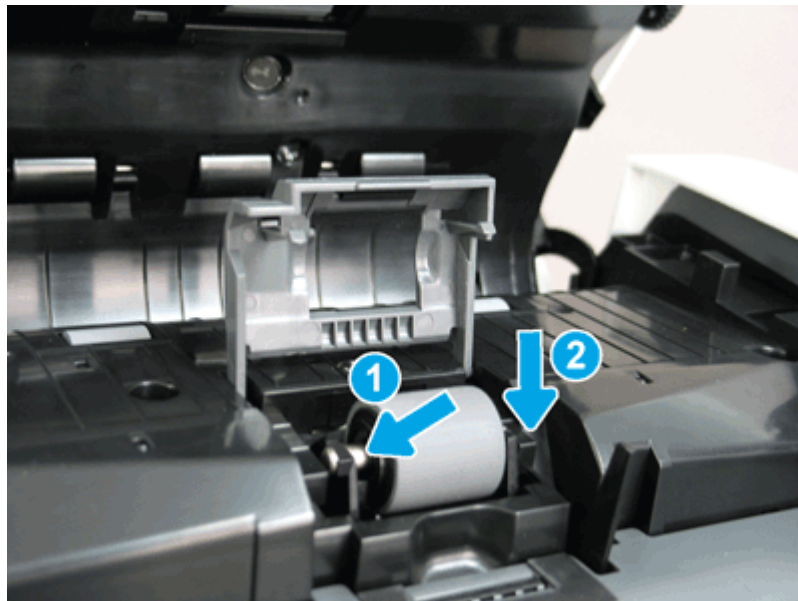


- b. Close the document feeder separation roller cover in the direction indicated by the arrow.

Figure 6-8 Close the separation roller cover

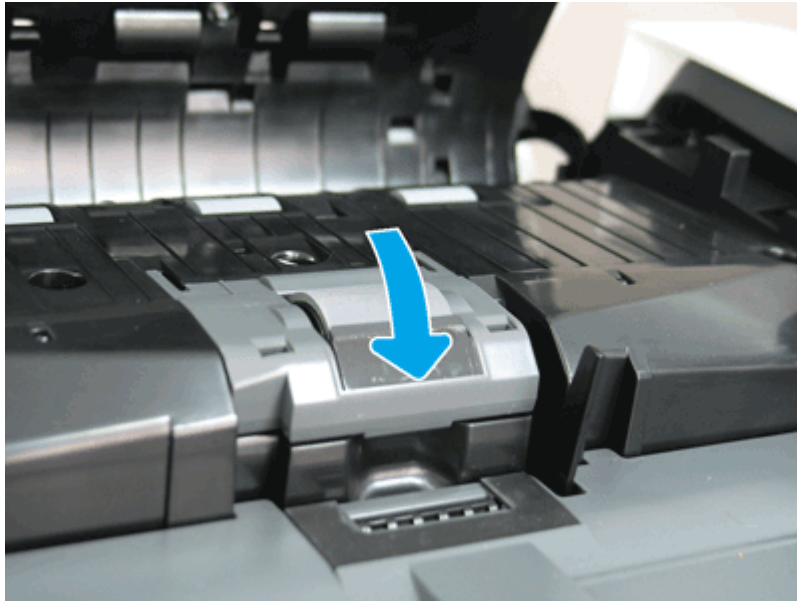


- c. Insert the left end of the replacement pick roller assembly into the document feeder location as indicated.

Figure 6-9 Install the pick roller

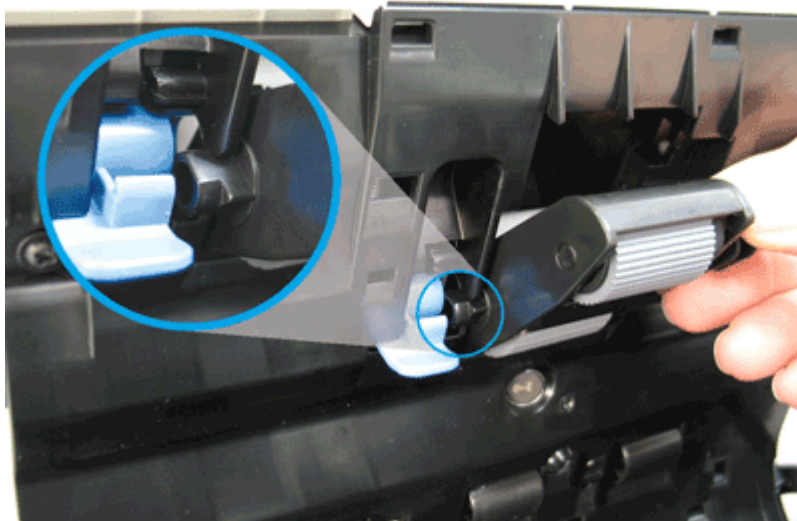


- d. Slide the locking lever toward the back of the printer to secure the document feeder pick roller.

Figure 6-10 Slide the locking lever toward the back

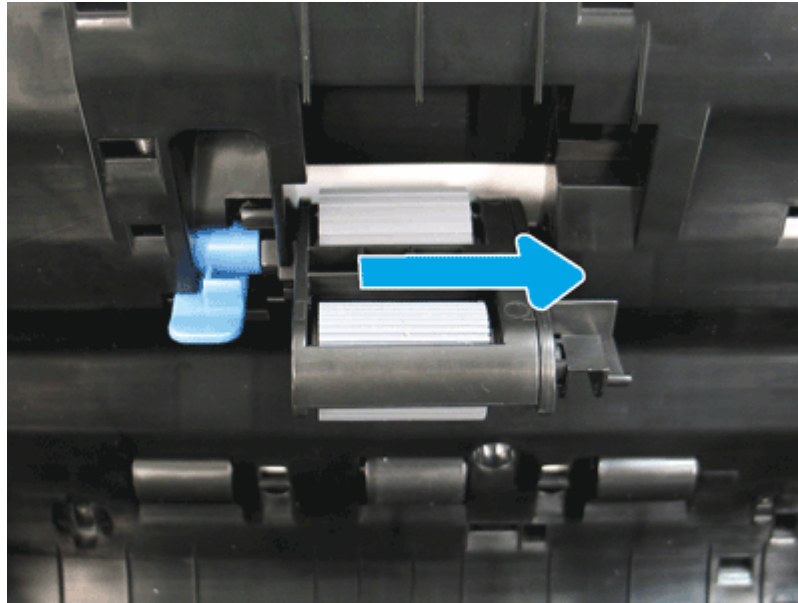


- e. Rotate the pick roller assembly up into the holder (callout 1), and then slide the blue locking lever toward the back of the printer (callout 2).

Figure 6-11 Rotate the pick roller up and slide the blue locking lever towards the back

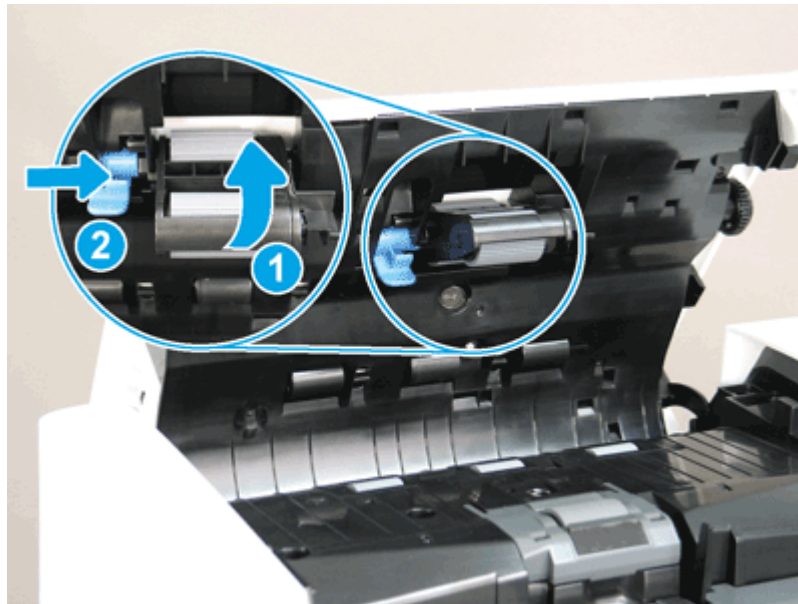

- f. Rotate the blue locking lever up.

Figure 6-12 Rotate the blue locking lever up

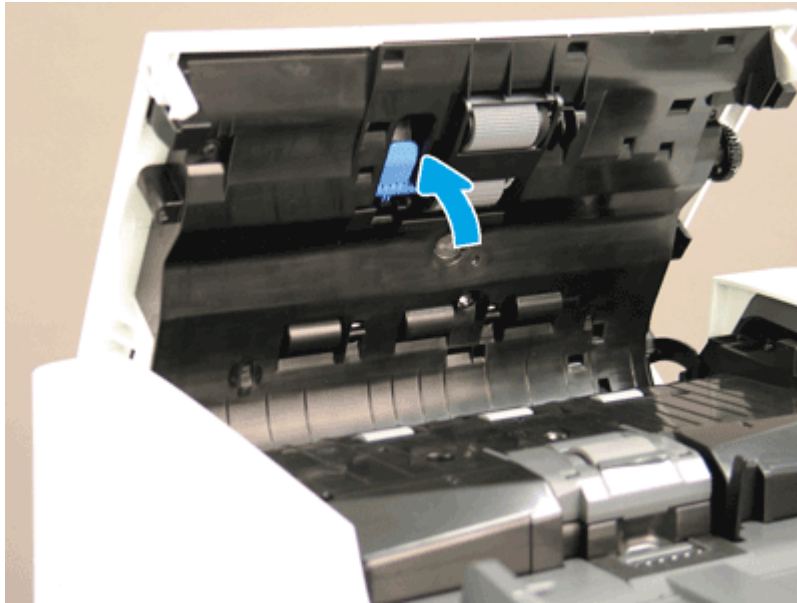

- g. Close the document feeder cover.

Figure 6-13 Close the document feeder cover



- 4. Rest the document feeder kit.
 - a. on the control panel, touch [Supplies](#) menu.
 - b. Touch [Reset Supplies](#).
 - c. Touch [Document Feeder Kit](#).
 - d. Touch [Reset](#).

10 . 39 . 70 Document feeder kit very low

The 10.WX.70 is an event log only message, it will not show on the control panel. The only message to display will be a warning message **<Supply> very low**.

The printer indicates when the document feeder maintenance kit is very low. The actual remaining document feeder maintenance kit life might vary.

Recommended action


1. The customer must order and pay for a replacement document feeder maintenance kit.
2. Remove the document feeder rollers.
 - a. Open the document feeder cover.

Figure 6-14 Open the document feeder cover




- b. Rotate the blue locking lever down.

Figure 6-15 Rotate the blue locking lever down

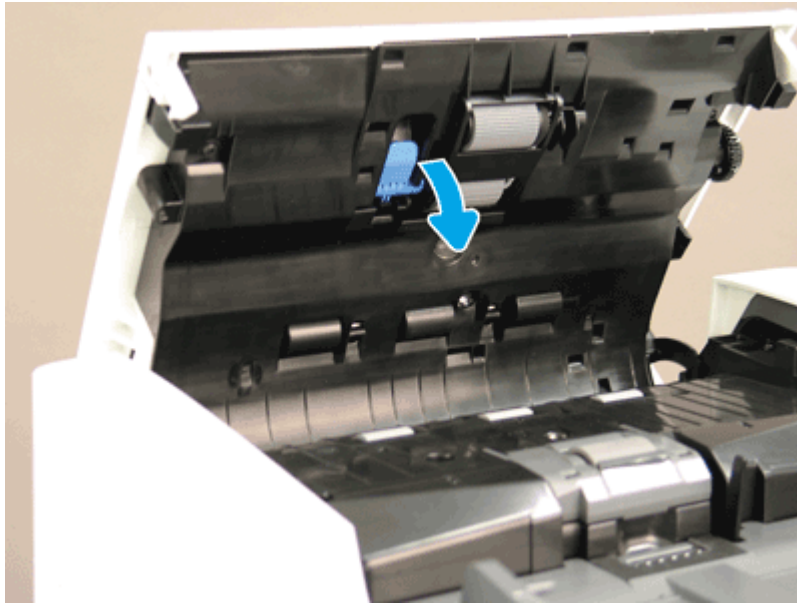


- c. Slide the locking lever toward the front of the printer, in the direction indicated by the arrow.

Figure 6-16 Slide the locking lever toward the front

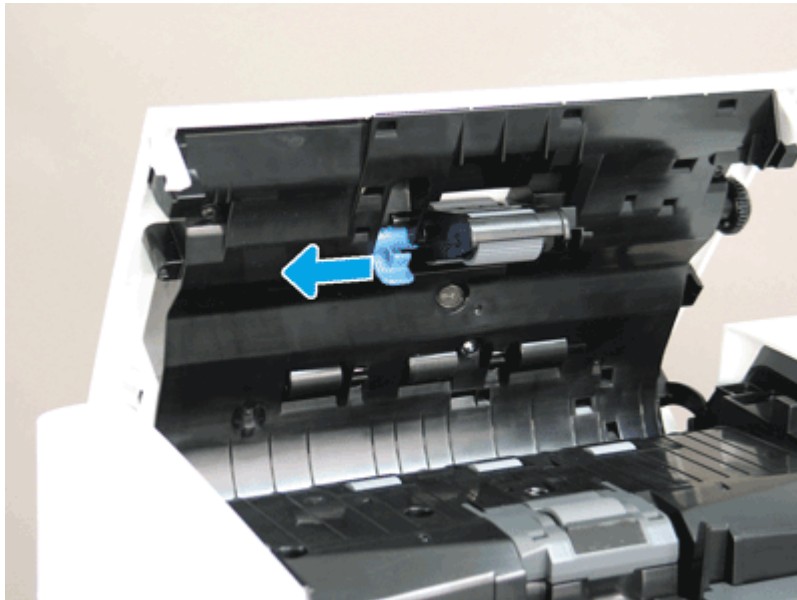


- d. Grasp both sides of the document feeder pick roller (callout 1), and then remove the roller assembly in the direction indicated by the arrow (callout 2).

Figure 6-17 Remove the pick roller

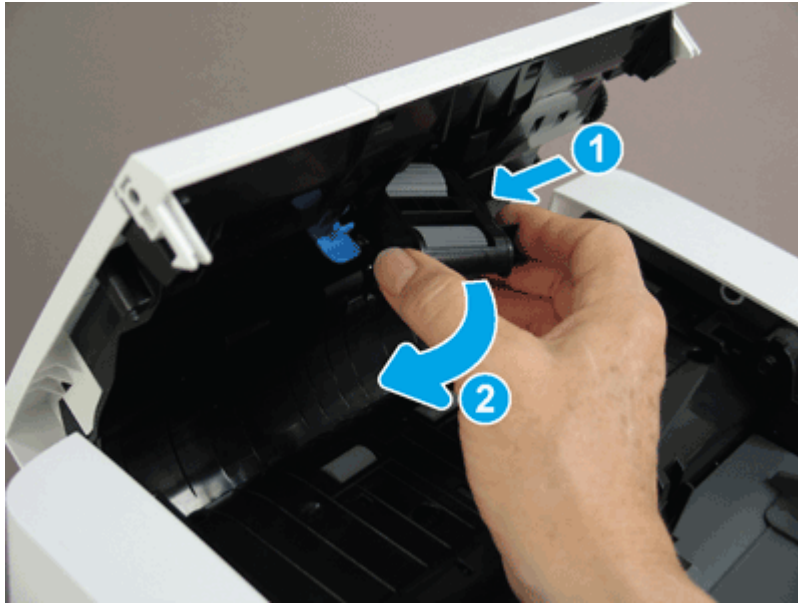


- e. Open the document feeder separation roller cover in the direction indicated by the arrow.

Figure 6-18 Open the separation roller cover

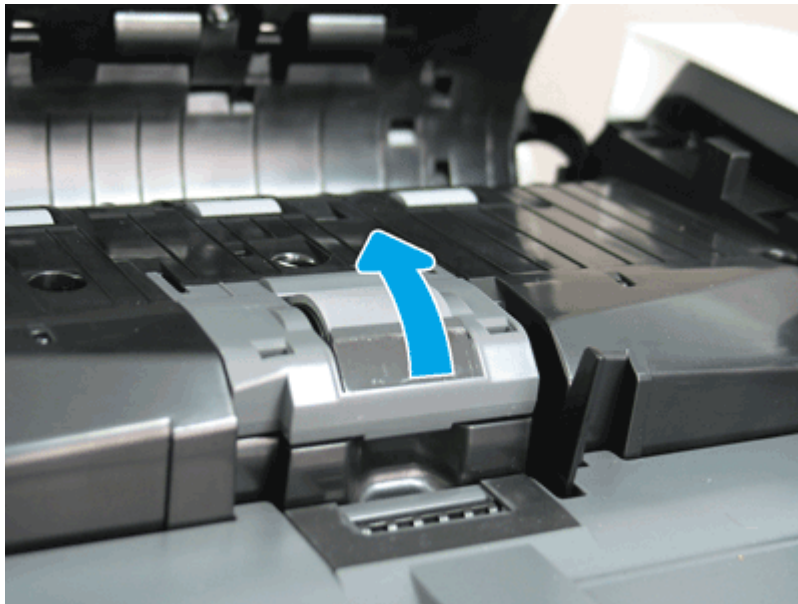


- f. Lift the document feeder separation roller (callout 1), and then remove the roller assembly in the direction indicated by the arrow (callout 2).

Figure 6-19 Remove the separation roller

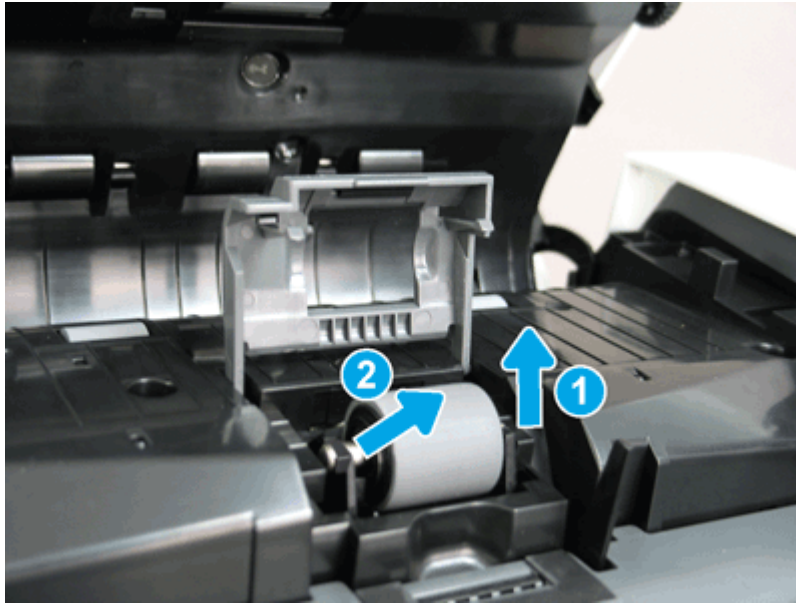


- 3. Install the new document feeder kit.
 - a. Insert the left end of the replacement separation roller into the document feeder location (callout 1), and then press the roller assembly down as indicated by the arrow (callout 2).

Figure 6-20 Install the separation roller

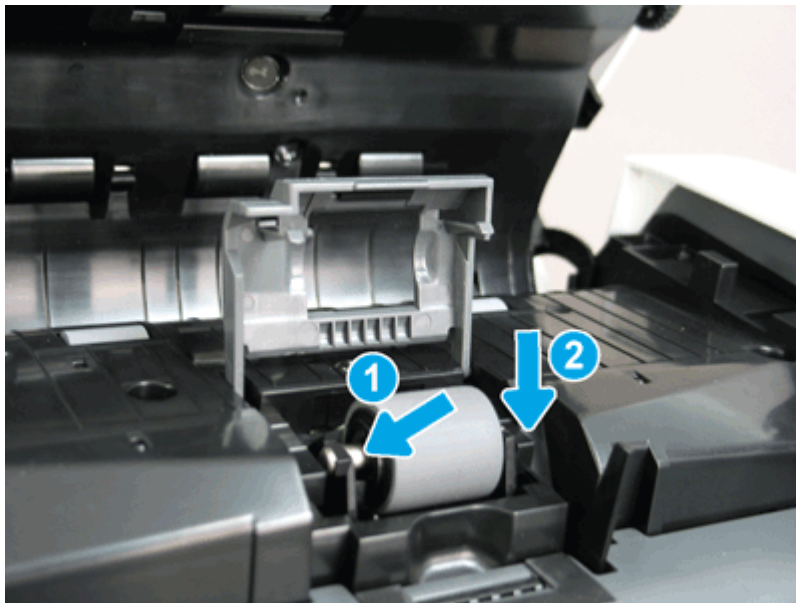


- b. Close the document feeder separation roller cover in the direction indicated by the arrow.

Figure 6-21 Close the separation roller cover

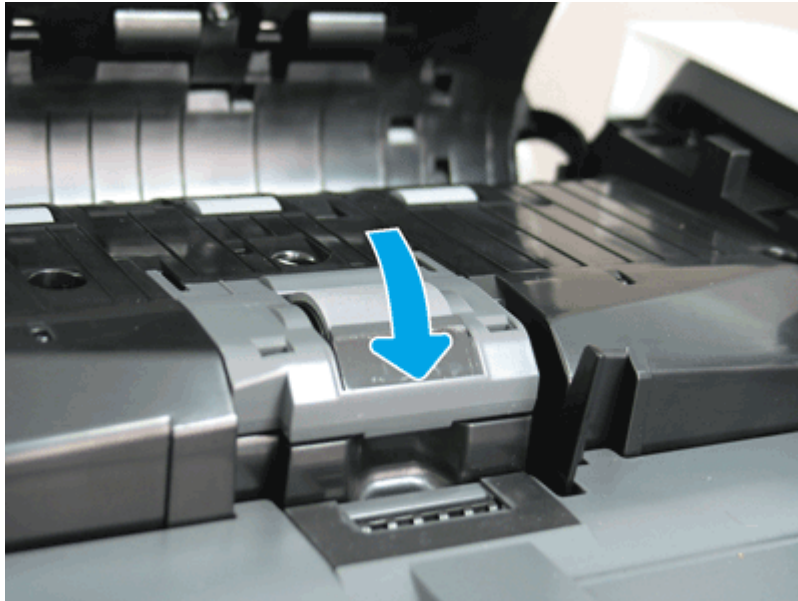


- c. Insert the left end of the replacement pick roller assembly into the document feeder location as indicated.

Figure 6-22 Install the pick roller

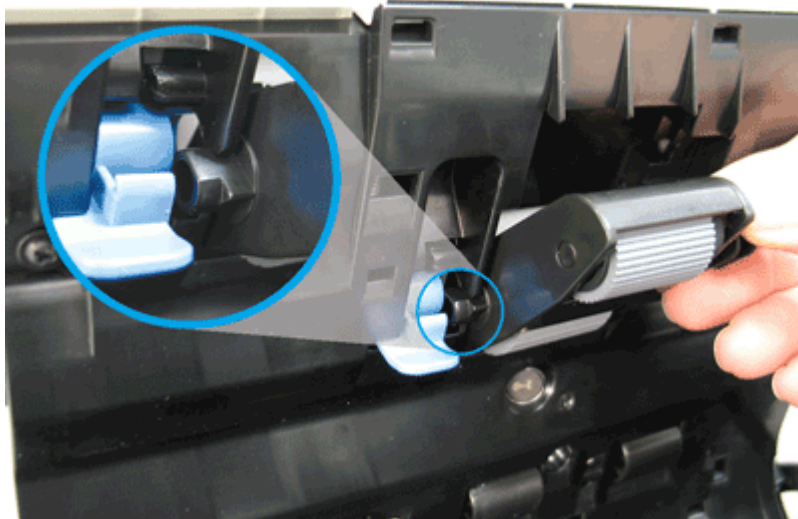


- d. Slide the locking lever toward the back of the printer to secure the document feeder pick roller.

Figure 6-23 Slide the locking lever toward the back

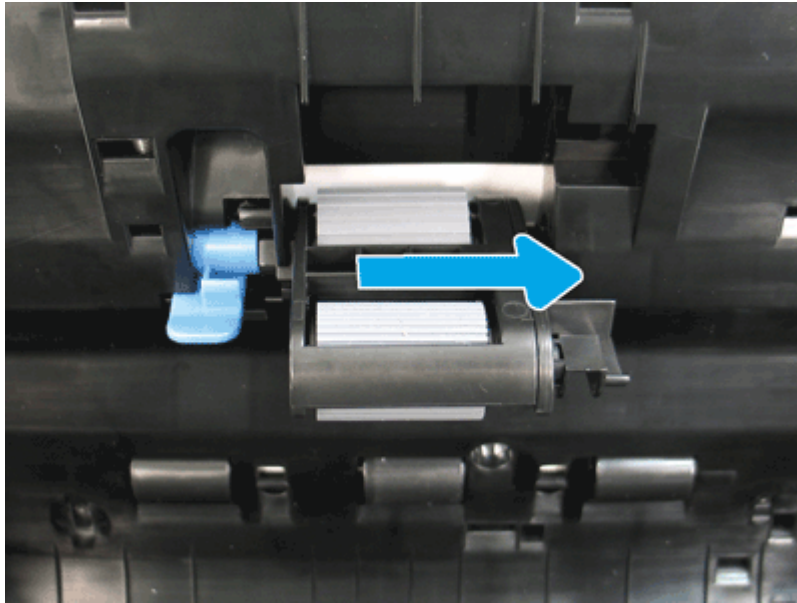


- e. Rotate the pick roller assembly up into the holder (callout 1), and then slide the blue locking lever toward the back of the printer (callout 2).

Figure 6-24 Rotate the pick roller up and slide the blue locking lever towards the back

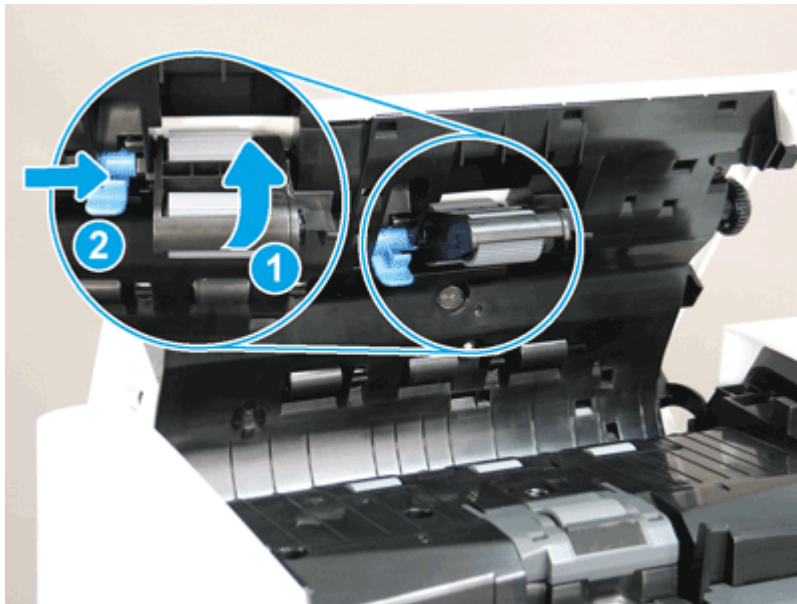

- f. Rotate the blue locking lever up.

Figure 6-25 Rotate the blue locking lever up

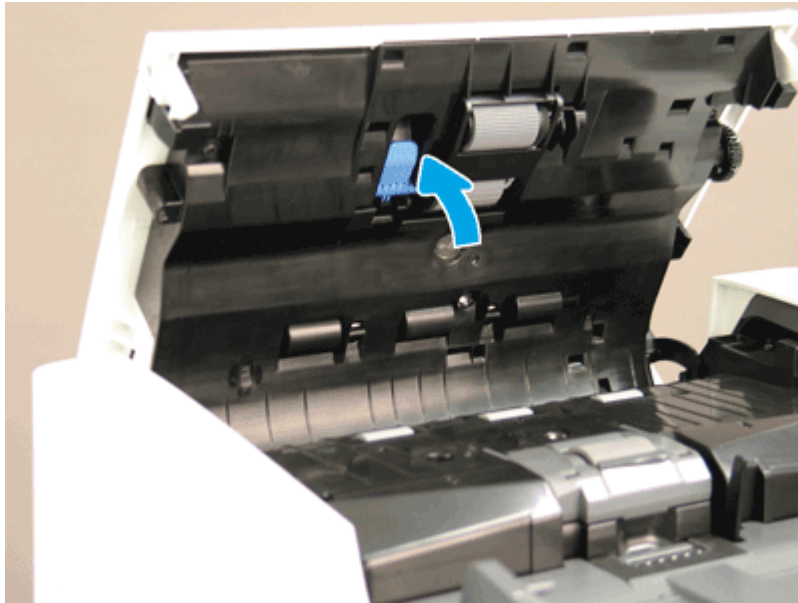

- g. Close the document feeder cover.

Figure 6-26 Close the document feeder cover



- 4. Rest the document feeder kit.
 - a. on the control panel, touch [Supplies](#) menu.
 - b. Touch [Reset Supplies](#).
 - c. Touch [Document Feeder Kit](#).
 - d. Touch [Reset](#).

10 . 99 . 31 Non-HP supply in use.

The printer displays this message when a used supply (a remanufactured or refilled genuine HP or non-HP supply) has been installed.

The 10.99.31 is an event log only message, it will not show on the control panel. The only message to display will be **Used supply in use** message.

Recommended action

- The toner cartridge has been previously used. Touch the **OK** button to continue.



NOTE: Removing a cartridge from one printer and then installing it in a different printer (for testing functionality) will cause this event code.



NOTE: If it is believed the customer purchased a genuine HP supply, go to www.hp.com/go/anticounterfeit.

10 . 99 . 34 Used supply in use.

The printer displays this message when a used supply (a remanufactured or refilled genuine HP or non-HP supply) has been installed.

The 10.99.34 is an event log only message, it will not show on the control panel. The only message to display will be **Used supply in use**.

Recommended action

- The toner cartridge has been previously used. Touch the **OK** button to continue.



NOTE: Removing a cartridge from one printer and then installing it in a different printer (for testing functionality) will cause this event code.



NOTE: If it is believed the customer purchased a genuine HP supply, go to www.hp.com/go/anticounterfeit.

10 . 99 . 40 Genuine HP supplies installed

The printer displays this message when a new cartridge has been installed and all cartridges are Genuine HP.

Recommended action

- Touch the **OK** button to continue.

10 . 99 . 41 Unsupported Supply in use

The toner cartridge is for a different printer.

Recommended action

- Remove the toner cartridge, and then install the correct cartridge for this printer.

11.WX.YZ error messages

11.* errors

Errors in the 11.* family are related to the printer real-time clock.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Set the time and date on the printer control panel.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Set the time and date on the printer control panel.
2. If the error persists, remove and reinstall the formatter. Make sure it is fully seated.
3. If the error still persists, replace the formatter.

11.00.01 or 11.00.02 Internal clock error

The printer real time clock has experienced an error.

01=dead clock

02=dead real time clock

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. Set the time and date on the control panel.



NOTE: The control panel display menu options for the steps below might vary depending on the printer model and firmware version installed.

- a. From the Home screen on the product control panel, select **Settings**.
- b. Select **General**, and then select **Date/Time Settings**.
- c. Open the **Date/Time Format** menu, configure the date and time format, and then save the settings.


- d. Open the [Date/Time](#) menu and configure the date and time zone settings for the printer location.



NOTE: If you are in an area that uses daylight savings time, select the [Adjust for Daylight Savings](#) check box.

- e. Select [Done](#) to save the settings.

Figure 6-27 Date/Time Settings

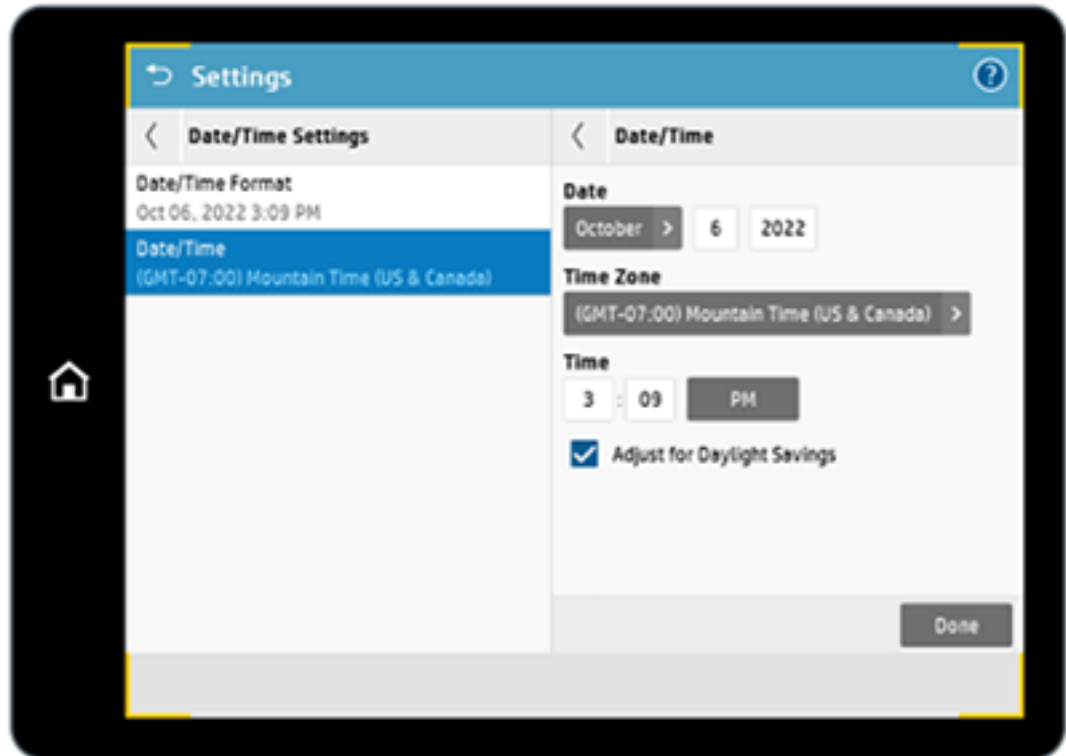

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. Set the time and date on the control panel.



NOTE: The control panel display menu options for the steps below might vary depending on the printer model and firmware version installed.

- a. From the Home screen on the product control panel, select [Settings](#).
- b. Select [General](#), and then select [Date/Time Settings](#).
- c. Open the [Date/Time Format](#) menu, configure the date and time format, and then save the settings.


- d. Open the [Date/Time](#) menu and configure the date and time zone settings for the printer location.



NOTE: If you are in an area that uses daylight savings time, select the [Adjust for Daylight Savings](#) check box.

- e. Select [Done](#) to save the settings.

Figure 6-28 Date/Time Settings

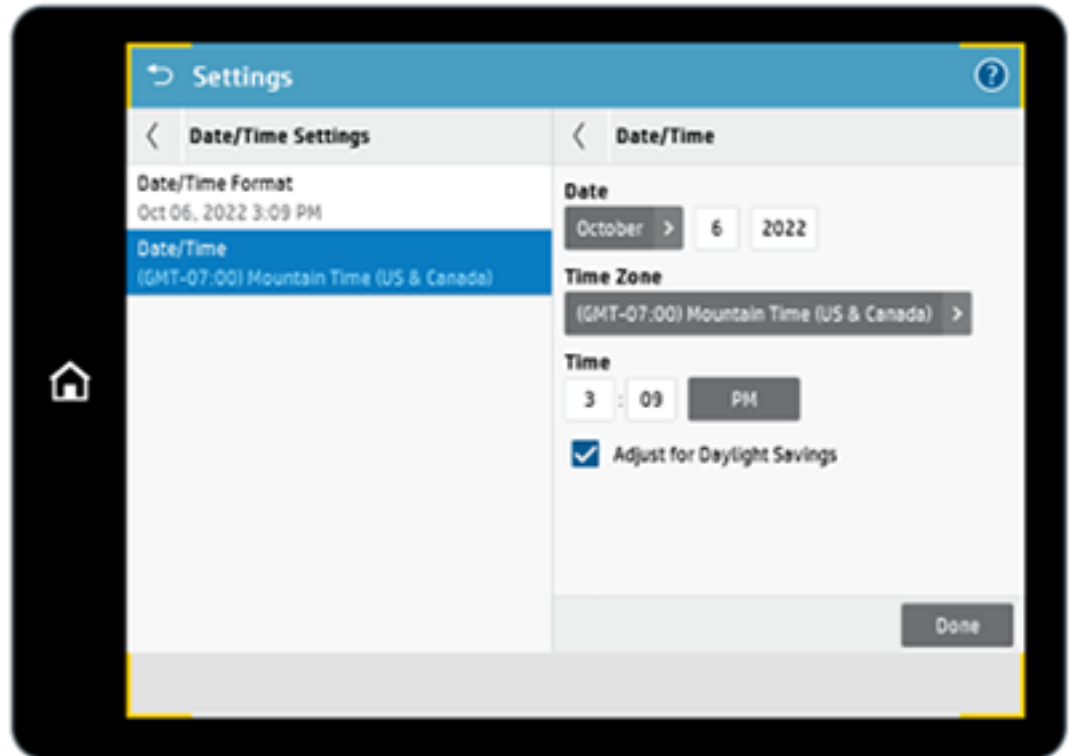

3. If the error persists, replace the formatter.

Use the table below to order the correct part number.

Table 6-2 Formatter part number

Description	Part number
Formatter (main logic) PC board	J8J61-60001

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. Set the time and date on the control panel.



NOTE: The control panel display menu options for the steps below might vary depending on the printer model and firmware version installed.


- a. From the Home screen on the product control panel, select [Settings](#).
- b. Select [General](#), and then select [Date/Time Settings](#).
- c. Open the [Date/Time Format](#) menu, configure the date and time format, and then save the settings.
- d. Open the [Date/Time](#) menu and configure the date and time zone settings for the printer location.



NOTE: If you are in an area that uses daylight savings time, select the [Adjust for Daylight Savings](#) check box.

- e. Select [Done](#) to save the settings.

Figure 6-29 Date/Time Settings

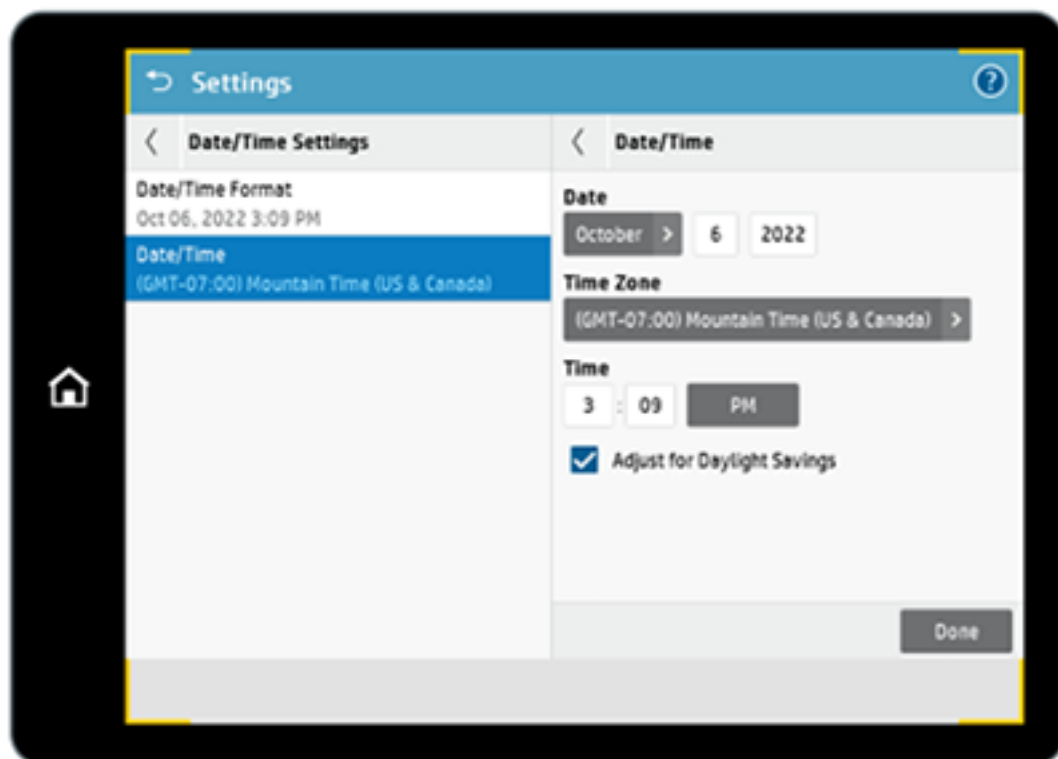

3. If the error persists, replace the formatter.



IMPORTANT: Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

Use the table below to order the correct part number.

Table 6-3 Formatter part number

Description/ Product models	Part number
Formatter (main logic) PC board	J8J61-60001
For products: M631, M632, M633, E62555, E62565, E62575	

Table 6-3 Formatter part number (continued)

Description/ Product models	Part number
Formatter (main logic) PC board	3GY14-67901
For products: E62655/E62665/E62675	
Kit -Formatter	3GY14-67902
For products: E62655/E62665/E62675 (India/China)	
Formatter	7PS94-67901
For products: M634, M635, M636, M637 (India/China)	
Formatter	7PS94-67902
For products: M634, M635, M636, M637	

For instructions: See the Repair Service Manual for this product.

13.WX.YZ error messages

13.* errors

Errors in the 13.* family are related to jams.

More than 1000 unique error codes are possible. Use the following information to understand the jam code. Not all codes apply to all printers.

Message format: 13.WX.YZ

- W represents the jam location.
- X represents the sensor or door that triggered the jam.
- Y represents the jam condition (delay, stay, wrap, etc.)
- Z represents the paper source, fuser mode, or destination

Table 6-4 Potential values for W and X

W	Jam location	X	Sensor or door
A	Input area	0	Envelope feeder
A	Input area	1	Tray 1 feed (unless Tray 1 feed is the registration sensor)
A	Input area	2	Tray 2 feed (unless Tray 2 feed is the registration sensor)
A	Input area	3	Tray 3 feed
A	Input area	4	Tray 4 feed
A	Input area	5	Tray 5 feed
A	Input area	6	Tray 6 feed
A	Input area	7	Optional tray exit sensor
A	Input area	A	Door 1
A	Input area	B	Door 2
A	Input area	C	Door 3
A	Input area	D	Door 4
A	Input area	E	Door 5
A	Input area	F	Multiple sensors or doors
B	Image area	0	Media sensor for forbidden transparencies
B	Image area	2	Registration/top of page
B	Image area	3	Top of page
B	Image area	4	Loop
B	Image area	5	Fuser input
B	Image area	9	Fuser output
B	Image area	A	Door 1

Table 6-4 Potential values for W and X (continued)

W	Jam location	X	Sensor or door
B	Image area	B	Door 2
B	Image area	F	Multiple sensors or doors
C	Switchback area (between the fuser and the output bin)	1	Intermediate switchback sensor
C	Switchback area (between the fuser and the output bin)	2	Switchback media stay sensor
C	Switchback area (between the fuser and the output bin)	3	Paper delivery sensor
D	Duplex area	1	Duplex switchback
D	Duplex area	2	Duplex delivery
D	Duplex area	3	Duplex refeed
D	Duplex area	A	Door 1 (if different than the imaging area)
D	Duplex area	B	Door 2 (if different than the imaging area)
D	Duplex area	F	Multiple sensors or doors
E	Output or intermediate paper transport unit (IPTU) area	1	Output bin full sensor
E	Output or intermediate paper transport unit (IPTU) area	2	IPTU feed sensor 1
E	Output or intermediate paper transport unit (IPTU) area	3	IPTU sensor 2
E	Output or intermediate paper transport unit (IPTU) area	4	IPTU sensor 3
E	Output or intermediate paper transport unit (IPTU) area	5	IPTU bin full sensor 4
E	Output or intermediate paper transport unit (IPTU) area	6	Output sensor
E	Output or intermediate paper transport unit (IPTU) area	A	Door 1
E	Output or intermediate paper transport unit (IPTU) area	F	Multiple sensors or doors
F	Multiple subsystems (occurs when paper is stuck in several areas)	F	Multiple sensors or doors
1	Jetlink input device	4	Tray 4 feed sensor
1	Jetlink Input device	5	Tray 5 feed sensor
1	Jetlink Input device	6	Tray 6 feed sensor
1	Jetlink Input device	7	Tray 7 feed sensor
1	Jetlink Input device	8	Tray 8 feed sensor
1	Jetlink Input device	9	Tray 9 feed sensor
1	Jetlink Input device	A	Door 1
1	Jetlink Input device	B	Door 2

Table 6-4 Potential values for W and X (continued)

W	Jam location	X	Sensor or door
1	Jetlink Input device	F	Multiple sensors or doors
2	Buffer pass unit	0	Buffer pass inlet sensor
2	Buffer pass unit	9	Buffer pass exit sensor
2	Buffer pass unit	A	Door 1
3	Page insert unit	0	Page insertion inlet sensor
3	Page insert unit	1	Page insertion tray 1 feed sensor
3	Page insert unit	2	Page insertion tray 2 feed sensor
3	Page insert unit	3	Page insertion tray 3 feed sensor
3	Page insert unit	4	Page insertion tray 4 feed sensor
3	Page insert unit	7	Output path feed sensor
3	Page insert unit	9	Page insertion exit sensor
3	Page insert unit	A	Door 1
4	Punch unit	0	Puncher inlet sensor
4	Punch unit	1	Puncher jam sensor
4	Punch unit	9	Puncher exit sensor
4	Punch unit	A	Door 1
5	Folding unit	0	Folder inlet sensor
5	Folding unit	1	Folder sensor
5	Folding unit	9	Folder exit sensor
5	Folding unit	A	Door 1
6	Stacker unit	0	Stacker inlet sensor
6	Stacker unit	4	Stacker outlet sensor
6	Stacker unit	7	Stacker switchback entrance sensor
6	Stacker unit	8	Stacker switchback registration sensor
6	Stacker unit	9	Stacker switchback lower sensor
7	Multi-bin mailbox (MBM) unit	0	MBM inlet sensor
7	Multi-bin mailbox (MBM) unit	1	MBM middle sensor
7	Multi-bin mailbox (MBM) unit	9	Stapler sensor
7	Multi-bin mailbox (MBM) unit	A	Door 1
7	Multi-bin mailbox (MBM) unit	B	Door 2
7	Multi-bin mailbox (MBM) unit	C	Door 3
7	Multi-bin mailbox (MBM) unit	F	Multiple sensors or doors
8	Stapler/stacker (SS) unit	0	SS inlet sensor
8	Stapler/stacker (SS) unit	1	SS Bin Z

Table 6-4 Potential values for W and X (continued)

W	Jam location	X	Sensor or door
8	Stapler/stacker (SS) unit	3	SS unit middle sensor
8	Stapler/stacker (SS) unit	4	SS unit outlet sensor 1
8	Stapler/stacker (SS) unit	5	SS unit outlet sensor 2
8	Stapler/stacker (SS) unit	9	Stapler sensor
8	Stapler/stacker (SS) unit	A	Door 1
8	Stapler/stacker (SS) unit	B	Door 2
9	Booklet maker unit	0	Booklet maker input sensor
9	Booklet maker unit	2	Booklet maker feed sensor 2
9	Booklet maker unit	2	Booklet maker feed sensor 3
9	Booklet maker unit	4	Booklet maker delivery sensor
9	Booklet maker unit	5	Booklet maker vertical paper path sensor
9	Booklet maker unit	6	Booklet unit front staple sensor
9	Booklet maker unit	7	Booklet unit rear staple sensor
9	Booklet maker unit	8	Booklet unit outlet sensor
9	Booklet maker unit	A	Door 1
9	Booklet maker unit	B	Door 2
9	Booklet maker unit	C	Door 3
9	Booklet maker unit	F	Multiple sensors or doors
0	Unknown	0	Unknown

Table 6-5 Potential values for Y (jam condition)

Y	Jam condition
0	Unknown
1	Unexpected sheet (duplex)
2	Staple jam
3	Jam caused by an open door (duplex)
4	Stay jam (the page never left the tray - duplex)
A	Stay jam (the page never left the tray - simplex)
B	Multifeed
C	Wrap
D	Delay (the page did not reach the sensor within the expected time - simplex)
E	Door open
F	Residual (paper is detected in the paper path when it should not be there)

The information represented by the value for Z depends on where the paper is in the paper path.

Table 6-6 Potential values for Z (source, fuser mode, or destination)

Paper location	Z	Source, fuser mode, or destination
When paper has not reached the fuser, Z represents the paper source.	1	Tray 1
Z represents the paper source.	2	Tray 2
Z represents the paper source.	3	Tray 3
Z represents the paper source.	4	Tray 4
Z represents the paper source.	5	Tray 5
Z represents the paper source.	6	Tray 6
Z represents the paper source.	D	Duplexer
Z represents the paper source.	E	Envelope feeder
When paper has reached the fuser, is in the duplex path, or in the output path, Z represents the fuser mode.	0	Photo 1, 2, or 3 Designated 2 or 3
Jams can occur when there is a mismatch between the actual paper and the fuser mode setting.		
Z represents the fuser mode.	1	Normal (automatically sensed rather than based on the paper type set at the control panel)
Z represents the fuser mode.	2	Normal (based on the paper type set at the control panel)
Z represents the fuser mode.	3	Light 1, 2, or 3
Z represents the fuser mode.	4	Heavy 1
Z represents the fuser mode.	5	Heavy 2
Z represents the fuser mode.	6	Heavy 3
Z represents the fuser mode.	7	Glossy 1
Z represents the fuser mode.	8	Glossy 2
Z represents the fuser mode.	9	Glossy 3
Z represents the fuser mode.	A	Glossy Film
Z represents the fuser mode.	B	Transparency
Z represents the fuser mode.	C	Label
Z represents the fuser mode.	D	Envelope 1, 2, or 3
Z represents the fuser mode.	E	Rough
When paper has entered the output bin, Z represents the output bin, numbered from top to bottom.	0	Unknown bin
Z represents the output bin	1	Bin 1
Z represents the output bin	2	Bin 2
Z represents the output bin	3	Bin 3
Z represents the output bin	4	Bin 4

Table 6-6 Potential values for Z (source, fuser mode, or destination) (continued)

Paper location	Z	Source, fuser mode, or destination
Z represents the output bin	5	Bin 5
Z represents the output bin	6	Bin 6
Z represents the output bin	7	Bin 7
Z represents the output bin	8	Bin 8
Z represents the output bin	9	Bin 9
All paper locations	E	Door open jam
All paper locations	F	Residual jam
All paper locations	0	Forbidden OHT jam (when Y=2)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size, and the tray should not be filled above the maximum fill marks or tabs.
4. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
5. Use a damp, lint-free cloth to clean the rollers in the appropriate tray. Replace rollers that are worn.
6. Open all doors and covers and ensure the paper path is completely clear of paper or obstructions.
7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

To prevent future paper jams in the printer, follow these recommendations:

- Use only paper that meets HP specifications for this printer.
For more information, refer to the printer User Guide or search for the "HP LaserJet Printers - Print Media Guide" (c06117757).
- Make sure the printing environment is within recommended specifications.
- Do not use paper that is wrinkled, folded, or damaged.
- Do not overload the tray with paper.
- Make sure that the paper guides in the tray are adjusted correctly for the size of paper.
- Make sure that the tray is fully inserted in the printer.
- If printing on heavy, embossed, or perforated paper, use the manual feed feature and feed sheets one at a time.

- Open the [Trays](#) menu on the printer control panel. Verify that the tray is configured correctly for the paper type and size.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size, and the tray should not be filled above the maximum fill marks or tabs.
4. Verify that the paper meets specifications for this printer.
5. Use a damp, lint-free cloth to clean the rollers in the appropriate tray. Replace rollers that are worn.
6. If the issue persists, open the [Administration > Troubleshooting > Diagnostic Tests > Component Test](#) menu, and perform the appropriate pickup/feed motor drive test. Replace the pickup assembly if the test fails.
7. Verify the sensors are functioning correctly. If the sensors fail the test, first verify that all connections on the DC controller are correctly seated. If possible, replace the sensor or assembly it is associated with.
8. If the sensors pass the test, look for blockage or damaged parts and replace any damaged parts.
9. If the error persists, elevate the case using the Standard Support Process.

13.00.EE

Unknown door open.

Recommended action for all

- Ensure that all of the doors and covers are closed.

13.00.FF

Residual jam.

This error has no specific sensor designated. It could be any sensor in the paper feed path and the required jam access point has not been accessed.

Recommended action for customers

1. Check the printer for a jam.
2. Remove any paper present or obstructions in the paper path.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Check the printer for a jam.
2. Remove any paper present or obstructions in the paper path.
3. View event log to determine if other jam errors are occurring and troubleshoot those errors.
4. Use the manual sensors test to isolate a faulty door switch or sensor.
 - a. From the home screen on the printer control panel, touch ["Support Tools"](#).
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
 - c. Select from the following tests:
 - [All Sensors](#)
 - [Input Tray Sensors](#) (choose from the group of sensors to test)
 - [Output Bin Sensors](#)
 - [Engine Sensors](#)
 - [Done](#) (return to the [Troubleshooting](#) menu)
 - [Reset](#) (reset the selected sensor's state)
5. Replace parts as determined by sensor tests, obstructions or broken parts.

13.A3.Dz

Paper delay jam at the tray 3 feed sensor.

- **13.A3.D3** Paper did not reach the Tray 3 feed sensor in the designated amount of time when printing from Tray 3.
- **13.A3.D4** Paper did not reach the Tray 3 feed sensor in the designated amount of time when printing from Tray 4.
- **13.A3.D5** Paper did not reach the Tray 3 feed sensor in the designated amount of time when printing from Tray 5.


Recommended action for customers

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the printer right door.
 - c. Remove any paper present or obstructions in the paper path.
 - d. Open the tray 3 right door.

- e. Press on the green arm to open the paper access cover.



NOTE: The following image shows a 3X550 sheet paper deck. All other accessory input trays have the same access area.

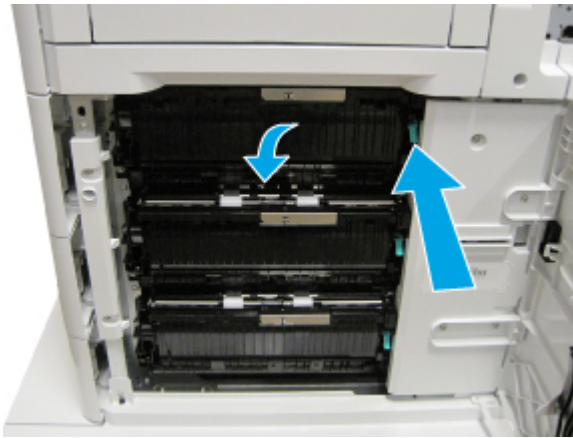

- f. Remove any paper present or obstructions in the paper path.
 - g. Close the right and lower right to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
 3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-30 Paper tray guides


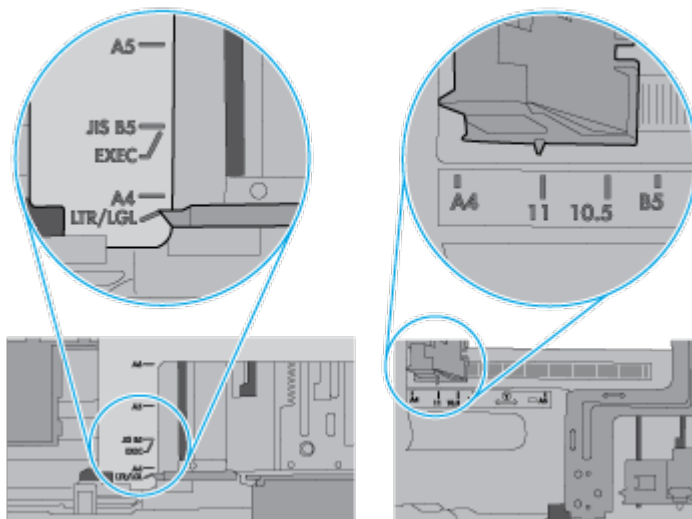


Figure 6-31 Paper height guides



4. Ensure that the tray 3 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.

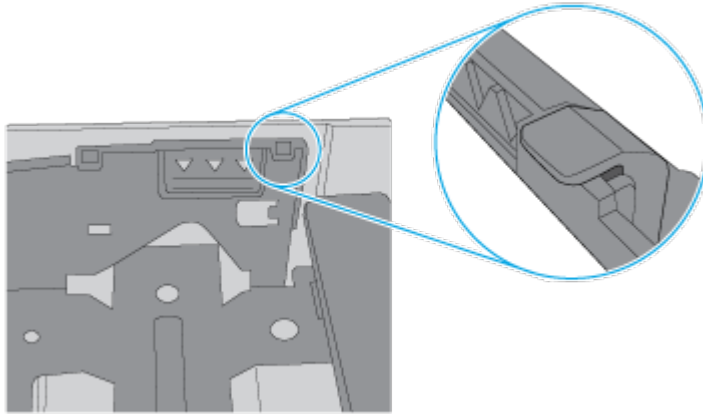

NOTE: Clean the rollers with a dampened lint free cloth or paper.

Part number: J8J70-67906


6. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the printer right door.
 - c. Remove any paper present or obstructions in the paper path.
 - d. Open the tray 3 right door.
 - e. Press on the green arm to open the paper access cover.



NOTE: The following image shows a 3X550 sheet paper deck. All other accessory input trays have the same access area.

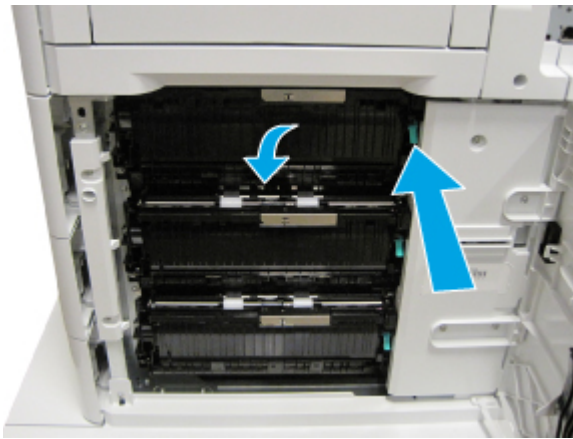

- f. Look for and clear any paper present or obstructions in the paper path.
 - g. Close the right and lower right to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
 3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-32 Paper tray guides


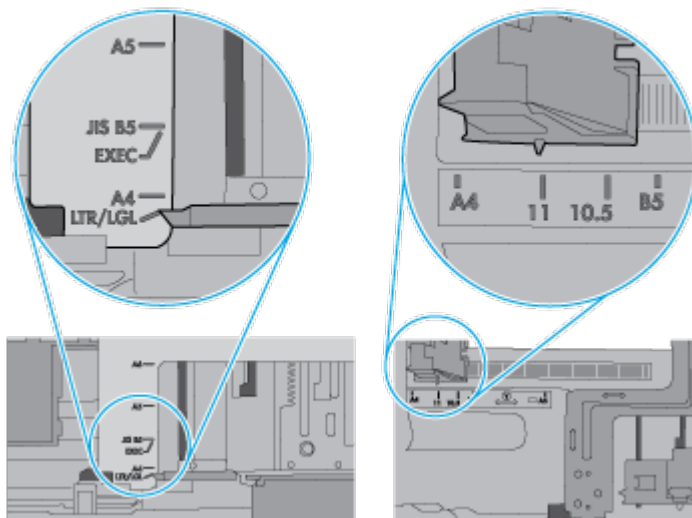


Figure 6-33 Paper height guides



4. Ensure that the tray 3 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.

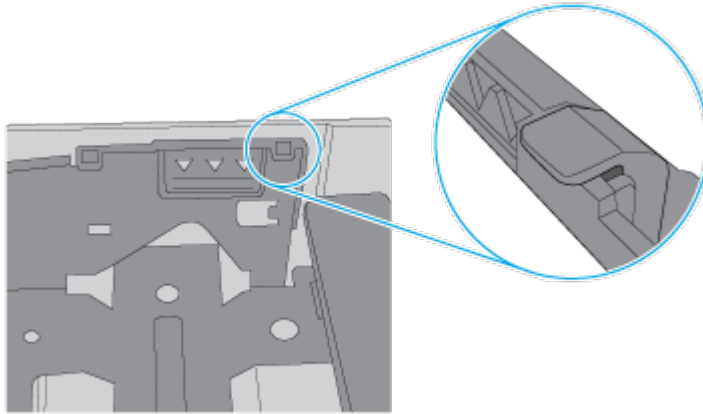


NOTE: Clean the rollers with a dampened lint free cloth or paper.

Part number: J8J70-67906

For instructions: See the Repair Service Manual for this product.

6. Perform a print test from tray 2 to ensure the printer main motor and gear drive is functioning correctly.
7. Check the printer entrance from tray 3.
 - a. Open the right door a inspect the tray 3 input area for obstructions and clear paper path as needed.

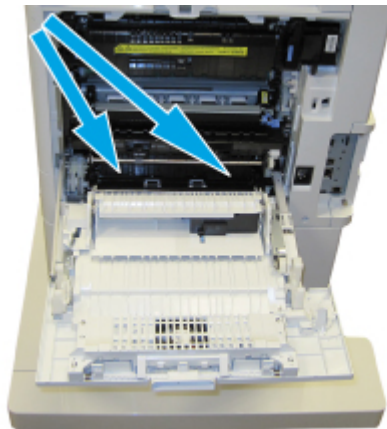

- b. Ensure the input feed rollers are clean and free of debris. Clean rollers as needed.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

8. Test the tray 3 paper feed sensor using the manual sensor test.
 - a. From the home screen on the printer control panel, touch "[Support Tools](#)".

b. Open the following menus:


- [Troubleshooting](#)
- [Diagnostic Tests](#)
- [Manual Sensor Test](#)
- [All Sensors , Input tray sensors](#)

c. Touch [Tray 3 paper feed sensor](#) to test the sensor.

d. Use a piece of paper or other object to test the sensor to verify that it is functioning correctly.



NOTE: The following image shows a 3X550 sheet paper deck. All other accessory input trays have the same sensor location area.

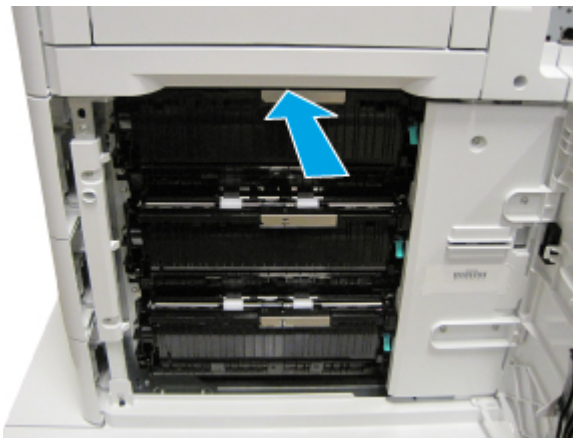

e. If the sensor does not function correctly, replace the tray 3 pickup assembly.



NOTE: Before replacing parts, ensure all connections on the paper feeder controller for tray 3 are correctly and securely connected..

Part number: RM2-0892-000CN

550 Sheet feeder instructions: See the Repair Service Manual for this product.

1x550 sheet paper deck instructions: See the Repair Service Manual for this product.

3x550 sheet paper deck instructions: See the Repair Service Manual for this product.

2x550 sheet paper deck instructions: See the Repair Service Manual for this product.

9. If the sensor functions correctly, test the tray 3 pickup/drive motor.

a. Open the following menus:

- [Troubleshooting](#)
- [Diagnostic Tests](#)
- [Component Test](#)

b. Touch [Tray 3 pickup motor test](#) to check if it is functioning correctly.

- c. If the motor does not function correctly, replace the feeder drive assembly.



NOTE: Before replacing parts, ensure all connections on the paper feeder controller for tray 3 are correctly and securely connected..

Part number: RM2-0875-000CN

1x550 Envelope sheet feeder instructions: See the Repair Service Manual for this product.

See the Repair Service Manual for this product.

3X550 Sheet paper deck instructions:

See the Repair Service Manual for this product.

2550 Sheet feeder instructions See the Repair Service Manual for this product.

10. If replacing the previous parts does not resolve the error, replace the input accessory controller PCA.

Table 6-7 Part numbers

Part name	Part number	Replacement Instructions
550 sheet paper feeder	RM2-8767-000CN	See the Repair Service Manual for this product.
1X550 sheet feeder stand	RM2-8827-000CN	See the Repair Service Manual for this product.
3X550 sheet feeder	RM2-8807-000CN	See the Repair Service Manual for this product.
2,550 sheet feeder (HCI)	RM2-9020-000CN	See the Repair Service Manual for this product.

13.A4.Dz

Paper delay jam at the tray 4 feed sensor.

- **13.A4.D4** Paper did not reach the Tray 4 feed sensor in the designated amount of time when printing from Tray 4.
- **13.A4.D5** Paper did not reach the Tray 4 feed sensor in the designated amount of time when printing from Tray 5.


Recommended action for customers

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the printer right door.
 - c. Remove any paper present or obstructions in the paper path.
 - d. Open the accessory input tray right door.

- e. Press on the green arm to open the paper access cover.



NOTE: The following image shows a 3X550 sheet paper deck. All other accessory input trays have the same access area.

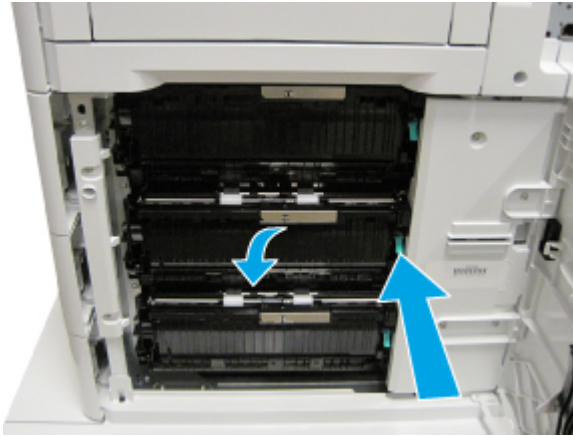

- f. Remove any paper present or obstructions in the paper path.
 - g. Close the right and lower right to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
 3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-34 Paper tray guides


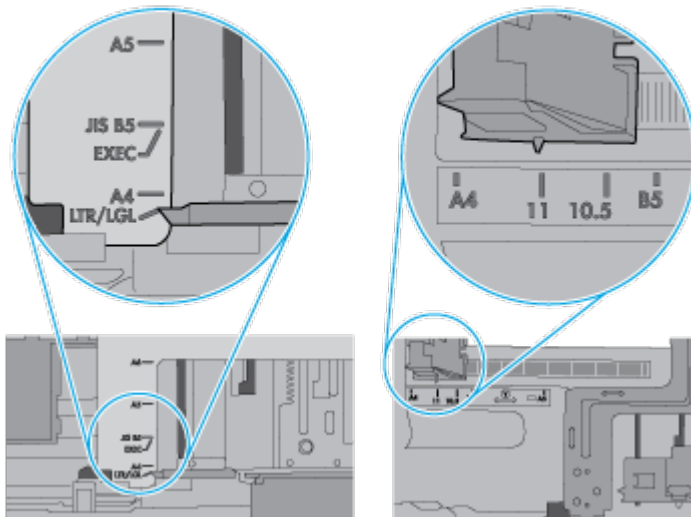


Figure 6-35 Paper height guides



4. Ensure that the tray 4 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.

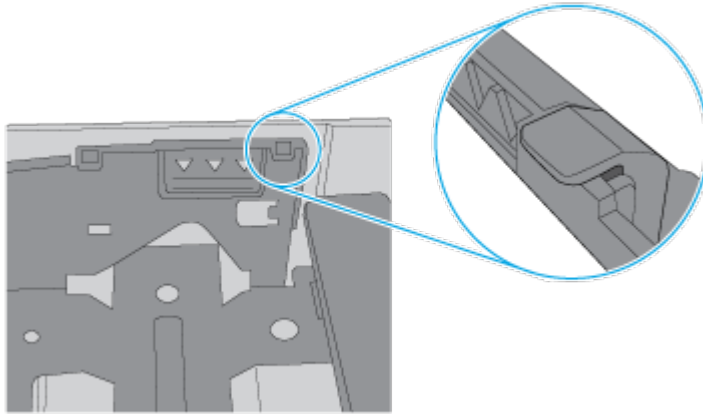

NOTE: Clean the rollers with a dampened lint free cloth or paper.

Part number: J8J70-67906


6. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the printer right door.
 - c. Remove any paper present or obstructions in the paper path.
 - d. Open the accessory input tray right door.
 - e. Press on the green arm to open the paper access cover.



NOTE: The following image shows a 3X550 sheet paper deck. All other accessory input trays have the same access area.

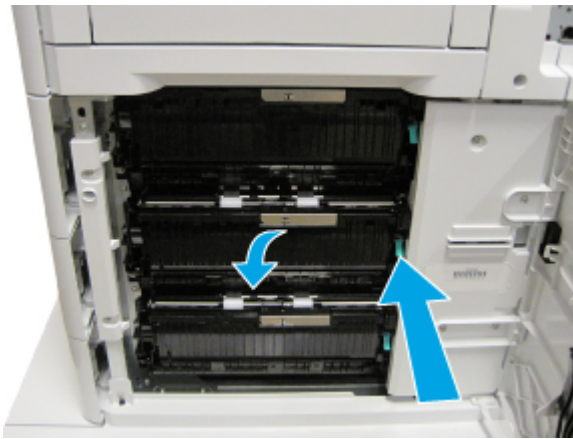

- f. Look for and clear any paper present or obstructions in the paper path.
 - g. Close the right and lower right to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
 3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-36 Paper tray guides


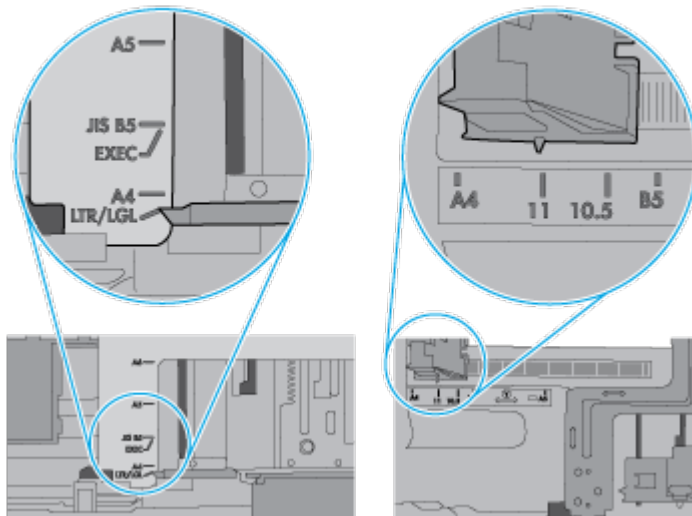


Figure 6-37 Paper height guides



4. Ensure that the tray 4 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.

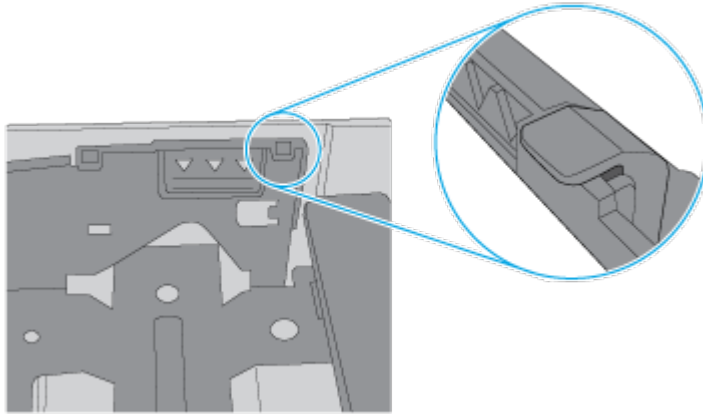

NOTE: Clean the rollers with a dampened lint free cloth or paper.


Part number: J8J70-67906

For instructions: See the Repair Service Manual for this product.

6. Test the tray 4 paper feed sensor using the manual sensor test.
 - a. From the home screen on the printer control panel, touch ["Support Tools"](#).
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
 - [All Sensors , Input tray sensors](#)
 - c. Touch [Tray 4 paper feed sensor](#) to test the sensor.
 - d. Use a piece of paper or other object to test the sensor to verify that it is functioning correctly.



NOTE: The following image shows a 3X550 sheet paper deck. All other accessory input trays have the same sensor location area.

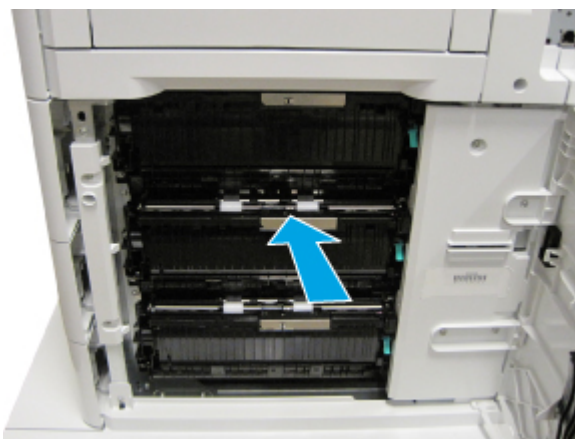

- e. If the sensor does not function correctly, replace the tray 4 pickup assembly.



NOTE: Before replacing parts, ensure all connections on the paper feeder controller for tray 4 are correctly and securely connected..

Part number: RM2-0892-000CN

550 Sheet feeder instructions: See the Repair Service Manual for this product.

3x550 sheet paper deck instructions: See the Repair Service Manual for this product.

2x550 sheet paper deck instructions: See the Repair Service Manual for this product.

7. If the sensor functions correctly, test the tray 4 pickup/drive motor.

- a. Open the following menus:

- [Troubleshooting](#)
- [Diagnostic Tests](#)
- [Component Test](#)

- b. Touch [Tray 4 pickup motor test](#) to check if it is functioning correctly.

- c. If the motor does not function correctly, replace the feeder drive assembly.



NOTE: Before replacing parts, ensure all connections on the paper feeder controller for tray 3 are correctly and securely connected..

Part number: RM2-0875-000CN

1x550 Envelope sheet feeder instructions: See the Repair Service Manual for this product.

See the Repair Service Manual for this product.

3X550 Sheet paper deck instructions:

See the Repair Service Manual for this product.

2550 Sheet feeder instructions See the Repair Service Manual for this product.

8. If replacing the previous parts does not resolve the error, replace the input accessory controller PCA.

Table 6-8 Part numbers

Part name	Part number	Replacement Instructions
1X550 sheet feeder stand	RM2-8827-000CN	See the Repair Service Manual for this product.
3X550 sheet feeder	RM2-8807-000CN	See the Repair Service Manual for this product.
2,550 sheet feeder (HCI)	RM2-9020-000CN	See the Repair Service Manual for this product.

13.A5.D5

Paper did not reach the Tray 5 feed sensor in the designated amount of time when printing from Tray 5.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the printer right door.
 - c. Remove any paper present or obstructions in the paper path.
 - d. Open the accessory input tray right door.
 - e. Press on the green arm to open the paper access cover.



- f. Remove any paper present or obstructions in the paper path.
 - g. Close the right and lower right to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.

3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-38 Paper tray guides


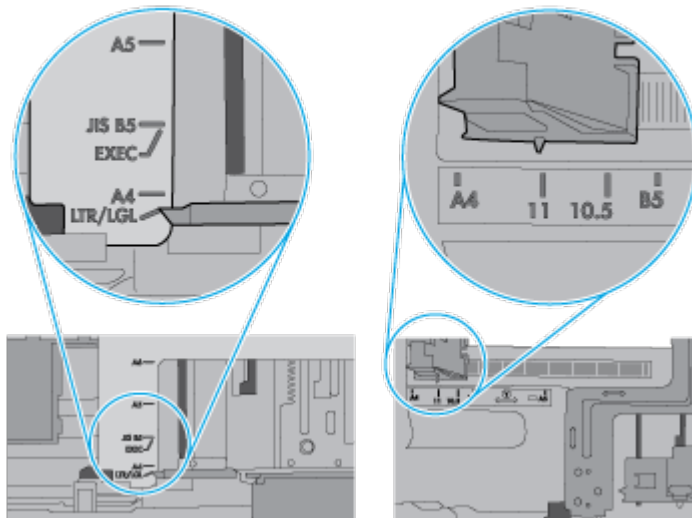


Figure 6-39 Paper height guides



4. Ensure that the tray 5 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.

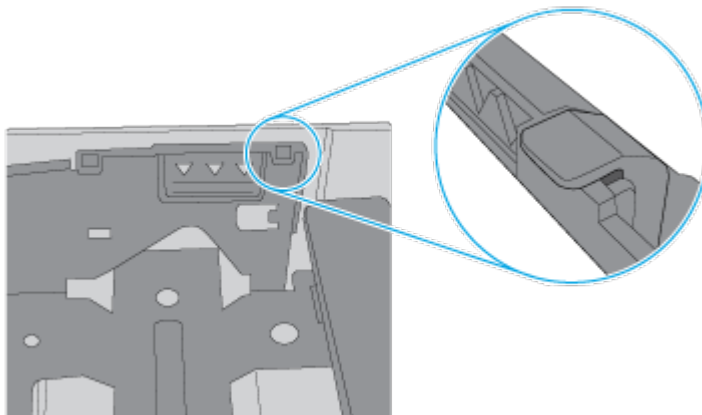

NOTE: Clean the rollers with a dampened lint free cloth or paper.


Part number: J8J70-67906

6. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.

- a. Open the tray and remove any jammed paper, and then close the tray.
- b. Open the printer right door.
- c. Remove any paper present or obstructions in the paper path.
- d. Open the accessory input tray right door.
- e. Press on the green arm to open the paper access cover.

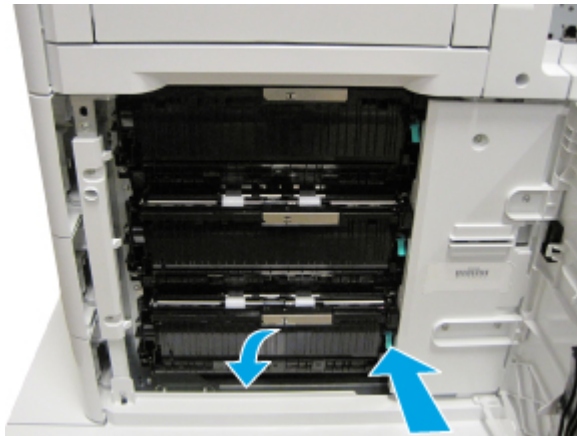

- f. Look for and clear any paper present or obstructions in the paper path.
 - g. Close the right and lower right to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
 3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-40 Paper tray guides


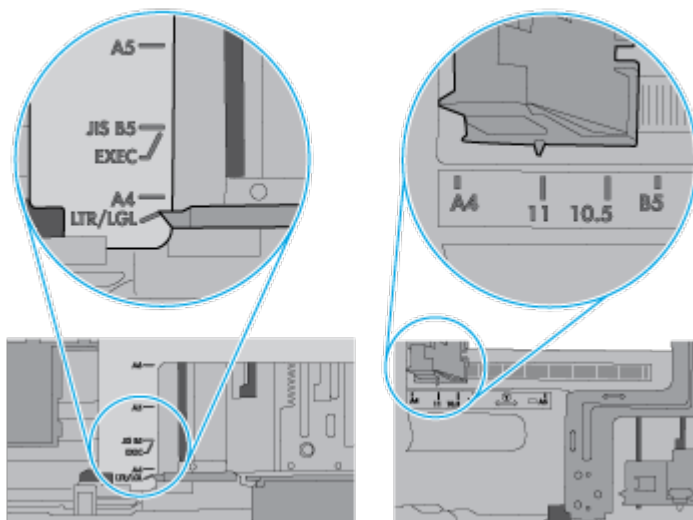


Figure 6-41 Paper height guides



4. Ensure that the tray 5 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.

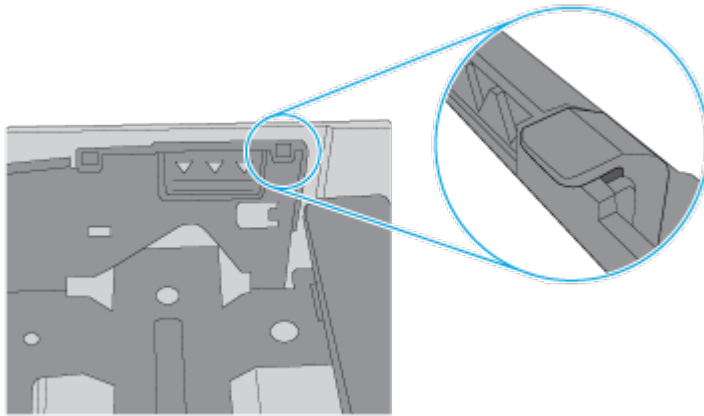


NOTE: Clean the rollers with a dampened lint free cloth or paper.

Part number: J8J70-67906

For instructions: See the Repair Service Manual for this product.

6. Test the tray 5 paper feed sensor using the manual sensor test.
 - a. From the home screen on the printer control panel, touch [“Support Tools”](#).
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
 - [All Sensors , Input tray sensors](#)
 - c. Touch [Tray 5 paper feed sensor](#) to test the sensor.

- d. Use a piece of paper or other object to test the sensor to verify that it is functioning correctly.

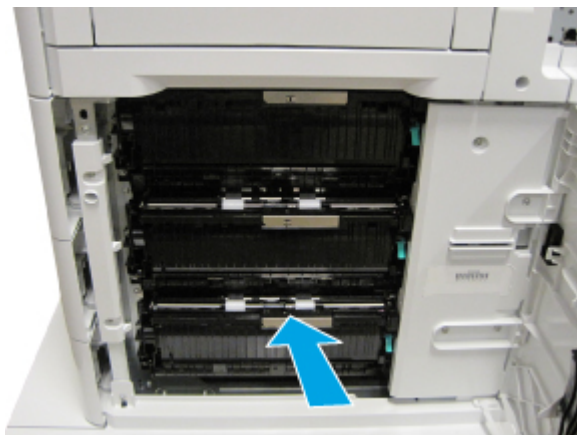

- e. If the sensor does not function correctly, replace the tray 5 pickup assembly.



NOTE: Before replacing parts, ensure all connections on the paper feeder controller for tray 5 are correctly and securely connected..

Part number: RM2-0892-000CN

1x550 Sheet feeder instructions: See the Repair Service Manual for this product.

3x550 sheet paper deck instructions: See the Repair Service Manual for this product.

7. If the sensor functions correctly, test the tray 5 pickup/drive motor.

- a. Open the following menus:

- [Troubleshooting](#)
- [Diagnostic Tests](#)
- [Component Test](#)

- b. Touch [Tray 4 pickup motor test](#) to check if it is functioning correctly.

- c. If the motor does not function correctly, replace the feeder drive assembly.



NOTE: Before replacing parts, ensure all connections on the paper feeder controller for tray 5 are correctly and securely connected..

Part number: RM2-0875-000CN

See the Repair Service Manual for this product.

3X550 Sheet paper deck instructions:

8. If replacing the previous parts does not resolve the error, replace the input accessory controller PCA.

Table 6-9 Part numbers

Part name	Part number	Replacement Instructions
1X550 sheet feeder stand	RM2-8827-000CN	See the Repair Service Manual for this product.

Table 6-9 Part numbers (continued)

Part name	Part number	Replacement Instructions
3X550 sheet feeder	RM2-8807-000CN	See the Repair Service Manual for this product.

13.A3.FF

Residual paper jam in Tray X.


This jam occurs when residual paper is detected at the tray X feed sensor.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the right and lower right doors.
 - c. Look for and clear any paper present or obstructions in the paper path.
 - d. Close the right and lower right to allow the printer to attempt to clear the jam message.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the right and lower right doors.
 - c. Look for and clear any paper present or obstructions in the paper path.
 - d. Close the right and lower right to allow the printer to attempt to clear the jam message.
2. Check the printer entrance from tray 3.
 - a. Open the right door a inspect the tray 3 input area for obstructions and clear paper path as needed.

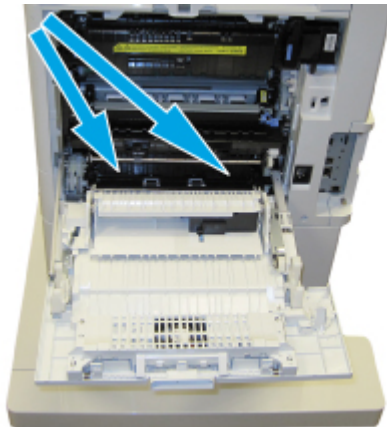

- b. Ensure the input feed rollers are clean and free of debris. Clean rollers as needed.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

3. Test the tray 3 paper feed sensor using the manual sensor test.

- a. From the home screen on the printer control panel, touch “[Support Tools](#)”.

- b. Open the following menus:


- [Troubleshooting](#)
- [Diagnostic Tests](#)
- [Manual Sensor Test](#)
- [All Sensors](#) , [Input tray sensors](#)

- c. Touch [Tray 3 paper feed sensor](#) to test the sensor.

- d. Use a piece of paper or other object to test the sensor to verify that it is functioning correctly.



NOTE: The following image shows a 3X550 sheet paper deck. All other accessory input trays have the same sensor location area.

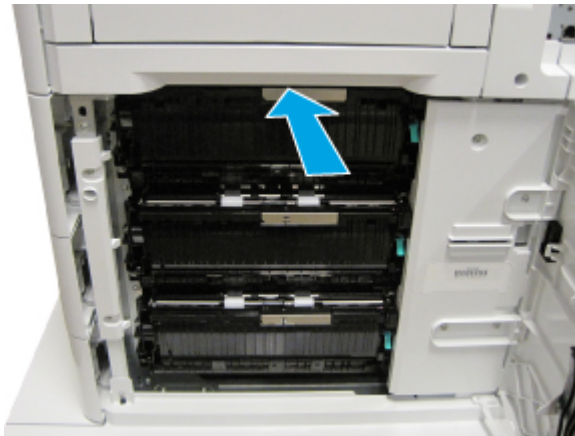

- e. If the sensor does not function correctly, replace the tray 3 pickup assembly.



NOTE: Before replacing parts, ensure all connections on the paper feeder controller for tray 3 are correctly and securely connected..

Part number: RM2-0892-000CN

550 Sheet feeder instructions: See the Repair Service Manual for this product.

1x550 sheet paper deck instructions: See the Repair Service Manual for this product.

3x550 sheet paper deck instructions: See the Repair Service Manual for this product.

2x550 sheet paper deck instructions: See the Repair Service Manual for this product.

4. If the issue persists, elevate the case using the Standard Support Process.

13 . AA . EE Left door open

The left door was opened during printing.

Recommended action for customers


1. Close the left door to allow the printer to attempt to clear the jam.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Close the left door to allow the printer to attempt to clear the jam.
2. Check the projection part on the left door that defeats the left door interlocks. If broken replace the left door assembly.

Part number: RM2-0850-000CN

For instructions: See the Repair Service Manual for this product.

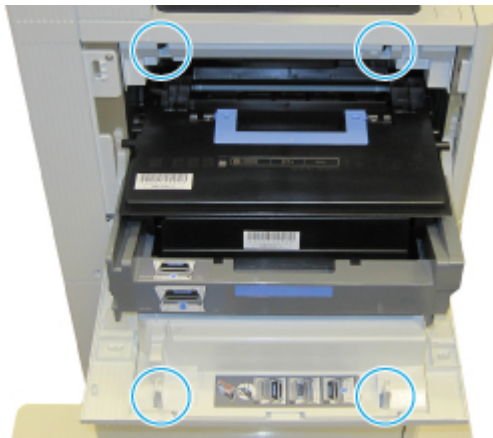


3. Check SW1 using the manual sensor test.
 - a. From the home screen on the printer control panel, touch [“Support Tools”](#).
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
 - c. Select from the following tests:
 - [All Sensors](#) , [Engine Sensors](#)
 - [Done](#) (return to the [Troubleshooting](#) menu)
 - [Reset](#) (reset the selected sensor’s state)

- d. Test SW2 using folded paper or another object to defect the interlock. If the switch test fails, replace the laser shutter assembly.

Part number: RM2-6755-000CN



NOTE: Before replacing any parts check connector J308 on the DC controller.

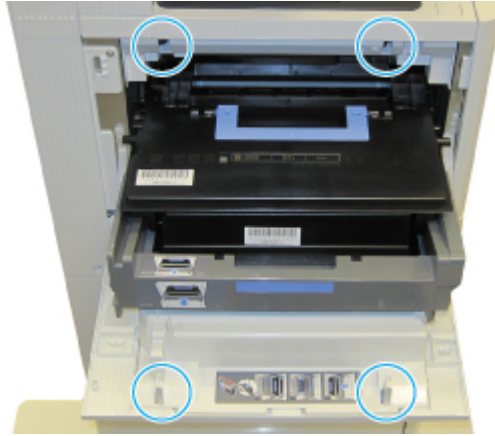

13 . AB . EE Right door Open

The right door was opened during printing.

Recommended action for customers


- Close the right door to allow the printer to attempt to clear the jam.

Recommended action for call-center agents and onsite technicians

1. Close the right door to allow the printer to attempt to clear the jam.
2. Check the projection part on the right door that defeats the right door interlocks. If broken replace the right door assembly.

Part number: RM2-0849-000CN

For instructions: See the Repair Service Manual for this product.

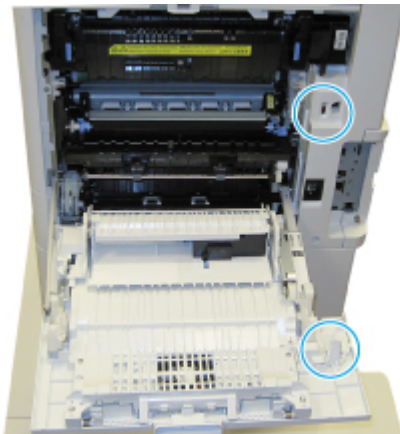


3. Check SW1 using the manual sensor test.
 - a. From the home screen on the printer control panel, touch “Support Tools”.
 - b. Open the following menus:
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - c. Select from the following tests:
 - All Sensors , Engine Sensors
 - Done (return to the Troubleshooting menu)
 - Reset (reset the selected sensor’s state)
 - d. Test SW1 using folded paper or another object to defect the interlock. If the switch test fails, replace the laser shutter assembly.

Part number: RM2-6755-000CN



NOTE: Before replacing any parts check connector J321 on the DC controller.

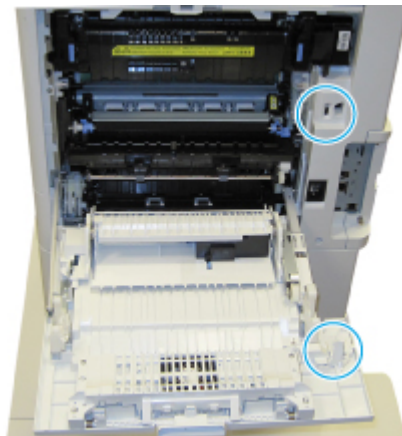

13 . B2 . Az Jam in right door

Paper stay jam in the right door at the image area.

Paper present at PS4550 after a specified time limit has passed.

- **13.B2.A1**

This jam occurs when the registration sensor (PS4550) detects paper present longer than the expected time based on the paper size when printing from Tray 1.

- **13.B2.A2**

This jam occurs when the registration sensor (PS4550) detects paper present longer than the expected time based on the paper size when printing from Tray 2.

- **13.B2.A3**

This jam occurs when the registration sensor (PS4550) detects paper present longer than the expected time based on the paper size when printing from Tray 3.

- **13.B2.AD**

This jam occurs when the registration sensor (PS4550) detects paper present longer than the expected time based on the paper size when printing from the duplexer.

If using adhesive or self-sealing media, please see the instructions in . (ish_3199741-3199797-16).

Recommended action for customers

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. Toggle the registration/TOP sensor (PS4550) to ensure that it moves freely.
4. Test the registration/TOP sensor (PS4550) using the manual sensor test.
 - a. From the home screen on the printer control panel, touch ["Support Tools"](#).
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
 - c. Select from the following tests:
 - [All Sensors](#) , [Engine Sensors](#)
 - [Done](#) (return to the [Troubleshooting](#) menu)
 - [Reset](#) (reset the selected sensor's state)

- d. Test the registration/TOP sensor to verify that the sensor is functioning correctly. If the sensor does not function, replace the registration assembly.



NOTE: Before replacing any parts check connector J15 on the DC controller.

Part number: RM2-6774-000CN

For instructions: See the Repair Service Manual for this product.

5. Check the transfer roller at the transfer area, ensure that everything is correctly seated and that there are no damaged parts. Replace the transfer roller or transfer assembly as needed.

Transfer roller part number: RM2-6800-000CN

For instructions: See the Repair Service Manual for this product.

Transfer assembly part number: RM2-6776-000CN

For instructions: See the Repair Service Manual for this product.

6. If the sensors are functioning correctly, run a few pages to check where the leading edge of the paper actually stops.
7. Check the paper feed frame assembly for broken parts or damage. Replace the feed frame assembly as needed.

Part number: RM2-0851-000CN

For instructions: See the Repair Service Manual for this product.

8. Enter the component test menu to run diagnostics on the printer.

- a. From the home screen on the printer control panel, touch ["Support Tools"](#).

- b. Open the following menus:

- [Troubleshooting](#)
- [Diagnostic Tests](#)
- [Components Test](#)

9. Test the drum motor M2.

- a. Touch [Drum motor](#).

- b. If the motor does not function correctly, ensure connector J203 on the DC controller PCA is securely and correctly seated.

- c. Check the main drive assembly for damage or blocked gears.

- d. Retest the drum motor as needed.

- e. If the drum motor continues to fail, replace the following as needed.

Drum motor part number: RM2-9316-000CN

Drum motor instructions: See the Repair Service Manual for this product.

Main drive assembly part number: RM2-6777-000CN

Main drive instructions: See the Repair Service Manual for this product.

10. Replace the registration assembly.

Part number: RM2-6774-000CN

For instructions: See the Repair Service Manual for this product.

11. If the issue persists, elevate the case using the Standard Support Process.

13 . B2 . D1 Jam in right door

Paper delay jam in the right door at the image area.

Paper did not reach PS4550 in the specified time when printing from Tray 1.

If using adhesive or self-sealing media, please see the instructions in . (ish_3199741-3199797-16).

Recommended action for customers

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. Ensure that the tray 1 pickup and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup, feed, and separation rollers as needed.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

5. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. Ensure that the tray 1 pickup and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup, feed, and separation rollers as needed.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

5. Toggle the registration/TOP sensor (PS4550) to ensure that it moves freely.
6. Test the registration/TOP sensor (PS4550) using the manual sensor test.

- a. From the home screen on the printer control panel, touch [“Support Tools”](#).
- b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
- c. Select from the following tests:
 - [All Sensors](#) , [Engine Sensors](#)
 - [Done](#) (return to the [Troubleshooting](#) menu)
 - [Reset](#) (reset the selected sensor’s state)
- d. Test the registration/TOP sensor to verify that the sensor is functioning correctly. If the sensor does not function, replace the registration assembly.



NOTE: Before replacing any parts check connector J15 on the DC controller.

Part number: RM2-6774-000CN

For instructions: See the Repair Service Manual for this product.

7. If the sensors are functioning correctly, run a few pages to check where the leading edge of the paper actually stops.
8. Check the paper feed frame assembly for broken parts or damage. Replace the feed frame assembly as needed.

Part number: RM2-0851-000CN

For instructions: See the Repair Service Manual for this product.

9. Enter the component test menu to run diagnostics on the printer.

- a. From the home screen on the printer control panel, touch [“Support Tools”](#).
- b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Components Test](#)

10. Test tray 1 feed clutch CL1.

- a. Touch [Tray 1 feed clutch](#).
- b. If the clutch does not function correctly, ensure connector J202 on the DC controller PCA is securely and correctly seated.
- c. Retest the clutch as needed.
- d. If the solenoid continues to fail, replace the clutch.

part number: RM2-0849-000CN

11. Test the drum motor M2.
 - a. Touch [Drum motor](#).
 - b. If the motor does not function correctly, ensure connector J203 on the DC controller PCA is securely and correctly seated.
 - c. Check the main drive assembly for damage or blocked gears.
 - d. Retest the drum motor as needed.
 - e. If the drum motor continues to fail, replace the following as needed.

Drum motor part number: RM2-9316-000CN

Drum motor instructions: See the Repair Service Manual for this product.

Main drive assembly part number: RM2-6777-000CN

Main drive instructions: See the Repair Service Manual for this product.
12. Replace the registration assembly.

Part number: RM2-6774-000CN

For instructions: See the Repair Service Manual for this product.
13. If the issue persists, elevate the case using the Standard Support Process.

13 . B2 . D2 Jam in right door

Paper delay jam at the image area.

Paper did not reach PS4550 in the specified time when printing from Tray 2.

This error might occur in conjunction with the Tray 2 Overfilled or Roller Issue message..

If using adhesive or self-sealing media, please see the instructions in (ish_3199741-3199797-16).

Recommended action for customers

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path. Grasp the jammed paper with both hands and pull it straight out to remove it out of the printer.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Turn the printer off and unplug the power cord.
3. Open the left door and clear any paper present or obstructions in the paper path.

Grasp any jammed paper with both hands and pull it straight out to remove it out of the printer.
4. Plug the power cord in and turn on the printer.


5. If the error persists, ensure the type and quality of the paper being used meets the HP specifications for the printer.



NOTE: For supported sizes and types view [HP LaserJet Enterprise M631-M633, HP LaserJet Managed E62555-E62575, E62655-E62675 - Supported paper sizes and types c05495229](#).

6. Pull out tray 2 completely out of the printer to remove it.
7. Ensure that the protective orange plastic shipping locks are removed, if present.
8. Remove any jammed or damaged sheets of paper from the tray.
9. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray.

Figure 6-42 Tray 2 paper guides

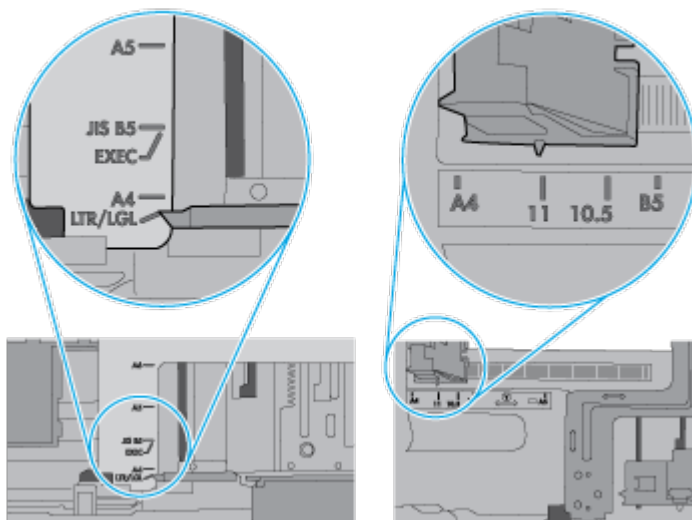

10. Ensure the paper is not filled above the fill mark (line below 3 triangles). Remove any excess media.

Figure 6-43 Paper height guides

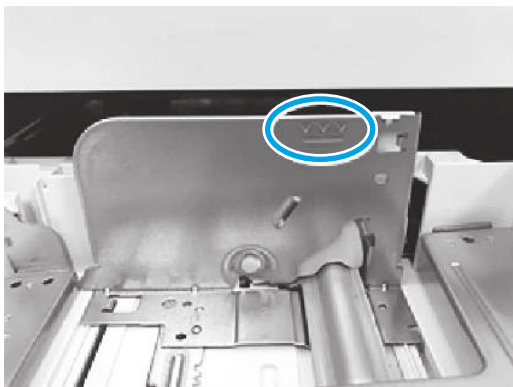


Figure 6-44 Overfilled tray



Figure 6-45 Stack of paper not overfilled in tray 2



11. Ensure that the feed and separation rollers are installed correctly and show no damage or wear.
 - a. Open the right door and pull the green tab located on the left-hand side to open the lower-access cover.

Figure 6-46 Jam-access door



- b. If the jammed paper is visible inside the lower-access cover, pull it straight out to remove it.



NOTE: If the paper is pulled toward a side, it might dislodge the rollers.

- c. Check if the rollers are installed correctly.

- If the flap of the blue roller tab is down, the rollers are not installed correctly.



NOTE: If the blue tab is DOWN, it will cause a 13.B2.D2 and/or a Tray 2 Overfilled or roller Issue message.

- If the flap of the blue roller tab is up, the rollers are installed correctly.

Figure 6-47 Feed rollers flap is down and not installed correctly


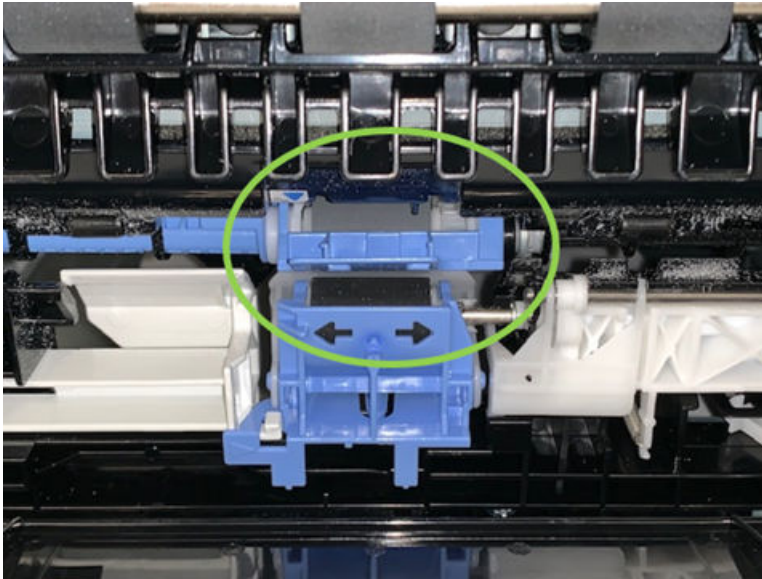



Figure 6-48 Feed rollers flap is up and installed correctly

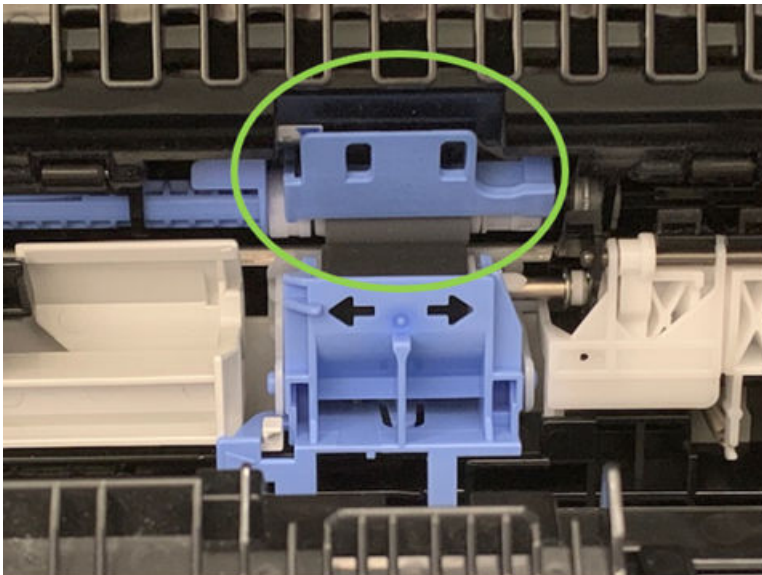

- d. Remove any visible lint or dust from each of the feed, pickup and separation rollers using a clean lint-free cloth moistened with warm water.

- e. With tray 2 removed, check the pickup roller for damage dirt or paper dust. Clean the roller with a damp lint free cloth as needed.

Figure 6-49 Check pickup roller

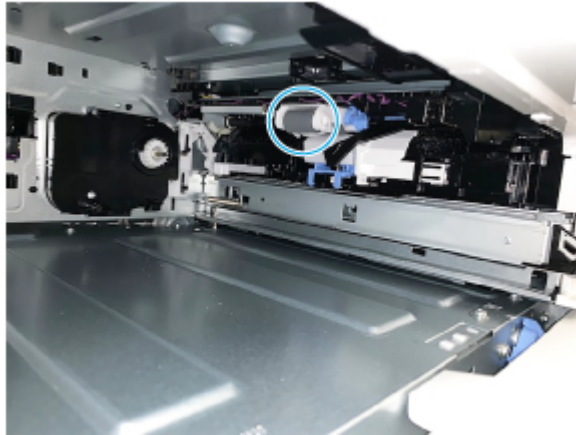

- f. If the pickup, feed, and separation rollers are damaged or worn out, replace the rollers.

- Part number: J8J70-67906
- Part description: Tray 2 roller assembly
- For instructions, go to [Removal and replacement: Trays 2-x rollers](#)

Figure 6-50 Worn out roller surface


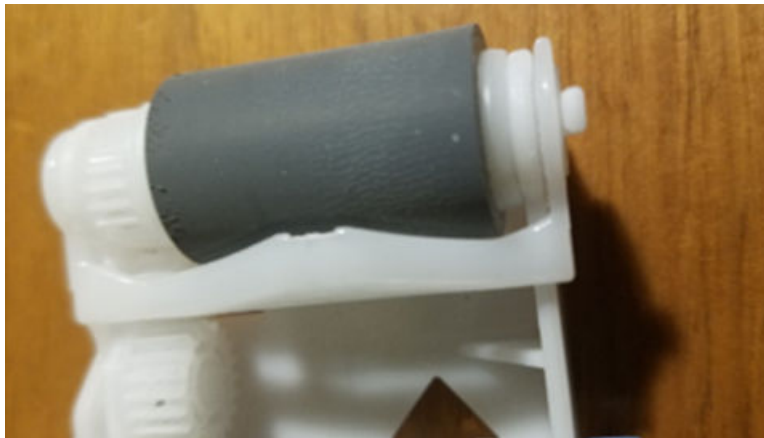


Figure 6-51 New roller surface

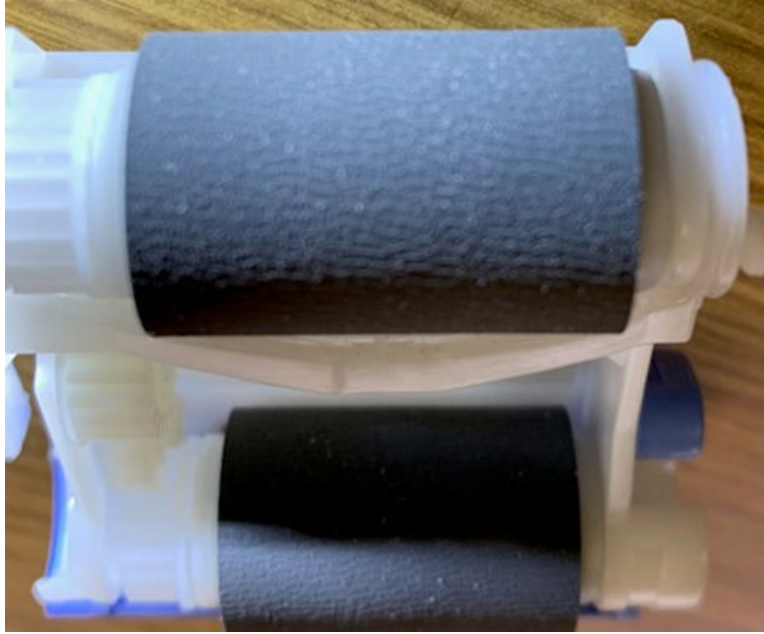

12. Reinstall tray 2.
13. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents


1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path. Grasp the jammed paper with both hands and pull it straight out to remove it out of the printer.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Turn the printer off and unplug the power cord.
3. Open the left door and clear any paper present or obstructions in the paper path.
Grasp any jammed paper with both hands and pull it straight out to remove it out of the printer.
4. Plug the power cord in and turn on the printer.
5. Pull out tray 2 completely out of the printer to remove it.
6. Ensure that the protective orange plastic shipping locks are removed, if present.
7. Remove any jammed or damaged sheets of paper from the tray.
8. If the error persists, ensure the type and quality of the paper being used meets the HP specifications for the printer.



NOTE: For supported sizes and types view [HP LaserJet Enterprise M631-M633, HP LaserJet Managed E62555-E62575, E62655-E62675 - Supported paper sizes and types](#) c05495229.

9. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray.

Figure 6-52 Tray 2 paper guides

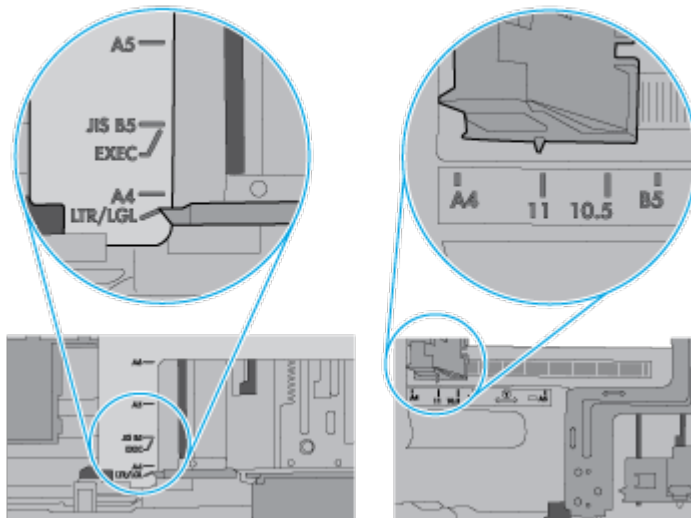

10. Ensure the paper is not filled above the fill mark (line below 3 triangles). Remove any excess media.

Figure 6-53 Paper height guides

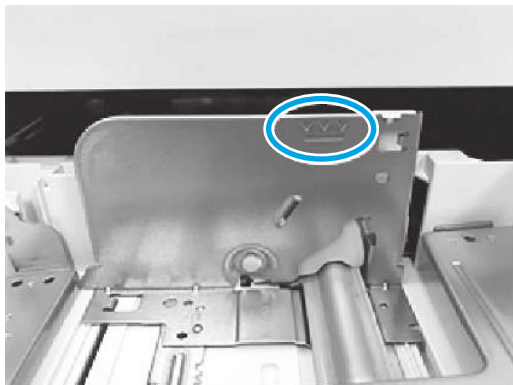


Figure 6-54 Overfilled tray



Figure 6-55 Stack of paper not overfilled in tray 2



11. Ensure that the feed and separation rollers are installed correctly and show no damage or wear.
 - a. Open the right door and pull the green tab located on the left-hand side to open the lower-access cover.

Figure 6-56 Jam-access door



- b. If the jammed paper is visible inside the lower-access cover, pull it straight out to remove it.



NOTE: If the paper is pulled toward a side, it might dislodge the rollers.

- c. Check if the rollers are installed correctly.
 - If the flap of the blue roller tab is down, the rollers are not installed correctly.
 - If the flap of the blue roller tab is up, the rollers are installed correctly.



NOTE: If the blue tab is DOWN, it will cause a 13.B2.D2 and/or a Tray 2 Overfilled or roller Issue message.

Figure 6-57 Feed rollers flap is down and not installed correctly


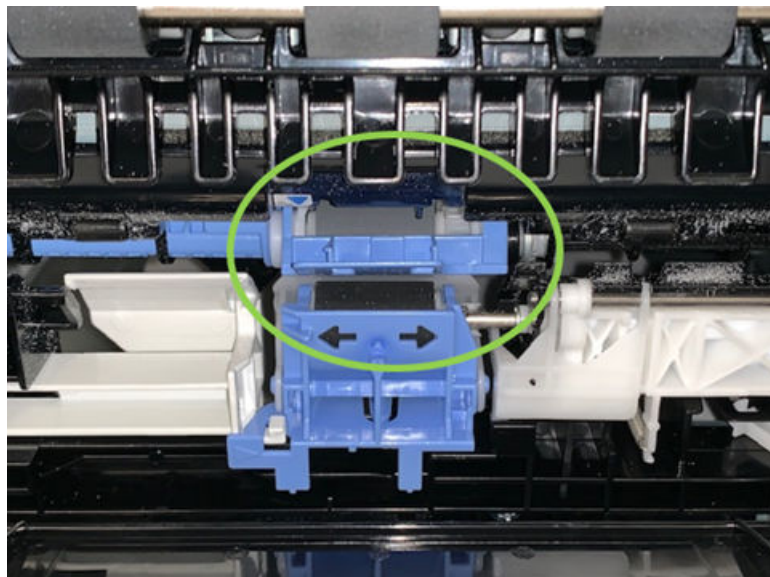



Figure 6-58 Feed rollers flap is up and installed correctly

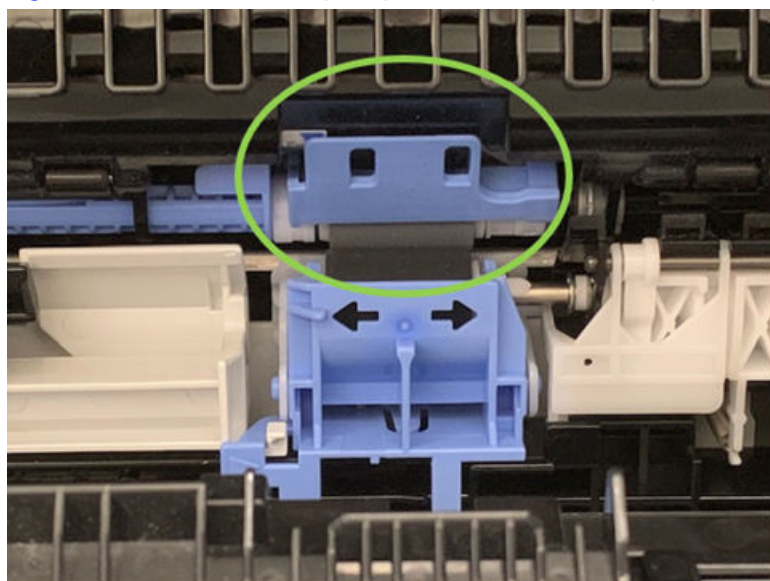

- d. Remove any visible lint or dust from each of the feed, pickup and separation rollers using a clean lint-free cloth moistened with warm water.

- e. With tray 2 removed, check the pickup roller for damage dirt or paper dust. Clean the roller with a damp lint free cloth as needed.

Figure 6-59 Check pickup roller

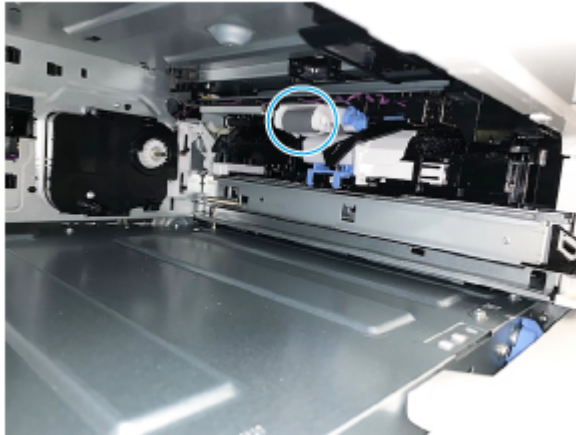

- f. If the pickup, feed, and separation rollers are damaged or worn out, replace the rollers.

- Part number: J8J70-67906
- Part description: Tray 2 roller assembly
- For instructions, go to [Removal and replacement: Trays 2-x rollers](#)

Figure 6-60 Worn out roller surface


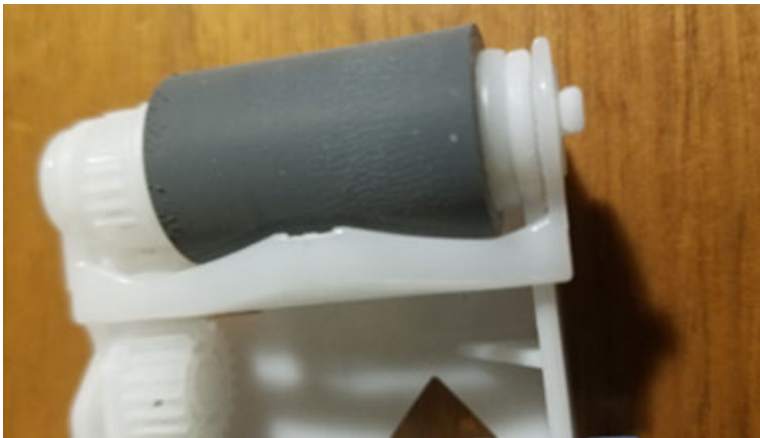


Figure 6-61 New roller surface



12. Reinstall tray 2.
13. Run a [Tray 2-Pickup Solenoid](#) test from the printer menu.
 - a. From the Home screen on the printer control panel, touch "[Support Tools](#)".
 - b. Open the following menus:
 - i. [Troubleshooting](#)
 - ii. [Diagnostic Tests](#)
 - iii. [Components Test](#)
 - c. Select the [Tray 2-Pickup Solenoid](#) option, select the [Repeat](#) check box, and then press the [Start](#) button.
 - d. Make sure to hear a clicking noise to confirm the solenoid is functioning.

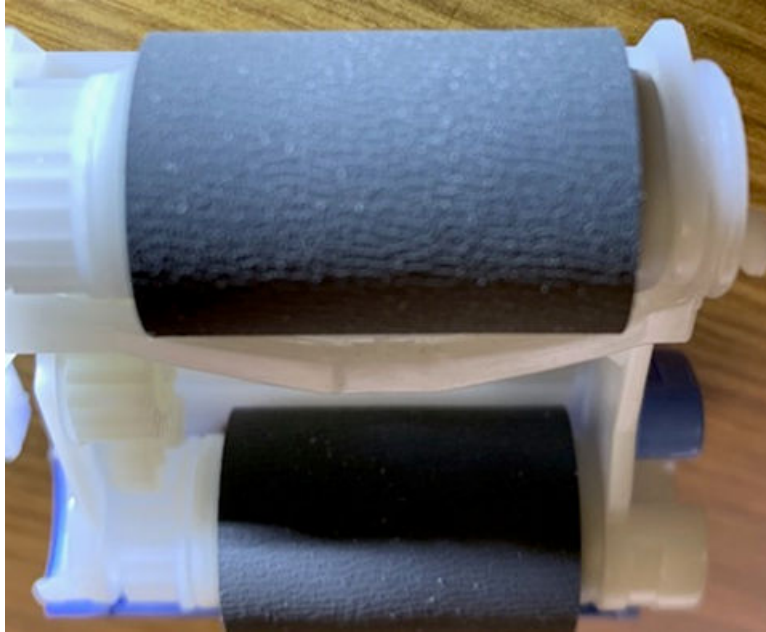

NOTE: The solenoid click sound is a very low volume and will click "on" and "off".

14. If the test fails replace the paper pickup assembly.
 - Part number: RM2-6771-010CN
 - For instructions, go to [See the Repair Service Manual for this product.](#)
15. If the issue persists, dispatch a service technician with a paper pickup assembly and a roller kit.

Paper pickup assembly part number: RM2-6771-010CN

For instructions, go to [See the Repair Service Manual for this product.](#)

Tray 2 - X rollers part number: J8J70-67906


For instructions, go to [Removal and replacement: Trays 2-x rollers](#)

Recommended action for onsite technicians

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path. Grasp the jammed paper with both hands and pull it straight out to remove it out of the printer.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Turn the printer off and unplug the power cord.
3. Open the left door and clear any paper present or obstructions in the paper path.

Grasp any jammed paper with both hands and pull it straight out to remove it out of the printer.
4. Plug the power cord in and turn on the printer.
5. Pull out tray 2 completely out of the printer to remove it.
6. Ensure that the protective orange plastic shipping locks are removed, if present.
7. Remove any jammed or damaged sheets of paper from the tray.
8. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray.

Figure 6-62 Tray 2 paper guides

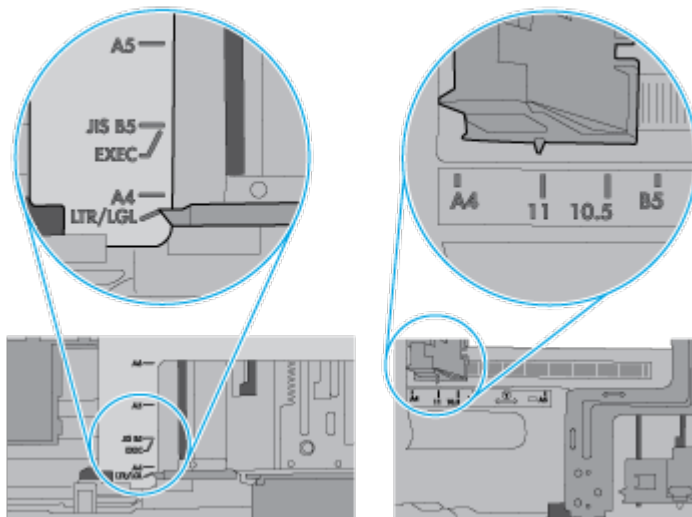

9. Ensure the paper is not filled above the fill mark (line below 3 triangles). Remove any excess media.

Figure 6-63 Paper height guides

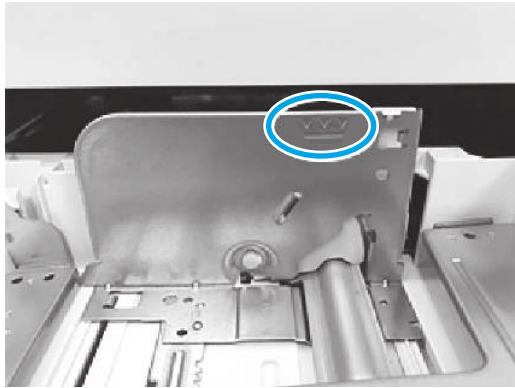


Figure 6-64 Overfilled tray



Figure 6-65 Stack of paper not overfilled in tray 2



10. Ensure that the feed and separation rollers are installed correctly and show no damage or wear.

- a. Open the right door and pull the green tab located on the left-hand side to open the lower-access cover.

Figure 6-66 Jam-access door



- b. If the jammed paper is visible inside the lower-access cover, pull it straight out to remove it.



NOTE: If the paper is pulled toward a side, it might dislodge the rollers.

- c. Check if the rollers are installed correctly.
- If the flap of the blue roller tab is down, the rollers are not installed correctly.
 - If the flap of the blue roller tab is up, the rollers are installed correctly.



NOTE: If the blue tab is DOWN, it will cause a 13.B2.D2 and/or a Tray 2 Overfilled or roller Issue message.

Figure 6-67 Feed rollers flap is down and not installed correctly



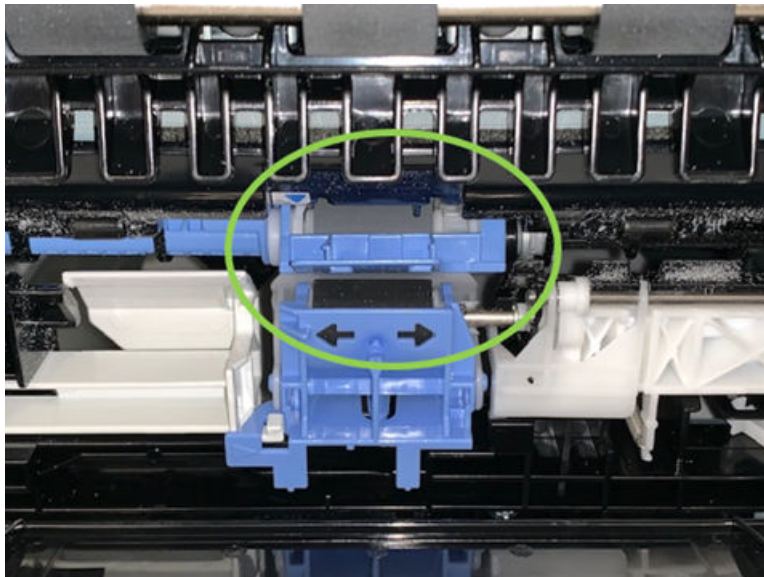


Figure 6-68 Feed rollers flap is up and installed correctly

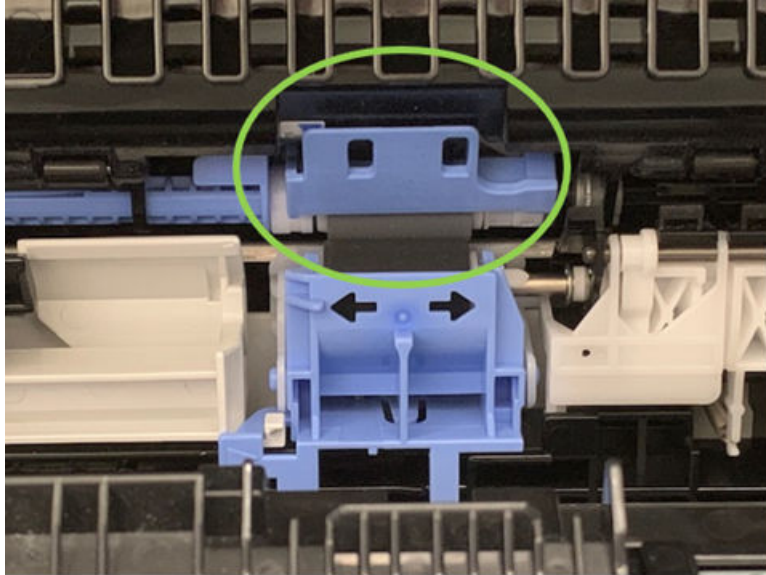

- d. Remove any visible lint or dust from each of the feed, pickup and separation rollers using a clean lint-free cloth moistened with warm water.
- e. With tray 2 removed, check the pickup roller for damage dirt or paper dust. Clean the roller with a damp lint free cloth as needed.

Figure 6-69 Check pickup roller

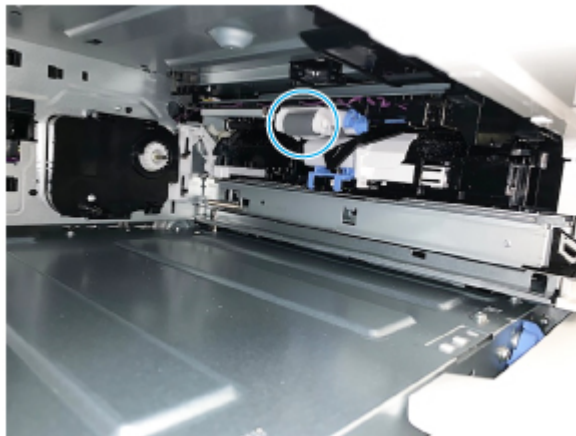


- f. If the pickup, feed, and separation rollers are damaged or worn out, replace the rollers.
 - Part number: J8J70-67906
 - Part description: Tray 2 roller assembly
 - For instructions, go to [Removal and replacement: Trays 2-x rollers](#)

Figure 6-70 Worn out roller surface



Figure 6-71 New roller surface

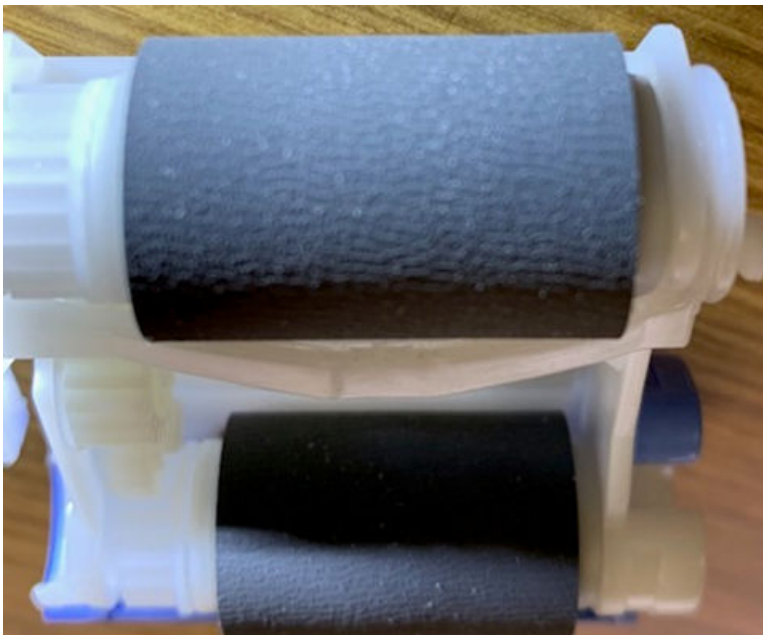

11. Reinstall tray 2.
12. Run the following tests from the printer troubleshooting menu.
 - [Tray 2-Pickup Solenoid](#)
 - [Tray 2-Paper sensor](#)
 - [Tray 2-Paper surface sensor](#)
 - a. From the Home screen on the printer control panel, touch [“Support Tools”](#).
 - b. Open the following menus:
 - i. [Troubleshooting](#)
 - ii. [Diagnostic Tests](#)
 - iii. [Components Test](#)

- c. Select the specific test option, select the [Repeat](#) check box, and then press the [Start](#) button.
- d. Check the following for each test.
 - Make sure to hear a clicking noise to confirm the solenoid is functioning.



NOTE: The solenoid click sound is a very low volume and will click "on" and "off".

- Ensure each sensor functions correctly.
13. If the any of the tests fail, replace the paper pickup assembly.
- Part number: RM2-6771-010CN
 - For instructions, go to See the Repair Service Manual for this product.
14. If the issue persists, elevate the case using the Standard Support Process.

13 . B2 . DX Jam in right door

Paper delay jam at the image area.

Paper passed PS3601 feed sensor in Tray 3 but did not reach the registration sensor (PS4550) in the designated amount of time when printing from Tray 3.

Paper passed PS3601 feed sensor in Tray 3 but did not reach the registration sensor (PS4550) in the designated amount of time when printing from Tray 4.

Paper passed PS3601 feed sensor in Tray 3 but did not reach the registration sensor (PS4550) in the designated amount of time when printing from Tray 5.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.

3. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-72 Tray paper guides


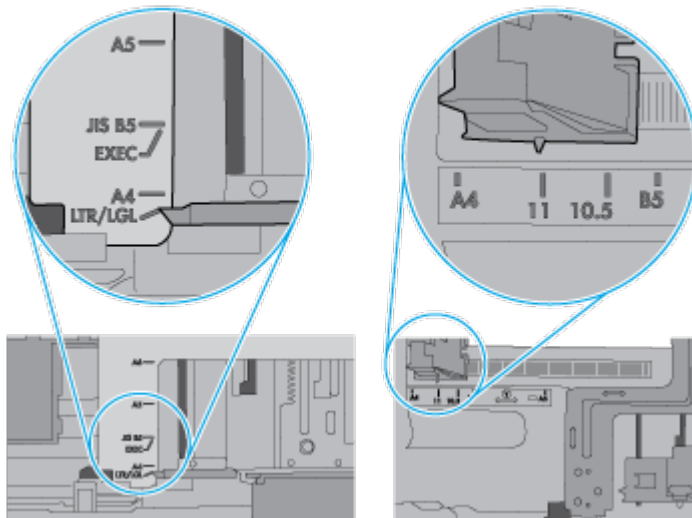


Figure 6-73 Tray 2 paper height guides



4. Ensure that the tray 3 pickup and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.

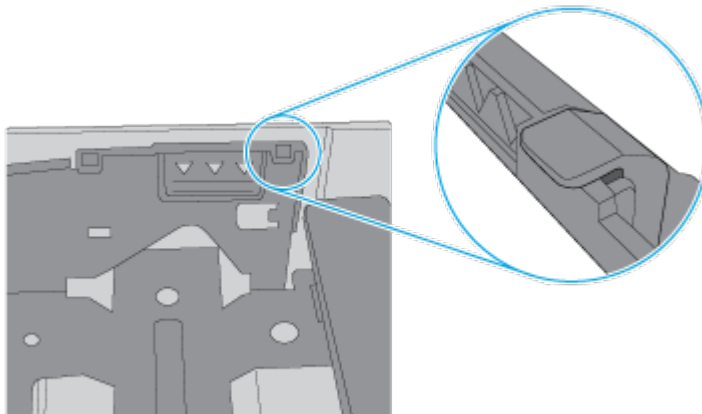

NOTE: Clean the rollers with a dampened lint free cloth or paper.

6. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open the right door.

- b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
- 2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
- 3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-74 Paper tray guides


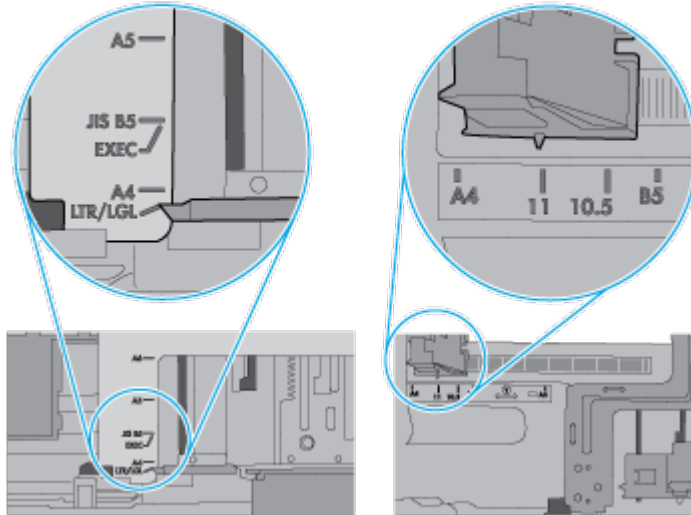


Figure 6-75 Paper height guides

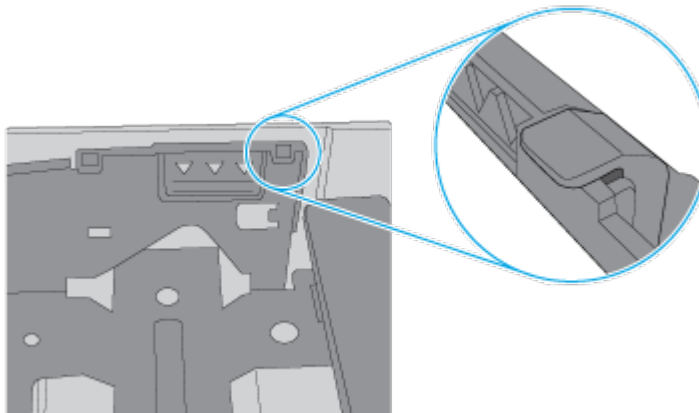

4. If the issue occurred after a recent repair, remove the tray cassette and check the rear side of the pickup assembly. Ensure that the lifting arm that engages the lift motor with the pickup unit is correctly aligned (see images).

Figure 6-76 Lifting arm in correct position


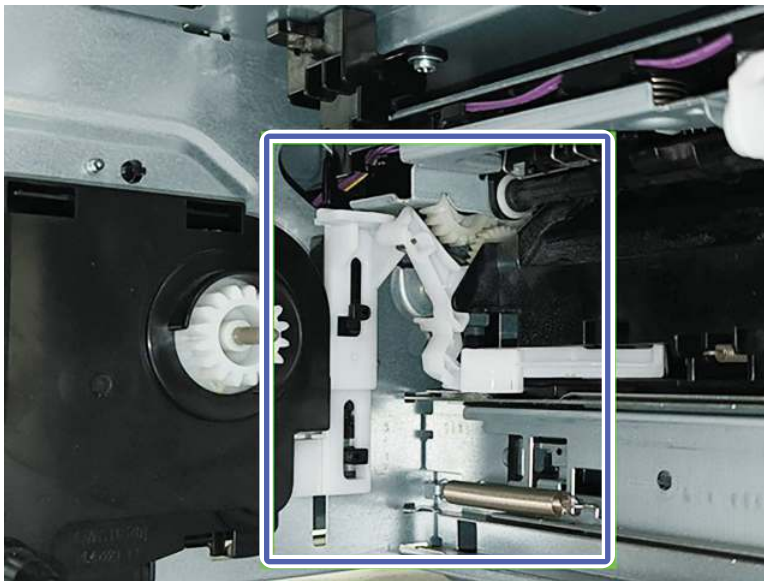


Figure 6-77 Lifting arm in wrong position

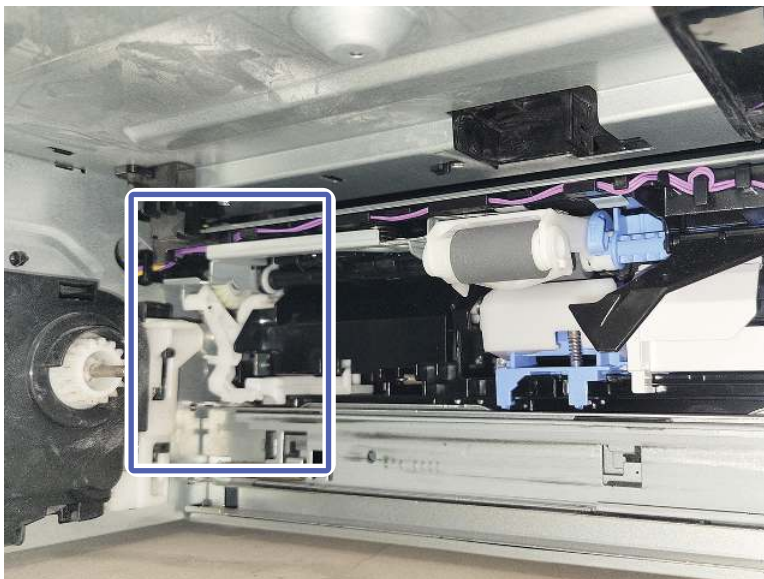

 **NOTE:** Arm is not engage and outside of lifting mechanism.

5. Toggle the registration/TOP sensor (PS4550) to ensure that it moves freely.
6. Test the registration/TOP sensor (PS4550) using the manual sensor test.
 - a. From the home screen on the printer control panel, touch **Support Tools**.
 - b. Open the following menus:
 - **Troubleshooting**

- [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
- c. Select from the following tests:
- [All Sensors](#) , [Engine Sensors](#)
 - [Done](#) (return to the [Troubleshooting](#) menu)
 - [Reset](#) (reset the selected sensor's state)
- d. Test the registration/TOP sensor to verify that the sensor is functioning correctly. If the sensor does not function, replace the registration assembly.



NOTE: Before replacing any parts check connector J15 on the DC controller.

Part number: RM2-6774-000CN

For instructions: See the Repair Service Manual for this product.

7. Check the transfer roller at the transfer area, ensure that everything is correctly seated and that there are no damaged parts. Replace the transfer roller or transfer assembly as needed.

Transfer roller part number: RM2-6800-000CN

For instructions: See the Repair Service Manual for this product.

Transfer assembly part number: RM2-6776-000CN

For instructions: See the Repair Service Manual for this product.

8. If the sensors are functioning correctly, run a few pages to check where the leading edge of the paper actually stops.
9. Check the paper feed frame assembly for broken parts or damage. Replace the feed frame assembly as needed.

Part number: RM2-0851-000CN

For instructions: See the Repair Service Manual for this product.

10. Enter the component test menu to run diagnostics on the printer.

- a. From the home screen on the printer control panel, touch "[Support Tools](#)".
- b. Open the following menus:
- [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Components Test](#)

11. Test the drum motor M2.

- a. Touch [Drum motor](#).
- b. If the motor does not function correctly, ensure connector J203 on the DC controller PCA is securely and correctly seated.
- c. Check the main drive assembly for damage or blocked gears.

- d. Retest the drum motor as needed.
- e. If the drum motor continues to fail, replace the following as needed.
 Drum motor part number: RM2-9316-000CN
 Drumm motor instructions: See the Repair Service Manual for this product.
 Main drive assembly part number: RM2-6777-000CN
 Main drive instructions: See the Repair Service Manual for this product.

12. Replace the registration assembly.

Part number: RM2-6774-000CN

For instructions: See the Repair Service Manual for this product.

13. If the issue persists, elevate the case using the Standard Support Process.

13 . B2 . FF Jam in right door

Paper residual jam at image area.

Paper present at PS4550, at power on or after clearing a jam.

If using adhesive or self-sealing media, please see the instructions in (ish_3199741-3199797-16).

Recommended action for customers

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Toggle the registration/TOP sensor (PS4550) to ensure that it moves freely.
3. Test the registration/TOP sensor (PS4550) using the manual sensor test.
 - a. From the home screen on the printer control panel, touch [“Support Tools”](#).
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)

- [Manual Sensor Test](#)
- c. Select from the following tests:
- [All Sensors](#) , [Engine Sensors](#)
 - [Done](#) (return to the [Troubleshooting](#) menu)
 - [Reset](#) (reset the selected sensor's state)
- d. Test the registration/TOP sensor to verify that the sensor is functioning correctly. If the sensor does not function, replace the registration assembly.



NOTE: Before replacing any parts check connector J15 on the DC controller.

Part number: RM2-6774-000CN

For instructions: See the Repair Service Manual for this product.

13 . B4 . FF Jam in right door

Paper residual jam at image area.

Paper present at fuser loop sensor PS4500 at power on or after clearing a jam.

If using adhesive or self-sealing media, please see the instructions in (ish_3199741-3199797-16).

Recommended action for customers

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Remove the fuser and check for paper and the correct movement of the sensors PS4500.



CAUTION: The fuser might be hot.

3. Test the fuser loop sensor PS4500. If the sensor fails the test, replace the sensor.



Part number: WG8-5935-000CN



NOTE: If onsite, Performing a reseal of the transfer assembly might resolve this issue.

If needed Part number:

Transfer assembly (duplex) - RM2-6776-010CN


Transfer assembly (simplex) - RM2-1248-000CN

4. Check the condition and position of the fuser pressure relief sensor. If the sensor is damaged or missing, replace the fuser.

Table 6-10 Part number

Part Description	Part Number
Fuser output sensor (SR5)	WG8-5935-000CN

Figure 6-78 An undamaged fuser pressure relief sensor

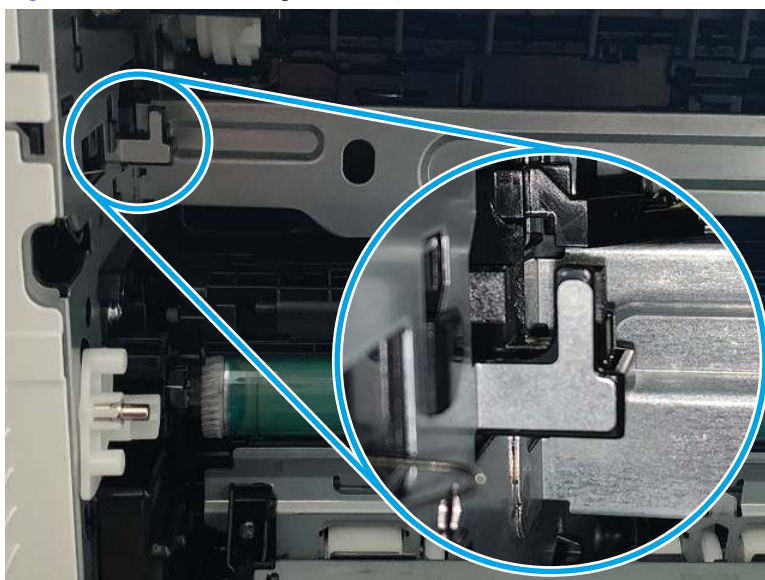

5. Inspect the fuser flag for damage. If the flag is damaged or missing, replace the fuser.

Table 6-11 Part numbers

Part Description	Part Number
110V Fuser	RM2-1256-010CN
220V Fuser	RM2-1257-010CN

For instructions:

Figure 6-79 An undamaged fuser alienation flag on the left side of the fuser



13.B9.Az Fuser jam

Paper stay jam in the fuser area or Paper present at PS4650 after specified time limit.

For additional troubleshooting information, go to [HP LaserJet Enterprise MFP, HP LaserJet Managed MFP - 13.B9.A1 or 13.80.A1 Jam \(Emerging Issue\)](#).

This jam code can be caused by:

- An accordion paper jam at the fuser exit.
- Something blocking the paper before reaching the output rollers.

- The output bin rollers are not turning. Because there is very little distance from the fuser exit to the output bin, paper stopped at the rollers can cause a fuser jam.
- A sticky fuser exit flag. If the flag is stuck or even delayed momentarily in the activated position it can cause this jam.
- Self-sealing or adhesive media is being used. Please see the instructions in . (ish_3199741-3199797-16).
- **13.B9.A1** jam is detected when printing from Tray 1.
- **13.B9.A2** jam is detected when printing from Tray 2.
- **13.B9.A3** jam is detected when printing from Tray 3.
- **13.B9.A4** jam is detected when printing from Tray 4.
- **13.B9.A5** jam is detected when printing from Tray 5.
- **13.B9.AD** jam is detected when printing from the duplexer.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians



IMPORTANT: If this error occurs on printers that have a stapler/stacker attached and the output is going only to the stapler/stacker bin, please go to the following document to troubleshoot: [HP LaserJet Enterprise MFP, HP LaserJet Managed MFP - 13.B9.A1 or 13.80.A1 Jam \(Emerging Issue\)](#)

If the jam occurs when the output is going to the top output of the stapler/stacker, or on printers that do not have a stapler/stacker attached, troubleshoot using the following steps:

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. Check the fuser delivery sensor for correct functionality and movement. Replace the fuser as needed.



CAUTION: The fuser might be hot.

110V part number: RM2-1256-000CN

For instructions: See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: See the Repair Service Manual for this product.



NOTE: Before replacing any parts check connector J401 and J402 on the DC controller.

4. Verify there is no debris from a previous jam stuck in the fuser, or the rollers leading into and out of the fuser.
5. Confirm that the output bin rollers are turning.
6. Check the transfer roller at the transfer area, ensure that everything is correctly seated and that there are no damaged parts. Replace the transfer roller or transfer assembly as needed.

Transfer roller part number: RM2-6800-000CN

For instructions: See the Repair Service Manual for this product.

Transfer assembly part number: RM2-6776-000CN

For instructions: See the Repair Service Manual for this product.

7. Enter the component test menu to run diagnostics on the printer.
 - a. From the home screen on the printer control panel, touch ["Support Tools"](#).
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Components Test](#)
8. Touch [Fuser motor](#) to test the motor. If the test fails replace the fuser drive assembly.

Part number: RM2-6763-000CN

For instructions: See the Repair Service Manual for this product.

9. Replace the fuser.

110V part number: RM2-1256-000CN

For instructions: See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: See the Repair Service Manual for this product.

13.B9.Cz

Fuser wrap jam.

This jam occurs when the paper disappears from the fuser output sensor before a designated amount of time after the paper reached the fuser output sensor (PS4650).

It is determined that the paper is being wrapped around the fuser roller.

Z = Fuser mode

- **13.B9.C1** Fuser wrap jam when **Auto Sense (Normal)**.
- **13.B9.C2** Fuser wrap jam when **Normal**.
- **13.B9.C3** Fuser wrap jam when **Light 1** or **Light 2**.
- **13.B9.C4** Fuser wrap jam when **Heavy 1**.
- **13.B9.C5** Fuser wrap jam when **Heavy 2**.
- **13.B9.C6** Fuser wrap jam when **Heavy Paper 3**.
- **13.B9.C7** Fuser wrap jam when **Glossy Paper 1**.
- **13.B9.C8** Fuser wrap jam when **Glossy Paper 2**.
- **13.B9.C9** Fuser wrap jam when **Glossy Paper 3**.
- **13.B9.CB** Fuser wrap jam when **Transparency**.
- **13.B9.CC** Fuser wrap jam when **Label**.
- **13.B9.CD** Fuser wrap jam when **Envelope 1** or **Envelope 2**.

If using adhesive or self-sealing media, please see the instructions in . (ish_3199741-3199797-16)

Recommended action for customers

1. Clear the paper jam.
 - a. Open the right door.
 - b. Remove the fuser, and remove any paper wrapped around the fuser roller.

 **CAUTION:** The fuser might be hot.

 - c. Look for and clear any paper present or obstructions in the paper path.
 - d. Reinstall the fuser.
 - e. Close the right door to allow the printer to attempt to clear the jam message.
2. Print a cleaning page to ensure that all of the toner is removed from the fuser roller.
3. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
4. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the right door.
 - b. Remove the fuser, and remove any paper wrapped around the fuser roller.

 **CAUTION:** The fuser might be hot.

- c. Look for and clear any paper present or obstructions in the paper path.
 - d. Reinstall the fuser.
 - e. Close the right door to allow the printer to attempt to clear the jam message.
2. Print a cleaning page to ensure that all of the toner is removed from the fuser roller.
 3. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
 4. If the error persists, replace the fuser.

110V part number: RM2-1256-000CN

For instructions: See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: See the Repair Service Manual for this product.

13.B9.Dz

Fuser delivery delay jam.

Paper did not reach the fuser sensor PS4650 within the specified time.

- **13.B9.D1** Fuser delivery delay jam when printing from Tray 1.
- **13.B9.D2** Fuser delivery delay jam when printing from Tray 2.
- **13.B9.D3** Fuser delivery delay jam when printing from Tray 3.
- **13.B9.D4** Fuser delivery delay jam when printing from Tray 4.
- **13.B9.D5** Fuser delivery delay jam when printing from Tray 5.
- **13.B9.DD** Fuser delivery delay jam when printing with the Duplexer.

The following are possible causes and areas that should be investigated.

- The paper jam is found wrapped around the fuser roller. In this case it is a sign of a worn out fuser.
- The paper jam is found in the transfer area. This could be caused by transfer area damage.
- A fuser drive or delivery issue.
- Self-sealing or adhesive media is being used. Please see the instructions in .(ish_3199741-3199797-16)

Recommended action for customers

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.

3. Ensure that the tray 1 pickup and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup, feed, and separation rollers as needed.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

5. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. Determine where the jam is located and remove the jam.
 - a. Open the right door and check for paper present in the paper path.
 - b. Remove the fuser and check for paper or obstructions.
4. If the paper is stopped before fuser, perform the following steps.
 - a. Thoroughly check the duplex paper path and the transfer area for any issues with the rollers, jammed paper, or any obstructions that might be causing the jam.
 - b. Check the transfer roller at the transfer area, ensure that everything is correctly seated and that there are no damaged parts. Replace the transfer roller or transfer assembly as needed.

Transfer roller part number: RM2-6800-000CN

Transfer assembly part number: RM2-6776-000CN
 - c. Inspect the transfer feed assembly for debris or damage. Replace the right door sub assembly as needed.

Part number: RM2-0849-000CN
5. If the paper is stopped in or at the fuser, perform the following steps.



CAUTION: The fuser might be hot.

- a. Remove the fuser and inspect the fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.

110V part number: RM2-1256-000CN

For instructions: See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: See the Repair Service Manual for this product.

- b. Test the fuser sensor (PS4650) using the manual sensor test.
 - i. From the home screen on the printer control panel, touch [“Support Tools”](#).
 - ii. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
 - iii. Select from the following tests:
 - [All Sensors , Engine Sensors](#)
 - [Done](#) (return to the [Troubleshooting](#) menu)
 - [Reset](#) (reset the selected sensor’s state)
 - iv. Test the fuser sensor to verify that the sensor is functioning correctly. If the sensor does not function, replace the fuser assembly.



NOTE: Before replacing any parts check connector J401 and J402 on the DC controller.

110V part number: RM2-1256-000CN

For instructions: See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: See the Repair Service Manual for this product.

- c. Enter the component test menu to run diagnostics on the printer.
 - i. From the home screen on the printer control panel, touch [“Support Tools”](#).
 - ii. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Components Test](#)
- d. Touch [Fuser motor](#) to test the motor. If the test fails replace the fuser drive assembly.

Part number: RM2-6763-000CN

For instructions: See the Repair Service Manual for this product.

- e. Replace the fuser.

110V part number: RM2-1256-000CN

For instructions: See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: See the Repair Service Manual for this product.

13.B9.FF

Residual paper jam at the fuser output sensor.

Paper is present at PS4650 at power on or after clearing a jam.

If using adhesive or self-sealing media, please see the instructions in . (ish_3199741-3199797-16).

Recommended action for customers

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Verify the paper meets the HP printer specifications.
3. Remove the fuser and inspect the fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.

 **CAUTION:** The fuser might be hot.

4. Test the fuser sensor (PS4650) using the manual sensor test.
 - a. From the home screen on the printer control panel, touch ["Support Tools"](#).
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
 - c. Select from the following tests:
 - [All Sensors](#) , [Engine Sensors](#)
 - [Done](#) (return to the [Troubleshooting](#) menu)
 - [Reset](#) (reset the selected sensor's state)

- d. Test the fuser sensor to verify that the sensor is functioning correctly. If the sensor does not function, replace the fuser assembly.



NOTE: Before replacing any parts check connector J401 and J402 on the DC controller.

110V part number: RM2-1256-000CN

For instructions: See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: See the Repair Service Manual for this product.

5. Enter the component test menu to run diagnostics on the printer.
 - a. From the home screen on the printer control panel, touch **Support Tools**.
 - b. Open the following menus:
 - **Troubleshooting**
 - **Diagnostic Tests**
 - **Components Test**
6. Touch **Fuser motor** to test the motor. If the test fails replace the fuser drive assembly.

Part number: RM2-6763-000CN

For instructions: See the Repair Service Manual for this product.
7. Replace the fuser.

110V part number: RM2-1256-000CN

For instructions: See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: See the Repair Service Manual for this product.

13.D3.Dz

Late to duplex re-feed jam.

- **13.D3.D1** The fuser is printing in fuser mode **Auto Sense** special case distinguished from "typed" Normal.
- **13.D3.D2** The fuser is printing in fuser mode **Normal**.
- **13.D3.D3** The fuser is printing in fuser mode **Light 1** or **Light 2**.
- **13.D3.D4** The fuser is printing in fuser mode **Heavy 1**.
- **13.D3.D5** The fuser is printing in fuser mode **Heavy 2**.
- **13.D3.D6** The fuser is printing in fuser mode **Heavy Paper 3**.
- **13.D3.D7** The fuser is printing in fuser mode **Glossy Paper 1**.
- **13.D3.D8** The fuser is printing in fuser mode **Glossy Paper 2**.

- **13.D3.D9** The fuser is printing in fuser mode **Glossy Paper 3**.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Perform the continuous paper path test in simplex mode of at least 50 pages to ensure that issue is occurring while duplex printing only.
3. Test duplexing from multiple trays to see if issue is tray specific or not. If the jam occurs from only one specific tray, troubleshoot the tray for pick and feed issues.
 - a. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
 - b. Ensure the tray is set correctly. If Tray 1 is set to ANY size ANY type, set it to the size the customer is trying to print on.
 - c. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
 - d. Ensure that the tray pickup, feed, and separation rollers are installed correctly and show no damage or wear. Clean or replace the rollers as needed.
4. Test the duplex sensor (PS4700) using the manual sensor test.
 - a. From the home screen on the printer control panel, touch **“Support Tools”**.
 - b. Open the following menus:
 - **Troubleshooting**
 - **Diagnostic Tests**
 - **Manual Sensor Test**
 - c. Select from the following tests:
 - **All Sensors , Engine Sensors**

- [Done](#) (return to the [Troubleshooting](#) menu)
 - [Reset](#) (reset the selected sensor's state)
- d. Test the duplex sensor to verify that the sensor is functioning correctly. If the sensor does not function, replace the right door sub assembly.



NOTE: Before replacing any parts check connector J309 on the DC controller.

Part number: RM2-0849-000CN

For instructions: See the Repair Service Manual for this product.

5. Enter the component test menu to run diagnostics on the printer.
- a. From the home screen on the printer control panel, touch "[Support Tools](#)".
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Components Test](#)
6. Run the Duplex refeed clutch solenoid. If the tests fail, replace the delivery assembly.

Paper delivery assembly part number: RM2-6787-000CN

For instructions: See the Repair Service Manual for this product.

7. Check the right door assembly and rollers for any damage or debris. Replace the right door assembly as needed.

Part number: RM2-0849-000CN

For instructions: See the Repair Service Manual for this product.

13.D3.FF

A power on jam has occurred at the duplex refeed sensor.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.

- a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Test the duplex sensor (PS4700) using the manual sensor test.
 - a. From the home screen on the printer control panel, touch [“Support Tools”](#).
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
 - c. Select from the following tests:
 - [All Sensors](#) , [Engine Sensors](#)
 - [Done](#) (return to the [Troubleshooting](#) menu)
 - [Reset](#) (reset the selected sensor’s state)
 - d. Test the duplex sensor to verify that the sensor is functioning correctly. If the sensor does not function, replace the right door sub assembly.



NOTE: Before replacing any parts check connector J309 on the DC controller.

Part number: RM2-0849-000CN

For instructions: See the Repair Service Manual for this product.

3. Replace the right door assembly as needed.

Part number: RM2-0849-000CN

For instructions: See the Repair Service Manual for this product.

13.E1.D3 Fuser Area Jam

Output delivery delay jam. Paper did not reach the output bin full sensor in time.

Recommended action for customers

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size, and the tray should not be filled above the maximum fill marks or tabs.
4. Verify that the paper meets specifications for this printer.
5. Use a damp, lint-free cloth to clean the rollers in the appropriate tray. Replace rollers that are worn.

6. Open all doors and covers and ensure the paper path is completely clear of paper or obstructions.
7. If the error persists, please contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

1. Turn the printer off.
2. Remove the toner cartridge and turn the printer on.

If the message "install toner cartridge appears without the 59 error, reinstall the toner cartridge.
3. If the error returns with the tone cartridge installed, try a new cartridge if available. If not replace the toner cartridge.



NOTE: Check the part number on the installed toner cartridge to ensure the correct capacity cartridge is ordered.

4. If the error persists, replace the Developing Drive Assembly (PS4850).

Developer drive assembly part number: RM2-6756-000CN
M607, M608, M608nk, M609, M610, M611, M612, E60055-E60075, E60155-E60175

For instructions: See the Repair Service Manual for this product.

M631, M632, M633, M634, M635, M636, M637, E62555-E62575, E62655-E62675

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

1. Turn the printer off.
2. Remove the toner cartridge and turn the printer on.

If the message "install toner cartridge appears without the 59 error, reinstall the toner cartridge.
3. If the error returns with the tone cartridge installed, try a new cartridge if available. If not replace the toner cartridge.



NOTE: Check the part number on the installed toner cartridge to ensure the correct capacity cartridge is ordered.

4. Check connection J301 on the DC Controller.
5. Check the connection on the Developing Drive Assembly.
6. If the error persists, replace the Developing Drive Assembly (PS4850).

Developer drive assembly part number: RM2-6756-000CN
M607, M608, M608nk, M609, M610, M611, M612, E60055-E60075, E60155-E60175

For instructions: See the Repair Service Manual for this product.

M631, M632, M633, M634, M635, M636, M637, E62555-E62575, E62655-E62675

For instructions: See the Repair Service Manual for this product.

13.E1.Dz

Output delivery delay jam. Paper did not reach the output bin full sensor in time.

- **13.E1.D1** The fuser is printing in fuser mode **Auto Sense** special case distinguished from "typed" Normal.
- **13.E1.D2** The fuser is printing in fuser mode **Normal**.
- **13.E1.D3** The fuser is printing in fuser mode **Light 1** or **Light 2**.
- **13.E1.D4** The fuser is printing in fuser mode **Heavy 1**.
- **13.E1.D5** The fuser is printing in fuser mode **Heavy 2**.
- **13.E1.D6** The fuser is printing in fuser mode **Heavy Paper 3**.
- **13.E1.D7** The fuser is printing in fuser mode **Glossy Paper 1**.
- **13.E1.D8** The fuser is printing in fuser mode **Glossy Paper 2**.
- **13.E1.D9** The fuser is printing in fuser mode **Glossy Paper 3**.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, please contact HP customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Check the delivery roller and assembly for any damage or debris. Replace the delivery assembly as needed.

Paper delivery assembly part number: RM2-6787-000CN

For instructions (M631, M632, M633): See the Repair Service Manual for this product.

3. Check the fuser for damage or wear. Replace the fuser as needed.

Fuser Kit 110v part number: RM2-1256-000cn

Fuser Kit 220v part number: RM2-1257-000cn

For instructions: See the Repair Service Manual for this product.

13.E1.D2

This event code was detected when the gear on the delivery assembly is separated from the fuser drive assembly and is not in contact with the fuser drive assembly.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.



NOTE: Always wait for the fuser to cool before removing it.

- a. Open the right door.
- b. Look for any paper present or obstructions in the paper path.
- c. Gently pull out any jammed papers.
- d. Hold the fuser handles, lift it up slightly, and then pull it straight out to remove the fuser out of the printer.



WARNING! The fuser can be hot while the printer is in use. Wait for the fuser to cool before handling it.

- e. Remove any jammed paper from the fuser opening.
 - f. Reinstall the fuser.
 - g. Close the right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
 3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.



NOTE: Always wait for the fuser to cool before removing it.

- a. Open the right door.
- b. Gently pull out any jammed papers.
- c. Hold the fuser handles, lift it up slightly, and then pull it straight out to remove the fuser out of the printer.



WARNING! The fuser can be hot while the printer is in use. Wait for the fuser to cool before handling it.


Figure 6-80 Remove the fuser



- d. Remove any jammed paper from the fuser opening.
- 2. Check if the gear on the Delivery assembly is separated from and Fuser drive assembly.

It was detected that the gear on the Delivery assembly might be separated and was not in contact with the Fuser drive assembly mechanism. The arrow in the image indicates the gear separation between the delivery and fuser drive assemblies.

Figure 6-81 Gear on the Delivery assembly is separated from Fuser drive assembly

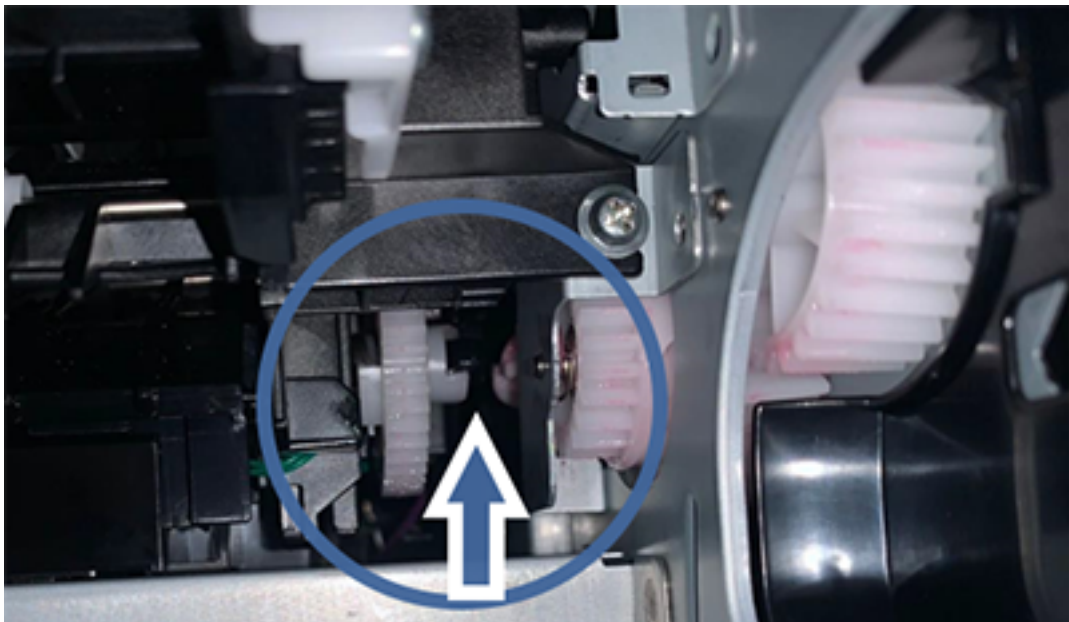


3. If the gear on the Delivery assembly is not in contact or connected with the Fuser drive assembly, use the tip of the screwdriver to release the gear and connect it to the Fuser drive assembly mechanism.



NOTE: Do not exert force when using the screwdriver for this task.

Figure 6-82 Gear on Delivery assembly connected to Fuser drive assembly

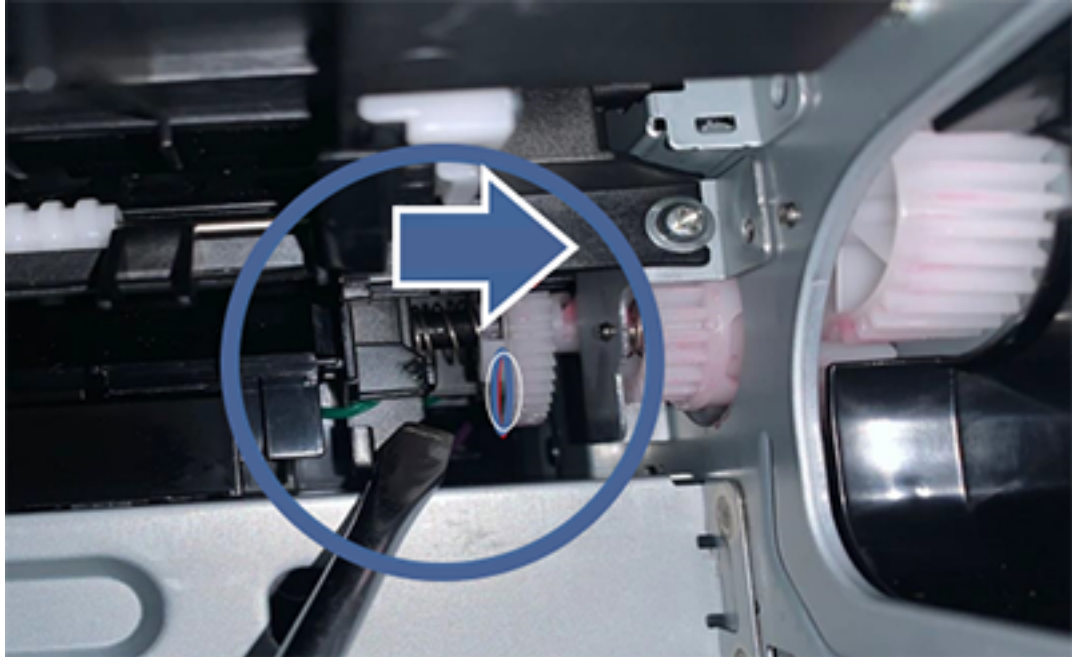


4. If the event continues to occur after the gear adjustment, remove the delivery assembly:
 - a. Press down the gear on the paper delivery assembly and rotate it manually.
 - b. Release the tab and cover.
 - c. Disconnect the two connectors, and then remove the M4 and M3 screws.
 - d. Pull out the delivery assembly.

For detailed instructions: See the Repair Service Manual for this product.

5. Verify the output sensor flags are positioned correctly and the mechanisms have the correct movement.

Figure 6-83 Location of the Output sensor flags

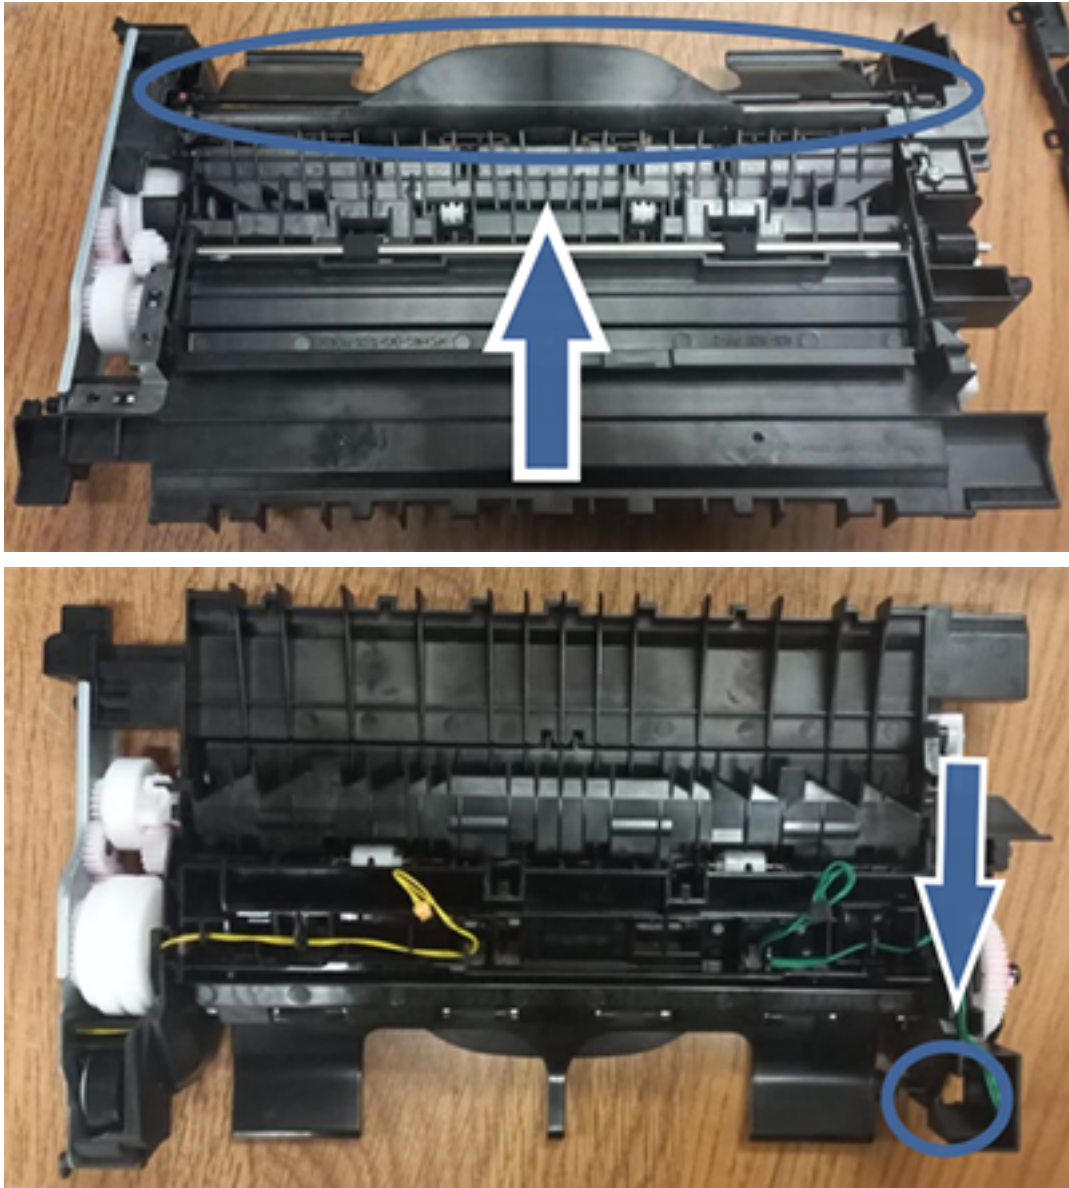

NOTE: When installing the delivery assembly, make sure to check that the bosses on the right and left sides are correctly engaged with the groove of the side plate.

6. Remove the fuser drive assembly, and then verify the dual-function mechanism rotates correctly and the spring is in the correct position.

For instructions: See the Repair Service Manual for this product.

Figure 6-84 Fuser drive assembly



Figure 6-85 Arrow indicates the correct rotation direction

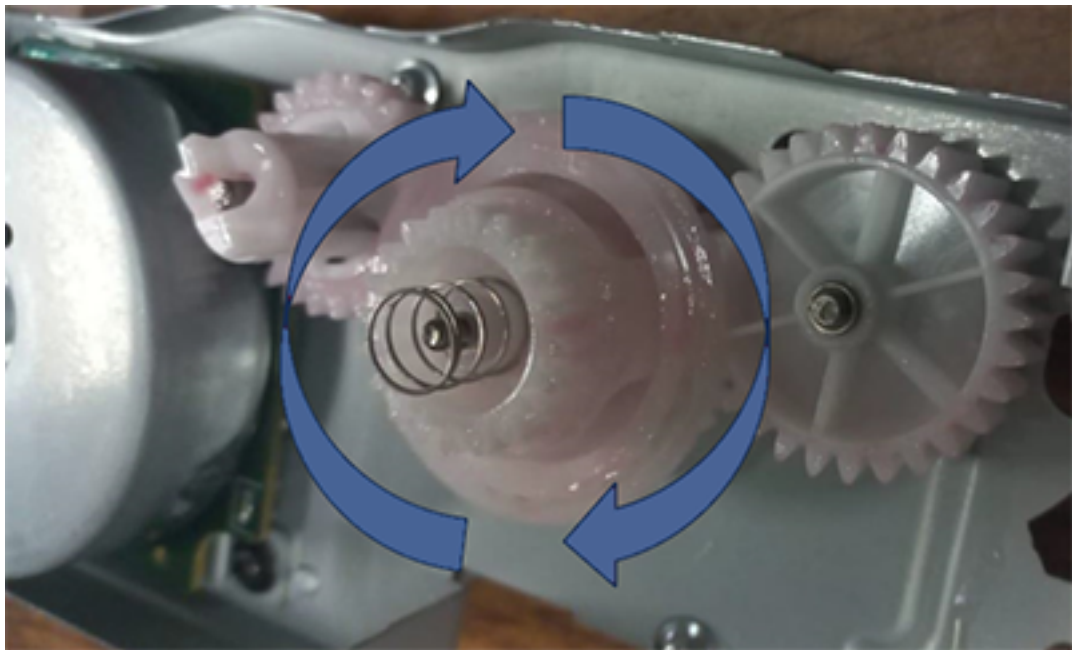


Figure 6-86 Correct position of the spring



7. Assemble the components and validate the functionality of the printer.

 **NOTE:** This failure is not resolved with replacing components, it was detected that there is a connection issue between the Delivery assembly and Fuser drive assembly mechanism, and this generates the failure in the printer functionality.

If these steps do not solve the failure, use the standard support process to resolve the issue.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.

 **NOTE:** Always wait for the fuser to cool before removing it.

- a. Open the right door.
- b. Gently pull out any jammed papers.
- c. Hold the fuser handles, lift it up slightly, and then pull it straight out to remove the fuser out of the printer.

 **WARNING!** The fuser can be hot while the printer is in use. Wait for the fuser to cool before handling it.


Figure 6-87 Remove the fuser



- d. Remove any jammed paper from the fuser opening.
2. Check if the gear on the Delivery assembly is separated from and Fuser drive assembly.

It was detected that the gear on the Delivery assembly might be separated and was not in contact with the Fuser drive assembly mechanism. The arrow in the image indicates the gear separation between the delivery and fuser drive assemblies.


Figure 6-88 Gear on the Delivery assembly is separated from Fuser drive assembly

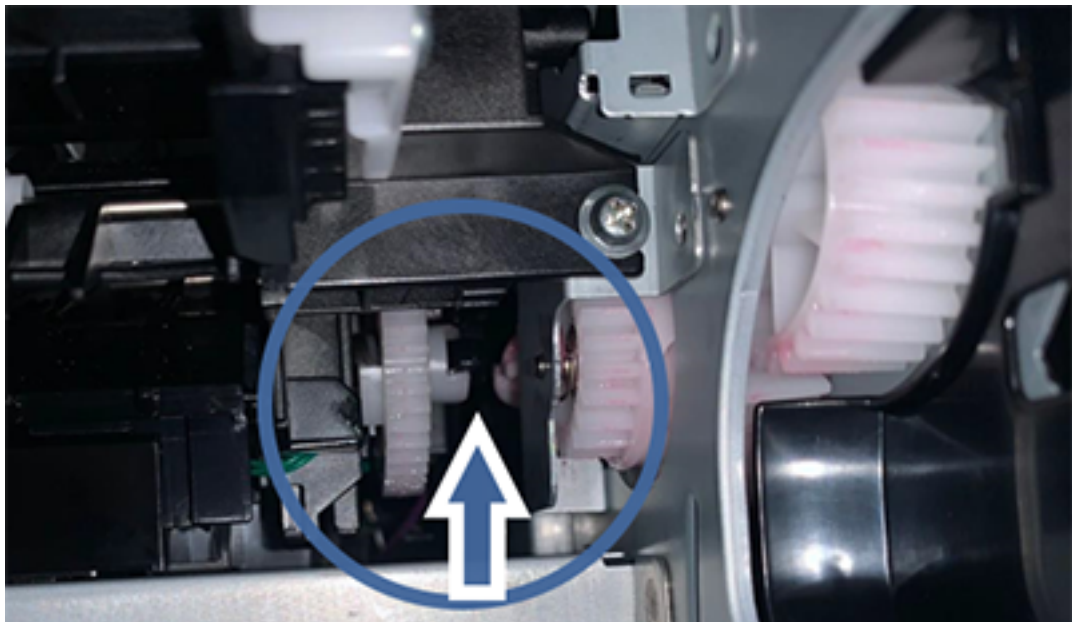

3. If the gear on the Delivery assembly is not in contact or connected with the Fuser drive assembly, use the tip of the screwdriver to release the gear and connect it to the Fuser drive assembly mechanism.

Do not exert force when using the screwdriver for this task.

Figure 6-89 Gear on Delivery assembly connected to Fuser drive assembly

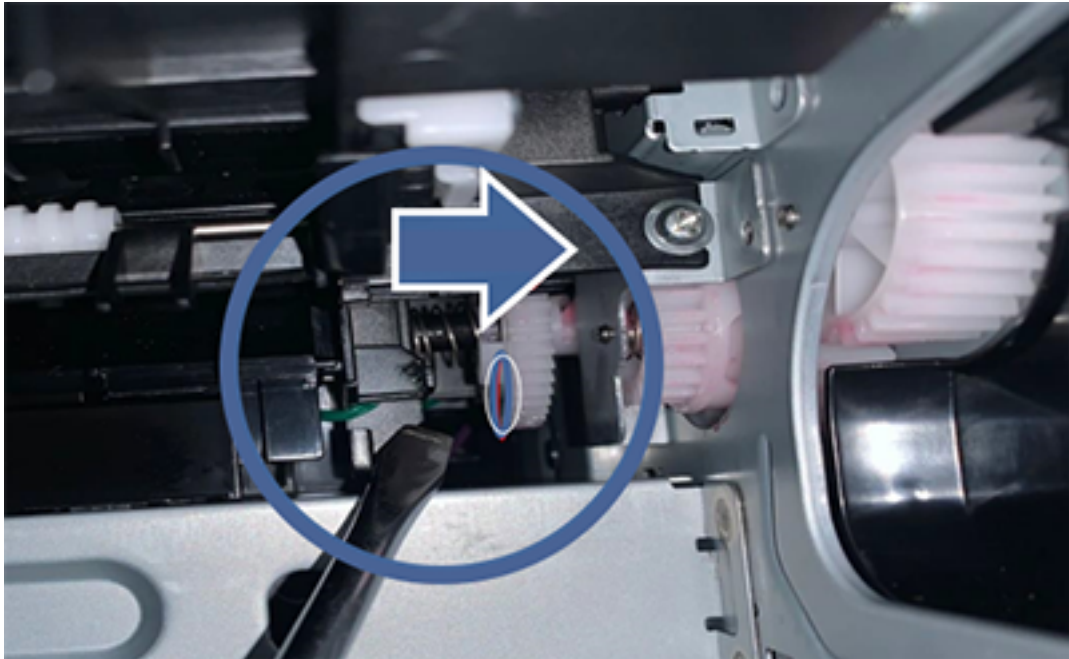



4. If the event continues to occur after the gear adjustment, remove the delivery assembly:
 - a. Press down the gear on the paper delivery assembly and rotate it manually.
 - b. Release the tab and cover.
 - c. Disconnect the two connectors, and then remove the M4 and M3 screws.
 - d. Pull out the delivery assembly.

For detailed instructions: See the Repair Service Manual for this product.

5. Verify the output sensor flags are positioned correctly and the mechanisms have the correct movement.

Figure 6-90 Location of the Output sensor flags

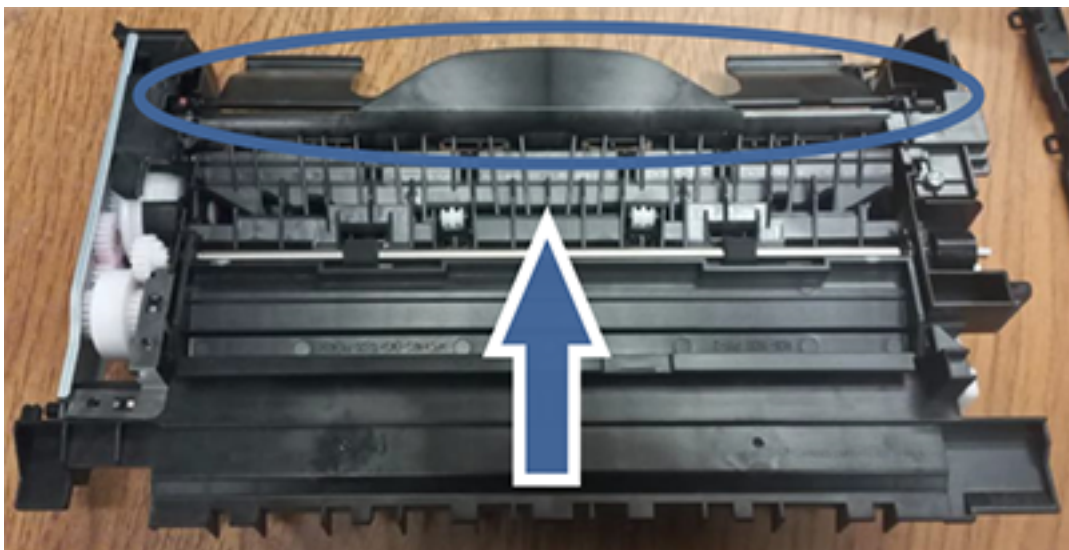

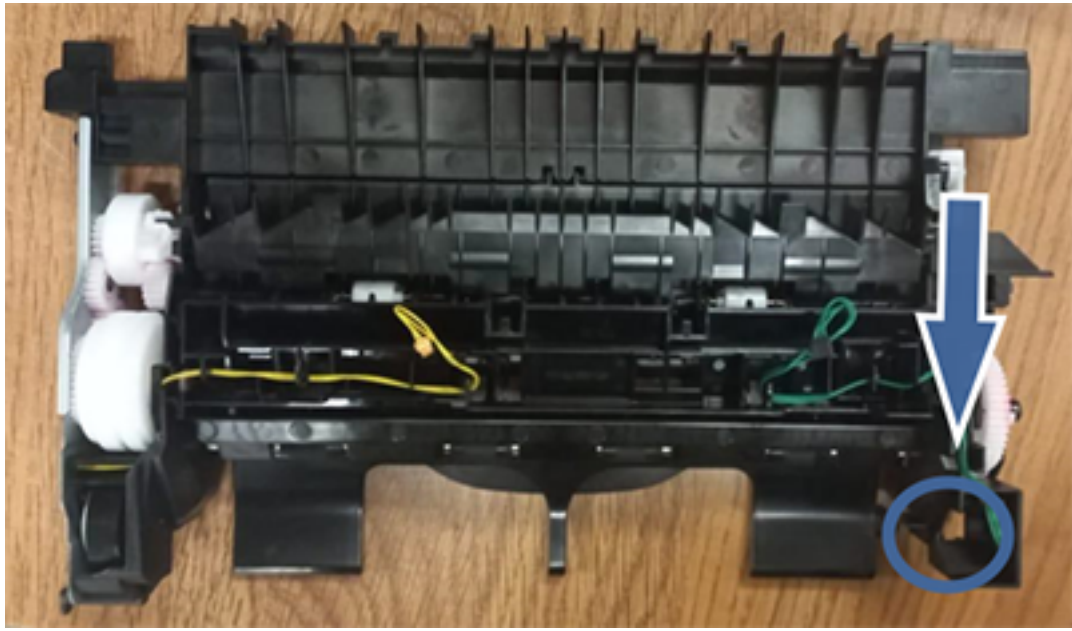

 **NOTE:** When installing the delivery assembly, make sure to check that the bosses on the right and left sides are correctly engaged with the groove of the side plate.

6. Remove the fuser drive assembly, and then verify the dual-function mechanism rotates correctly and the spring is in the correct position.

For instructions: See the Repair Service Manual for this product.

Figure 6-91 Fuser drive assembly



Figure 6-92 Arrow indicates the correct rotation direction

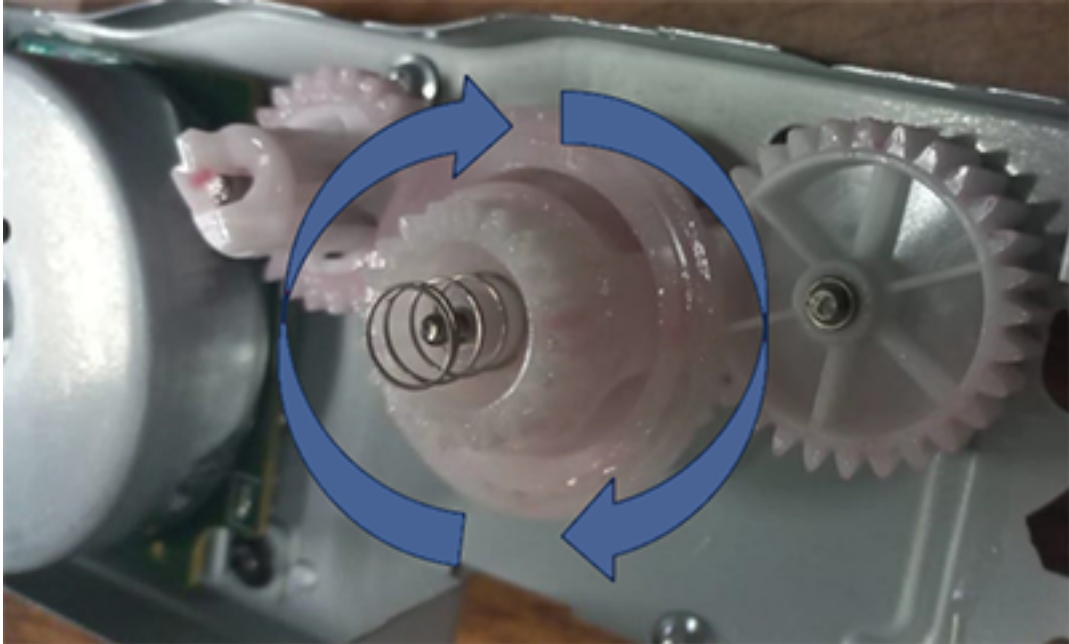


Figure 6-93 Correct position of the spring



7. Assemble the components and validate the functionality of the printer.



NOTE: This failure is not resolved with replacing components, it was detected that the Delivery assembly is with an inadequate connection assembly, and this generates the failure in the printer functionality.

If these steps do not solve the failure, use the standard support process to resolve the issue.

13.FF.FF

A power on residual paper jam has occurred.

This error has no specific sensor designated. It could be any sensor in the paper feed path.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the right door to allow the printer to attempt to clear the jam message.
2. Check for obstructions in the paper path. View the event log to determine if other jam errors are occurring and troubleshoot those errors.
3. Check sensors and switches to isolate a faulty door switch or sensor.
 - a. From the home screen on the printer control panel, touch **“Support Tools”**.
 - b. Open the following menus:
 - **Troubleshooting**
 - **Diagnostic Tests**
 - **Manual Sensor Test**
 - c. Select from the following tests:
 - **All Sensors , Engine Sensors**
 - **Done** (return to the **Troubleshooting** menu)

- **Reset** (reset the selected sensor's state)
- d. Test the all sensors and switches to verify that they are functioning correctly.
- e. Replace parts as determined by sensor tests, damage, or obstructions.



NOTE: Before replacing any parts check **ALL** connectors on the DC controller.

13.60.5z

Paper is too short jam inside right door or the stapler/stacker.

- **13.60.51** A jam is detected when printing to output tray 1.
- **13.60.52** A jam is detected when printing to output tray 2.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the output device right door.
 - b. Remove all paper found.
 - c. Close the output device right door.
 - d. Open the printer right door.
 - e. Remove the fuser unit.



CAUTION: The fuser might be hot.

- f. Remove all paper found and then reinstall the fuser.
 - g. Close the printer right door.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the output device right door.
 - b. Remove all paper found.
 - c. Close the output device right door.
 - d. Open the printer right door.
 - e. Remove the fuser unit.



CAUTION: The fuser might be hot.

- f. Remove all paper found and then reinstall the fuser.
 - g. Close the printer right door.

2. If the issue persists, replace the lower paper feed assembly.
Part number: RM2-1071-000CN
For instructions: See the Repair Service Manual for this product.
3. If the issue persists, replace the upper paper feed assembly.
Part number: RM2-1067-000CN
For instructions: See the Repair Service Manual for this product.

13.60.6z

Inter page gap jam inside right door or the stapler/stacker.

- **13.60.61** A jam is detected when printing to output tray 1.
- **13.60.62** A jam is detected when printing to output tray 2.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the output device right door.
 - b. Remove all paper found.
 - c. Close the output device right door.
 - d. Open the printer right door.
 - e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

 - f. Remove all paper found and then reinstall the fuser.
 - g. Close the printer right door.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the output device right door.
 - b. Remove all paper found.
 - c. Close the output device right door.
 - d. Open the printer right door.
 - e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

 - f. Remove all paper found and then reinstall the fuser.

- g. Close the printer right door.
- 2. If the issue persists, replace the lower paper feed assembly.
Part number: RM2-1071-000CN
For instructions: See the Repair Service Manual for this product.
- 3. If the issue persists, replace the upper paper feed assembly.
Part number: RM2-1067-000CN
For instructions: See the Repair Service Manual for this product.

13.60.F0

Paper jam inside right door of the stapler/stacker at power on.

Recommended action for customers

- 1. Clear the paper jam.
 - a. Open the output device right door.
 - b. Remove all paper found.
 - c. Close the output device right door.
 - d. Open the printer right door.
 - e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

 - f. Remove all paper found and then reinstall the fuser.
 - g. Close the printer right door.
- 2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

- 1. Clear the paper jam.
 - a. Open the output device inner right door.
 - b. Remove all paper found.
 - c. Close the output device inner right door.
 - d. Open the printer right door.
 - e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

 - f. Remove all paper found and then reinstall the fuser.
 - g. Close the printer right door.

2. If the issue persists, replace the lower paper feed assembly.

Part number: RM2-1071-000CN

For instructions: See the Repair Service Manual for this product.

13.80.Az

Paper stay jam inside right door of the stapler/stacker. The paper stopped at the stapler/stacker entry sensor in the designated time.

For additional troubleshooting information, go to [HP LaserJet Enterprise MFP, HP LaserJet Managed MFP - 13.B9.A1 or 13.80.A1 Jam \(Emerging Issue\)](#).

- **13.80.A1** A jam is detected when printing to output bin 1.
- **13.80.A2** A jam is detected when printing to output bin 2.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the output device right door.
 - b. Remove all paper found.
 - c. Close the output device right door.
 - d. Open the printer right door.
 - e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

 - f. Remove all paper found and then reinstall the fuser.
 - g. Close the printer right door.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **IMPORTANT:** If this error occurs on printers that have a stapler/stacker attached and the output is going only to the stapler/stacker bin, please go to the following document to troubleshoot: [HP LaserJet Enterprise MFP, HP LaserJet Managed MFP - 13.B9.A1 or 13.80.A1 Jam \(Emerging Issue\)](#)

If the jam occurs when the output is going to the top output of the stapler/stacker, or on printers that do not have a stapler/stacker attached, troubleshoot using the following steps:

1. Clear the paper jam.
 - a. Open the output device right door.
 - b. Remove all paper found.
 - c. Close the output device right door.
 - d. Open the printer right door.

- e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

- f. Remove all paper found and then reinstall the fuser.
- g. Close the printer right door.

2. If the issue persists, replace the lower paper feed assembly.

Part number: RM2-1071-000CN

For instructions: See the Repair Service Manual for this product.

3. If the issue persists, replace the upper paper feed assembly.

Part number: RM2-1067-000CN

For instructions: See the Repair Service Manual for this product.

13.80.D1 Paper jam in stapler/stacker

Late to Stapler/Stacker jam

Recommended action for customers

1. Check the printer for a jam in the stapler/stacker.
2. Look for and clear any paper present or obstructions in the paper path.
3. View event log to determine if other jam errors are occurring and troubleshoot those errors.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Check the printer for a jam.
2. Look for and clear any paper present or obstructions in the paper path.
3. View event log to determine if other jam errors are occurring and troubleshoot those errors.
4. Verify there is no debris from a previous jam stuck in the fuser, or the rollers leading into and out of the fuser.
5. Confirm that the output bin rollers are turning.
6. If the error persists, replace the stapler/stacker micro switch.

Micro switch (stapler/stacker) part number: WC4-5171-000CN

13.80.Dz

Paper delay jam inside inner right door of the stapler/stacker. The paper did not reach the stapler/stacker entry sensor in the designated time.

- **13.80.D1** A jam is detected when printing to output bin 1.
- **13.80.D2** A jam is detected when printing to output bin 2.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the output device right door.
 - b. Remove all paper found.
 - c. Close the output device right door.
 - d. Open the printer right door.
 - e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

 - f. Remove all paper found and then reinstall the fuser.
 - g. Close the printer right door.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the output device right door.
 - b. Remove all paper found.
 - c. Close the output device right door.
 - d. Open the printer right door.
 - e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

 - f. Remove all paper found and then reinstall the fuser.
 - g. Close the printer right door.
2. If the issue persists, replace the lower paper feed assembly.

Part number: RM2-1071-000CN

For instructions: See the Repair Service Manual for this product.

13.80.F0

Paper jam inside inner right door of the stapler/stacker at power on.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the output device right door.
 - b. Remove all paper found.

- c. Close the output device right door.
- d. Open the printer right door.
- e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

- f. Remove all paper found and then reinstall the fuser.
- g. Close the printer right door.

- 2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

- 1. Clear the paper jam.
 - a. Open the output device inner right door.
 - b. Remove all paper found.
 - c. Close the output device inner right door.
 - d. Open the printer right door.
 - e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

- f. Remove all paper found and then reinstall the fuser.
- g. Close the printer right door.

- 2. If the issue persists, replace the lower paper feed assembly.

Part number: RM2-1071-000CN

For instructions: See the Repair Service Manual for this product.

13.83.Az

Paper stay jam right door of the stapler/stacker. The paper stopped at the staple entry sensor in the designated time.

- **13.83.A1** A jam is detected when printing to output bin 1.
- **13.83.A2** A jam is detected when printing to output bin 2.

Recommended action for customers

- 1. Clear the paper jam.
 - a. Open the output device right door.
 - b. Remove all paper found.
 - c. Close the output device right door.

- d. Open the printer right door.
- e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

- f. Remove all paper found and then reinstall the fuser.
- g. Close the printer right door.

- 2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

- 1. Clear the paper jam.
 - a. Open the output device right door.
 - b. Remove all paper found.
 - c. Close the output device right door.
 - d. Open the printer right door.
 - e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

- f. Remove all paper found and then reinstall the fuser.
- g. Close the printer right door.

- 2. If the issue persists, replace the upper paper feed assembly.

Part number: RM2-1067-000CN

For instructions: See the Repair Service Manual for this product.

- 3. If the issue persists, replace the jog assembly.

Part number: RM2-1066-000CN

For instructions: See the Repair Service Manual for this product.

13.83.Dz

Paper delay jam inside right door of the stapler/stacker. The paper did not reach the stapler/stacker entry sensor in the designated time.

- **13.83.D1** A jam is detected when printing to output bin 1.
- **13.83.D2** A jam is detected when printing to output bin 2.

Recommended action for customers

- 1. Clear the paper jam.
 - a. Open the output device right door.
 - b. Remove all paper found.

- c. Close the output device right door.
- d. Open the printer right door.
- e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

- f. Remove all paper found and then reinstall the fuser.
- g. Close the printer right door.

- 2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

- 1. Clear the paper jam.
 - a. Open the output device right door.
 - b. Remove all paper found.
 - c. Close the output device right door.
 - d. Open the printer right door.
 - e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

- f. Remove all paper found and then reinstall the fuser.
- g. Close the printer right door.

- 2. If the issue persists, replace the lower paper feed assembly.

Part number: RM2-1071-000CN

For instructions: See the Repair Service Manual for this product.

- 3. If the issue persists, replace the upper paper feed assembly.

Part number: RM2-1067-000CN

For instructions: See the Repair Service Manual for this product.

13.83.FO

Power on Jam/Stacker jam – middle sensor.

Recommended action for customers


- 1. Check the printer for a jam in the stapler/stacker.
- 2. Look for and clear any paper in the upper right cover of the stapler/stacker.
- 3. View the event log to determine if any other jam errors are occurring and troubleshoot those errors.

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Check the printer for a paper jam.
2. Look for and clear any paper in the upper right cover of the stapler stacker.
3. View the event log to determine if any other jam errors are occurring and troubleshoot those errors.
4. Confirm that the output bin rollers are turning.
5. If this occurs after service of the upper paper feed assembly, check that the cover was reinstalled correctly and is not blocking sensor movement.

Figure 6-94 Sensor location

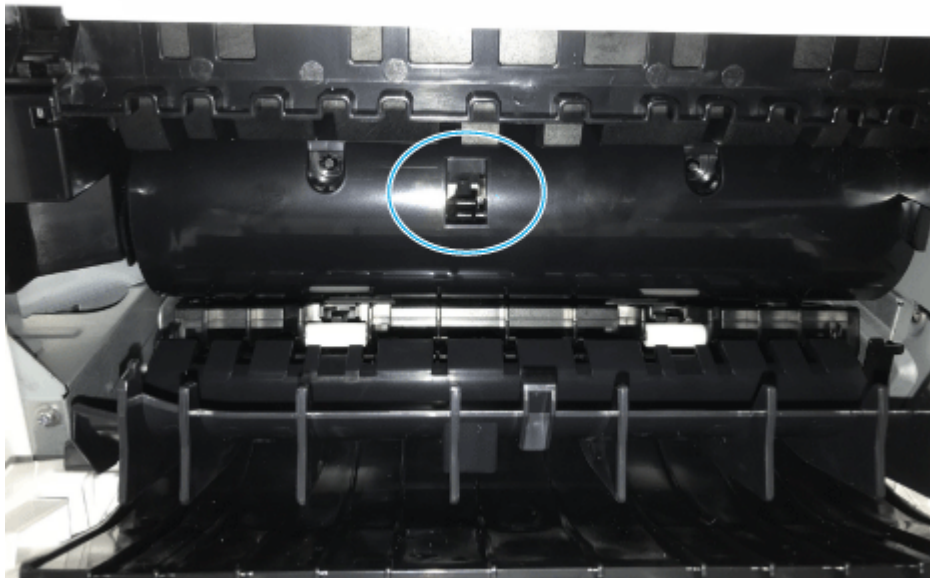

6. If the error persists, replace the stapler/stacker upper paper feed assembly.

Part number: RM2-6810-000CN

For instructions: See the Repair Service Manual for this product.

20.WX.YZ error messages

20.* errors

Errors in the 20.* family are related to the printer memory. The page might require more memory than the printer has available.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Touch the **OK** button to continue.
2. Reduce the page complexity.
3. Add product memory.

20.00.00 Insufficient memory <device>

Event log message 20.00.00.

The printer does not have enough memory to print the page.

The printer received more data than can fit in the available memory. The customer might have tried to transfer too many macros, soft fonts, or complex graphics.

Recommended action

- Touch the **OK** button to print the transferred data. Some data might be lost. Reduce the page complexity or add printer memory.

21.00.00 Page Too ComplexEvent log error message 21.00.00.

The printer displays this message to indicate that the page decompression process was too slow for the printer.

Recommended action

- Touch the **OK** button to continue. There may be some data loss on the page that was being formatted when the error occurred.

30.WX.YZ error messages

30.* errors

Errors in the 30.* family are related to the flatbed scanner.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Calibrate the scanner. Open these menus: [Device Maintenance > Calibrate-Cleaning > Calibrate Scanner](#).
2. Clean the scanner glass and glass strips.
3. Perform the tests for scanner diagnostics. Open these menus: [Administration > Troubleshooting > Diagnostic Tests > Scanner Tests](#).
4. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

5. Check all connections on the scanner control board and from the scanner control board to the formatter and the DC controller or the engine control board. If all connections are good, replace the scanner control board.
6. Replace the formatter.
7. If the error persists, replace the scanner assembly.

30.01.01

The flatbed cover sensor was interrupted.

The scanner flatbed cover is open.

This message appears only in the event log and is not posted on the control panel.

The control panel will read **Flatbed Cover Open**.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. This error message should automatically clear.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the printer and then turn on the printer.
2. Open the scanner lid or automatic document feeder (ADF).
3. Locate the black plastic sensor flag on the document feeder/scanner cover. This sensor is located on the left rear of the document feeder/flatbed glass.



4. If the black plastic sensor flag on the ADF is damaged or missing, replace the image scanner assembly.


Table 6-12 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips.</i>)	J8J64-67901

5. Perform the following tests to check the functionality of the flatbed cover sensor.
 - a. Press the ADF black plastic sensor flag down and allow it to spring back, and then press the sensor flag down again. Ensure that the control panel displays a warning message “Flatbed cover open” when the black sensor flag is in the up position. The warning message should not display when the sensor flag is pressed down.

If the test is functional, perform the next test to verify the actuation of the sensor flag.

Figure 6-95 "Flatbed cover open" warning message

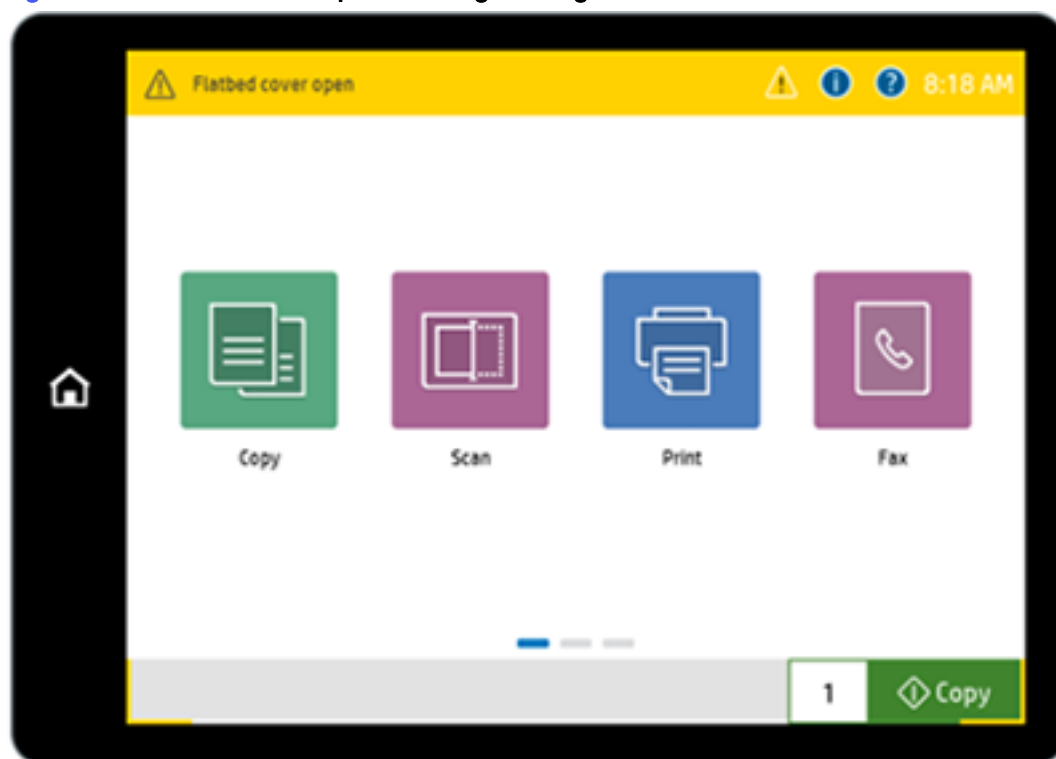

- b. Open and close the scanner lid to test the functionality of the sensor flag. Check the document feeder hinges and ensure the ADF cover is seated correctly.

 **NOTE:** If the actuation of the sensor flag works while depressing manually but not when opening and closing the scanner lid, inspect the ADF hinges to verify they are not broken, and that the ADF is seated correctly.

6. If a broken hinge is identified, replace the ADF hinge.

Table 6-13 ADF hinge part number

Description	Part number
ADF hinge	5851-7205

7. Access the [Manual Sensor Test](#) on the printer control panel to verify the functionality of the [Flatbed cover](#) sensor.


- a. From the Home screen on the control panel, scroll to and select [Support Tools](#).

 **NOTE:** The control panel menu options might vary depending on the printer model and firmware version installed.

- b. Open the following menus: **Troubleshooting > Diagnostic Tests > Manual Sensor Test**.

- c. Select **Flatbed cover**.

Figure 6-96 Flatbed cover option in Manual Sensor Test menu on the printer control panel

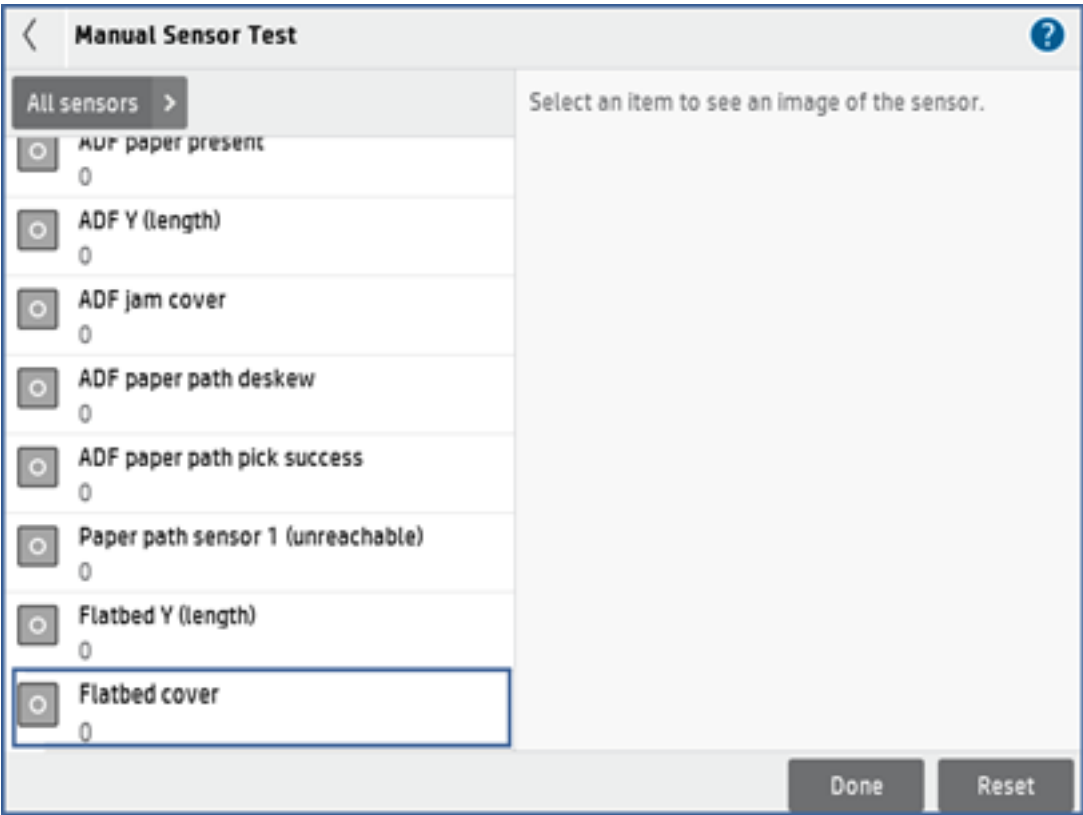

- d. Open and close the flatbed cover.



NOTE: The Flatbed cover sensor counter under the sensor name should increment by one (from "0" to "1", for example) each time the cover is opened or closed.

- e. Check the control panel display to verify the sensor is activated and incremented by one each time you open and close the flatbed cover.
8. If the flatbed cover sensor does not actuate and the counter is not incremented, replace the image scanner assembly.

Table 6-14 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips.</i>)	J8J64-67901

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.


Figure 6-97 Gate Closed



Figure 6-98 Proper insertion



Figure 6-99 Improper insertion

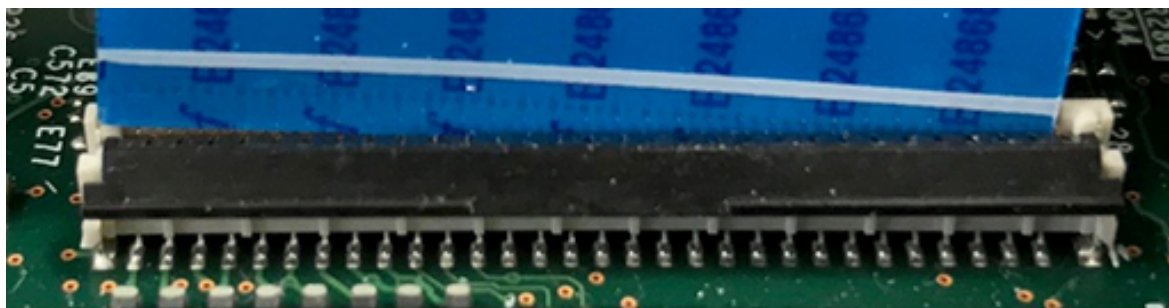

3. Locate the black plastic sensor flag on the document feeder/scanner cover. This sensor is located on the left rear of the document feeder/flatbed glass.



4. If the black plastic sensor flag on the ADF is damaged or missing, replace the image scanner assembly.

Table 6-15 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips.</i>)	J8J64-67901


5. Access the [Manual Sensor Test](#) on the printer control panel.
 - a. From the Home screen on the control panel, scroll to and select [Support Tools](#).

 **NOTE:** The control panel menu options might vary depending on the printer model and firmware version installed.

 - b. Open the following menus: **Troubleshooting > Diagnostic Tests > Manual Sensor Test**.

- c. Select [Flatbed cover](#).

Figure 6-100 Flatbed cover option in Manual Sensor Test menu on the printer control panel

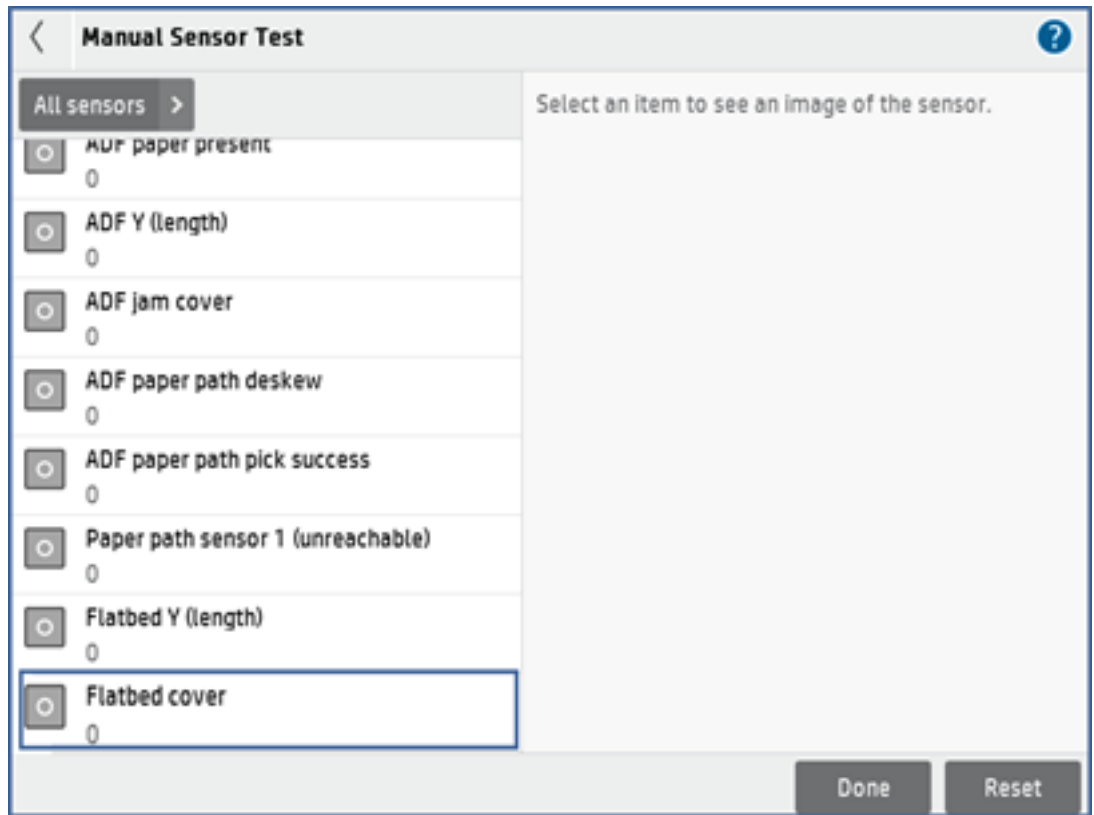

6. Perform the following test in the order presented to verify the functionality of the [Flatbed cover](#) sensor.

NOTE: The Flatbed cover sensor counter under the sensor name should increment by one (from "0" to "1", for example) for each actuation of the sensor flag or each time the document flatbed cover is opened or closed.

- a. Press the ADF black plastic sensor flag down and allow it to spring back. Repeat the steps and check if the Flatbed cover sensor counter increments by one for each actuation of the sensor flag.
- b. If the sensor fails to actuate the counter, replace the image scanner assembly.

Table 6-16 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips</i>)	J8J64-67901

- c. If the sensor flag increases the counter, open and close the flatbed cover to actuate the sensor while performing the same test.
- d. If the flatbed cover sensor does not actuate and advance the counter, inspect the ADF hinges to verify that they are not broken, and to ensure that the flatbed cover is seated correctly.

- e. If a broken hinge is identified, replace the ADF hinge.

Table 6-17 ADF hinge part number

Description	Part number
ADF hinge	5851-7205

7. If the error persists, disconnect and reconnect all the cables on the scanner control board (SCB).

Figure 6-101 Scanner control board (SCB): Sensor connections

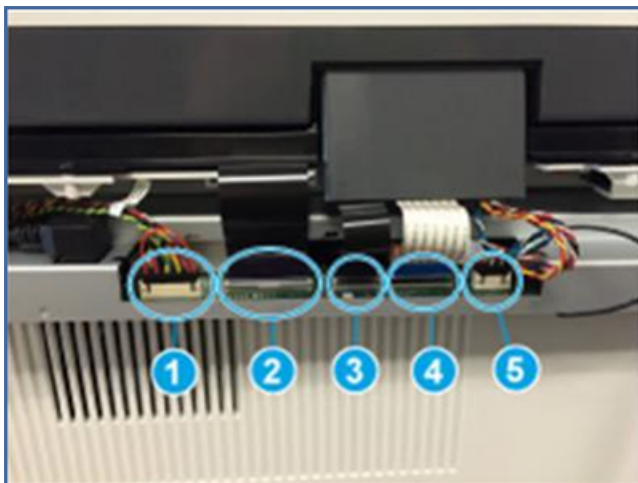


Table 6-18 SCB sensor callout descriptions

Callout	Description
1	Flatbed sensor/motor
2	Flatbed FFC
3	ADF sensor
4	ADF FFC
5	ADF Motor

8. If the error persists after the SCB cables are connected correctly, replace the scanner control board (SCB).

Table 6-19 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) - Flow series	5851-7347

For instructions: See the Repair Service Manual for this product.

30 . 01 . 08 Home position error

The scanner optic failed to return to the home position.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page to check if the latest version of the printer and scanner firmware is installed. If the latest firmware version is not installed, update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. Observe whether the movement of the optics assembly moves correctly.
4. If the error persists after the firmware update and /or the optics assembly fails to move correctly, perform a Continuous Scan diagnostic test using the printer control panel to test the functionality of the scan optics.

- a. From the Home screen on the control panel, scroll to and touch [Support Tools](#).




NOTE: The control panel menu options might vary depending on the printer model and firmware version installed.

- b. Open the following menus: **Troubleshooting > Diagnostic Tests**.
- c. Select [Continuous Scan](#).

- d. Select **Start** to run the test.

Figure 6-102 Start the Continuous Scan test

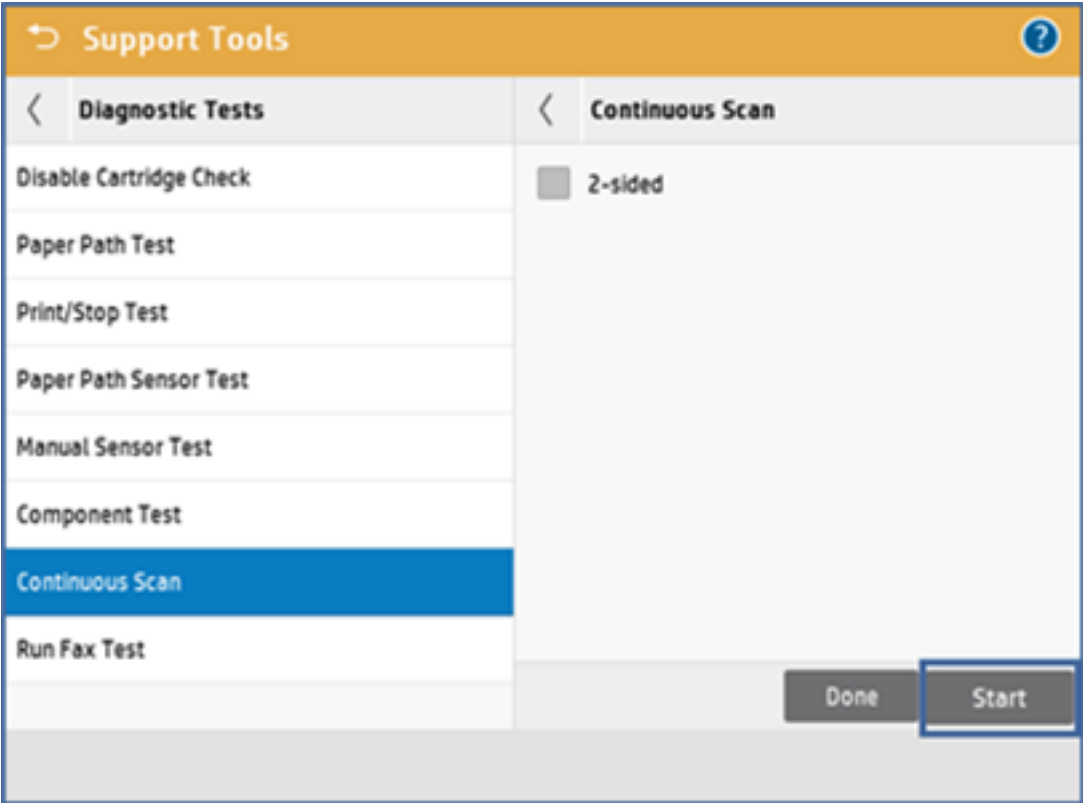

- e. Check if the scan head moves from the home position through the scan, and back to the home position.

 **NOTE:** The scan head should actuate, moving from the home position through a scan, and back to the home position. This process will repeat until interrupted.

5. If the scan head does not actuate or operate correctly, replace the image scanner assembly (ISA).

Table 6-20 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips.</i>)	J8J64-67901

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.


Figure 6-103 Gate Closed



Figure 6-104 Proper insertion



Figure 6-105 Improper insertion

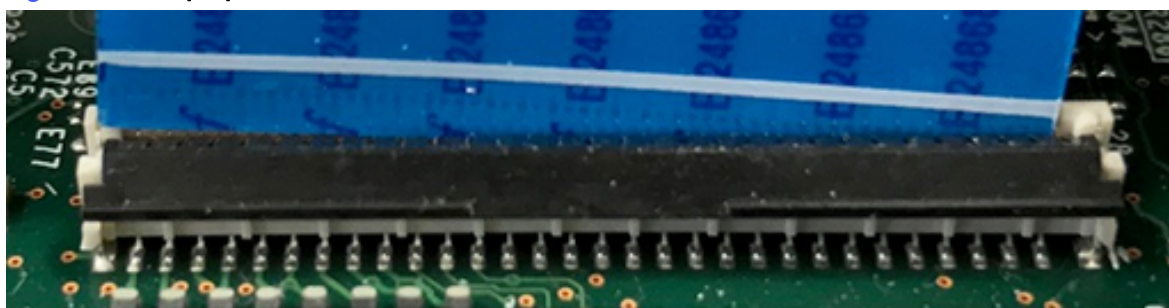

1. Turn the printer off, and then on.
2. Print a Configuration Page to check if the latest version of the printer and scanner firmware is installed. If the latest firmware version is not installed, update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. Observe whether the movement of the optics assembly moves correctly.
4. If the error persists after the firmware update and /or the optics assembly fails to move correctly, perform a Continuous Scan diagnostic test using the printer control panel to test the functionality of the scan optics.


- a. From the Home screen on the control panel, scroll to and touch [Support Tools](#).



NOTE: The control panel menu options might vary depending on the printer model and firmware version installed.

- b. Open the following menus: **Troubleshooting > Diagnostic Tests**.
- c. Select [Continuous Scan](#).
- d. Select [Start](#) to run the test.

Figure 6-106 Start the Continuous Scan test

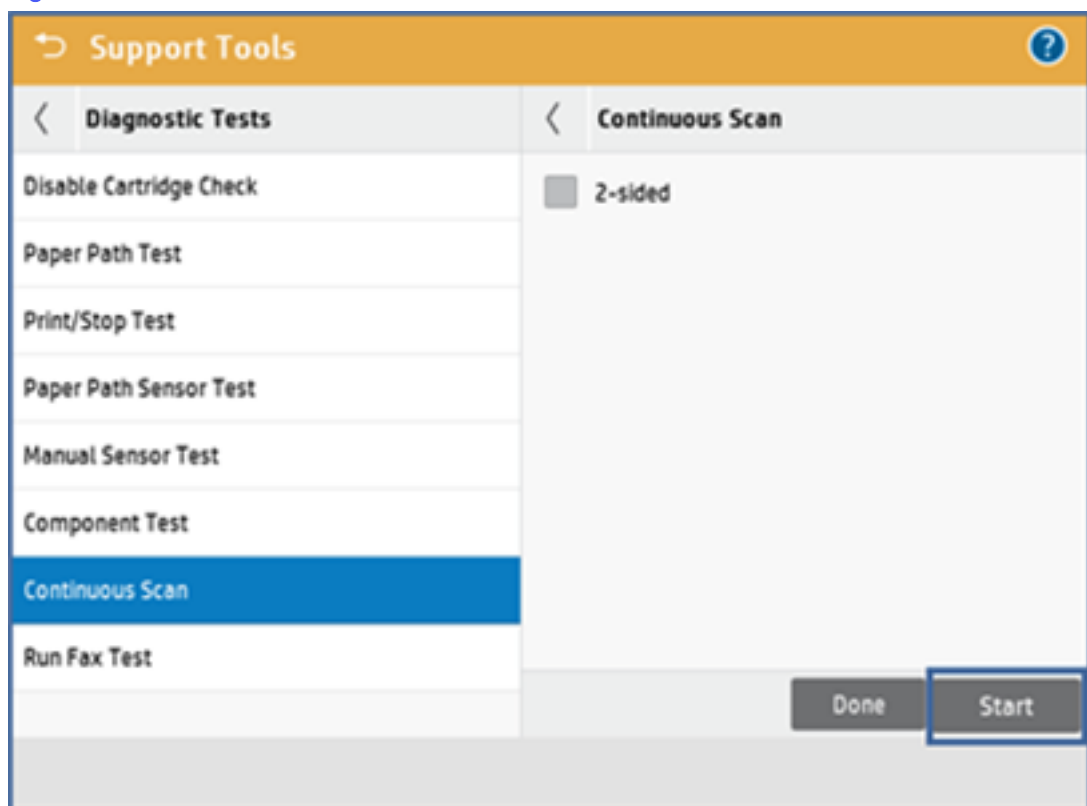

- e. Check if the scan head moves from the home position through the scan, and back to the home position.



NOTE: The scan head should actuate, moving from the home position through a scan, and back to the home position. This process will repeat until interrupted.

5. If the scan head does not actuate or operate correctly, replace the image scanner assembly (ISA).

Table 6-21 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips.</i>)	J8J64-67901

For instructions: See the Repair Service Manual for this product.

6. If the error persists, disconnect and reconnect all the cables on the scanner control board (SCB).

 **NOTE:** Ensure that all the cables on the SCB are connected and seated correctly before replacing any parts.

Figure 6-107 Scanner control board (SCB): Sensor connections

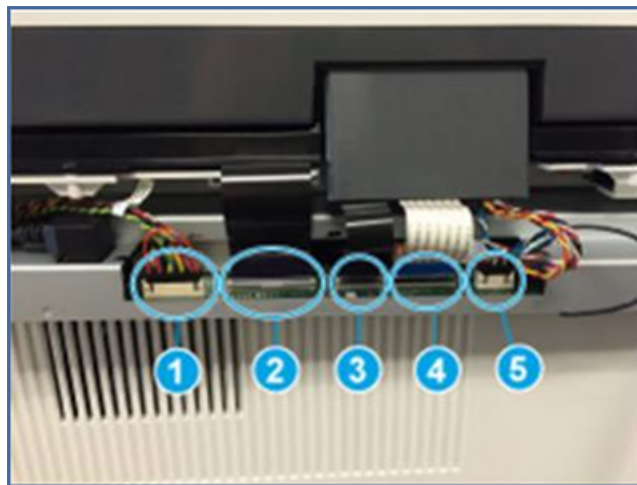


Table 6-22 SCB sensor callout descriptions

Callout	Description
1	Flatbed sensor/motor
2	Flatbed FFC
3	ADF sensor
4	ADF FFC
5	ADF Motor

7. If the error persists after the SCB cables are connected correctly, replace the scanner control board (SCB).

Table 6-23 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) Flow series	5851-7347

For instructions: See the Repair Service Manual for this product.

30 . 01 . 14 Scan system EEPROM error

SCB EEPROM error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page to check if the latest version of the printer and scanner firmware is installed. If the latest firmware version is not installed, update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the error persists after the firmware update, replace the scanner control board (SCB).

Table 6-24 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) Flow series	5851-7347

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.


Figure 6-108 Gate Closed



Figure 6-109 Proper insertion



Figure 6-110 Improper insertion

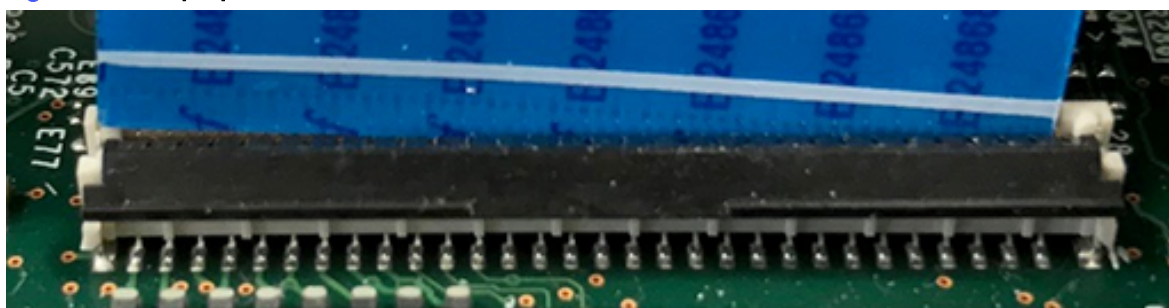

1. Turn the printer off, and then on.
2. Print a Configuration Page to check if the latest version of the printer and scanner firmware is installed. If the latest firmware version is not installed, update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the error persists, disconnect and reconnect all the cables on the scanner control board (SCB).

 **NOTE:** Ensure that all the cables on the SCB are connected and seated correctly before replacing any parts.

Figure 6-111 Scanner control board (SCB): Sensor connections

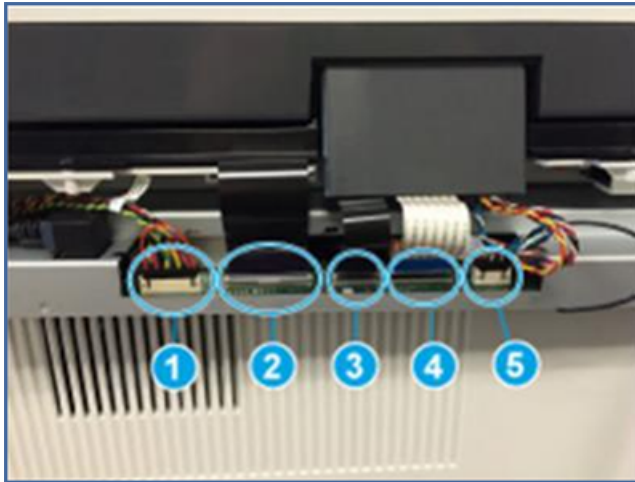


Table 6-25 SCB sensor callout descriptions

Callout	Description
1	Flatbed sensor/motor
2	Flatbed FFC
3	ADF sensor
4	ADF FFC
5	ADF Motor

4. If the error persists after the SCB cables are connected correctly, replace the scanner control board (SCB).

Table 6-26 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) Flow series	5851-7347

For instructions: See the Repair Service Manual for this product.

30.01.41 Scanner error

The formatter lost connections with the SCB or communication was corrupted.

 **NOTE:** Check the voltage of the unit on the regulatory sticker. In the past, this event is directly related to a 220V printer being plugged into a 110V outlet. Ensure that the voltage of the outlet matches the voltage of the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

 **IMPORTANT:** If this error occurs after the control panel has come out of Sleep mode or after opening and closing the ADF multiple times, go to (document c06103348) for additional troubleshooting steps.

1. Turn the printer power off, and then disconnect the power cable from the printer.
2. Wait for one minute, reconnect the power cable, and then turn the printer power on.
3. If the error persists, upgrade the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the issue persists, dispatch service to continue troubleshooting.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.

Figure 6-112 Gate Closed

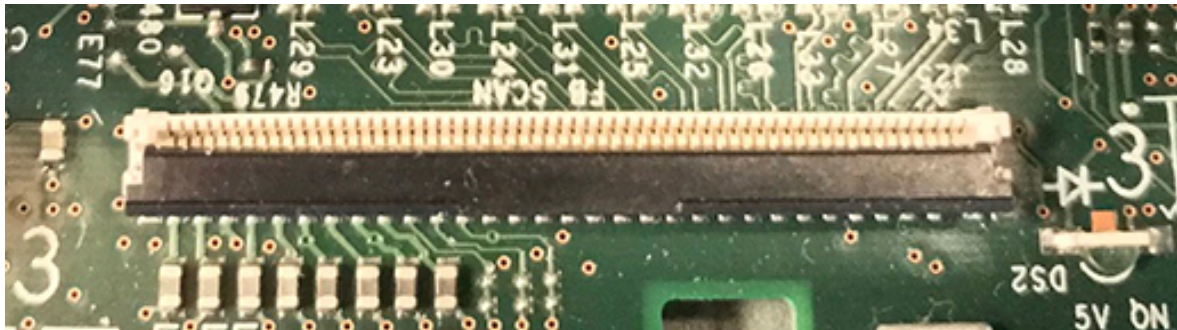


Figure 6-113 Proper Insertion


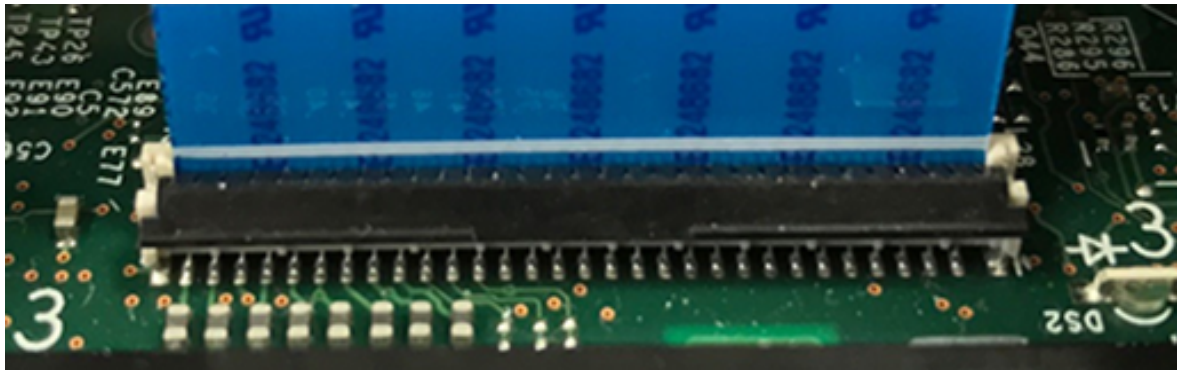


Figure 6-114 Improper insertion

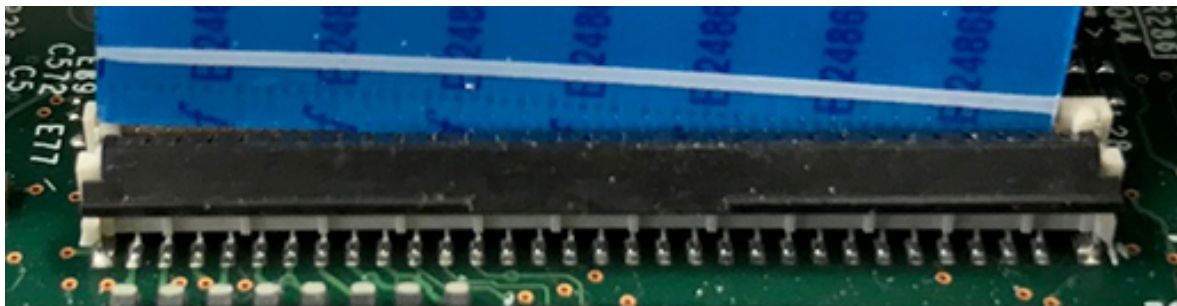

IMPORTANT: If this error occurs after the control panel has come out of Sleep mode or after opening and closing the ADF multiple times, please go to (document c06103348) for additional troubleshooting steps.

1. Turn the printer off, and then on.
2. Wait for one minute, reconnect the power cable, and then turn the printer power on.

3. If the error persists, upgrade the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, disconnect and reconnect all SCB cables.

Figure 6-115 SCB cables and the HDMI cable



Table 6-27 SCB cables and the HDMI cable callout descriptions

Callout	Description
1	Power cable
2	HDMI (Formatter/SCB communication)
3	Flatbed sensor/motor
4	Flatbed FFC
5	ADF sensor/motor
6	ADF FFC
7	ADF Motor

5. If the error persists, disconnect and reconnect the HDMI cable on the formatter that links to the SCB.
6. If the error persists, turn off the printer. Replace the SCB.

Table 6-28 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) Flow series	5851-7347

For instructions: See the Repair Service Manual for this product.

7. If the error persists, turn off the printer, open the automatic document feeder (ADF) to view the flatbed or scanner glass, and then turn the printer power on.
 - If the flatbed scanner lamp **does not light** and/or the scan head assembly does not move, replace the Integrated Scanner Assembly (ISA).

Table 6-29 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips</i>)	J8J64-67901

- If the flatbed scanner lamp **does light** and/or the scan head assembly moves, replace the Automatic Document Feeder (ADF).

Table 6-30 Automatic Document Feeder (ADF) part numbers

Description	Part number
Document feeder kit Enterprise series (<i>Includes white backing and retention clips</i>)	5851-7203
Document feeder kit Workflow series (<i>Includes white backing and retention clips</i>)	5851-7204

For instructions: See the Repair Service Manual for this product.

8. If the error persists, replace the formatter.



NOTE: Make sure to order the correct part number for the printer.

Table 6-31 Formatter part number

Description/Product models	Part number
Formatter (main logic) PC board	J8J61-60001
For products: M631, M632, M633, E62555, E62565, E62575	
Formatter (main logic) PC board	3GY14-67901
For products: E62655/E62665/E62675	
Kit -Formatter	3GY14-67902
For products: E62655/E62665/E62675 (India/China)	
Formatter	7PS94-67901
For products: M634, M635, M636, M637 (India/China)	
Formatter	7PS94-67902
For products: M634, M635, M636, M637	

For instructions: See the Repair Service Manual for this product.

9. If the error persists, replace the Scanner Controller Board (SCB) formatter HDMI cable.

Table 6-32 SCB formatter HDMI cable part number

Description	Part number
Scanner controller board (SCB) formatter HDMI cable	J8J63-60104

10. If the error persists, elevate the case using your regional elevation process.

30 . 01 . 43 SCB memory failure

SCB memory error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, turn the printer off.
3. If the error persists, send a technician onsite to check the connections on the scanner control board (SCB).

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, turn the printer off.

3. Check the cables on the scanner control board (SCB). Make sure the flat flexible cables (FFC's) are seated correctly.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.

Figure 6-116 Gate Closed

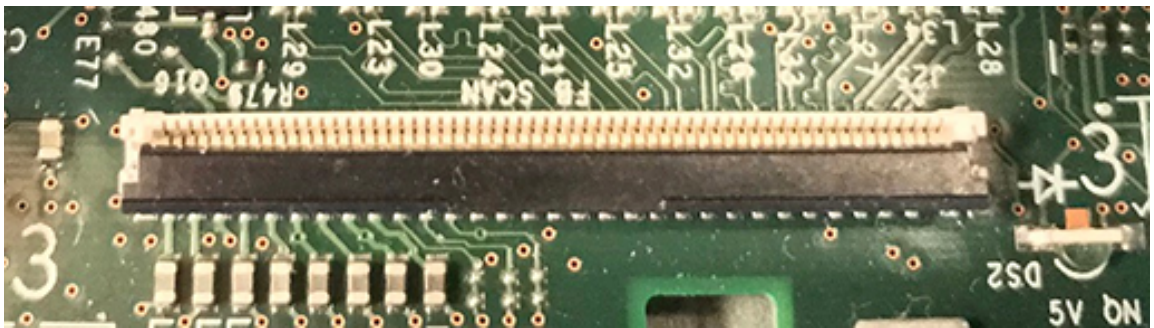


Figure 6-117 Proper Insertion



Figure 6-118 Improper Insertion



4. Disconnect and reconnect all cables between the formatter and the scanner control board (SCB).

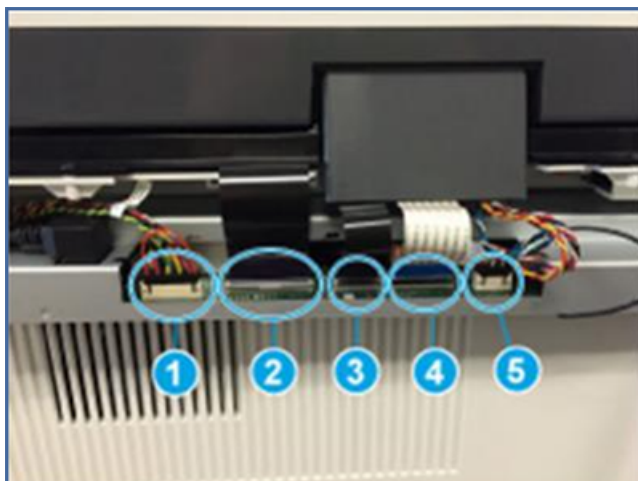


Table 6-33 SCB sensor callout descriptions

Callout	Description
1	Flatbed sensor/motor
2	Flatbed FFC
3	ADF sensor
4	ADF FFC
5	ADF Motor

5. Restart the printer and check if the error persists.
6. If the error persists, replace the scanner control board (SCB).

Table 6-34 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) Flow series	5851-7347

For instructions: See the Repair Service Manual for this product.

7. If the error persists, replace the formatter.

Table 6-35 Formatter part number

Description/ Product models	Part number
Formatter (main logic) PC board	J8J61-60001
For products: M631, M632, M633, E62555, E62565, E62575	
Formatter (main logic) PC board	3GY14-67901
For products: E62655/E62665/E62675	

Table 6-35 Formatter part number (continued)

Description/ Product models	Part number
Kit -Formatter	3GY14-67902
For products: E62655/E62665/E62675 (India/China)	
Formatter	7PS94-67901
For products: M634, M635, M636, M637 (India/China)	
Formatter	7PS94-67902
For products: M634, M635, M636, M637	

For instructions: See the Repair Service Manual for this product.

30.01.44

SCB communication error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer power off, and then disconnect the power cable from the printer.
2. Wait for one minute, reconnect the power cable, and then turn the printer power on.
3. If the error persists, upgrade the printer firmware.

For instructions, go to *HP Enterprise, HP Managed - Update the printer firmware*.

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.



IMPORTANT: If this error occurs after the control panel has come out of Sleep mode or after opening and closing the ADF multiple times, go to (document c06103348) for additional troubleshooting steps.

1. Turn the printer power off, and then disconnect the power cable from the printer.
2. Wait for one minute, reconnect the power cable, and then turn the printer power on.
3. If the error persists, upgrade the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, turn off the printer, open the automatic document feeder (ADF) to view the flatbed or scanner glass, and then turn the printer power on.
 - If the flatbed scanner lamp **does not light** and/or the scan head assembly does not move, replace the Image Scanner Assembly (ISA).

Table 6-36 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips.</i>)	J8J64-67901

- If the flatbed scanner lamp **does light** and/or the scan head assembly moves, replace the Automatic Document Feeder (ADF).

Table 6-37 Automatic Document Feeder (ADF) part numbers

Description	Part number
Document feeder kit Enterprise series (<i>Includes white backing and retention clips</i>)	5851-7203
Document feeder kit Workflow series (<i>Includes white backing and retention clips</i>)	5851-7204

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

 **NOTE:** When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.

Figure 6-119 Gate Closed

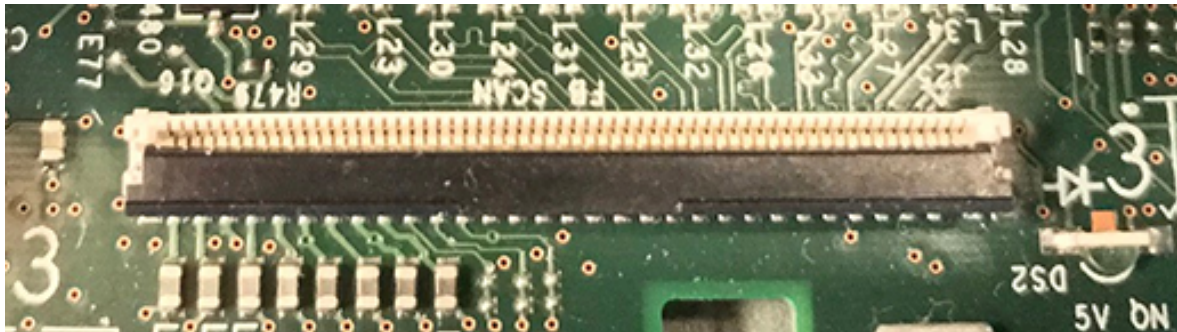


Figure 6-120 Proper insertion


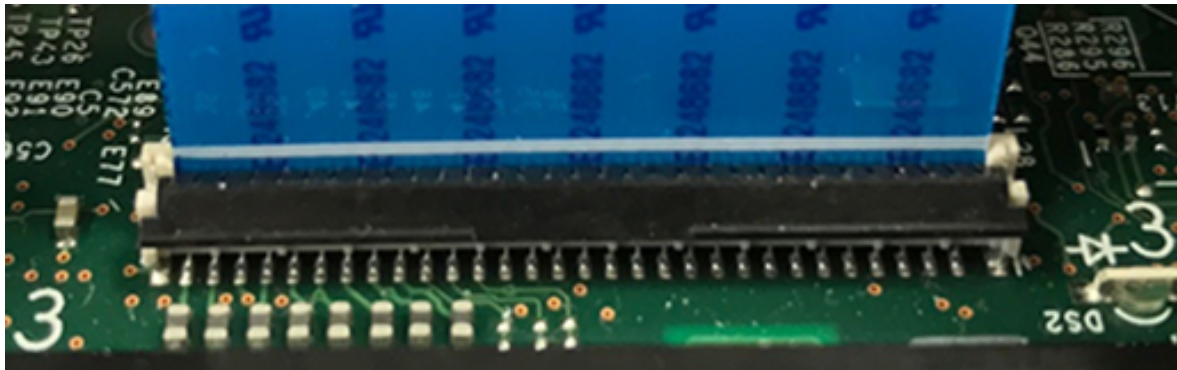


Figure 6-121 Improper insertion

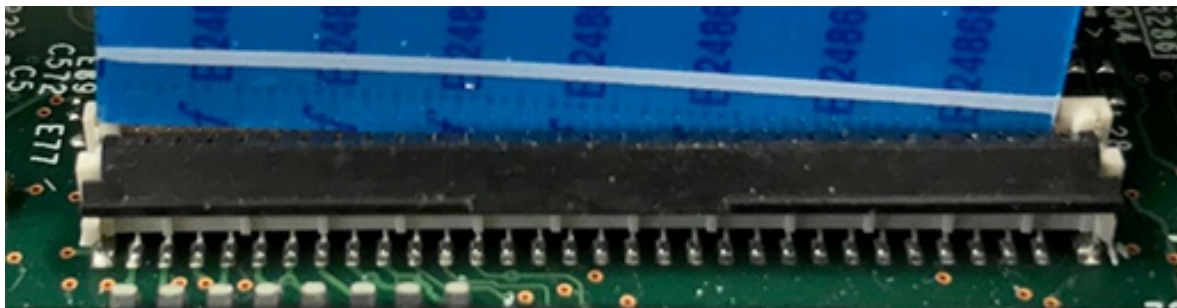

 **IMPORTANT:** If this error occurs after the control panel has come out of Sleep mode or after opening and closing the ADF multiple times, please go to (document c06103348) for additional troubleshooting steps.

1. Turn the printer power off, and then disconnect the power cable from the printer.
2. Wait for one minute, reconnect the power cable, and then turn the printer power on.

3. If the error persists, upgrade the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, disconnect and reconnect all SCB cables and the HDMI cable on the formatter.

Figure 6-122 SCB cables and the HDMI cable



Table 6-38 SCB cables and the HDMI cable callout descriptions

Callout	Description
1	Power cable
2	HDMI (Formatter/SCB communication)
3	Flatbed sensor/motor
4	Flatbed FFC
5	ADF sensor/motor
6	ADF FFC
7	ADF Motor

5. If the error persists, turn off the printer, open the automatic document feeder (ADF) to view the flatbed or scanner glass, and then turn the printer power on.
 - If the flatbed scanner lamp **does not light** and/or the scan head assembly does not move, replace the Integrated Scanner Assembly (ISA).

Table 6-39 Image scanner assembly part number

Description	Part number
Image scanner assembly (Includes white backing and retention clips.)	J8J64-67901

- If the flatbed scanner lamp **does light** and/or the scan head assembly moves, replace the Automatic Document Feeder (ADF).

Table 6-40 Automatic Document Feeder (ADF) part numbers

Description	Part number
Document feeder kit Enterprise series <i>(Includes white backing and retention clips)</i>	5851-7203
Document feeder kit Workflow series <i>(Includes white backing and retention clips)</i>	5851-7204

For instructions: See the Repair Service Manual for this product.

6. If the error persists, elevate the case using your regional elevation process.
7. If the issue persists after replacing the ISA and ADF parts and elevating the case, replace the Scanner Controller Board (SCB).

Table 6-41 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) Flow series	5851-7347

For instructions: See the Repair Service Manual for this product.

8. If the error persists, replace the formatter.



NOTE: Make sure to order the correct part number for the printer.

Table 6-42 Formatter part number

Description	Part number
Formatter (main logic) PC board	J8J61-60001
For products: M631, M632, M633, E62555, E62565, E62575	
Formatter (main logic) PC board	3GY14-67901
For products: E62655/E62665/E62675	
Kit -Formatter	3GY14-67902
For products: E62655/E62665/E62675 (India/China)	
Formatter	7PS94-67901
For products: M634, M635, M636, M637 (India/China)	
Formatter	7PS94-67902
For products: M634, M635, M636, M637	

For instructions: See the Repair Service Manual for this product.

9. If the error persists, replace the Scanner Controller Board (SCB) formatter HDMI cable.

Table 6-43 SCB formatter HDMI cable part number

Description	Part number
Scanner controller board (SCB) formatter HDMI cable	J8J63-60104

30 . 01 . 46 Scanner Error

Scanner firmware error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer, and then press the power button to turn on the printer.
2. If the error persists, update the firmware to the latest version available at [HP Customer Support - Software and Driver Downloads \(https://support.hp.com/drivers\)](https://support.hp.com/drivers).

For instructions, go to *HP Enterprise, HP Managed - Update the printer firmware*.

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Update the printer firmware to the latest version available at HP Customer Support - Software and Driver Downloads (<https://support.hp.com/drivers>).

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

2. Turn the printer off, and then on.
3. If the error persists, dispatch a service technician with a scanner control board (SCB) to troubleshoot the issue and replace the part, if applicable.



IMPORTANT: Do not send the formatter.

Table 6-44 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) Flow series	5851-7347

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.

Figure 6-123 Gate Closed

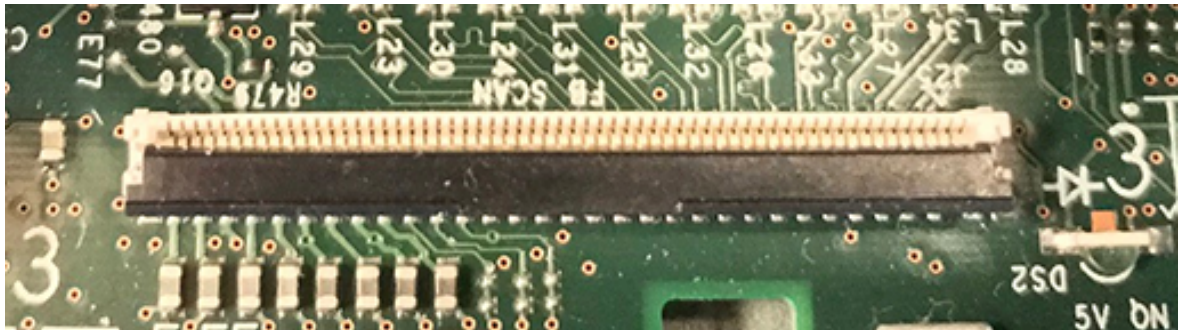


Figure 6-124 Proper insertion


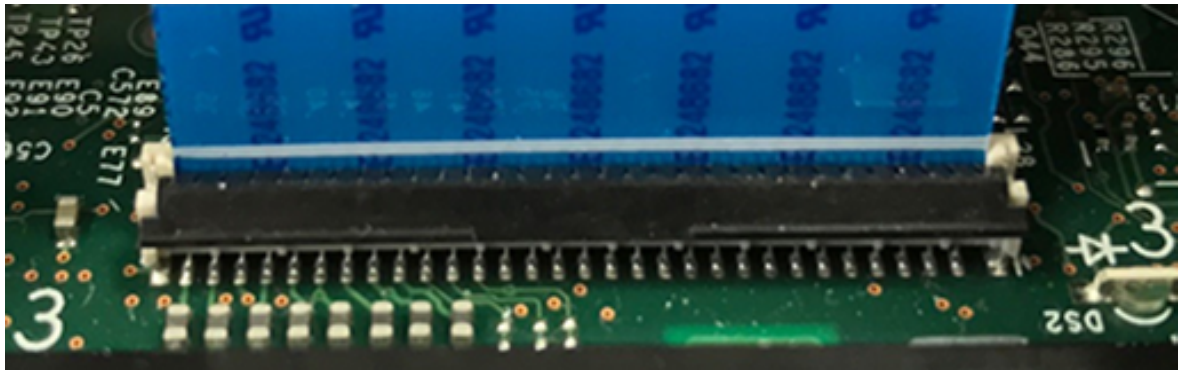


Figure 6-125 Improper insertion

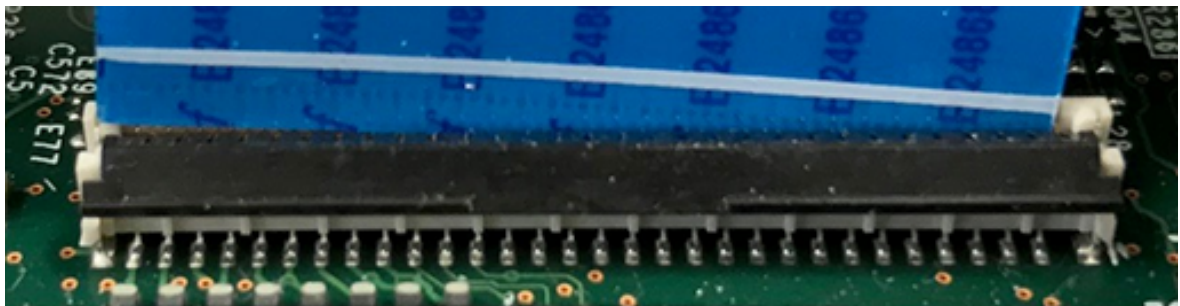

1. Update the printer firmware to the latest version available at HP Customer Support - Software and Driver Downloads (<https://support.hp.com/drivers>).

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

2. Turn the printer off, and then on.

3. If the error persists, turn the printer off.
4. Check and reseat all the cables on the formatter and the SCB for correct connection and seating. The figure below indicates the connector locations.

Figure 6-126 Scanner control board (SCB): Sensor connections

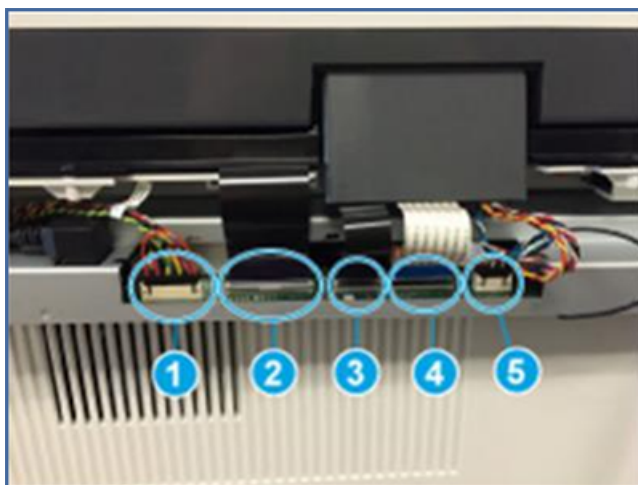


Table 6-45 SCB sensor callout descriptions

Callout	Description
1	Flatbed sensor/motor
2	Flatbed FFC
3	ADF sensor
4	ADF FFC
5	ADF Motor

5. If the error persists, replace the scanner control board (SCB).

Table 6-46 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) Flow series	5851-7347

For instructions: See the Repair Service Manual for this product.

30.01.54

24V SCB power reached an over-current condition and the over-current is persistent after an automatic power cycle. (Event Log Message Only)

This issue typically appears after a 2-sided scan from the ADF, and the control panel might become unresponsive.

For additional troubleshooting steps, go to **WISE** and search for the following document: HP LaserJet Enterprise MFP M631-M633, HP LaserJet Managed MFP E62555-E62575 Non-Flow - Control panel is not responsive and/or a 30.01.41 error (Emerging Issue) (document c06103348).

Recommended action for customers

1. Turn the printer off, and then on.
2. This error message should automatically clear.
3. If the error persists, download FutureSmart firmware 4.7 or later.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. This error message should automatically clear.
3. If the error persists, download FutureSmart firmware 4.7 or later. DO NOT replace any hardware components.

30.01.57

Scanner error detected.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer, and then press the power button to turn on the printer.
2. If the error persists, upgrade the printer firmware.

To download the latest printer firmware version, go to [HP Customer Support - Software and Driver Downloads](#).

For instructions to update the printer firmware, go to *HP Enterprise, HP Managed - Update the printer firmware*.

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer, and then turn on the printer.
2. If the error persists, update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the error persists, replace the scanner control board (SCB).

Table 6-47 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) Flow series	5851-7347

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.

Figure 6-127 Gate Closed

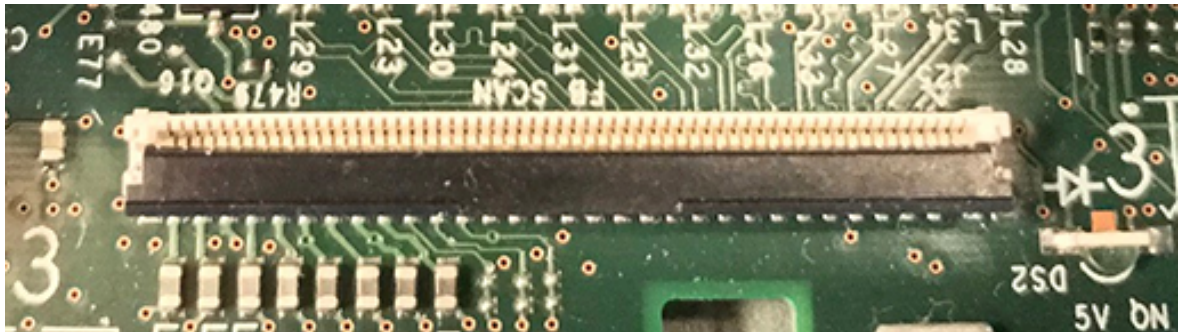


Figure 6-128 Proper insertion


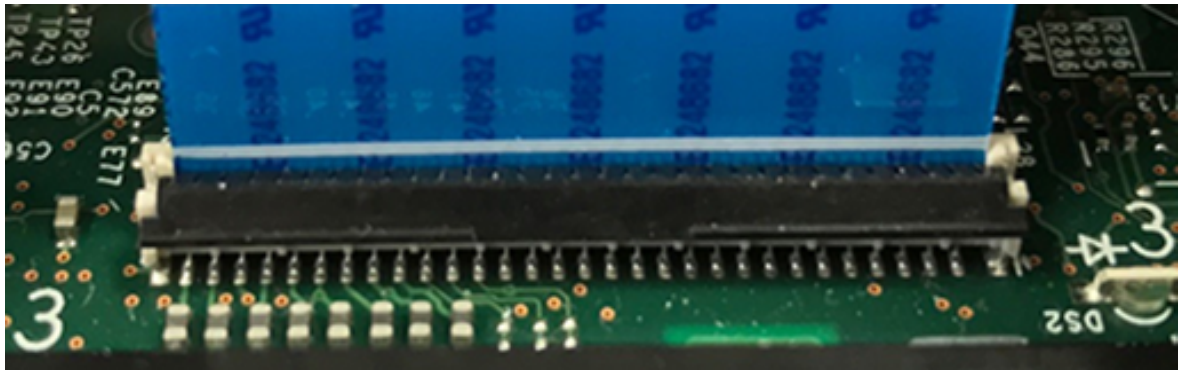


Figure 6-129 Improper insertion

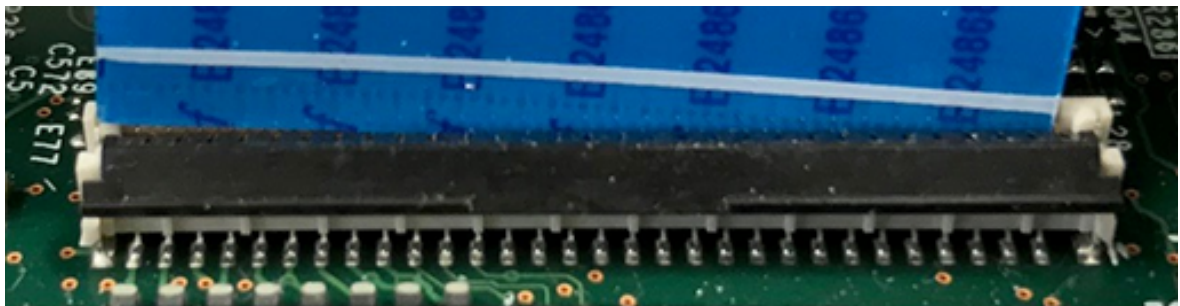

1. Press the power button to turn off the printer, and then turn on the printer.
2. If the error persists, update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the error persists, disconnect and reconnect all the cables on the scanner control board (SCB).

Figure 6-130 Scanner control board (SCB): Sensor connections

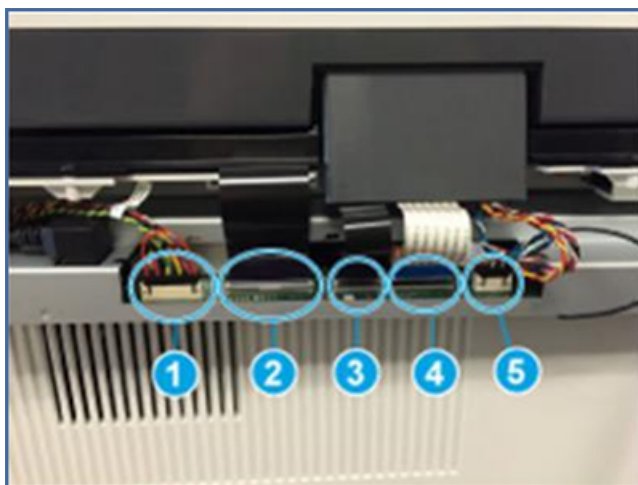


Table 6-48 SCB sensor callout descriptions

Callout	Description
1	Flatbed sensor/motor
2	Flatbed FFC
3	ADF sensor
4	ADF FFC
5	ADF Motor

4. If the error persists, replace the scanner control board (SCB).

Table 6-49 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) Flow series	5851-7347

For instructions: See the Repair Service Manual for this product.

30.03.14

A non-fatal error has occurred.

A scanner EEPROM (NVM) error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. This is an informational message, and no action should be required.
2. If the error persists, turn the printer off, and then on to let the scanner initialize.

30.03.20

Front side scanner not detected.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the error persists, replace the image scanner assembly.

Table 6-50 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips.</i>)	J8J64-67901

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.

Figure 6-131 Gate Closed



Figure 6-132 Proper insertion



2. If the issue persists, disconnect and reconnect the cable connections on the scanner board (SCB), including the flat flexible cables (FFC), and then test for functionality.

Figure 6-134 SCB cables and the HDMI cable




Table 6-51 SCB cables and the HDMI cable callout descriptions

Callout	Description
1	Power cable
2	HDMI (Formatter/SCB communication)
3	Flatbed sensor/motor
4	Flatbed FFC
5	ADF sensor/motor
6	ADF FFC
7	ADF Motor

3. If the issue persists, run the [Continuous Scan](#) diagnostic test to test the functionality of the scan optics.
- a. From the Home screen on the control panel, scroll to and touch [Support Tools](#).
-  **NOTE:** The control panel menu options might vary depending on the printer model and firmware version installed.
- b. Open the following menus: **Troubleshooting > Diagnostic Tests**.
- c. Select [Continuous Scan](#).

- d. Select [Start](#) to run the test.

Figure 6-135 Start the Continuous Scan test

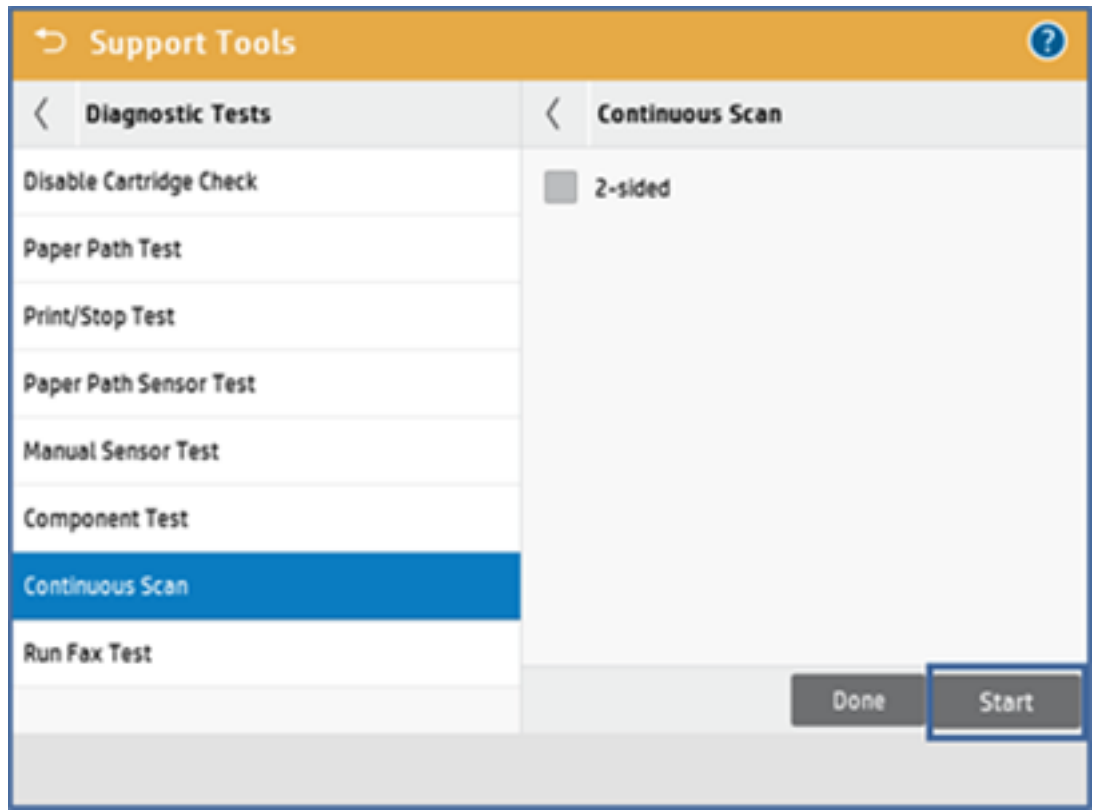

- e. Check if the scan head moves from the home position through the scan, and back to the home position.



NOTE: The scan head should actuate, moving from the home position through a scan, and back to the home position. This process will repeat until interrupted.

4. If the scan head does not actuate or operate correctly, replace the image scanner assembly (ISA).

Table 6-52 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips.</i>)	J8J64-67901

For instructions: See the Repair Service Manual for this product.

5. If the issue persists, elevate the issue using your country/region support process.

30 . 03 . 22 Scanner failure

Front side illumination calibration failure.

The scan module cannot see the illumination module, or marginal illumination.

The optical assembly may not be parked under the calibration strip.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, open the scanner lid, clean the scanner glass, document feeder strips, and white plastic backing.

For instructions, view the following video: [Cleaning the scanner glass and white backing](#).

3. If the issue persists, update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, open the scanner lid, clean the scanner glass, document feeder strips, and white plastic backing.

For instructions, view the following video: [Cleaning the scanner glass and white backing](#).

3. Upgrade the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

4. Check the event log for other scanner errors. If the errors are present, resolve those errors.
5. If the issue persists, replace the image scanner assembly.

Table 6-53 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips.</i>)	J8J64-67901

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.


Figure 6-136 Gate Closed



Figure 6-137 Proper insertion



Figure 6-138 Improper insertion

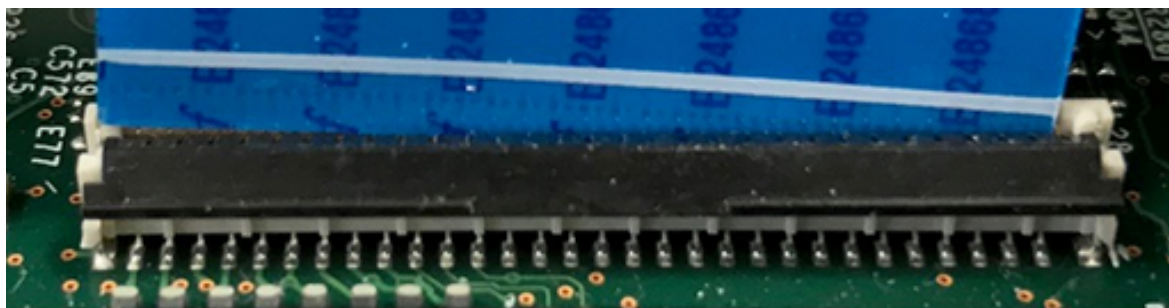

3. If the issue persists, update the printer firmware.
For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).
4. Check the event log for other scanner errors. If the errors are present, resolve those errors.
5. If the issue persists, disconnect and reconnect the cable connections on the scanner board (SCB), including the flat flexible cables (FFC), and then test for functionality.

Figure 6-139 SCB cables and the HDMI cable



Table 6-54 SCB cables and the HDMI cable callout descriptions


Callout	Description
1	Power cable
2	HDMI (Formatter/SCB communication)
3	Flatbed sensor/motor
4	Flatbed FFC
5	ADF sensor/motor
6	ADF FFC
7	ADF Motor

6. If the issue persists, run the [Continuous Scan](#) diagnostic test to test the functionality of the scan optics.
 - a. From the Home screen on the control panel, scroll to and touch [Support Tools](#).

 **NOTE:** The control panel menu options might vary depending on the printer model and firmware version installed.
 - b. Open the following menus: **Troubleshooting > Diagnostic Tests**.

- c. Select [Continuous Scan](#).
- d. Select [Start](#) to run the test.

Figure 6-140 Start the Continuous Scan test

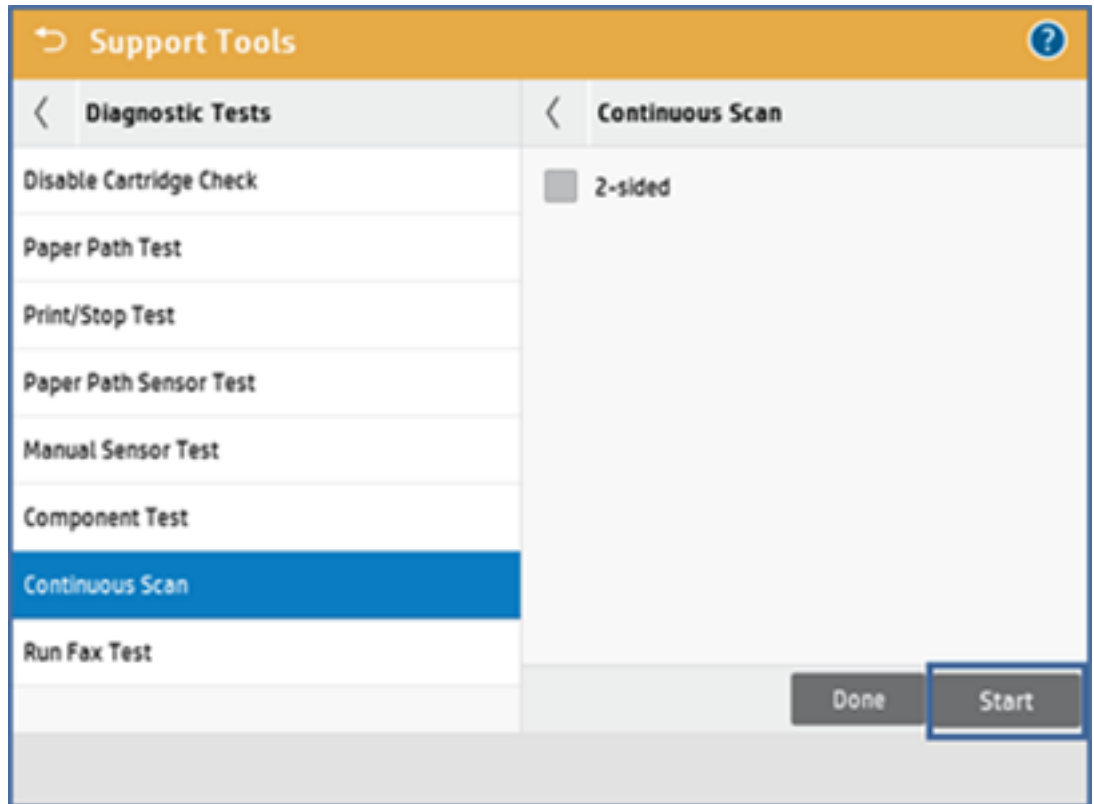

- e. Check if the scan head moves from the home position through the scan, and back to the home position.



NOTE: The scan head should actuate, moving from the home position through a scan, and back to the home position. This process will repeat until interrupted.

- 7. If the scan head does not actuate or operate correctly, replace the image scanner assembly (ISA).

Table 6-55 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips.</i>)	J8J64-67901

For instructions: See the Repair Service Manual for this product.

- 8. If the issue persists, elevate the issue using your country/region support process.

30 . 03 . 23 Scanner failure

Calibration error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

3. Check the event log for other scanner errors. If the errors are present, resolve those errors.
4. If the issue persists, replace the image scanner assembly.

Table 6-56 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips.</i>)	J8J64-67901

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.

Figure 6-141 Gate Closed

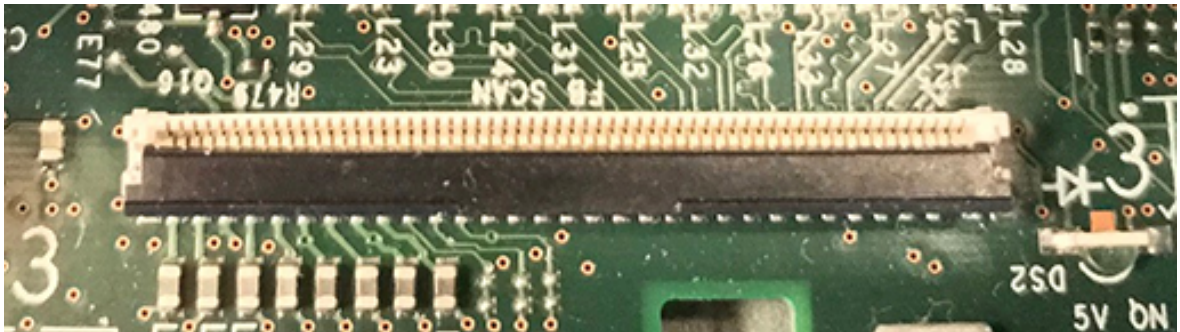


Figure 6-142 Proper insertion


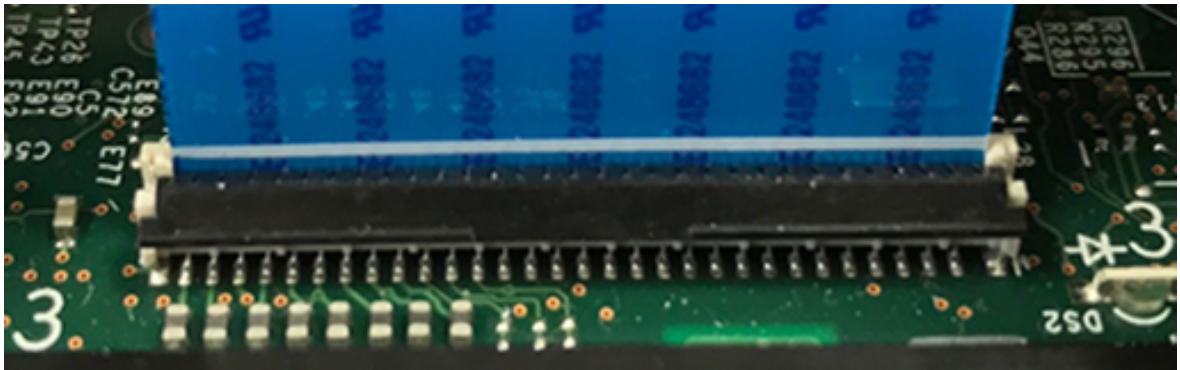


Figure 6-143 Improper insertion

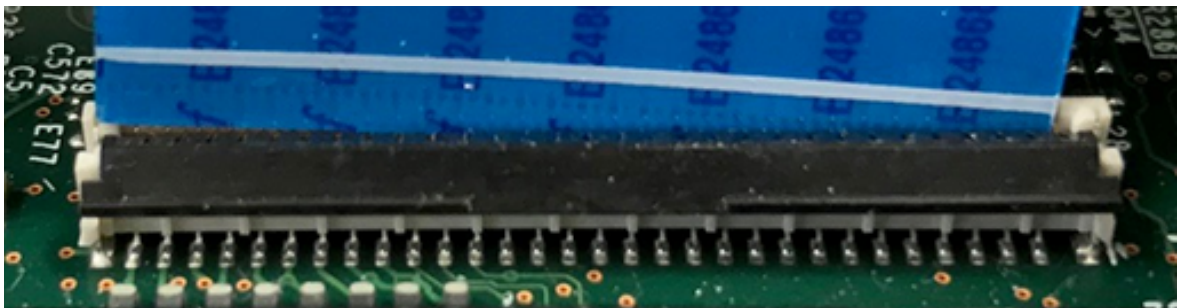

4. If the issue persists, disconnect and reconnect the cable connections on the scanner board (SCB), including the flat flexible cables (FFC), and then test for functionality.

Figure 6-144 SCB cables and the HDMI cable




Table 6-57 SCB cables and the HDMI cable callout descriptions

Callout	Description
1	Power cable
2	HDMI (Formatter/SCB communication)
3	Flatbed sensor/motor
4	Flatbed FFC
5	ADF sensor/motor
6	ADF FFC
7	ADF Motor

5. If the issue persists, run the [Continuous Scan](#) diagnostic test to test the functionality of the scan optics.
- a. From the Home screen on the control panel, scroll to and touch [Support Tools](#).
-  **NOTE:** The control panel menu options might vary depending on the printer model and firmware version installed.
- b. Open the following menus: **Troubleshooting > Diagnostic Tests**.
- c. Select [Continuous Scan](#).

- d. Select **Start** to run the test.

Figure 6-145 Start the Continuous Scan test

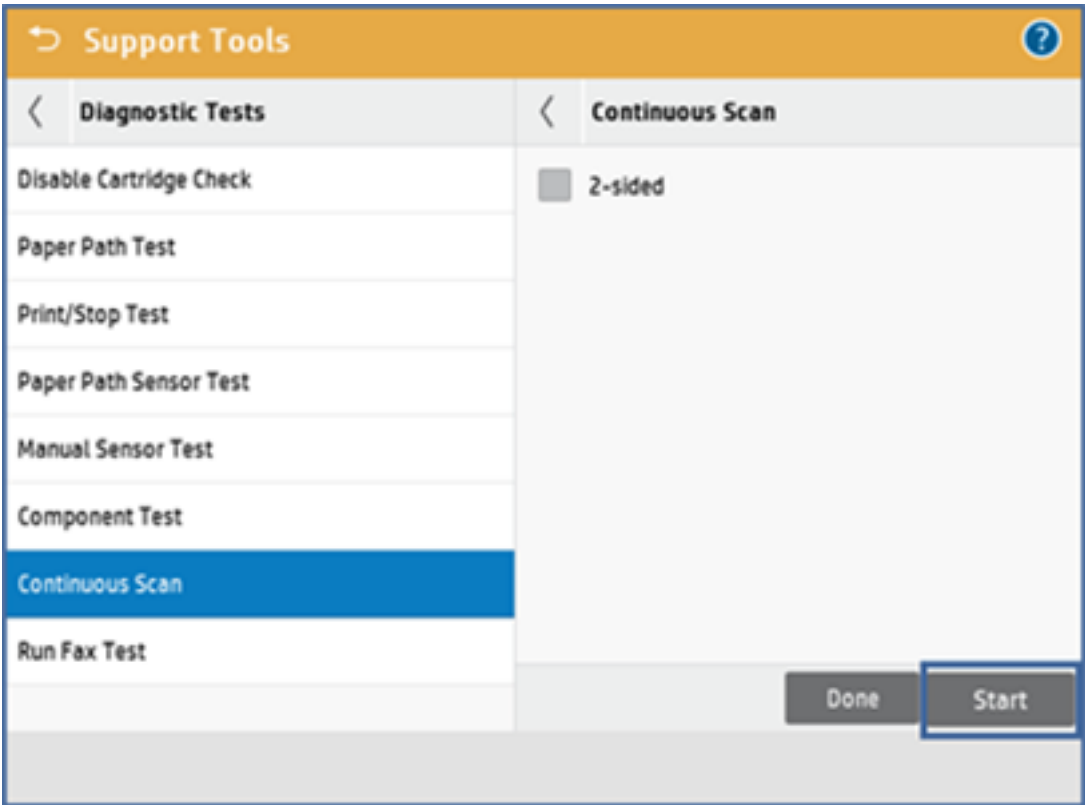

- e. Check if the scan head moves from the home position through the scan, and back to the home position.

 **NOTE:** The scan head should actuate, moving from the home position through a scan, and back to the home position. This process will repeat until interrupted.

6. If the scan head does not actuate or operate correctly, replace the image scanner assembly (ISA).

Table 6-58 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips.</i>)	J8J64-67901

For instructions: See the Repair Service Manual for this product.

7. If the issue persists, elevate the issue using your country/region support process.

30 . 03 . 30 Scanner Failure

Flatbed motor shutdown.

The SCB cannot communicate with the flatbed scanner motor.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, replace the image scanner assembly.

Table 6-59 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips.</i>)	J8J64-67901

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

 **NOTE:** When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.

Figure 6-146 Gate Closed



2. If the issue persists, disconnect and reconnect the cable connections on the scanner board (SCB), including the flat flexible cables (FFC), and then test for functionality.

Figure 6-149 SCB cables and the HDMI cable




Table 6-60 SCB cables and the HDMI cable callout descriptions

Callout	Description
1	Power cable
2	HDMI (Formatter/SCB communication)
3	Flatbed sensor/motor
4	Flatbed FFC
5	ADF sensor/motor
6	ADF FFC
7	ADF Motor

3. If the issue persists, run the [Continuous Scan](#) diagnostic test to test the functionality of the scan optics.
- a. From the Home screen on the control panel, scroll to and touch [Support Tools](#).
-
-  **NOTE:** The control panel menu options might vary depending on the printer model and firmware version installed.
-
- b. Open the following menus: **Troubleshooting > Diagnostic Tests**.
- c. Select [Continuous Scan](#).

- d. Select [Start](#) to run the test.

Figure 6-150 Start the Continuous Scan test

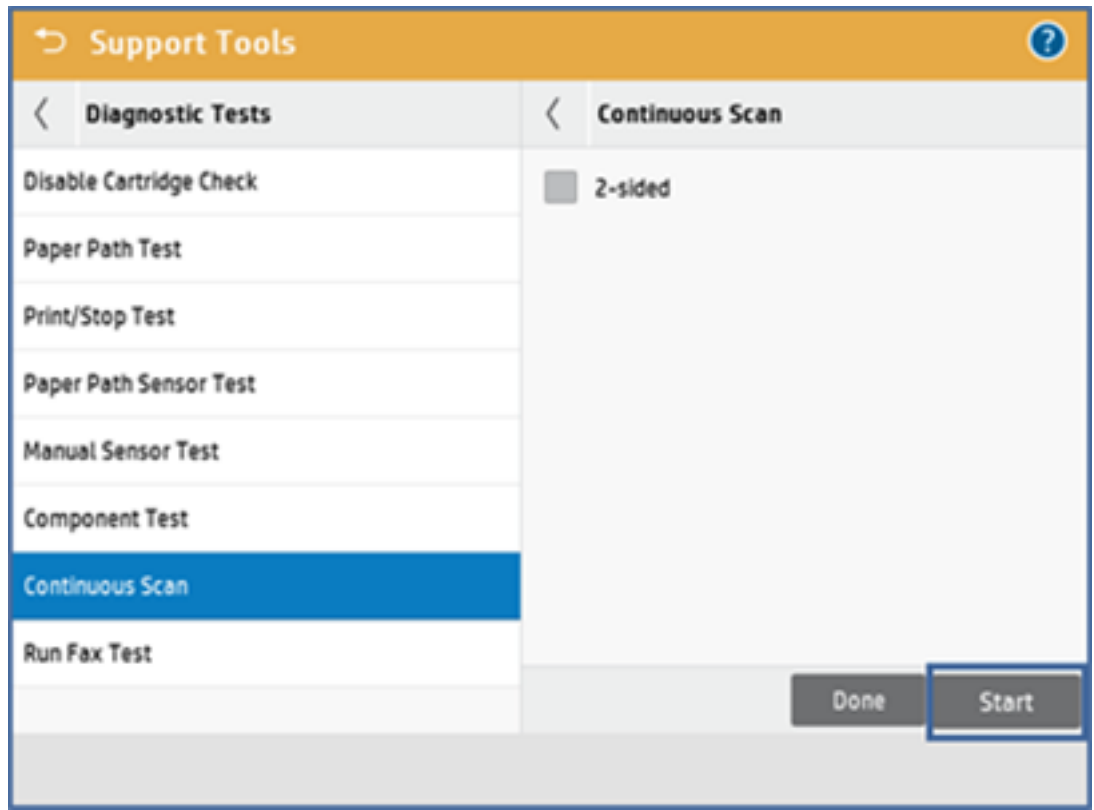

- e. Check if the scan head moves from the home position through the scan, and back to the home position.



NOTE: The scan head should actuate, moving from the home position through a scan, and back to the home position. This process will repeat until interrupted.

4. If the scan head does not actuate or operate correctly, replace the image scanner assembly (ISA).

Table 6-61 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips.</i>)	J8J64-67901

For instructions: See the Repair Service Manual for this product.

5. If the issue persists, elevate the issue using your country/region support process.

30 . 03 . 45 Scanner Error To continue turn off then on

SCB firmware assertion failure. SCB firmware assertion controls the scan head motor.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, update the printer firmware.
For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, update the printer firmware.
For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).
3. Check the event log for other scanner errors. If the errors are present, resolve those errors.
4. If the issue persists, replace the image scanner assembly.

Table 6-62 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips.</i>)	J8J64-67901

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.


Figure 6-151 Gate Closed



Figure 6-152 Proper insertion



Figure 6-153 Improper insertion

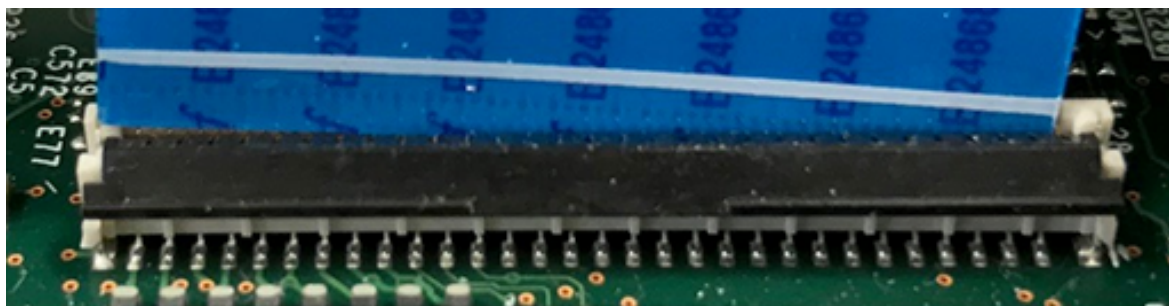

1. Turn the printer off, and then on.
2. If the issue persists, update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

3. Check the event log for other scanner errors. If the errors are present, resolve those errors.

4. If the issue persists, disconnect and reconnect the cable connections on the scanner board (SCB), including the flat flexible cables (FFC), and then test for functionality.

Figure 6-154 SCB cables and the HDMI cable




Table 6-63 SCB cables and the HDMI cable callout descriptions

Callout	Description
1	Power cable
2	HDMI (Formatter/SCB communication)
3	Flatbed sensor/motor
4	Flatbed FFC
5	ADF sensor/motor
6	ADF FFC
7	ADF Motor

5. If the issue persists, run the [Continuous Scan](#) diagnostic test to test the functionality of the scan optics.
- a. From the Home screen on the control panel, scroll to and touch [Support Tools](#).
-  **NOTE:** The control panel menu options might vary depending on the printer model and firmware version installed.
- b. Open the following menus: **Troubleshooting > Diagnostic Tests**.
- c. Select [Continuous Scan](#).

- d. Select **Start** to run the test.

Figure 6-155 Start the Continuous Scan test

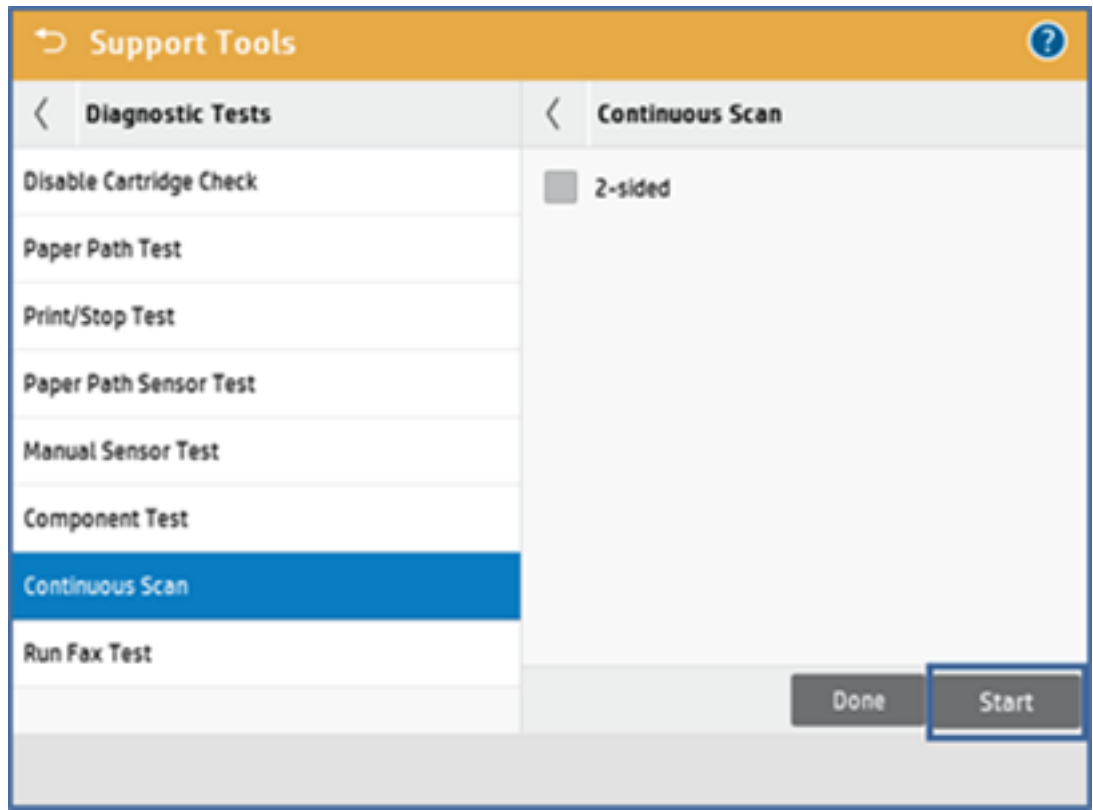

- e. Check if the scan head moves from the home position through the scan, and back to the home position.



NOTE: The scan head should actuate, moving from the home position through a scan, and back to the home position. This process will repeat until interrupted.

6. If the scan head does not actuate or operate correctly, replace the image scanner assembly (ISA).

Table 6-64 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips.</i>)	J8J64-67901

For instructions: See the Repair Service Manual for this product.

7. If the issue persists, elevate the issue using your country/region support process.

30 . 04 . 01 Flatbed Sensor Cable Not Detected

The flatbed sensor cable is not attached or did not sync with scanner controller board FW at power up. Cables are only accessible to a service technician.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer, and then press the power button to turn on the printer.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, replace the image scanner assembly (ISA).

Table 6-65 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips.</i>)	J8J64-67901

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.


Figure 6-156 Gate Closed



Figure 6-157 Proper insertion



Figure 6-158 Improper insertion

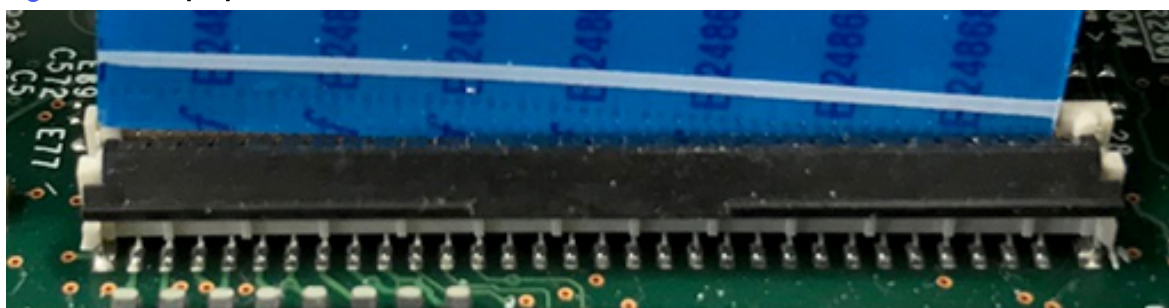

3. Disconnect and reconnect the cable on the scanner control board (SCB) labeled MOT/SNS (Callout 1: Flatbed sensor cable). Reboot and test for functionality.

Figure 6-159 Scanner control board (SCB): Sensor connections

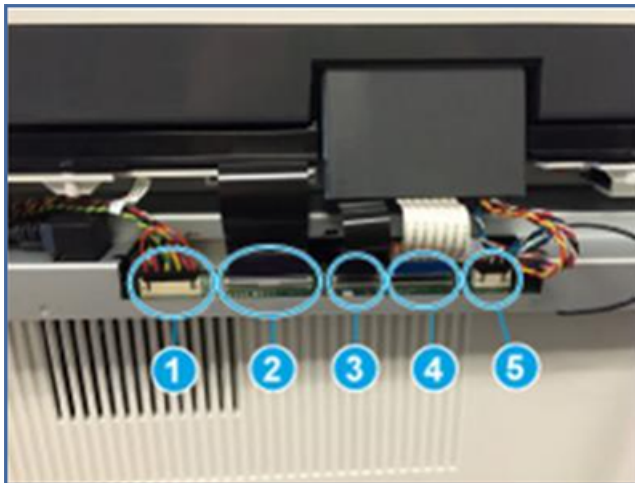


Table 6-66 SCB sensor callout descriptions

Callout	Description
1	Flatbed sensor/motor
2	Flatbed FFC
3	ADF sensor
4	ADF FFC
5	ADF Motor

4. If the error persists, replace the image scanner assembly (ISA).

Table 6-67 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips.</i>)	J8J64-67901

For instructions: See the Repair Service Manual for this product.

5. If the error persists, replace the scanner control board (SCB).

Table 6-68 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) Flow series	5851-7347

For instructions: See the Repair Service Manual for this product.

30 . 04 . 02 Flatbed FFC Cable Not Detected

The flatbed FFC cable is not attached or did not sync with scanner controller board FW at power up. Cables are only accessible to a service technician.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, replace the image scanner assembly.

Table 6-69 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips.</i>)	J8J64-67901

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.

Figure 6-160 Gate Closed

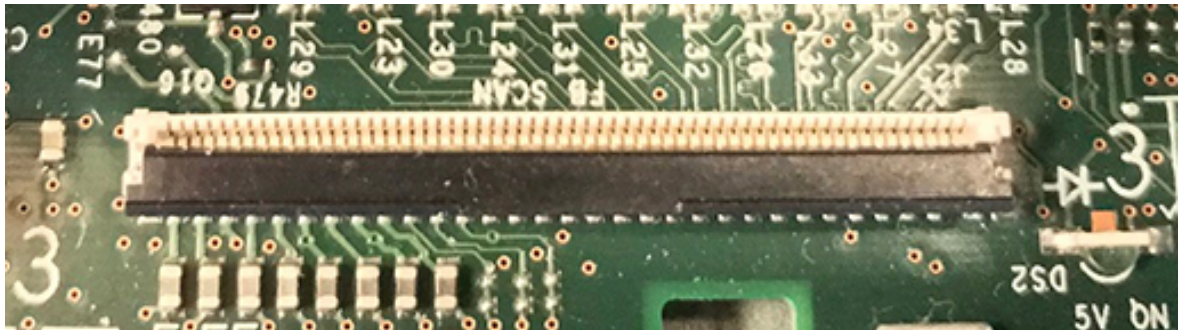


Figure 6-161 Proper Insertion


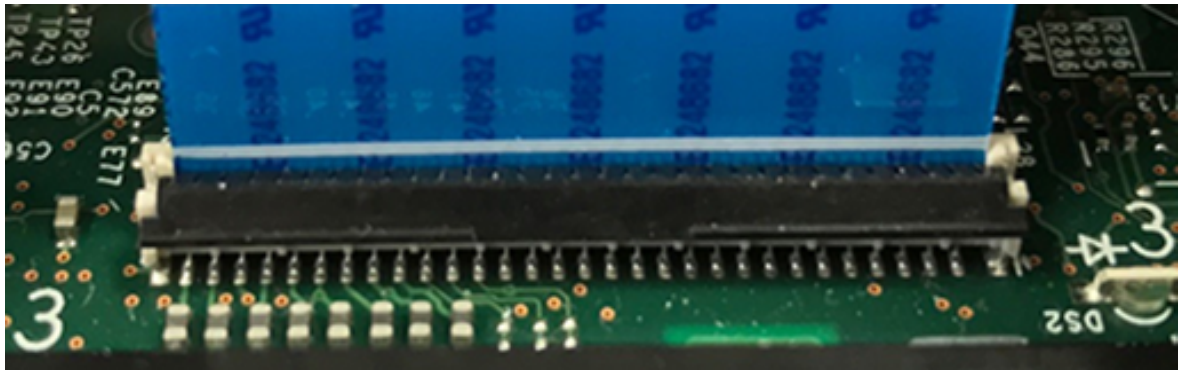


Figure 6-162 Improper Insertion

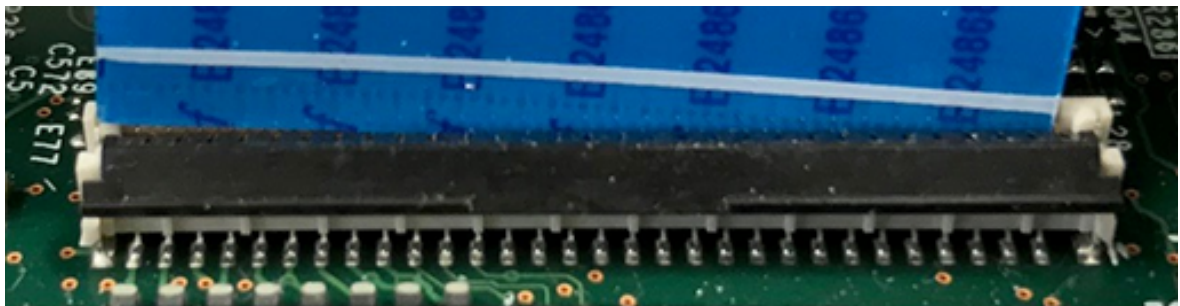

1. Use the power button to turn off the printer, and then to turn on the printer.

2. If the issue persists, disconnect and reconnect the cable connections on the scanner board (SCB), including the flat flexible cables (FFC), and then test for functionality.

Figure 6-163 SCB cables and the HDMI cable



Table 6-70 SCB cables and the HDMI cable callout descriptions


Callout	Description
1	Power cable
2	HDMI (Formatter/SCB communication)
3	Flatbed sensor/motor
4	Flatbed FFC
5	ADF sensor/motor
6	ADF FFC
7	ADF Motor

3. If the issue persists, run the [Continuous Scan](#) diagnostic test to test the functionality of the scan optics.
 - a. From the Home screen on the control panel, scroll to and touch [Support Tools](#).

 **NOTE:** The control panel menu options might vary depending on the printer model and firmware version installed.
 - b. Open the following menus: **Troubleshooting > Diagnostic Tests**.
 - c. Select [Continuous Scan](#).

- d. Select **Start** to run the test.

Figure 6-164 Start the Continuous Scan test

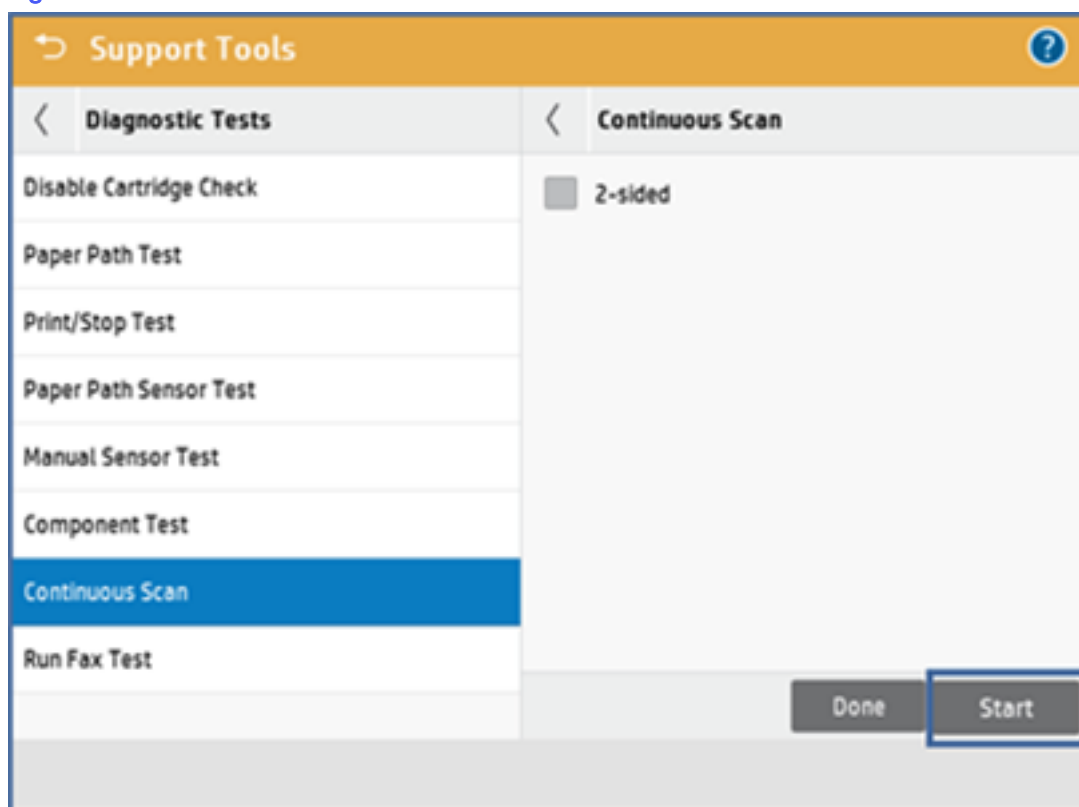

- e. Check if the scan head moves from the home position through the scan, and back to the home position.



NOTE: The scan head should actuate, moving from the home position through a scan, and back to the home position. This process will repeat until interrupted.

4. If the scan head does not actuate or operate correctly, replace the image scanner assembly (ISA).

Table 6-71 Image scanner assembly part number

Description	Part number
Image scanner assembly (<i>Includes white backing and retention clips.</i>)	J8J64-67901

For instructions: See the Repair Service Manual for this product.

5. If the issue persists, elevate the issue using your country/region support process.

30 . 04 . 03 ADF FFC Cable Disconnected

The automatic document feeder FFC cable is not attached or did not sync with scanner controller board FW at power up. Cables are not accessible to the user.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer, and then press the power button to turn on the printer.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Dispatch a technician onsite to perform the following tasks:
 - a. Instruct the onsite service personnel to disconnect and reconnect the ADF FFC on the scanner control board (SCB) labeled 'ADF SCAN'(Callout 4: ADF FFC).

Figure 6-165 Scanner control board (SCB): Sensor connections

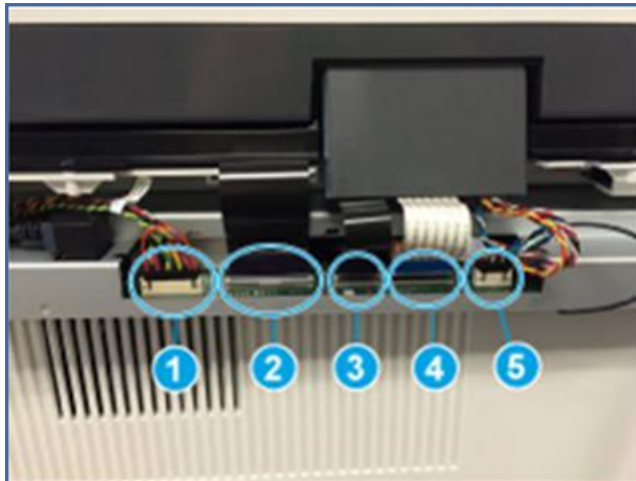


Table 6-72 SCB sensor callout descriptions

Callout	Description
1	Flatbed sensor/motor
2	Flatbed FFC
3	ADF sensor
4	ADF FFC
5	ADF Motor

- b. Ensure that the automatic document feeder FFC cable (Callout 4) is connected correctly. Reboot and test for functionality.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

 **NOTE:** When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.

Figure 6-166 Gate Closed

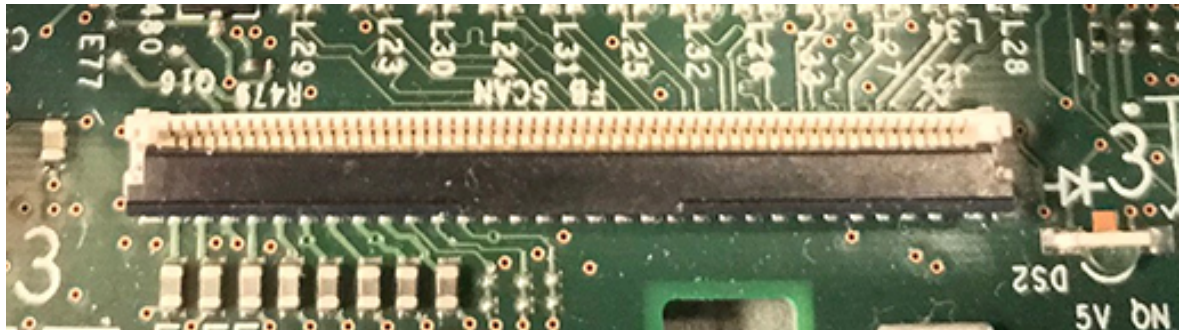


Figure 6-167 Proper insertion


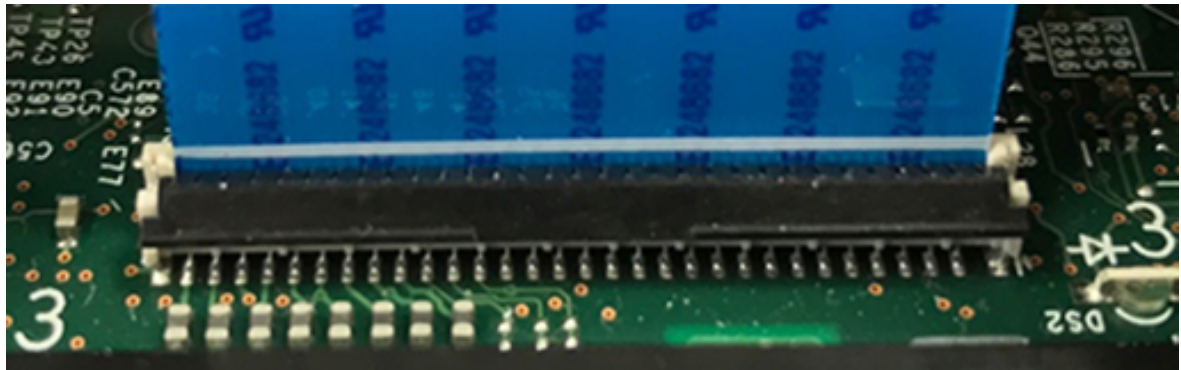


Figure 6-168 Improper insertion

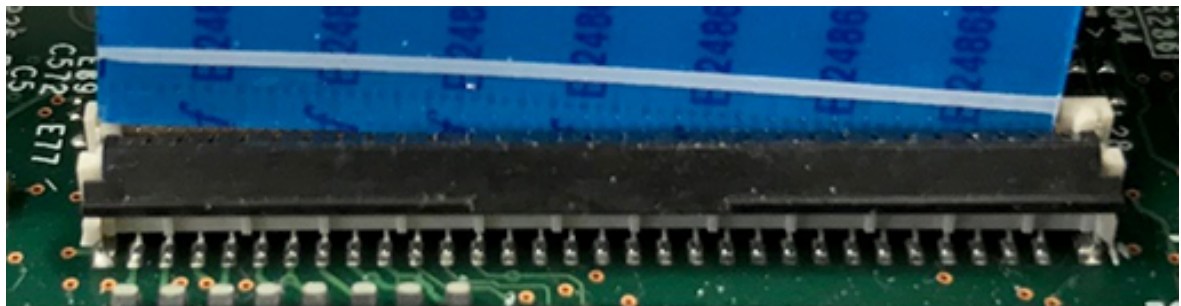

1. Turn the printer off, and then on.

2. If the error persists, disconnect and reconnect the ADF FFC on the scanner control board (SCB) labeled 'ADF SCAN'(Callout 4: ADF FFC), and then test for functionality.

Figure 6-169 Scanner control board (SCB): Sensor connections

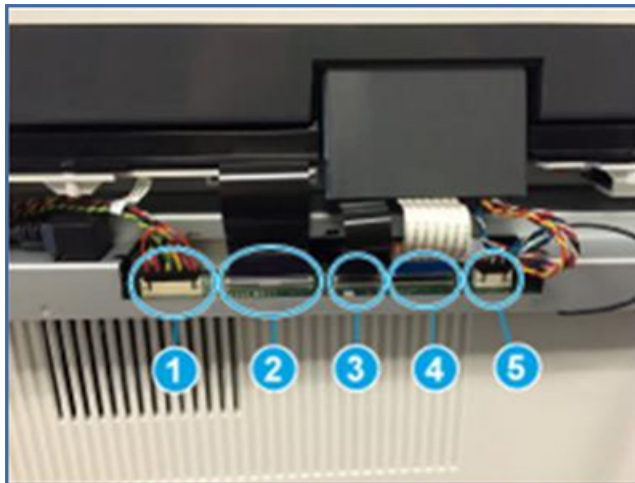


Table 6-73 SCB sensor callout descriptions

Callout	Description
1	Flatbed sensor/motor
2	Flatbed FFC
3	ADF sensor
4	ADF FFC
5	ADF Motor

3. If the error persists, replace the automatic document feeder (ADF).

Table 6-74 Automatic Document Feeder (ADF) part numbers

Description	Part number
Document feeder kit Enterprise series (<i>Includes white backing and retention clips</i>)	5851-7203
Document feeder kit Workflow series (<i>Includes white backing and retention clips</i>)	5851-7204

For instructions: See the Repair Service Manual for this product.

4. If the error persists, replace the scanner control board (SCB).

Table 6-75 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) Flow series	5851-7347

For instructions: See the Repair Service Manual for this product.

5. If the error persists, elevate the issue using the Standard Support Process.

30 . 04 . 04 ADF Motor Cable Disconnected

The automatic document motor cable is not attached or did not sync with scanner controller board FW at power up. Cables are not accessible to the user.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer, and then press the power button to turn on the printer.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Dispatch a technician onsite to perform the following tasks:
 - a. Instruct the onsite service personnel to disconnect and reconnect the ADF Motor cable (TP102, see Callout 5: ADF Motor) on the scanner control board (SCB).

Figure 6-170 Scanner control board (SCB): Sensor connections

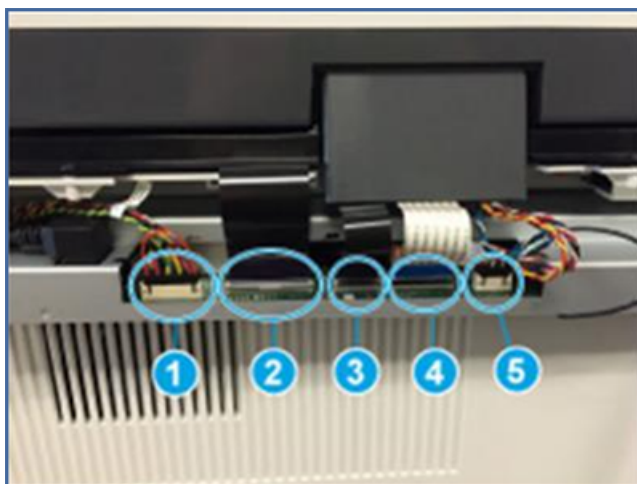


Table 6-76 SCB sensor callout descriptions

Callout	Description
1	Flatbed sensor/motor
2	Flatbed FFC
3	ADF sensor
4	ADF FFC

Table 6-76 SCB sensor callout descriptions (continued)

Callout	Description
5	ADF Motor

- b.** Ensure that the automatic document feeder motor cable (Callout 5) is connected correctly. Reboot and test for functionality.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

 **NOTE:** When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.

Figure 6-171 Gate Closed

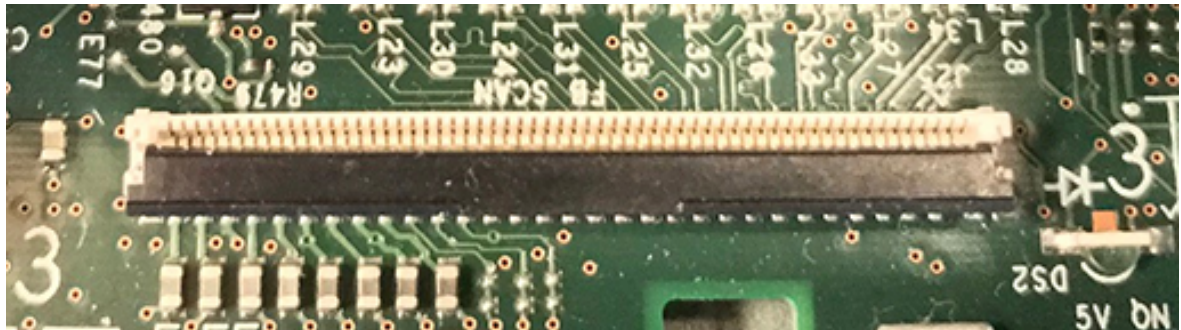


Figure 6-172 Proper insertion


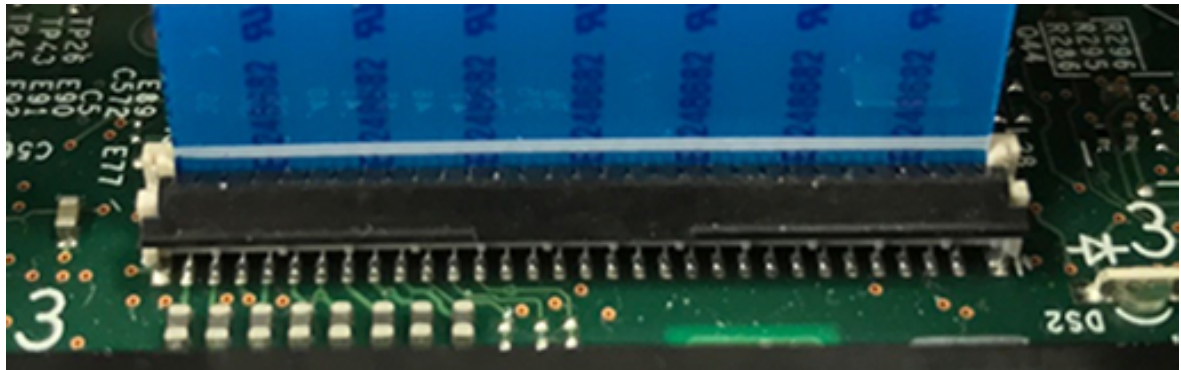


Figure 6-173 Improper insertion

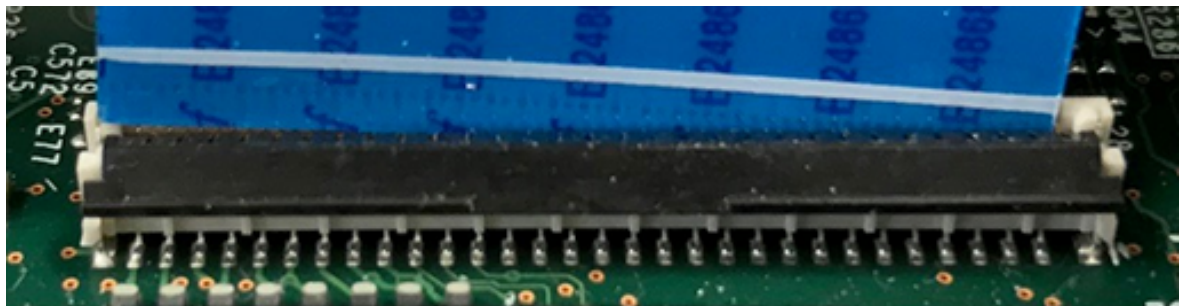

1. Turn the printer off, and then on.

2. If the error persists, disconnect and reconnect the ADF Motor cable (TP102) on the scanner control board (SCB) (see Callout 5: ADF Motor), and then test for functionality.

Figure 6-174 Scanner control board (SCB): Sensor connections

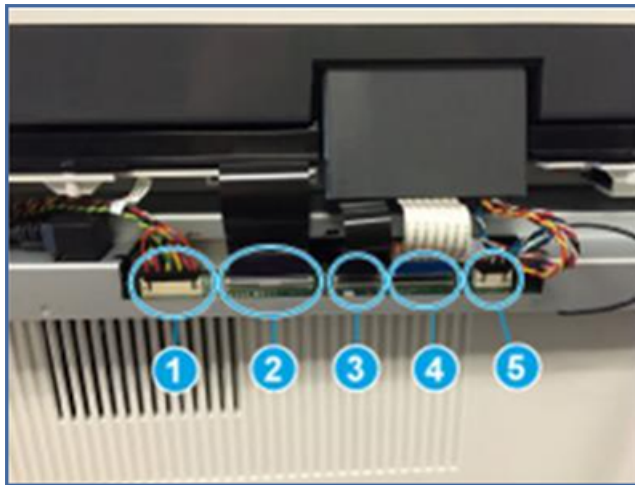


Table 6-77 SCB sensor callout descriptions

Callout	Description
1	Flatbed sensor/motor
2	Flatbed FFC
3	ADF sensor
4	ADF FFC
5	ADF Motor

3. If the error persists, replace the automatic document feeder (ADF).

Table 6-78 Automatic Document Feeder (ADF) part numbers

Description	Part number
Document feeder kit Enterprise series (Includes white backing and retention clips)	5851-7203
Document feeder kit Workflow series (Includes white backing and retention clips)	5851-7204

For instructions: See the Repair Service Manual for this product.

4. If the error persists, replace the scanner control board (SCB).

Table 6-79 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) Flow series	5851-7347

For instructions: See the Repair Service Manual for this product.

5. If the error persists, elevate the issue using the Standard Support Process.

30 . 04 . 05 ADF Sensor Cable Disconnected

The document feeder sensor cable is not attached or did not sync with scanner controller board FW at power up. Cables are not accessible to the user.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer, and then press the power button to turn on the printer.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Dispatch a technician onsite to perform the following tasks:
 - a. Instruct the onsite service personnel to disconnect and reconnect the document feeder sensor cable (ADF SNS, see Callout 3: ADF Sensor) on the scanner control board (SCB).

Figure 6-175 Scanner control board (SCB): Sensor connections

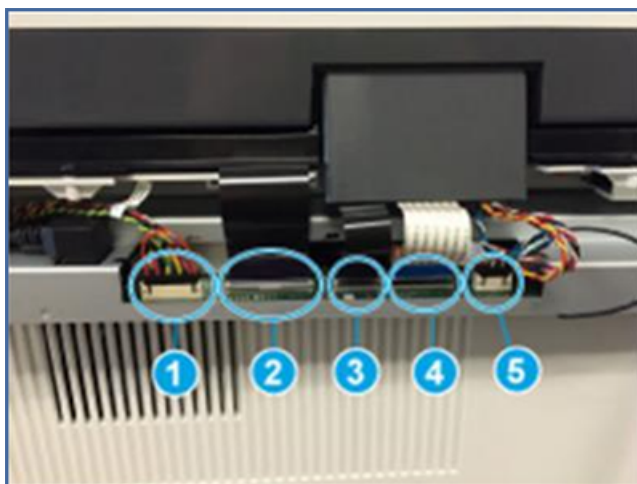


Table 6-80 SCB sensor callout descriptions

Callout	Description
1	Flatbed sensor/motor
2	Flatbed FFC
3	ADF sensor
4	ADF FFC

Table 6-80 SCB sensor callout descriptions (continued)

Callout	Description
5	ADF Motor

- b. Ensure that the automatic document feeder sensor cable (Callout 3) is connected correctly. Reboot and test for functionality.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.

Figure 6-176 Gate Closed

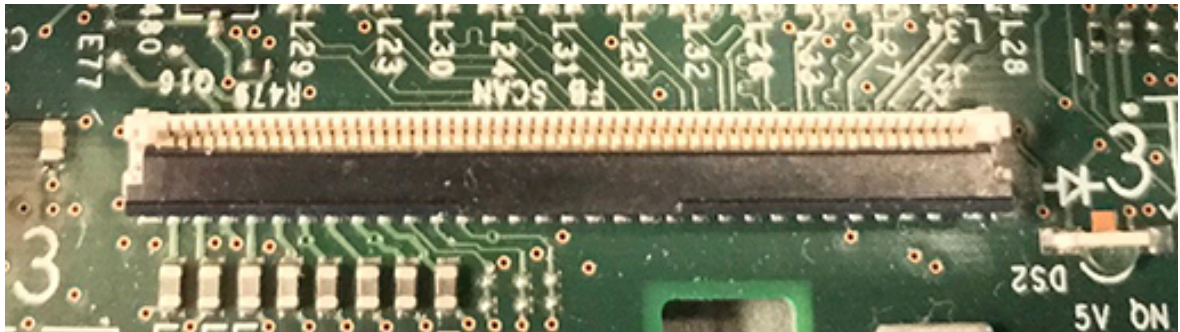


Figure 6-177 Proper insertion


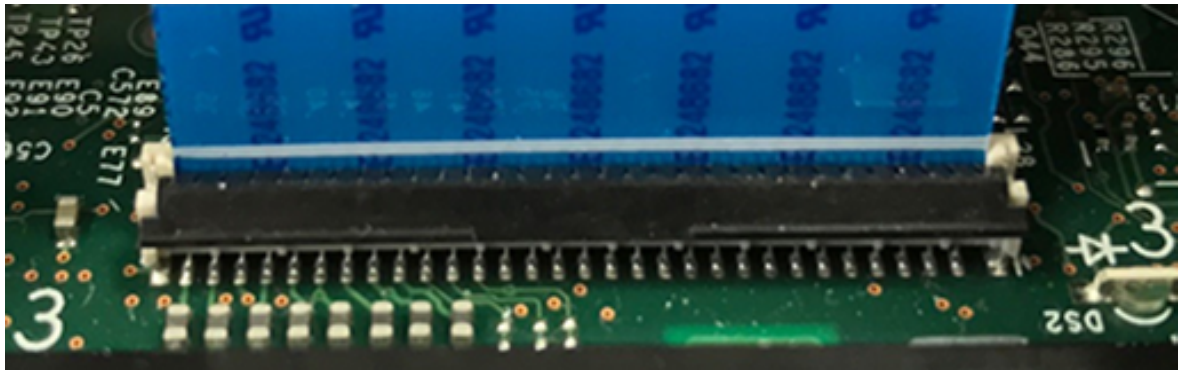


Figure 6-178 Improper insertion

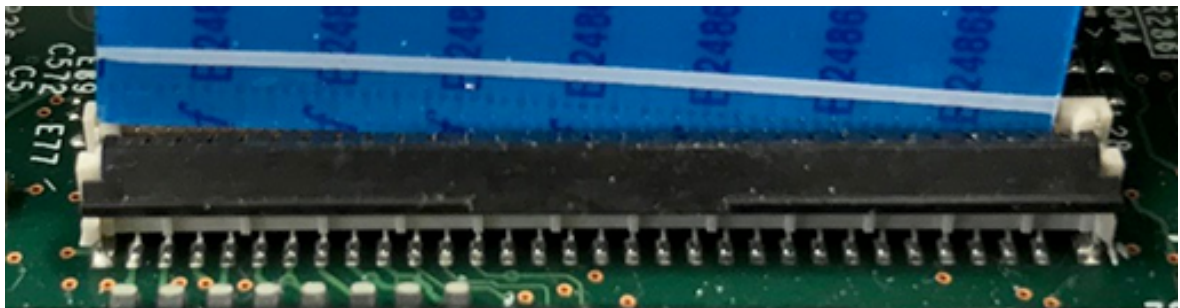

1. Turn the printer off, and then on.

2. If the error persists, disconnect and reconnect the document feeder sensor cable (ADF SNS) on the scanner control board (SCB) (Callout 3: ADF sensor), and then test for functionality.

Figure 6-179 Scanner control board (SCB): Sensor connections

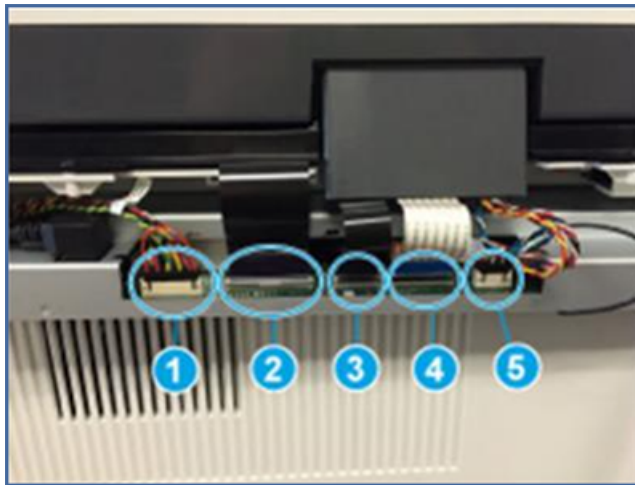


Table 6-81 SCB sensor callout descriptions

Callout	Description
1	Flatbed sensor/motor
2	Flatbed FFC
3	ADF sensor
4	ADF FFC
5	ADF Motor

3. If the error persists, replace the automatic document feeder (ADF).

Table 6-82 Automatic Document Feeder (ADF) part numbers

Description	Part number
Document feeder kit Enterprise series (<i>Includes white backing and retention clips</i>)	5851-7203
Document feeder kit Workflow series (<i>Includes white backing and retention clips</i>)	5851-7204

For instructions: See the Repair Service Manual for this product.

4. If the error persists, replace the scanner control board (SCB).

Table 6-83 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) Flow series	5851-7347

For instructions: See the Repair Service Manual for this product.

5. If the error persists, elevate the issue using the Standard Support Process.

31.WX.YZ error messages

31.* errors

Errors in the 31.* family are related to the document feeder.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Verify the document feeder top cover is completely closed when feeding pages through it.
2. Verify the document feeder input tray is not overloaded and that the guides are adjusted correctly.
3. Open the document feeder top cover and check the rollers. Clean or replace them if necessary.
4. Clean the scanner glass and all the calibration strips.
5. Calibrate the scanner. Open these menus: [Device Maintenance > Calibrate-Cleaning > Calibrate Scanner](#).
6. Clean the scanner glass and glass strips, and clean the white strips used for calibration.
7. Perform the tests for scanner diagnostics. Open these menus: [Administration > Troubleshooting > Diagnostic Tests > Scanner Tests](#). Look for tests related to the document feeder, such as the [Jam Cover Sensor](#) test.
8. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)
9. Check all connections from the document feeder to the scanner control board, and reseal them if necessary.
10. If the error persists, replace the document feeder assembly.

31 . 01 . 47 Document feeder not detected

The document feeder was not detected, or the document feeder might not be connected. The flatbed glass is still available for scanning.

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, please contact HP customer support.

Recommended action for call-center agents and onsite technicians



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.

Figure 6-180 Gate Closed

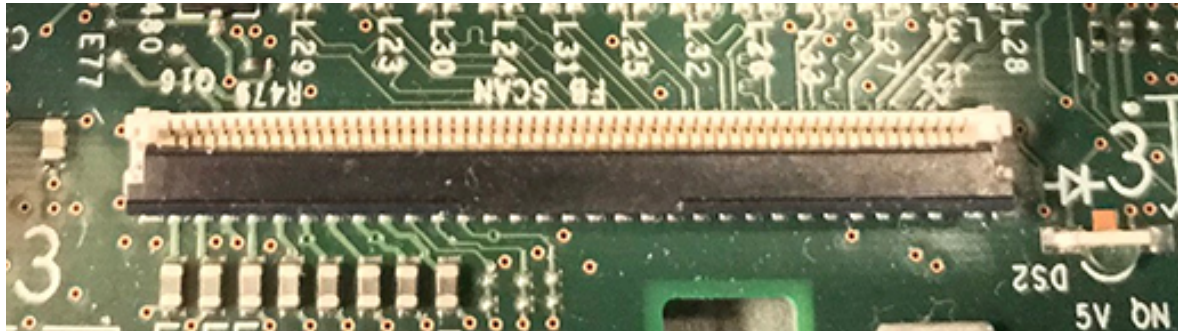


Figure 6-181 Proper insertion


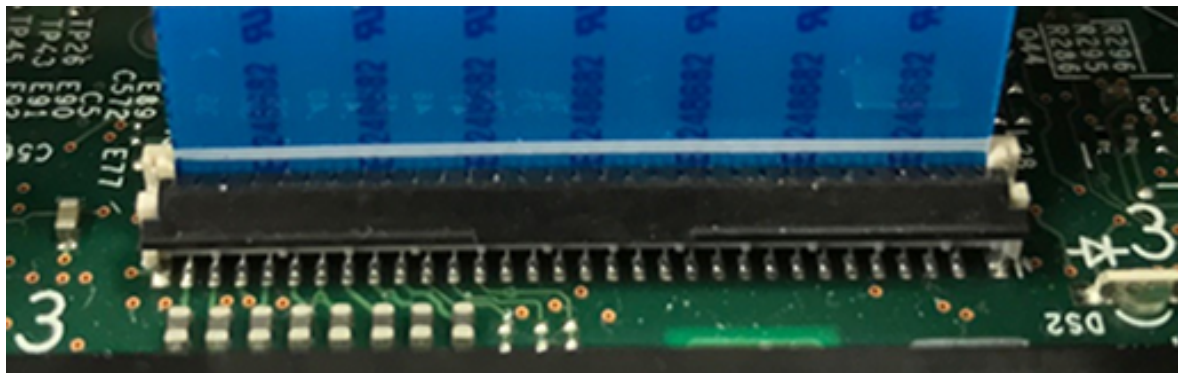


Figure 6-182 Improper insertion

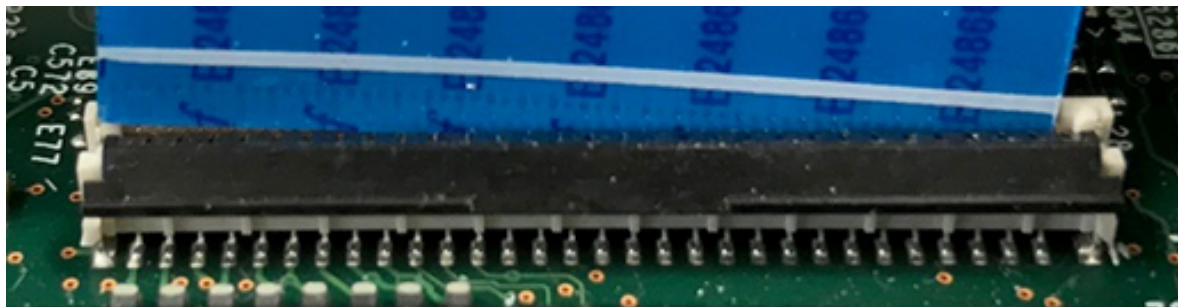

1. Turn the printer off, and then on.
2. If the error persists, replace the document feeder.


Document feeder kit part number: 5851-7203

For instructions: See the Repair Service Manual for this product.

FLOW Models document feeder kit part number: 5851-7204

For instructions: See the Repair Service Manual for this product.

3. Before replacing the document feeder, the on-site technician should verify that the connections between the document feeder and the SCB are correctly seated.

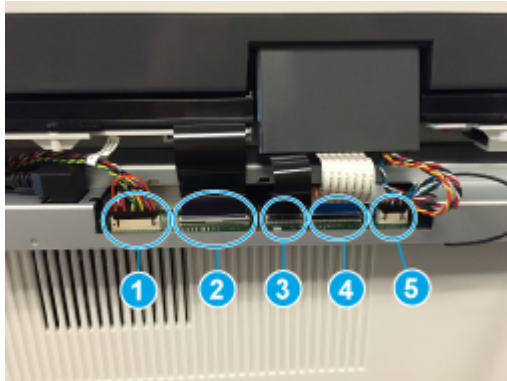

- 1 – Flatbed sensor/motor
- 2 – Flatbed FFC
- 3 – ADF sensor
- 4 – ADF FFC
- 5 – ADF motor

31.03.14

Backside scanner EEPROM (NVM) error.

A non-fatal error has occurred.

Recommended action

No action needed

- No action required.

31.03.20 Backside scanner not detected

Backside scanner not detected.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer, and then press the power button to turn on the printer.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Dispatch a technician onsite to perform the following tasks:
 - a. Instruct the onsite service personnel to disconnect and reconnect the ADF FFC on the scanner control board (SCB) labeled 'ADF SCAN'(Callout 4: ADF FFC).

Figure 6-183 Scanner control board (SCB): Sensor connections

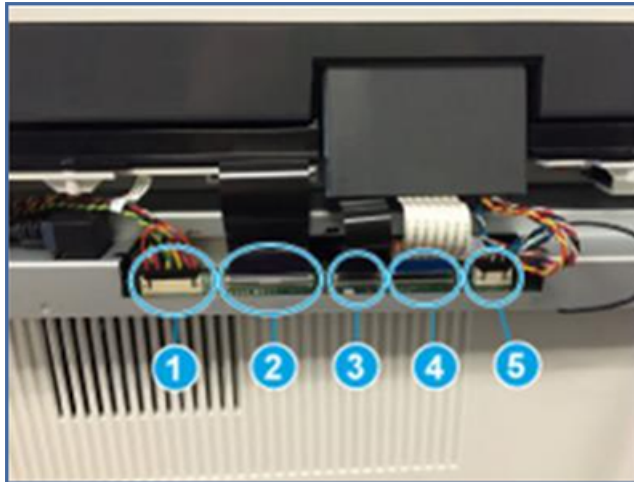


Table 6-84 SCB sensor callout descriptions

Callout	Description
1	Flatbed sensor/motor
2	Flatbed FFC
3	ADF sensor
4	ADF FFC
5	ADF Motor

- b. Ensure that the automatic document feeder FFC cable (Callout 4) is connected correctly. Reboot and test for functionality.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.


Figure 6-184 Gate Closed



Figure 6-185 Proper insertion



Figure 6-186 Improper insertion

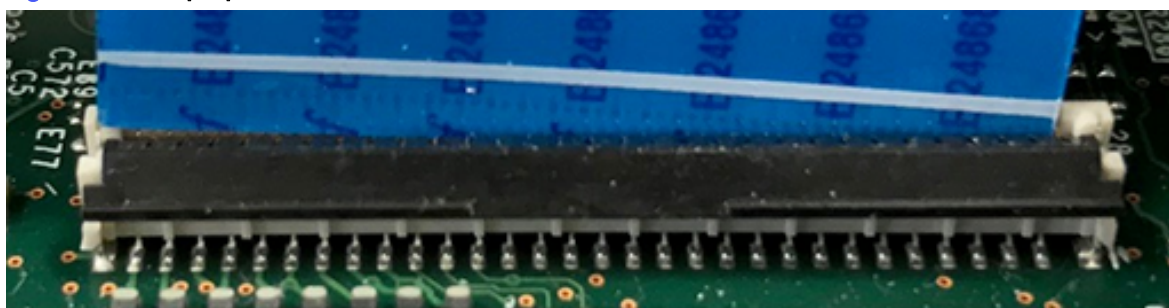

1. Turn the printer off, and then on.

2. If the error persists, disconnect and reconnect the ADF FFC on the scanner control board (SCB) labeled 'ADF SCAN'(Callout 4: ADF FFC), and then test for functionality.

Figure 6-187 Scanner control board (SCB): Sensor connections

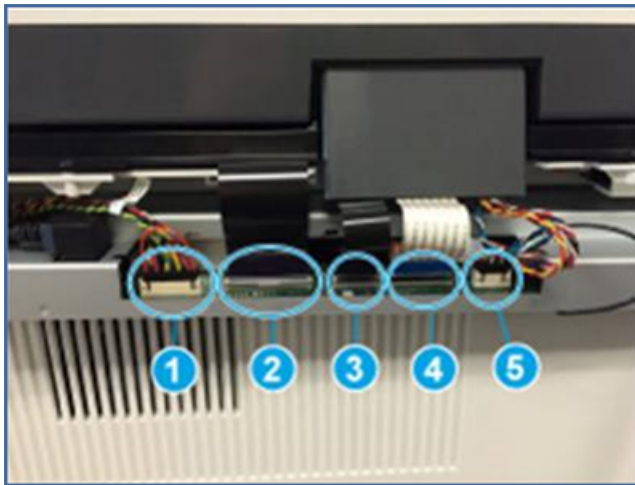


Table 6-85 SCB sensor callout descriptions

Callout	Description
1	Flatbed sensor/motor
2	Flatbed FFC
3	ADF sensor
4	ADF FFC
5	ADF Motor

3. If the error persists, replace the document feeder assembly.

Table 6-86 Automatic Document Feeder (ADF) part numbers

Description	Part number
Document feeder kit Enterprise series (<i>Includes white backing and retention clips</i>)	5851-7203
Document feeder kit Workflow series (<i>Includes white backing and retention clips</i>)	5851-7204

For instructions: See the Repair Service Manual for this product.

4. If the error persists, replace the SCB.

Table 6-87 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) Flow series	5851-7347

For instructions: See the Repair Service Manual for this product.

5. If the error persists, elevate the issue using the Standard Support Process.

31 . 03 . 22 Scanner calibration failure

Backside illumination calibration failure.

Recommended action for customers

1. Turn the printer off, and then on.
2. Upgrade the firmware.
3. If the error persists, please contact HP customer support.

Recommended action for call-center agents and onsite technicians

 **NOTE:** When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.

Figure 6-188 Gate Closed

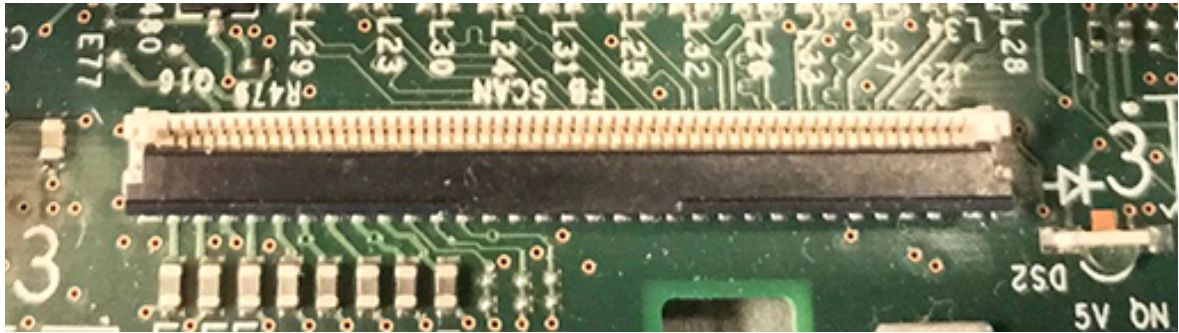


Figure 6-189 Proper Insertion


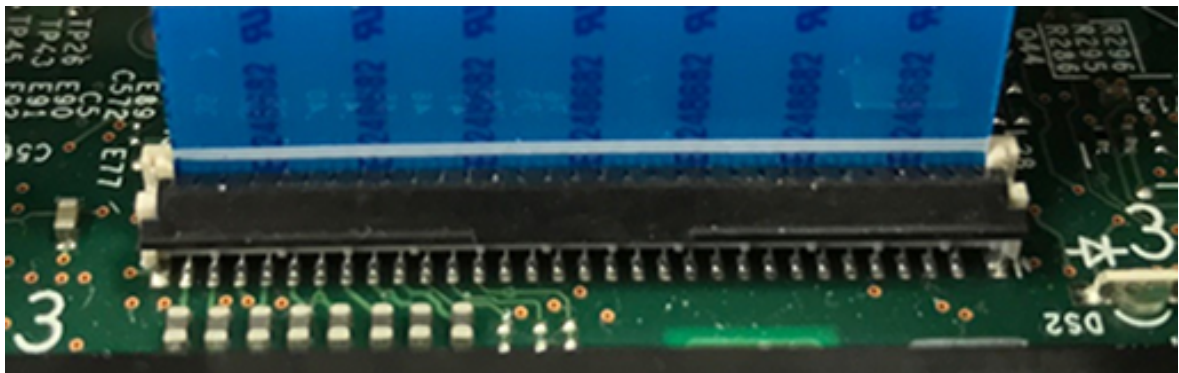


Figure 6-190 Improper insertion

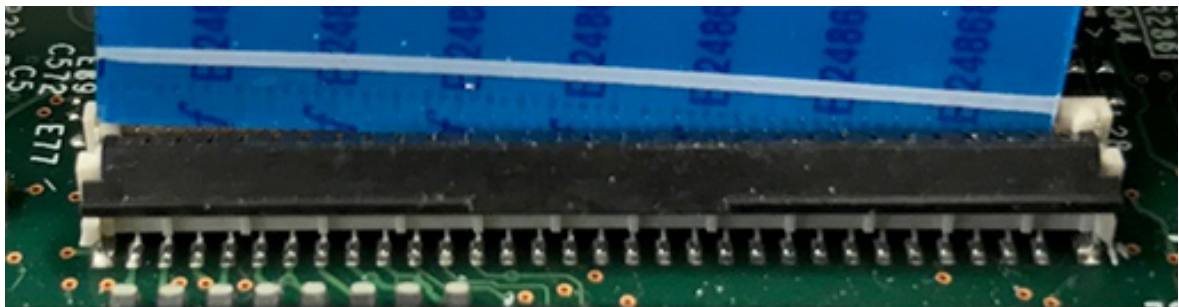

1. Turn the printer off, and then on.
2. Upgrade the firmware.
3. Replace the document feeder assembly.


Document feeder kit part number: 5851-7203

For instructions: See the Repair Service Manual for this product.

FLOW Models document feeder kit part number: 5851-7204

For instructions: See the Repair Service Manual for this product.

4. Before replacing the document feeder, the on-site technician should verify the cables between the image scanner and the SCB are correctly connected.

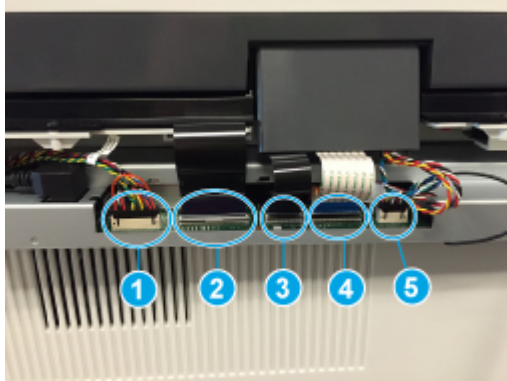

1 – Flatbed sensor/motor

2 – Flatbed FFC

3 – ADF sensor

4 – ADF FFC

5 – ADF motor

31 . 03 . 30 Document feeder pick motor error

The document feeder pick motor is not turning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the top cover and remove any paper present. Close the top cover.
2. Turn the printer off, and then on.
3. Verify that the paper being used meets the HP specifications for the printer.
4. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
5. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

 **NOTE:** When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.

Figure 6-191 Gate Closed

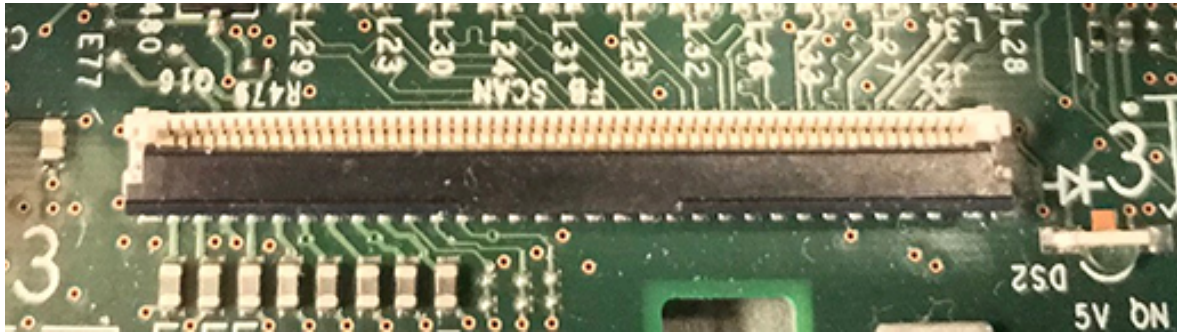


Figure 6-192 Proper insertion


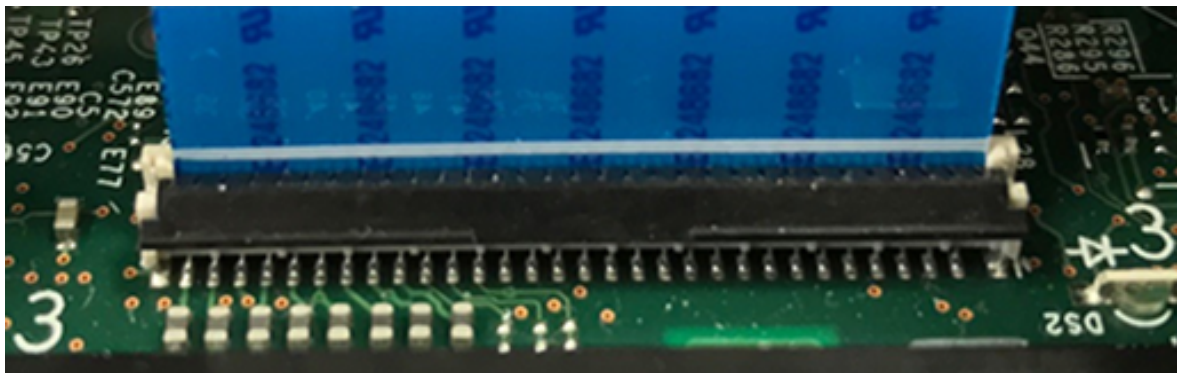


Figure 6-193 Improper insertion

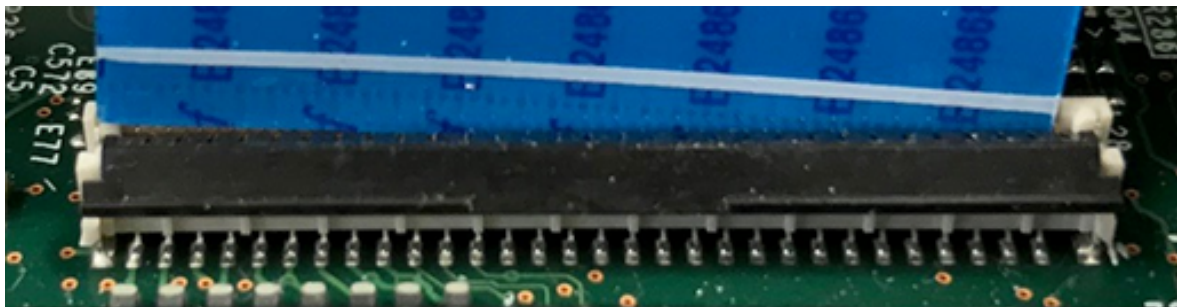

1. Open the top cover and remove any paper present. Close the top cover.
2. Verify that the paper being used meets the HP specifications for the printer.
3. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
4. Check the event log for other document feeder errors. If other errors are present, resolve those errors first.


5. Open and close the top cover to see if the pick motor turns without displaying the error. If the motor turns, the motor is good.
6. Replace the document feeder.

Document feeder kit part number: 5851-7203

For instructions: See the Repair Service Manual for this product.

FLOW Models document feeder kit part number: 5851-7204

For instructions: See the Repair Service Manual for this product.
7. Before replacing the document feeder, the on-site technician should verify that the motor cables are connected.

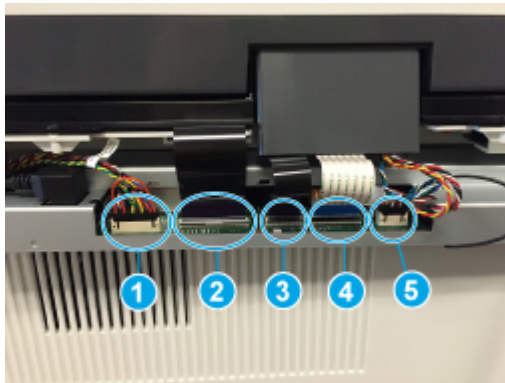

- 1 – Flatbed sensor/motor
- 2 – Flatbed FFC
- 3 – ADF sensor
- 4 – ADF FFC
- 5 – ADF motor

31 . 03 . 31 Document feeder motor stall

The document feeder feed motor is not turning.

Recommended action for customers

1. Open the top cover and remove any paper present. Close the top cover.
2. Turn the printer off, and then on.
3. Verify that the paper being used meets the HP specifications for the printer.
4. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
5. If the error persists, please contact HP customer support.

Recommended action for call-center agents and onsite technicians

 **NOTE:** When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.

Figure 6-194 Gate Closed

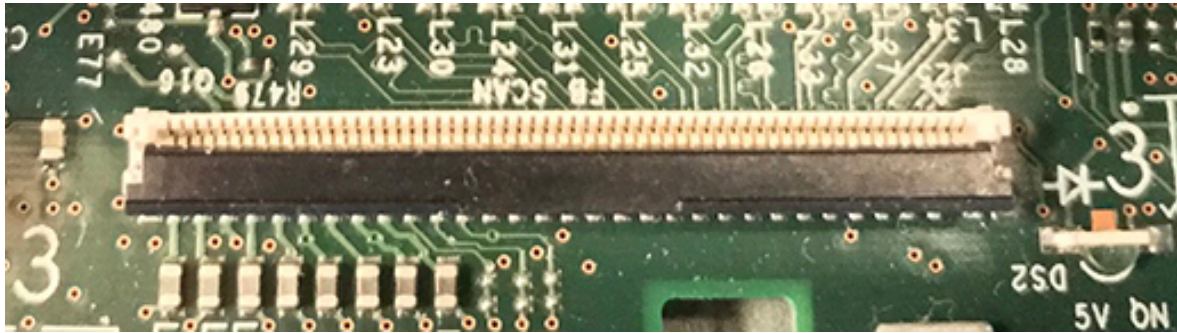


Figure 6-195 Proper insertion


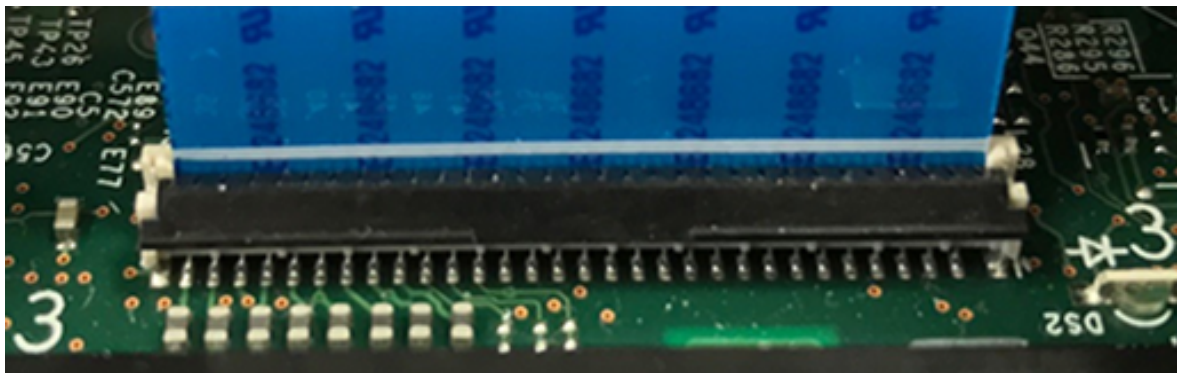


Figure 6-196 Improper insertion

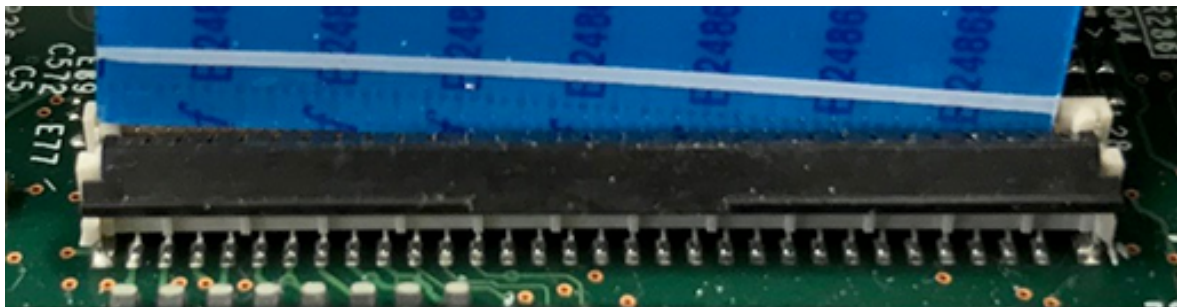


1. Open the top cover and remove any paper present. Close the top cover.
2. Verify that the paper being used meets the HP specifications for the printer.
3. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
4. Check the event log for other document feeder errors. If other errors are present, resolve those errors first.

5. Open and close the top cover to see if the pick motor turns without displaying the error. If the motor turns, the motor is good.
6. Replace the document feeder.

Document feeder kit part number: 5851-7203
For instructions: See the Repair Service Manual for this product.

FLOW Models document feeder kit part number: 5851-7204
For instructions: See the Repair Service Manual for this product.
7. Before replacing the document feeder, the on-site technician should verify that the motor cables are connected.

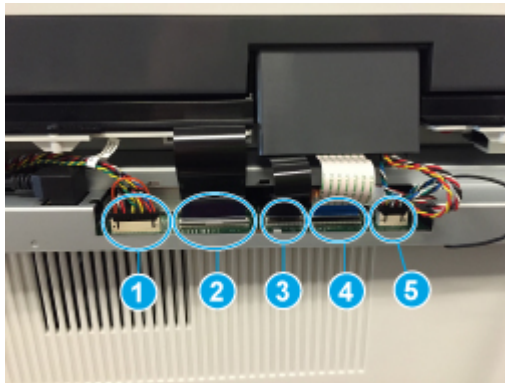

- 1 – Flatbed sensor/motor
- 2 – Flatbed FFC
- 3 – ADF sensor
- 4 – ADF FFC
- 5 – ADF motor

31 . 03 . 33 Backside scanner calibration area dirty

The white area used for backside scanner calibration is dirty.

Recommended action for customers

1. Clean the white strip on platen glass and on the document feeder (side 2 glass).



2. Turn the printer off, and then on.
3. Verify that the paper being used meets the HP specifications for the printer.
4. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
5. If the error persists, please contact HP customer support.

Recommended action for call-center agents and onsite technicians

 **NOTE:** When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.


Figure 6-197 Gate Closed



Figure 6-198 Proper insertion



Figure 6-199 Improper insertion

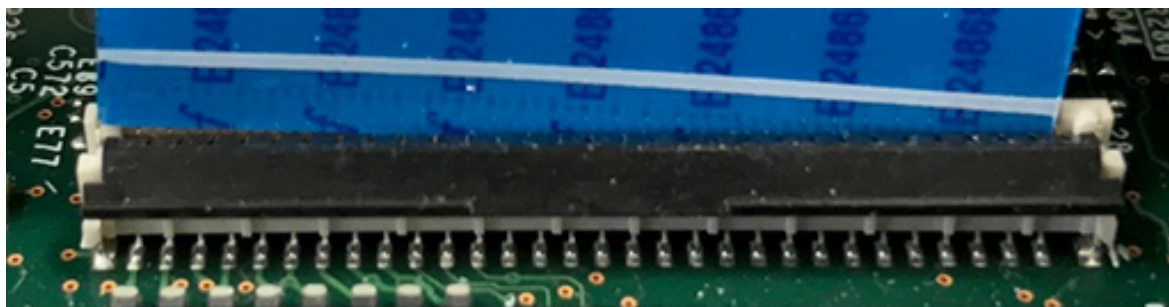

1. Clean the white strip on platen glass and on the document feeder (side 2 glass).



2. If the error remains replace the document feeder assembly.


Document feeder kit part number: 5851-7203

For instructions: See the Repair Service Manual for this product.

FLOW Models document feeder kit part number: 5851-7204

For instructions: See the Repair Service Manual for this product.

3. Before replacing the document feeder, the on-site technician should verify that all cables are connected correctly on the SCB.

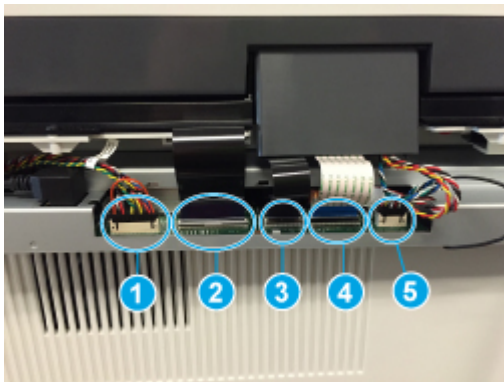

1 – Flatbed sensor/motor

2 – Flatbed FFC

3 – ADF sensor

4 – ADF FFC

5 – ADF motor

31 . 13 . 00 Document feeder multi-pick error

A multiple pick error was reported by the document feeder assembly (ADF).

Issue might be described as the following:


- Picking multiple documents
- Picking more than one page
- Multiple sheets pulled from ADF
- Multiple pages picked

Recommended action for customers

1. Remove any paper in the paper path.


For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

2. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

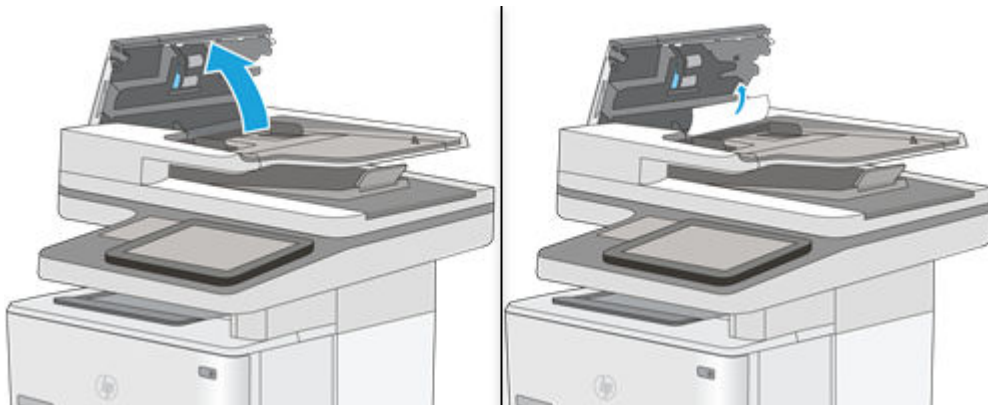


3. Lift the document-feeder input tray and remove any jammed paper.

- a. Lift the document feeder input tray

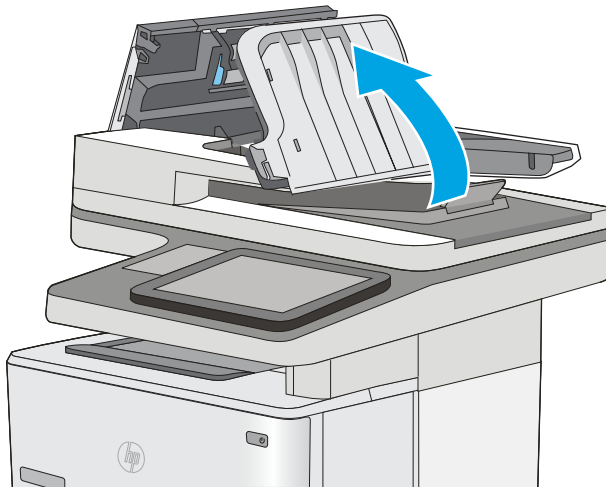

- b. Remove any paper found under the tray.

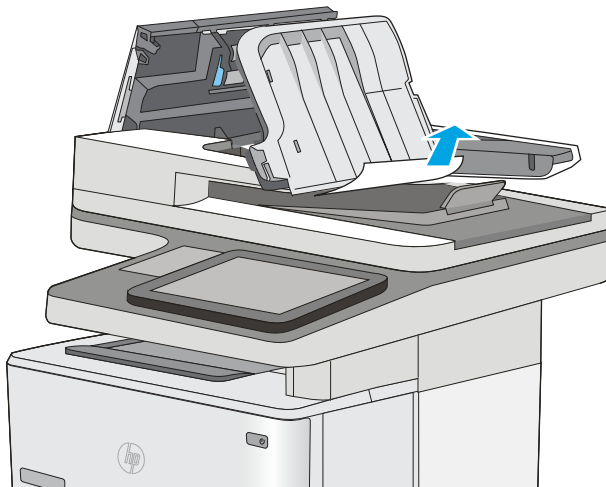


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

4. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path

- a. Open the ADF and remove any paper found.

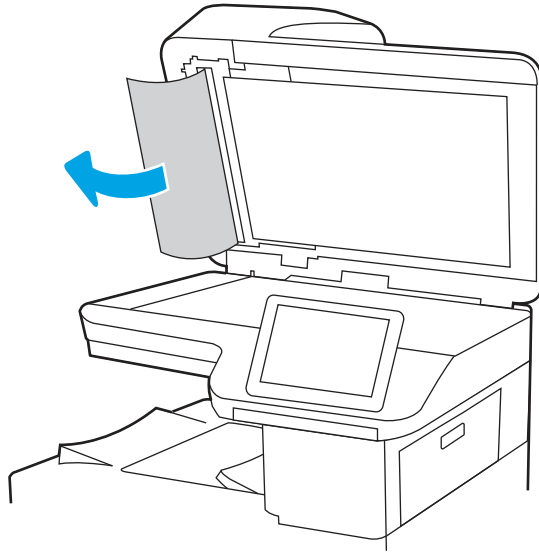

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

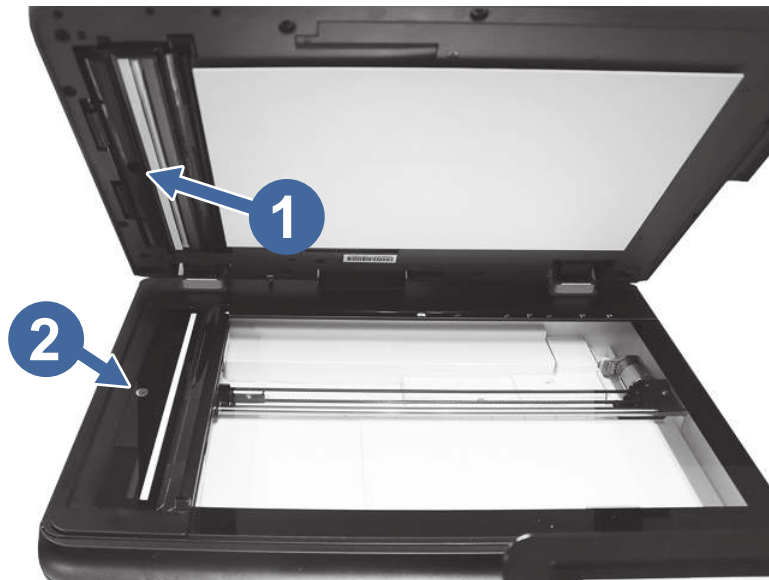

Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.


- c. Close the document feeder.
5. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

6. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-200 Set the ADF guides

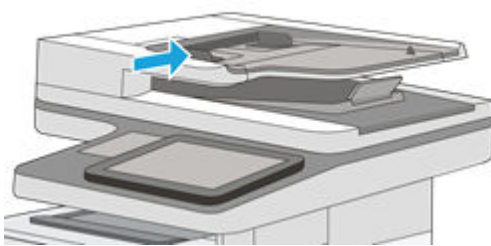


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


7. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

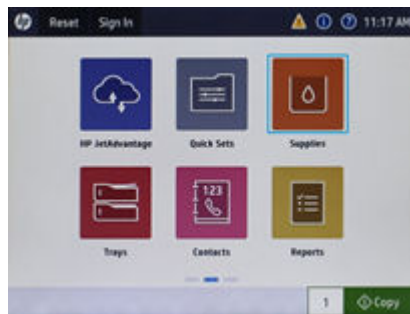

- b. Select **Document Feeder Kit**.

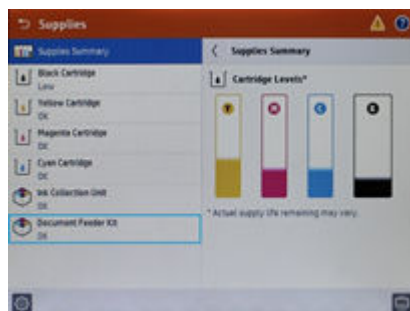


- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

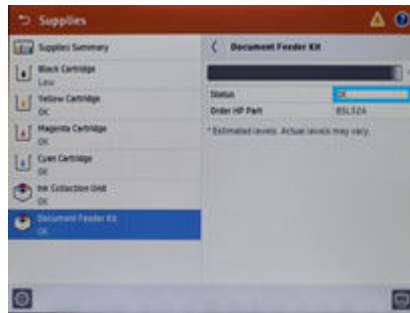

- d. If the status is **Low** or **Very Low** it is recommended that the customer replace the Document Feeder Kit.

Part number: [J8J95A](#)/HP 300 ADF Roller Replacement Kit

8. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

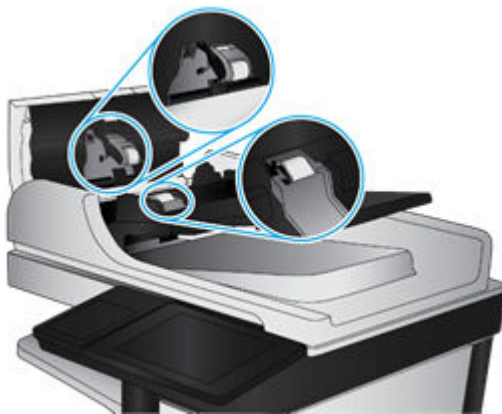

9. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.


Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.


1. Remove any paper in the paper path.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)


2. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

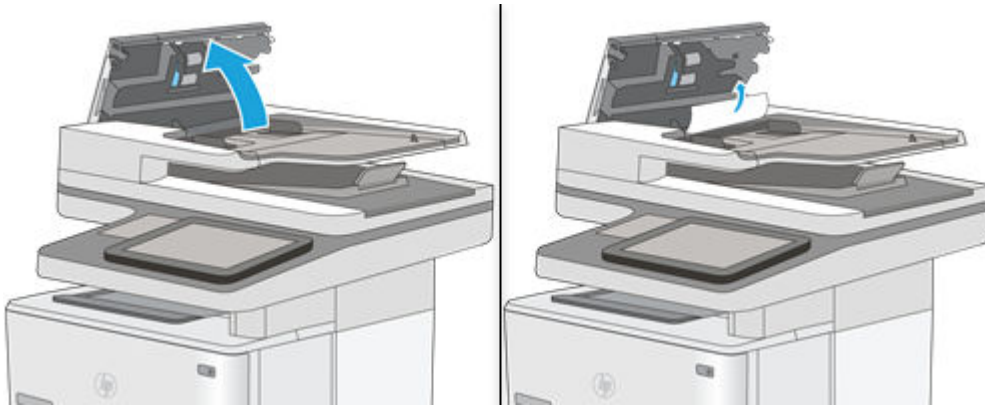

3. Lift the document-feeder input tray and remove any jammed paper.
 - a. Lift the document feeder input tray

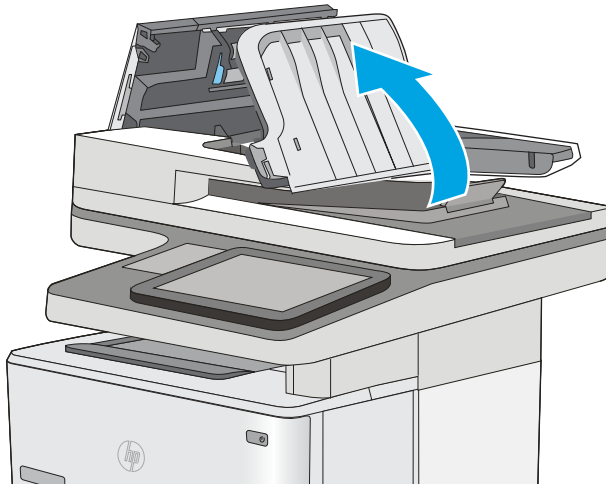

- b. Remove any paper found under the tray.

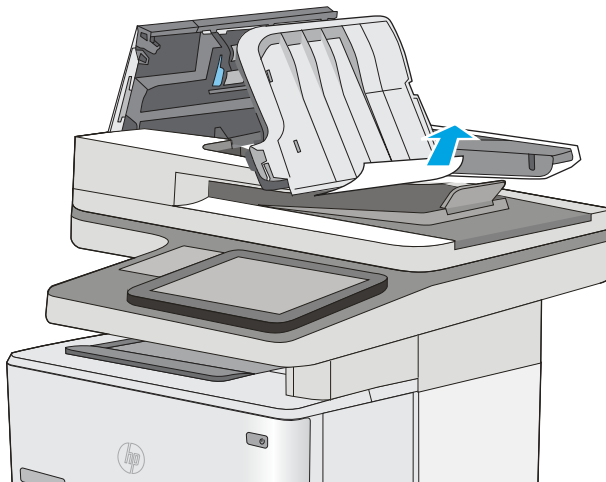


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

- 4. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path
 - a. Open the ADF and remove any paper found.

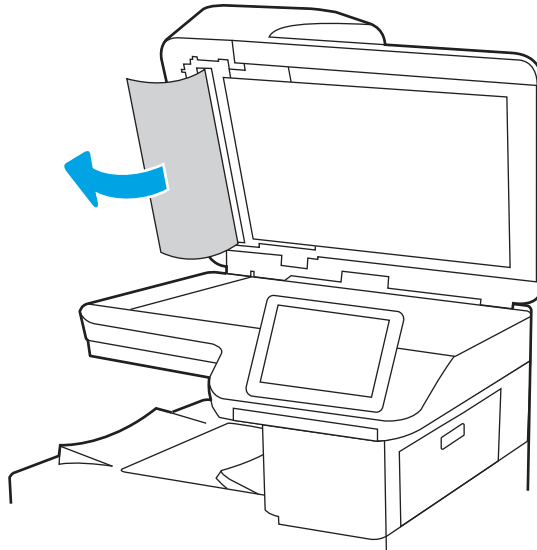

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

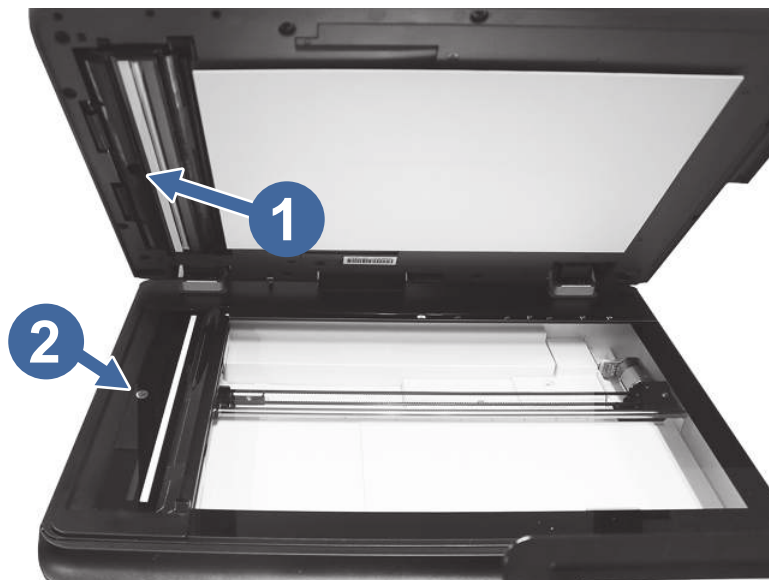

Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.


5. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

6. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-201 Set the ADF guides

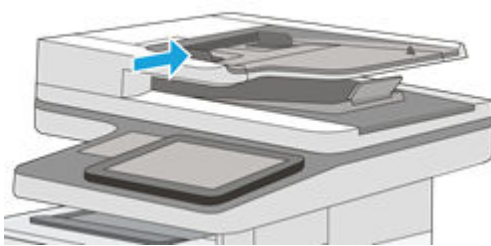


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


7. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

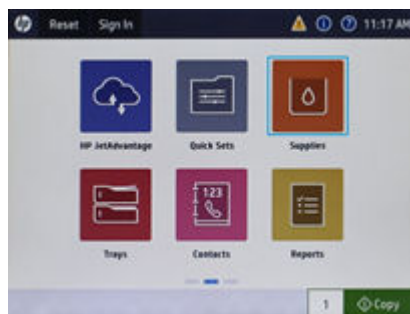

- b. Select **Document Feeder Kit**.

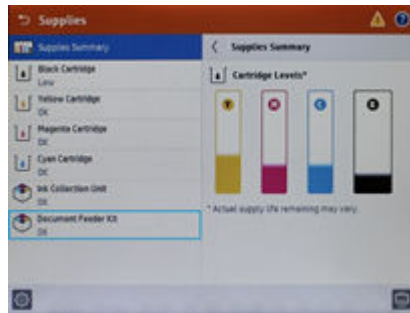

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

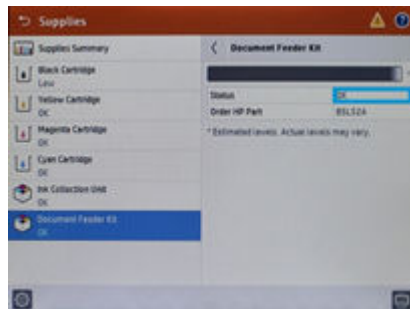


- d. If the status is **Low** or **Very Low** it is recommended that the customer replace the Document Feeder Kit.

Part number: [J8J95A](#)/HP 300 ADF Roller Replacement Kit .

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace 5851-7202 (Roller replacement kit - Replacement feed rollers for the document feeder)

8. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

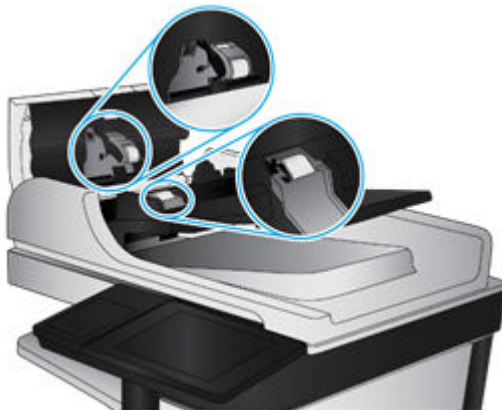

9. If the error persists, replace the Document Feeder Kit rollers and separation pad.

Table 6-88 Roller replacement kit part number

Part description	Part number
Roller replacement kit - Replacement feed rollers for the document feeder	5851-7202

10. If a grinding noise is heard or reported in conjunction with the pick or feed of paper through the ADF, replace the document feeder (ADF) unit.

Use the table below to order the correct part for your printer. The replacement part for the Document feeder kit (ADF) Enterprise and Workflow series includes white backing and retention clips.

Table 6-89 Document feeder kit for Enterprise and Workflow models part numbers

Part description	Part number
Document feeder kit - Enterprise series	5851-7203
Document feeder kit - Workflow series	5851-7204


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.


1. Remove any paper in the paper path.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

2. Open the automatic document feeder lid, pull all the sheets back into the input tray, and then resume the job.
3. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path
 - a. Open the ADF and remove any paper found.

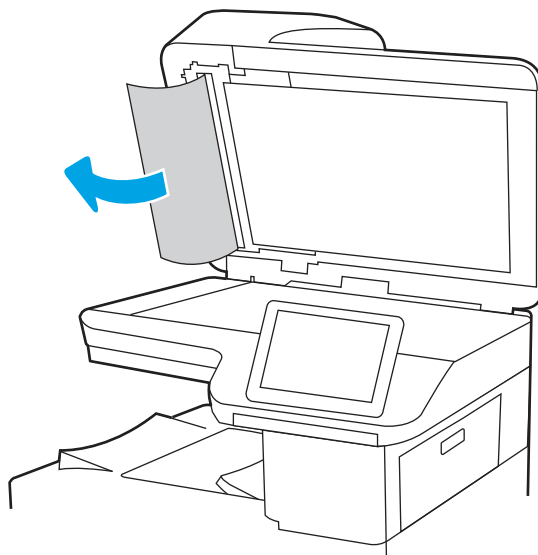

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

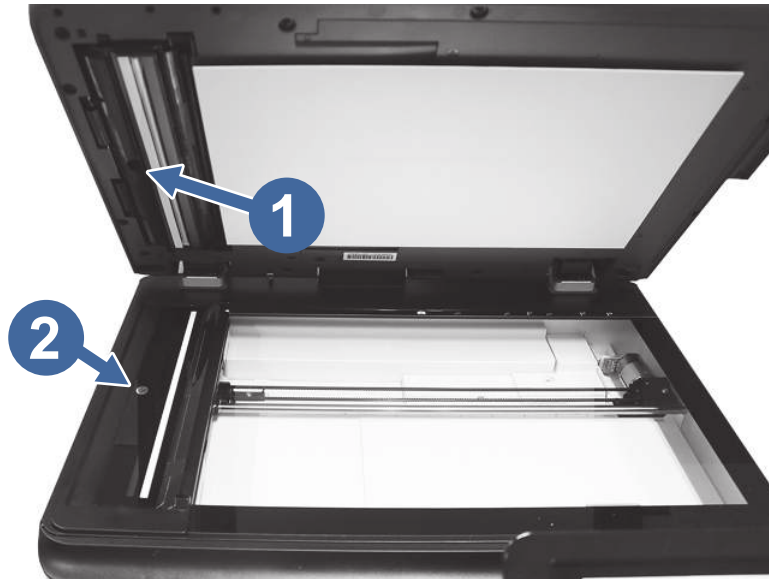

Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.


- c. Close the document feeder.
4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):
 5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
Make sure that the paper stack is correctly aligned at the center of the input tray when paper is

loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-202 Set the ADF guides

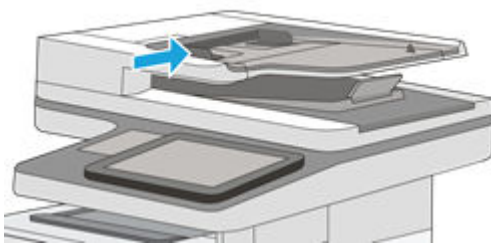


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

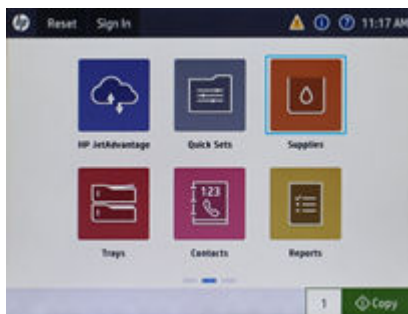

- b. Select **Document Feeder Kit**.

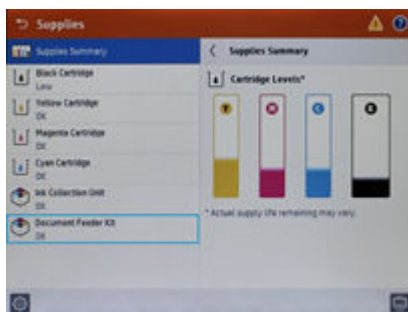

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

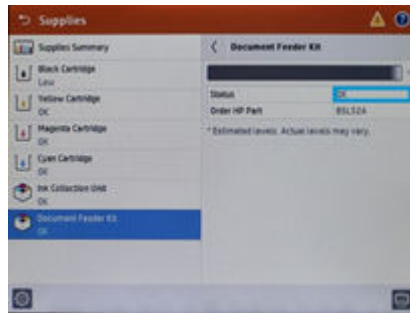

- d. If the status is **Low** or **Very Low** it is recommended that the customer replace the Document Feeder Kit.


Part number: [J8J95A](#)/HP 300 ADF Roller Replacement Kit .

To order parts, go to <https://store.hp.com>



NOTE: Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace 5851-7202 (Roller replacement kit - Replacement feed rollers for the document feeder)


7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

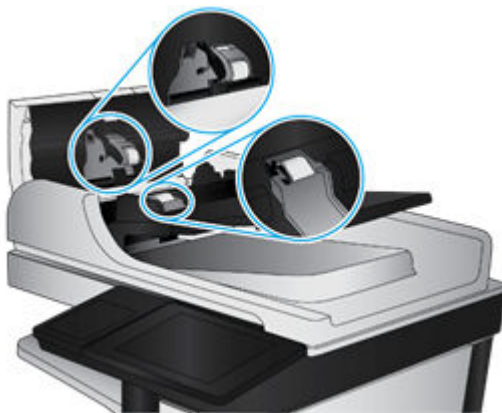

8. If necessary, replace the Document Feeder Kit rollers and separation pad.
Roller replacement kit - Replacement feed rollers for the document feeder: 5851-7202
For instructions: See the Repair Service Manual for this product.
9. Test the document feeder by running a multiple page copy job.
- Should a grinding noise be reported or heard in conjunction with the pick/feed of paper through the ADF, Replace the document feeder (ADF) unit.
 - If the pick/feed issue does not include grinding noise, continue with the recommended action for the specific 31.13.x event/or symptomatic behavior

10. Inspect the ADF pick success sensor, cleaning both the REDI (paper pick success) sensor window and REDI (PAPER PICK SUCCESS) sensor reflector. If there is any dust or fiber remnants, clean by using a can of compressed air to blow out and clean.


Figure 6-203 ADF REDI sensor

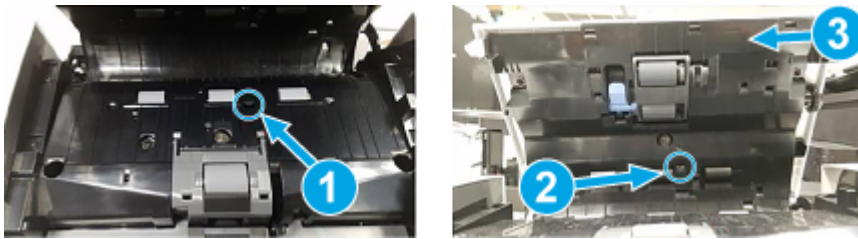

- 1 – REDI sensor window
- 2 – REDI sensor reflector
- 3 – ADF hatch

11. Verify that the connections between the automatic document feeder and the SCB are correctly seated.

Figure 6-204 SBC connections

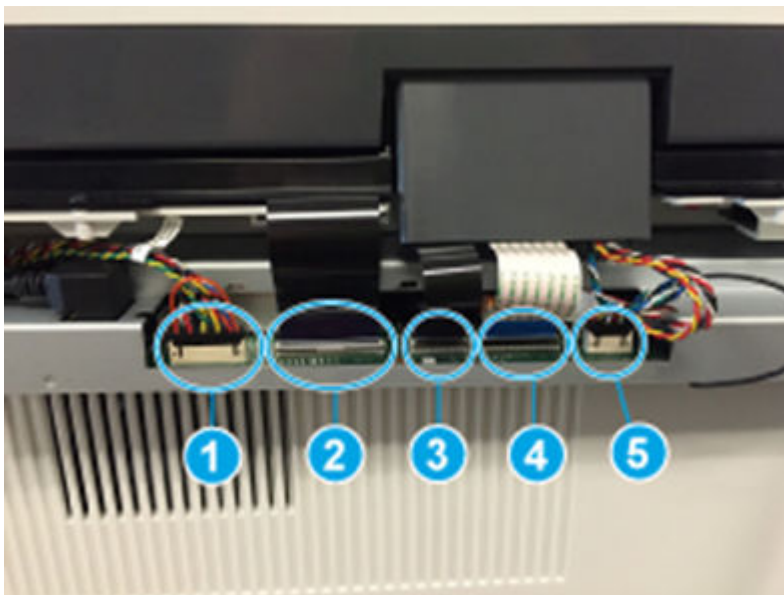

- 1 – Flatbed sensor/motor
- 2 – Flatbed FFC
- 3 – ADF sensor
- 4 – ADF FFC
- 5 – ADF sensor

5— ADF Motor


 **NOTE:** The flat flexible cables (FFC's) on the Scanner Control Board (SCB) are zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are DRAMATICALLY different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 families.

Gate closed



Proper insertion

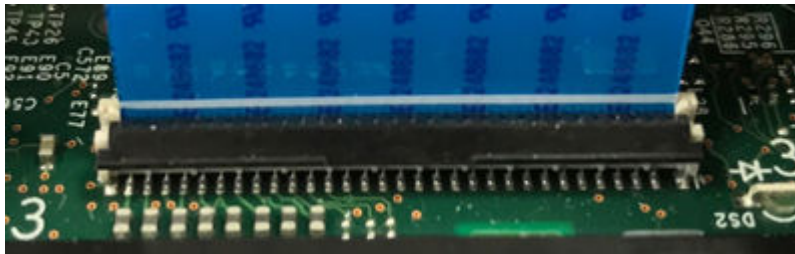


Improper insertion




12. Using the Manual Scanner Sensor Test verify functionality of the ADF Paper Path Pick Success sensor.


- a. Navigate to and select **Support Tools**.

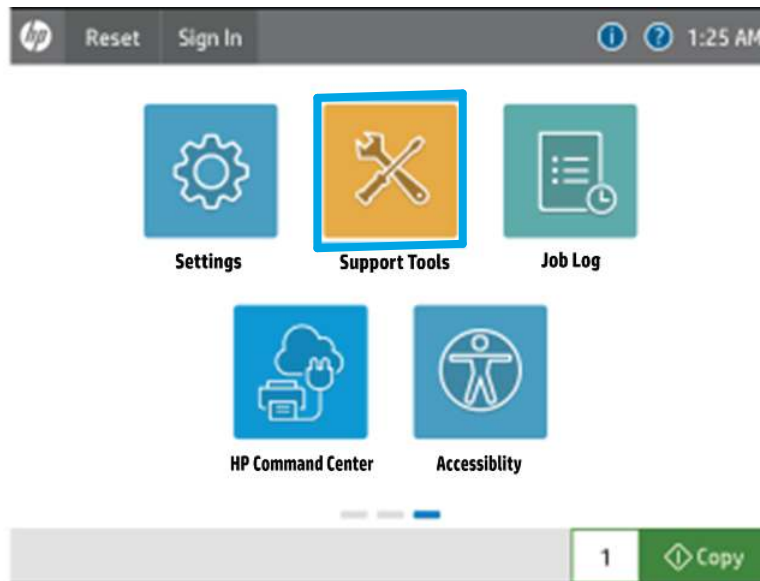


- b. Select **Troubleshooting**.

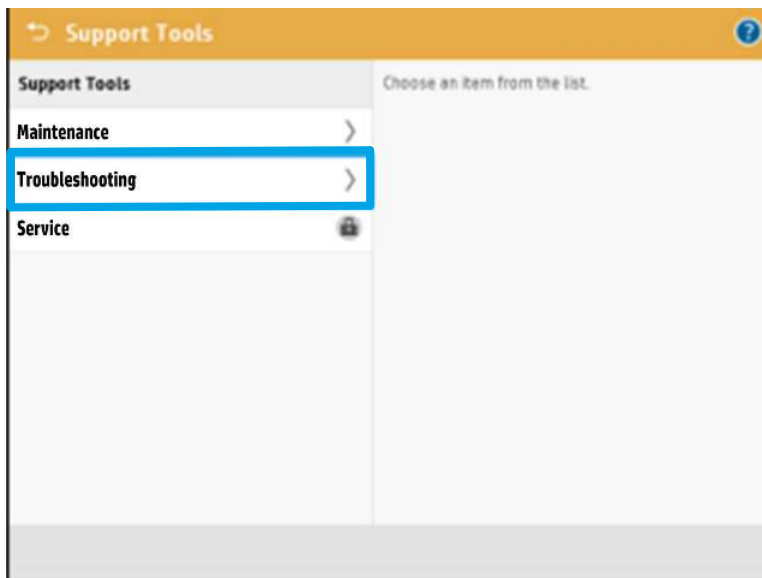


- c. Select **Diagnostic Tests**.

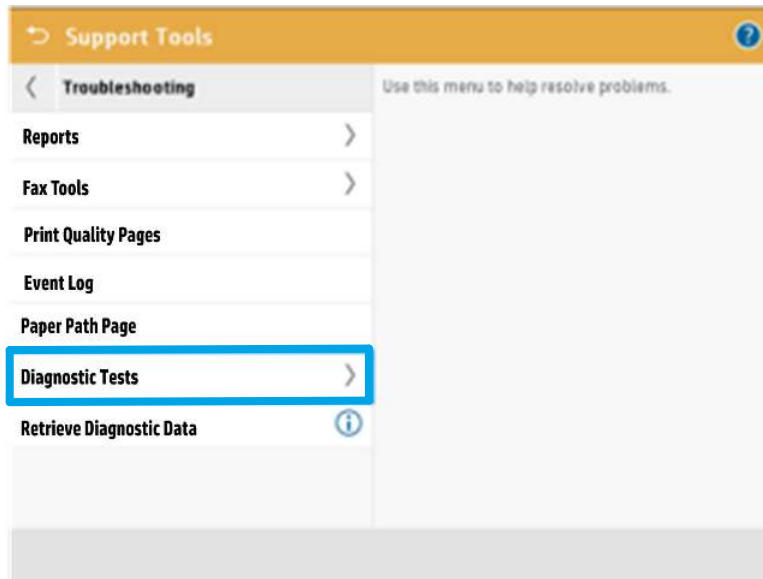

- d. Select **Continue**.

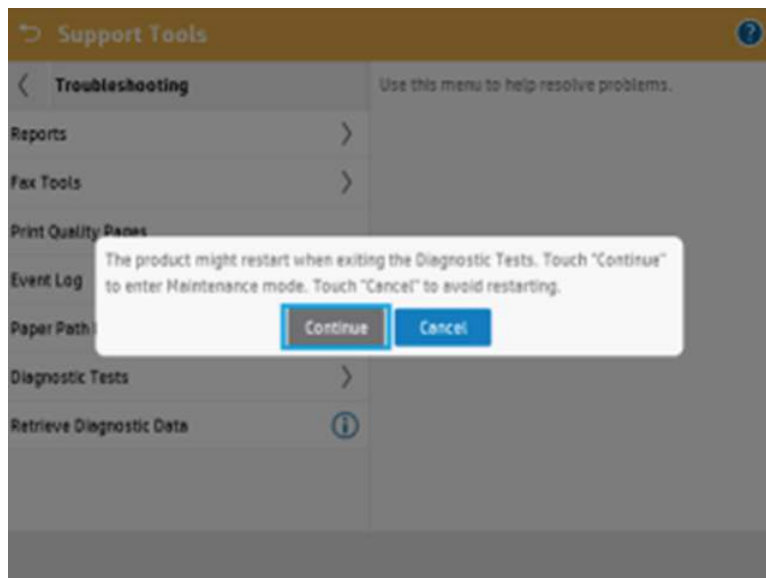

- e. Select **Manual Sensor Test**.

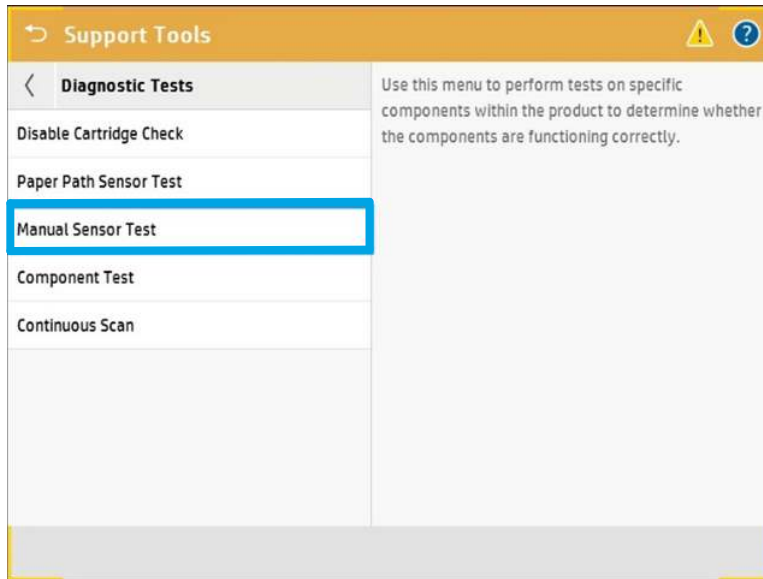

- f. Select **ADF Paper Path Deskew**.




- g. Select **ADF Paper Path Pick Success**.

(Only in FLOW-MODELS)



NOTE: Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advancing.

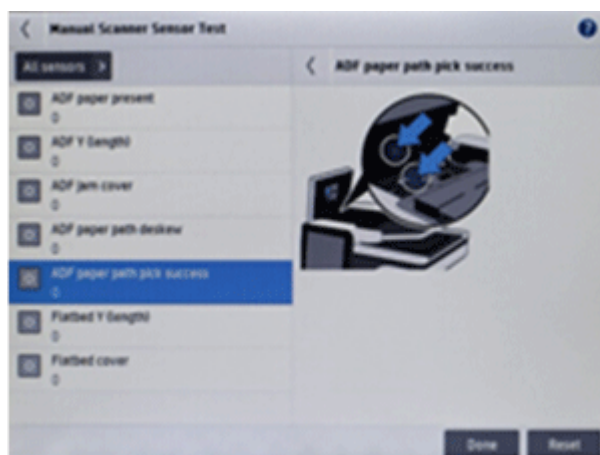

- h. Close the ADF cover and ensure that is secure and closed correctly.
13. Open and close the ADF cover to trigger the ADF Paper Path Pick Success sensor.



 **NOTE:** Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advanced.

14. If the ADF Paper Path Pick Success test fails to advance the count, replace the document feeder.

 **NOTE:** If a grinding noise is heard or reported in conjunction with the pick or feed of paper through the ADF, replace the document feeder (ADF) unit.

Use the table below to order the correct part for your printer. The replacement part for the Document feeder kit (ADF) Enterprise and Workflow series includes white backing and retention clips.

Table 6-90 Document feeder kit for Enterprise (Non-flow models) and Workflow (Flow models) series part numbers

Part description	Part number
Document feeder kit - Enterprise series	5851-7203
Document feeder kit - Workflow series	5851-7204

For instructions: See the Repair Service Manual for this product.

31.13.01

Document feeder job error, pick error.

Paper pick was initiated but the page did not make it to the pick success sensor.


- Paper not feeding from document feeder (ADF)
- Pick error ADF
- pick issue document feeder

Recommended action for customers

1. Remove any paper in the paper path.


For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

2. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

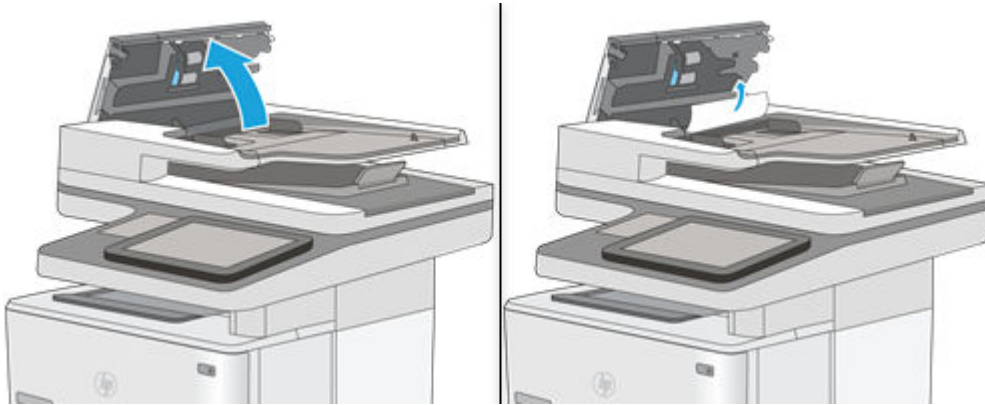


3. Lift the document-feeder input tray and remove any jammed paper.

- a. Lift the document feeder input tray

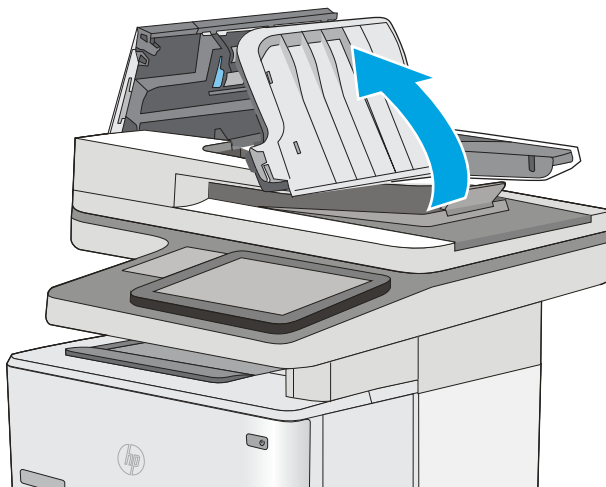

- b. Remove any paper found under the tray.

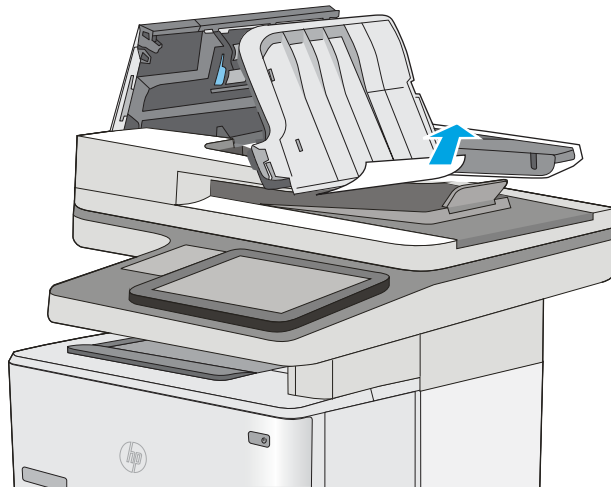


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

4. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path

- a. Open the ADF and remove any paper found.

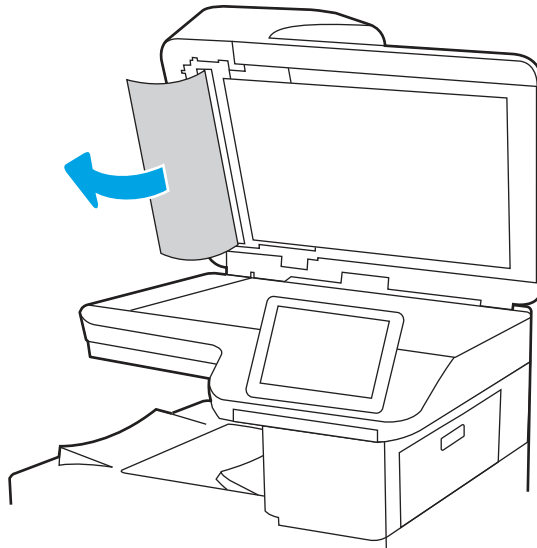

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

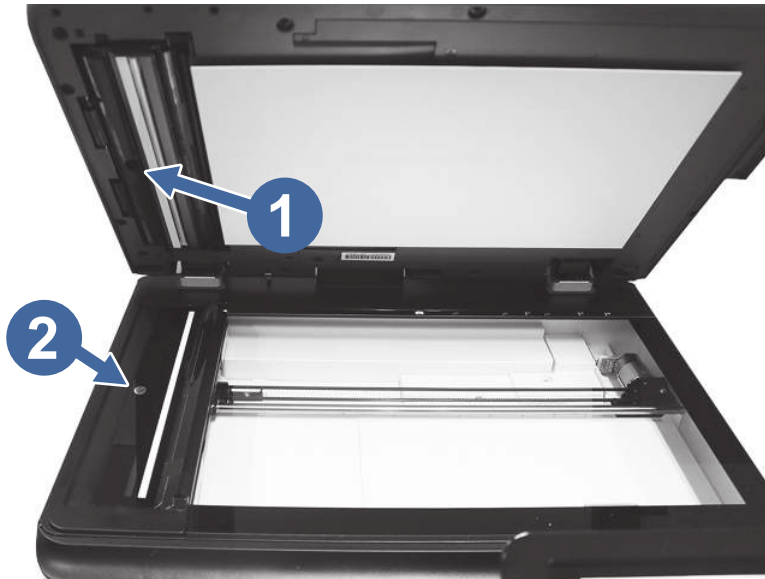


Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.
- 5. Ensure that the paper meets the document feeder (ADF) specifications for the printer.
This document outlines the supported weights and sizes of the ADF including best practices:
Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF);
- 6. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
Make sure that the paper stack is correctly aligned at the center of the input tray when paper is

loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-205 Set the ADF guides

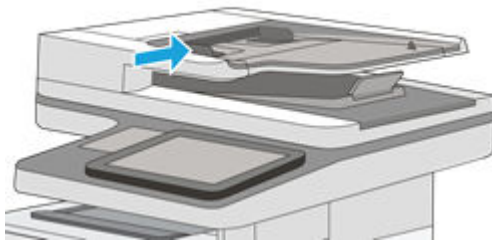


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


7. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

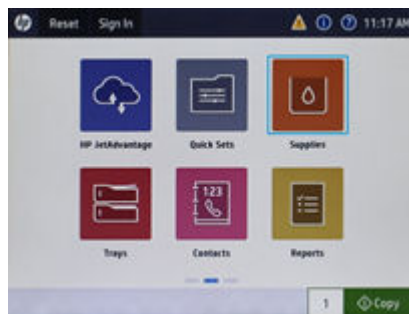

- b. Select **Document Feeder Kit**.

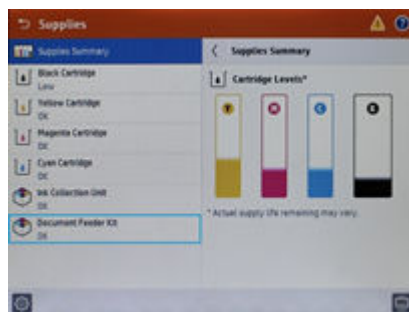


- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

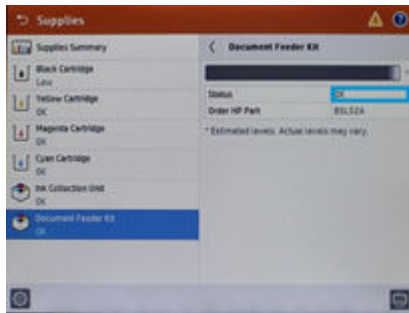

- d. If the status is **Low** or **Very Low** it is recommended that the customer replace the Document Feeder Kit.

Part number: [J8J95A](#)/HP 300 ADF Roller Replacement Kit

8. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

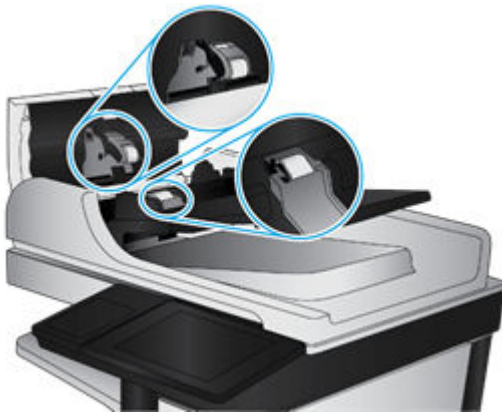

9. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.


Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.


1. Remove any paper in the paper path.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)


2. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

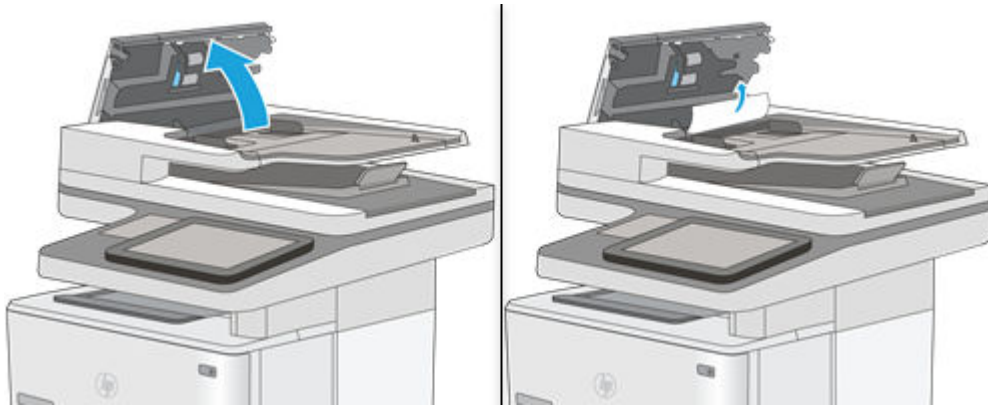

3. Lift the document-feeder input tray and remove any jammed paper.
 - a. Lift the document feeder input tray

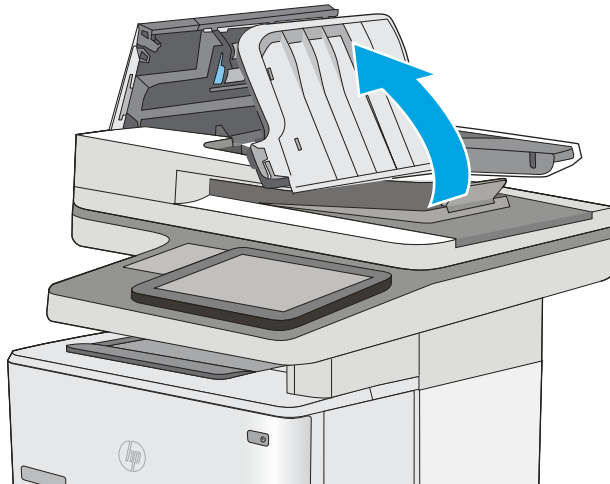

- b. Remove any paper found under the tray.

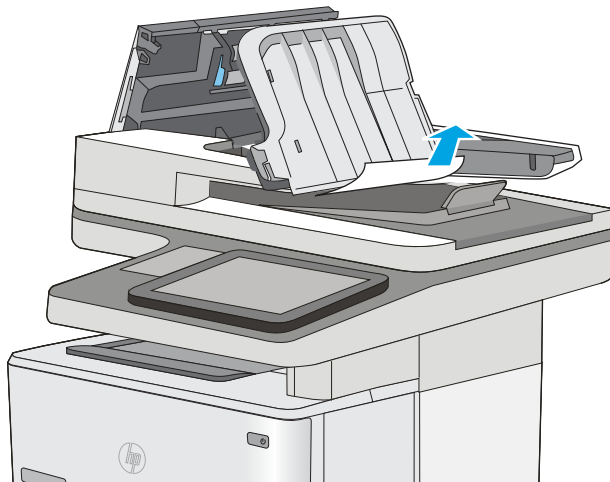


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

- 4. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path
 - a. Open the ADF and remove any paper found.

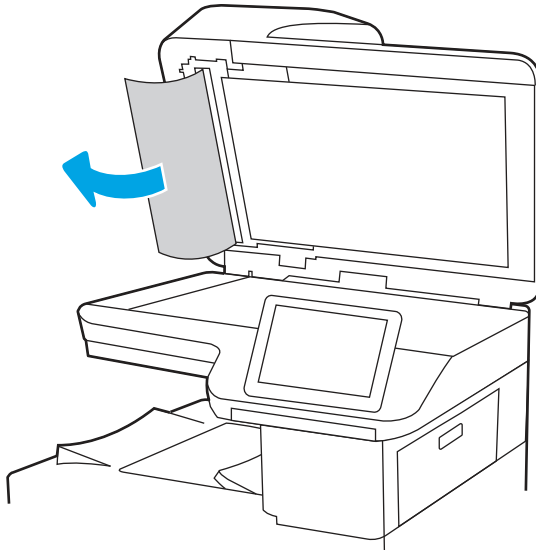

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

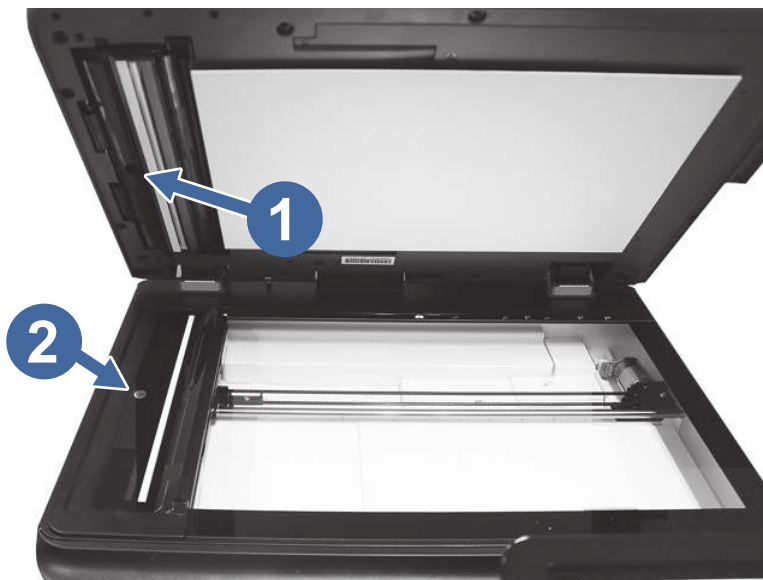

Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.


5. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

6. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-206 Set the ADF guides

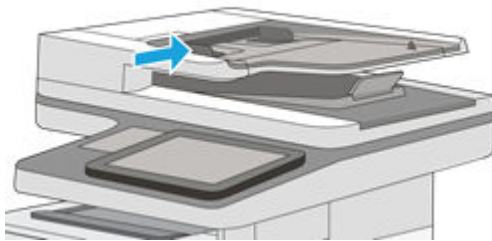


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


7. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

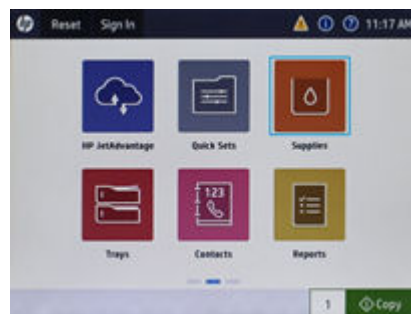

- b. Select **Document Feeder Kit**.

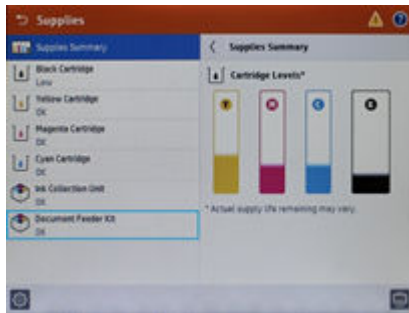

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

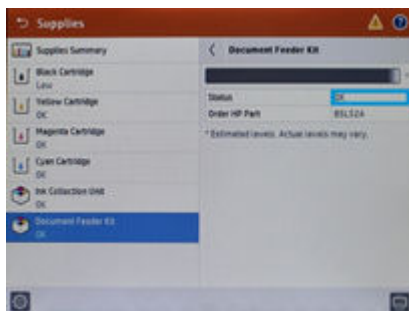


- d. If the status is **Low** or **Very Low** it is recommend that the customer replace the Document Feeder Kit.

Part number: [J8J95A](#)/HP 300 ADF Roller Replacement Kit .

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace 5851-7202 (Roller replacement kit - Replacement feed rollers for the document feeder)

8. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

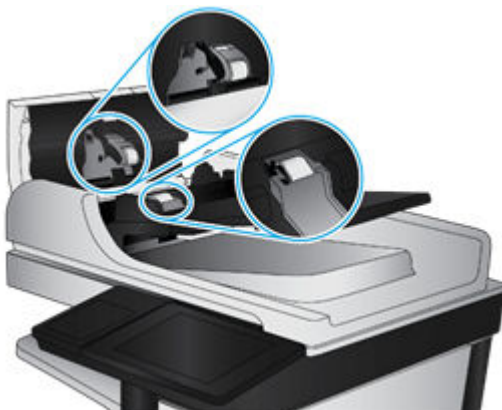

9. If the error persists, replace the Document Feeder Kit rollers and separation pad.

Table 6-91 Roller replacement kit part number

Part description	Part number
Roller replacement kit - Replacement feed rollers for the document feeder	5851-7202

10. If a grinding noise is heard or reported in conjunction with the pick or feed of paper through the ADF, replace the document feeder (ADF) unit.

Use the table below to order the correct part for your printer. The replacement part for the Document feeder kit (ADF) Enterprise and Workflow series includes white backing and retention clips.

Table 6-92 Document feeder kit for Enterprise and Workflow models part numbers

Part description	Part number
Document feeder kit - Enterprise series	5851-7203
Document feeder kit - Workflow series	5851-7204


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.


1. Remove any paper in the paper path.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

2. Open the automatic document feeder lid, pull all the sheets back into the input tray, and then resume the job.
3. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path
 - a. Open the ADF and remove any paper found.

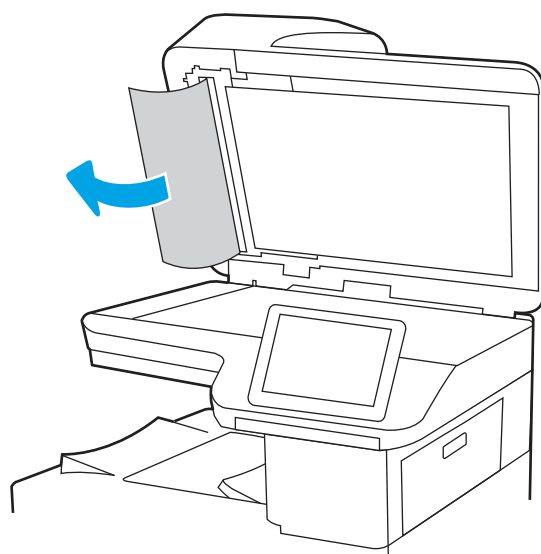

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

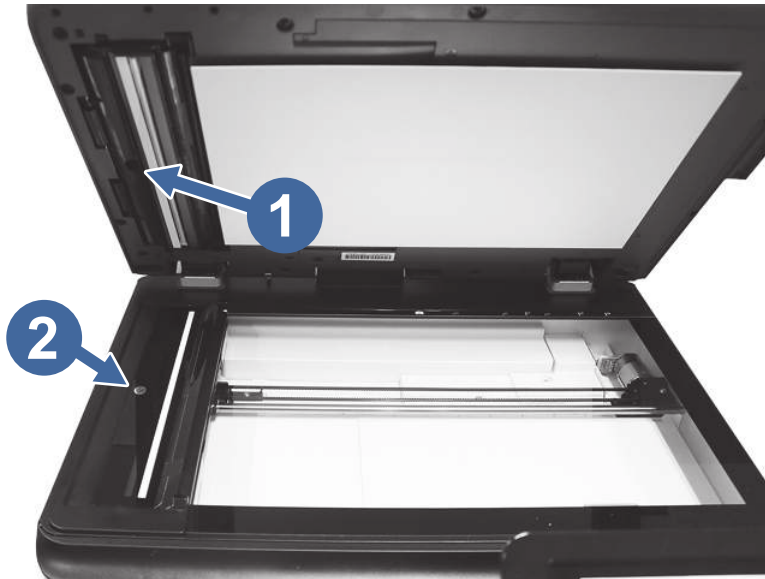


Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.
4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.
This document outlines the supported weights and sizes of the ADF including best practices:
Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF);
 5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
Make sure that the paper stack is correctly aligned at the center of the input tray when paper is

loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-207 Set the ADF guides

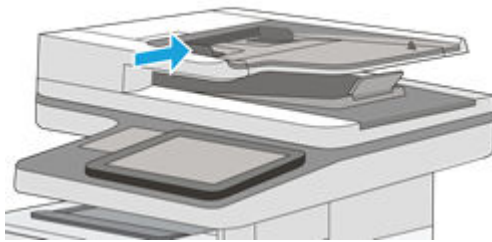


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

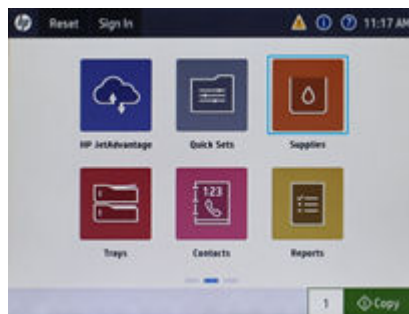

- b. Select **Document Feeder Kit**.

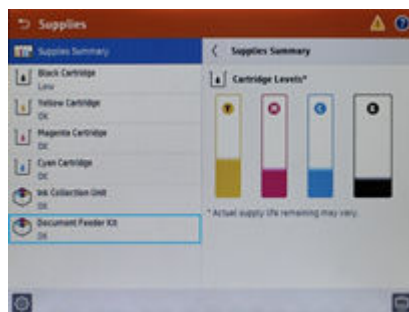

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

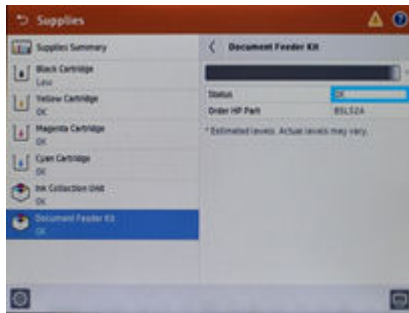


- d. If the status is **Low** or **Very Low** it is recommended that the customer replace the Document Feeder Kit.

Part number: [J8J95A](#)/HP 300 ADF Roller Replacement Kit .

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace 5851-7202 (Roller replacement kit - Replacement feed rollers for the document feeder)

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

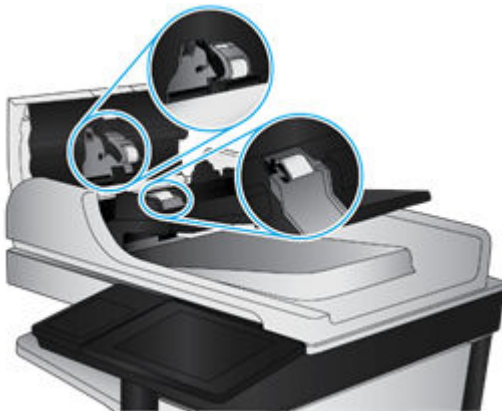

8. If necessary, replace the Document Feeder Kit rollers and separation pad.
Roller replacement kit - Replacement feed rollers for the document feeder: 5851-7202
For instructions: See the Repair Service Manual for this product.
9. Test the document feeder by running a multiple page copy job.
- Should a grinding noise be reported or heard in conjunction with the pick/feed of paper through the ADF, Replace the document feeder (ADF) unit.
 - If the pick/feed issue does not include grinding noise, continue with the recommended action for the specific 31.13.x event/or symptomatic behavior

10. Inspect the ADF pick success sensor, cleaning both the REDI (paper pick success) sensor window and REDI (PAPER PICK SUCCESS) sensor reflector. If there is any dust or fiber remnants, clean by using a can of compressed air to blow out and clean.


Figure 6-208 ADF REDI sensor



- 1 – REDI sensor window
- 2 – REDI sensor reflector
- 3 – ADF hatch

11. Verify that the connections between the automatic document feeder and the SCB are correctly seated.

Figure 6-209 SBC connections

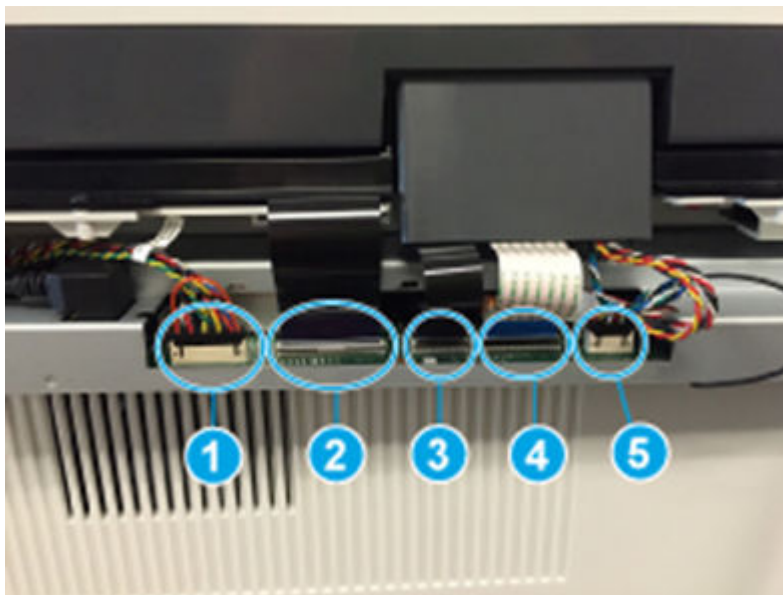

- 1 – Flatbed sensor/motor
- 2 – Flatbed FFC
- 3 – ADF sensor
- 4 – ADF FFC

5— ADF Motor




NOTE: The flat flexible cables (FFC's) on the Scanner Control Board (SCB) are zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are DRAMATICALLY different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 families.

Gate closed



Proper insertion

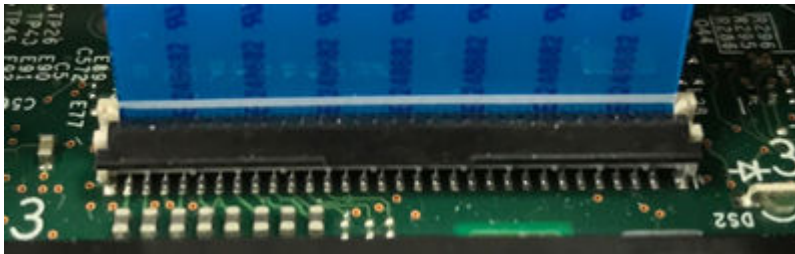

Improper insertion




12. Using the Manual Scanner Sensor Test verify functionality of the ADF Paper Path Pick Success sensor.


- a. Navigate to and select **Support Tools**.




- b. Select **Troubleshooting**.

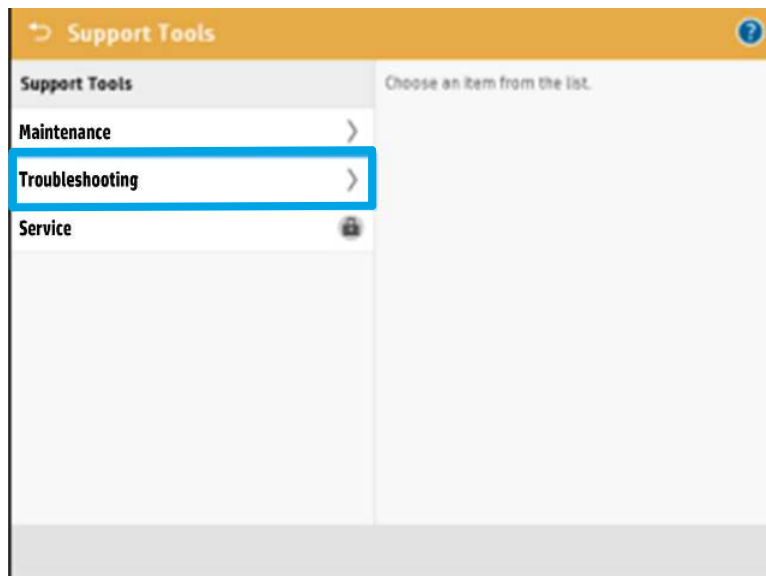


- c. Select **Diagnostic Tests**.

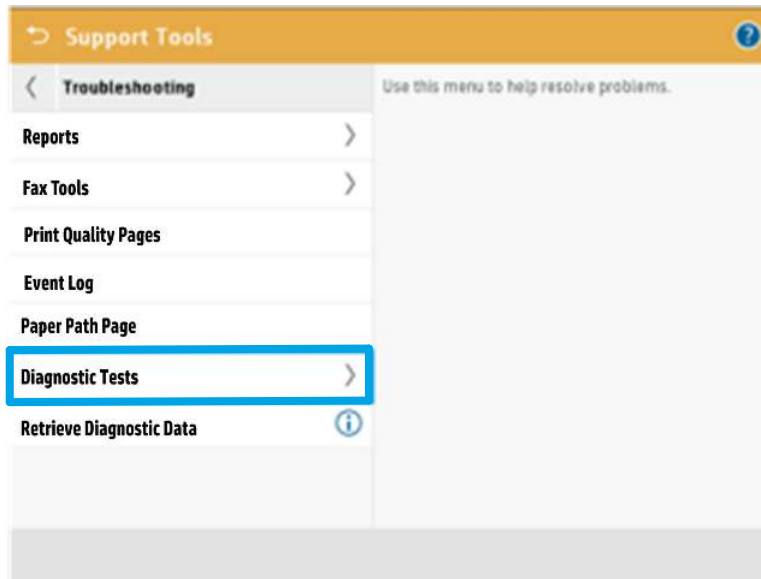


- d. Select **Continue**.

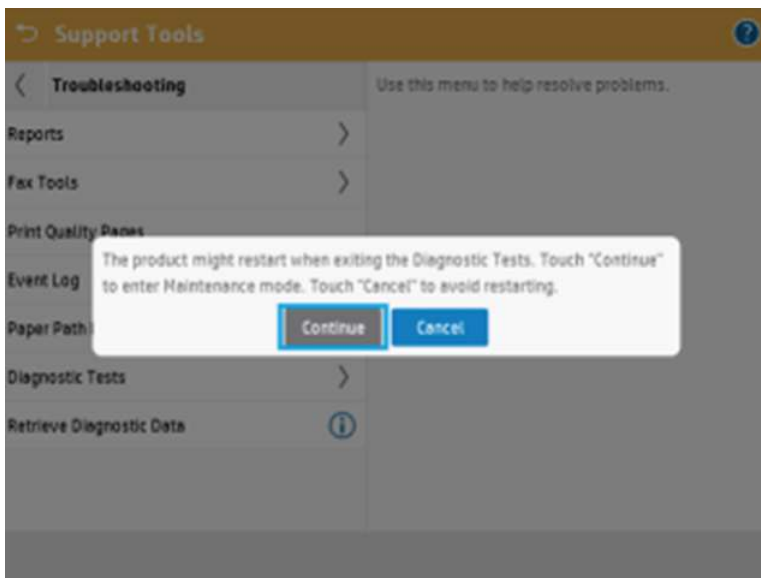

- e. Select **Manual Sensor Test**.

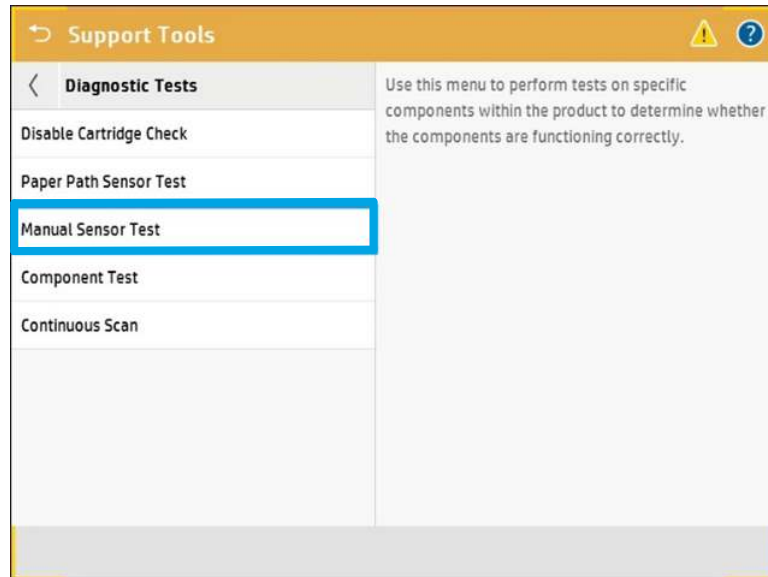

- f. Select **ADF Paper Path Deskew**.

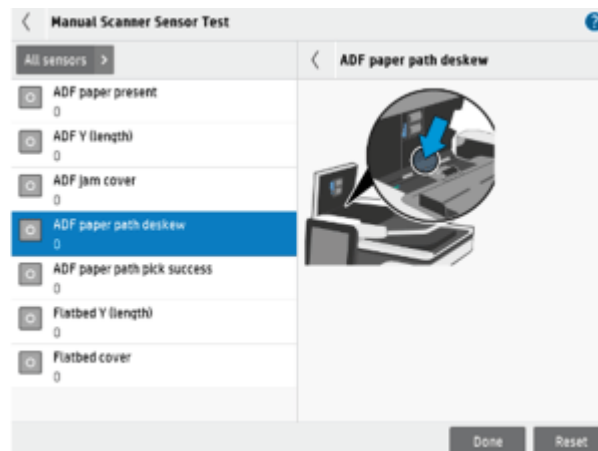

- g. Select **ADF Paper Path Pick Success**.

(Only in FLOW-MODELS)



NOTE: Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advancing.



h. Close the ADF cover and ensure that is secure and closed correctly.

13. Open and close the ADF cover to trigger the ADF Paper Path Pick Success sensor.



 **NOTE:** Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advanced.

14. If the ADF Paper Path Pick Success test fails to advance the count, replace the document feeder.

 **NOTE:** If a grinding noise is heard or reported in conjunction with the pick or feed of paper through the ADF, replace the document feeder (ADF) unit.

Use the table below to order the correct part for your printer. The replacement part for the Document feeder kit (ADF) Enterprise and Workflow series includes white backing and retention clips.

Table 6-93 Document feeder kit for Enterprise (Non-flow models) and Workflow (Flow models) series part numbers

Part description	Part number
Document feeder kit - Enterprise series	5851-7203
Document feeder kit - Workflow series	5851-7204

For instructions: See the Repair Service Manual for this product.

31.13.02

Document feeder job error, feed jam.

The paper passed the pick-success sensor, and then jammed in the automatic document feeder paper path.

This issue might be describe as the following:


- Automatic document feeder jam
- ADF Jamming
- ADF paper jam
- Jams in document feeder

Recommended action for customers

1. Remove any paper in the paper path.


For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

2. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

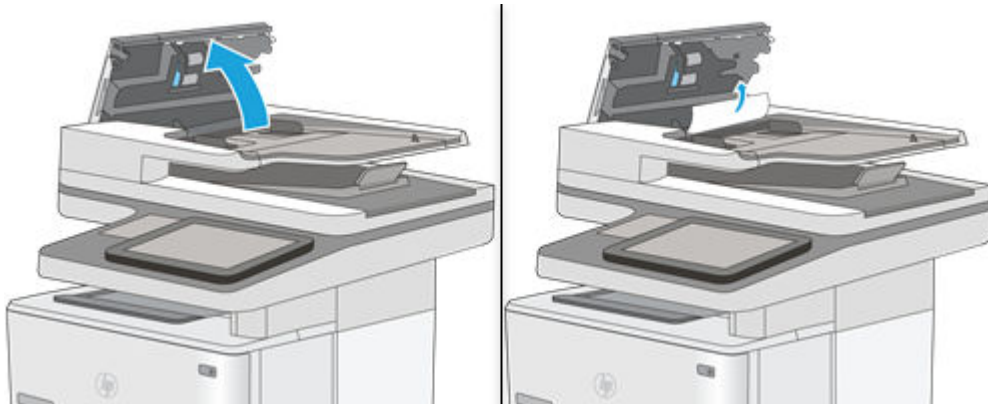


3. Lift the document-feeder input tray and remove any jammed paper.

- a. Lift the document feeder input tray

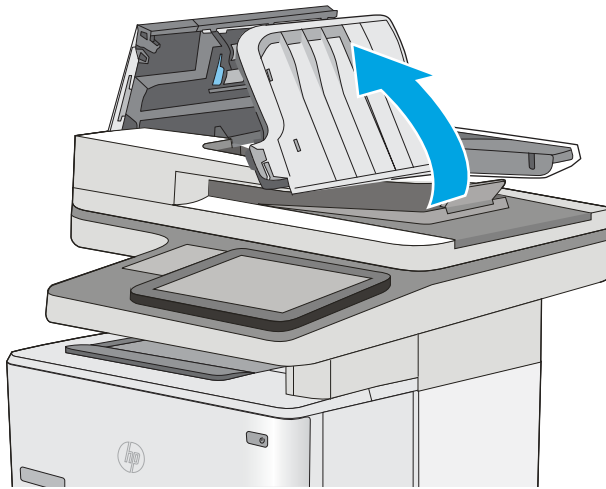

- b. Remove any paper found under the tray.

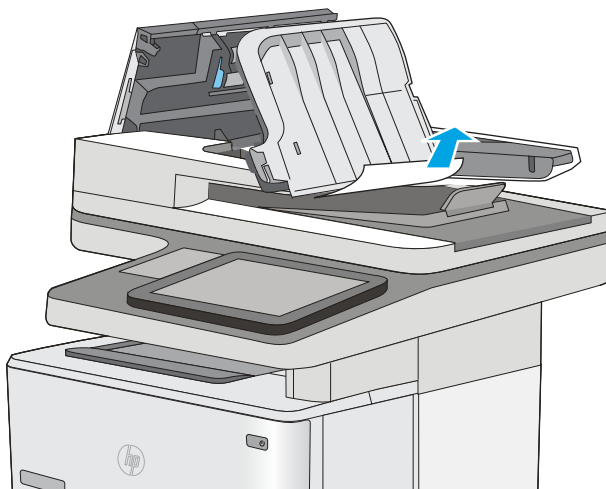


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

4. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path

- a. Open the ADF and remove any paper found.

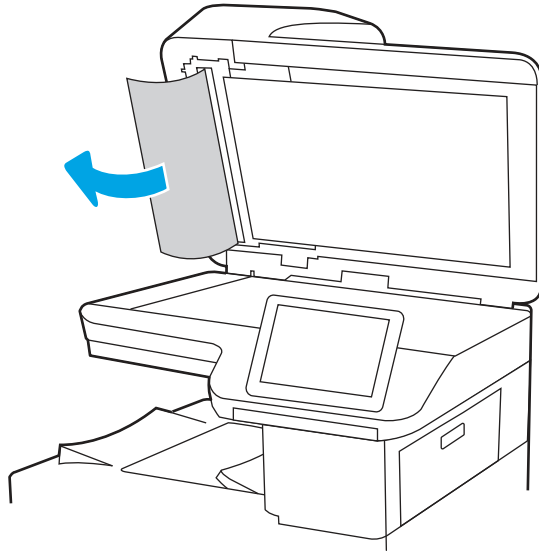

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

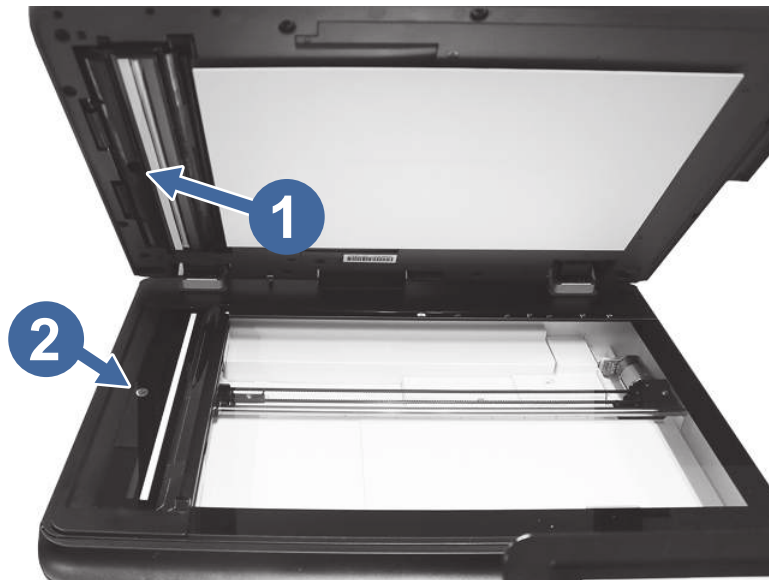

Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.


- c. Close the document feeder.
5. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

6. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-210 Set the ADF guides

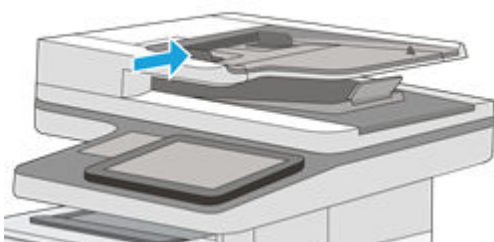


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


7. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

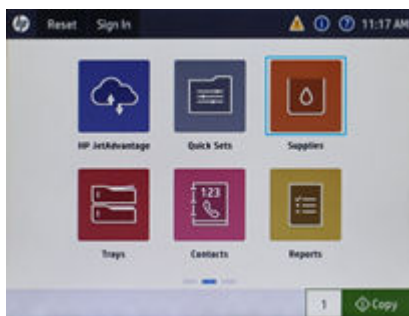

- b. Select **Document Feeder Kit**.

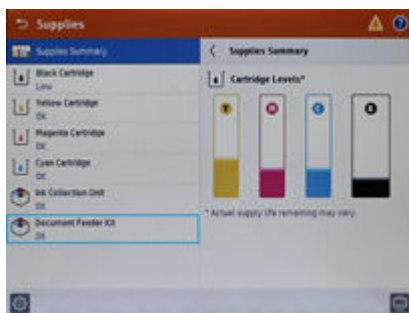


- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

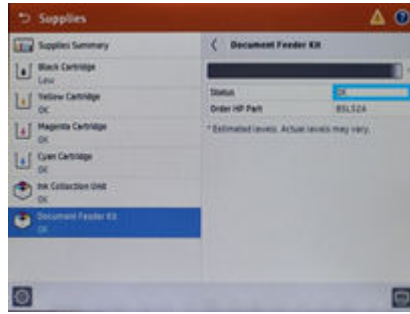

- d. If the status is **Low** or **Very Low** it is recommended that the customer replace the Document Feeder Kit.

Part number: [J8J95A](#)/HP 300 ADF Roller Replacement Kit

8. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

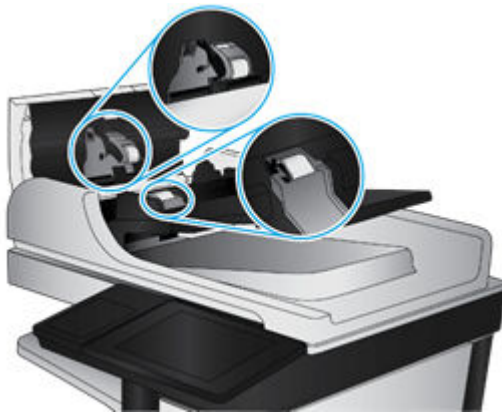

9. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.


Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.


1. Remove any paper in the paper path.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)


2. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

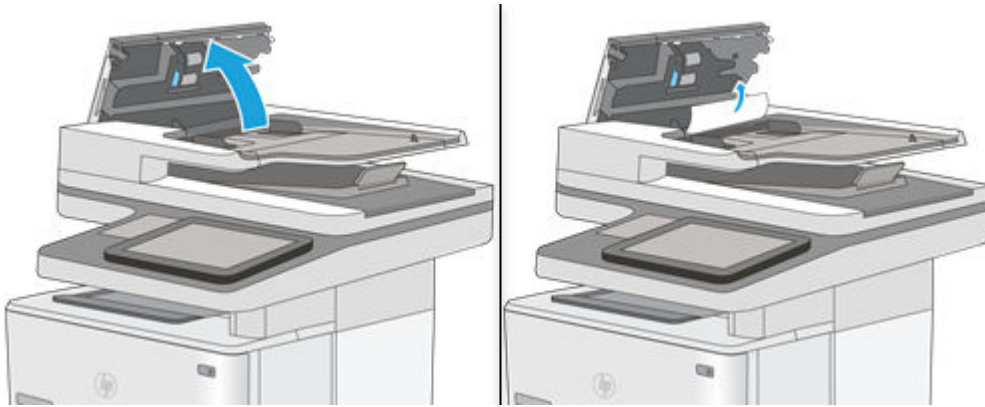

3. Lift the document-feeder input tray and remove any jammed paper.
 - a. Lift the document feeder input tray

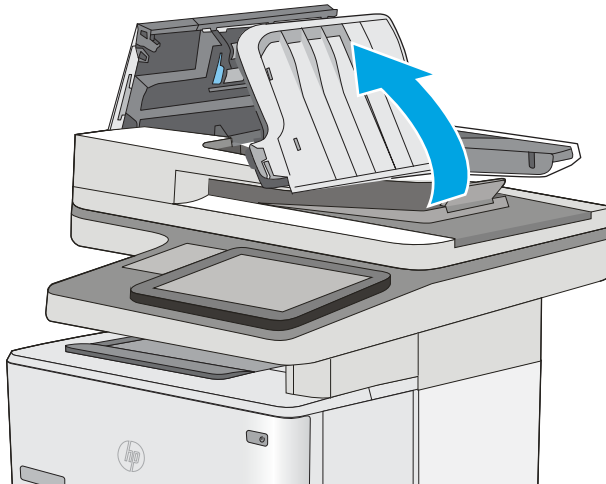

- b. Remove any paper found under the tray.

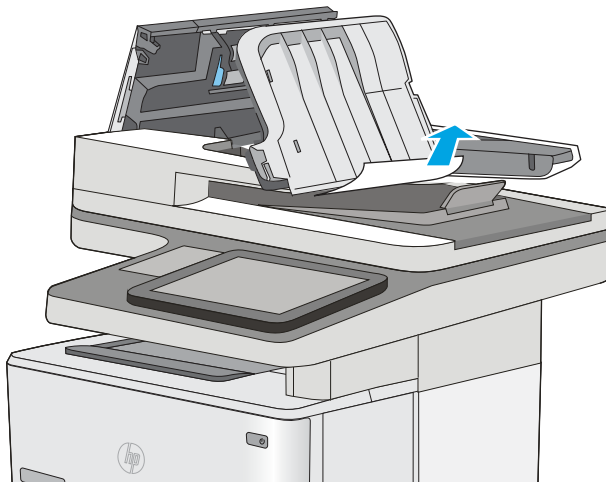


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

- 4. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path
 - a. Open the ADF and remove any paper found.

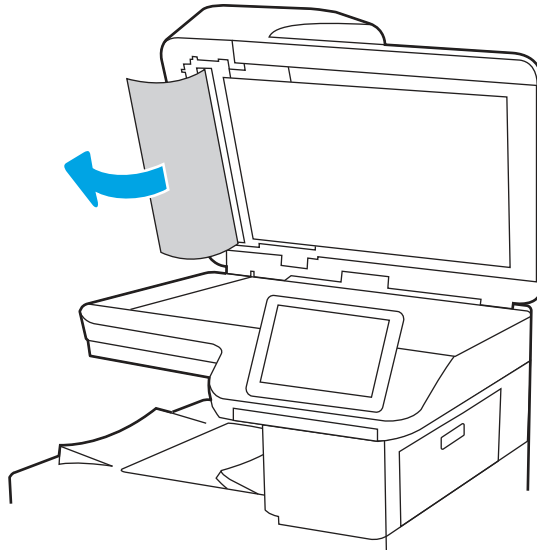

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

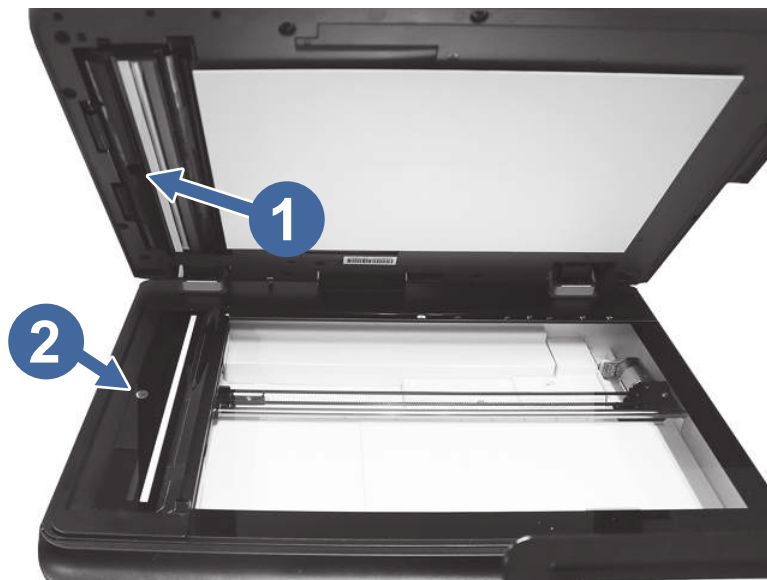

Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.


5. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

6. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-211 Set the ADF guides

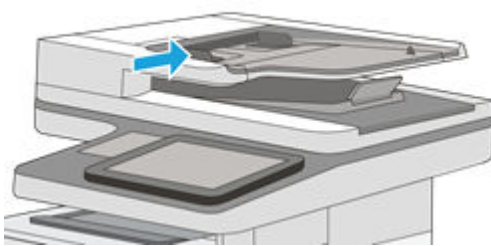


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


7. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

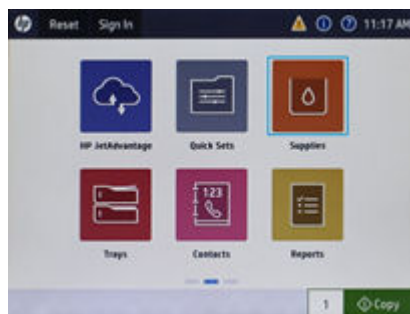

- b. Select **Document Feeder Kit**.

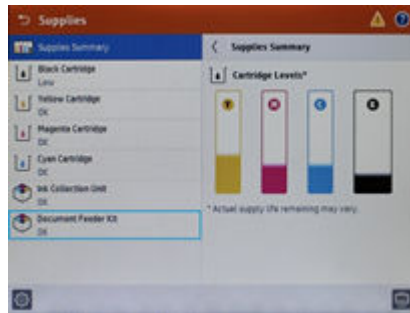

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

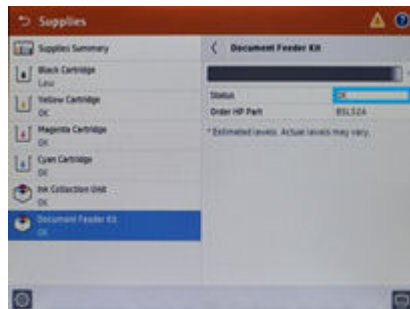


- d. If the status is **Low** or **Very Low** it is recommended that the customer replace the Document Feeder Kit.

Part number: [J8J95A](#)/HP 300 ADF Roller Replacement Kit .

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace 5851-7202 (Roller replacement kit - Replacement feed rollers for the document feeder)

8. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

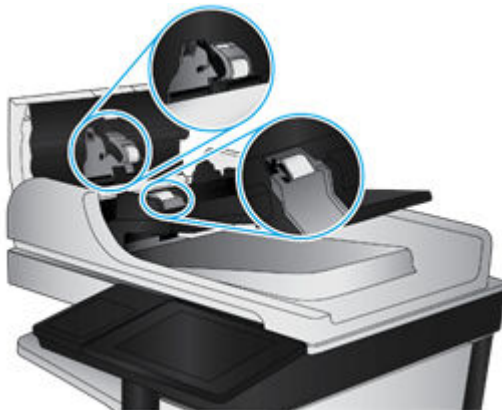

9. If the error persists, replace the Document Feeder Kit rollers and separation pad.

Table 6-94 Roller replacement kit part number

Part description	Part number
Roller replacement kit - Replacement feed rollers for the document feeder	5851-7202

10. If a grinding noise is heard or reported in conjunction with the pick or feed of paper through the ADF, replace the document feeder (ADF) unit.

Use the table below to order the correct part for your printer. The replacement part for the Document feeder kit (ADF) Enterprise and Workflow series includes white backing and retention clips.

Table 6-95 Document feeder kit for Enterprise and Workflow models part numbers

Part description	Part number
Document feeder kit - Enterprise series	5851-7203
Document feeder kit - Workflow series	5851-7204


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.


1. Remove any paper in the paper path.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

2. Open the automatic document feeder lid, pull all the sheets back into the input tray, and then resume the job.
3. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path
 - a. Open the ADF and remove any paper found.

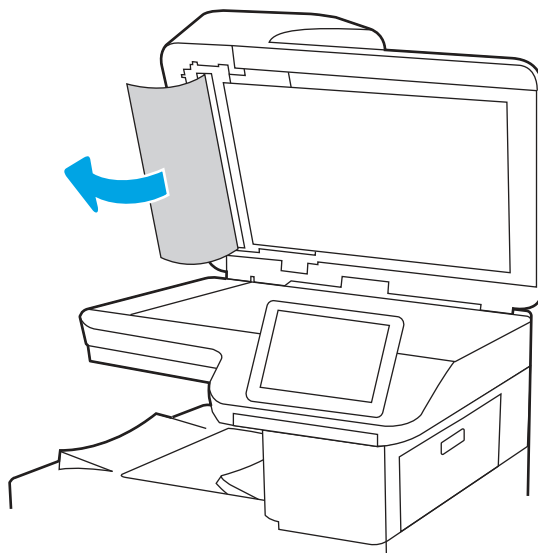

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

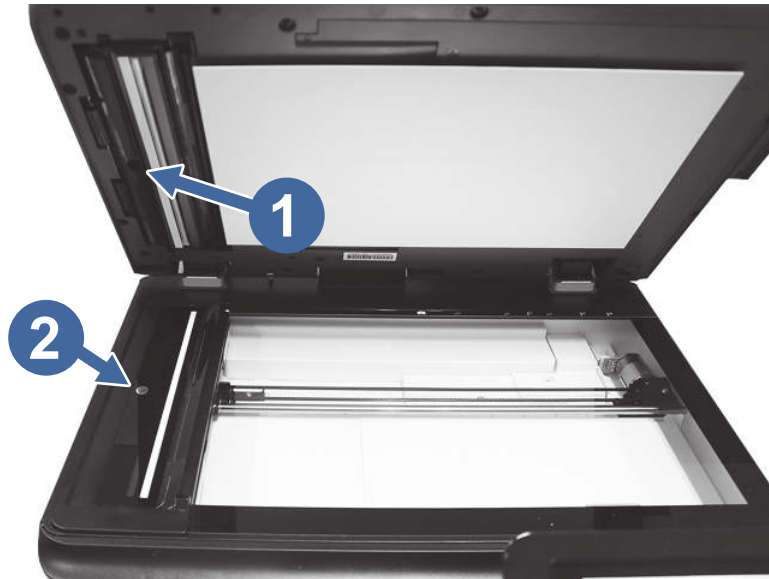

Callout 1: Check for paper blocking this area.


Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.
4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:
Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):
 5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
Make sure that the paper stack is correctly aligned at the center of the input tray when paper is

loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-212 Set the ADF guides

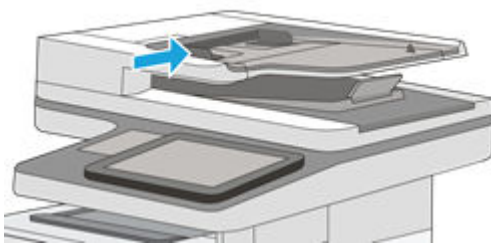


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

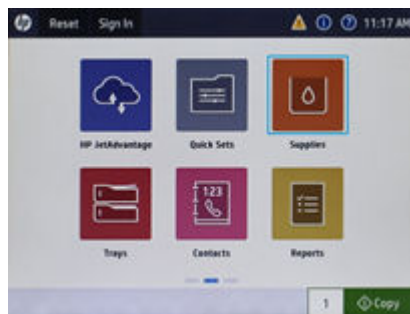

- b. Select **Document Feeder Kit**.

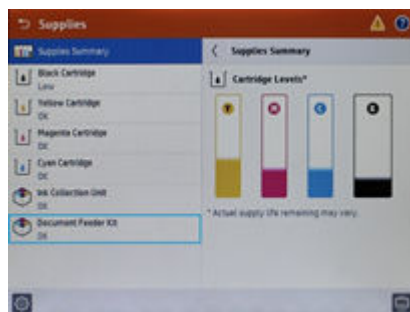

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

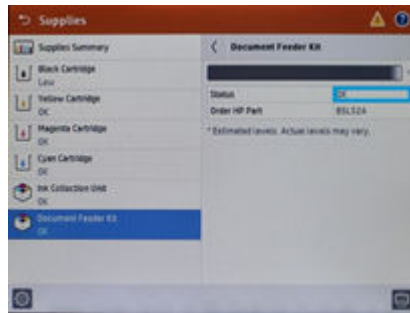

- d. If the status is **Low** or **Very Low** it is recommended that the customer replace the Document Feeder Kit.


Part number: [J8J95A](#)/HP 300 ADF Roller Replacement Kit .

To order parts, go to <https://store.hp.com>



NOTE: Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace 5851-7202 (Roller replacement kit - Replacement feed rollers for the document feeder)


7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

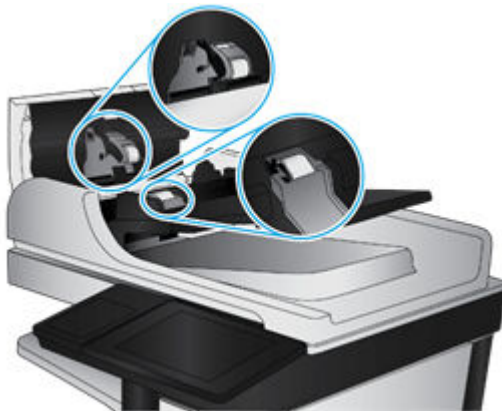

8. If necessary, replace the Document Feeder Kit rollers and separation pad.
Roller replacement kit - Replacement feed rollers for the document feeder: 5851-7202
For instructions: See the Repair Service Manual for this product.
9. Test the document feeder by running a multiple page copy job.
- Should a grinding noise be reported or heard in conjunction with the pick/feed of paper through the ADF, Replace the document feeder (ADF) unit.
 - If the pick/feed issue does not include grinding noise, continue with the recommended action for the specific 3113.x event/or symptomatic behavior

10. Inspect the ADF pick success sensor, cleaning both the REDI (paper pick success) sensor window and REDI (PAPER PICK SUCCESS) sensor reflector. If there is any dust or fiber remnants, clean by using a can of compressed air to blow out and clean.


Figure 6-213 ADF REDI sensor

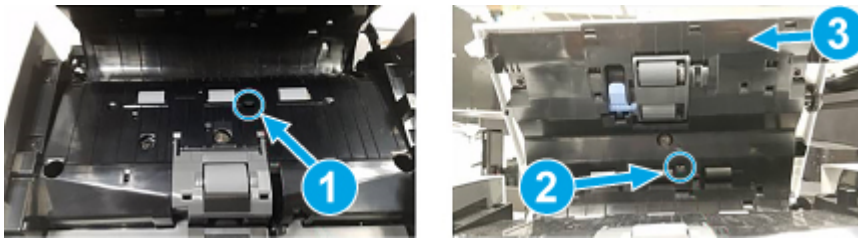

- 1 – REDI sensor window
- 2 – REDI sensor reflector
- 3 – ADF hatch

11. Verify that the connections between the automatic document feeder and the SCB are correctly seated.

Figure 6-214 SBC connections

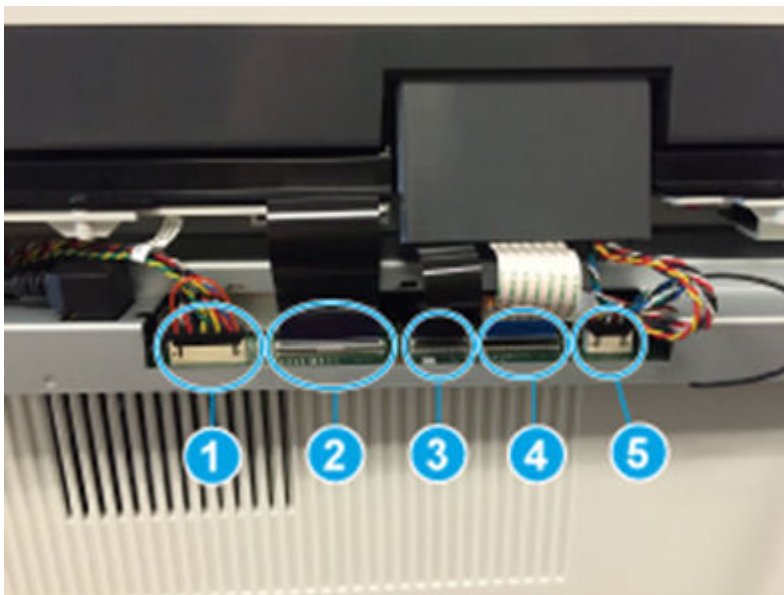

- 1 – Flatbed sensor/motor
- 2 – Flatbed FFC
- 3 – ADF sensor
- 4 – ADF FFC

5— ADF Motor




NOTE: The flat flexible cables (FFC's) on the Scanner Control Board (SCB) are zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are **DRAMATICALLY** different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 families.

Gate closed



Proper insertion

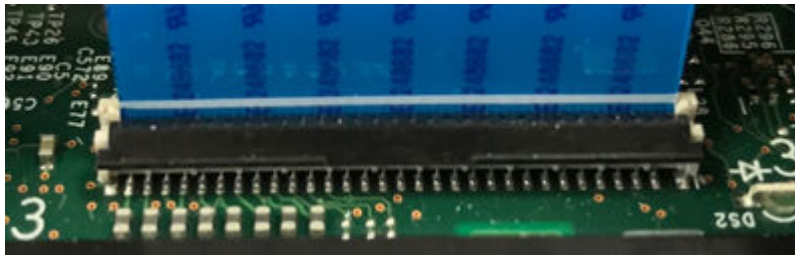


Improper insertion




- Using the Manual Scanner Sensor Test verify functionality of the ADF Paper Path Pick Success sensor.


- a. Navigate to and select **Support Tools**.

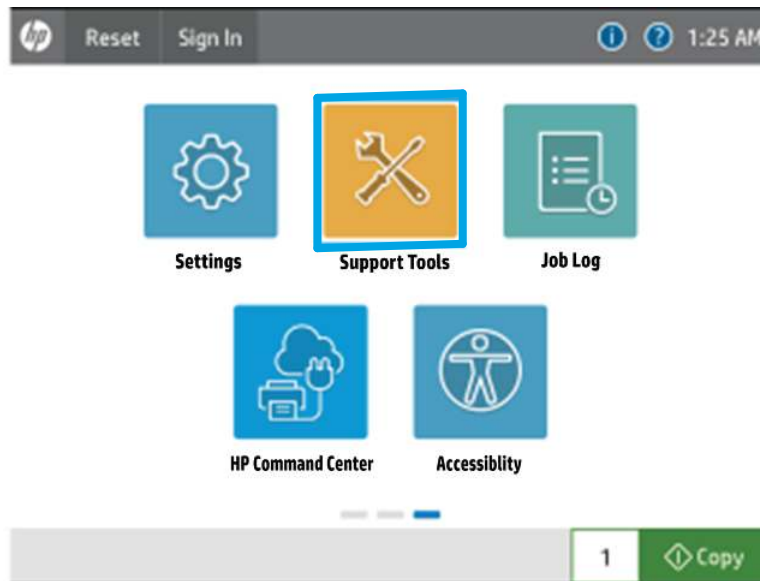


- b. Select **Troubleshooting**.

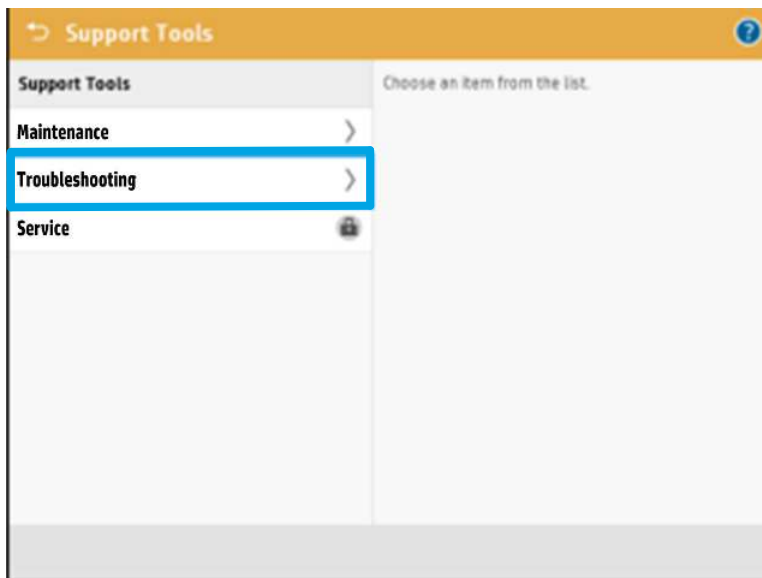


- c. Select **Diagnostic Tests**.

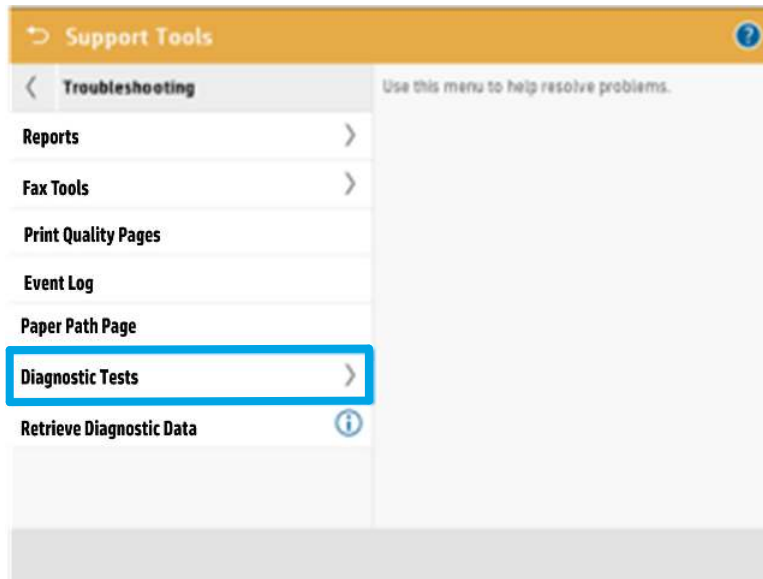

- d. Select **Continue**.

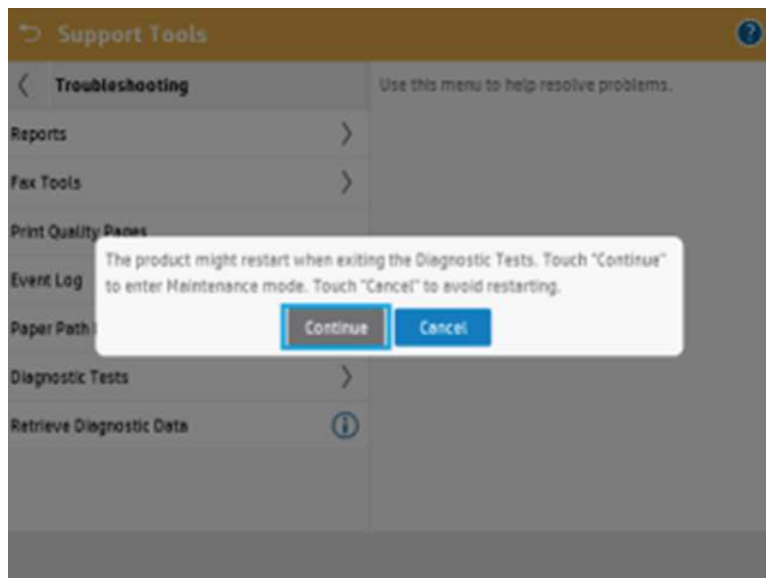

- e. Select **Manual Sensor Test**.

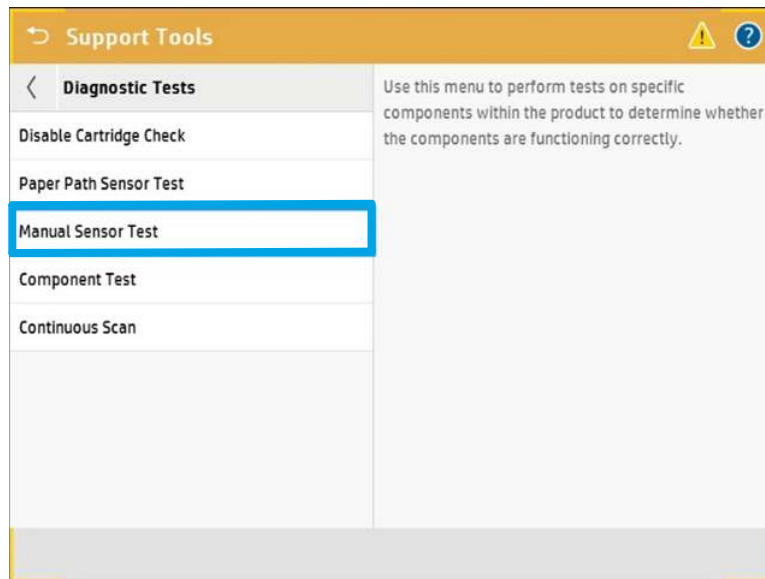

- f. Select **ADF Paper Path Deskew**.




- g. Select **ADF Paper Path Pick Success**.

(Only in FLOW-MODELS)



NOTE: Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advancing.

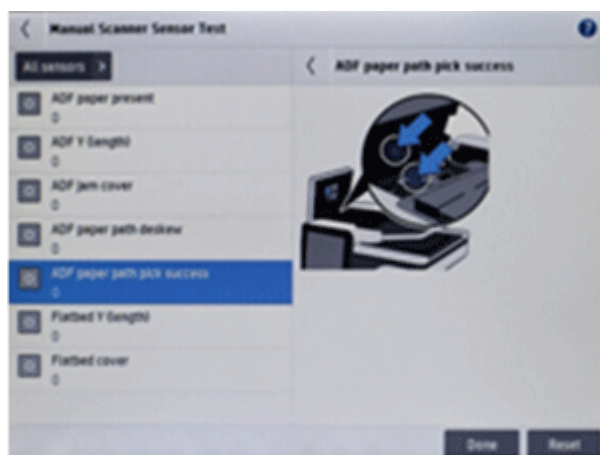

- h. Close the ADF cover and ensure that is secure and closed correctly.
- 13. Open and close the ADF cover to trigger the ADF Paper Path Pick Success sensor.



 **NOTE:** Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advanced.

- 14. If the ADF Paper Path Pick Success test fails to advance the count, replace the document feeder.

 **NOTE:** If a grinding noise is heard or reported in conjunction with the pick or feed of paper through the ADF, replace the document feeder (ADF) unit.

Use the table below to order the correct part for your printer. The replacement part for the Document feeder kit (ADF) Enterprise and Workflow series includes white backing and retention clips.

Table 6-96 Document feeder kit for Enterprise (Non-flow models) and Workflow (Flow models) series part numbers

Part description	Part number
Document feeder kit - Enterprise series	5851-7203
Document feeder kit - Workflow series	5851-7204


For instructions: See the Repair Service Manual for this product.

31.13.13

The document feeder jam access door is open.

Recommended action for customers

1. Open and close the document feeder jam access cover ensuring that the cover latches correctly.

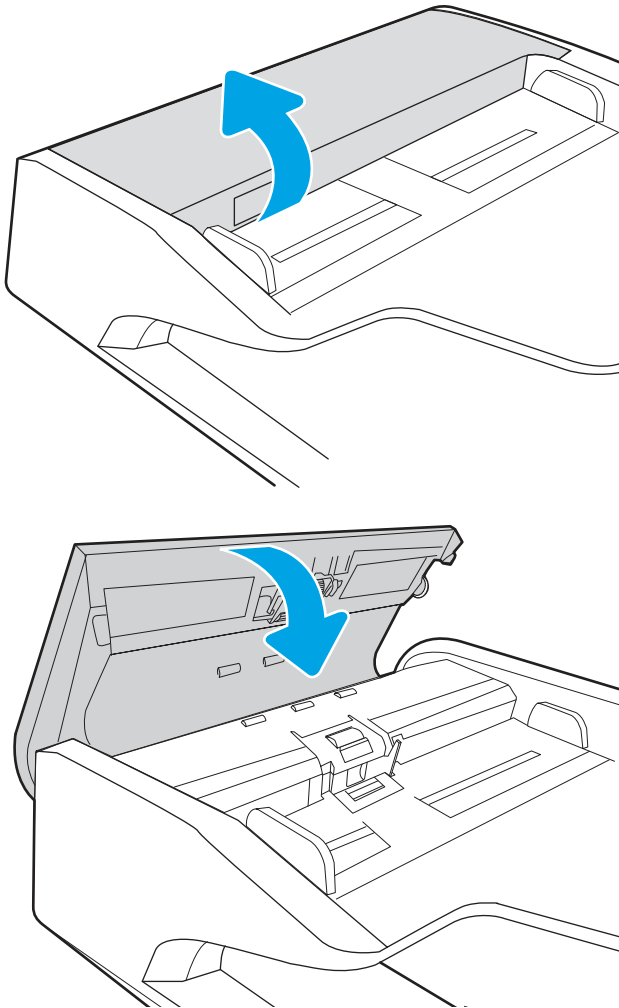

2. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Open and close the document feeder jam access cover ensuring that the cover latches correctly.
2. Verify that the flag is not broken off. Open and close the jam cover and if the sensor status does not change then replace the document feeder.
3. Replace the document feeder.

Document feeder kit part number: 5851-7203

For instructions: See the Repair Service Manual for this product.

FLOW Models document feeder kit part number: 5851-7204

For instructions: See the Repair Service Manual for this product.

31.13.14

Document feeder job error: over-current.

This is a feed jam in the document feeder, and the motor is not turning.

Recommended action for customers

1. Open the document feeder cover, pull all the sheets back into the tray and then resume the job.
2. Verify that the paper being used meets the HP specifications for the printer.
3. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
4. Check and clean the feed rollers and separation pad. If needed, replace the pickup roller assembly and separation pad.
5. If the error persists, please contact HP customer support.

Recommended action for call-center agents and onsite technicians

 **NOTE:** When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB) it's important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 printers.

Figure 6-215 Gate Closed

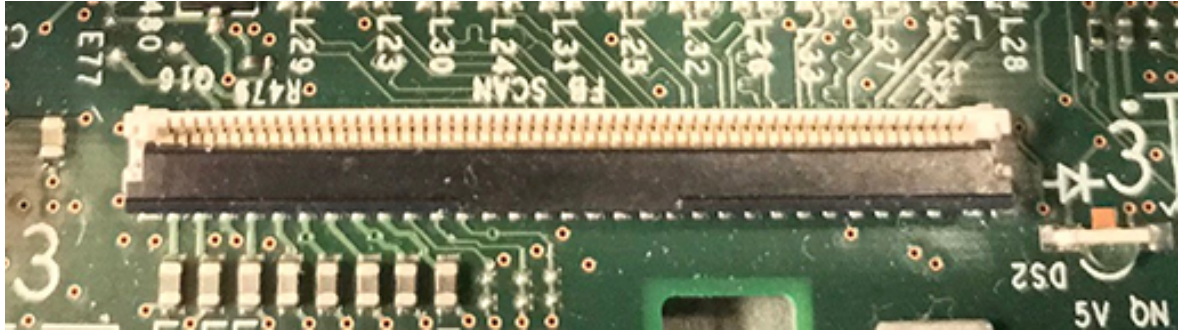


Figure 6-216 Proper Insertion


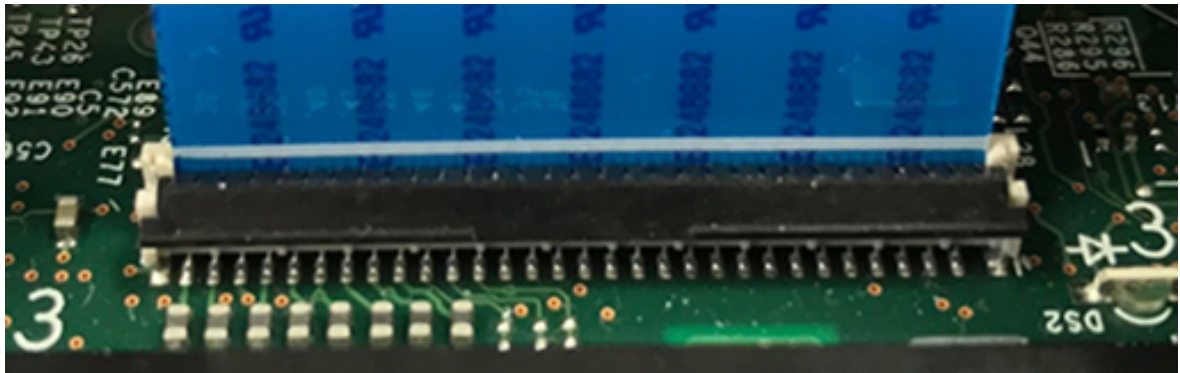


Figure 6-217 Improper Insertion

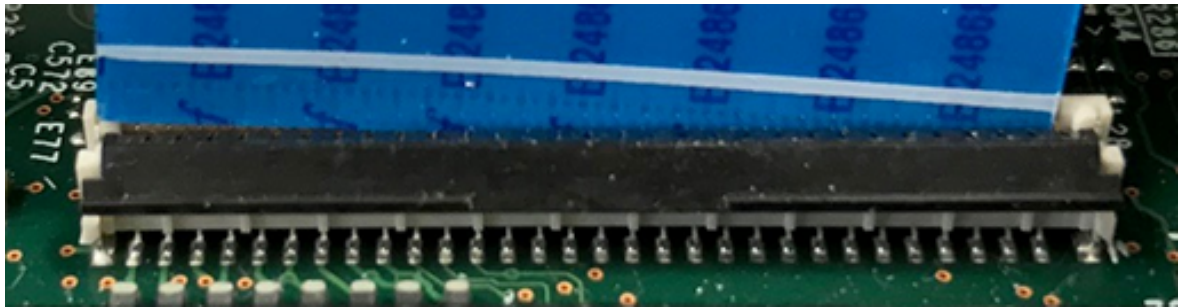

1. Open the document feeder lid, pull all the sheets back into the input tray, and then resume the job.
2. Verify that the paper being used meets the HP specifications for the printer.
3. Ensure that the input tray is not overloaded and the tray guides are set to the correct size.
4. Check the document feeder page count for roller life. If they are past the life of the rollers have the customer purchase a new roller kit.

5. Check and clean the feed rollers and separation pad. If needed, replace the pickup roller assembly and separation pad.
6. Replace the document feeder.


Document feeder kit part number: 5851-7203

For instructions: See the Repair Service Manual for this product.

FLOW Models document feeder kit part number: 5851-7204

For instructions: See the Repair Service Manual for this product.

7. Before replacing the document feeder, the on-site technician should verify that all cables are connected correctly on the SCB.

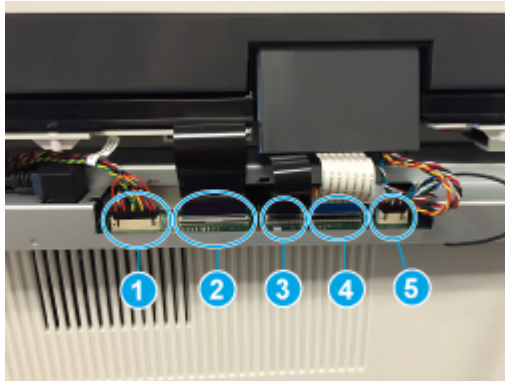

- 1 – Flatbed sensor/motor
- 2 – Flatbed FFC
- 3 – ADF sensor
- 4 – ADF FFC
- 5 – ADF motor

32.WX.YX error messages

32.* errors

Errors in the 32.* family are related to either product start events or to backup and restore events.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. Retry the job.

32.08.A1, 32.08.A2, 32.08.A3

An event related to starting the printer.

32.08.A1 (event code)

Shutdown event. Boot after abnormal shutdown.

32.08.A2 (event code)

Boot from normal shutdown event.

32.08.A3 (event code)

Regular boot event.

Recommended action

There is no action needed for this message.

- No action necessary.

32.1C.05

The restore job ticket was submitted with invalid credentials.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Verify the credentials that were submitted.
2. Check the domain, user name, and password.

32.1C.06 (event code)

The backup job ticket was submitted with invalid credentials.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Verify the credentials that were submitted.
2. Check the domain, user name, and password.

32 . 1C . 07 (event code)

Backup restore permissions error.

There was an error during the creation, read, or write of the restore file.

Recommended action

Follow these troubleshooting steps in the order presented.

- Retry the job.

32 . 1C . 08 (event code)

Not enough disk space to perform backup/restore, or a network share issue.

There was an error during the creation, read, or write of the backup file.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Retry the job.
2. Remove stored jobs and retry.
3. If the error persists, try using a larger capacity storage device for the share location and check the network share settings.
4. Check the network share or try setting up a new shared network drive or folder.

32 . 1C . 09 (event code)

Tried to restore a backup file that was not valid for this printer.

The data in the backup file specified in the restore job ticket is no longer valid due to a corruption of the data, or the data is no longer present.

Recommended action

Follow these troubleshooting steps in the order presented.

- Use a valid backup file.

32 . 1C . 0A (event code)

Backup file is invalid.

The data in the backup file specified in the restore job ticket is no longer valid due to a corruption of the data, or the data is no longer present.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Use a valid backup file.

2. Reboot, and then observe the state of the printer.
3. If the error persists, perform a partition clean from the **Preboot** menu.

32.1C.0D (event code)

Backup/restore failed, auto-reboot failed, or the printer might be busy.

Recommended action

Follow these troubleshooting steps in the order presented.

- Reboot, and then retry the backup/restore.

32.1C.11 (event code)

Backup/restore time-out while communicating with the engine.

The backup operation was aborted because the printer is busy.

Recommended action

Follow these troubleshooting steps in the order presented.

- Wait until the printer is idle, and then try again.

32.1C.13, 32.1C.14

Not enough space exists to perform the backup.

The backup was aborted because the disk is at a critical level or full.

Scheduled backup failure.

Recommended action

Follow these troubleshooting steps in the order presented.

- Free up disk space, and then try again.

32.1C.15

The restore operation was aborted because the backup file was created by a previous version of firmware no longer supported by the feature.

Recommended action

Follow these troubleshooting steps in the order presented.

- Use the current backup file.

32.1C.2E

The restore operation was aborted because the printer is busy.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Wait until the printer is idle, and then retry.
2. Turn the printer off then on, and then retry.

32.1C.2F

Reset failure.

Recommended action

Follow these troubleshooting steps in the order presented.

- Turn the printer off, and then on. Retry the job.

32.1C.40

The backup operation completed successfully (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.41

The backup operation encountered an error (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.42

The backup operation completed, but with a warning message (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.43

A component in the backup file is not supported by the current version of firmware and will not be restored (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.44

A component in the backup file is not transferable to another printer and will not be restored (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.45

Some data was not included in the backup file (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.46

An expected component could not be found and was thus not backed up. Because components should be known on backups, this code is a warning (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.47

Some data was not restored from the backup file (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.48

The backup job ticket was submitted using an invalid network path.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Check that a shared folder was provided as part of the network path and not left blank.
2. Check that the server and the shared folder exists.
3. Check that you (or the applicable user) has permission to access the shared folder on the provided server.

32.1C.49

The backup job ticket was submitted with a bad encryption.



NOTE: This would only apply to a web services call to perform a backup with a blank PIN

Recommended action

Follow these troubleshooting steps in the order presented.

- Verify that the encryption personal identification number (PIN) meets the restrictions for the printer.

32.1C.4A

An error occurred when creating the temporary directories used to store the backup files in transition to and from the compressed (ZIP) file.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Retry the job.
2. If this does not resolve the issue, turn the printer off then on again and retry the job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

32.1C.56

Reset aborted. Backup/restore in progress (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.57

Reset aborted (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.58

Unknown reset error (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.60

The restore operation completed successfully (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.61

The restore operation encountered an error.

Recommended action

Follow these troubleshooting steps in the order presented.

- Review the printer's event log to see specific details about the failure.

32.1C.62

The restore operation completed, but with a warning message.

Recommended action

Follow these troubleshooting steps in the order presented.

- Review the error log to see specific details about the failure.

32.1C.68

The restore job ticket was submitted using an invalid network path.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Check that a shared folder was provided as part of the network path and not left blank.
2. Check that the server and the shared folder exist.
3. Check that you (or the applicable user) has permission to access the shared folder on the provided server.
4. Check that the path includes the compressed .ZIP file name as part of the path.

32.1C.69

The restore job ticket was submitted with a bad encryption personal identification number (PIN).

Recommended action

Follow these troubleshooting steps in the order presented.

- Verify the encryption personal identification number (PIN) is the same PIN used to encrypt the backup file.

32.1C.6A

An error occurred when creating the temporary directories used to store the restore files in transition to and from the compressed (ZIP) file.

Recommended action

Follow these troubleshooting steps in the order presented.

- Retry the job.

32 . 1C . 6D

An unusual error occurred when running the restore operation.

Recommended action

Follow these troubleshooting steps in the order presented.

- Retry the job.

33.WX.YZ error messages

33.* errors

Errors in the 33.* family are related to the printer's storage system or the formatter. The component might have been previously installed in another printer and is therefore locked to that other printer. Or, the component might be incorrect for this printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, investigate if the solid state drive (SSD) or hard disk drive (HDD) or formatter are the original ones. If recently swapped or replaced, turn the printer off, install the original SSD/HDD and/or formatter, and then turn the printer on.
3. If the issue persists, locate and notate the complete 33.WX.YZ error message as displayed on the control panel of the printer and contact your HP-authorized service or support provider, or contact customer support at <http://www.hp.com/go/contactHP>.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. If the issue persists, investigate if the solid state drive (SSD) or hard disk drive (HDD) or formatter are the original ones. If recently swapped or replaced, turn the printer off, install the original SSD or HDD and/or formatter, and then turn the printer on.
3. If the formatter/SSD or HDD were recently replaced and the original is unavailable verify the correct formatter/SSD or HDD are installed by referencing the part numbers.
4. If the issue persists, locate and notate the complete 33.WX.YZ error message as displayed on the control panel of the printer. Reference support content for the specific error and take the necessary action.
5. If the error cannot be cleared and you are unable to get the complete error code from the printer, perform a **Partial Clean** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

 **CAUTION:** A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

6. If the error persists, download and from the **Preboot** menu install the latest version of printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

7. If the error persists, elevate the case using the Standard Support Process.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. If the issue persists, investigate if the solid state drive (SSD) or hard disk drive (HDD) or formatter are the original ones. If recently swapped or replaced, turn the printer off, install the original SSD or HDD and/or formatter, and then turn the printer on.
3. If the formatter/SSD or HDD were recently replaced and the original is unavailable verify the correct formatter/SSD or HDD are installed by referencing the part numbers.
4. If the issue persists, locate and notate the complete 33.WX.YZ error message as displayed on the control panel of the printer. Reference support content for the specific error and take the necessary action.
5. If the error cannot be cleared and you are unable to get the complete error code from the printer, perform a **Partial Clean** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

 **CAUTION:** A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

6. If the error persists, download and from the **Preboot** menu install the latest version of printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).
7. If the error persists, elevate the case using the Standard Support Process.

33.01.xx

A save or restore process has occurred.

- **33.01.01** (event code)

A restore process has occurred.

- **33.01.02** (event code)

A save process has occurred.

- **33.01.03** (event code)

Save recover functionality OK after previously being disabled.

Recommended action

See recommended action.

- No action necessary.

33.02.01 Used board/disk installed

Used board or disk installed.

An encrypted board or disk with existing data previously locked to a different printer has replaced the original. If you continue, data is permanently lost.



IMPORTANT: Do not install used formatter boards in HP LaserJet, HP PageWide Enterprise or Managed printers. Only replace the formatter when specifically directed to do so during troubleshooting using the Control Panel Message Document (CPMD). If you see the 33.02.01 event code, it means a used board has been installed, and the settings may be incorrect.

For more information go to, or search for: [HP LaserJet Enterprise, HP LaserJet Managed, HP PageWide Enterprise, HP PageWide Managed - 33.02.01 error or printer name and/or product number changes after replacing the formatter](#) (c06360930).

Recommended action

1. If the firmware has just been upgraded, see: [HP FutureSmart - '33.02.01 Used board/disk installed' error received after updating the firmware from HP FutureSmart 4.8.1 or 4.9 to a newer version](#)
2. Update the printer firmware to the latest version.
3. Press **OK** on the control panel or remotely by using the new Remote Control Panel feature in the Embedded Web Server. The printer will return to a ready state.
4. If the issue persists, reinstall the used board or disk into its original printer.
5. To save the data on the board or disk, turn the printer off. Replace the board or disk with another board or disk.
6. To delete the data on the board or disk and continue, touch the **OK** button.

33.02.02

Save Recover Status Error

The save or recover is disabled, (one or both disabled) (**Event Log Only**)

Recommended action

There is no action needed for this message.

- No action necessary.

33.03.02

Data size mismatch. Unable to recover DCC NVRAM.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Turn the printer off, and then ensure that all the connectors on the DC controller PCA are connected correctly.
3. If the error persists, replace the DC Controller.



NOTE: Make sure to order the correct part number for the printer.

Table 6-97 DC controller PCA part numbers

Description /Printer models	Part numbers
DC controller PC board assembly For printers: M631/M632/M633/E62555/E62565/E62575	RM2-9493-000CN
DC controller For printers: M634/M635/M636/M637	RM3-8458-000CN
DC controller PCA For printers: E62655/E62665/E62675	RM3-7621-000CN

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure that all the connectors on the DC controller PCA are connected correctly.
3. If the error persists, replace the DC Controller PCA.



NOTE: Make sure to order the correct part number for the printer.

Table 6-98 DC controller PCA part numbers

Description /Printer models	Part numbers
DC controller PC board assembly For printers models: M631/M632/M633/E62555/E62565/E62575	RM2-9493-000CN
DC controller For printer models: M634/M635/M636/ M637	RM3-8458-000CN
DC controller PCA For printer models: E62655/E62665/E62675	RM3-7621-000CN

For instructions: See the Repair Service Manual for this product.

33.03.03 Incompatible formatter installed.

This is an EFI BIOS event to prevent booting with the wrong formatter installed.

Recommended action

- Turn the printer off, and then install the correct formatter in the printer.



NOTE: If it is believed that this formatter is the correct part number and model for this printer, install a replacement formatter, and then return the formatter in question to HP for evaluation.

33.03.05 EFI Boot error

EFI BIOS event showing that a replacement formatter Recover attempt was unsuccessful.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-agent

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. If the error persists, ensure to use the **Backup/Restore** feature to save the printer settings, and then perform a **Partial Clean** procedure using the **Preboot** menu.



CAUTION: A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

- a. Turn the printer on.
- b. Press the HP logo that displays in the middle of the screen when you see the “1/8” under the logo.
- c. Use the arrow buttons to highlight **Administrator**, and then press the **OK** button.
- d. Use the arrow buttons to highlight **Partial Clean**, and then press the **OK** button.
- e. Press the **OK** button again.
- f. Press or touch the Home button to return to the main Pre-boot menu and highlight **Continue**, and then press the **OK** button.

The printer will automatically reboot and should return to a Ready state.

3. If the error persists, download and install the latest printer firmware available at [HP Customer Support - Software and Driver Downloads](https://support.hp.com/drivers) (<https://support.hp.com/drivers>).

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

4. If the error persists, replace the formatter.

Table 6-99 Formatter part numbers

Description	Part number
Formatter (main logic) PC board assembly	J8J61-60001

For instructions to remove and replace the formatter: See the Repair Service Manual for this product.

Recommended action for call-agent

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. If the error persists, ensure to use the **Backup/Restore** feature to save the printer settings, and then perform a **Partial Clean** procedure using the **Preboot** menu.

 **CAUTION:** A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

- a. Turn the printer on.
- b. Press the HP logo that displays in the middle of the screen when you see the “1/8” under the logo.
- c. Use the arrow buttons to highlight **Administrator**, and then press the **OK** button.
- d. Use the arrow buttons to highlight **Partial Clean**, and then press the **OK** button.
- e. Press the **OK** button again.
- f. Press or touch the Home button to return to the main Pre-boot menu and highlight **Continue**, and then press the **OK** button.

The printer will automatically reboot and should return to a Ready state.

3. If the error persists, download and install the latest printer firmware available at [HP Customer Support - Software and Driver Downloads](https://support.hp.com/drivers) (https://support.hp.com/drivers).

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

4. If the error persists, remove and reinstall the formatter board.
5. If the error persists, replace the formatter.

Table 6-100 Formatter part number

Description/ Product models	Part number
Formatter (main logic) PC board	J8J61-60001
For products: M631, M632, M633, E62555, E62565, E62575	
Formatter (main logic) PC board	3GY14-67901
For products: E62655/E62665/E62675	

Table 6-100 Formatter part number (continued)

Description/ Product models	Part number
Kit -Formatter	3GY14-67902
For products: E62655/E62665/E62675 (India/China)	
Formatter	7PS94-67901
For products: M634, M635, M636, M637 (India/China)	
Formatter	7PS94-67902
For products: M634, M635, M636, M637	

For instructions to remove and replace the formatter: See the Repair Service Manual for this product.

6. If the error persists, elevate the issue using the Standard Support Process.

33.03.06

The memory PCA was not detected on startup.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for agent and onsite technician

1. Turn the printer off, and then on again.
2. If the error persists, turn the printer off, disconnect the power cord, and remove the formatter cover. Press firmly on the memory PCA cable connection to the formatter.
3. If the error persists, replace the memory PCA assembly.

Part number: RM2-7645-000CN

33.04.01 Missing TPM

A Trusted Platform Module is missing from a printer that previously had a TPM installed.

TPM accessory (optional): This system is using a TPM module installed as an accessory to protect data and it is not present. The original TPM must be returned or you can select the [Stop Using](#) option in the preboot TPM sub-menu. All data will be cryptographically erased and a reload of firmware from USB might be required.

TPM Standard (Standard on product): This system is using a TPM module installed at the factory to protect data and it is not present. Verify that the TPM is seated firmly on the formatter, in case of shifting during shipment. If the TPM has been removed for a formatter replacement, put the original TPM on the board. If the original TPM cannot be reinstalled or has become damaged, **DO NOT** replace any parts. Replace the printer.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Reinstall the missing TPM module into the printer.



NOTE: If the TPM accessory was installed, you can also go to the [Administration](#) menu and under TPM, select the [Stop Using](#) option if you no longer want to use the TPM accessory.

3. Restart the printer.

33.04.02 Missing TPM

The wrong TPM is installed on a printer that previously had a different TPM installed.

TPM Optional device: This system is using a TPM module to protect data and it is not present. The original TPM module must be returned or you may select the **Stop Using** option in the preboot TPM sub-menu.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Reinstall the original TPM module into the printer.
3. Restart the printer.
4. Go to the [Administration](#) menu and under TPM and select the [Enable and Use](#) option.



NOTE: To no longer use the TPM device, go to the [Administration](#) menu and under TPM and select the [Stop Using](#) option.

33.04.03 Unknown TPM

A used TPM has been installed on a printer that has not previously had a TPM installed.

TPM Optional device: This system is using a TPM module to protect data and it is not present. The TPM module currently installed is used to protect data in another device. The original TPM module must be returned or you can start using this TPM module by selecting the [Enable and Use](#) option in the preboot TPM sub-menu. You can also stop using a TPM altogether.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off and remove the TPM module. The printer will not be protected.
2. If choosing to protect the printer with the used TPM, refer to the "Install a new or re-enable an existing TPM after disabling a previous TPM" section of the <http://h10032.www1.hp.com/ctg/Manual/c04499622> (c04499622).

33.04.05

TPM (Trusted Platform Module) Security Error

This system contains a TPM module that is not supported on the device or belongs to another device.

TPM is unique for each device.

For units that shipped with a TPM on board standard (most newer models): If the original TPM installed in the factory is unavailable or damaged, DO NOT replace any parts. Follow the recommended action.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order they are listed.

The technician will need to re-establish the trusted platform module state in the printer.



NOTE: Never replace the TPM on a unit that shipped with one. The TPM that can be ordered is only available for adding a level of security on a device that never had a TPM paired from the factory. A new TPM cannot be installed for security reasons.

1. Do **not** replace the formatter or HDD. It will not solve this issue.
2. Perform a Format Disk procedure, select **Continue** in the Pre-boot menu, and then reboot the device.
 - If the unit boots to a 33 . 04 . 05 error, reseal the eMMC or HDD.
 - If the unit continues to boot to a 33 . 04 . 05 error, continue to the next step.
3. Perform a Format Disk procedure again, and then reboot the device.
 - If the unit boots to a 99 . 09 . 67 error, reboot the device, and then update the firmware. This should resolve the issue.
 - If the unit continues to boot to a 33 . 04 . 05 error, continue to the next steps.
4. Remove the TPM and eMMC or HDD, open **Startup Options**, and then perform a Cold Reset.



WARNING! When removing the TPM, take extreme care as the connector on the TPM board can become dislodged and break. If this happens, a printer replacement will be required.

5. Reinstall the eMMC or HDD, open the Pre-boot menu, select **Manage Disk**, select **Boot Device**, and then select **Erase Unlock**.
 - If unit boots to a 99 . 09 . 67 error, reboot the device, and then update the firmware. This should resolve the issue.
 - If the unit continues to boot to a 33 . 04 . 05 error, continue to the next step.

6. Reseat the TPM and eMMC or HDD, perform a Format Disk, open Diagnostics, and then run diagnostics for all components.
 - If the Diagnostics fail, elevate the case to ATS and include all details.
 - If Diagnostics passes, continue to the next steps.
7. Remove the TPM and eMMC or HDD, open **Startup Options**, and then perform a Cold Reset.
8. Reinstall the eMMC or HDD, open the Pre-boot menu, select **Manage Disk**, select **Boot Device**, select **Erase Unlock**, and then reboot the device.
 - If the unit boots to a 99.09.67 error, reboot and then update the firmware. This should resolve the issue.
 - If the unit continues to boot to a 33 . 04 . 05 error, continue to the next step.
9. Include the following information in the CDAX case notes, and then elevate the case to ATS. No additional feedback is needed.



NOTE: Ensure that all original printer parts are installed on the unit at the time of elevation.

- Printer serial number.
- Collect the Diagnostic log file (.jdp file).
- Information when the 33 . 04 . 05 error displayed on the printer control panel.
- Parts replaced prior to the error displaying on the printer control panel.

33 . 05 . 0z SureStart errors

A SureStart error has occurred.

The printer detected and recovered from a corrupted version of BIOS.

- **33.05.01** Boot code corrupt (event code)
- **33.05.02** Boot code corrupt (event code)
- **33.05.03** Boot code corrupt (event code)

The newly downloaded firmware failed to cryptographically validate the BIOS code.

- **33.05.04** Security alert
- **33.05.04** Upgrade corrupt (event code)
- **33.05.05** Security alert
- **33.05.05** Boot code corrupt (event code)
- **33.05.06** Security alert
- **33.05.06** Upgrade corrupt (event code)
- **33.05.07** Security alert
- **33.05.07** Upgrade corrupt (event code)

- **33.05.08** Invalid boot attempt (event code)
- **33.05.09** Downgrade attempted (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

- **For 33.05.01, 33.05.02, and 33.05.03 errors:** No action is necessary.
- **For all other errors:** Download a firmware bundle to the printer from the Preboot menu.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)



NOTE: For more information on SureStart, search for: "SureStart Whitelisting and Intrusion Detection Troubleshooting Manual" (c04863614).

33.05.1x Whitelisting errors

An error occurred with a firmware file digital signature or an error with the certificate used to validate the firmware file certificate.

- **33.05.10** Security alert
- **33.05.10** Firmware verification Error: XX (Event code)
- **33.05.11** Security alert
- **33.05.11** Firmware verification Error: XX (Event code)
- **33.05.12** Security alert
- **33.05.12** Firmware verification Error: XX (Event code)

Recommended action

Follow these troubleshooting steps in the order presented.

1. Perform a [Format Disk](#) procedure.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16).

2. If the device does not reboot to [Ready](#), download a firmware bundle to the device from the Preboot menu.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)



NOTE: Performing a Format Disk procedure is required before downloading a firmware bundle.

For more information on SureStart, go to: (Doc ID: c04863614). [HP SureStart Whitelisting and Intrusion Detection Troubleshooting Manual](#)

33.05.2x Intrusion detection errors

The intrusion detection system has encountered an error.

The intrusion detection memory process determined an unauthorized change in system memory.

- **33.05.21** Security alert
- **33.05.21** Potential intrusion (Event code)

The intrusion detection memory process heartbeat was not detected.

- **33.05.22** Security alert
- **33.05.22** Cannot scan for potential intrusions (Event code)

The intrusion detection memory process did not initialize.

- **33.05.23** Security alert
- **33.05.23** Intrusion detection not initialized (Event code)
- **33.05.24** Intrusion detection initialization error (Event code)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.



NOTE: Selecting [Continue](#) from the Preboot menu will not resolve the error. The printer must be turned off, and then on to clear the error allowing the printer to reboot to a [Ready](#) state.

Information on the Intrusion Detection error.

For more information on SureStart, go to: [HP SureStart - Whitelisting and Intrusion Detection Troubleshooting Manual](#) (Doc ID: c04863614).

33.05.5z Intrusion detection errors

The intrusion detection system has encountered an error.

The intrusion detection memory process determined an unauthorized change in system memory.

- **33.05.51** Security alert
- **33.05.51** Potential intrusion (Event code)

The intrusion detection memory process heartbeat was not detected.

- **33.05.52** Security alert
- **33.05.52** Cannot scan for potential intrusions (Event code)

The intrusion detection memory process did not initialize.

- **33.05.53** Security alert
- **33.05.53** Intrusion detection not initialized (Event code)
- **33.05.54** Intrusion detection initialization error (Event code)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.



NOTE: Selecting [Continue](#) from the Preboot menu will not resolve the error. The printer must be turned off, and then on to clear the error allowing the printer to reboot to a [Ready](#) state.

Information on the Intrusion Detection error.

For more information on SureStart, go to: [HP SureStart - Whitelisting and Intrusion Detection Troubleshooting Manual](#) (Doc ID: c04863614).

33.06.01

The firmware is not able to detect the correct memory chip on the formatter.

This issue occurs because the wrong formatter was installed in the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Remove the formatter that was installed and reinstall the original or order the correct formatter for the printer.

3. Reinstall all the parts including HDD/eMMC, TPM and any additional accessories.
4. Reload firmware from a USB stick using the pre-boot menu if necessary.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

40.WX.YZ error messages

40.* errors

Errors in the 40.* family are related to input/output accessories, such as USB storage devices, Jetdirect cards, or EIO cards or on-board network functions.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Touch the **OK** button to clear the error.
2. Remove and then reinstall the accessory.

40 . 00 . 01 USB I/O buffer overflow To continue, touch “OK”

The USB buffer has overflowed.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to print the transferred data (some data might be lost).
2. Check the host configuration.

40 . 00 . 02 Embedded I/O buffer overflow To continue, touch “OK”

The product has experienced a JetDirect buffer overflow.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to print the transferred data (some data might be lost).
2. Check the host configuration.

40 . 00 . 03 EIO [x] buffer overflow To continue, touch “OK”

Too much data was sent to the EIO card in the specified slot (x). An incorrect communications protocol might be in use.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to print the transferred data (some data might be lost).

40 . 00 . 04 EIO [x] bad transmission To continue, touch “OK”

The connection between the product and the USB device has been broken.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to clear the error message and continue printing.
2. Remove, and then reinstall the USB device.

40 . 00 . 05 Embedded I/O bad transmission To continue, touch OK

The USB device has been removed.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to clear the error message (data will be lost).
2. Install the USB device.

40 . 08 . 0x USB storage accessory removed

The USB storage accessory has been removed.

x = 0 or 1; information code.

Secure file erase is enabled.

Recommended action

See recommended action.

- No action necessary.

40 . 0x . 05 USB storage accessory removed

The USB storage accessory was removed.

x = 1, 2, 3, 5, or 6; information code.

Recommended action

See recommended action.

- No action necessary.

40 . 80 . 04 Failed to read NVRAM

Cannot read contract-requested value from NVRAM

Either the value was not populated or NVRAM was unreadable

Recommended action

- Turn printer off, and then on.

41.WX.YZ error messages

41.01.YZ

Event log error message: 41.01.YZ.

An unknown misprint error occurred on the printer.

Y = Type, Z = Tray

- Y = 0: Photo Paper (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light Paper 1, 2, or 3 mode
- Y = 4: Heavy Paper 1
- Y = 5: Heavy Paper 2
- Y = 6: Heavy Paper 3
- Y = 7: Glossy Paper 1
- Y = 8: Glossy Paper 2
- Y = 9: Glossy Paper 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode
- Z = 0: From unknown tray
- Z = 1: From Tray 1
- Z = 2: From Tray 2
- Z = 3: From Tray 3
- Z = 4: From Tray 4
- Z = 5: From Tray 5
- Z = 6: From Tray 6
- Z = 7: From Tray 7
- Z = 8: From Tray 8

- Z = 9: From Tray 9
- Z = D: From duplex

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. If the error is not cleared, press the power button to turn off the printer, and then to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. If the error is not cleared, turn the printer off, and then on.
3. If the error persists, replace the laser scanner assembly.



NOTE: Ensure to include instructions for the onsite technician to check the wire harness from the laser scanner assembly to the DC controller.

Table 6-101 Laser scanner assembly part numbers

Description	Part numbers
Laser scanner assembly	RM2-0906-000CN

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. If the error is not cleared, turn the printer off, and then on.
3. If the error returns, check if the wire harness from the laser scanner assembly to the DC controller are seated correctly.
4. If the error persists, replace the laser scanner assembly.

Table 6-102 Laser scanner assembly part numbers

Description	Part numbers
Laser scanner assembly	RM2-0906-000CN

For instructions: See the Repair Service Manual for this product.

5. If the error persists, replace the DC Controller PCA.



NOTE: Make sure to order the correct part number for the printer.

Table 6-103 DC controller PCA part numbers

Description /Printer models	Part numbers
DC controller PC board assembly For printers models: M631/M632/M633/E62555/E62565/ E62575	RM2-9493-000CN
DC controller For printer models: M634/M635/M636/ M637	RM3-8458-000CN
DC controller PCA For printer models: E62655/E62665/E62675	RM3-7621-000CN

For instructions: See the Repair Service Manual for this product.

41.02.00 Error

A beam detected misprint error occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. If the error is not cleared, press the power button to turn off the printer, and then to turn on the printer.
3. If the error persists, attempt to remove and reinstall the toner cartridge.



IMPORTANT: Ensure that the printer is using genuine HP supplies.

- a. Press the cartridge door release button to open the door.
- b. Pull out the cartridge drawer.
- c. Grasp the handle of the toner cartridge and pull it up to remove the toner cartridge from the printer.
- d. Check if genuine HP toner cartridges are installed.

A genuine HP toner cartridge has the word "HP" on it, or has the HP logo on it. For more information on identifying HP cartridges go to <http://www.hp.com/go/learnaboutsupplies>.
- e. Insert the toner cartridge in the cartridge drawer.
- f. Close the toner cartridge drawer.
- g. Close the cartridge door.

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error message.
2. If the error is not cleared, press the power button to turn off the printer, and then to turn on the printer.
3. If the error persists, swap out or reseal the toner cartridge.
4. Ensure that the toner cartridges is a genuine HP supply.

A genuine HP toner cartridge has the word "HP" on it, or has the HP logo on it. For more information on identifying HP cartridges go to <http://www.hp.com/go/learnaboutsupplies>.

5. If the error persists, replace the laser scanner assembly.

Table 6-104 Laser scanner assembly part number

Description	Part number
Laser scanner assembly	RM2-0906-000CN

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error message.
2. If the error is not cleared, press the power button to turn off the printer, and then to turn on the printer.
3. If the error persists, reseal the toner cartridge.
4. Ensure that the toner cartridges is a genuine HP supply.

A genuine HP toner cartridge has the word "HP" on it, or has the HP logo on it. For more information on identifying HP cartridges go to <http://www.hp.com/go/learnaboutsupplies>.

5. If the error persists, check if the wire harness from the laser scanner to the DC controller is seated correctly.

6. If the error persists, reset the following connectors on the DC controller: J205 and J606.

Figure 6-218 DC controller PCA connector locations

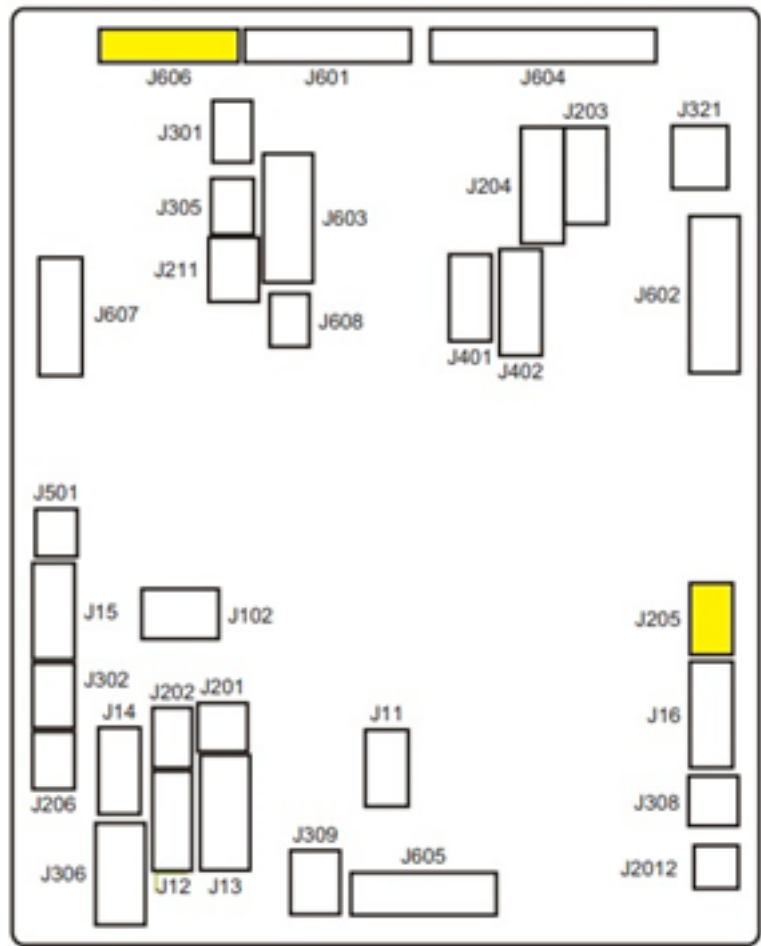


Table 6-105 DC controller PCA connections/ Laser scanner assembly connectors

Item	Description
J205	Laser scanner assembly
J606	Laser scanner assembly

7. If the error persists, replace the laser scanner assembly.

Table 6-106 Laser scanner assembly part numbers

Description	Part numbers
Laser scanner assembly	RM2-0906-000CN

For instructions: See the Repair Service Manual for this product.

8. If the error persists, replace the DC Controller PCA.

 **NOTE:** Make sure to order the correct part number for the printer.

Table 6-107 DC controller PCA part numbers

Description /Printer models	Part numbers
DC controller PC board assembly For printers models: M631/M632/M633/E62555/E62565/ E62575	RM2-9493-000CN
DC controller For printer models: M634/M635/M636/ M637	RM3-8458-000CN
DC controller PCA For printer models: E62655/E62665/E62675	RM3-7621-000CN

For instructions: See the Repair Service Manual for this product.

41 . 03 . FZ Unknown Misprint Error

This is a general misprint error. Either the paper is loaded off-center with the guides in the tray, or a paper width sensor failure occurred from an unknown tray.

The error will be one of the following:

- 41 . 03 . F0
- 41 . 03 . F1
- 41 . 03 . F2
- 41 . 03 . F3
- 41 . 03 . F4
- 41 . 03 . F5
- 41 . 03 . FD

Recommended action for customers

1. Touch **OK** to clear the error.
2. Remove the paper and the reload the tray. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
3. If the error is not cleared, turn the printer off, and then on.
4. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Remove the paper and the reload the tray. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
2. If the error persists, print a Configuration Page and note the paper size for the tray in question.

- a. If the size is not reported correctly, run the tray size sensor test in the manual sensor test.
- b. From the home screen on the printer control panel, touch “Support Tools”.
- c. Open the following menus:
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
- d. Select from the following tests:
 - All Sensors
 - Engine Sensors
 - Done (return to the Troubleshooting menu)
 - Reset(reset the selected sensor’s state)
- e. Select the specific tray size sensors to test.
- f. If the tray size sensors test **GOOD**, replace the paper tray.
- g. If the tray size sensors test **BAD**, check the cable connections between the tray size sensor and the DC Controller.
- h. If the cable connections are plugged in correctly and the cables are not damaged, replace the correct component that contains the tray size sensing switches.

Tray 2 part number: RM2-0857-000CN

1X550, 3X550 SF part number: RM2-0857-000CN

Tray 3 2,550 HCI part number: RM2-0857-000CN

Tray 4 2,550 HCI part number: RM2-0921-000CN

41 . 03 . yz Unexpected size in tray <X>

The printer detected a different paper size than expected.



NOTE: If using adhesive or self-sealing media, please see the instructions in . (ish_3199741-3199797-16)

Y = Type, Z = Tray

- Y = 0 Size mismatch. Detected paper is longer or shorter than expected.
- Y = A Size mismatch. Detected paper too long.
- Y = B Size mismatch. Detected paper too short.
- Y = C Size mismatch. Inter-page gap error.
- Y = D Size mismatch. Detected paper narrower than expected.
- Y = E Size mismatch. Detected paper wider than expected.
- Z = D Source is the duplexer.

- Z = E Source is the envelope feeder.
- Z = 1 Source is Tray 1.
- Z = 2 Source is Tray 2.
- Z = 3 Source is Tray 3.
- Z = 4 Source is Tray 4.
- Z = 5 Source is Tray 5.

Recommended action for customers

1. Touch **OK** to use another tray.
2. Print a configuration page to verify the size and type the trays are set to.
3. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
4. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
5. If the paper is jammed inside the printer, ensure it is completely removed. If paper has been ripped during removal and paper is stuck in the feed roller, spin the rollers down, which feeds the jammed paper up for easier removal.
6. Verify that the toner cartridge and the transfer roller are seated correctly.
7. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Touch **OK** to use another tray.
2. Print a configuration page to verify the size and type the trays are set to.
3. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
4. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
5. If the paper is jammed, ensure it is completely removed. If paper has been ripped during removal and paper is stuck in the feed roller, spin the rollers down, which feeds the jammed paper up for easier removal.
6. Verify that the toner cartridge and the transfer roller are seated correctly.
7. Use the manual sensor test to verify that the cassette paper switch is functioning correctly.
 - a. If the size is not reported correctly, run the tray size sensor test in the manual sensor test.
 - b. From the home screen on the printer control panel, touch "**Support Tools**".
 - c. Open the following menus:
 - **Troubleshooting**

- Diagnostic Tests
 - Manual Sensor Test
- d. Select from the following tests:
- All Sensors
 - Engine Sensors
 - Done (return to the Troubleshooting menu)
 - Reset(reset the selected sensor's state)
- e. Select the specific tray size sensors to test.
- f. If the tray size sensors test **GOOD**, replace the paper tray.
- g. If the tray size sensors test **BAD**, check the cable connections between the tray size sensor and the DC Controller.
- h. If the cable connections are plugged in correctly and the cables are not damaged, replace the correct component that contains the tray size sensing switches.

Tray 2 part number: RM2-0857-000CN

1X550, 3X550 SF part number: RM2-0857-000CN

Tray 3 2,550 HCI part number: RM2-0857-000CN

Tray 4 2,550 HCI part number: RM2-0921-000CN

8. Check paper path sensors PS4550 and PS4500 for correct operation and that they do not stick at all. Replace any damaged sensor or assembly.

Part number: RM2-6774-000CN

For instructions: See the Repair Service Manual for this product.

110V part number: RM2-1256-000CN

For instructions: See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: See the Repair Service Manual for this product.



NOTE: Before replacing parts, ensure all connections on the DC controller and the specific assembly are correctly and securely connected.

41.04.yz Printer Error

An unknown misprint error occurred on the printer.

Y = Type, Z = Tray

- Y = 0: Photo Paper (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)

- Y = 3: Light Paper 1, 2, or 3 mode
- Y = 4: Heavy Paper 1
- Y = 5: Heavy Paper 2
- Y = 6: Heavy Paper 3
- Y = 7: Glossy Paper 1
- Y = 8: Glossy Paper 2
- Y = 9: Glossy Paper 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode
- Z = D: Source is the duplexer.
- Z = 0: Source is the envelope feeder.
- Z = 1: Source is Tray 1.
- Z = 2: Source is Tray 2.
- Z = 3: Source is Tray 3.
- Z = 4: Source is Tray 4.
- Z = 5: Source is Tray 5.


Recommended action for customers

1. Touch **OK** to clear the error.
2. If the error does not clear, turn the printer off, and then on.
3. Swap out or re-seat each toner cartridge to test the toner cartridges.
4. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Touch **OK** to clear the error.
2. If the error does not clear, turn the printer off, and then on.
3. Swap out or re-seat each toner cartridge to test the toner cartridges.
4. Check the toner cartridges before replacing any other parts. Verify it is an original HP supply.

5. Check all high-voltage connections on the toner cartridge and in the toner cartridge slot.

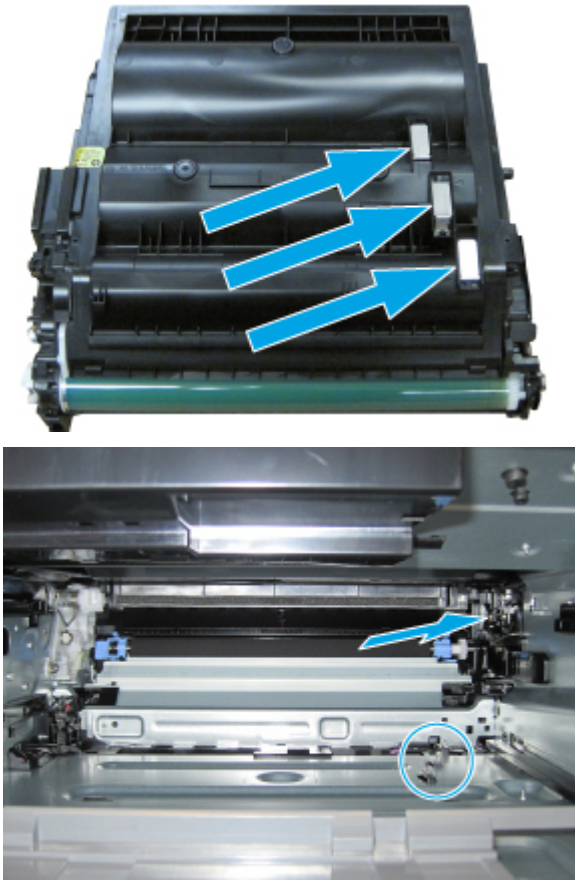

6. Re-seat the connections to the laser/scanner and the DC controller.
7. If the error persists, replace the laser/scanner.
Part number: RM2-0906-000CN
For instructions: See the Repair Service Manual for this product.
8. If all connections are good and the error persists, replace the DC Controller based on the specific product.

DC Controller part numbers:

RM2-9493-000CN (M631, M632, M633, E62555, E62565, E62575)

RM3-7621-000CN (E62655, E62665, E62675 only)

RM3-8458-000CN (M634, M635, M636, M637)

For instructions: See the Repair Service Manual for this product.

42.WX.YZ error messages

42.* errors

Errors in the 42.* family indicate an internal system failure has occurred.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on. Retry the job.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on. Retry the job.
2. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

44.WX.YZ error messages

44.* errors

Errors in the 44.* family are related to the digital send functionality: fax, email, send to SharePoint, or save to folder.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. In many cases, the error will automatically clear, and you can try the job again.
2. Verify the digital send feature has been correctly configured at the control panel and with the HP Embedded Web Server (EWS).



NOTE: To access the EWS, open a Web browser, and in the address line, enter the printer IP address.

3. Turn the printer off, and then on. Retry the job.
4. For fax errors, verify the fax card is correctly installed on the formatter.
5. For SharePoint or save-to-folder errors, verify the permissions are set correctly for access to the SharePoint or network folder.
6. For email errors, verify connectivity to the network, and verify the SMTP gateway is configured correctly. Also verify if there is a size limit on email attachments.
7. If the error persists, reset the printer to factory settings, and then upgrade the firmware to the latest version.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

44.01.xx Error Event log message

A digital send error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. No action necessary. This error message should automatically clear.
2. Try to send the job again.
3. If the error does not clear or it returns:
 - a. Use optimal resolution and image quality settings.
 - b. Wait until all the digital send jobs have been processed.
 - c. Turn the printer off, and then on. Retry the job.
 - d. Verify if there is an attachment limit on the email.

- e. Verify network connectivity, SMTP gateways, access to folder share.

44 . 02 . xx Error Event log message (*Multifunction product only*)

Personal address book error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the digital send configuration and address book.

44 . 03 . xx Error Event log message

A digital send error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

- Try to send the job again.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Use optimal resolution and image quality settings.
2. Wait until all the digital send jobs have been processed.
3. Turn the printer off, and then on and retry the job.
4. Verify if there is an attachment limit on the email.
5. Verify network connectivity, SMTP gateways, access to folder share.

44 . 04 . xx Error Event log message (*Multifunction product only*)

A Digital Send Email error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the digital send configuration.

44 . 05 . xx Error Event log message (*Multifunction product only*)

A Digital Send Folder Job error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.

2. Check the digital send configuration.

44 . 07 . xx Error Event log message (*Multifunction product only*)

Digital Send Remote Printer Job Error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the digital send configuration.

44 . 08 . xx Error Event log message (*Multifunction product only*)

SharePoint Job Error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, cancel and then restart the job.
2. If the error occurs repeatedly, reboot the engine and retry the job.
3. If error still persists, reset to factory settings. Upgrade to most current firmware.

44 . 10 . xx Error Event log message (*Multifunction product only*)

A send to email error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the digital send configuration.

For more information, Go to: [Or click here: HP LaserJet Enterprise MFP - Set up Scan to Email](#).

44 . 11 . 0E Error Event log message (*Multifunction product only*)

The attachment filename already exists at the destination, and the fail-on-filename-collisions flag was set. This file will not be sent.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, use a different filename or verify that the filename is not already in use.
2. If the issue persists, use a unique filename or disable the fail-on-filename-collisions flag.

44 . 11 . xx Error Event log message (*Multifunction product only*)

A digital send error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

Try to send the job again.

Check the digital send configuration.

44 . 12 . 0E Error Event log message (*Multifunction product only*)

A digital send error has occurred.

The attachment filename already exists at the destination, and the fail-on-filename-collisions flag is set. This file will not be sent.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, use a different filename or verify that the filename is not already in use.
2. If the issue persists, use a unique filename or disable the fail-on-filename-collisions flag.

44 . 12 . xx Error Event log message (*Multifunction product only*)

A digital send error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the digital send configuration.

44 . 16 . 01 Error Event log message (*Multifunction product only*)

A digital send error has occurred while trying to create file type.

XX =

- 01 - RTF File
- 03 - CSV File
- 04 - HTML File
- 05 - XML File
- 06 - XPS File
- 07 - PDF File

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.

2. Check the digital send configuration.

44 . 1 6 . 02 Error Event log message (*Multifunction product only*)

The destination URL was found to be invalid or unreachable.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, cancel and then restart the job.
2. If the error persists, turn the product off and then on and retry the job.
3. If the error still persists, reset to factory settings. Upgrade to the current firmware version.

44 . 1 6 . 03 Error Event log message (*Multifunction product only*)

The destination URL is not a SharePoint site.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, verify settings in job configuration and then restart the job.
2. If the error persists:
 - Check network connection settings.
 - Verify access to the SharePoint site.

44 . 1 6 . 04 Error Event log message (*Multifunction product only*)

Credentials associated with the SharePoint destination were found to be invalid or missing.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, verify settings in job configuration and then restart the job.
2. If the error persists:
 - Check network connection settings.
 - Verify access to the SharePoint site.

44 . 1 6 . 05 Error Event log message (*Multifunction product only*)

Credentials do not have write access to the SharePoint destination.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, verify settings in job configuration and then restart the job.
2. If the error persists:
 - Check network connection settings.
 - Verify access to the SharePoint site.

44 . 16 . 06 Error Event log message (*Multifunction product only*)

Upload of image file failed. Reason unknown.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, verify settings in job configuration and then restart the job.
2. If the error persists, turn the product off then on again and retry the job.
3. If the error still persists, reset to factory settings. Upgrade to the current firmware version.

44 . 16 . 07 Error Event log message (*Multifunction product only*)

Upload of image file failed.

The file exceeded the maximum form submission length on the Web server.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, send fewer pages in the job, lower the DPI of the scanned pages, or select a file type that splits pages into separate files (for example, jpeg).
2. If the error occurs repeatedly, contact the SharePoint site administrator to increase the Web server's maximum form submission length.

44 . 16 . 08 Error Event log message (*Multifunction product only*)

Upload of image file failed. The SharePoint site storage quota limit was exceeded.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, make space on the SharePoint site by deleting some files, and then retry the job.
2. If the error occurs repeatedly, contact the SharePoint site administrator to increase the storage quota limit.

44 . 16 . 09 Error Event log message (*Multifunction product only*)

Upload of image file failed. A folder or filename length is too long.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, check the destination URL and filename in the SharePoint job configuration to verify no folder or filename exceeds the maximum of 128 characters.
2. If the error occurs repeatedly, try sending to a different folder on the SharePoint site or changing the filename (which could include prefix or suffix).

44 . 1 6 . 0A Error Event log message (*Multifunction product only*)

Upload of the image file failed.

The image file already exists on the server and is checked out for editing by another user.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, verify that the filename used by the job is not checked out on the SharePoint site.
2. If the error persists, use a different filename for the job.

44 . 1 6 . 0B Error Event log message (*Multifunction product only*)

Upload of the image file failed.

The image file already exists on the server and the job was set to not overwrite files.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, set the job to overwrite existing files.
2. If the error persists, use a different filename for the job.

44 . 1 6 . 0D Error Event log message (*Multifunction product only*)

Encountered an unexpected processing error while transferring attachments to the destination SharePoint.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, verify settings in job configuration and restart the job.
2. If the error persists, turn the product off, and then on and retry the job.
3. If the error persists, reset to factory settings. Upgrade to the current firmware version.

44 . 1 6 . 0E Error Event log message (*Multifunction product only*)

The attachment filename already exists at the destination, and the fail-on-filename-collisions flag was set. This file will not be sent.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, use a different filename or verify that the filename is not already in use.
2. If the error persists, use a unique filename or disable the fail-on-filename-collisions flag.

44 . 16 . 0F Error Event log message (*Multifunction product only*)

Not enough memory to process the current SharePoint Job.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, cancel and/or restart the job, breaking it up into small jobs.
2. Repeat this process if the error persists until job goes through.

44 . 16 . 10 Error Event log message (*Multifunction product only*)

The SharePoint server is using an invalid certificate.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, send the SharePoint job to a non-secure address, or send the job to a SharePoint server that has a valid certificate.
2. If the error occurs repeatedly, send the job to a different, trusted SharePoint server.

44 . 16 . FF Error Event log message (*Multifunction product only*)

An unexpected error occurred in the SharePoint resource device code.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, verify settings in job configuration and restart the job.
2. If error persists, turn the product off, and then on and retry the job.
3. If the error persists, reset to factory settings. Upgrade to the current firmware version.

44 . 34 . xx Error Event log message

A fax error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the fax settings to make sure they are set to the proper settings for the environment.

3. If the issue persists, for additional fax troubleshooting information go to [HP LaserJet Enterprise MFP, HP PageWide Enterprise MFP - Checklist for solving fax problems](#).

44 . 34 . 03 Fax Modem Failure

Digital Send error. Fax result modem fail.

Recommended action

1. Turn the printer off.
2. Verify the fax card is correctly installed on the formatter. Ensure that the fax card is aligned with slot on the formatter chassis and is firmly seated against the formatter board.
3. Turn the printer on.
4. If the issue persists, replace the fax kit.

New part number: CC487A

For instructions: See the Repair Service Manual for this product.

Service part number: CC522-67929

For instructions: See the Repair Service Manual for this product.

44 . 34 . E5 Fax Modem Failure

A fax error has occurred.

Recommended action

1. Turn the printer off.
2. Verify the fax card is correctly installed on the formatter. Ensure that the fax card is aligned with slot on the formatter chassis and is firmly seated against the formatter board.
3. If the issue persists, download and reinstall the firmware.
4. If the issue persists, perform a Partial Clean:
 - a. Turn the printer off, and then on.
 - b. The HP logo displays on the printer control panel. When a "1/8" with an underscore displays below the HP logo, touch the logo to open the [Pre-boot](#) menu.
 - c. Use the arrow buttons on the touchscreen to navigate the pre-boot menu.
 - d. Use the down arrow to highlight [Partial Clean](#), and then touch the [OK](#) button.
 - e. Touch the [OK](#) button again.
 - f. Touch the Back button to highlight [Continue](#), and then touch the [OK](#) button.

The printer will continue to boot to **Ready**.

5. If the issue persists, replace the fax kit.

New part number: CC487A

For instructions: See the Repair Service Manual for this product.

Service part number: CC522-67929

For instructions: See the Repair Service Manual for this product.

44 . 92 . yz Error Event log message

A fax error has occurred.

Recommended action

1. Try to send the job again.
2. Check the fax settings to ensure they are set to the correct settings for the environment.
3. If the issue persists, for additional fax troubleshooting information go to [HP LaserJet Enterprise MFP, HP PageWide Enterprise MFP - Checklist for solving fax problems](#)

44 . 90 . xx, 44 . 91 . xx, 44 . 92 . xx Error Event log message

A fax error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the fax settings to make sure they are set to the proper settings for the environment.
3. If the issue persists, for additional fax troubleshooting information go to [HP LaserJet Enterprise MFP, HP PageWide Enterprise MFP - Checklist for solving fax problems](#).

46.WX.YZ error messages

46.* error messages

Errors in the 46.* family occur when the printer is trying to perform an action that it is not able to complete.

- No network connectivity
- A problem with the file being printed, with the software application sending the job, or with the print driver

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Verify the printer is connected to the network, look at the network port connection on the back of the printer, and verify that the amber activity light flashes indicating network traffic, and the green link-status light is continuously lit indicating a network link. If the problem continues, try a different network cable or port on the hub and check network configuration settings such as the printer's IP address.
3. Send a different file from the same software application to see if the error is specific to the original file. Try sending a job from a different software application to see if the error is specific to the application. Verify the computer has the correct print driver installed.
4. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Verify the printer is connected to the network. If it is not, use a different network cable, and check the configuration settings.
3. Send a different file from the same software application to see if the error is specific to the original file. Try sending a job from a different software application to see if the error is specific to the application. Verify the computer has the correct print driver installed.
4. Upgrade the printer firmware.

5. If the error persists, go to WISE and search for the following document that contains links to flowcharts that you can use to troubleshoot the issue:

HP FutureSmart - 49 Error Troubleshooting (Persistent and Intermittent) (Document ID: c03122817)

46.21.52

Copy Processor board communication error. (Event Log Only)

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, reload the most current version of firmware located on. [HP.com](https://www.hp.com) Firmware version 4.5.6 has the fix included.

47.WX.YZ error messages

47.* errors

Errors in the 47.* family indicate an internal error has occurred.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.00.xx

Back channel internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.

3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.01.xx

Image transformer internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the **Format Disk** item in the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.02.xx

Job parser internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.

3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.03.xx

Print job internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.04.xx

Print spooler 9100 internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.

3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.05.xx

Print spooler framework internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.06.xx

Print application internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.

3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.FC.yz Printer Calibration Failed To continue, touch "OK"

The device is unable to access or implement one of the image patterns files.

y = Calibration type, z = Event

- 47.FC.00 (event code) Color plane registration (CPR) Image not found at system initialization
- 47.FC.01 (event code) CPR Store Image failure
- 47.FC.02 (event code) CPR Image not found
- 47.FC.03 (event code) CPR Print engine execution failure
- 47.FC.10 (event code) Consecutive Dmax Dhalf Image not found at system initialization
- 47.FC.11 (event code) Consecutive Dmax Dhalf Store image failure
- 47.FC.12 (event code) Consecutive Dmax Dhalf Image not found
- 47.FC.13 (event code) Consecutive Dmax Dhalf Print engine execution failure
- 47.FC.20 (event code) Error Diffusion Image not found at system initialization
- 47.FC.21 (event code) Error Diffusion Store image failure
- 47.FC.22 (event code) Error Diffusion Image not found
- 47.FC.23 Error Diffusion Print engine execution failure
- 47.FC.30 0 (event code) Drum Speed Adjustment Image not found at system initialization
- 47.FC.31 (event code) Drum Speed Adjustment Store image failure
- 47.FC.32 (event code) Drum Speed Adjustment Image not found
- 47.FC.33 (event code) Drum Speed Adjustment Print engine execution failure
- 47.FC.40 (event code) Pulse Width Modulation Image not found at system initialization
- 47.FC.41 (event code) Pulse Width Modulation Store image failure
- 47.FC.42 (event code) Pulse Width Modulation Image not found
- 47.FC.43 (event code) Pulse Width Modulation Print engine execution failure

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the product off, and then on again.
2. If the error persists, reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the product off, and then on again.
2. If the error persists over multiple power cycles, then do the following.
 - In the [Support Tools](#) > [Troubleshooting](#) > [Diagnostics](#) menu, run the hard disk tests to validate the health of the device. Fix any issue found with the mass storage device.
3. If the error persists, reload the firmware.
4. If the error persists, perform a **Format Disk** procedure using the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

48.WX.YZ error messages

48.* errors

Errors in the 48.* family indicate an internal error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. In most cases, no action is necessary.
2. If the error persists, upgrade the printer firmware.
3. If the error persists, continue troubleshooting with the flowcharts for either Intermittent or Persistent 48 error troubleshooting (whichever is appropriate) in document c03122817. Search for the following document on **WISE**: HP LaserJet FutureSmart Devices - 49 Error Troubleshooting (Persistent and Intermittent).



NOTE: 48.wx.yz errors are similar to 49.wx.yz errors and use the same troubleshooting steps and procedures.

49.WX.YZ error messages

49 . xx . yy Error To continue turn off then on

A firmware error occurred.

Possible causes:

- Corrupted print jobs
- Software application issues
- Non-product specific print drivers
- Poor quality USB or network cables
- Bad network connections or incorrect configurations
- Invalid firmware operations
- Unsupported accessories

A 49 error might happen at any time for multiple reasons. Although some types of 49 errors can be caused by hardware failures, it is more common for 49 errors to be caused by printing a specific document or performing some task on the printer.

49 errors most often occur when a printer is asked to perform an action that the printer firmware is not capable of and might not have been designed to comply with, such as:

- Printing files with unsupported programming commands
- A unique combination of user environment and user interactions with the printer
- Interfacing with a third-party solution that was not designed to work with the printer
- Specific timing, network traffic, or concurrent processing of jobs

Recommended action for customers

Follow these troubleshooting steps in the order presented.



NOTE: LaserJet formatter PCAs are rarely the root cause of 49 service errors. Please do not replace the formatter unless troubleshooting has identified the formatter as the root cause.

1. Turn the printer off, and then on.
2. If the error persists, check the following:
 - The error might be caused by a network connectivity problem, such as a bad USB or network interface cable, a bad USB port, or an invalid network configuration setting.
 - The error might be caused by the print job, due to an invalid print driver, a problem with the software application, or a problem with the file being printed.
 - Upgrading the printer firmware might help resolve the error.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: LaserJet formatter PCAs are rarely the root cause of 49 service errors. Please do not replace the formatter unless troubleshooting has identified the formatter as the root cause.

1. Turn the printer off, and then on.
2. If the error persists, check the following:
 - The error might be caused by a network connectivity problem, such as a bad interface cable, a bad USB port, or an invalid network configuration setting.
 - The error might be caused by the print job, due to an invalid print driver, a problem with the software application, or a problem with the file being printed.
 - Upgrading the printer firmware might help resolve the error.
3. If the error persists, continue troubleshooting with the flowcharts for either Intermittent or Persistent 49 error troubleshooting (whichever is appropriate) in document c03122817. Search for the following document on **WISE**: HP LaserJet FutureSmart Devices - 49 Error Troubleshooting (Persistent and Intermittent).



NOTE: 48 errors are similar to 49 errors.

49.21.52

Jetlink unrecognized speed.

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, reload the most current version of firmware located on [HP Support](#).
Firmware version 4.5.6 has the fix included.

49.38.0C

Firmware error.

This issue is caused by a formatter replacement that has not had the correct parameters set at the factory.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, Upgrade the firmware.
Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If any of the following messages display on the control panel: **49.38.0C**, **49.38.0D**, **"Disk Full"**, **"Data Corruption"**, or printer hangs with an **"Initializing message..."**, refer the following support document in WISE: ish_8742720-8736298-16

HP LaserJet Enterprise MFP M528, M577, M634, M635, M636, M637, M681, M682, Managed MFP E52645, E57540, E62655, E62665, E62675, E67550, E67560, E67650, E67660 - A 49.38.0C or 49.38.0D error displays on the printer control panel or in the Event Log (Service Action Advisory).

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If any of the following messages display on the control panel: **49.38.0C**, **49.38.0D**, **"Disk Full"**, **"Data Corruption"**, or printer hangs with an **"Initializing message..."**, refer the following support document in WISE: ish_8742720-8736298-16

HP LaserJet Enterprise MFP M528, M577, M634, M635, M636, M637, M681, M682, Managed MFP E52645, E57540, E62655, E62665, E62675, E67550, E67560, E67650, E67660 - A 49.38.0C or 49.38.0D error displays on the printer control panel or in the Event Log (Service Action Advisory).

49.38.07

Generic error.

This issue is caused by a formatter replacement that has not had the correct parameters set at the factory. This issue is tied to the factory installed Trusted Platform Module (TPM).

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Print or view the printer Event log. Perform the appropriate tasks if 49.38.0C and/or 49.38.0D errors are present:

- If 49.38.0C and/or 49.38.0D errors are present, refer the following support document in WISE:
ish_8742720-8736298-16

HP LaserJet Enterprise MFP M528, M577, M634, M635, M636, M637, M681, M682, Managed MFP E52645, E57540, E62655, E62665, E62675, E67550, E67560, E67650, E67660 - A 49.38.0C or 49.38.0D error displays on the printer control panel or in the Event Log (Service Action Advisory).

- If 49.38.0C or 49.38.0D events are not in the Event log, see step 3.

3. Update the printer firmware to at a minimum of FutureSmart v5.3 version or newer.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print or view the printer Event log. Perform the appropriate tasks if 49.38.0C and/or 49.38.0D errors are present:

- If 49.38.0C and/or 49.38.0D errors are present, refer the following support document in WISE:
ish_8742720-8736298-16

HP LaserJet Enterprise MFP M528, M577, M634, M635, M636, M637, M681, M682, Managed MFP E52645, E57540, E62655, E62665, E62675, E67550, E67560, E67650, E67660 - A 49.38.0C or 49.38.0D error displays on the printer control panel or in the Event Log (Service Action Advisory).

- If 49.38.0C or 49.38.0D events are not in the Event log, see step 3.

3. Update the printer firmware to FutureSmart v5.3 version or newer.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

50.WX.YZ error messages

50.* errors

Errors in the 50.* family indicate a problem with the fuser.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and remove the fuser. Check the fuser for damage or obstructions. Reinstall or replace the fuser as needed.

 **CAUTION:** The fuser might be hot.

2. Check the connectors between the fuser and the DC controller and from the fuser to the printer.
3. Replace the fuser. If it has already been replaced, replace the fuser power supply.

50.1x.yz

Low fuser temperature failure

x = fuser mode, y = previous printer sleep state, and z = next printer sleep state.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.

 **NOTE:** Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.


6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians


1. Turn the printer off.
2. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

⚠ CAUTION: The fuser might be hot.

- a. Open the rear door.

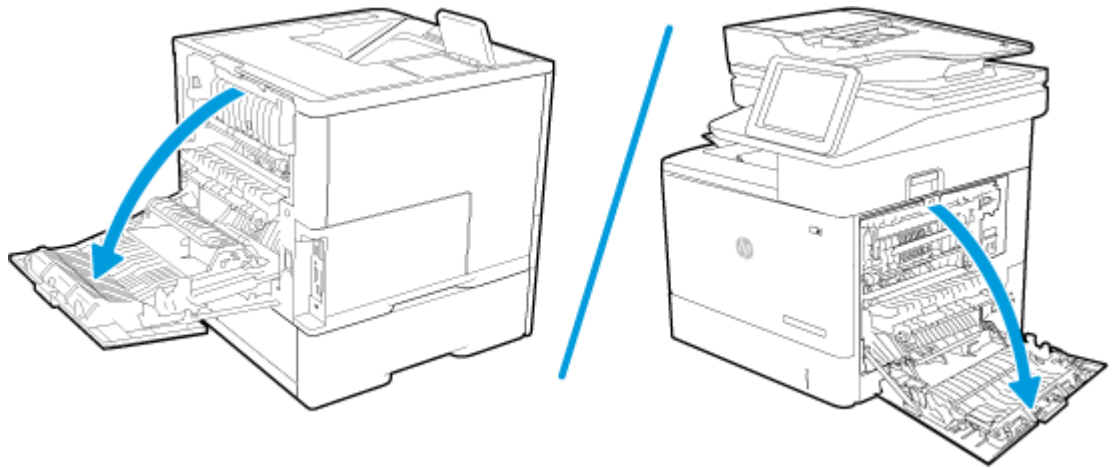


- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

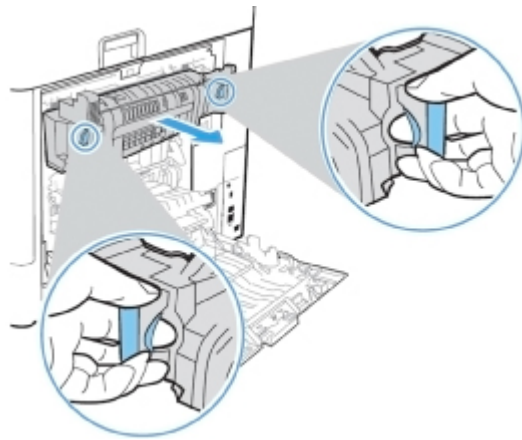

- c. Ensure that there is no residual paper in the fuser.


- d. Reseat the fuser.

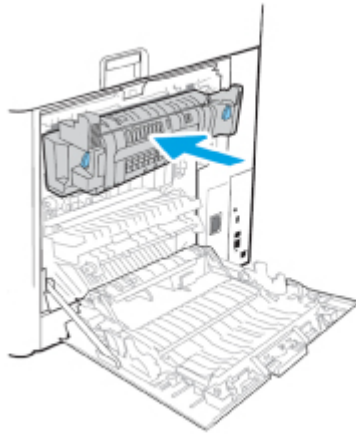

- e. Close the front door.

3. If the error persists, check the fuser connections.

- a. Remove the fuser.
- b. Check the connection on the fuser

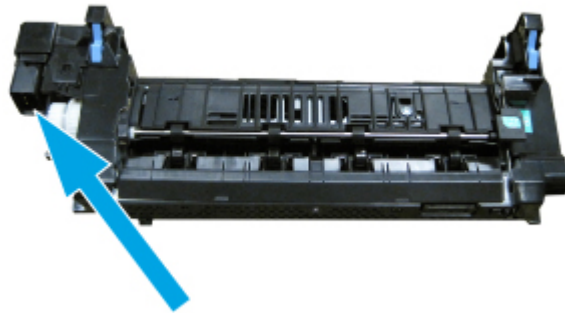


- c. If the fuser connector is damaged, replace the fuser.

110V part number: RM2-1256-000CN

220V part number: RM2-1257-000CN

- d. Check the connection to the fuser in the printer.

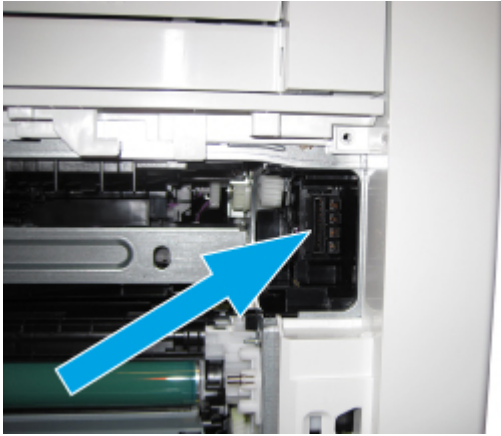

- e. If the connector is damaged, elevate the issue using the Standard Support Process.
 - f. Check connections J401 and J402 on the DC controller PCA.
4. If the fuser has not been replaced, replace the fuser.
- 110V part number: RM2-1256-000CN
For instructions: See the Repair Service Manual for this product.
- 220V part number: RM2-1257-000CN
For instructions: See the Repair Service Manual for this product.
5. If the error persists, replace the low voltage power supply (LVPS).
- 110V LVPS part number: RM2-6797-000CN
For instructions: See the Repair Service Manual for this product.
- 220V LVPS part number: RM2-6798-000CN
For instructions: See the Repair Service Manual for this product.

50.2X.YZ

Fuser warm-up error

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterruptible power supply, and plug it directly into a wall socket.


3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians


1. Turn the printer off.
2. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

⚠ CAUTION: The fuser might be hot.

- a. Open the rear door.

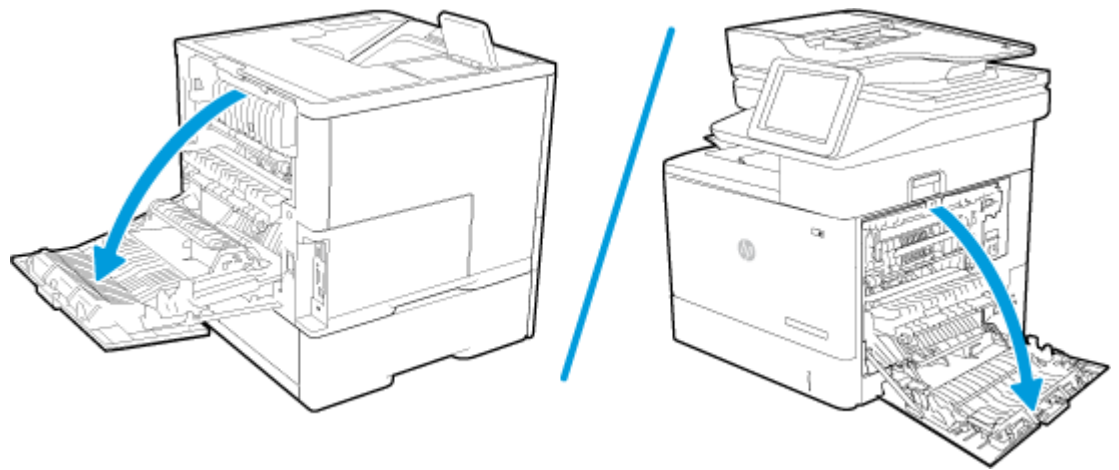


- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

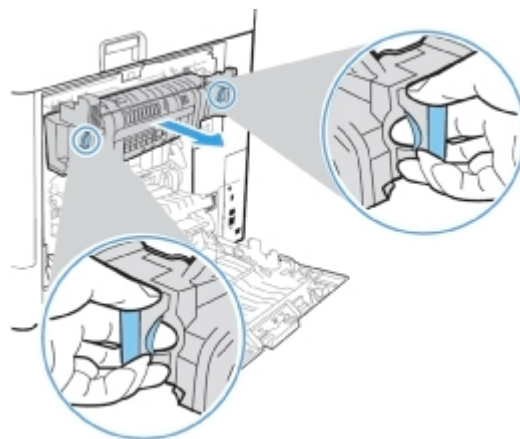


- c. Ensure that there is no residual paper in the fuser.

- d. Reseat the fuser.

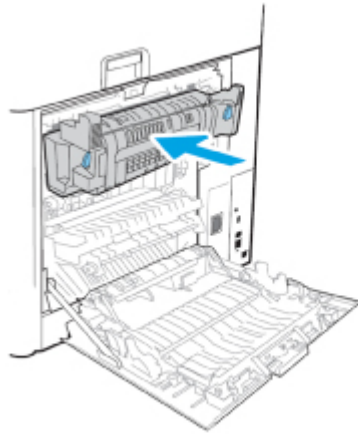

- e. Close the front door.
- 3. If the error persists, check the fuser connections.
 - a. Remove the fuser.
 - b. Check the connection on the fuser

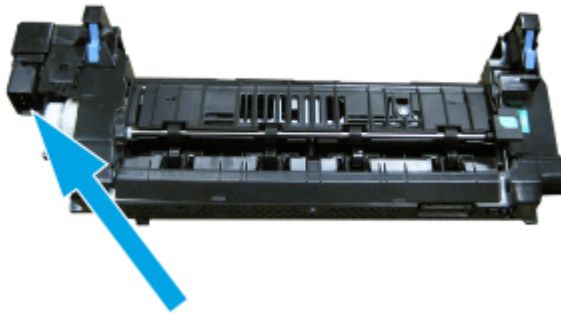


- c. If the fuser connector is damaged, replace the fuser.

110V part number: RM2-1256-000CN

220V part number: RM2-1257-000CN

- d. Check the connection to the fuser in the printer.

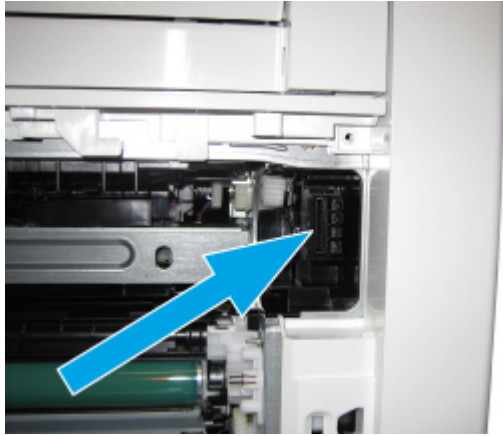

- e. If the connector is damaged, elevate the issue using the Standard Support Process.
 - f. Check connections J401 and J402 on the DC controller PCA.
4. If the fuser has not been replaced, replace the fuser.
- 110V part number: RM2-1256-000CN
For instructions: See the Repair Service Manual for this product.
- 220V part number: RM2-1257-000CN
For instructions: See the Repair Service Manual for this product.
5. If the error persists, replace the low voltage power supply (LVPS).
- 110V LVPS part number: RM2-6797-000CN
For instructions: See the Repair Service Manual for this product.
- 220V LVPS part number: RM2-6798-000CN
For instructions: See the Repair Service Manual for this product.

50.3X.YZ

High fuser temperature

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.

 **NOTE:** Unplug the printer from any power-strip or uninterruptible power supply, and plug it directly into a wall socket.


3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians


1. Turn the printer off.
2. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

⚠ CAUTION: The fuser might be hot.

- a. Open the rear door.

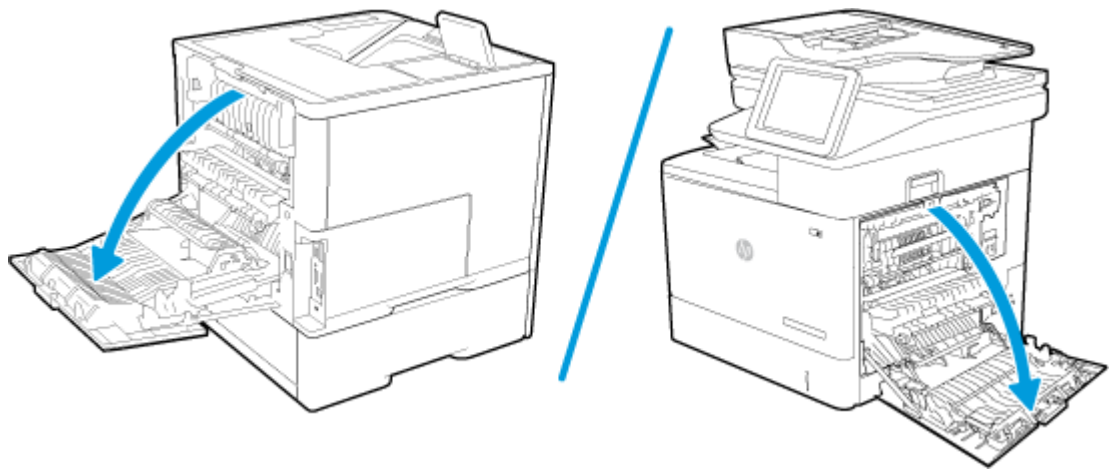


- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

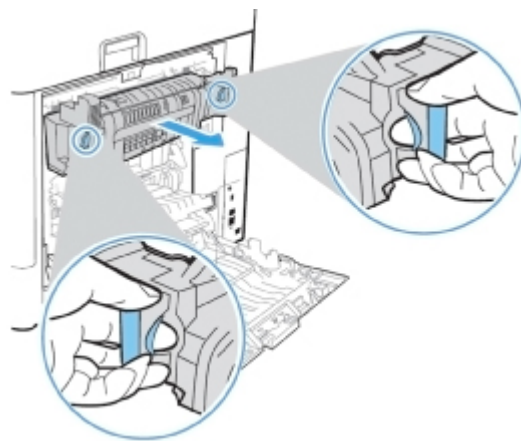

- c. Ensure that there is no residual paper in the fuser.


- d. Reseat the fuser.

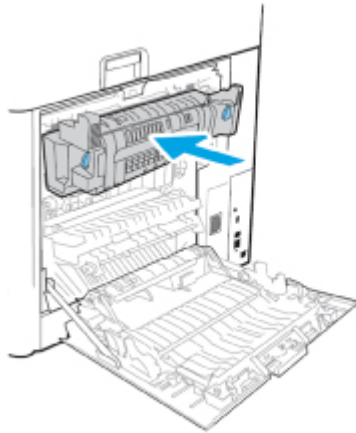

- e. Close the front door.

3. If the error persists, check the fuser connections.

- a. Remove the fuser.
- b. Check the connection on the fuser

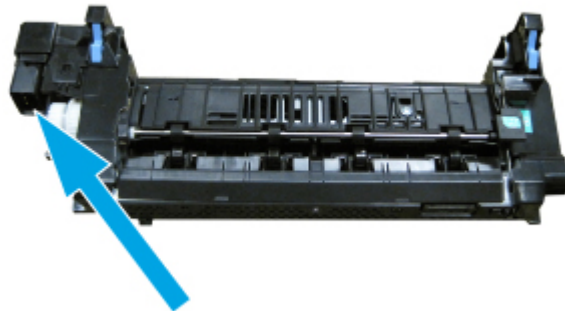

- c. If the fuser connector is damaged, replace the fuser.


110V part number: RM2-1256-000CN

For instructions: See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: See the Repair Service Manual for this product.

- d. Check the connection to the fuser in the printer.

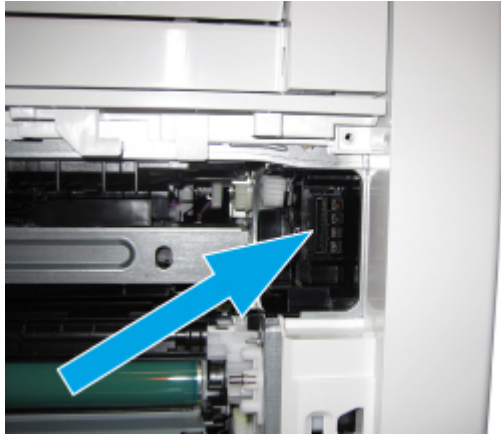

- e. If the connector is damaged, elevate the issue using the Standard Support Process.
 - f. Check connections J401 and J402 on the DC controller PCA.
4. Check the paper type setting in the printer control panel menus and in the print driver. Ensure that the settings match and are correct for the type of paper being used.
 5. If the error persists, replace the low voltage power supply (LVPS).
110V LVPS part number: RM2-6797-000CN
For instructions: See the Repair Service Manual for this product.
220V LVPS part number: RM2-6798-000CN
For instructions: See the Repair Service Manual for this product.

50 . 4X . YZ

Drive circuit fault

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.


6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians


1. Turn the printer off.
2. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

⚠ CAUTION: The fuser might be hot.

- a. Open the rear door.

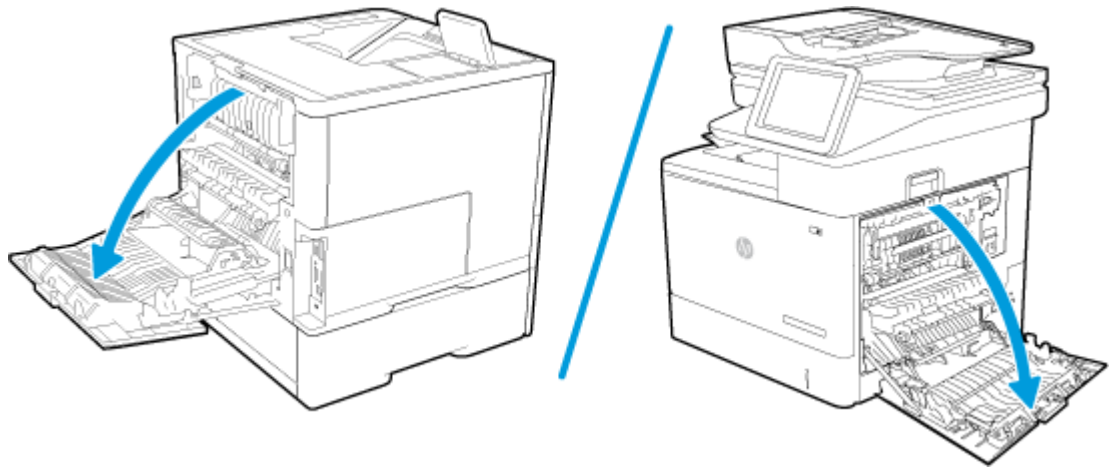


- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

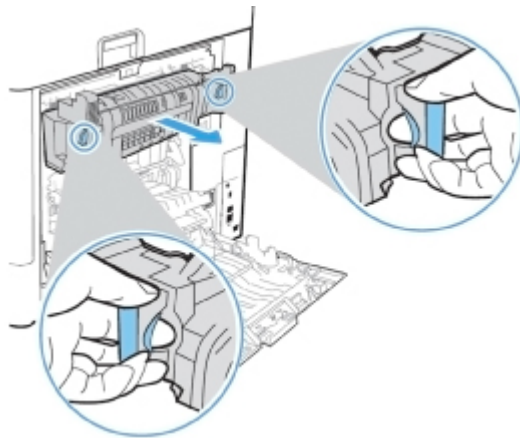

- c. Ensure that there is no residual paper in the fuser.

- d. Reseat the fuser.

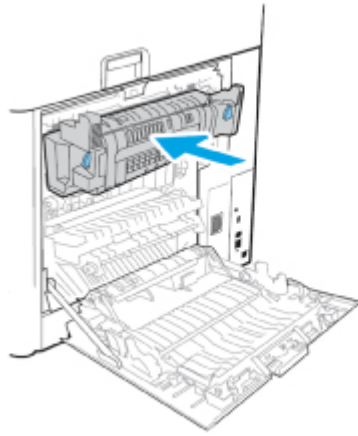

- e. Close the front door.

3. Check the printer power source. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.



NOTE: If the printer does not meet the power requirement of 43 to 67Hz frequency, the fuser temperature control does not work correctly and this will cause the error.

4. Check connections J401 and J402 on the DC controller PCA.
5. If the fuser has not been replaced, replace the fuser.

110V part number: RM2-1256-000CN

For instructions: See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: See the Repair Service Manual for this product.

6. If the error persists, replace the low voltage power supply (LVPS).

110V LVPS part number: RM2-6797-000CN

For instructions: See the Repair Service Manual for this product.

220V LVPS part number: RM2-6798-000CN

For instructions: See the Repair Service Manual for this product.

50 . 6X . YZ

Open fuser circuit (heating element failure)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.

 **NOTE:** Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.


3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians


1. Turn the printer off.
2. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.


- a. Open the rear door.

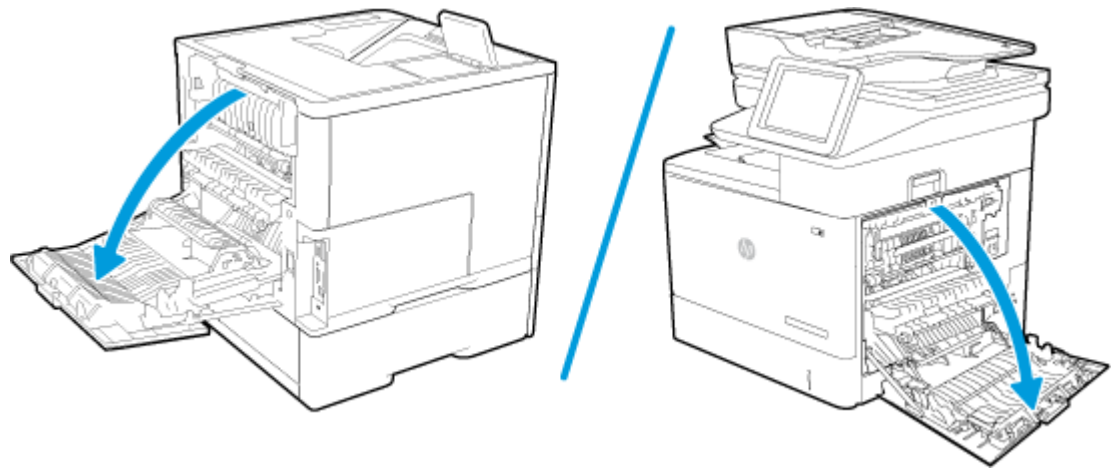

- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

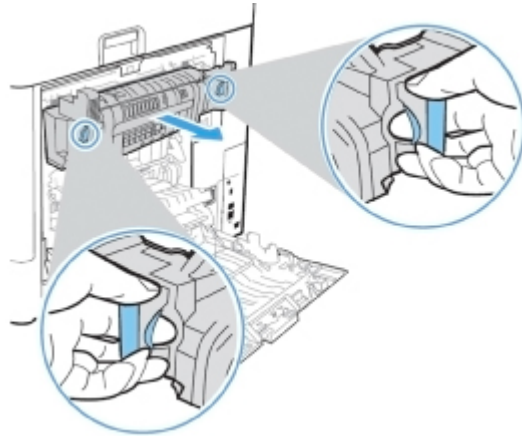


- c. Ensure that there is no residual paper in the fuser.
- d. Reseat the fuser.

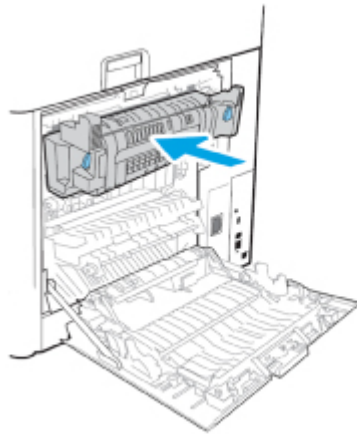

- e. Close the front door.
- 3. If the error persists, check the fuser connections.
 - a. Remove the fuser.

- b. Check the connection on the fuser

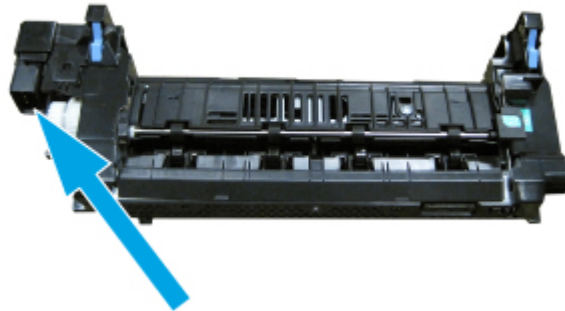

- c. If the fuser connector is damaged, replace the fuser.


110V part number: RM2-1256-000CN

For instructions: See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: See the Repair Service Manual for this product.

- d. Check the connection to the fuser in the printer.

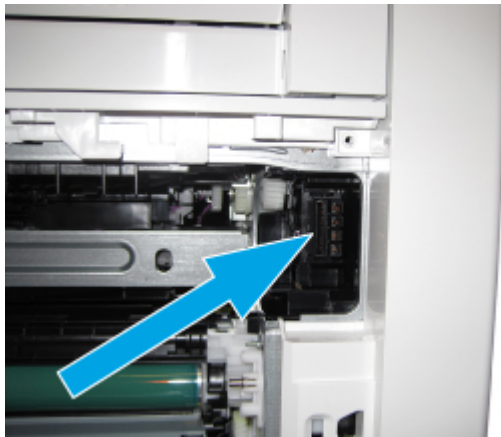

- e. If the connector is damaged, elevate the issue using the Standard Support Process.

- f. Check connections J401 and J402 on the DC controller PCA.

- 4. If the fuser has not been replaced, replace the fuser.

110V part number: RM2-1256-000CN

For instructions: See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: See the Repair Service Manual for this product.

5. If the error persists, replace the low voltage power supply (LVPS).
110V LVPS part number: RM2-6797-000CN
For instructions: See the Repair Service Manual for this product.
220V LVPS part number: RM2-6798-000CN
For instructions: See the Repair Service Manual for this product.

50.7F.00

Fuser pressure-release mechanism failure

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterruptible power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

1. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.




CAUTION: The fuser might be hot.

2. Check the condition and position of the fuser pressure relief sensor. If the sensor is damaged or missing, replace the fuser sensor.

Fuser output sensor (SR5) part number: WG8-5935-000CN

Figure 6-219 An undamaged fuser pressure relief sensor

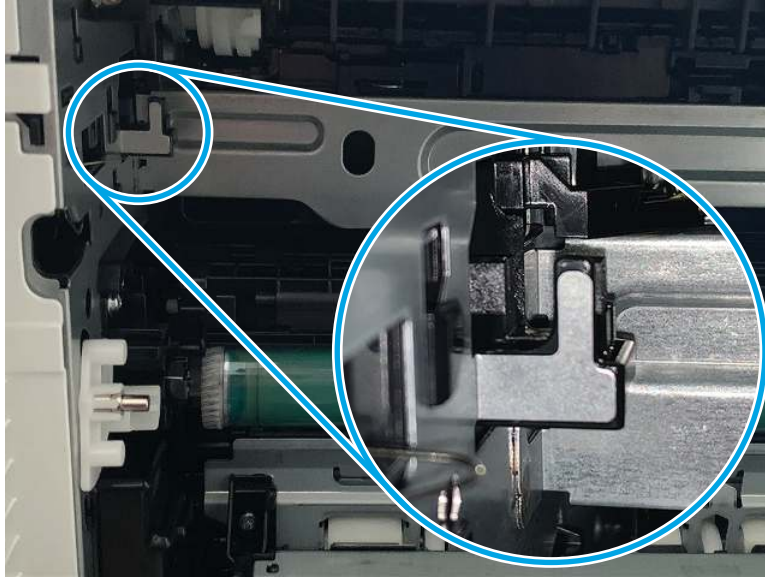

3. Inspect the fuser flag for damage. If the flag is damaged or missing, replace the fuser.

110V Fuser part number: RM2-1256-010CN

220V Fuser part number: RM2-1257-010CN

Figure 6-220 An undamaged fuser alienation flag on the left side of the fuser



4. If the error persists, replace the fuser drive motor assembly.

Fuser drive motor (M1) assembly part number: RM2-6763-000CN

Recommended action for onsite technicians


1. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

⚠ CAUTION: The fuser might be hot.

2. Check the condition and position of the fuser pressure relief sensor. If the sensor is damaged or missing, replace the fuser sensor.

Fuser output sensor (SR5) part number: WG8-5935-000CN

Figure 6-221 An undamaged fuser pressure relief sensor

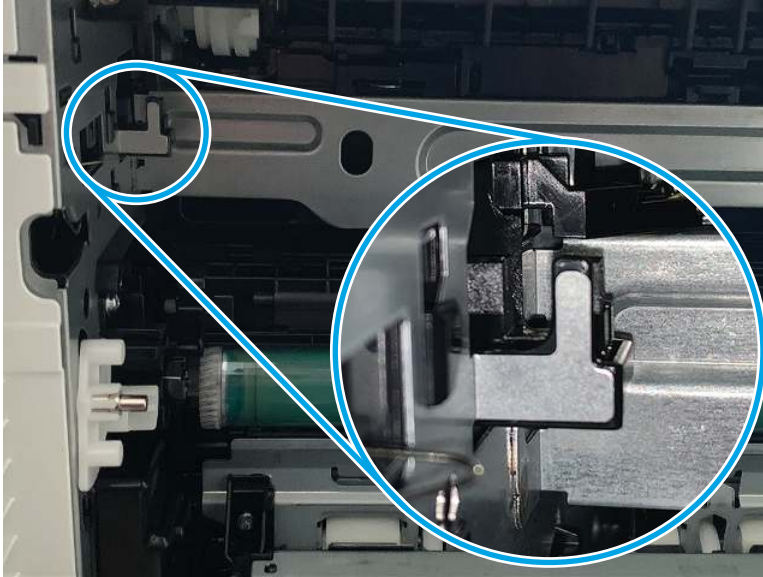

3. Inspect the fuser flag for damage. If the flag is damaged or missing, replace the fuser.

110V Fuser part number: RM2-1256-010CN

220V Fuser part number: RM2-1257-010CN

For instructions: See the Repair Service Manual for this product.

Figure 6-222 An undamaged fuser alienation flag on the left side of the fuser




4. Run a **Fuser pressure relief motor** test from the printer control panel:
 - a. From the Home screen on the printer control panel, touch **Support Tools**.
 - b. Open **Troubleshooting > Diagnostic Tests > Components Test**.
 - c. Select the **Fuser pressure relief motor** option.
 - d. Select the **Repeat** check box.
 - e. Touch the **Start** button.
 - f. Listen for a clicking noise, which confirms that the motor is functioning.
 - g. If the motor test fails, replace the fuser drive motor assembly.

Fuser drive motor (M1) assembly part number: RM2-6763-000CN

For instructions: See the Repair Service Manual for this product.

5. If this issue occurs after the replacement of a fuser drive assembly, check the spring on the new assembly and ensure it is in place. Without the spring, it will cause a 50.7F error.

Figure 6-223 Spring in correct location

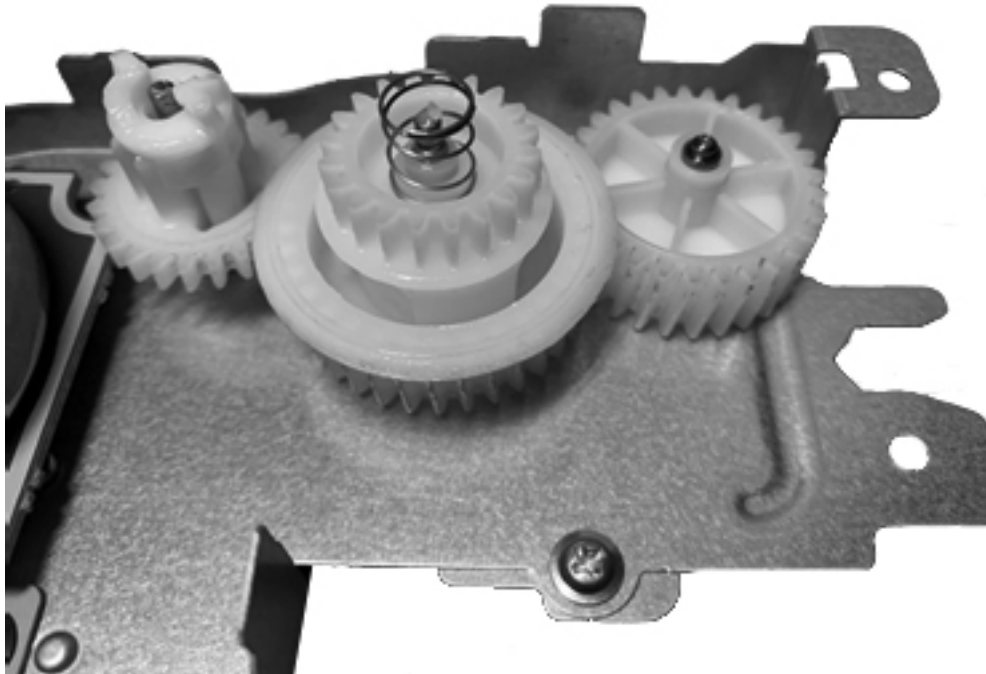

50.8X.YZ

Low fuser temperature 2

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.

 **NOTE:** Unplug the printer from any power-strip or uninterruptible power supply, and plug it directly into a wall socket.


3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians


1. Turn the printer off.
2. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

⚠ CAUTION: The fuser might be hot.

- a. Open the rear door.

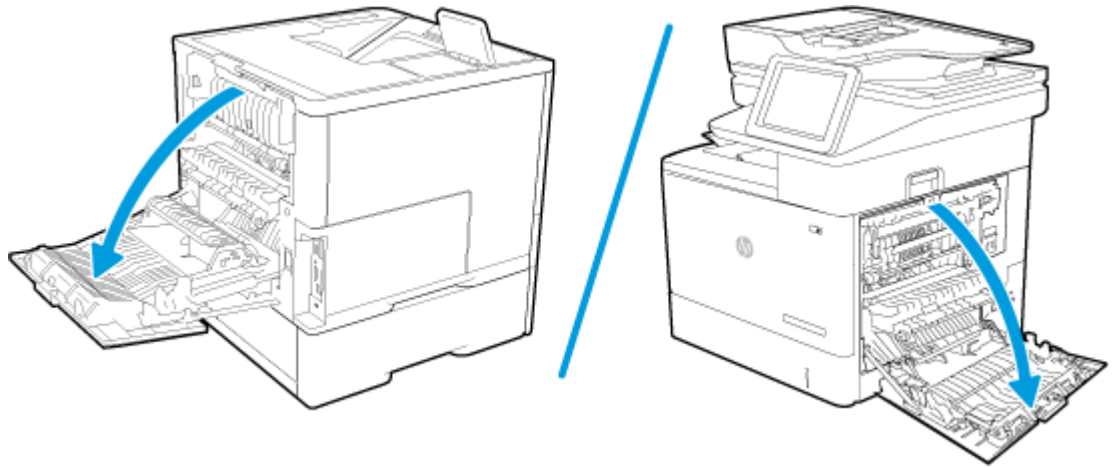


- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

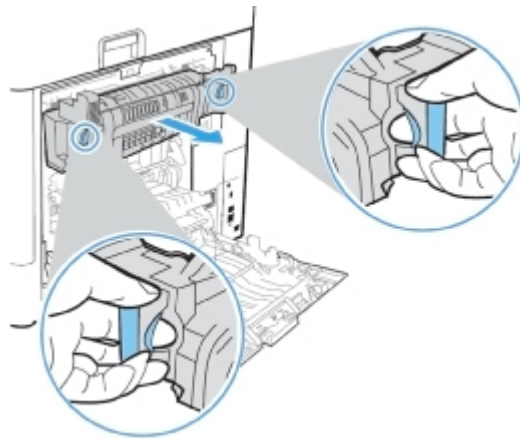

- c. Ensure that there is no residual paper in the fuser.

- d. Reseat the fuser.

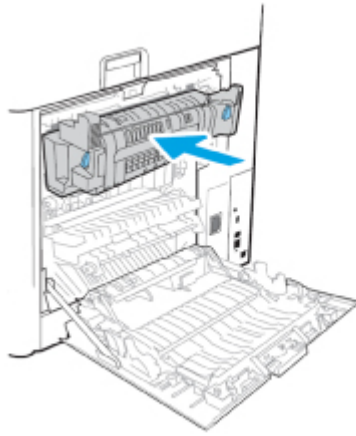

- e. Close the front door.

3. Check the printer power source. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.



NOTE: If the printer does not meet the power requirement of 43 to 67Hz frequency, the fuser temperature control does not work correctly and this will cause the error.

4. Check connections J401 and J402 on the DC controller PCA.
5. If the fuser has not been replaced, replace the fuser.

110V part number: RM2-1256-000CN

For instructions: See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: See the Repair Service Manual for this product.

6. If the error persists, replace the low voltage power supply (LVPS).

110V LVPS part number: RM2-6797-000CN

For instructions: See the Repair Service Manual for this product.

220V LVPS part number: RM2-6798-000CN

For instructions: See the Repair Service Manual for this product.

50.9X.YZ

High fuser temperature 2

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterrupt power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.

Check the size and type on the control panel Trays menu or use the EWS Trays menu

4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.


Recommended action for call-center agents and onsite technicians

1. Turn the printer off.
2. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.




CAUTION: The fuser might be hot.


- a. Open the rear door.

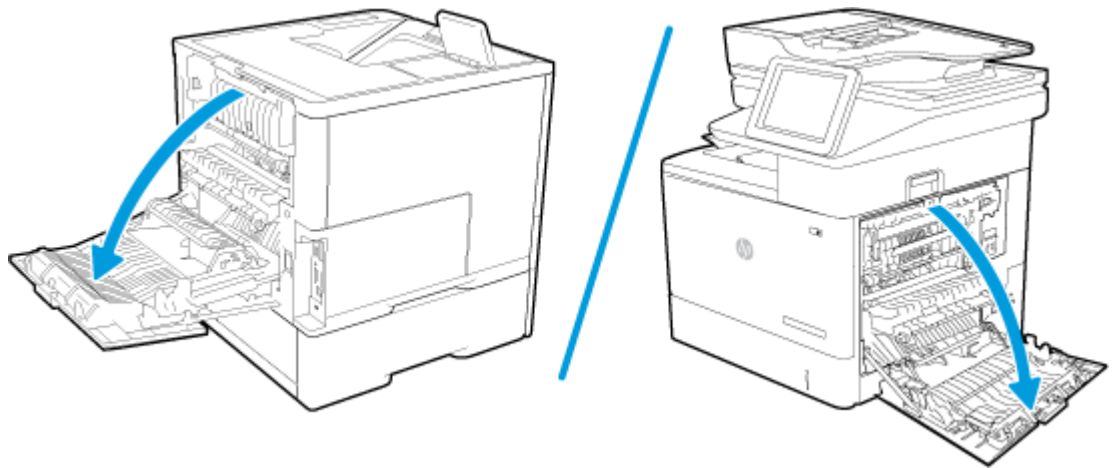

- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

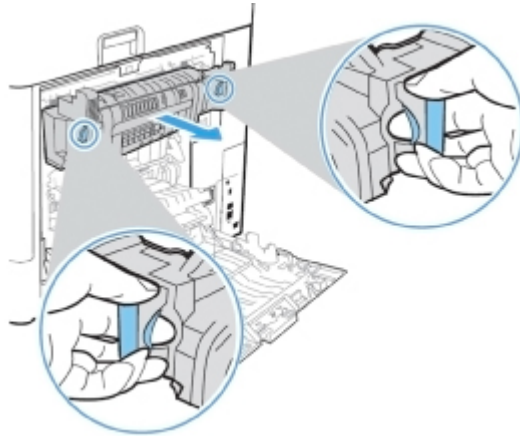

- c. Ensure that there is no residual paper in the fuser.
- d. Reseat the fuser.

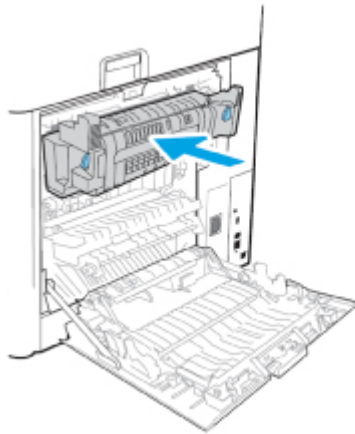

- e. Close the front door.
3. Check the printer power source. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.



NOTE: If the printer does not meet the power requirement of 43 to 67Hz frequency, the fuser temperature control does not work correctly and this will cause the error.

4. Check connections J401 and J402 on the DC controller PCA.
5. If the fuser has not been replaced, replace the fuser.

110V part number: RM2-1256-000CN

For instructions: See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: See the Repair Service Manual for this product.

6. If the error persists, replace the low voltage power supply (LVPS).
110V LVPS part number: RM2-6797-000CN
For instructions: See the Repair Service Manual for this product.
220V LVPS part number: RM2-6798-000CN
For instructions: See the Repair Service Manual for this product.

50 .AX.YZ

Low fuser temperature 3

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterruptible power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.


Recommended action for call-center agents and onsite technicians

1. Turn the printer off.
2. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.




CAUTION: The fuser might be hot.


- a. Open the rear door.

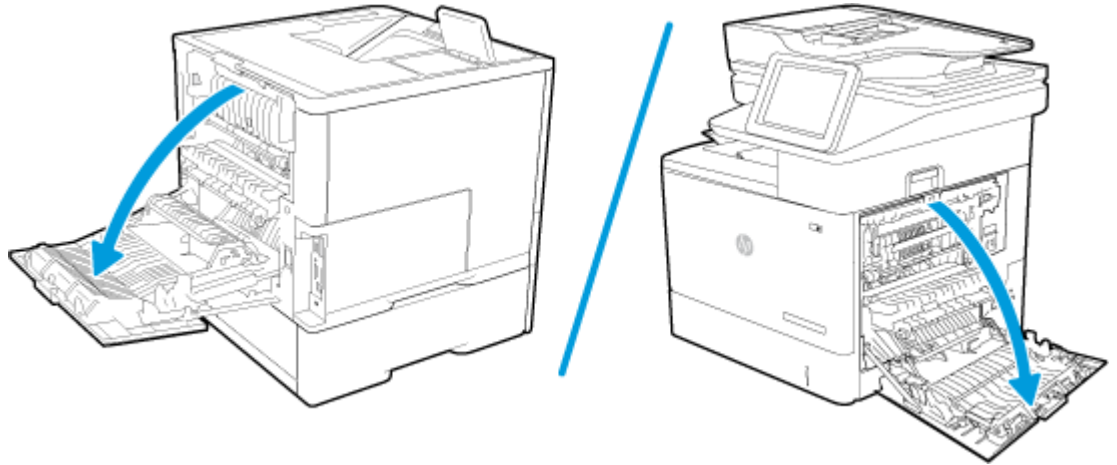

- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

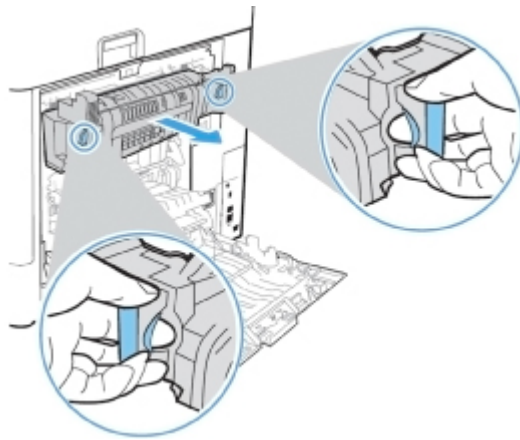

- c. Ensure that there is no residual paper in the fuser.
- d. Reseat the fuser.

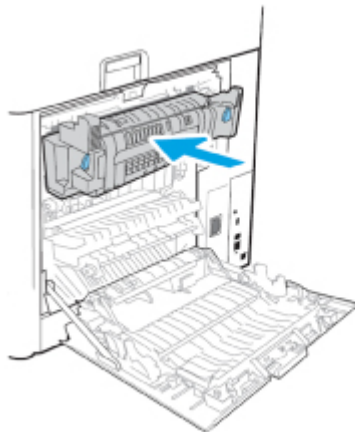

- e. Close the front door.

3. Check the printer power source. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.



NOTE: If the printer does not meet the power requirement of 43 to 67Hz frequency, the fuser temperature control does not work correctly and this will cause the error.

4. Check connections J401 and J402 on the DC controller PCA.
5. If the fuser has not been replaced, replace the fuser.

110V part number: RM2-1256-000CN

For instructions: See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: See the Repair Service Manual for this product.

6. If the error persists, replace the low voltage power supply (LVPS).

110V LVPS part number: RM2-6797-000CN

For instructions: See the Repair Service Manual for this product.

220V LVPS part number: RM2-6798-000CN

For instructions: See the Repair Service Manual for this product.

50 .BX .YZ

High fuser temperature 3

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterruptible power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.


Recommended action for call-center agents and onsite technicians

1. Turn the printer off.


2. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

⚠ CAUTION: The fuser might be hot.

- a. Open the rear door.

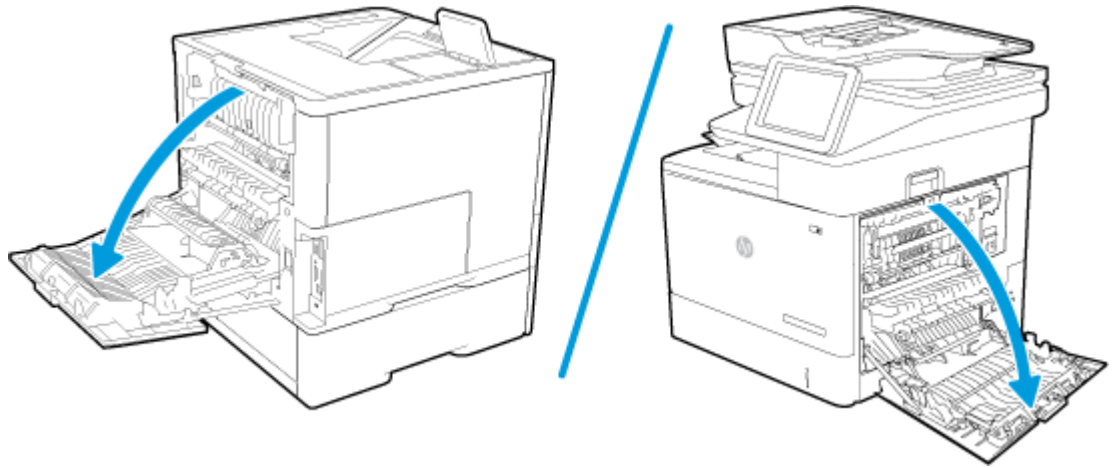


- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

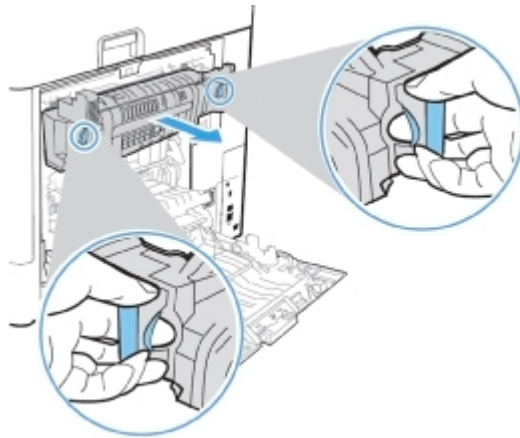

- c. Ensure that there is no residual paper in the fuser.

- d. Reseat the fuser.

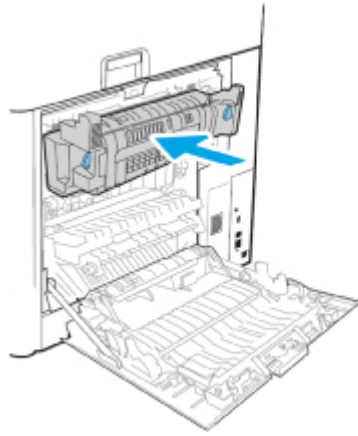

- e. Close the front door.

- 3. Check the printer power source. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.



NOTE: If the printer does not meet the power requirement of 43 to 67Hz frequency, the fuser temperature control does not work correctly and this will cause the error.

- 4. Check connections J401 and J402 on the DC controller PCA.
- 5. If the fuser has not been replaced, replace the fuser.

110V part number: RM2-1256-000CN

For instructions: See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: See the Repair Service Manual for this product.

- 6. If the error persists, replace the low voltage power supply (LVPS).

110V LVPS part number: RM2-6797-000CN

For instructions: See the Repair Service Manual for this product.

220V LVPS part number: RM2-6798-000CN

For instructions: See the Repair Service Manual for this product.

51.WX.YZ, 52.WX.YZ error messages

51.* errors

Errors in the 51.* family are related to the laser scanner.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Ensure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Check all connections on the laser/scanner and from the laser/scanner to the DC controller, and reseal them if necessary.
3. If the error persists, replace the laser scanner.

51.00.yz

An error with the laser/scanner assembly has occurred in the printer.

- **51.00.10** Beam detect error
- **51.00.19** Laser malfunction

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Open and close the front and rear doors to see if the printer returns to a [Ready](#).
2. Turn the printer off, and then on.

3. Reconnect connector (J8301) on the laser/scanner assembly and connector (J606) on the DC controller PCA.
4. If the error persists, replace the laser/scanner assembly.

Part number: RM2-0906-000CN

For instructions: See the Repair Service Manual for this product.

52.00.00/52.00.20 Scanner Startup/Rotation error

A printer laser/scanner error occurred.

- **52.00.00** laser/scanner startup error.
- **52.00.20** laser/scanner rotation error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Open and close the front and rear doors to see if the printer returns to a **Ready**.
2. Turn the printer off, and then on.
3. Reconnect connector (J6104) on the laser/scanner assembly and connector (J205) on the DC controller PCA.
4. If the error persists, replace the laser/scanner assembly.

Part number: RM2-0906-000CN

For instructions: See the Repair Service Manual for this product.

53.WX.YZ error messages

53.A0.y0

Tray "Y" side guide misalignment resolved.

The engine detected that the tray guide misalignment has been resolved.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A0.10:** Tray 1 Side guide misalignment resolved.
- **53.A0.20:** Tray 2 side guide misalignment resolved.
- **53.A0.30:** Tray 3 side guide misalignment resolved.
- **53.A0.40:** Tray 4 side guide misalignment resolved.
- **53.A0.50:** Tray 5 side guide misalignment resolved.
- **53.A0.60:** Tray 6 side guide misalignment resolved.

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.A0.y1

Tray "Y" Side guide misalignment proactive warning.

The engine detected a tray "Y" side guide misalignment.

This is a proactive warning intended to avoid a jam event.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A0.11:** Tray 1 side guide misalignment warning.
- **53.A0.21:** Tray 2 side guide misalignment warning.
- **53.A0.31:** Tray 3 side guide misalignment warning.
- **53.A0.41:** Tray 4 side guide misalignment warning.
- **53.A0.51:** Tray 5 side guide misalignment warning.
- **53.A0.61:** Tray 6 side guide misalignment warning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Ensure that the paper size in the tray matches the tray size in the [Trays](#) menu.

2. If the trays are **not** locked, ensure the tray guides are correctly aligned to the size of paper being installed.
3. If the trays are locked, contact your managed print provider if you need to change the paper size from the one selected.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Ask the customer to check the paper size loaded in the tray to see if it matches the size listed in the [Trays](#) menu or on the Configuration Page.
2. If the trays are **not** locked, educate the customer on the correct way to align the side guides when refilling paper in the tray.
3. Instruct the customer to contact the managed print provider if the paper size needs to be changed from the one selected.

53.A1.y0 Enter error message

Tray "Y" paper delivery direction misalignment resolved.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A1.10:** Tray 1 Side guide misalignment resolved.
- **53.A1.20:** Tray 2 side guide misalignment resolved.
- **53.A1.30:** Tray 3 side guide misalignment resolved.
- **53.A1.40:** Tray 4 side guide misalignment resolved.
- **53.A1.50:** Tray 5 side guide misalignment resolved.
- **53.A1.60:** Tray 6 side guide misalignment resolved.

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.A1.y1

Tray "Y" paper delivery direction misalignment warning.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A1.11:** Tray 1 paper delivery direction misalignment warning.
- **53.A1.21:** Tray 2 paper delivery direction misalignment warning.
- **53.A1.31:** Tray 3 paper delivery direction misalignment warning.

- **53.A1.41:** Tray 4 paper delivery direction misalignment warning.
- **53.A1.51:** Tray 5 paper delivery direction misalignment warning.
- **53.A1.61:** Tray 6 paper delivery direction misalignment warning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Ensure that the paper size in the tray matches the tray size in the [Trays](#) menu.
2. If the trays are **not** locked, ensure the tray guides are correctly aligned to the size of paper being installed.
3. If the trays are locked, contact your managed print provider if you need to change the paper size from the one selected.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Ensure that the paper tray guides are set to the correct paper size that is being loaded into the paper tray.



NOTE: Check the event log for the following messages to determine which tray guides need to be adjusted.

- **53.A1.11:** Tray 1 paper delivery direction misalignment warning.
 - **53.A1.21:** Tray 2 paper delivery direction misalignment warning.
 - **53.A1.31:** Tray 3 paper delivery direction misalignment warning.
 - **53.A1.41:** Tray 4 paper delivery direction misalignment warning.
 - **53.A1.51:** Tray 5 paper delivery direction misalignment warning.
 - **53.A1.61:** Tray 6 paper delivery direction misalignment warning.
2. Ensure that the rear paper guide is set to the correct paper length.
 3. Ask the customer to check the paper size loaded in the tray to see if it matches the size listed in the [Trays](#) menu or on the Configuration Page.
 4. If the trays are **not** locked, educate the customer on the correct way to align the guides when refilling paper in the tray.
 5. Inspect the quality and condition of the customer paper to identify conditions that may lead to paper skewing.
 6. Inspect the condition of the feed and separation rollers of the listed tray, and ensure they are not worn, or damaged. Replace the rollers as needed.

53.A2.y0

Tray "Y" overload resolved.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A2.10:** Tray 1 overload resolved.
- **53.A2.20:** Tray 2 overload resolved.
- **53.A2.30:** Tray 3 overload resolved.
- **53.A2.40:** Tray 4 overload resolved.
- **53.A2.50:** Tray 5 overload resolved.
- **53.A2.60:** Tray 6 overload resolved.

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.A2.y1

Tray "Y" overload warning.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A2.11:** Tray 1 overload warning.
- **53.A2.21:** Tray 2 overload warning.
- **53.A2.31:** Tray 3 overload warning.
- **53.A2.41:** Tray 4 overload warning.
- **53.A2.51:** Tray 5 overload warning.
- **53.A2.61:** Tray 6 overload warning.

Recommended action

Follow these troubleshooting steps in the order presented.

- Remove paper from the specified tray until it is below the paper fill level mark.

53.B0.0z

Tray "Z" feed roller nearing end of life.

Prepare to replace tray pick rollers



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B0.01:** Tray 1 feed roller nearing end of life.
- **53.B0.02:** Tray 2 feed roller nearing end of life.

- **53.B0.03:** Tray 3 feed roller nearing end of life.
- **53.B0.04:** Tray 4 feed roller nearing end of life.
- **53.B0.05:** Tray 5 feed roller nearing end of life.
- **53.B0.06:** Tray 6 feed roller nearing end of life.

Recommended action

Follow these troubleshooting steps in the order presented.

- The paper tray rollers will need to be replaced soon. Be prepared to replace the tray rollers for the specified tray.



NOTE: Check the event log for the following messages to determine which tray rollers need to be changed.

- **53.B0.01:** Tray 1 feed roller nearing end of life.
- **53.B0.02:** Tray 2 feed roller nearing end of life.
- **53.B0.03:** Tray 3 feed roller nearing end of life.
- **53.B0.04:** Tray 4 feed roller nearing end of life.
- **53.B0.05:** Tray 5 feed roller nearing end of life.
- **53.B0.06:** Tray 6 feed roller nearing end of life.

53.B1.0z

Tray "Z" feed roller at end of life.



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B1.01:** Tray 1 feed roller at end of life.
- **53.B1.02:** Tray 2 feed roller at end of life.
- **53.B1.03:** Tray 3 feed roller at end of life.
- **53.B1.04:** Tray 4 feed roller at end of life.
- **53.B1.05:** Tray 5 feed roller at end of life.
- **53.B1.06:** Tray 6 feed roller at end of life.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

- Replace the feed and separation rollers for the specified tray.

53.B2.0z

Tray "Z" feed roller brand new.



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B2.01:** Tray 1 feed roller brand new.
- **53.B2.02:** Tray 2 feed roller brand new.
- **53.B2.03:** Tray 3 feed roller brand new.
- **53.B2.04:** Tray 4 feed roller brand new.
- **53.B2.05:** Tray 5 feed roller brand new.
- **53.B2.06:** Tray 6 feed roller brand new.

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.B3.0z

Tray "Z" pick roller brand new (engine detected).

The engine detected that new tray feed rollers have been installed.



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B3.01:** Tray 1 feed roller brand new (engine detected).
- **53.B3.02:** Tray 2 feed roller brand new (engine detected).
- **53.B3.03:** Tray 3 feed roller brand new (engine detected).
- **53.B3.04:** Tray 4 feed roller brand new (engine detected).
- **53.B3.05:** Tray 5 feed roller brand new (engine detected).
- **53.B3.06:** Tray 6 feed roller brand new (engine detected).

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.C1.0z Tray "Z" size mismatch.

The specified tray contains a size that does not match the configured size.

Complete screen message:

The specified tray contains a size that does not match the configured size.

The tray is configured to support the only size indicated

Confirm guides are in correct position.

This issue occurs when the managed print provider has locked the paper tray to either letter or A4 and the tray has a different size paper loaded.



NOTE: This can occur if the tray was swapped out or the physical trays locks in the tray were removed and the guides changed.

- **53.C1.02:** Tray 2 size mismatch.
- **53.C1.03:** Tray 3 size mismatch.
- **53.C1.04:** Tray 4 size mismatch.
- **53.C1.05:** Tray 5 size mismatch.
- **53.C1.06:** Tray 6 size mismatch.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Ensure that the paper size in the tray matches the tray size in the [Trays](#) menu.
2. Contact your managed print provider if you need to change the paper size from the one selected.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Ask the customer to check the media size loaded in the tray to see if it matches the size listed in the [Trays](#) menu or on the Configuration Page.
2. Instruct the customer to contact the managed print provider if the paper size needs to be changed from the one selected.

54.WX.YZ error messages

54.* errors

Errors in the 54.* family are related to the image-formation system.

- For HP LaserJet printers, they can indicate a problem with the toner cartridges or the transfer unit (color printers only), or they can indicate a problem with a sensor, such as with the laser/scanner.
- For HP PageWide printers, they can indicate a problem with the calibration process.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Make sure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Check the supplies status page using the [Supplies](#) menu on the control panel to verify that toner cartridges, toner collection unit (TCU), or the transfer belt kit are not past their useful life. Replace the supplies and maintenance parts as necessary.

To print a Supplies Status Page:

- a. From the Home screen on the printer control panel, select [Administration](#).
- b. Open the following menus:
 - i. [Reports](#)
 - ii. [Configuration/Status Pages](#)
- c. Scroll to and select [Supplies Status Page](#).
- d. Select [Print](#) to print the page.

To order parts, go to <https://www.hp.com/buy/parts>.

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Check the supplies status page to verify that the toner cartridges, TCU, or the transfer belt kit are not past their useful life. Replace the supplies and maintenance parts as necessary.

3. For color printers, inspect the transfer belt for damage. Replace the transfer belt if necessary or instruct the customer to replace it.
4. For color printers, if the error persists, replace the registration assembly.
5. Check the connections between the laser/scanner and the DC controller, and from the laser/scanner to the printer. Reseat them if necessary. If the error persists, replace the laser scanner.

54.00.01 / 54.00.03

Environment sensor abnormality warning

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then turn on the printer.
2. Replace the environment sensor.

Part number: RM2-9037-000CN



NOTE: Before replacing any parts, ensure that the connection (J16) on the DC Controller is correctly seated.

55.WX.YZ, 56.WX.YZ error messages

55.* errors

Errors in the 55.* family often indicate a problem with the DC controller.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Reset the printer:
 - a. Turn the printer off using the power switch, and then wait at least 30 seconds.
 - b. Turn the printer on and wait for it to initialize.
2. Make sure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
3. If the error persists, replace the DC controller.

55.00.01, 55.00.03 or 55.00.04 DC Controller Error

The communication link between the formatter and DC controller was lost.

- **55.00.01** DC controller memory error.
- **55.00.03** DC controller no engine response.
- **55.00.04** DC controller communications time out

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, replace the DC Controller PCA.

 **NOTE:** Make sure to order the correct part number for the printer.

Table 6-108 DC controller PCA part numbers

Description /Printer models	Part numbers
DC controller PC board assembly	RM2-9493-000CN
For printers models: M631/M632/M633/E62555/E62565/E62575	
DC controller	RM3-8458-000CN
For printer models: M634/M635/M636/ M637	
DC controller PCA	RM3-7621-000CN
For printer models: E62655/E62665/E62675	

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians


Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, disconnect and reconnect the flat flexible (FFC) connections on the formatter and DC controller.

Formatter connector: Remove one zero insertion force (ZIF) FFC (callout 1) and seven connectors (callout 2) from formatter PCA as indicated in the image below.


 **NOTE:** One connector at the upper left corner of the formatter PCA is hidden behind the sheet metal and is not indicated by callout 2.

Figure 6-224 Formatter connection: (callout 1, ZIF connector)

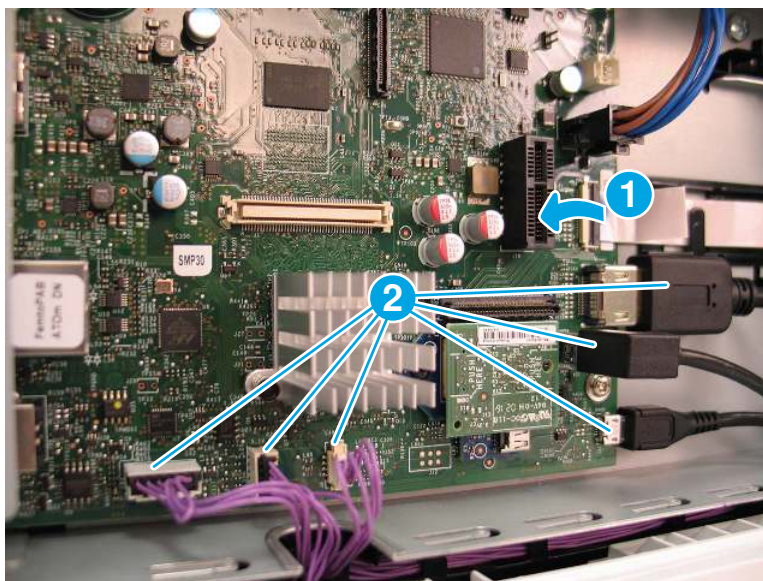

DC controller connector: Disconnect and remove the zero insertion force (ZIF) FFC cable (callout 1).

Figure 6-225 DC Controller connection (callout 1, ZIF connector)

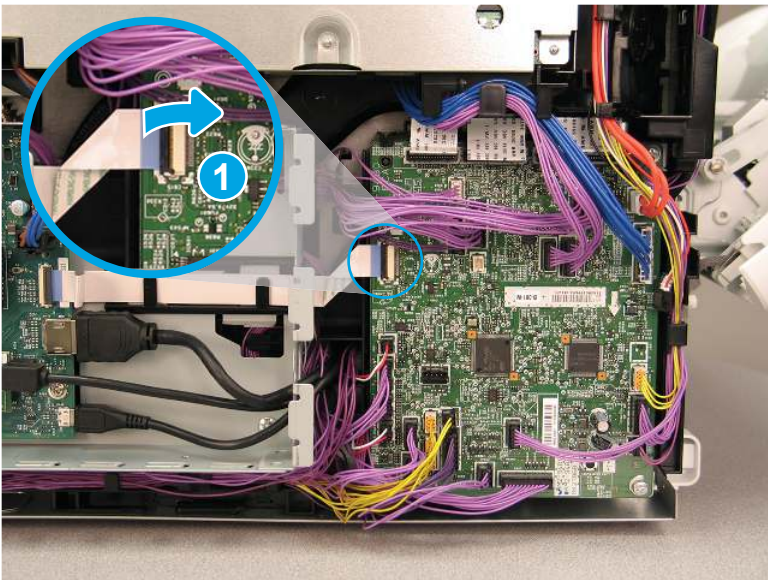

3. If the error persists, replace the DC Controller PCA.

 **NOTE:** Make sure to order the correct part number for the printer.

Table 6-109 DC controller PCA part numbers

Description /Printer models	Part numbers
DC controller PC board assembly	RM2-9493-000CN
For printers models: M631/M632/M633/E62555/E62565/ E62575	
DC controller	RM3-8458-000CN
For printer models: M634/M635/M636/ M637	
DC controller PCA	RM3-7621-000CN
For printer models: E62655/E62665/E62675	

For instructions: See the Repair Service Manual for this product.

55 . 00 . 05 Engine Firmware RFU Error

The firmware upgrade failed.

Recommended action

- 1. Turn the printer off, and then on.
- 2. If issue remains re-send the upgrade.

55.01.06, 55.02.06 DC controller error To continue turn off then on

NVRAM memory warning

- 55.01.06 (event code)

NVRAM memory data error warning.

- 55.02.06 (event code)

NVRAM memory access error warning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, check the input and output accessories (envelop feeder, stapler/stacker for example) installed for the printer.
3. Press the power button to turn off the printer, attempt to remove the installed accessories, and then turn on the printer.
4. If the error clears, turn off the printer, reinstall the accessories, and then restart the printer.
5. If the error appears, send a technician to troubleshoot the issue.
6. If the error persists, dispatch a certified engineer (CE) with a DC controller and flat flexible cables (FFC).

Table 6-110 FCC part number

Description	Part number
Flat flexible cable	RK2-8398-000CN

Table 6-111 DC controller part number

Description	Part number
DC controller PCA	RM2-9493-000CN
For printers models: M631/M632/M633/E62555/E62565/E62575	
DC controller	RM3-8458-000CN
For printer models: M634/M635/M636/ M637	

Table 6-111 DC controller part number (continued)

Description	Part number
DC controller PCA	RM3-7621-000CN
For printer models: E62655/E62665/E62675	

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, check the input and output accessories (envelop feeder, stapler/stacker for example) installed for the printer.
3. Press the power button to turn off the printer, attempt to remove the installed accessories, and then turn on the printer.
4. If the error clears, perform the following tasks when reinstalling the accessory.
 - a. Reinstall the accessory and verify that the cables are connected correctly.
 - b. If the error persists, ensure that the accessory has the correct part number and is compatible for the printer model installed. If the part number is incorrect, order the correct part number for the printer model.
 - c. If the part number for the accessory is correct, ensure that the latest firmware version is installed on the printer. Update the firmware, if required.
 - d. If the firmware is updated and the error persists, replace the faulty accessory.
5. If the error persists, turn off the printer, and carefully reseal the flat-flexible cable (FFC) on the formatter (J8104) and the FFC on the DC controller (J607).
6. If the FFC is damaged, replace the cable.

Table 6-112 FCC part number

Description	Part number
Flat flexible cable	RK2-8398-000CN

7. If the error persists, replace the DC Controller PCA.



NOTE: Make sure to order the correct part number for the printer.

Table 6-113 DC controller PCA part numbers

Description /Printer models	Part numbers
DC controller PC board assembly	RM2-9493-000CN
For printers models: M631/M632/M633/E62555/E62565/E62575	

Table 6-113 DC controller PCA part numbers (continued)

Description /Printer models	Part numbers
DC controller	RM3-8458-000CN
For printer models: M634/M635/M636/ M637	
DC controller PCA	RM3-7621-000CN
For printer models: E62655/E62665/E62675	

For instructions: See the Repair Service Manual for this product.

56.00.YZ

The printer experienced a communication error with the optional paper trays.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call agents and service technicians

1. Turn the printer off, then on.
2. If the error persists, re-seat the optional paper trays.
3. Check the input connectors for damage. If a connector is damaged, replace the connector.

1X550 single sheet feeder cable assembly part number: RM2-8868-000CN

All other input accessories cable assembly part number: RM2-9286-000CN

56.00.01 Illegal Input Printer Error

The printer experienced an illegal input.

Recommended action

1. Turn the printer off, then on.
2. Remove any third-party hardware and test again.

57.WX.YZ error messages

57.* errors

Errors in the 57.* family indicate a problem with a fan.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.
2. Press the Power button again to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Use the printer troubleshooting manual to identify the locations of each fan. Turn the printer off and then on, and listen for noise coming from the area of each fan. Replace any fan that is not making noise.
2. Update the firmware to the latest version. If the latest version firmware is already installed, reinstall it now.

For more information, see:

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. Remove enough parts to access the DC controller or the power supply PCA. Check the connections from each fan to the DC controller or power supply PCA. Reseat them if necessary.
4. With the DC controller or power supply PCA exposed, turn the printer on. Immediately measure the voltage between the connectors for each fan and the DC controller. If the voltage changes from 0V to approximately 24V during the power-on cycle, replace the affected fan. If the voltage remains at 0V, replace the DC controller.

57.00.01 Fan failure

Cartridge upper (FM3) failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.
2. Press the Power button again to turn on the printer.

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, then on.
2. Replace the cartridge upper fan FM3.

Part number: RK2-8946-000CN



NOTE: Onsite technician should perform the following steps before replacing the fan.

- a. Remove and reconnect (J6404) on the cartridge upper fan.
- b. Remove and reconnect (J16) on the DC controller PCA.
- c. If the error persists, replace the cartridge upper fan FM3.

Part number: RK2-8946-000CN

57.00.02 Fan failure

Cartridge lower fan (FM4) error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.
2. Press the Power button again to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, then on.
2. Remove and reconnect (J6405) on the cartridge lower fan.
3. Remove and reconnect (J16) on the DC controller PCA.
4. If the error persists, replace the cartridge lower fan FM4.

Part number: RK2-8946-000CN

57.00.03 Fan failure

Duplex fan FM2 failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.

2. Press the Power button again to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

1. Turn the printer off, then on.
2. Verify the error condition with the customer. The printer will not be able to print.
 - Dispatch a technician with the part below.
Fan 2 part number: RK2-8948-000CN

Recommended action for onsite technicians

1. Turn the printer off, then on.
2. Verify the error condition with the customer.
 - Prior to replacing the fan, tighten the screw on the upper paper feed guide assembly shown below.

Figure 6-226 View from Rear door

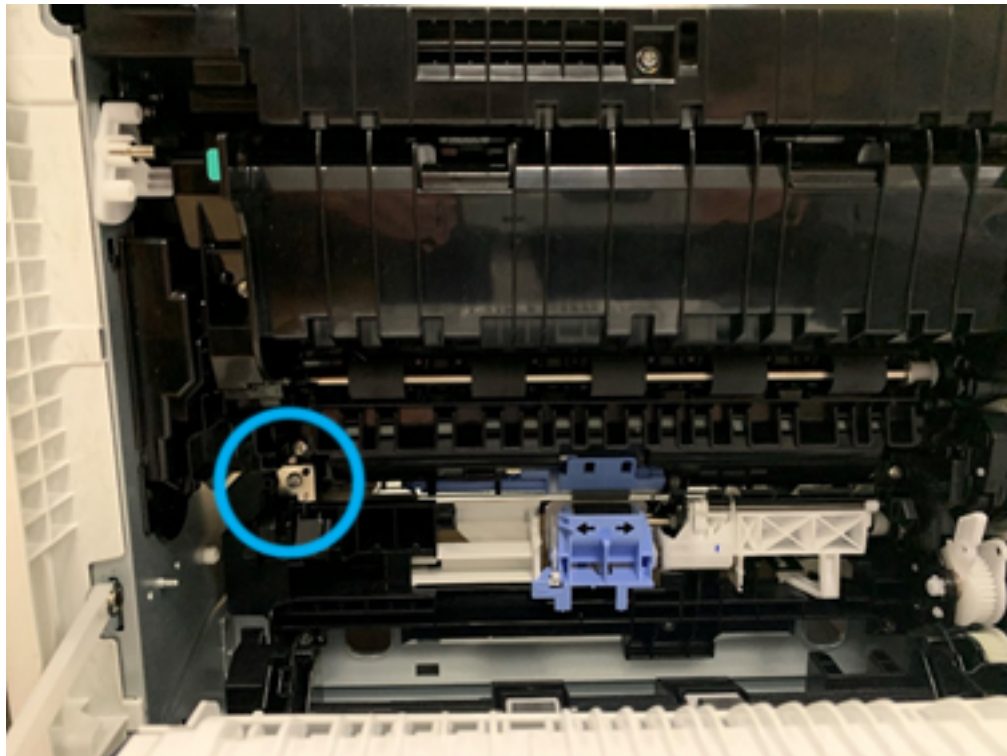


Figure 6-227 Tighten screw



3. Remove and reconnect (J13L) on door assembly and connector (J13) on the DC controller PCA.
4. If error persists after tightening screw, replace the fan.

 **IMPORTANT:** Prior to replacing the fan, tighten the screw on the upper paper feed guide assembly shown previously. A floating ground condition may exist causing excess electrical discharge being absorbed by FM2 and causing a premature failure.

Fan 2 part number: RK2-8948-000CN

5. If the fan replacement does not resolve the issue, replace the DC Controller based on the specific product.

DC Controller part numbers:

RM2-9493-000CN (M631, M632, M633, E62555, E62565, E62575)

RM3-7621-000CN (E62655, E62665, E62675 only)

RM3-8458-000CN (M634, M635, M636, M637)

For instructions: See the Repair Service Manual for this product.

57.00.04 Fan failure

Scanner fan FM1 failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.

2. Press the Power button again to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, then on.
2. Remove and reconnect (J6402) on the scanner fan.
3. Remove and reconnect (J211) on the DC controller PCA.
4. If the error persists, replace the scanner fan FM1.

Part number: RK2-8946-000CN

58.WX.YZ error messages

58.* errors

Errors in the 58.* family indicate an electrical problem inside the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Make sure the printer is connected to a dedicated power outlet and not to a surge protector or other type of extension cord.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Make sure the printer is connected to a dedicated power outlet and not to a surge protector or other type of extension cord.
3. Check all connections on the DC Controller and the power supply. Trace the connections from the DC Controller and power supply to the sensors and other components and reseal them if necessary.

58.00.02 Error

Environmental sensor failure.

Recommended action for customers

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues. Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues. Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. If the error persists, replace the environmental sensor.

Part number: RM2-9037-000CN



NOTE: Before replacing any parts, ensure that the connections of the environment sensor (J4200) and connector (J16) on the DC controller PCA are correctly seated and are not damaged.

58.00.03 Error

DC controller failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Verify the error condition with the customer.
3. If the error persists, replace the DC controller PCA.

Table 6-114 DC controller PCA part numbers

Description /Printer models	Part numbers
DC controller PC board assembly For printers models: M631/M632/M633/E62555/E62565/ E62575	RM2-9493-000CN
DC controller For printer models: M634/M635/M636/ M637	RM3-8458-000CN
DC controller PCA For printer models: E62655/E62665/E62675	RM3-7621-000CN

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, disconnect and reconnect all the cables on the DC controller.



NOTE: Before replacing any parts, ensure that the connections on the DC controller PCA are not damaged and seated correctly.

3. If the error persists, replace the DC controller PCA.

Table 6-115 DC controller PCA part numbers

Description /Printer models	Part numbers
DC controller PC board assembly For printers models: M631/M632/M633/E62555/E62565/ E62575	RM2-9493-000CN
DC controller For printer models: M634/M635/M636/ M637	RM3-8458-000CN
DC controller PCA For printer models: E62655/E62665/E62675	RM3-7621-000CN

For instructions: See the Repair Service Manual for this product.

58.00.04 Error

Low-voltage power supply unit malfunction.

Recommended action for customers

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues. Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues. Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. Ensure the printer is plugged into a dedicated power outlet.
3. If the error persists, replace the low-voltage power supply (LVPS).



NOTE: Before replacing any parts, ensure that the connections on the DC controller PCA are correctly seated and are not damaged.

110V LVPS part number: RM2-6797-000CN

For instructions: See the Repair Service Manual for this product.

220V LVPS part number: RM2-6798-000CN

For instructions: See the Repair Service Manual for this product.

58.01.04 Error

24V power supply error during operation.

During a regular printing operation the 24V power supply experienced an error.

Recommended action for customers

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues. Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues. Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. Ensure the printer is plugged into a dedicated power outlet.

3. If the error persists, replace the low-voltage power supply (LVPS).



NOTE: Before replacing any parts, ensure that the connections on the DC controller PCA are correctly seated and are not damaged.

110V LVPS part number: RM2-6797-000CN

For instructions: See the Repair Service Manual for this product.

220V LVPS part number: RM2-6798-000CN

For instructions: See the Repair Service Manual for this product.

58.02.04 Error

24V power supply error during printer power on or wake up.

During the printer power on, or when waking from a sleep mode, the printer experienced an error with the 24V power supply.



NOTE: Check the voltage of the unit on the regulatory sticker. This event is directly related to a 220V printer being plugged into a 110V outlet. Ensure that the voltage of the outlet matches the voltage of the printer.

Recommended action for customers

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues. Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues. Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. Ensure the printer is plugged into a dedicated power outlet.
3. If the error persists, replace the low-voltage power supply (LVPS).



NOTE: Before replacing any parts, ensure that the connections on the DC controller PCA are correctly seated and are not damaged.

110V LVPS part number: RM2-6797-000CN

For instructions: See the Repair Service Manual for this product.

220V LVPS part number: RM2-6798-000CN

For instructions: See the Repair Service Manual for this product.

59.WX.YZ error messages

59.* errors

Errors in the 59.* family indicate a problem with one of the motors or with the lifter drive assembly for one of the trays.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Check all connections on the main control board of the printer, (DC controller, Engine control board ECB) each motor, and to the paper feeder drive PCA (for an optional paper feeder). Reseat them if necessary.

59.00.30 or 59.00.40: Fuser error

Fuser motor (M1) start up error or fuser motor (M1) rotational error.

Recommended action for customers

- See this support document: [HP LaserJet Enterprise, HP PageWide Enterprise - 59.OX.YZ Errors](#)

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Locate the fuser and remove it.

Depending on the location of the fuser, open the rear door or the right door to remove the fuser.

 **CAUTION:** The fuser might be hot. Ensure to wait for the fuser to cool before removing it.

3. Rotate the fuser gear to ensure it moves freely. If it does not move freely, replace the fuser.

 **NOTE:** The fuser gear might not move easily and will require moderate force to rotate.


Table 6-116 Fuser assembly part numbers

Description	Part number
110V Fuser assembly	RM2-1256-020CN
220V Fuser assembly	RM2-1257-020CN

For instructions: See the Repair Service Manual for this product.

4. If the fuser gear moves freely, perform a diagnostic test to check the fuser motor.
 - a. From the Home screen on the printer control panel, select [Support Tools](#).
 - b. Open the following menus:
 - i. [Troubleshooting](#)
 - ii. [Diagnostic Tests](#)
 - iii. [Component Test](#)
 - c. Select [Fuser motor](#), and then select [Start](#).

Figure 6-228 Fuser motor test

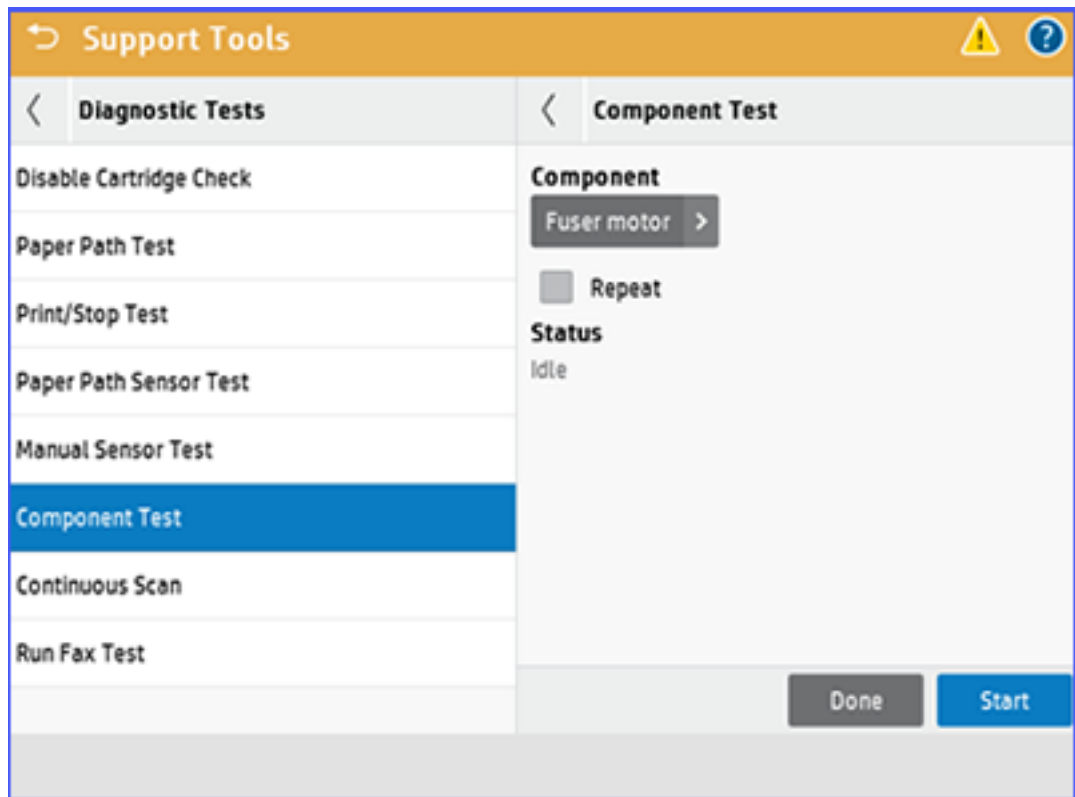

5. If the fuser motor test fails, replace the fuser drive assembly.

Table 6-117 Fuser drive motor part number

Description	Part number
Fuser drive motor (M1) assembly	RM2-6763-000CN

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Locate the fuser and remove it.

Depending on the location of the fuser for the printer model, open the rear door or the right door to remove the fuser.

 **CAUTION:** The fuser might be hot. Ensure to wait for the fuser to cool before removing it.

3. Rotate the fuser gear to ensure it moves freely. If it does not move freely, replace the fuser.

 **NOTE:** The fuser gear might not move easily and will require moderate force to rotate.

Table 6-118 Fuser assembly part numbers


Description	Part number
110V Fuser assembly	RM2-1256-020CN
220V Fuser assembly	RM2-1257-020CN

For instructions: See the Repair Service Manual for this product.

4. If the fuser gear moves freely, perform a diagnostic test to check the fuser motor.
 - a. From the Home screen on the printer control panel, select [Support Tools](#).
 - b. Open the following menus:
 - i. [Troubleshooting](#)
 - ii. [Diagnostic Tests](#)
 - iii. [Component Test](#)

- c. Select **Fuser motor**, and then select **Start**.

Figure 6-229 Fuser motor test

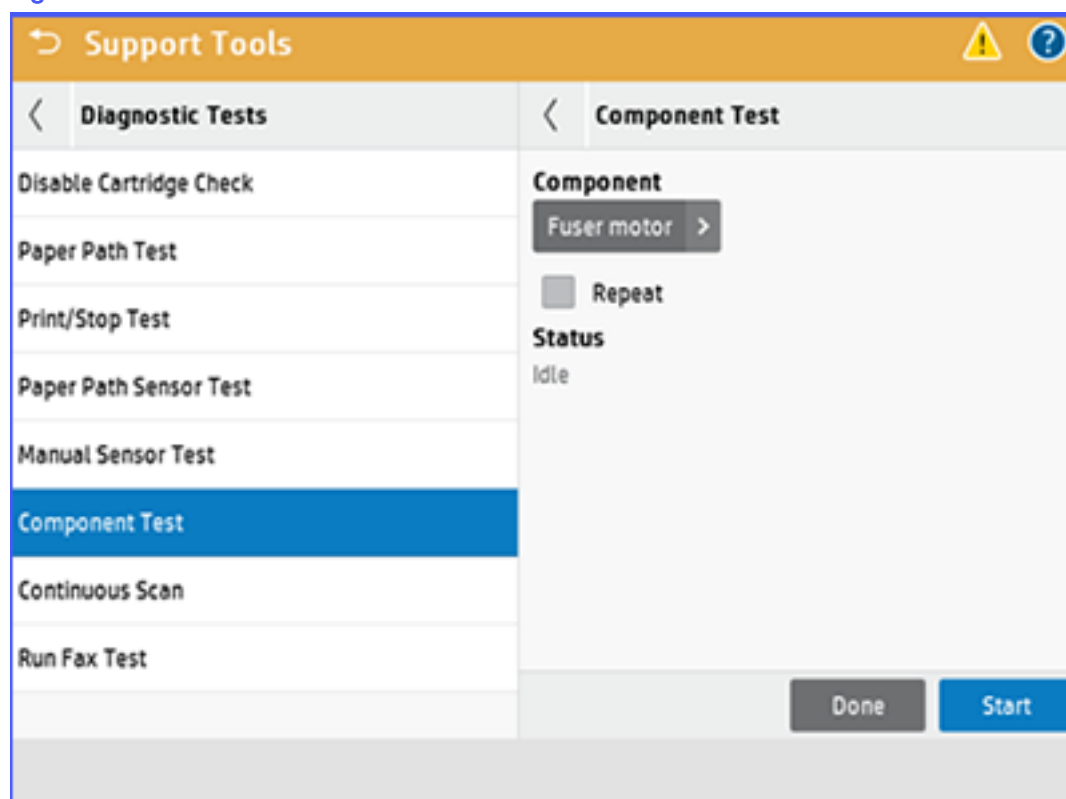

5. If the fuser motor test fails or does not function correctly, disconnect and reconnect the connector J204 on the DC controller PCA, and then perform the Fuser motor test again.
6. If the issue persists, replace the fuser drive assembly (M1).

Table 6-119 Fuser drive motor part number

Description	Part number
Fuser drive motor (M1) assembly	RM2-6763-000CN

For instructions: See the Repair Service Manual for this product.

7. If the error persists, replace the DC controller PCA.



NOTE: Make sure to order the correct part number for the printer.

Table 6-120 DC controller PCA part numbers

Description /Printer models	Part numbers
DC controller PC board assembly	RM2-9493-000CN
For printers models: M631/M632/M633/E62555/E62565/E62575	

Table 6-120 DC controller PCA part numbers (continued)

Description /Printer models	Part numbers
DC controller	RM3-8458-000CN
For printer models: M634/M635/M636/ M637	
DC controller PCA	RM3-7621-000CN
For printer models: E62655/E62665/E62675	

For instructions: See the Repair Service Manual for this product.

59.00.50 or 59.00.60

The printer experienced a drum motor (M2) error.

- **59.00.50, 59.05.50** Drum motor startup abnormality.
- **59.00.60, 59.05.60** Drum motor rotation abnormality.

Recommended action for customers

- See this support document: [HP LaserJet Enterprise, HP PageWide Enterprise - 59.0X.YZ Errors](#)

Recommended action for call-center agents

1. Turn the printer off.
2. Remove the toner cartridge and turn the printer on.
3. If the error does not display, replace the toner cartridge. If the error persists, replace the drum motor

Drum motor part number: RM2-9316-000CN

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

1. Turn the printer off.
2. Remove the toner cartridge and turn the printer on.
3. Test the fuser motor.
 - a. From the home screen on the printer control panel, touch **Support Tools**.
 - b. Open the following menus: **Troubleshooting > Diagnostic Tests > > Components Test**
 - c. Touch **Drum motor**.
 - d. If the motor does not function correctly, ensure connector J203 on the DC controller PCA is securely and correctly seated.
 - e. Retest the drum motor as needed.

- f. If motor continues to fail, replace the drum motor assembly.

Drum motor part number: RM2-9316-000CN

For instructions: See the Repair Service Manual for this product.

Main drive assembly part number: RM2-6777-000CN

For instructions: See the Repair Service Manual for this product.

- 4. If the error persists after the motor has been replaced, replace the DC controller.

DC Controller part numbers:

RM2-9493-000CN (M631, M632, M633, E62555, E62565, E62575)

RM3-7621-000CN (E62655, E62665, E62675 only)

RM3-8458-000CN (M634, M635, M636, M637)

For instructions: See the Repair Service Manual for this product.

59.00.90

The developer-disengagement motor experienced a rotational error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

- 1. Turn the printer off, and then on.
- 2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

- 1. Turn the printer off.
- 2. Remove the toner cartridge and turn the printer on.

If the message "install toner cartridge appears without the 59 error, reinstall the toner cartridge.

- 3. If the error returns with the toner cartridge installed, try a new cartridge if available. If not replace the toner cartridge.



NOTE: Check the part number on the installed toner cartridge to ensure the correct capacity cartridge is ordered.

- 4. If the error persists with a new toner cartridge, replace the Developing Drive Assembly.

Developer drive assembly part number: RM2-6756-000CN

M607, M608, M608nk, M609, M610, M611, M612, E60055-E60075, E60155-E60175

For instructions: See the Repair Service Manual for this product.

M631, M632, M633, M634, M635, M636, M637, E62555-E62575, E62655-E62675

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

1. Turn the printer off.
2. Remove the toner cartridge and turn the printer on.
If the message "install toner cartridge appears without the 59 error, reinstall the toner cartridge.
3. If the error returns with the toner cartridge installed, try a new cartridge if available. If not replace the toner cartridge.



NOTE: Check the part number on the installed toner cartridge to ensure the correct capacity cartridge is ordered.

4. If the error persists, check connection J301 on the DC Controller.
5. Check the connection on the Developing Drive Assembly.
6. If the error persists with a new toner cartridge, replace the Developing Drive Assembly.

Developer drive assembly part number: RM2-6756-000CN

M607, M608, M608nk, M609, M610, M611, M612, E60055-E60075, E60155-E60175

For instructions: See the Repair Service Manual for this product.

M631, M632, M633, M634, M635, M636, M637, E62555-E62575, E62655-E62675

For instructions: See the Repair Service Manual for this product.

59.00.C0

The developer-disengagement motor experienced a rotational error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

1. Turn the printer off.
2. Remove the toner cartridge and turn the printer on.
If the message "install toner cartridge appears without the 59 error, reinstall the toner cartridge.
3. If the error returns with the tone cartridge installed, try a new cartridge if available. If not replace the toner cartridge.



NOTE: Check the part number on the installed toner cartridge to ensure the correct capacity cartridge is ordered.

4. If the error persists with a new toner cartridge, replace the Developing Drive Assembly.

Developer drive assembly part number: RM2-6756-000CN

M607, M608, M608nk, M609, M610, M611, M612, E60055-E60075, E60155-E60175

For instructions: See the Repair Service Manual for this product.

M631, M632, M633, M634, M635, M636, M637, E62555-E62575, E62655-E62675

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

1. Turn the printer off.
2. Remove the toner cartridge and turn the printer on.
If the message "install toner cartridge appears without the 59 error, reinstall the toner cartridge.
3. If the error returns with the tone cartridge installed, try a new cartridge if available. If not replace the toner cartridge.



NOTE: Check the part number on the installed toner cartridge to ensure the correct capacity cartridge is ordered.

4. Check connection J301 on the DC Controller.
5. Check the connection on the Developing Drive Assembly.
6. If the error persists, replace the Developing Drive Assembly (PS4850).

Developer drive assembly part number: RM2-6756-000CN

M607, M608, M608nk, M609, M610, M611, M612, E60055-E60075, E60155-E60175

For instructions: See the Repair Service Manual for this product.

M631, M632, M633, M634, M635, M636, M637, E62555-E62575, E62655-E62675

For instructions: See the Repair Service Manual for this product.

60.00.0Y, 62.00.00 error messages

60.* errors

Errors in the 60.* family are related to one of the optional trays.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.



NOTE: You can determine the tray number from the last digit in the error number. For example:

- 60.00.02 or 60.01.02 = Tray 2
- 60.00.03 or 60.01.03 = Tray 3

1. Open the failing tray and remove all paper from the tray.
2. Close the tray to check if the error persists.
3. Reload the paper and test the printer.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Use the [Tray/Bin Manual Sensor](#) test to verify that the sensors for each tray are functioning correctly.
2. Check all connectors on the paper feeder PCA.
3. Replace the optional paper feeder.

60.01.02

Tray 2 lifting error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.



NOTE: You can determine the tray number from the last digit in the error number. For example:

- 60.00.02 or 60.01.02 = Tray 2
- 60.00.03 or 60.01.03 = Tray 3

1. Open the failing tray and remove all paper from the tray.
2. Close the tray to check if the error persists.
3. Reload the paper and test the printer.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.



NOTE: You can determine the tray number from the last digit in the error number. For example:

- 60.00.02 or 60.01.02 = Tray 2
- 60.00.03 or 60.01.03 = Tray 3

1. Open the failing tray and remove all paper from the tray.
2. Close the tray and check if the error persists.
3. If the issue persists, reload the paper in the tray and adjust the paper guides to the correct paper size.



NOTE: Do not adjust the paper guides tightly against the paper stack. Adjust them to the indentations or markings in the tray.

4. If the error persists, replace the cassette assembly.

Table 6-121 Cassette assembly part number

Description	Part number
550-sheet paper feeder cassette	RM2-0866-020CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: You can determine the tray number from the last digit in the error number. For example:

- 60.00.02 or 60.01.02 = Tray 2
- 60.00.03 or 60.01.03 = Tray 3

1. Open the failing tray and remove all paper from the tray.
2. Close the tray and check if the error persists.
3. If the issue persists, reload the paper in the tray and adjust the paper guides to the correct paper size.



NOTE: Do not adjust the paper guides tightly against the paper stack. Adjust them to the indentations or markings in the tray.

4. If the error persists, replace the cassette assembly.

Table 6-122 Cassette assembly part number

Description	Part number
550-sheet paper feeder cassette	RM2-0866-020CN

5. If the error persists, disconnect and reconnect J206 on the DC Controller PCA prior to replacing any part.

Figure 6-230 DC controller PCA connections: Location of J206 connector

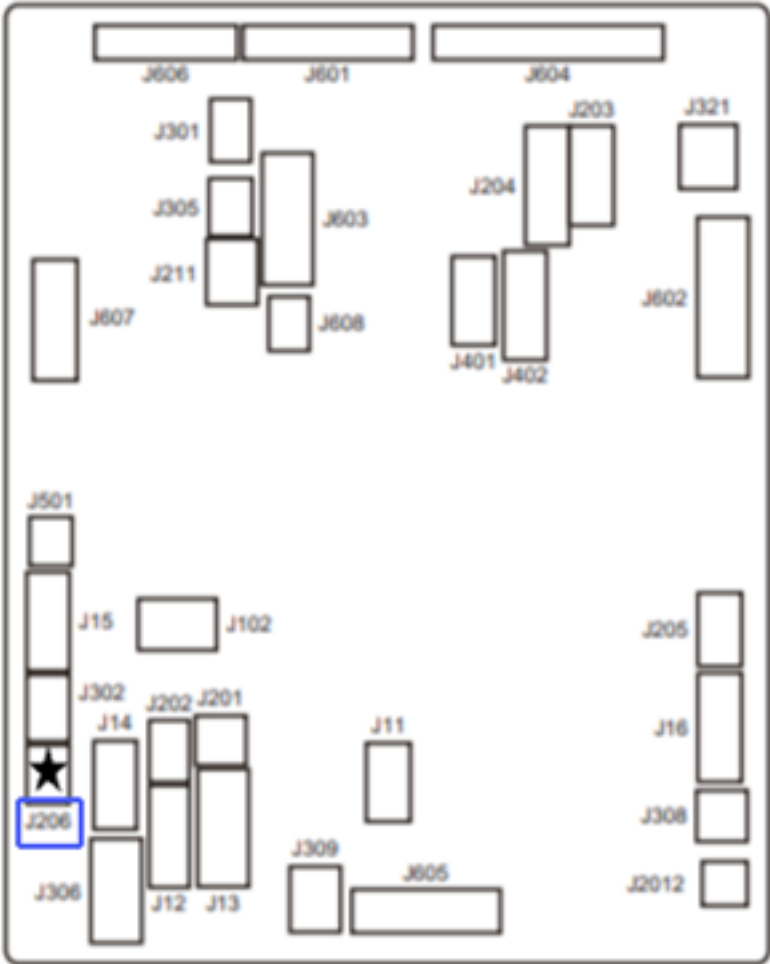


Table 6-123 DC controller PCA connections: J206 connector

Item	Description
J206	Lifter motor

6. If the error persists, replace the lifter drive assembly.

Table 6-124 Lifter drive assembly

Description	Part number
Lifter drive assembly - Includes motor (M3)	RM2-6744-000CN

For instructions: See the Repair Service Manual for this product.

7. If the error persists, replace the DC Controller PCA.



NOTE: Make sure to order the correct part number for the printer.

Table 6-125 DC controller PCA part numbers

Description /Printer models	Part numbers
DC controller PC board assembly	RM2-9493-000CN
For printers models: M631/M632/M633/E62555/E62565/E62575	
DC controller	RM3-8458-000CN
For printer models: M634/M635/M636/ M637	
DC controller PCA	RM3-7621-000CN
For printer models: E62655/E62665/E62675	

For instructions: See the Repair Service Manual for this product.

60.01.03

Tray 3 lifting error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.



NOTE: You can determine the tray number from the last digit in the error number. For example:

- 60.00.02 or 60.01.02 = Tray 2
- 60.00.03 or 60.01.03 = Tray 3

1. Open the failing tray and remove all paper from the tray.
2. Close the tray to check if the error persists.
3. Reload the paper and test the printer.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Re-seat connector on the Feeder Controller/HCI Controller PCA assembly from the lifter drive assembly.

2. If the error persists, replace the Lifter drive Assembly based on the input tray.

Table 6-126 Parts

Part Name	Part Number	Instructions link
1x550 Input Tray Lifter Drive Assembly (M3601)	RM2-0895-000CN	For instructions: See the Repair Service Manual for this product.
1x550 Envelope feeder Lifter Drive Assembly (M3601)	RM2-0895-000CN	For instructions: See the Repair Service Manual for this product.
1x550 Sheet Feeder stand Lifter Drive Assembly (M3401)	RM2-0948-000CN	For instructions: See the Repair Service Manual for this product.
3x550 Sheet Feeder Lifter Drive Assembly (M3401)	RM2-0948-000CN	For instructions:
3x550 Upper, middle and lower trays.		See the Repair Service Manual for this product.
2,550 Upper cassette tray		See the Repair Service Manual for this product.
		See the Repair Service Manual for this product.
2,550 Sheet Feeder stand 2,000 sheet deck Lifter Drive Assembly (M3401)	RM2-0948-000CN	See the Repair Service Manual for this product.
		for instructions: See the Repair Service Manual for this product.

3. If the error persists, replace the Feeder Controller PCA Assembly.

Table 6-127 Parts

Part Name	Part Number	Instructions link
1x550 Input Tray Controller PCA	RM2-8767-000CN	For instructions: See the Repair Service Manual for this product.
1x550 Envelope feeder Controller PCA	RM2-8785-000CN	For instructions: See the Repair Service Manual for this product.
1x550 Sheet Feeder stand Controller PCA	RM2-8827-000CN	For instructions: See the Repair Service Manual for this product.
3x550 Sheet Feeder Controller PCA	RM2-8807-000CN	For instructions: See the Repair Service Manual for this product.
2,550 Sheet Feeder stand Controller PCA	RM2-9020-000CN	for instructions: See the Repair Service Manual for this product.

60.01.04

Tray 4 lifting error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.



NOTE: You can determine the tray number from the last digit in the error number. For example:

- 60.00.02 or 60.01.02 = Tray 2
- 60.00.03 or 60.01.03 = Tray 3

1. Open the failing tray and remove all paper from the tray.
2. Close the tray to check if the error persists.
3. Reload the paper and test the printer.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Re-seat connector on the Feeder Controller/HCI Controller PCA assembly from the lifter drive assembly.
2. If the error persists, replace the Lifter drive Assembly based on the input tray.

Table 6-128 Parts

Part Name	Part Number	Instructions link
1x550 Input Tray Lifter Drive Assembly (M3601)	RM2-0895-000CN	For instructions: See the Repair Service Manual for this product.
1x550 Envelope feeder Lifter Drive Assembly (M3601)	RM2-0895-000CN	For instructions: See the Repair Service Manual for this product.
1x550 Sheet Feeder stand Lifter Drive Assembly (M3401)	RM2-0948-000CN	For instructions: See the Repair Service Manual for this product.
3x550 Sheet Feeder Lifter Drive Assembly (M3401)	RM2-0948-000CN	For instructions: See the Repair Service Manual for this product.
3x550 Upper, middle and lower trays.		See the Repair Service Manual for this product.
2,550 Upper cassette tray		See the Repair Service Manual for this product.
2,550 Sheet Feeder stand 2,000 sheet deck Lifter Drive Assembly (M3401)	RM2-0948-000CN	See the Repair Service Manual for this product. for instructions: See the Repair Service Manual for this product.

3. If the error persists, replace the Feeder Controller PCA Assembly.

Table 6-129 Parts

Part Name	Part Number	Instructions link
1x550 Input Tray Controller PCA	RM2-8767-000CN	For instructions: See the Repair Service Manual for this product.

Table 6-129 Parts (continued)

Part Name	Part Number	Instructions link
1x550 Envelope feeder Controller PCA	RM2-8785-000CN	For instructions: See the Repair Service Manual for this product.
1x550 Sheet Feeder stand Controller PCA	RM2-8827-000CN	For instructions: See the Repair Service Manual for this product.
3x550 Sheet Feeder Controller PCA	RM2-8807-000CN	For instructions: See the Repair Service Manual for this product.
2,550 Sheet Feeder stand Controller PCA	RM2-9020-000CN	for instructions: See the Repair Service Manual for this product.

60.01.05

Tray 5 lifting error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.



NOTE: You can determine the tray number from the last digit in the error number. For example:

- 60.00.02 or 60.01.02 = Tray 2
- 60.00.03 or 60.01.03 = Tray 3

1. Open the failing tray and remove all paper from the tray.
2. Close the tray to check if the error persists.
3. Reload the paper and test the printer.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Re-seat connector on the Feeder Controller/HCI Controller PCA assembly from the lifter drive assembly.
2. If the error persists, replace the Lifter drive Assembly based on the input tray.

Table 6-130 Parts

Part Name	Part Number	Instructions link
1x550 Input Tray Lifter Drive Assembly (M3601)	RM2-0895-000CN	For instructions: See the Repair Service Manual for this product.
1x550 Envelope feeder Lifter Drive Assembly (M3601)	RM2-0895-000CN	For instructions: See the Repair Service Manual for this product.
1x550 Sheet Feeder stand Lifter Drive Assembly (M3401)	RM2-0948-000CN	For instructions: See the Repair Service Manual for this product.

Table 6-130 Parts (continued)

Part Name	Part Number	Instructions link
3x550 Sheet Feeder Lifter Drive Assembly (M3401)	RM2-0948-000CN	For instructions: See the Repair Service Manual for this product.
3x550 Upper, middle and lower trays.		
2,550 Upper cassette tray		See the Repair Service Manual for this product. See the Repair Service Manual for this product.
2,550 Sheet Feeder stand 2,000 sheet deck Lifter Drive Assembly (M3401)	RM2-0948-000CN	See the Repair Service Manual for this product. for instructions: See the Repair Service Manual for this product.

- If the error persists, replace the Feeder Controller PCA Assembly.

Table 6-131 Parts

Part Name	Part Number	Instructions link
1x550 Input Tray Controller PCA	RM2-8767-000CN	For instructions: See the Repair Service Manual for this product.
1x550 Envelope feeder Controller PCA	RM2-8785-000CN	For instructions: See the Repair Service Manual for this product.
1x550 Sheet Feeder stand Controller PCA	RM2-8827-000CN	For instructions: See the Repair Service Manual for this product.
3x550 Sheet Feeder Controller PCA	RM2-8807-000CN	For instructions: See the Repair Service Manual for this product.
2,550 Sheet Feeder stand Controller PCA	RM2-9020-000CN	for instructions: See the Repair Service Manual for this product.

60.01.06

Tray 6 lifting error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.



NOTE: You can determine the tray number from the last digit in the error number. For example:

- 60.00.02 or 60.01.02 = Tray 2
- 60.00.03 or 60.01.03 = Tray 3

- Open the failing tray and remove all paper from the tray.
- Close the tray to check if the error persists.
- Reload the paper and test the printer.

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Re-seat connector on the Feeder Controller/HCI Controller PCA assembly from the lifter drive assembly.
2. If the error persists, replace the Lifter drive Assembly based on the input tray.

Table 6-132 Parts

Part Name	Part Number	Instructions link
1x550 Input Tray Lifter Drive Assembly (M3601)	RM2-0895-000CN	For instructions: See the Repair Service Manual for this product.
1x550 Envelope feeder Lifter Drive Assembly (M3601)	RM2-0895-000CN	For instructions: See the Repair Service Manual for this product.
1x550 Sheet Feeder stand Lifter Drive Assembly (M3401)	RM2-0948-000CN	For instructions: See the Repair Service Manual for this product.
3x550 Sheet Feeder Lifter Drive Assembly (M3401)	RM2-0948-000CN	For instructions: See the Repair Service Manual for this product.
3x550 Upper, middle and lower trays.		See the Repair Service Manual for this product.
2,550 Upper cassette tray		See the Repair Service Manual for this product.
2,550 Sheet Feeder stand 2,000 sheet deck Lifter Drive Assembly (M3401)	RM2-0948-000CN	See the Repair Service Manual for this product. for instructions: See the Repair Service Manual for this product.

3. If the error persists, replace the Feeder Controller PCA Assembly.

Table 6-133 Parts

Part Name	Part Number	Instructions link
1x550 Input Tray Controller PCA	RM2-8767-000CN	For instructions: See the Repair Service Manual for this product.
1x550 Envelope feeder Controller PCA	RM2-8785-000CN	For instructions: See the Repair Service Manual for this product.
1x550 Sheet Feeder stand Controller PCA	RM2-8827-000CN	For instructions: See the Repair Service Manual for this product.
3x550 Sheet Feeder Controller PCA	RM2-8807-000CN	For instructions: See the Repair Service Manual for this product.
2,550 Sheet Feeder stand Controller PCA	RM2-9020-000CN	for instructions: See the Repair Service Manual for this product.

62.* errors

Errors in the 62.* family indicate a problem with the print engine.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Check all connectors on the formatter. Reseat them if necessary.
3. Upgrade the printer firmware.
4. If the error persists print the event log from the control panel, or access it from the HP Embedded Web Server (EWS), then elevate the case using the Standard Support Process.



NOTE: To access the EWS, open a Web browser, and in the address line, enter the printer IP address.

62 . 00 . 00 No system To continue turn off then on

The printer experienced an internal system failure.

Recommended action

1. Turn the printer off, then on.
2. If the error persists, reload the firmware. If the error still persists, perform a firmware upgrade.
3. If the firmware upgrade does not resolve the problem, replace the hard disk.

65.X0.AZ error messages

65.* errors

Errors in the 65.* family are related to output accessories.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. Verify the output accessory is correctly connected to the printer.
3. If the error persists, replace the output accessory.

66.WX.YZ error messages

66.* errors

Errors in the 66.* family are related to output accessories.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. Verify the output accessory is correctly connected to the printer.
3. If the error persists, replace the output accessory.

66 . 00 . 77 Output accessory failure

The output device experienced an internal communication malfunction

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. If the error persists, replace the output accessory controller PCA.

Part number: RM2-8847-000CN

For instructions: See the Repair Service Manual for this product.

66 . 00 . 0A Output accessory failure

STOP_CONTROL timeout error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. If the error persists, replace the output accessory controller PCA.
Part number: RM2-8847-000CN
For instructions: See the Repair Service Manual for this product.

66.80.01 and 66.80.02 device failure

An external paper handling accessory error has occurred.

- **66.80.01** Y-align malfunction
- **66.80.02** Jogger malfunction

Recommended action for customers

1. Check the output device for any paper jams or obstructions. Clear paper jams and debris as needed.
2. Turn the printer off, and then on.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following to help resolve the issue.

1. Check the output device for any paper jams or obstructions. Clear paper jams and debris as needed.
2. Turn the printer off, and then on.
3. Disconnect J401 and check for the error 66.80.01. If the error is 66.80.01 reconnect the cable and continue with the following steps.
4. Disconnect J301 (upper feeder assembly). If the printer is booting up and shows the stacker right door is open (which is normal for that sensor), and no more 66.80.01 error. Replace the jogger assembly first.

Part number: RM2-1066-000CN

For instructions: See the Repair Service Manual for this product.

5. If the printer still shows the error 66.80.01 replace the upper feeder assembly.

Part number: RM2-1067-000CN

For instructions: See the Repair Service Manual for this product.

66.80.03, 66.80.19, 66.80.20 or 66.80.35 device failure

A stapler error has occurred in the external paper handling accessory.

- **66.80.03** Stapler malfunction

- **66.80.19** Stapler malfunction
- **66.80.20** The staple jaw is unable to close, most likely due to a jammed staple.
- **66.80.35** Self priming malfunction

Recommended action for customers

1. Check the output device for any paper jams or obstructions. Clear paper jams and debris as needed.
2. Remove the staple cartridge and check for jammed staples. Clear all jammed staples.
3. Turn the printer off, and then on.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Check the output device for any paper jams or obstructions. Clear paper jams and debris as needed.
2. Remove the staple cartridge and check for jammed staples. Clear all jammed staples.
3. Turn the printer off, and then on.
4. If the error persists, replace the stapler.

Part number: RK2-8148-000CN

For instructions: See the Repair Service Manual for this product.

66 . 80 . 17 device failure

An external paper handling accessory error has occurred.

- **66.80.17** Fan malfunction

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. If the error persists, replace the fan.

Part number: RK2-8153-000CN

For instructions: See the Repair Service Manual for this product.

66.80.21, 66.80.22, 66.80.23, and 66.80.33 device failure

An external paper handling accessory error has occurred.

- **66.80.21** Lift up malfunction
- **66.80.22** Lift down malfunction
- **66.80.23** Lift sensor malfunction
- **66.80.33** Alienation malfunction

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. If the error persists, replace the upper paper feed assembly.

Part number: RM2-1067-000CN

For instructions: See the Repair Service Manual for this product.

70.WX.YZ error messages

70.* errors

Messages in the 70.* family indicate a problem with the DC controller or Formatter (ECB) depending on your printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Replace the DC controller or the Formatter as needed.

70 . 00 . 00 Error To continue turn off then on

DC controller failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, replace the DC controller.



NOTE: Make sure to order the correct part number for the printer.

Table 6-134 DC controller PCA part numbers

Description /Printer models	Part numbers
DC controller PC board assembly	RM2-9493-000CN
For printers models:M631/M632/M633/E62555/E62565/E62575	

Table 6-134 DC controller PCA part numbers (continued)

Description /Printer models	Part numbers
DC controller	RM3-8458-000CN
For printer models: M634/M635/M636/ M637	
DC controller PCA	RM3-7621-000CN
For printer models: E62655/E62665/E62675	

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, disconnect and reconnect the cables on the DC controller.
3. If the error persists, replace the DC controller PCA.



NOTE: Make sure to order the correct part number for the printer.

Table 6-135 DC controller PCA part numbers

Description /Printer models	Part numbers
DC controller PC board assembly	RM2-9493-000CN
For printers models: M631/M632/M633/E62555/E62565/E62575	
DC controller	RM3-8458-000CN
For printer models: M634/M635/M636/ M637	
DC controller PCA	RM3-7621-000CN
For printer models: E62655/E62665/E62675	

For instructions: See the Repair Service Manual for this product.

80.WX.YZ, 81.WX.YZ, 82.WX.YZ error messages

80 . 0x . yz Embedded Jetdirect Error

An Embedded HP JetDirect print server critical error has occurred.

- 80 . 01 . 80 (event log) No heartbeat
- 80 . 01 . 81 (event log) Reclaim time-out
- 80 . 01 . 82 (event log) Invalid data length
- 80 . 01 . 8B (event log) Invalid max outstanding packet header field
- 80 . 01 . 8C (event log) Invalid channel mapping response
- 80 . 03 . 01 (event log) No PGP buffers
- 80 . 03 . 02 (event log) Channel table full
- 80 . 03 . 03 (event log) Producer index not reset
- 80 . 03 . 04 (event log) Consumer index not reset
- 80 . 03 . 05 (event log) Queue position size too small
- 80 . 03 . 06 (event log) Transport overflow
- 80 . 03 . 07 (event log) No overflow packets
- 80 . 03 . 08 (event log) Invalid identify response
- 80 . 03 . 09 (event log) Invalid channel map return status
- 80 . 03 . 10 (event log) Invalid reclaim return status
- 80 . 03 . 12 (event log) Datagram invalid buffer
- 80 . 03 . 13 (event log) Max stream channels
- 80 . 03 . 14 (event log) Max datagram channels
- 80 . 03 . 15 (event log) Card reset failed
- 80 . 03 . 16 (event log) Self-test failure
- 80 . 03 . 17 (event log) Unknown PGP packet
- 80 . 03 . 18 (event log) Duplicate I/O channel

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer.
2. Disconnect the network (Ethernet) cable.
3. Press the power button to turn on the printer.

4. Turn off the printer, and then reconnect the Ethernet cable to the Ethernet port on the printer and on the router.
5. Turn on the printer.
6. If the error is present only with network cable connected, try using another Ethernet cable or check the network settings.
7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-agents

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer.
2. Disconnect the network (Ethernet) cable.
3. Press the power button to turn on the printer.
4. If the error is present only with network cable connected, try using another cable or check the network settings.
5. If the error persists, replace the formatter.

Table 6-136 Formatter part numbers

Description	Part number
Formatter (main logic) PC board assembly	J8J61-60001

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer.
2. Disconnect the network (Ethernet) cable.
3. Press the power button to turn on the printer.
4. If the error is present only with network cable connected, try using another cable or check the network settings.
5. If the error persists, replace the formatter.

Table 6-137 Formatter part number

Description/ Product models	Part number
Formatter (main logic) PC board	J8J61-60001
For products: M631, M632, M633, E62555, E62565, E62575	
Formatter (main logic) PC board	3GY14-67901
For products: E62655/E62665/E62675	

Table 6-137 Formatter part number (continued)

Description/ Product models	Part number
Kit -Formatter	3GY14-67902
For products: E62655/E62665/E62675 (India/China)	
Formatter	7PS94-67901
For products: M634, M635, M636, M637 (India/China)	
Formatter	7PS94-67902
For products: M634, M635, M636, M637	

For instructions: See the Repair Service Manual for this product.

81 . WX . YZ EIO Error To continue turn off then on

An external I/O card has failed on the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer.
2. Disconnect the network (Ethernet) cable.
3. Press the power button to turn on the printer.
4. Turn off the printer, and then reconnect the Ethernet cable to the Ethernet port on the printer and on the router.
5. Turn on the printer.
6. If the error is present only with network cable connected, try using another Ethernet cable or check the network settings.
7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer.
2. Disconnect the network (Ethernet) cable.
3. Press the power button to turn on the printer.
4. Turn off the printer, and then reconnect the Ethernet cable, and then turn on the printer.
5. If the error is present only with network cable connected, try using another cable or check the network settings.
6. If the error persists, replace the formatter.

Use the table below to order the correct part number for the printer.

Table 6-138 Formatter part number

Description/ Product models	Part number
Formatter (main logic) PC board	J8J61-60001
For products: M631, M632, M633, E62555, E62565, E62575	
Formatter (main logic) PC board	3GY14-67901
For products: E62655/E62665/E62675	
Kit -Formatter	3GY14-67902
For products: E62655/E62665/E62675 (India/China)	
Formatter	7PS94-67901
For products: M634, M635, M636, M637 (India/China)	
Formatter	7PS94-67902
For products: M634, M635, M636, M637	

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer.
2. Disconnect the network (Ethernet) cable.
3. Press the power button to turn on the printer.
4. Turn off the printer, and then reconnect the network (Ethernet) cable, and then turn on the printer.
5. If the error is present only with network cable connected, try using another cable or check the network settings.
6. If the error persists, replace the formatter.



IMPORTANT: Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

Table 6-139 Formatter part number

Description/ Product models	Part number
Formatter (main logic) PC board	J8J61-60001
For products: M631, M632, M633, E62555, E62565, E62575	
Formatter (main logic) PC board	3GY14-67901
For products: E62655/E62665/E62675	
Kit -Formatter	3GY14-67902
For products: E62655/E62665/E62675 (India/China)	

Table 6-139 Formatter part number (continued)

Description/ Product models	Part number
Formatter	7PS94-67901
For products: M634, M635, M636, M637 (India/China)	
Formatter	7PS94-67902
For products: M634, M635, M636, M637	

For instructions: See the Repair Service Manual for this product.

81.09.00 Error

Internal Jetdirect Inside Networking event.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technician

Follow these troubleshooting steps in the order presented.

1. Verify that the issue occurs with the latest version of firmware.
 - a. Obtain the latest public firmware version for the device from hp.com.
 - b. Update the device firmware.
 - c. The device will reboot during the firmware update process.
 - d. If available (from HP Advance Technical Support), obtain the latest interim version of firmware to perform the same update test.
 - e. If the issue persists, continue with the next troubleshooting step.
2. Verify that the issue occurs when the device has the latest firmware and is not connected to the network.
 - a. Disconnect the network cable from the network I/O port on the device.
 - b. Turn the printer off, and then on.
 - c. If the error persists, continue with the next troubleshooting step.
3. Verify that the issue occurs when disconnected from the network and with default configuration.
 - a. Run a partial clean.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

- b. If the error persists, continue with the next troubleshooting step.
4. **Call center agents:** Dispatch an onsite technician to re-establish the trusted platform module state in the printer.

IMPORTANT: Never replace the TPM on a unit that shipped with one. The TPM that can be ordered is only available for adding a level of security on a device that never had a TPM paired from the factory. A new TPM cannot be installed for security reasons.

82.* errors

Errors in the 82.* family indicate a problem with an external I/O device, such as a Jetdirect card, an EIO card, or an external hard disk.

- **82.00.00 error:** Memory Error.
- **82.73.45 error:** Memory Error. Disk successfully cleaned. Event log only.
- **82.73.46 error:** Memory Error. A hard disk or compact flash disk cleaning failed. Usually caused by a failure of the disk hardware. Event log only.
- **82.73.47 error:** Memory Error. Some of sanitized disk did not correctly verify. Event log only.

Recommended action for customers

Customer actions for 80.* errors.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. Reload the printer firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call center agents

Call center agent actions for 80.* errors.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. If the error persists, perform a [Partial Clean](#) procedure using the [Preboot](#) menu.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish 4502973-4502949-16) - .

- a. Turn the printer on.
- b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.

- c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Partial Clean](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Press the back button once to highlight [Continue](#), and then press the [OK](#) button.
 - g. The printer automatically initializes and then returns to a Ready state.
4. If the error persists, perform a [Format Disk](#) procedure using the [Preboot](#) menu, and then upgrade the firmware to the latest version.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

- a. Turn the printer on.
 - b. Press the HP logo that displays in the middle of the screen when you see the [1/8](#) under the logo.
 - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Format Disk](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Wait for the printer to automatically initialize. The message **99.09.67** appears on the control panel.
 - g. Reload the firmware using a USB flash drive. See [99.09.67 error](#) for more information.
5. If the error persists, dispatch an onsite technician (no replacement parts required).

Recommended action for call center agents

Call center agent actions for 80.* errors.

- 1. Turn the printer off, reconnect the network cable, and then turn the printer on.
- 2. Try another network cable.
- 3. If the error persists, perform a [Partial Clean](#) procedure using the [Preboot](#) menu.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

- a. Turn the printer on.
- b. Press the HP logo that displays in the middle of the screen when you see the [1/8](#) under the logo.
- c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
- d. Press the down arrow button to highlight [Partial Clean](#), and then press the [OK](#) button.
- e. Press the [OK](#) button again.

- f. Press the back button once to highlight [Continue](#), and then press the [OK](#) button.
 - g. The printer automatically initializes and then returns to a Ready state.
 - 4. If the error persists, perform a [Format Disk](#) procedure using the [Preboot](#) menu, and then upgrade the firmware to the latest version.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

- a. Turn the printer on.
 - b. Press the HP logo that displays in the middle of the screen when you see the [1/8](#) under the logo.
 - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Format Disk](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Wait for the printer to automatically initialize. The message **99.09.67** appears on the control panel.
 - g. Reload the firmware using a USB flash drive. See [99.09.67 error](#) for more information.

82 . 0x . yz Internal disk device failure

The internal disk failed on the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. Check if the error persists.
3. If the error persists, turn off the printer, and then disconnect the power cable.
4. Remove the Hard disk drive (HDD), and then reinstall the HDD.



NOTE: Do not replace the Hard disk drive.

For instructions:

- Go to
 - or
 - Watch the following video: [How to replace the Hard disk drive](#).
 - 5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the error persists, turn off the printer, and then remove and reinstall the Hard disk drive (HDD).
For instructions, watch the following video: [How to replace the Hard disk drive](#).

3. Check if the printer boots to an error state, and then see the following information before performing a **Format Disk**.



NOTE: After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

4. Use the Preboot menu to perform a Format Disk.
 - a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
 - c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
 - d. Press the **OK** button again.
 - e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".
5. Use the power button to turn off, and then to turn on the printer.
The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.

6. Update the printer firmware using the Preboot menu.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

7. If the error persists, replace the hard disk drive (HDD).



NOTE: The M631dn and M634dn printer models are shipped with the eMMC installed by default, all other printer models have a HDD.



WARNING! Do not replace the printer formatter, it will not resolve this issue.



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-140 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: See the Repair Service Manual for this product..

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the error persists, turn off the printer, and then remove and reinstall the Hard disk drive (HDD).

For instructions, watch the following video: [How to replace the Hard disk drive](#).

3. Check if the printer boots to an error state, and then see the following information before performing a **Format Disk**.



NOTE: After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed). Any installed workflow solutions be present will be deleted after a Format Disk, and will require reloading and setup by the customer.

4. Use the Preboot menu to perform a Format Disk.
 - a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
 - c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
 - d. Press the **OK** button again.
 - e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".
5. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.
6. Update the printer firmware using the Preboot menu.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

7. If the error persists, replace the Hard disk drive.

 **NOTE:** The M631dn and M634dn printer models are shipped with the eMMC installed by default, all other printer models have a HDD.

 **WARNING!** Do not replace the printer formatter, it will not resolve this issue.

 **NOTE:** Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-141 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: See the Repair Service Manual for this product..

8. If the issue persists, elevate the issue using your country/region support process.

82 . 73 . 45 Disk Successfully cleaned

Event log only, disk successfully cleaned.

Recommended action

See recommended action.

- No action necessary.

82 . 73 . 46, 82 . 73 . 47

A hard disk or compact flash disk cleaning failed.

This error is usually caused by a failure of the disk hardware.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the product off, and then on.
2. Reload the printer firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Use the [Format Disk](#) item in the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

3. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

90.WX.YZ error messages

90.* errors

Errors in the 90.* family are related to the control panel.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, dispatch an onsite technician.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off by holding down the power button for at least 10 seconds.
2. Check the connectors on the control panel. Reseat them if necessary.
3. Turn the printer on. If the status LED on the formatter is yellow instead of green, the control panel might be defective. Replace the control panel.

90.0F.06

Pre-boot error after hardware replacement.

This message is a normal part of booting up and establishing communication with the control panel.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Check if service was performed on the printer prior to the reported event.
3. If a hardware component was changed and caused this issue, remove the component and replace it with the original part being replaced.

Reinstalling the original part might resolve the issue.

4. If the error persists, replace the DC Controller PCA.



NOTE: Make sure to order the correct part number for the printer.

Table 6-142 DC controller PCA part numbers

Description /Printer models	Part numbers
DC controller PC board assembly	RM2-9493-000CN
For printers models: M631/M632/M633/E62555/E62565/E62575	
DC controller	RM3-8458-000CN
For printer models: M634/M635/M636/ M637	
DC controller PCA	RM3-7621-000CN
For printer models: E62655/E62665/E62675	

For instructions: See the Repair Service Manual for this product.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Check if service was performed on the printer prior to the reported event.
3. If a hardware component was changed and caused this issue, remove the component and replace it with the original part being replaced.

Reinstalling the original part might resolve the issue.

4. If the issue persists, disconnect and reconnect all the cables on the DC controller.
5. If the issue persists, replace the DC Controller PCA.



NOTE: Make sure to order the correct part number for the printer.

Table 6-143 DC controller PCA part numbers

Description /Printer models	Part numbers
DC controller PC board assembly	RM2-9493-000CN
For printers models: M631/M632/M633/E62555/E62565/E62575	
DC controller	RM3-8458-000CN
For printer models: M634/M635/M636/ M637	

Table 6-143 DC controller PCA part numbers (continued)

Description /Printer models	Part numbers
DC controller PCA	RM3-7621-000CN
For printer models: E62655/E62665/E62675	

For instructions: See the Repair Service Manual for this product.

90.15.00

The video interface has been detected.

Communication with the control panel has been detected.

This message is a normal part of booting up and establishing communication with the control panel.

Recommended action

- No action necessary.

90.15.01

The video interface has **NOT** been detected.

Communication with the control panel has not been established in the expected time frame. The control panel likely will not display correctly.

Recommended action

1. Turn the printer off, and then on.
2. Turn the printer off by holding down the power button for at least 10 seconds.
3. Ensure that the control panel connectors on control panel are correctly seated.
4. Turn the printer on. If formatter status LED is yellow, the control panel may be defective.
5. Replace the control panel.

98.0X.0Y error messages

98.00.0c

Data corruption has occurred and fails to mount partition.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, update the printer firmware to the latest version.
 - a. Go to [Software and Driver Downloads](https://support.hp.com/us-en/drivers) (<https://support.hp.com/us-en/drivers>), and then click the *Printer* icon.
 - b. Enter your printer model, and then click **Submit**.
 - c. Expand the **Firmware** section, and then click **Download** to download the latest firmware version.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. Check if the **98.00.0c** event is intermittent or persistent and perform the appropriate task.
 - For **intermittent 98.00.0c** event error, do the following:
 - a. Print or view the printer Event log.
 - b. Check if a 49.38.0C or 49.38.0D error is present in the Event log.
 - c. If 49.38.0C and/or 49.38.0D errors are present, refer the following support document in WISE: ish_8742720-8736298-16
 - d. If 49.38.0C or 49.38.0D errors are NOT present, download the printer firmware using a USB flash drive.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

- For **persistent 98.00.0c** event error, do the following:
 - Download the printer firmware using a USB flash drive.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. Check if the printer boots to an error state, and then see the following information about performing a **Format Disk**.



NOTE: After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

4. Use the Preboot menu to perform a Format Disk.

a. Depending on the printer control panel, follow the appropriate step:

- **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
- **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.

b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.

c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.

d. Press the **OK** button again.

e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".

5. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.

6. Update the printer firmware from the Preboot menu using a USB flash drive.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

7. If the error persists, replace the Hard disk drive.



WARNING! Do not replace the printer formatter, it will not resolve this issue.



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-144 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. Check if the **98.00.0c** event is intermittent or persistent and perform the appropriate task.
 - For **intermittent 98.00.0c** event error, do the following:
 - a. Print or view the printer Event log.
 - b. Check if a 49.38.0C or 49.38.0D errors are present
 - c. If 49.38.0C and/or 49.38.0D errors are present, refer the following support document in WISE: ish_8742720-8736298-16
 - d. If 49.38.0C or 49.38.0D errors are NOT present, download the printer firmware using a USB flash drive.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

- For **persistent 98.00.0c** event error, do the following:
 - Download the printer firmware using a USB flash drive.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. Check if the printer boots to an error state, and then see the following information before performing a **Format Disk**.



NOTE: After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

4. Use the Preboot menu to perform a Format Disk.
 - a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
 - c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
 - d. Press the **OK** button again.

- e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".
5. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.

6. Update the printer firmware from the Preboot menu using a USB flash drive.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

7. If the error persists, replace the Hard disk drive.



WARNING! Do not replace the printer formatter, it will not resolve this issue.



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-145 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: See the Repair Service Manual for this product..

8. If the issue persists, elevate the issue using your country/region support process.

98.00.01 or 98.01.00 Corrupt data in firmware volume

Data corruption has occurred in the firmware volume.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Use the [Format Disk](#) item in the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

3. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

98.00.02 Corrupt data in the solutions volume

Data corruption has occurred in the solutions volume.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. Check if the **98.00.0c** event is intermittent or persistent, and then perform the appropriate task.
 - For **intermittent 98.00.0c** event error, do the following:
 - a. Print or view the printer Event log.
 - b. Check if a 49.38.0C or 49.38.0D error is present in the Event log.
 - c. If 49.38.0C and/or 49.38.0D errors are present, refer the following support document in WISE: ish_8742720-8736298-16
 - d. If 49.38.0C or 49.38.0D errors are NOT present, download the printer firmware using a USB flash drive.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

- For **persistent 98.00.0c** event error, do the following:
 - Download and update the printer firmware using a USB flash drive.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. Check if the printer boots to an error state, and then review the following information about performing a **Format Disk**.

 **NOTE:** After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

4. Use the Preboot menu to perform a Format Disk.

- a. Depending on the printer control panel, follow the appropriate step:

- **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
- **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.

- b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.

If a password is assigned to the administrator, a prompt displays to enter the password.

- c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.

- d. Press the **OK** button again.

- e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".

5. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.

6. Update the printer firmware from the Preboot menu using a USB flash drive.

 **NOTE:** The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

7. If the error persists, replace the Hard disk drive.

 **WARNING!** Do not replace the printer formatter to resolve this issue.

 **NOTE:** Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-146 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011

Table 6-146 Hard disk drive (HDD) part number (continued)

Description	Part number
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. Check if the **98.00.0c** event is intermittent or persistent and perform the appropriate task.
 - For **intermittent 98.00.0c** event error, do the following:
 - a. Print or view the printer Event log.
 - b. Check if a 49.38.0C or 49.38.0D error is present in the Event log.
 - c. If 49.38.0C and/or 49.38.0D errors are present, refer the following support document in WISE: ish_8742720-8736298-16
 - d. If 49.38.0C or 49.38.0D errors are NOT present, download the printer firmware using a USB flash drive.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).
 - For **persistent 98.00.0c** event error, do the following:
 - Download the printer firmware using a USB flash drive.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).
3. Check if the printer boots to an error state, and then see the following information about performing a **Format Disk**.



NOTE: After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

4. Use the Preboot menu to perform a Format Disk.
 - a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.

- **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
If a password is assigned to the administrator, a prompt displays to enter the password.
 - c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
 - d. Press the **OK** button again.
 - e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".
5. Use the power button to turn off, and then to turn on the printer.
The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.
6. Update the printer firmware from the Preboot menu using a USB flash drive.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

7. If the error persists, replace the Hard disk drive.



WARNING! Do Not replace the printer formatter to resolve this issue.



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-147 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: See the Repair Service Manual for this product.

8. If the issue persists, elevate the issue using your country/region support process.

98 . 00 . 03 Corrupt data in the configuration volume

Data corruption has occurred in the configuration volume.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.

2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Download the firmware again, and then attempt the upgrade again.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Use the [Format Disk](#) item in the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

4. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

98 . 00 . 04 Corrupt data in the job data volume

Data corruption has occurred in the job data volume.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Make sure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Rerun the file erase function.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

98.03.11

Partition manager error

Machine Data partition lost all data.

Recommended action

1. Turn the printer off, and then on.
2. Ensure the firmware is the latest version.
3. Reinstall the firmware.

99.WX.YZ error messages

99.* errors

Errors in the 99.* family are related to the firmware upgrade process.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Make sure the connection to the network is good, and then try the firmware upgrade again.
2. If the error persists, try using the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Make sure the connection to the network is good, and then try the upgrade again.
2. Try using the USB upgrade method.
3. If the error persists, run the [Format Disk](#) process from the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

4. If the issue persists, replace the hard disk drive (HDD).



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-148 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41616-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

99.00.01 Upgrade not performed file is corrupt

A remote firmware upgrade (RFU) was not performed.

This is a CRC error in the firmware image (bad image).

Recommended action

Follow these troubleshooting steps in the order presented.

- Download the firmware upgrade file, and then attempt the upgrade again.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99 . 00 . 02 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading the header number and size. It indicates a problem with the network environment, not the product.

Recommended action

Follow these troubleshooting steps in the order presented.

The most common cause is an issue with the network environment.

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



NOTE: If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99 . 00 . 03 Upgrade not performed error writing to disk

A remote firmware upgrade (RFU) was not performed.

This is a disk error. It might indicate a problem or a hard disk drive failure. It might be necessary to check the connection to the hard disk drive or replace the hard disk drive.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, update the printer firmware to the latest version.
 - a. Go to [Software and Driver Downloads](https://support.hp.com/us-en/drivers) (<https://support.hp.com/us-en/drivers>), and then click the *Printer* icon.
 - b. Enter your printer model, and then click **Submit**.
 - c. Expand the **Firmware** section, and then click **Download** to download the latest firmware version.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, download and update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the issue persists, use the Preboot menu to perform a Format Disk.



IMPORTANT: **Format Disk** removes all data. After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed to return the printer to a bootable state.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

- a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
If a password is assigned to the administrator, a prompt displays to enter the password.
- c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
- d. Press the **OK** button again.
- e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".
- f. Use the power button to turn off, and then to turn on the printer.
The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.
- g. Update the printer firmware from the Preboot menu.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, replace the Hard disk drive.

 **WARNING!** Do not replace the printer formatter to resolve this issue.

 **NOTE:** Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-149 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: See the Repair Service Manual for this product..

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, download and update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the issue persists, use the Preboot menu to perform a Format Disk.

 **IMPORTANT:** **Format Disk** removes all data. After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed to return the printer to a bootable state.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

- a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
If a password is assigned to the administrator, a prompt displays to enter the password.
- c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
- d. Press the **OK** button again.

- e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".
- f. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.

- g. Update the printer firmware from the Preboot menu.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, use the Preboot menu to perform a hard disk drive diagnostic test.
 - a. Access the Preboot menu and then select **Administrator**.
 - i. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - ii. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
 - b. Select **Diagnostics**.
 - c. Except for option **6 Disk**, select each diagnostic option, and then select **Do not Run** item to exclude the Disk diagnostic when executing multiple diagnostics.
 - d. Select option **6 Disk**, and then select **d Smart** drive to help anticipate disk failures (SMART status).
 - e. Select **OK**.
 - f. Scroll down and select the **Run Selected** item to start the test.
5. If any errors are encountered or if the error persists, replace the hard disk drive.



WARNING! Do not replace the printer formatter to resolve this issue.



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-150 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: See the Repair Service Manual for this product..

6. If the issue persists, elevate the issue using your country/region support process.

99 . 00 . 04 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading the header.

The most common cause is an issue with the network environment.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



NOTE: If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)

99 . 00 . 05 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading image data.

The most common cause is an issue with the network environment.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



NOTE: If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)

99 . 00 . 06 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

This is an unexpected read error when reading the header number and size.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, update the printer firmware to the latest version.
 - a. Go to [Software and Driver Downloads](https://support.hp.com/us-en/drivers) (<https://support.hp.com/us-en/drivers>), and then click the *Printer* icon.
 - b. Enter your printer model, and then click **Submit**.
 - c. Expand the **Firmware** section, and then click **Download** to download the latest firmware version.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, download and update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the issue persists, use the Preboot menu to perform a Format Disk.



IMPORTANT: **Format Disk** removes all data. After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed to return the printer to a bootable state.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

- a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.

If a password is assigned to the administrator, a prompt displays to enter the password.
- c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
- d. Press the **OK** button again.
- e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".

- f. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.

- g. Update the printer firmware from the Preboot menu.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, replace the Hard disk drive.



WARNING! Do not replace the printer formatter to resolve this issue.



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-151 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: See the Repair Service Manual for this product..

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, download and update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the issue persists, use the Preboot menu to perform a Format Disk.



IMPORTANT: **Format Disk** removes all data. After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed to return the printer to a bootable state.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

- a. Depending on the printer control panel, follow the appropriate step:

- **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.

- **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
If a password is assigned to the administrator, a prompt displays to enter the password.
- c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
- d. Press the **OK** button again.
- e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".
- f. Use the power button to turn off, and then to turn on the printer.
The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.
- g. Update the printer firmware from the Preboot menu.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, use the Preboot menu to perform a hard disk drive diagnostic test.
 - a. Access the Preboot menu and then select **Administrator**.
 - i. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - ii. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
 - b. Select **Diagnostics**.
 - c. Except for option **6 Disk**, select each diagnostic option, and then select **Do not Run** item to exclude the Disk diagnostic when executing multiple diagnostics.
 - d. Select option **6 Disk**, and then select **d Smart** drive to help anticipate disk failures (SMART status).
 - e. Select **OK**.
 - f. Scroll down and select the **Run Selected** item to start the test.
5. If any errors are encountered or if the error persists, replace the hard disk drive.



WARNING! Do not replace the printer formatter to resolve this issue.



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-152 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: See the Repair Service Manual for this product..

6. If the issue persists, elevate the issue using your country/region support process.

99 . 00 . 07 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

This is an unexpected read error when reading the rest of the header.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, update the printer firmware to the latest version.
 - a. Go to [Software and Driver Downloads](https://support.hp.com/us-en/drivers) (<https://support.hp.com/us-en/drivers>), and then click the *Printer* icon.
 - b. Enter your printer model, and then click **Submit**.
 - c. Expand the **Firmware** section, and then click **Download** to download the latest firmware version.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, download and update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the issue persists, use the Preboot menu to perform a Format Disk.

 **IMPORTANT:** **Format Disk** removes all data. After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed to return the printer to a bootable state.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

- a. Depending on the printer control panel, follow the appropriate step:
- **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
- If a password is assigned to the administrator, a prompt displays to enter the password.
- c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
- d. Press the **OK** button again.
- e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".
- f. Use the power button to turn off, and then to turn on the printer.
- The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.
- g. Update the printer firmware from the Preboot menu.

 **NOTE:** The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, replace the Hard disk drive.

 **WARNING!** Do not replace the printer formatter to resolve this issue.

 **NOTE:** Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-153 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: See the Repair Service Manual for this product..

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, download and update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the issue persists, use the Preboot menu to perform a Format Disk.



IMPORTANT: **Format Disk** removes all data. After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed to return the printer to a bootable state.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

- a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.

If a password is assigned to the administrator, a prompt displays to enter the password.
- c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
- d. Press the **OK** button again.
- e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".
- f. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.
- g. Update the printer firmware from the Preboot menu.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, use the Preboot menu to perform a hard disk drive diagnostic test.
 - a. Access the Preboot menu and then select **Administrator**.
 - i. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.

- **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - ii. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
 - b. Select **Diagnostics**.
 - c. Except for option **6 Disk**, select each diagnostic option, and then select **Do not Run** item to exclude the Disk diagnostic when executing multiple diagnostics.
 - d. Select option **6 Disk**, and then select **d Smart** drive to help anticipate disk failures (SMART status).
 - e. Select **OK**.
 - f. Scroll down and select the **Run Selected** item to start the test.
5. If any errors are encountered or if the error persists, replace the hard disk drive.

 **WARNING!** Do not replace the printer formatter to resolve this issue.

 **NOTE:** Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-154 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: See the Repair Service Manual for this product..

6. If the issue persists, elevate the issue using your country/region support process.

99 . 00 . 08 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

This is an unexpected read error when reading image data.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, update the printer firmware to the latest version.
 - a. Go to [Software and Driver Downloads](https://support.hp.com/us-en/drivers) (<https://support.hp.com/us-en/drivers>), and then click the *Printer* icon.
 - b. Enter your printer model, and then click **Submit**.

- c. Expand the **Firmware** section, and then click **Download** to download the latest firmware version.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, download and update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the issue persists, use the Preboot menu to perform a Format Disk.



IMPORTANT: **Format Disk** removes all data. After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed to return the printer to a bootable state.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

- a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.

If a password is assigned to the administrator, a prompt displays to enter the password.
- c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
- d. Press the **OK** button again.
- e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".
- f. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.
- g. Update the printer firmware from the Preboot menu.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, replace the Hard disk drive.

 **WARNING!** Do not replace the printer formatter to resolve this issue.

 **NOTE:** Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-155 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: See the Repair Service Manual for this product..

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, download and update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the issue persists, use the Preboot menu to perform a Format Disk.

 **IMPORTANT:** **Format Disk** removes all data. After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed to return the printer to a bootable state.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

- a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.

If a password is assigned to the administrator, a prompt displays to enter the password.
- c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
- d. Press the **OK** button again.

- e. Select **Accept** to confirm the onscreen message, “Will require new firmware install”.
- f. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.

- g. Update the printer firmware from the Preboot menu.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, use the Preboot menu to perform a hard disk drive diagnostic test.
 - a. Access the Preboot menu and then select **Administrator**.
 - i. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - ii. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
 - b. Select **Diagnostics**.
 - c. Except for option **6 Disk**, select each diagnostic option, and then select **Do not Run** item to exclude the Disk diagnostic when executing multiple diagnostics.
 - d. Select option **6 Disk**, and then select **d Smart** drive to help anticipate disk failures (SMART status).
 - e. Select **OK**.
 - f. Scroll down and select the **Run Selected** item to start the test.
5. If any errors are encountered or if the error persists, replace the hard disk drive.



WARNING! Do not replace the printer formatter to resolve this issue.



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-156 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: See the Repair Service Manual for this product..

6. If the issue persists, elevate the issue using your country/region support process.

99 . 00 . 09 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled.

Recommended action

Follow these troubleshooting steps in the order presented.

- Resend the remote firmware upgrade (RFU).

99 . 00 . 10 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled when reading the header number and size.

Recommended action

Follow these troubleshooting steps in the order presented.

- Resend the remote firmware upgrade (RFU).

99 . 00 . 11 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled when reading the rest of the header, after reading the header number and size.

Recommended action

Follow these troubleshooting steps in the order presented.

- Resend the remote firmware upgrade (RFU).

99 . 00 . 12 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The header number is 1, but the header size does not match version 1 size.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the remote firmware upgrade (RFU) file again.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Resend the RFU.

99 . 00 . 13 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The header number is 2, but the header size does not match version 2 size.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the remote firmware upgrade (RFU) file again.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Resend the RFU.

99 . 00 . 14 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The file is invalid.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the remote firmware upgrade (RFU) file again.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Resend the RFU.

99 . 00 . 2x

There is a compatibility issue with the firmware.

The specific message varies depending on the cause, but the solution for each message is the same.

- 99 . 00 . 20 (event log)

The bundle is not for this product.

- 99 . 00 . 21 (event log)

The bundle is not signed with the correct signature, or the signature is invalid.

- 99 . 00 . 22 (event log)

The bundle header version is not supported by this firmware.

- 99 . 00 . 23 (event log)

The package header version is not supported by this firmware.

- 99 . 00 . 24 (event log)

The format of the bundle is invalid.

- 99.00.25 (event log)
The format of the package is invalid.
- 99.00.26 (event log)
A CRC32 check did not pass.
- 99.00.27 (event log)
An I/O error occurred while downloading the bundle.

Recommended action

Follow these troubleshooting steps in the order presented.

1. **99.00.27 only:** Turn the product off, and then on.
2. Download the correct firmware file, and then resend the firmware upgrade.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#) For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).
3. If the error persists, try installing the upgrade by another method (USB or Embedded Web Server).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99.01.xx

A firmware install error has occurred.

The specific message varies depending on the cause, but the solution for each message is the same.

- 99.01.00
- 99.01.10
- 99.01.20
- 99.01.21

Recommended action

Follow these troubleshooting steps in the order presented.

- Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
Firmware update steps,

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99.02.01

Firmware installation was successful.

Recommended action

See recommended action.

- No action necessary.

99.02.09

Firmware upgrade cancelled by user.

Recommended action

See recommended action.

- No action necessary.

99.07.yz Firmware install error

Fax modem error.

- **99.07.00** Unexpected fax modem FW installer error. Firmware installation failed. The finisher installer encountered an error during installation.
- **99.07.10** An error occurred accessing the repository during the fax modem FW install. Firmware installation failed. The fax modem installer encountered an error in the repository.
- **99.07.20** The fax modem FW installer could not connect to the fax modem. Firmware installation failed. The fax modem installer encountered an error while detecting or initializing modem.
- **99.07.21** The fax modem could not be reset. Firmware installation failed. The fax modem installer failed to download flash to the modem.
- **99.07.23** Fax modem reset failed.

Recommended action

1. Turn the printer off.
2. Verify the fax card is correctly installed on the formatter. Ensure the fax card is aligned with slot on the formatter chassis and is firmly seated against the formatter board. Turn the printer on.
3. If the error persists, download and reinstall the firmware.
4. If the error persists, perform a Partial Clean:
 - a. Turn the printer off, and then on.
 - b. Touch the **HP logo** that displays in the middle of the screen when you see the "1/8" under the logo. The Preboot menu will open.
 - c. Touch the down arrow button to highlight **Administrator**, and then touch the OK button.
 - d. Use the down arrow button to highlight **Partial Clean**, and then touch the OK button.
 - e. Touch the **OK** button again.
 - f. Touch the Back button to highlight Continue, and then touch the **OK** button.
 - g. The printer will continue to boot to **Ready**.
5. If the error persists, replace the fax kit.

New part number: CC487A

For instructions: See the Repair Service Manual for this product.

Service part number: CC522-67929

For instructions: See the Repair Service Manual for this product.

99 . 07 . 22 Firmware install error

This error indicates that the firmware installation failed. It displays on the printer control panel when the fax modem installer fails to download the installed firmware to the modem.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Make sure that the network connection is stable and good, and then attempt to update the firmware again.
2. If the error persists, try to update the firmware at the control panel using a USB flash drive.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Use the following general troubleshooting steps to try to resolve the problem.

1. Make sure that the network connection is stable and good, and then attempt to update the firmware again.
2. If the error persists, try to update the firmware at the control panel using a USB flash drive.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. Use the [Format Disk](#) item in the Preboot menu.

 **CAUTION:** Selecting Format Disk removes all data. The system is not bootable after this action and 99.09.67 displays on the control panel. A firmware download must be performed to return the system to a bootable state. Should any installed workflow solutions be present they will be deleted and require reloading and setup by the customer.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

4. If the issue persists, identify which storage solution is utilized, a hard disk drive (HDD) or embedded multi-media card (eMMC).
 - a. Print or view the device configuration page.
 - b. Reference section **Installed Personalities and Options**.
 - c. Reference **Internal Disk: Hard Disk: Enabled**
 - d. Reference **Hard Disk Encryption Status**, "Disk cannot be encrypted" denotes an eMMC storage device.

5. Depending on the storage solution installed, replace either the hard disk drive (HDD) or embedded multi-media card (eMMC).



IMPORTANT: WARNING: Do not replace the printer formatter, it will not resolve this issue.



NOTE: Device is unusable until a new boot device is installed.



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-157 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above
Module 16GB embedded Multimedia Card (eMMC) kit	5851-6587

Recommended action for onsite technicians

Use the following general troubleshooting steps to try to resolve the problem.

1. Make sure that the network connection is stable and good, and then attempt to update the firmware again.
2. If the error persists, try to update the firmware at the control panel using a USB flash drive.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)

3. Use the [Format Disk](#) item in the Preboot menu.



CAUTION: Selecting Format Disk removes all data. The system is not bootable after this action and 99.09.67 displays on the control panel. A firmware download must be performed to return the system to a bootable state. Should any installed workflow solutions be present they will be deleted and require reloading and setup by the customer.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

4. If the issue persists, identify which storage solution is utilized, a hard disk drive (HDD) or embedded multi-media card (eMMC).
 - a. Print or view the device configuration page.
 - b. Reference section **Installed Personalities and Options.**
 - c. Reference **Internal Disk: Hard Disk: Enabled**
 - d. Reference **Hard Disk Encryption Status**, "Disk cannot be encrypted" denotes an eMMC storage device.

5. Depending on the storage solution installed, replace either the hard disk drive (HDD) or embedded multi-media card (eMMC).

 **IMPORTANT: WARNING:** Do not replace the printer formatter, it will not resolve this issue.

 **NOTE:** Device is unusable until a new boot device is installed.

 **NOTE:** Most customers have the self-encrypting drive (SED), and should not have a Federal Information Processing Standards (FIPS) drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-158 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above
Module 16GB embedded Multimedia Card (eMMC) kit	5851-6587

6. If the issue persists, elevate using your region's support process.

99 . 09 . 60 Unsupported disk

This is a [Preboot](#) menu error.

The hard disk currently installed is not recognized or supported by the printer.

Recommended action

- Install the correct hard disk for this printer.

Do NOT replace the formatter board, it will not resolve this.

99 . 09 . 61 Unsupported disk

The hard disk drive installed is not support in this printer.

The hard disk drive (HDD) is not encrypted and the printer is configured for an encrypted HDD.

Recommended action

Follow these troubleshooting steps in the order presented.

 **NOTE:** Do NOT replace the formatter board, it will not resolve this error.

- Access the [Preboot](#) menu, and then select [Lock Disk](#) to lock the disk.
 - a. Access the [Preboot](#) menu
 - b. Turn the product on.
 - c. Touch the HP logo that displays in the center of the touchscreen until the [Preboot](#) menu item opens.

- d. Use the arrow buttons on the touchscreen to navigate the [Preboot](#) menu.
- e. Touch the [OK](#) button to select a menu item.

99 . 09 . 62 Unknown disk

This error indicates that there is an encryption mismatch between the HDD and the formatter.

This typically happens because an HDD was swapped into a device from another device.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.



NOTE: Do NOT replace the formatter board, it will not resolve this error.

1. Use the [Preboot](#) menu to unlock the disk.
 - a. Access the [Preboot](#) menu
 - b. Turn the product on.
 - c. Touch the HP logo that displays in the center of the touchscreen until the [Preboot](#) menu item opens.
 - d. Use the arrow buttons on the touchscreen to navigate the [Preboot](#) menu.
 - e. Touch the [OK](#) button to select a menu item.
2. If a disk is to be reused in a different product, execute the [Erase and Unlock](#) procedure from the [Preboot](#) menu, and then reload the firmware.
 - From the [Preboot](#) menu, open the following menus:
 - [Administration](#) (select 3)
 - [Manage Disks](#) (select 6)
 - [Boot Device](#) (select 6)
 - [Erase / Unlock](#) (select 2)
3. If the issue persists, replace the HDD/SSD as needed.



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-159 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41616-011
Solid state drive (SSD)	0950-5111
Federal Information Processing Standards Drive, FIPS	6HN31-67001
See NOTE above.	See NOTE above.

99 . 09 . 63 Incorrect disk

Expected encrypted hard disk drive is not present.

This is expected behavior when installing a new hard disk drive in a device where the previous hard disk drive was encrypted.

Recommended action

- Follow the procedure to load firmware on a new hard disk drive, and then lock the disk to this printer.

Do NOT replace the formatter board, it will not resolve this.

For instructions on accessing the Preboot menu, see this document: [HP LaserJet Enterprise M604, M605, M606 and HP Color LaserJet Enterprise M552, M553 - Pre-boot menu options](#).

99 . 09 . 64 Disk Nonfunctional

A fatal hard disk drive failure has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. Check if the error persists.
3. If the error persists, turn off the printer, and then disconnect the power cable.
4. Remove the Hard disk drive (HDD), and then reinstall the HDD.



NOTE: Do not replace the Hard disk drive.

For instructions on how to remove and reinstall the hard drive, watch the following video: [How to replace the Hard disk drive](#).

5. If the error persists, the hard disk drive needs to be replaced. Contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.

2. If the error persists, turn off the printer, and then remove and reinstall the Hard disk drive (HDD).

For instructions, watch the following video: [How to replace the Hard disk drive](#).

3. If the issue persists, make sure to review the following information about performing a **Format Disk**.

 **WARNING!** Selecting Format Disk removes **all** data.

 **IMPORTANT:** After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

4. Use the Preboot menu to perform a Format Disk.

- a. Depending on the printer control panel, follow the appropriate step:

- **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
- **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.

- b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.

- c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.

- d. Press the **OK** button again.

- e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".

5. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.

6. Update the printer firmware using the Preboot menu when a **99.09.67** error displays on the printer control panel.

 **NOTE:** The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

7. If the error persists, replace the Hard disk drive.

 **NOTE:** The M631dn and M634dn printer models are shipped with the eMMC installed by default. All other printer models have a HDD.

 **WARNING!** Do not replace the printer formatter, it will not resolve this issue.

 **NOTE:** Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-160 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: See the Repair Service Manual for this product..

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the error persists, turn off the printer, and then remove and reinstall the Hard disk drive (HDD).

For instructions, watch the following video: [How to replace the Hard disk drive](#).

3. If the issue persists, make sure to review the following information about performing a **Format Disk**.

 **WARNING!** Selecting Format Disk removes **all** data.

 **IMPORTANT:** After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

4. Use the Preboot menu to perform a Format Disk.
 - a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.

If a password is assigned to the administrator, a prompt displays to enter the password.
 - c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
 - d. Press the **OK** button again.
 - e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".
 - f. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.

- g. Update the printer firmware using the Preboot menu when a **99.09.67** error displays on the printer control panel.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

5. If the error persists, use the Preboot menu to perform a hard disk drive diagnostic test.
- a. Access the Preboot menu and then select **Administrator**.
- i. Depending on the printer control panel, follow the appropriate step:
- **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- ii. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
- b. Select **Diagnostics**.
- c. Except for option **6 Disk**, select each diagnostic option, and then select **Do not Run** item to exclude the Disk diagnostic when executing multiple diagnostics.
- d. Select option **6 Disk**, and then select **d Smart** drive to help anticipate disk failures (SMART status).
- e. Select **OK**.
- f. Scroll down and select the **Run Selected** item to start the test.
6. If any errors are encountered or if the error persists, replace the hard disk drive.



WARNING! Do not replace the printer formatter to resolve this issue.



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-161 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: See the Repair Service Manual for this product..

99 . 09 . 65 Disk data error

Disk data corruption has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.



NOTE: Do NOT replace the formatter board, it will not resolve this error.

- Use the [Format Disk](#) procedure from the [Preboot](#) menu, and then resend the remote firmware upgrade (RFU).

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

99 . 09 . 66 No boot device.

A hard disk drive or eMMC is not installed in the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. Check if the error persists.
3. If the error persists, turn off the printer, and then disconnect the power cable.
4. Remove the Hard disk drive (HDD), and then reinstall the HDD.



NOTE: Do not replace the Hard disk drive.

For instructions on how to remove and reinstall the hard drive, watch the following video: [How to replace the Hard disk drive](#).

5. If the error persists, the hard disk drive needs to be replaced. Contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Print a Configuration page and under the **Installed Personalities and Options** section, determine the customer's intended boot device is a Hard disk drive or Embedded multi-media card (eMMC).

M634dn printer model is the only model shipped with the eMMC installed.

2. If the error persists, turn off the printer, and then remove and reinstall the Hard disk drive (HDD).


Do not replace the hard drive.

For instructions, watch the following video: [How to replace the Hard disk drive](#).

3. Disconnect and reconnect the eMMC component located on the formatter.
 - a. Use the power button to turn off the printer, wait 30 seconds, and then disconnect the power cable.
 - b. Remove the formatter cover
 - i. On the formatter cover, release two thumb screws (callout 1).

- ii. Slide the formatter cover in the direction indicated by the arrow (callout 2) and remove it


Figure 6-231 Release two thumb screws and remove the formatter cover

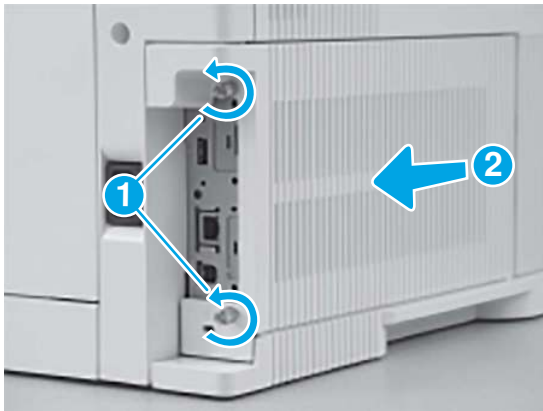


- c. Locate the eMMC component on the formatter, and then pull it straight off of the formatter to remove it.

CAUTION: Electrostatic sensitive (ESD) parts. Always touch the sheet-metal chassis to provide a static ground before touching an ESD-sensitive part.

Figure 6-232 Remove the eMMC component off of the formatter

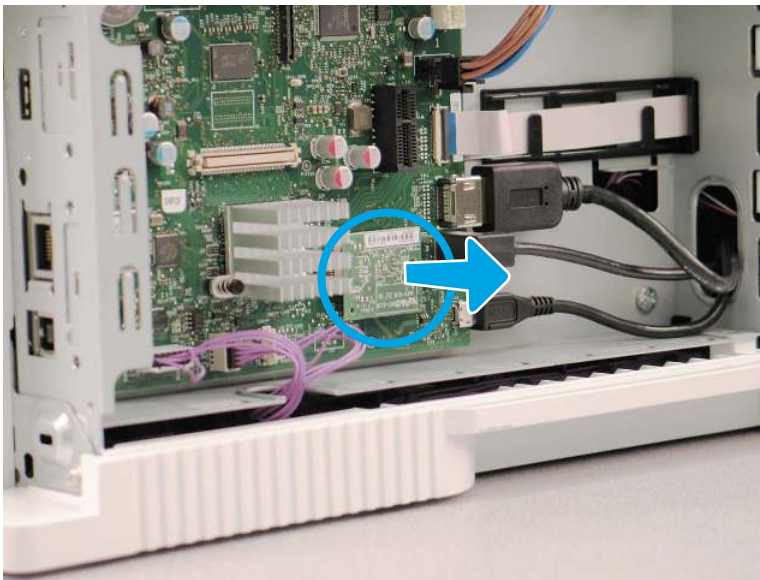


- d. Install the embedded multi-media card (eMMC).
 - i. Align the connector on the replacement eMMC (callout 1) with the connector on the formatter (callout 2)

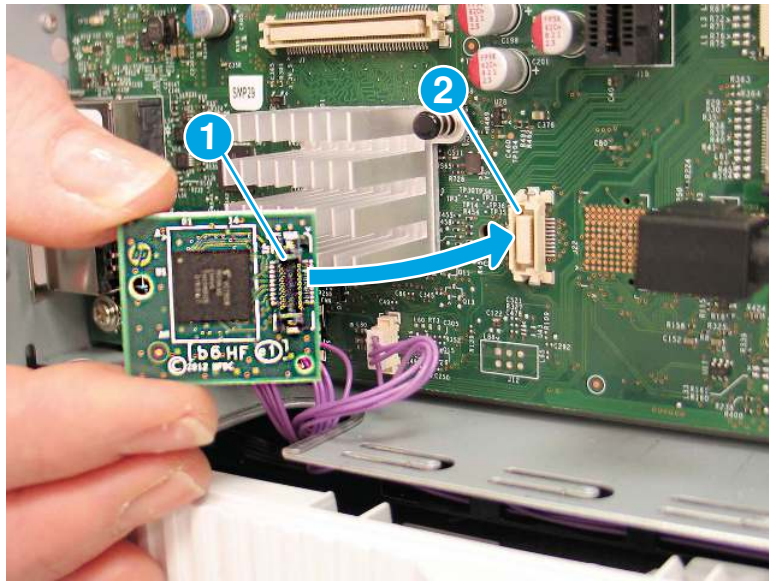

- ii. Push the eMMC on to the formatter to install it.


 **IMPORTANT:** Press on the top part of the eMMC to ensure it is fully seated in the connector.

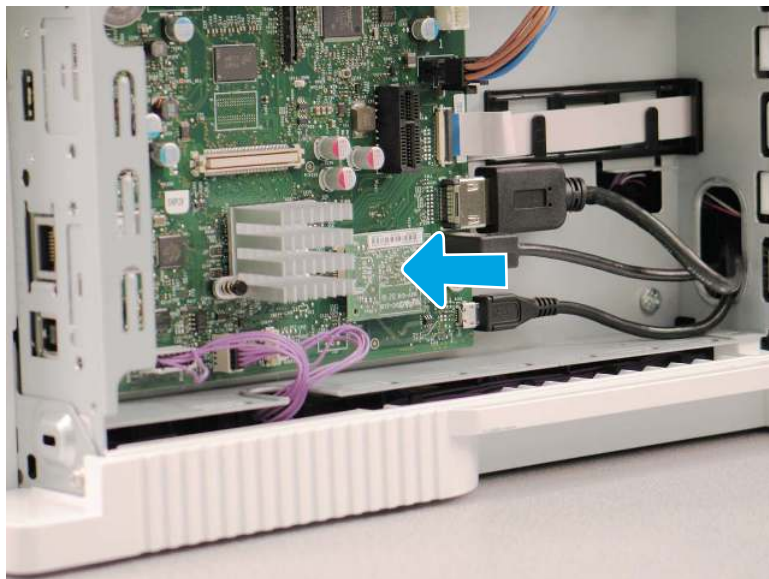

- e. Install the formatter cover.

Slide the formatter cover on to the printer in the direction indicated by the arrow (callout 1), and then tighten the two thumb screws (callout 2).

Figure 6-233 Slide on the formatter cover and tighten two thumb screws

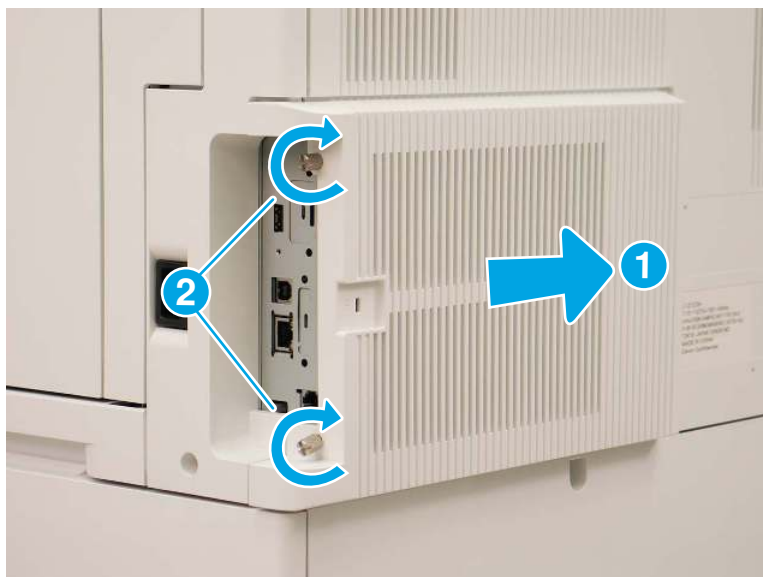

- f. Connect the power cable, and then use the power button to turn on the printer.
4. If the error persists, replace the hard disk drive or eMMC.

 **NOTE:** Device is unusable until a new boot device is installed.

 **WARNING!** Do not replace the printer formatter, it will not resolve this issue.

 **NOTE:** Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-162 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.
Module 16B embedded MultiMedia Card (eMMC) kit	5851-6436

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians


Follow these troubleshooting steps in the order presented.

1. Print a Configuration page and under the **Installed Personalities and Options** section, determine the customer's intended boot device is a Hard disk drive or Embedded multi-media card (eMMC).

M634dn printer model is the only model shipped with the eMMC installed.

2. If the error persists, turn off the printer, and then remove and reinstall the Hard disk drive (HDD).
Do not replace the hard drive.
For instructions, watch the following video: [How to replace the Hard disk drive](#).
3. Disconnect and reconnect the eMMC component located on the formatter.
 - a. Use the power button to turn off the printer, wait 30 seconds, and then disconnect the power cable.
 - b. Remove the formatter cover
 - i. On the formatter cover, release two thumb screws (callout 1).
 - ii. Slide the formatter cover in the direction indicated by the arrow (callout 2) and remove it


Figure 6-234 Release two thumb screws and remove the formatter cover

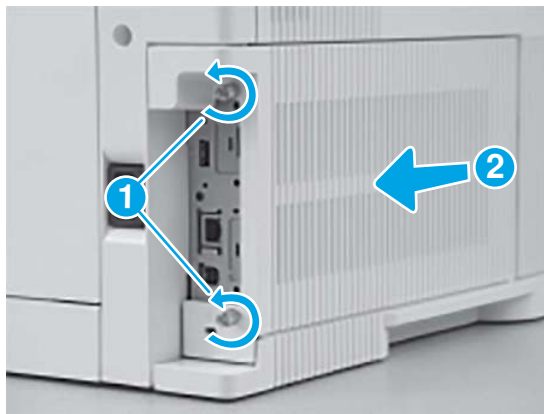


- c. Locate the eMMC component on the formatter, and then pull it straight off of the formatter to remove it.

⚠ CAUTION: Electrostatic sensitive (ESD) parts. Always touch the sheet-metal chassis to provide a static ground before touching an ESD-sensitive part.

Figure 6-235 Remove the eMMC component off of the formatter

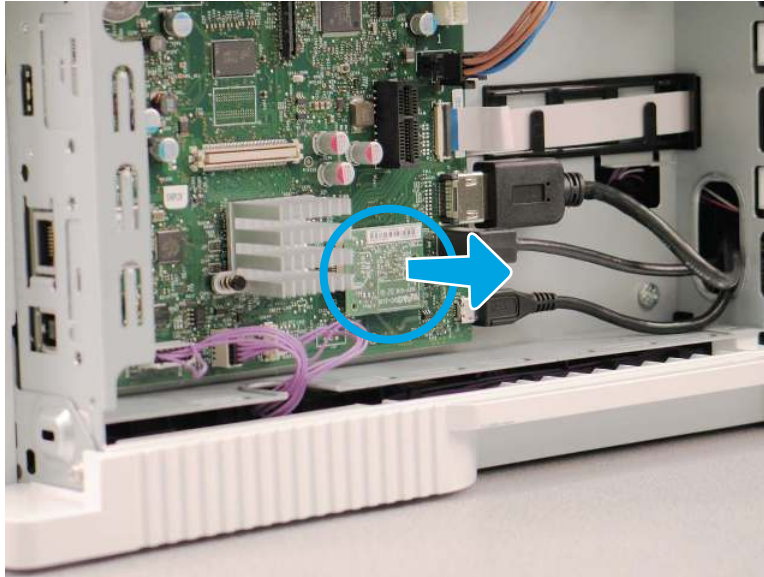


- d. Install the embedded multi-media card (eMMC).
 - i. Align the connector on the replacement eMMC (callout 1) with the connector on the formatter (callout 2)

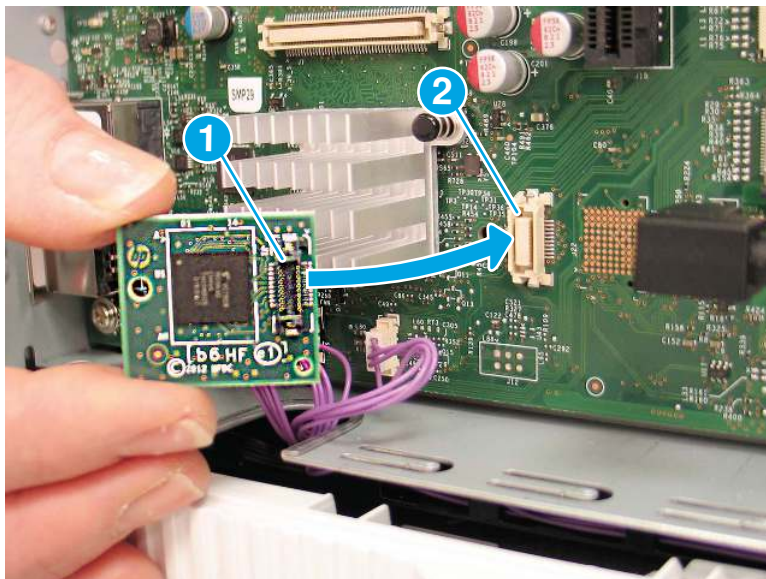

- ii. Push the eMMC on to the formatter to install it.


 **IMPORTANT:** Press on the top part of the eMMC to ensure it is fully seated in the connector.

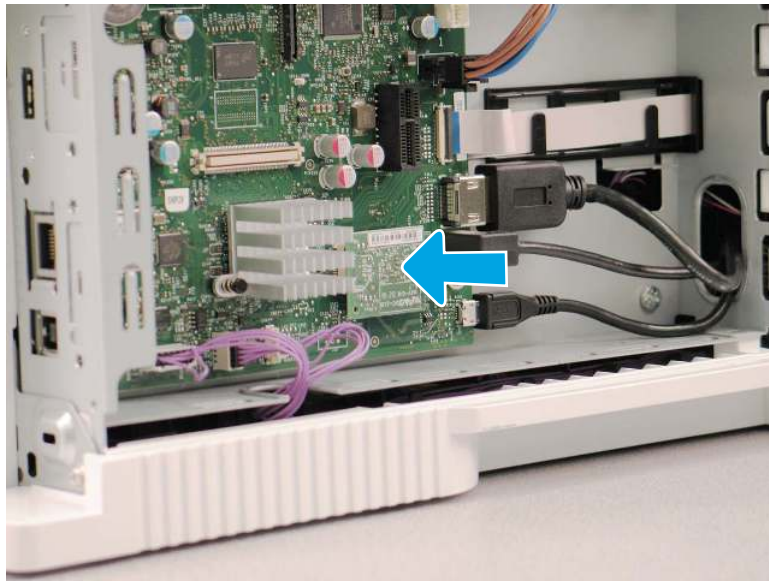

- e. Install the formatter cover.

Slide the formatter cover on to the printer in the direction indicated by the arrow (callout 1), and then tighten the two thumb screws (callout 2).

Figure 6-236 Slide on the formatter cover and tighten two thumb screws

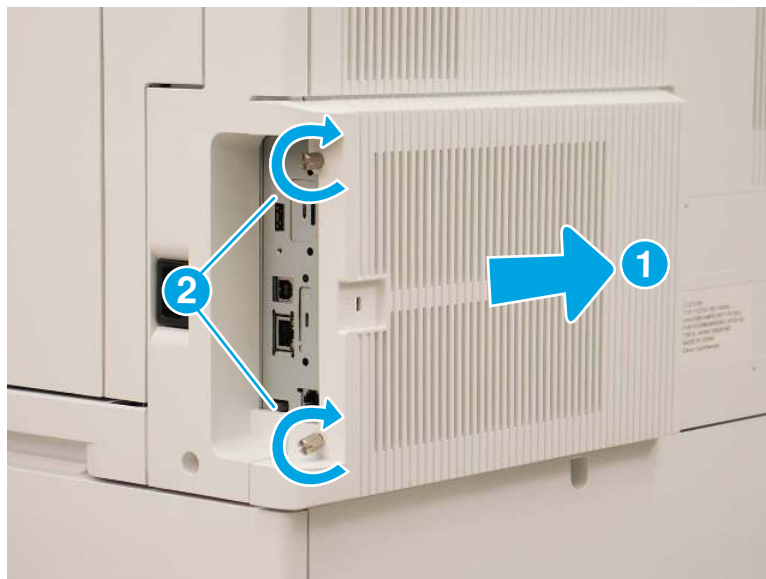

- f. Connect the power cable, and then use the power button to turn on the printer.

4. If the error persists, replace the hard disk drive or eMMC.



NOTE: Device is unusable until a new boot device is installed.



WARNING! Do not replace the printer formatter, it will not resolve this issue.



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-163 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.
Module 16B embedded MultiMedia Card (eMMC) kit	5851-6436

For instructions: See the Repair Service Manual for this product.

99 . 09 . 67 Disk is not bootable please download firmware

There is no firmware installed on the hard disk drive.

This is usually the result of installing a new hard disk drive or performing a Clean Disk procedure from the Preboot menu.



NOTE: When installing a new hard drive or eMMC, the disk should be formatted through the Preboot menu, BEFORE loading firmware.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. Check if the error persists.
3. If the error persists, replace the Hard disk drive (HDD).

Follow the instructions with the replacement drive or refer the following documents for instructions:

- Go to
- or
- Watch the following video: [How to replace the Hard disk drive.](#)

4. If the error persists, verify a compatible hard disk drive (HDD) is installed.



NOTE: The M631dn and M634dn printer models are the only models shipped with the eMMC installed by default. All other models have a HDD.

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Download the printer firmware and extract the files using a USB flash drive.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

2. If the issue persists, use the Preboot menu to perform a Format Disk.



IMPORTANT: **Format Disk** removes all data. After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed to return the printer to a bootable state.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

- a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.

If a password is assigned to the administrator, a prompt displays to enter the password.
- c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
- d. Press the **OK** button again.
- e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".
- f. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.

- g. Update the printer firmware from the Preboot menu using a USB flash drive.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the error persists, replace the hard disk drive.

The M631dn and M634dn are the only printer models shipped with the eMMC installed by default. All other models have a HDD.

 **WARNING!** Do not replace the printer formatter to resolve this issue.

 **NOTE:** Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-164 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: See the Repair Service Manual for this product..

 **NOTE:** As a workaround, it is possible to return the printer to a functional state by enabling the eMMC as the primary boot device until the HDD can be replaced.

To enable the eMMC as the primary boot device perform the following steps:

1. Access the Preboot menu and then select **Administrator**.
 - a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
2. Select **Manage Disk**, and then select **Boot Device**.
3. Select **Use Secondary**, and then select **OK**.
4. Use the power button to turn off the printer, and then disconnect the power cable.
5. Disconnect the HDD from the formatter.
6. Use the power button to turn on the printer.

The printer should boot using the eMMC.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Download the printer firmware and extract the files using a USB flash drive.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

2. If the issue persists, use the Preboot menu to perform a Format Disk.



IMPORTANT: **Format Disk** removes all data. After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed to return the printer to a bootable state.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

- a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.

If a password is assigned to the administrator, a prompt displays to enter the password.
- c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
- d. Press the **OK** button again.
- e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".
- f. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.

- g. Update the printer firmware from the Preboot menu using a USB flash drive.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the error persists, replace the hard disk drive.

The M631dn and M634dn are the only printer models shipped with the eMMC installed by default. All other models have a HDD.



WARNING! Do not replace the printer formatter to resolve this issue.



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-165 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: See the Repair Service Manual for this product..



NOTE: As a workaround, it is possible to return the printer to a functional state by enabling the eMMC as the primary boot device until the HDD can be replaced.

To enable the eMMC as the primary boot device perform the following steps:

- a. Access the Preboot menu and then select **Administrator**.
 - i. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - ii. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
- b. Select **Manage Disk**, and then select **Boot Device**.
- c. Select **Use Secondary**, and then select **OK**.
- d. Use the power button to turn off the printer, and then disconnect the power cable.
- e. Disconnect the HDD from the formatter.
- f. Use the power button to turn on the printer.

The printer should boot using the eMMC.

4. If the issue persists, elevate the issue using your country/region support process.

99 . 39 . 64 eMMC Nonfunctional

The eMMC is not functioning.

Recommended action

- Replace the eMMC.



NOTE: The device is unusable until a new eMMC is installed.

Do NOT replace the formatter board, it will not resolve this issue.

99.39.67 eMMC Not Bootable

Data on the eMMC cannot be secured or encrypted.

When the hard disk drive is installed all data on the eMMC is automatically migrated to the hard disk drive and erased from the eMMC. As long as the hard disk drive is installed the eMMC is non-functional.

The customer passed the data migration and put the eMMC back in.

Recommended action

1. Download firmware to the eMMC.
2. If the download fails to eMMC, replace the eMMC.

Do NOT replace the formatter board, it will not resolve this.



NOTE: The device is unusable until a new eMMC is installed.

7 Alphabetical control panel messages

Use the following alphabetical message to see further information on the message.

Alphabetical messages

Accept bad signature

The product is performing a remote firmware upgrade and the code signature is invalid.

Recommended action

Follow these troubleshooting steps in the order presented.

- Download the correct firmware upgrade file for the product, and then reinstall the upgrade.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

Authentication required

A user name and password are required.

Recommended action

- Type the user name and password, or contact the network administrator.

Bad optional tray connection

The optional tray is not connected, not connected correctly, or a connection is not working correctly.

Recommended action

1. Turn the printer off.
2. Remove and then reinstall the optional tray.
3. If more than one extra 550 Sheet feeder is available swap trays and test again.
4. Remove the tray and inspect the connectors on the tray and printer for damage. If either of them are broken, have bent pins, or otherwise appear damaged, replace them.
5. Carefully reposition printer base onto the optional tray. HP recommends that two people lift the printer.
6. If the problem continues, replace the connector for the tray.

550 Sheet feeder upper cable assembly part number: RM2-8880-000CN

550 Sheet feeder lower cable assembly part number: RM2-8881-000CN

1X550, 3X550 and 2,550 Sheet feeder stand cable assembly part number: RM2-9286-000CN

Canceling...<jobname>

The printer is canceling the current job <jobname>.

Recommended action

See recommended action.

- No action necessary.

Cartridge low

If this message appears even though the toner cartridge is new, perform the following.

Recommended action

1. Remove, and then reinstall the toner cartridge.
2. Make sure a genuine HP supply is used.
3. If the error persists, replace the toner cartridge.

Cartridge Memory Abnormal

This message appears even though the toner cartridge is new.

Recommended action

1. Remove, and then reinstall the toner cartridge.
2. If the error persists, replace the toner cartridge.

Cartridge out

This message appears even though the toner cartridge is new.

Recommended action

1. Remove, and then reinstall the toner cartridge.
2. Make sure a genuine HP supply is used.
3. If the error persists, replace the toner cartridge.

Checking engine

The printer is conducting an internal test.

Recommended action

See recommended action.

- No action necessary.

Checking paper path

The printer is checking for possible paper jams.

Recommended action

See recommended action.

- No action necessary.

Chosen personality not available To continue touch “OK”

A print job requested a printer language (personality) that is not available for this printer. The job will not print and will be cleared from memory.

Recommended action

Follow these troubleshooting steps in the order presented.

- Print the job by using a print driver for a different printer language, or add the requested language to the printer (if possible). To see a list of available personalities, print a configuration page.
 - a. From the Home screen on the printer control panel, go to the following menus: **Reports > Configuration/Status Pages**
 - b. Select [Configuration Page](#), then select the [Print](#) button to print the pages.

Cleaning

The printer is performing an automatic cleaning cycle. Printing will continue after the cleaning is complete.

Recommended action

See recommended action.

- No action necessary.

Clearing activity log

This message is displayed while the activity log is cleared. The printer exits the menus when the log has been cleared.

Recommended action

- No action necessary.

Clearing paper path

The printer is attempting to eject jammed paper.

Recommended action

Follow these troubleshooting steps in the order presented.

- Check the progress at the bottom of the display.

Close left door

The left door is open.

This message appears even though the top left door is closed.

Recommended action for customers

1. Close the left door to allow the printer to attempt to clear the jam.
2. Open then close the left door to ensure it is fully closed.


Recommended action for call-center agents and onsite technicians

1. Close the left door to allow the printer to attempt to clear the jam.

2. Check the projection part on the left door that defeats the left door interlocks. If broken replace the left door assembly.

Part number: RM2-0850-000CN

For instructions: See the Repair Service Manual for this product.

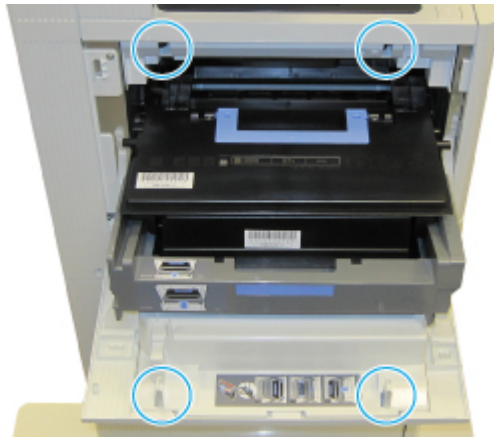

3. Check SW1 using the manual sensor test.
 - a. From the home screen on the printer control panel, touch [“Support Tools”](#).
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
 - c. Select from the following tests:
 - [All Sensors](#) , [Engine Sensors](#)
 - [Done](#) (return to the [Troubleshooting](#) menu)
 - [Reset](#)(reset the selected sensor’s state)
 - d. Test SW2 using folded paper or another object to defect the interlock. If the switch test fails, replace the laser shutter assembly.

Part number: RM2-6755-000CN



NOTE: Before replacing any parts check connector J308 on the DC controller.

Close right door

The right door is open.

Recommended action for customers

- Close the right door to allow the printer to attempt to clear the jam.

Recommended action for call-center agents and onsite technicians

1. Close the right door to allow the printer to attempt to clear the jam.
2. Check the projection part on the right door that defeats the right door interlocks. If broken replace the right door assembly.

Part number: RM2-0849-000CN

For instructions: See the Repair Service Manual for this product.




3. Check SW1 using the manual sensor test.
 - a. From the home screen on the printer control panel, touch [“Support Tools”](#).
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
 - c. Select from the following tests:
 - [All Sensors](#) , [Engine Sensors](#)
 - [Done](#) (return to the [Troubleshooting](#) menu)
 - [Reset](#)(reset the selected sensor’s state)
 - d. Test SW1 using folded paper or another object to defect the interlock. If the switch test fails, replace the laser shutter assembly.

Part number: RM2-6755-000CN



NOTE: Before replacing any parts check connector J321 on the DC controller.

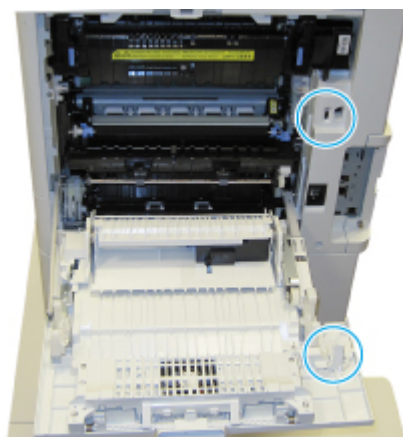

Communication lost

A Communication Lost message appears on the control panel in five different languages.

The communication path from the control panel to the formatter includes the Control Panel, USB cable, and the formatter.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, check the heartbeat LED on the formatter located on the rear of the printer.
 - If the formatter heartbeat LED status flashes **yellow**, it indicates a communication problem between the control panel and the formatter. Replace the control panel.

Table 7-1 Control panel part numbers

Description	Part number
Control panel assembly	B5L47-67018

- If the formatter heartbeat LED status is solid **red**, it indicates a problem with the formatter. Replace the formatter.

Table 7-2 Formatter part numbers

Description	Part number
Formatter (main logic) PC board	J8J61-60001

Recommended action for service technicians

Follow these troubleshooting steps in the order presented.


1. Turn the printer off, and then on.
2. If the issue persists, turn off the printer, and then reseal the USB cable connection in the control panel.
 - a. Tilt the control panel forward (callout 1), and then open the document feeder (callout 2).

Figure 7-1 Tilt the control panel forward and open the document feeder



- b. Beginning at the right side of the control-panel cover, carefully release five tabs along the top edge of the cover.

Figure 7-2 Release five tabs

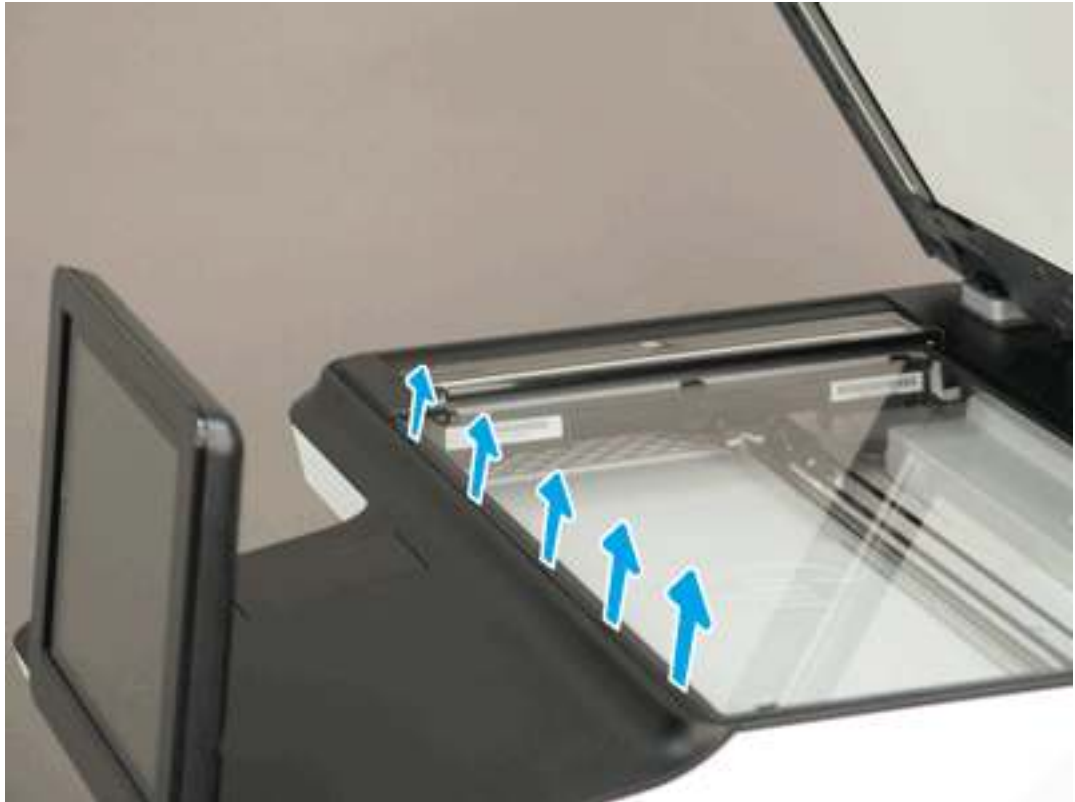


- c. Continue to rotate the top edge of the cover away from the printer, and then remove the cover.

Figure 7-3 Remove the cover



- d. Disconnect and then reconnect the USB cable (callout 2) from the holder.

Figure 7-4 2 connectors (callout 1) and USB cable (callout 2)

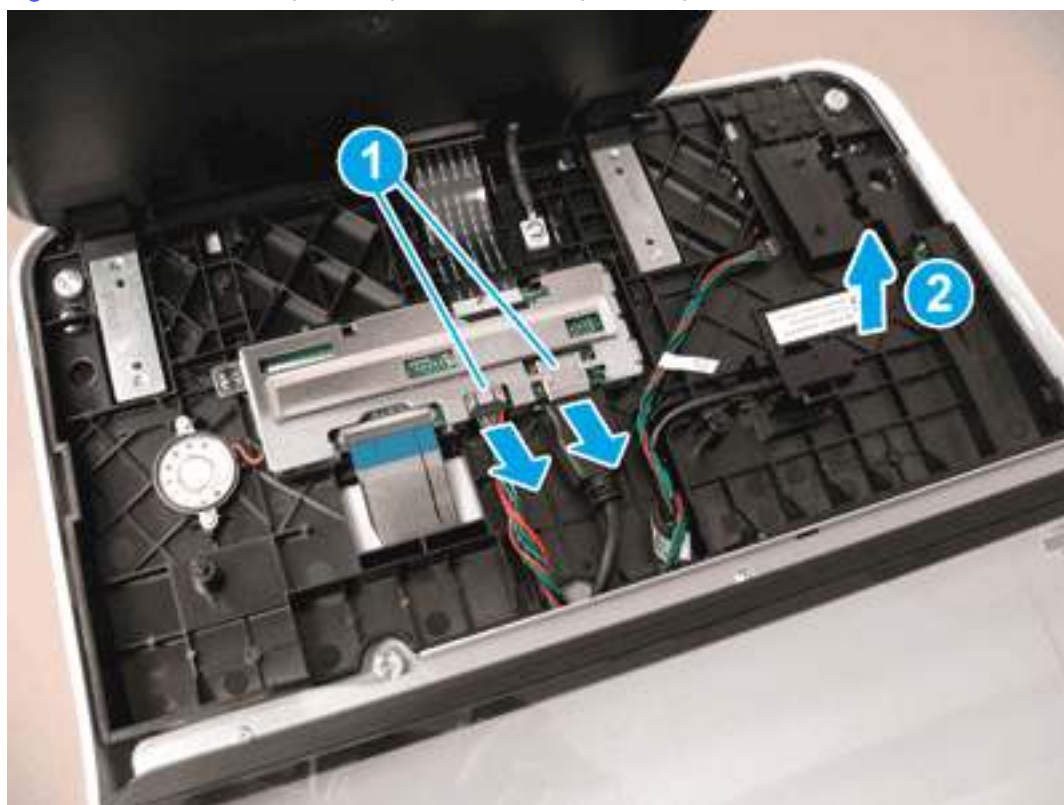

3. Press the power button to turn on the printer.
4. If the printer returns to a "Ready" state, verify functionality of the control panel.
5. If the issue persists, turn the printer off.
6. Reseat the J51 connector, HDMI, USB and HIP cables on the formatter.
7. Turn the printer on, and then check if the issue persists.
8. If the issue persists, replace the formatter.

Use the table below to order the correct part number for the printer.

Table 7-3 Formatter part number

Description/ Product models	Part number
Formatter (main logic) PC board	J8J61-60001
For products: M631, M632, M633, E62555, E62565, E62575	
Formatter (main logic) PC board	3GY14-67901
For products: E62655/E62665/E62675	
Kit -Formatter	3GY14-67902
For products: E62655/E62665/E62675 (India/China)	

Table 7-3 Formatter part number (continued)

Description/ Product models	Part number
Formatter	7PS94-67901
For products: M634, M635, M636, M637 (India/China)	
Formatter	7PS94-67902
For products: M634, M635, M636, M637	

For instructions: See the Repair Service Manual for this product.

9. If the issue persists, replace the control panel.

Use the table below to order the correct part number.

Table 7-4 Control panel part numbers

Description	Part number
Control panel assembly	B5L47-67018

For instructions: . See the Repair Service Manual for this product.

Data received To print last page press “OK”

The printer is waiting for the command to print the last page.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the “OK” button on the control panel to print the last page of the job.

Event log is empty

No printer events are in the log.

Recommended action

See recommended action.

- No action necessary.

Expected drive missing

The printer cannot find the encrypted hard drive.

Recommended action

Follow these troubleshooting steps in the order presented.

- Install the encrypted hard disk drive.

External device initializing

An external device is initializing.

Recommended action

See recommended action.

- No action necessary.

Fuser Kit low

10.23.60 (event code)

The printer indicates when a supply is low.

Recommended action

- Replace the fuser.

110V part number: RM2-1256-000CN

For instructions: See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: See the Repair Service Manual for this product.

Fuser Kit very low To continue, touch “OK”

10.23.70 (event code)

The printer indicates when a supply is very low.

After an HP supply has reached the very low threshold, the HP premium protection warranty for that supply has ended.

Recommended action

- Replace the fuser.

110V part number: RM2-1256-000CN

For instructions: See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: See the Repair Service Manual for this product.

Gateways failed

There is an incorrect gateways configuration.

Recommended action

- Use the [EIO <X> Jetdirect](#) menu to configure the default gateway.

Genuine HP supply installed

A new genuine HP supply has been installed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **Hide** button to remove this message.

Incompatible <Supply>

The indicated supply is not compatible with this printer.

- **10.00.35:** (event code) Toner cartridge
- **10.23.35:** (event code) Fuser kit

Recommended action

- Replace the supply with one that is designed for this printer.

Incompatible supplies

Print cartridges or other supply items are installed that were not designed for this printer. The printer cannot print with these supplies installed.

Event codes are supply specific.

Recommended action

- Touch the **OK** button to identify the incompatible supplies.
Replace the supplies with those that are designed for this printer.

Initializing...

The printer is starting.

Recommended action

- See recommended action.
- No action necessary.

Install fuser unit

10.23.15: (event code) Fuser Kit

The fuser has been removed or installed incorrectly.

Recommended action

1. Turn the printer off and open the right door.
2. Remove the fuser then reinstall it.

 **CAUTION:** The fuser might be hot.

3. If the message remains, replace the fuser.

110V part number: RM2-1256-000CN

For instructions: See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: See the Repair Service Manual for this product.

Install supplies

More than one supply is missing or is installed incorrectly.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to identify the supplies that need to be replaced.
2. Touch the **OK** button a second time for more information about the specific supply.
3. Install the supply or make sure it is correctly installed and fully seated.

Internal disk device failure To clear touch “OK”

82.0X.YY (event code)

The internal disk failed.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to clear the error.
2. If the error persists, turn off the printer, and then remove and reinstall the hard drive.
3. Turn on the printer.
4. If the error persists, replace the internal hard drive.



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 7-5 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: See the Repair Service Manual for this product.

Internal disk file operation failed

A PjL system command attempted to perform an illogical operation, such as downloading a file to a nonexistent directory.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

Internal disk file system is full

A PjL system command attempted to write data to the internal hard disk drive but was unsuccessful because the hard disk drive is full.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

Internal disk is write protected

The internal hard disk drive is write protected and no new files can be written to it.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

Internal disk not found

The internal hard disk drive was not found at start up.

Recommended action

Follow these troubleshooting steps in the order presented.

- Turn the printer off, and then on.

Internal disk not functional

82.0X.YY (event code)

The internal hard drive is not functioning correctly.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then remove and reinstall the hard drive.
2. Turn on the printer.

3. If the error persists, replace the internal hard drive.



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 7-6 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: See the Repair Service Manual for this product.

Internal disk not initialized

The internal hard disk drive file system must be initialized before it can be used.

Recommended action

Follow these troubleshooting steps in the order presented.

- Initialize the internal hard disk drive file system.

For information on performing various actions on the hard disk drive, go to:

[HP LaserJet, OfficeJet, PageWide, ScanJet - HP FutureSmart Firmware Device Hard Disk, SSD, and eMMC Security \(white paper\)](#)

Internal disk spinning up

The internal hard disk drive device is spinning up its platter. Jobs that require hard disk drive access must wait.

Recommended action

See recommended action.

- No action necessary.

Load Tray <X>: [Type], [Size] To use another tray, press “OK”

This message displays when the indicated tray is selected, but is not loaded, and other paper trays are available for use.

It also displays when the tray is configured for a different paper type or size than the print job requires.

Recommended action

1. Load the correct paper in the tray.
2. If prompted, confirm the size and type of paper loaded.

3. Otherwise, press the OK button to select another tray.
4. If error persists, use the cassette paper present sensor test in the Tray/bin manual sensor test to verify that the sensor is functioning correctly.
5. Make sure that the sensor flag on the paper presence sensor is not damaged and moves freely.
6. Reconnect the corresponding connector.

Loading program <XX> Do not power off

Programs and fonts can be stored on the printer's file system and are loaded into RAM when the printer is turned on. The number <XX> specifies a sequence number indicating the current program being loaded.

Recommended action

See recommended action.

- No action necessary.

Manually feed output stack Then touch "OK" to print second side

The printer has printed the first side of a manual duplex job and is waiting for you (or the applicable user) to insert the output stack to print the second side.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Maintaining the same orientation, remove the pages from the output bin.
2. Flip the document printed side up.
3. Load the document in Tray 1.
4. Touch the **OK** button to print the second side of the job.

Manually feed: <Type><Size>

This message appears when manual feed is selected, Tray 1 is not loaded, and other trays are empty.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Load the tray with requested paper.
2. If the paper is already in the tray, press the **Help** button to exit the message and then press the **OK** button to print.
3. To use another tray, clear paper from Tray 1, press the **Help** button to exit the message and then press the **OK** button.

No job to cancel

You have pressed the stop button but the printer is not actively processing any jobs.

Recommended action

See recommended action.

- No action necessary.

No USB drive or files found

The formatter was not able to detect the USB thumb drive.


If you experience the “No USB drive or files found” attempting to upgrade printer firmware via the walk up easy-access USB port perform the following.

Recommended action for customers

Follow these steps to try to resolve this error.

If you experience the “No USB drive or files found” attempting to upgrade printer firmware via the walk up easy-access USB port perform the following.

1. After the firmware file has been downloaded from hp.com uncompress the file and copy the xxxxxx.bdl file to the root of a portable USB flash memory storage device (thumb drive), insert the USB flash memory storage device into the easy-access USB port, and attempt to flash the firmware.
2. If the issue persists, verify the USB flash drive is formatted as FAT32. If unsure, format the flash drive as FAT32 and/or try a different flash drive and repeat step 1.
3. If the issue persists, the USB flash drive can be inserted directly into a USB port on the printer's formatter and the firmware flashed.
 - a. Locate the printer's formatter interface located at the rear left side of printer.
 - b. If necessary, rotate the printer for easier access to the formatter ports.
 - c. Locate the USB connection port (callout 2).

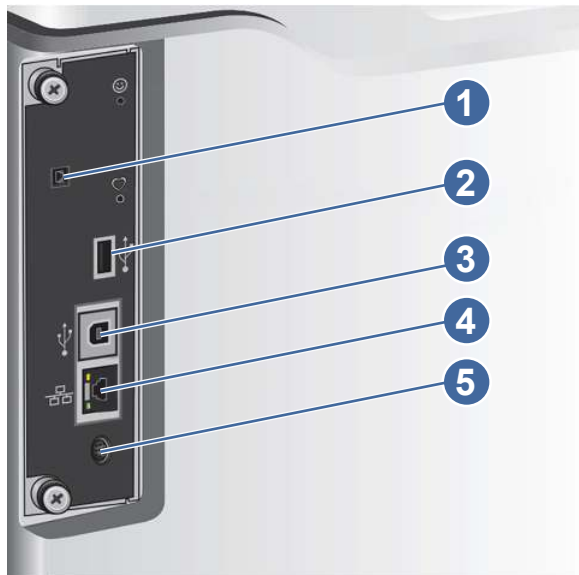

- d. Insert the USB flash drive (callout 2).

- e. Attempt to flash the printer's firmware.
 - f. After the firmware update remove the USB flash drive.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for onsite technicians

Follow these steps to try to resolve this error.

1. Try another thumb drive.
2. Use both the rear and walk up USB ports.
3. If the error persists, install another formatter board.

For instructions: See the Repair Service Manual for this product.

Table 7-7 Part information

Part number	Part description
J8J61-60001	Formatter PCA (M631, M632, M633, E62555, E62565, E62575)
3GY14-67901	Formatter PCA (E62655/E62665/E62675)
3GY14-67902	Formatter PCA (E62655/E62665/E62675; India, China)
K0Q14-60001	Formatter PCA (M631/M632/M633 x models only)
K0Q14-60002	Formatter PCA (M631/M632/M633 n, dn models only)
7PS94-67901	Formatter PCA (M634, M635, M636, M637; India, China)
7PS94-67902	Formatter PCA (M634, M635, M636, M637)

4. If the error persists, elevate using the standard support process.

Recommended action for call-center agents

Follow these steps to try to resolve this error.

1. Try another thumb drive.
2. Use both the rear and walk up USB ports.
3. If the error persists, install another formatter board.

For instructions: See the Repair Service Manual for this product.

Table 7-8 Part information

Part number	Part description
J8J61-60001	Formatter PCA (M631, M632, M633, E62555, E62565, E62575)
3GY14-67901	Formatter PCA (E62655/E62665/E62675)
3GY14-67902	Formatter PCA (E62655/E62665/E62675; India, China)
K0Q14-60001	Formatter PCA (M631/M632/M633 x models only)
K0Q14-60002	Formatter PCA (M631/M632/M633 n, dn models only)
7PS94-67901	Formatter PCA (M634, M635, M636, M637; India, China)

Table 7-8 Part information (continued)

Part number	Part description
7PS94-67902	Formatter PCA (M634, M635, M636, M637)

4. If the error persists, elevate using the standard support process.

NON HP Supply Installed

This message is displayed for about 6 seconds when a new non-HP supply is installed.

10.99.31 (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

1. Use a genuine HP supply for the printer.
2. If you believe a genuine HP supply is being used, go to www.hp.com/go/anticounterfeit.

Output Bin Full

The **Output Bin Full** message displays when the output bin is full and paper must be removed before printing can continue.

Recommended action

1. Remove the paper from the output bin.
2. If this message appears even though the output bin is not full.
 - a. Make sure that the output bin sensor flag is not damaged and can move freely. If the flag is damaged, replace the flag.
 - b. Use the output bin full sensor test in the manual sensor test to test the sensor. If it does not respond, replace the delivery assembly.

Paper delivery assembly part number: RM2-6787-000CN

For instructions: See the Repair Service Manual for this product.

Paused...

The printer is paused, and there are no error messages pending at the display. The I/O continues receiving data until the memory is full.

Recommended action

Follow these troubleshooting steps in the order presented.

- Press the **Stop** button.

Performing Paper Path Test

A paper path test is being performed.

Recommended action

See recommended action.

- No action necessary.

Please Wait...

The printer is in the process of clearing data.

Recommended action

See recommended action.

- No action necessary.

Printing Cleaning Page...

The printer is printing the cleaning page.

Recommended action

See recommended action.

- No action necessary.

Printing Configuration...

The printer is printing the Configuration page.

Recommended action

See recommended action.

- No action necessary.

Printing engine test...

The printer is printing an engine test page.

Recommended action

See recommended action.

- No action necessary.

Printing Event Log...

The printer is printing the Event Log page.

Recommended action

See recommended action.

- No action necessary.

Printing File Directory...

The printer is printing the File Directory pages.

Recommended action

See recommended action.

- No action necessary.

Printing Font List...

The printer is printing the Font List pages.

Recommended action

See recommended action.

- No action necessary.

Printing Help Page...

The printer is printing the Help page.

Recommended action

See recommended action.

- No action necessary.

Printing Menu Map...

The printer is printing the Menu Map pages.

Recommended action

See recommended action.

- No action necessary.

Printing Registration Page

The printer is printing the Registration pages.

Recommended action

See recommended action.

- No action necessary.

Printing stopped...

Time has expired on the Print/Stop test.

Recommended action

See recommended action.

- No action necessary.

Printing Supplies Status Page...

The printer is printing the Supplies Status page.

Recommended action

See recommended action.

- No action necessary.

Printing Usage Page...

The printer is printing the Usage page.

Recommended action

See recommended action.

- No action necessary.

Processing duplex job Do not grab paper until job completes

Paper temporarily comes into the output bin while printing a duplex job.

Recommended action

See recommended action.

- No action necessary.

Processing job from tray <x>... Do not grab paper until job completes

The printer is actively processing a job from the designated tray.

Recommended action

See recommended action.

- No action necessary.

Processing...

The printer is currently processing a job but is not yet picking pages. When paper motion begins, this message is replaced by a message that indicates the tray the job is using.

Recommended action

See recommended action.

- No action necessary.

Processing... copy <x> of <y>

The printer is currently processing or printing collated copies. The message indicates that copy number <x> of total copies <y> is currently being processed.

Recommended action

See recommended action.

- No action necessary.

RAM disk device failure To clear press “OK”

The specified device failed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

RAM disk file operation failed To clear press “OK”

A PjL command was received that attempted to perform an illegal operation, such as downloading a file to a nonexistent directory.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

RAM disk file system is full To clear press “OK”

The RAM disk is full.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

RAM disk not initialized

The RAM disk file system must be initialized before it can be used.

Recommended action

Follow these troubleshooting steps in the order presented.

- Initialize the RAM disk file system.

RAM disk is write protected To clear press “OK”

The device is protected and no new files can be written to it.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

Ready

The printer is online and ready for data. No status or printer attendance messages are pending at the display.

Recommended action

See recommended action.

- No action necessary.

Ready <IP Address>

The printer is online and ready for data. No status or printer attendance messages are pending at the display. The printer IP address displays.

Recommended action

See recommended action.

- No action necessary.

Receiving Upgrade

The printer is receiving a firmware upgrade.

Recommended action

Follow these troubleshooting steps in the order presented.

- Do not turn the printer off until it reaches the [Ready](#) state.

Remove USB accessory

This message displays when an unsupported USB device is inserted into a host USB port on the printer.

Recommended action

Follow these troubleshooting steps in the order presented.

- Remove the unsupported USB device.

Replace <Supply>

This alert displays only if the printer is configured to stop when a supply reaches the very low threshold. The printer indicates when a supply level is at its estimated end of life. The actual life remaining might be different than estimated.

The supply does not need to be replaced now unless the print quality is no longer acceptable.

HP recommends that the customer have a replacement supply available to install when print quality is no longer acceptable.

The printer can be configured to stop when the supply level is very low. The supply might still be able to produce acceptable print quality.

- **10.00.70** : Toner cartridge (event code)
10.23.70 Fuser kit (event code)

Recommended action

- Replace the specified supply.

Or, configure the printer to continue printing using the [Manage Supplies](#) menu on the printer control panel.

Resend external accessory firmware

An external accessory requires a firmware upgrade. Printing can continue, but jams might occur if the job uses the external accessory.

Recommended action

Follow these troubleshooting steps in the order presented.

- Perform a firmware upgrade.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

Resend Upgrade

A firmware upgrade did not complete successfully.

Recommended action

Follow these troubleshooting steps in the order presented.

- Upgrade the firmware again.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

Restore Factory Settings

The printer is restoring factory settings.

Recommended action

See recommended action.

- No action necessary.

RFU Load Error Send full RFU on <X> Port

The printer displays this message before the firmware is loaded at initialization when an error has occurred during a firmware upgrade.

Recommended action

- Resend the firmware upgrade.

ROM disk device failed To clear press "OK"

The specified device failed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

ROM disk file operation failed To clear press "OK"

A PJL command was received that attempted to perform an illegal operation, such as downloading a file to a nonexistent directory.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

ROM disk file system is full To clear press “OK”

The specified device is full.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

ROM disk is write protected To clear press “OK”

The device is protected and no new files can be written to it.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

ROM disk not initialized To clear press “OK”

The ROM disk file system must be initialized before it can be used.

Recommended action

Follow these troubleshooting steps in the order presented.

- Initialize the ROM disk file system.

Sanitizing disk <X> complete Do Not power off

The hard disk is being cleaned.

Recommended action

- Contact the network administrator.

Size mismatch in Tray <X>

The paper in the listed tray does not match the size specified for that tray.

If using adhesive or self-sealing media, please see the instructions in . (ish_3199741-3199797-16)

Recommended action

1. Load the correct paper.
2. Make sure that the paper is positioned correctly.
3. Close the tray, and then make sure that the control panel lists the correct size and type for the specified tray.

4. If necessary, use the control panel menus to reconfigure the size and type settings for the specified tray.
5. If this message appears even though the correct size paper is loaded in the correct paper tray perform the following.
 - a. Use the Tray size switch test in the Tray/Bin manual sensor test to test the switch. If it does not respond, replace the tray drive assembly.

Part number: RM2-0875-000CN

550 Sheet feeder instructions: See the Repair Service Manual for this product.

Removal and replacement: See the Repair Service Manual for this product.

3X550 Sheet paper deck instructions: See the Repair Service Manual for this product.

2550 Sheet feeder deck instructions: See the Repair Service Manual for this product.
 - b. Reconnect tray connectors on the media size switch, and then reconnect connector on the DC controller to tray.

Sleep mode on

The printer is in sleep mode. Pressing a control-panel button, receiving a print job, or occurrence of an error condition clears this message.

Recommended action

See recommended action.

- No action necessary.

Supplies low

Multiple supplies on the printer have reached the low threshold.

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the supply when print quality is no longer acceptable.

Supply memory warning

The printer cannot read or write to the e-label or the e-label is missing.

Recommended action

See recommended action.

- No action necessary.

Too many jobs in queue

This message displays when the user selects a USB file to print, and 100 files are already in the print queue.

Recommended action

- To select another file, touch the **OK** button.

Tray <X> empty: [Type], [Size]

The specified tray is empty and the current job does not need this tray to print.

- X = 1: Tray 1
- X = 2: Tray 2
- X = 3: Tray 3
- X = 4: Tray 4
- X = 5: Tray 5

Recommended action

- Refill the tray at a convenient time.



NOTE: This could be a false message. If the tray is loaded without removing the shipping lock, the printer does not sense that the paper is loaded. Remove the shipping lock, and then load the tray.

Tray 2 empty: [Type], [Size]


Tray 2 is empty and the current job does not need this tray to print.

Recommended action

1. Check the tray, and refill it if it is empty.
2. If the error persists, unplug the printer cord and rotate the printer so that the rear door of the printer is in front of you.

3. Raise the primary transfer assembly.

Figure 7-5 Raise the transfer assembly

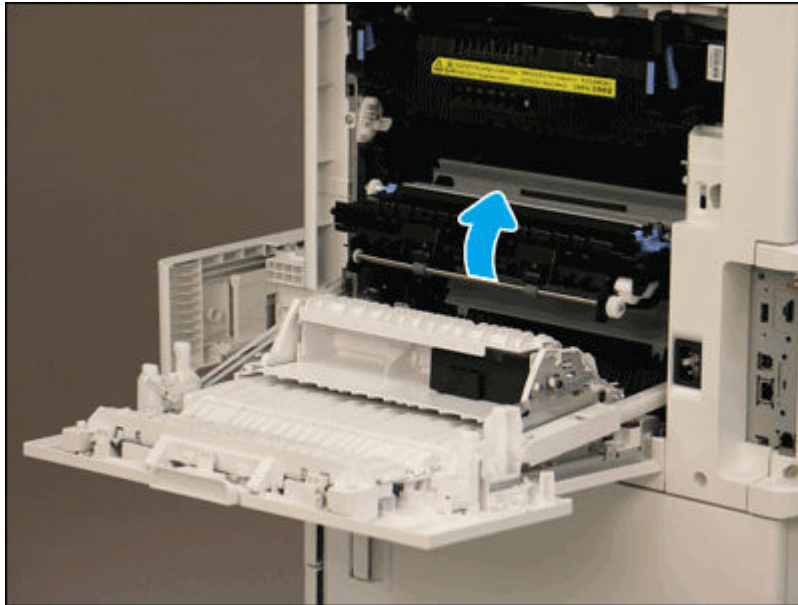

4. Open the rear door to check the feed rollers.
 - a. Pull the green tab located on the upper left-hand side to open the lower-access cover.

Figure 7-6 Open the jam access door



- b. Check the rollers to ensure that they are installed correctly.
 - If the flap of the blue roller tab is down, the rollers are not installed correctly.



NOTE: If the blue tab is DOWN, Tray 2 will not lift, and the control panel will indicate that Tray 2 is empty.

- If the flap of the blue roller tab is up, the rollers are installed correctly.

5. If the error persists, contact customer support.

Tray <X> lifting

The printer is in the process of lifting paper in the indicated tray.

- X = 2: Tray 2
- X = 3: Tray 3
- X = 4: Tray 4
- X = 5: Tray 5

Recommended action

- No action necessary.

Tray <X> open

The specified tray is open or not closed completely.

- X = 2: Tray 2
- X = 3: Tray 3
- X = 4: Tray 4
- X = 5: Tray 5

Recommended action

1. Close the tray.
2. If this message displays after the lifter drive assembly was removed or replaced, make sure that the connector of the assembly is connected correctly and fully seated.
3. If the error persists, use the Media size switches test in the Tray/Bin manual sensor test to test the switches. If they do not respond, replace associated the lifter drive assembly.
4. If the switches do not respond, replace the associated lifter drive assembly.

Tray <X> [type] [size]

The paper in the specified tray is detected as the specified size and type.

The custom switch was not changed.

Recommended action

- If the paper is a custom size or type, change the custom-size switch on the tray as necessary.

Tray 2 overfilled or roller issue

The upper pick roller is not seated correctly or the paper sensor is missing, damaged, or dislodged.

The error message displays the following message on the printer control panel

Check that the tray is not loaded above the fill lines. Remove any excess paper.

If a new pickup roller was recently installed, check to see that the parts are firmly seated, and the access latch is closed.

Recommended action for customers


1. Pull out tray 2 completely out of the printer to remove it.
2. Check if the paper sensor flag located inside tray 2 next to the roller is missing, damaged, or dislodged.
 - a. Open the right door and pull the green tab located on the left-hand side to open the lower-access cover.

Figure 7-7 Jam-access door



- b. Check if the paper sensor flag is missing, damaged, or dislodged. If it is please contact customer support at: www.hp.com/go/contactHP.

Figure 7-8 Paper sensor flag in Tray 2

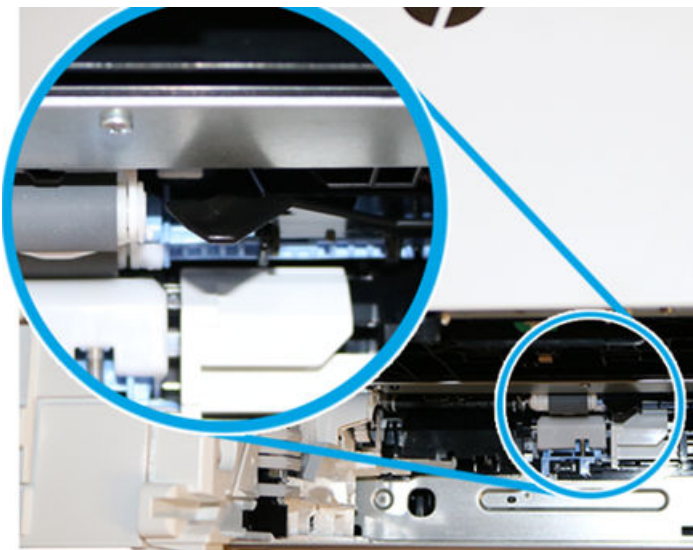

3. Ensure that the stack of paper in the tray is not above the fill mark (line below the three triangles) as indicated in the image.

Figure 7-9 Paper height guides

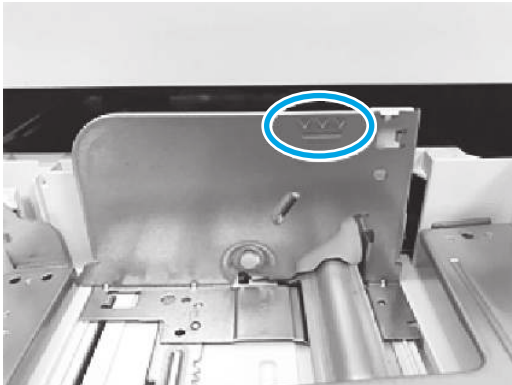


Figure 7-10 Overfilled tray

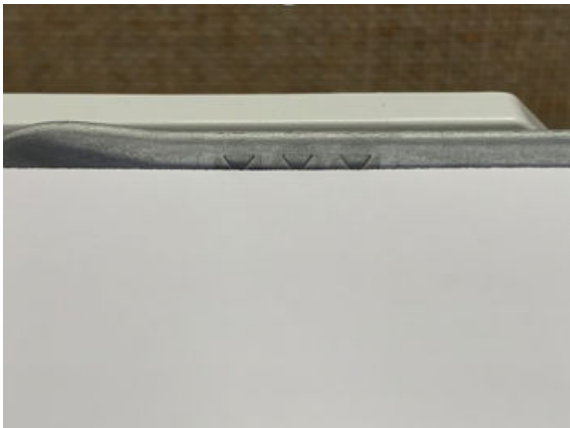


Figure 7-11 Stack of paper not overfilled in tray 2



4. Make sure to remove any excess pages from the tray.
5. Check if the rollers are installed correctly.
 - If the flap of the blue roller tab is down, the rollers are not installed correctly.
 - If the flap of the blue roller tab is up, the rollers are installed correctly.

Figure 7-12 Feed rollers flap is down and not installed correctly


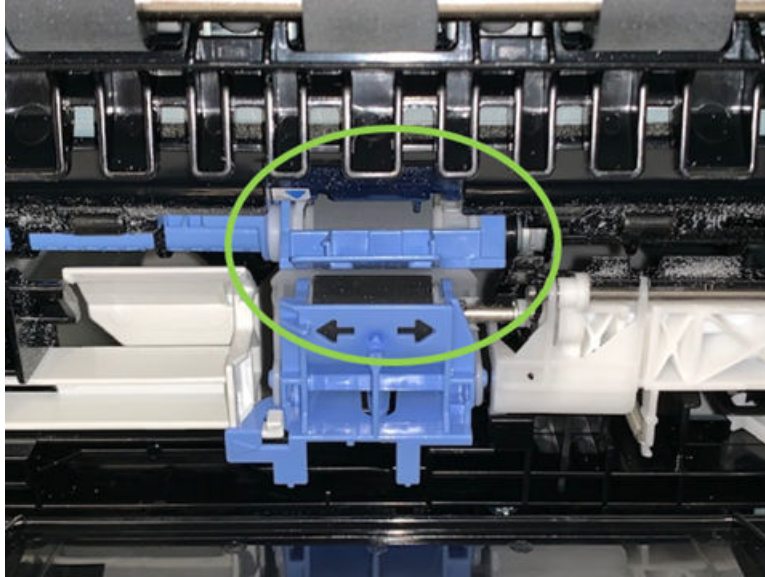


Figure 7-13 Feed rollers flap is up and installed correctly

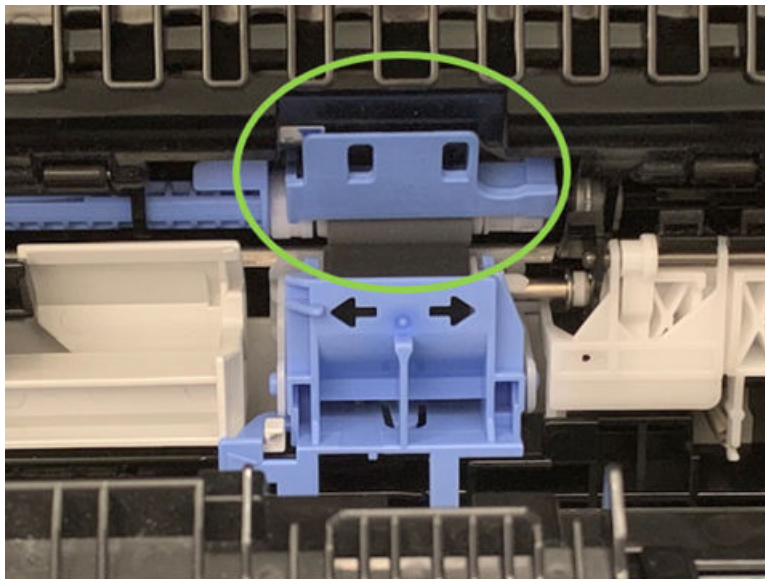

6. Re-seat the feed and separation rollers.
For instructions, go to [Removal and replacement: Trays 2-x rollers](#)
7. Reinstall tray 2.
8. If the message persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Pull out tray 2 completely out of the printer to remove it.
2. Pull out tray 2 completely out of the printer to remove it.
3. Check if the paper sensor flag located inside tray 2 next to the roller is missing, damaged, or dislodged.


- a. Open the right door and pull the green tab located on the left-hand side to open the lower-access cover.

Figure 7-14 Jam-access door



- b. Check if the paper sensor flag is missing, damaged, or dislodged. If it is please contact customer support at: www.hp.com/go/contactHP.

Figure 7-15 Paper sensor flag in Tray 2

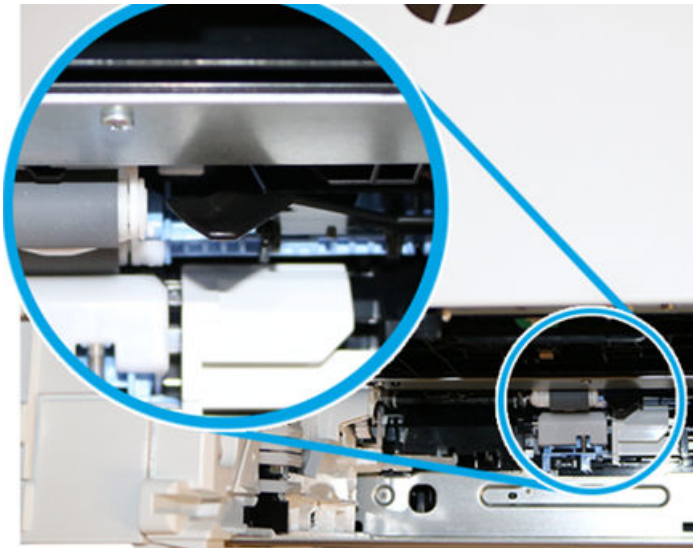

4. Ensure that the stack of paper in the tray is not above the fill mark (line below the three triangles) as indicated in the image.

Figure 7-16 Paper height guides

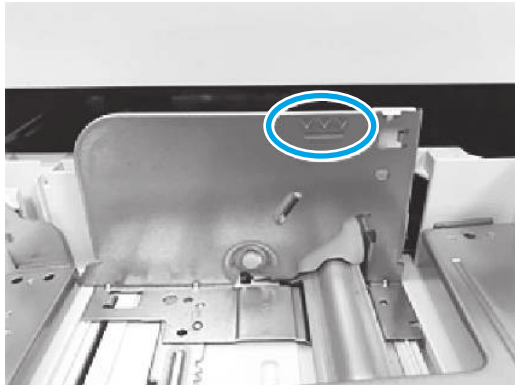


Figure 7-17 Overfilled tray

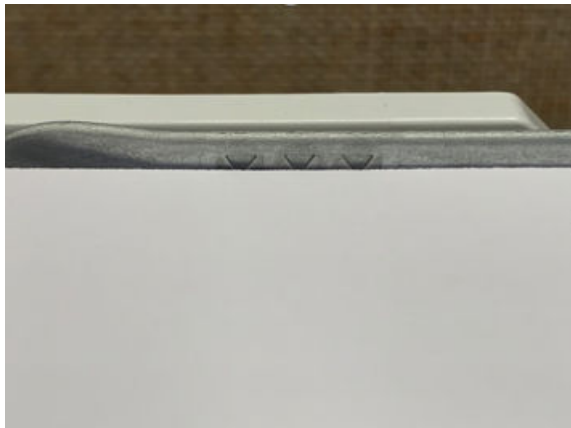


Figure 7-18 Stack of paper not overfilled in tray 2



5. Make sure to remove any excess pages from the tray.
6. Make sure to remove any excess pages from the tray.
7. Check if the rollers are installed correctly.
 - If the flap of the blue roller tab is down, the rollers are not installed correctly.

- If the flap of the blue roller tab is up, the rollers are installed correctly.

Figure 7-19 Feed rollers flap is down and not installed correctly


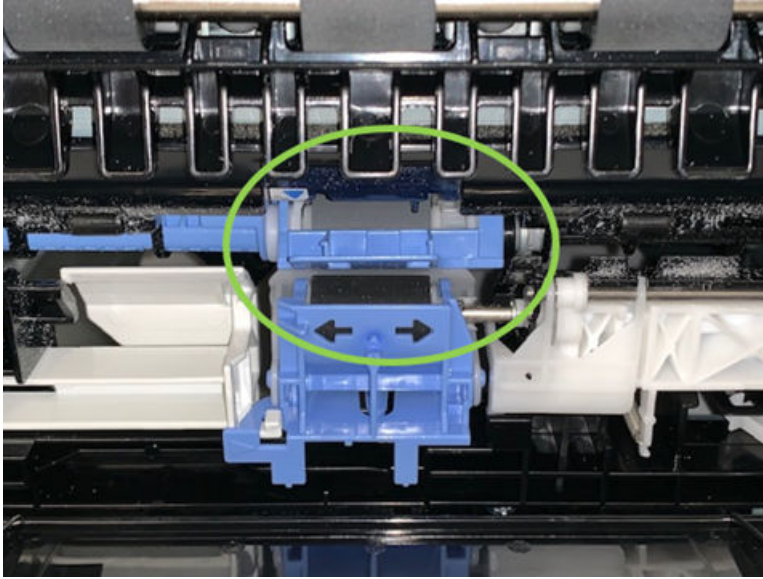


Figure 7-20 Feed rollers flap is up and installed correctly

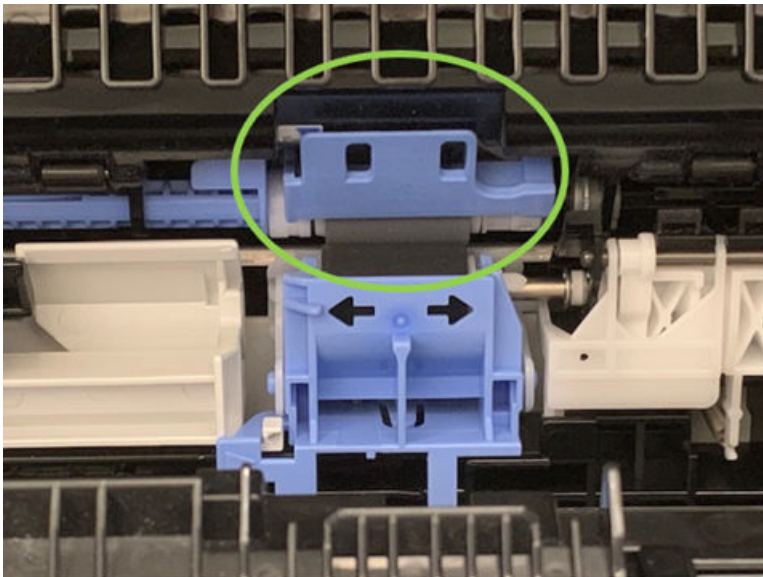

8. Re-seat the feed and separation rollers.
For instructions, go to [Removal and replacement: Trays 2-x rollers](#)
9. If the message persists, replace the feed and separation roller.
Tray 2-x roller assembly part number: J8J70-67906
For instructions, go to [Removal and replacement: Trays 2-x rollers](#)
10. Reinstall tray 2.

Type mismatch Tray <x>

The specified tray contains a paper type that does not match the configured type.

Recommended action

Follow these troubleshooting steps in the order presented.

The specified tray will not be used until this condition is addressed. Printing can continue from other trays.

1. Load the correct paper in the specified tray.
2. On the printer control panel, make sure the paper type loaded in the tray matches the specified setting for the tray.

The unit has corrupt data

Data corruption has occurred in the firmware volume.

- 98 . 00 . 01 : Corrupt data in the firmware volume
- 98 . 00 . 02 : Corrupt data in the solutions volume
- 98 . 00 . 03 : Corrupt data in the configuration volume
- 98 . 00 . 04 : Corrupt data in the job data volume

Recommended action for 98.00.01, 98.00.02, and 98.00.03

Follow these troubleshooting steps in the order presented.

For 98 . 00 . 01 , 98 . 00 . 02 , and 98 . 00 . 03 , perform the following steps:

1. Turn the printer off, and then on.
2. Use the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

3. Reload the firmware.

Recommended action for 98.00.04

Follow these troubleshooting steps in the order presented.

For 98 . 00 . 04 , perform the following steps:

1. Turn the printer off, and then on.
2. Run the file erase function.

For the steps to perform this procedure, go to WISE and search for the following document: HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure (c03398779).

Unsupported drive installed To continue, touch “OK”

A non-supported hard disk drive has been installed. The hard disk drive is unusable by this printer.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove the hard drive.
3. Turn the printer on.

Unsupported tray configuration

The printer has too many optional trays installed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Turn the printer off, remove the unsupported trays, and then turn the printer on.

Unsupported USB accessory detected Remove USB accessory

A non-supported USB accessory has been installed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Turn the printer off, remove the USB accessory, and then turn the printer on.

USB accessory not functional

A parameter in the USB accessory is not correctly functioning.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove the USB accessory.
3. Insert a replacement USB accessory.
4. Turn the printer on.

USB hubs are not fully supported Some operations may not work properly

Some USB hubs require more power than the printer has available.

Recommended action

Follow these troubleshooting steps in the order presented.

- Remove the USB hub.

USB is write protected To clear press "OK"

The device is protected and no new files can be written to it.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

USB needs too much power Remove USB and then turn off and on

A USB accessory is drawing too much electrical current. Printing cannot continue.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, remove the USB accessory, and then turn the printer on.
2. Use a USB accessory that uses less power or that contains its own power supply.

USB not initialized

The USB device file system must be initialized before it can be used.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Enable the USB port using the following steps:
 - **FutureSmart 3:**
 - a. From the Home screen on the printer control panel, open the following menus:
 - i. **Administration**
 - ii. **General Settings**
 - b. Select **Enable Device USB**.
 - c. Select **Enabled**, and then select **Save**.
 - d. Touch the Back button  to return to the **General Settings** menu.
 - **FutureSmart 4:**
 - a. From the Home screen on the printer control panel, select **Settings**.
 - b. Select **Copy/Print**.
 - c. Select **Enable Device USB**, and then select **Enabled**.
 - d. Touch the Back button  to return to the **Settings** menu.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

USB storage accessory removed Clearing any associated data

This message displays for about 6 seconds after a USB device is removed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to remove this message.

USB storage device failure To clear press “OK”

The specified device failed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

USB storage file operation failed To clear press “OK”

A PjL file system command was received that attempted to perform an illegal operation, such as downloading a file to a nonexistent directory.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

USB storage file operation failed To clear press “OK”

A PjL file system command was received that attempted to perform an illegal operation, such as downloading a file to a nonexistent directory.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

USB storage file system is full To clear press “OK”

The file system on the installed USB device is full.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

Verifying, Please Wait

This message displays when the printer is retrieving a print job from device memory, but can cause the printer control panel to lock up.

The user enter the **Retrieve from Device Memory** menu to print a job. After selecting the desired print jobs, **Verifying, Please Wait** displays on the control panel. The status bar will move for a moment, and then lock up. Typically, if the user waits a few minutes, the error will clear and the job will print.

In rare cases, the message will lock up permanently and force the user to power cycle the printer.

The event log might show the following errors as a result of power cycling the printer during lockup:

- 48.05.05
- 98.03.11

Recommended action

1. Turn the printer off and then on again.
2. Make sure the firmware is the latest revision.

Waiting for tray <x> to lift

The specified tray is in the process of lifting paper to the top of the tray (so it can correctly feed).

Recommended action

See recommended action.

- No action necessary.

Windows Login Required to Use this Feature

Windows login required.

Recommended action

Follow these troubleshooting steps in the order presented.

- Enter your windows login.

Index

Symbols/Numerics

49.38.07 356, 357
76.00.24 5

B

backup error
 32.WX.YZ error 4
 reset error 4
 restore error 4

C

connector error
 65.WX.YZ error 5

D

DC controller communication error
 55.WX.YZ error 5
DC controller firmware error
 70.WX.YZ error 5
digital sending error (firmware)
 44.WX.YZ error 5
document feeder error
 31.WX.YZ error 4
duplexer error
 69.WX.YZ error 5

E

Embedded Jetdirect error
 80.WX.YZ error 5
engine error (LaserJet)
 46.WX.YZ error 5
 63.WX.YZ error 5
engine error (PageWide)
 61.WX.YZ error 5
event log error (firmware)
 42.WX.YZ error 4

F

fan error
 58.WX.YZ error 5

firmware communication error
 49.WX.YZ error 5
firmware install error
 99.WX.YZ error 6
hard disk error 6
remote firmware upgrade
 error 6

fuser error
 41.WX.YZ error 4
 laser scanner error 4
 paper path error 4
fuser error (LaserJet)
 50.WX.YZ error 5

H

hard disk partition error
 98.WX.YZ error 6

I

input accessory error
 67.WX.YZ error 5
input/output error
 40.WX.YZ error 4
internal diagnostics error
 90.WX.YZ error 5
video display error 5

J

jam error (LaserJet)
 13.WX.YZ error 4
jam error (PageWide)
 13.WX.YZ error 4
job accounting error (firmware)
 48.WX.YZ error 5
job management error
 (firmware) 5
job pipeline error (firmware) 5
job parser error (firmware)
 47.WX.YZ error 5
printer calibration error 5

L

laser scanner error (LaserJet)
 51.WX.YZ error 5
 52.WX.YZ error 5
last update 1

M

memory error
 82.WX.YZ error 5
 EMMC error 5
 hard disk error 5
motor error (LaserJet)
 59.WX.YZ error 5

N

Near Field Communication error
 81.WX.YZ error 5
Bluetooth error 5
external I/O card error 5
internal EIO error 5
wireless error 5

O

output accessory error
 66.WX.YZ error 5
OXPD/Web kit error
 45.WX.YZ error 5

P

page error
 21.WX.YZ error 4
paper handling error (LaserJet)
 56.WX.YZ error 5
print bar error (PageWide)
 62.WX.YZ error 5
printer memory error
 20.WX.YZ error 4

R

real-time clock error
11.WX.YZ error 4

S

scanner error
30.WX.YZ error 4
security error
33.WX.YZ error 4
sensor error
54.WX.YZ error 5
58.WX.YZ error 5
supplies error (LaserJet)
10.WX.YZ error 4
supplies error (PageWide)
17.WX.YZ error 4
system error (LaserJet)
62.WX.YZ error 5

T

tray motor error (LaserJet)
60.WX.YZ error 5