





HP Color LaserJet Enterprise M455

HP Color LaserJet Managed E45028

HP Color LaserJet Enterprise MFP M480

HP Color LaserJet Managed MFP E47528

Control Panel Messages Document (CPMD)

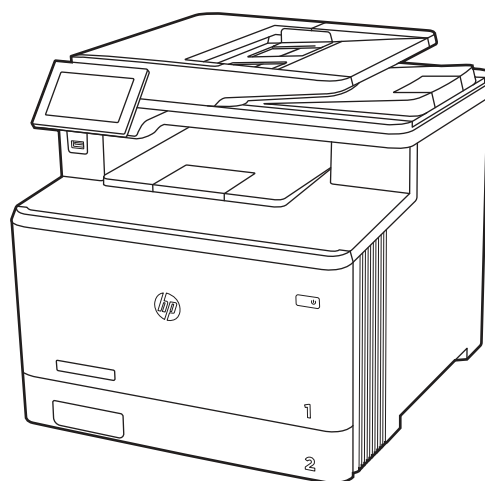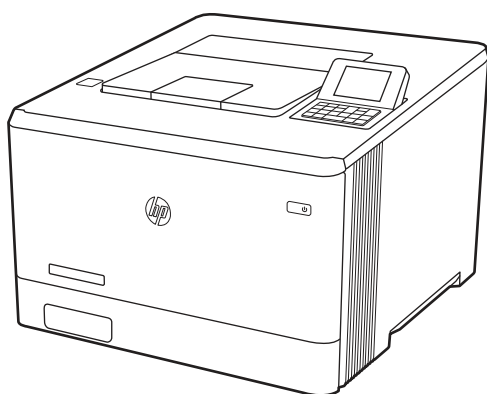

www.hp.com/support/colorljM455
www.hp.com/support/colorljM480MFP

www.hp.com/support/colorljE45028
www.hp.com/support/colorljE47528MFP



HP Color LaserJet M455, E45028, MFP M480, E47528 - Control panel messages document (CPMD)

SUMMARY

This document provides error-code troubleshooting information

Legal information

Copyright and License

© Copyright 2023 HP Development Company, L.P.

Reproduction, adaptation, or translation without prior written permission is prohibited, except as allowed under the copyright laws.

The information contained herein is subject to change without notice.

The only warranties for HP products and services are set forth in the express warranty statements accompanying such products and services. Nothing herein should be construed as constituting an additional warranty. HP shall not be liable for technical or editorial errors or omissions contained herein.

Edition 4, 8/2025

Trademark Credits

Adobe®, Adobe Photoshop®, Acrobat®, and PostScript® are trademarks of Adobe Systems Incorporated.

Apple and the Apple logo are trademarks of Apple Inc., registered in the U.S. and other countries.

macOS is a trademark of Apple Inc., registered in the U.S. and other countries.

AirPrint is a trademark of Apple Inc., registered in the U.S. and other countries.

Google™ is a trademark of Google Inc.

Microsoft®, Windows®, and Windows Server® are U.S. registered trademarks of Microsoft Corporation.

UNIX® is a registered trademark of The Open Group.

Table of contents

1 Document last updated	1
2 About this document	2
3 Control-panel message types	3
Error-code and control-panel-message troubleshooting overview	3
Error codes (types and structure)	3
4 How to search for printer documentation	6
WISE - How to access and use	6
Accessing WISE	6
Using WISE to search for error codes	10
Using WISE to access repair and replace videos for FRUs	12
5 Printer service information	17
6 Numerical control panel messages	18
10.WX.YZ error messages	18
10.00.00, 10.01.00, 10.02.00, 10.03.00 Supply problem	18
10.0x.0z Supply memory error	21
10.0x.10 or 10.0x.11 or 10.0x.12	25
10.00.30, 10.01.30, 10.02.30 or 10.03.30 Unauthorized <Color> supply	29
10.00.34, 10.01.34, 10.02.34, or 10.03.34, Used supply in use	29
10.00.57, 10.01.57, 10.02.57, 10.03.57 Protected <Color> supply installed	30
10.00.60, 10.01.60, 10.02.60, or 10.03.60, <Supply> low	30
10.00.69, 10.01.69, 10.02.69, or 10.03.69 <Supply> very low	33
10.00.70, 10.01.70, 10.02.70, 10.03.70 Printing past very low <Color> supply	35
11.WX.YZ error messages	38
11.* errors	38
11.00.01 or 11.00.02 Internal clock error	38
13.WX.YZ error messages	39
13.A3.D3 Paper is jam in Tray 3	39
13.B2.D1 Jam in Tray 1	47
13.B2.D2 Paper jam in Tray 2	60
13.B2.Dz Paper jam in rear door	67
13.B4.yz,13.B5.yz Paper jam in rear door	75
13.B9.Az	80
13.B9.Cz	84
13.B9.Dz	88
13.D1.Az	92
13.D1.Dz	96
13.D3.Az	101
13.D3.Dz	106
20.WX.YZ error messages	112

20.* errors	112
20.00.00 Insufficient memory <device>	112
21.WX.YZ error messages	112
21.* errors	112
30.WX.YZ error messages	113
30.01.08 Home position error	113
30.01.14 Scan system EEPROM error	114
30.01.41 Scanner error	115
30.01.43 Scanner error	117
30.01.44 Scanner error	118
30.01.46 Scanner error	120
30.03.14 Scanner error	121
30.03.20 Scanner error	122
30.03.22 Scanner failure	123
30.03.23 Scanner failure	125
30.03.30 Scanner Failure	126
30.03.45 Scanner Error To continue turn off then on	127
31.WX.YZ error messages	128
31.01.47 Document feeder not detected	128
31.03.14 Backside scanner EEPROM error	129
31.03.20 backside scanner not detected	130
31.03.22 Scanner calibration failure	132
31.03.31 Document feeder motor stall	133
31.13.01 Document feeder pick error	134
31.13.02 Jam in document feeder	144
32.WX.YZ error messages	153
32.* errors	153
32.08.A1, 32.08.A2, 32.08.A3	153
32.1C.05	153
32.1C.06 (event code)	153
32.1C.07 (event code)	154
32.1C.08 (event code)	154
32.1C.09 (event code)	154
32.1C.0A (event code)	154
32.1C.0D (event code)	155
32.1C.11 (event code)	155
32.1C.13, 32.1C.14	155
32.1C.15	155
32.1C.2E	155
32.1C.2F	156
32.1C.40	156
32.1C.41	156
32.1C.42	156
32.1C.43	156
32.1C.44	157
32.1C.45	157
32.1C.46	157
32.1C.47	157

32.1C.48	157
32.1C.49	158
32.1C.4A	158
32.1C.56	158
32.1C.57	158
32.1C.58	158
32.1C.60	159
32.1C.61	159
32.1C.62	159
32.1C.68	159
32.1C.69	159
32.1C.6A	160
32.1C.6D	160
33.WX.YZ error messages	160
33.* errors.....	160
33.01.xx	162
33.02.01 Used board/disk installed	162
33.03.02	163
33.03.03 Incompatible formatter installed	163
33.04.05.....	164
33.05.0z SureStart errors	165
33.05.1x Whitelisting errors	166
33.05.2x Intrusion detection errors	167
33.05.5z Intrusion detection errors	168
40.WX.YZ error messages	168
40.* errors.....	168
40.00.01 USB I/O buffer overflow To continue, touch "OK"	169
40.00.02 Embedded I/O buffer overflow To continue, touch "OK"	169
40.00.03 EIO [x] buffer overflow To continue, touch "OK"	169
40.00.04 EIO [x] bad transmission To continue, touch "OK"	169
40.00.05 Embedded I/O bad transmission To continue, touch OK	170
40.08.0x USB storage accessory removed	170
41.WX.YZ error messages	170
41.* errors	170
41.01.YZ error.....	170
41.02.00 Error	172
41.03.01, 41.03.A1, 41.03.B1, 41.03.C1 Error	173
41.03.02, 41.03.A2, 41.03.B2, 41.03.C2 Error	175
41.03.03, 41.03.A3, 41.03.B3, 41.03.C3 Error	177
41.03.FZ Unknown Misprint Error	179
41.04.YZ Printer Error	180
41.07.Y2 Error To continue, touch "OK"	182
42.WX.YZ error messages	185
42.XX.YZ	185
42.B0.01 or 42.B0.02	186
44.WX.YZ error messages	187
44.* errors.....	187

44.01.xx Error Event log message	188
44.02.xx Error Event log message (Multifunction product only.).....	188
44.03.xx Error Event log message	188
44.04.xx Error Event log message (Multifunction product only.)	189
44.05.xx Error Event log message (Multifunction product only.)	189
44.07.xx Error Event log message (Multifunction product only.).....	189
44.08.xx Error Event log message (Multifunction product only.)	189
44.10.xx Error Event log message (Multifunction product only.).....	189
44.11.0E Error Event log message (Multifunction product only.).....	190
44.11.xx Error Event log message (Multifunction product only.).....	190
44.12.0E Error Event log message (Multifunction product only.).....	190
44.12.xx Error Event log message (Multifunction product only.).....	190
44.16.01 Error Event log message (Multifunction product only.).....	191
44.16.02 Error Event log message (Multifunction product only.).....	191
44.16.03 Error Event log message (Multifunction product only.).....	191
44.16.04 Error Event log message (Multifunction product only.).....	192
44.16.05 Error Event log message (Multifunction product only.).....	192
44.16.06 Error Event log message (Multifunction product only.).....	192
44.16.07 Error Event log message (Multifunction product only.).....	192
44.16.08 Error Event log message (Multifunction product only.).....	193
44.16.09 Error Event log message (Multifunction product only.).....	193
44.16.0A Error Event log message (Multifunction product only.)	193
44.16.0B Error Event log message (Multifunction product only.).....	193
44.16.0D Error Event log message (Multifunction product only.).....	194
44.16.0E Error Event log message (Multifunction product only.).....	194
44.16.0F Error Event log message (Multifunction product only.).....	194
44.16.10 Error Event log message (Multifunction product only.).....	194
44.16.FF Error Event log message (Multifunction product only.).....	195
44.34.xx Error Event log message	195
44.34.03 Fax Modem Failure	195
44.34.E5 Fax Modem Failure	196
44.92.YZ Error Event log message	197
44.90.xx, 44.91.xx, 44.92.xx Error Event log message	197
47.WX.YZ error messages.....	197
47.* errors.....	197
47.00.xx	198
47.01.xx	198
47.02.xx	199
47.03.xx	199
47.04.xx	200
47.05.xx	200
47.06.xx	201
48.WX.YZ error messages.....	201
48.* errors.....	201
49.WX.YZ error messages	202
49.XX.YY Error To continue turn off then on	202
50.WX.YZ error messages	203
50.* errors.....	203

50.1x.yz	204
50.2x.yz	205
50.3x.yz	207
50.4x.yz	208
50.6x.yz	209
50.7x.yz	211
50.8x.yz	214
50.9x.yz	216
50.Ax.yz	217
50.Bx.yz	219
51.WX.YZ error messages	221
51.* errors	221
51.00.10	221
52.WX.YZ error messages	222
52.* errors	222
52.XX.00	222
53.WX.YZ error messages	223
53.A0.y0	223
53.A0.y1	224
53.A1.y0 Enter error message	225
53.A1.y1	225
53.A2.y0	226
53.A2.y1	227
53.B0.0z	227
53.B1.0z	228
53.B2.0z	229
53.B3.0z	229
53.C1.0z Tray "Z" size mismatch.	229
54.WX.YZ error messages	230
54.* errors	230
54.00.01	231
54.00.06, 54.00.18, 54.00.19	232
54.14.00	233
54.00.15, 54.01.15, 54.02.15, or 54.03.15	233
54.0x.0B, 54.0x.0C, 54.0x.0D, or 54.0x.0E (Event log only)	235
54.05.07 or 54.06.07 or 54.07.07 or 54.08.07	236
54.21.00	236
54.0B.yz Event log only	237
54.0C.0z or 54.0D.0z	238
54.0F.00, 54.0F.01, 54.0F.02, or 54.0F.03 Event log only	240
55.WX.YZ error messages	241
55.* errors	241
55.00.00, 55.01.00, 55.30.00 or 55.40.00	241
55.00.05 Engine Firmware RFU Error	242
55.01.06 or 55.02.06	244
56.WX.YZ error messages	244
56.* errors	244

56.01.00	245
57.WX.YZ error messages.....	245
57.* errors.....	245
57.00.01 Fan failure	246
57.00.01 Fan failure	246
58.WX.YZ error messages.....	247
58.* errors.....	247
58.04.00	248
59.WX.YZ error messages.....	249
59.* errors.....	249
59.00.30 or 59.00.40 Fuser error	250
59.09.00 or 59.0A.00	251
59.00.C0 or 59.00.F0	252
59.5x.00 or 59.6x.00	253
59.0x.70 or 59.0x.80	254
60.WX.YZ error messages.....	255
60.* errors.....	255
60.00.02.....	256
60.00.03.....	257
62.WX.YZ error messages.....	258
62.00.00 To continue turn off then on.	258
70.WX.YZ error messages.....	258
70.* errors.....	258
80.WX.YZ, 81.WX.YZ error messages.....	259
80.* errors.....	259
80.0X.YY Embedded Jetdirect Error	261
81.09.00 Error	263
82.WX.YZ error messages.....	264
82.* errors.....	264
82.73.46, 82.73.47	267
98.WX.YZ error messages.....	267
98.* errors.....	267
98.00.01 or 98.01.00 Corrupt data in firmware volume	268
98.00.02 Corrupt data in the solutions volume	268
98.00.03 Corrupt data in the configuration volume	269
98.00.04 Corrupt data in the job data volume	270
99.WX.YZ error messages.....	270
99.* errors.....	270
99.00.01 Upgrade not performed file is corrupt	271
99.00.02 Upgrade not performed timeout during receive	271
99.00.03 Upgrade not performed error writing to disk	272
99.00.04 Upgrade not performed timeout during receive	273
99.00.05 Upgrade not performed timeout during receive	273
99.00.06 Upgrade not performed error reading upgrade	273
99.00.07 Upgrade not performed error reading upgrade	274
99.00.08 Upgrade not performed error reading upgrade	275

99.00.10 Upgrade canceled by user	276
99.00.11 Upgrade canceled by user	276
99.00.12 Upgrade not performed the file is invalid	276
99.00.13 Upgrade not performed the file is invalid	277
99.00.14 Upgrade not performed the file is invalid	277
99.00.2x	277
99.01.xx	278
99.02.01	278
99.02.09	279
99.09.61 Unsupported disk	279
99.09.62 Unknown disk	279
99.09.63 Incorrect disk	280
99.09.65 Disk data error	280

7 Alphabetical control panel messages..... 282

Alphabetical messages	282
Canceling...<jobname>	282
Wrong cartridges in slot	282
Cartridge Memory Error	282
Cartridge Memory Missing	285
Checking engine	289
Checking paper path	289
Cleaning	289
Close the cartridge access door	289
<Color> cartridge low	291
<Color> cartridge very low	291
Cooling device	292
Data received To print last page press "OK"	292
Device error. Press [OK] to continue	292
Device is busy. Tray again later	292
Document feeder jam. Clear and reload	293
Document feeder miss-pick. reload	302
Fax is busy. Canceled send	311
Fax line surge	311
Fax receive error	311
Fax send error	312
Fax storage is full. Canceling the fax send/receive	312
Genuine HP cartridge installed	313
Genuine HP supply installed	313
Incompatible supplies	313
Incompatible <Supply>	313
Initializing..	314
Insert or close Tray <X> to continue	314
Install <color> cartridge	314
Jam in output bin. Open rear door and clear jam	314
Jam in print paper path. Open rear door and clear jam	316
Jam in Tray 1. Clear the jam, and then press "OK"	320
Jam in Tray 2. Clear the jam, and then press "OK"	332
Jam in Tray 3. Clear the jam, and then press "OK"	340

Load Tray <X>: [Type], [Size] To use another tray, press "OK"	347
Manually feed output stack Then touch "OK" to print second side	347
Manually feed: <Type><Size>	348
Misprint. Press [OK] to continue.	348
No Dial tone	348
No Fax detected	349
No job to cancel	349
NON HP Supply Installed	349
Printer out of memory, job too big	350
Output Bin Full	350
Paused...	351
Printing Configuration...	351
Printing engine test...	351
Printing Event Log...	351
Printing File Directory...	351
Printing Font List...	352
Printing Help Page...	352
Printing Menu Map...	352
Printing Supplies Status Page...	352
Printing Usage Page...	352
Power Failure Recovery	352
Power supply malfunction.	353
Protected <COLOR> cartridge	353
Ready	353
Ready <IP Address>	353
Rear door open	354
Replace Supplies	355
Restore Factory Settings	355
Supplies low	356
Supply memory warning	356
System Main has Failed	356
Tray <X> empty: [Type], [Size]	358
Tray <X> lifting error	359
Tray <X> Overfilled	359
Type mismatch Tray <x>	359
Used or Counterfeit in Use	360
Used supply installed To continue, touch "OK" OR Used supply in use	360
Waiting for tray <x> to lift	360

Index	361
-------	-----

1 Document last updated

The following is the last time this document was updated:

Last update: August 4, 2025

2 About this document

This document provides error-code troubleshooting information.



IMPORTANT: Procedures and part numbers change. For current information, use the browser-based format.

Verify PDF is the most current before use. PDF part numbers must be verified with web-based error code information or parts look-up before parts are ordered.

Choose the format that best meets your needs.

Table 2-1 Content format types

Format	Document title example	Recommended use
Web-based	Go to: Product Detail page > Error Code Look-up	Quick access to individual web-based error code troubleshooting TIP: Save Product Detail page URL location in favorites
Web-Base	Go To: WISE default Search page > Enter [Product] and error code	- Access to individual web-based error code troubleshooting - Web-based: Most up-to-date information available
PDF	[Product] - Control Panel Message Document (CPMD) PDF	- Use when support portals are NOT accessible at time of service - Use when a printable document is needed NOTE: Always refer to the printer service manual for removal and replacement procedures NOTE: For current information, use the Web-based format.

3 Control-panel message types

The control-panel messages and event code entries indicate the current printer status or situations that might require action.



NOTE: Event log errors do not appear on the control-panel display. Open the event log to view or print the event log errors.

A control-panel message displays temporarily and might require you (or the applicable user) to acknowledge the message by touching the **OK** button to resume printing or by touching the **Stop** button to cancel the job.

With certain messages, the job might not finish printing, or the print quality might be affected. If the message is related to printing and the auto-continue feature is on, the printer will attempt to resume printing after the message has appeared for 10 seconds without acknowledgement.

For some messages, restarting the printer might fix the problem. If a critical error persists, the printer might require service.

Error-code and control-panel-message troubleshooting overview

This section provides information on error codes and searching for information.

Error codes (types and structure)

Error codes and control-panel messages display on the printer control panel to indicate the current printer status or situations that might require action. Error codes are numerical, or alphanumerical, and have a set structure with six characters (example: 13.WX.YZ).

- The first two characters are numeric and represent the system component that is causing the error. For example, in error code 10 . 22 . 15, **10** = **Supplies** for HP LaserJets.
- The remaining four characters (W, X, Y, and Z values) further define the error.

HP LaserJet and HP PageWide Enterprise error codes are documented in the control panel message document (CPMD) for each printer.

The CPMD is a comprehensive list of error codes, diagnostic and troubleshooting steps to clear or resolve the error, and other helpful information such as service mode pins and part numbers.

The CPMD is continually updated and republished with the latest information for the following error codes.

Table 3-1 ERROR CODES: The first two characters

Error code	System Component	System Error Description
10.WX.YZ	Supplies (LaserJet)	Supply error or supply memory error.
11.WX.YZ	Real-time clock	Internal error with the clock on the formatter.
13.WX.YZ	Jam (LaserJet)	Paper jam or open door jam error.

Table 3-1 ERROR CODES: The first two characters (continued)

Error code	System Component	System Error Description
15.WX.YZ	Jam (PageWide)	Paper jam or open door jam error.
17.WX.YZ	Supplies (PageWide)	Supply error or supply memory error.
20.WX.YZ	Printer memory	Insufficient memory or buffering error.
21.WX.YZ	Page	Page complexity causing a decompression error when trying to process job.
30.WX.YZ	Scanner	Flatbed scanner error occurring inside the unit.
31.WX.YZ	Document feeder	Document feeder, scanner, or jam error.
32.WX.YZ	Backup, restore, or reset	Backup, restore, or reset notification or error.
33.WX.YZ	Security	Backup, Disk, EFI BIOS, Firmware integrity (SureStart), or Trusted Platform Module (TPM) notification or error.
40.WX.YZ	Input/Output (I/O)	Partition manager, secure erase, or USB accessory error.
41.WX.YZ	Fuser, Laser scanner, or Paper path	Miscellaneous error including general and misprint or mismatch errors typically involving (but not limited to) the fuser, the laser scanner, or the paper path.
42.WX.YZ	Firmware	Firmware failure involving the Event Log, Shell, System Manager, or other component.
44.WX.YZ	Firmware	Firmware failure involving a digital sending component.
45.WX.YZ	OXPd/Web Kit (PageWide)	Informational notifications involving the OXPd Web Kit (communications log).
46.WX.YZ	Engine (LaserJet)	Engine communication error.
47.WX.YZ	Firmware	Job parser or printer calibration error.
48.WX.YZ	Firmware	PJA job accounting, job management, or job pipeline error.
49.WX.YZ	Firmware	Firmware communication error.
50.WX.YZ	Fuser (LaserJet)	Fuser error.
51.WX.YZ	Laser scanner (LaserJet)	Laser scanner beam error.
52.WX.YZ	Laser scanner (LaserJet)	Laser scanner startup error.
54.WX.YZ	Sensor	Sensor error (not jam related).
55.WX.YZ	DC controller (LaserJet)	DC controller communication error.
56.WX.YZ	Paper handling (LaserJet)	Paper input/output or accessory error.
57.WX.YZ	Fan	Fan error.
58.WX.YZ	Sensor	Engine sensor failure.
59.WX.YZ	Motor (LaserJet)	Motor error.
60.WX.YZ	Tray motor error (LaserJet)	Tray lifting or pick up error.
61.WX.YZ	Engine (PageWide)	Print engine error with the 8-bit data package.

Table 3-1 ERROR CODES: The first two characters (continued)

Error code	System Component	System Error Description
62.WX.YZ	System (LaserJet)	LaserJet internal system error.
	Print bar (PageWide)	PageWide print system error.
63.WX.YZ	Engine (LaserJet)	General engine error (electrical, communication, etc.).
65.WX.YZ	Connector	Output accessory connection error.
66.WX.YZ	Output accessory	Output accessory error.
67.WX.YZ	Input accessory	Input accessory connection error
69.WX.YZ	Duplexer	Duplexer error.
70.WX.YZ	DC controller (LaserJet)	DC controller firmware error.
76.WX.YZ	DC controller (LaserJet)	Power supply fluctuations causes formatter and DC controller communication issue and results them not to be in synchronization.
80.WX.YZ	Managed device	Embedded Jetdirect error.
81.WX.YZ	Near Field Communication (NFC)	Wireless, Bluetooth or internal EIO error.
82.WX.YZ	Memory (hard disk, EMMC, etc.)	Disk hardware error.
90.WX.YZ	Internal diagnostics	Internal test of systems (i.e. disk, CPB, display) or interconnection error.
98.WX.YZ	Hard disk	Hard disk partition error.
99.WX.YZ	Firmware installer	Remote Firmware Upgrade (RFU), firmware install (engine or accessory), or disk error.

4 How to search for printer documentation

The CPMD, error codes, and other support documentation for each printer is available on the HP portals.

For HP internal access to WISE, go to [WISE](#).

For HP channel partners access WISE, see [Accessing WISE for HP channel partners \(HP Partner Portal\) on page 6](#) or [Accessing WISE for HP channel partners \(CSDP\)](#).

WISE is available to call agents, service technicians, and HP internal users. The level of detail available depends on your access credentials. To learn how to find support content in WISE, [watch the video here](#).

WISE - How to access and use

Learn how to access and use Web-based Interactive Search Engines (WISE) to locate available support information. WISE is a repository of technical support documentation including service manuals, user guides, videos, and general support information.

Accessing WISE

Learn how to access Web-based Interactive Search Engines (WISE) if you are an HP channel partner or an internal HP user.

Accessing WISE for HP channel partners (HP Partner Portal)


Learn how to access WISE by accessing the HP Partner Portal if you are an HP Channel Partner.

 **NOTE:** If this is your first visit to the HP Partner Portal, you will be asked to create an account. Follow the setup directions using your HP Partner credentials.

 [View a video of how to access WISE for HP channel partners](#)


1. Sign-in to the HP Partner Portal (click <https://partner.hp.com> to access the sign-in page).

Figure 4-1 HP Partner Portal sign-in page

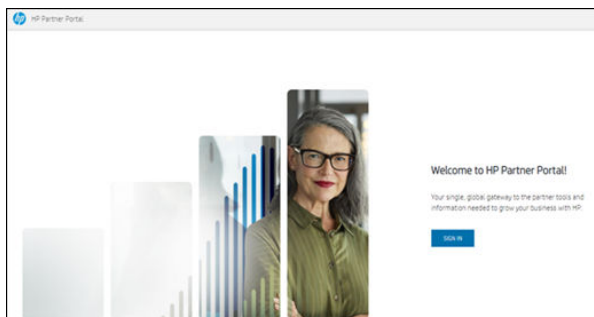


2. On the HP Partner Portal home page, click the **Services & Support** item.

Figure 4-2 HP Partner Portal home page

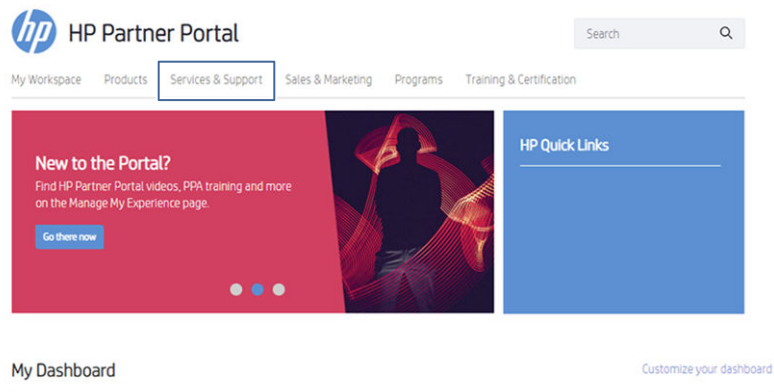


3. Select the **Technical Support (WISE)** item.

Figure 4-3 HP Partner Portal Service & Support page

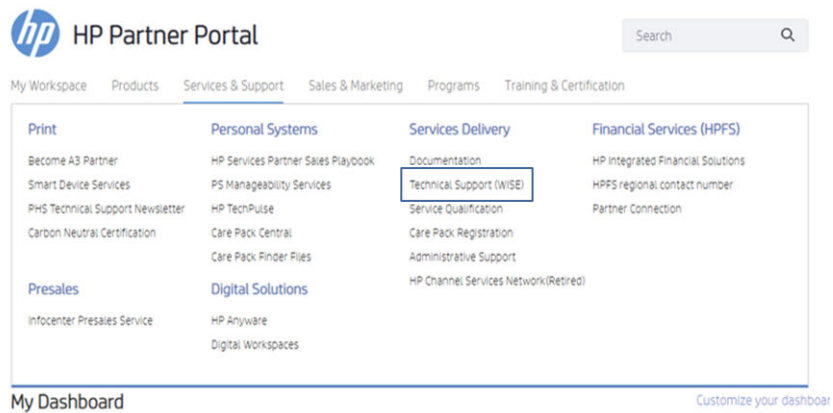


4. Select the **Technical Documentation** item.

Figure 4-4 HP Partner Portal Technical Support (WISE)page

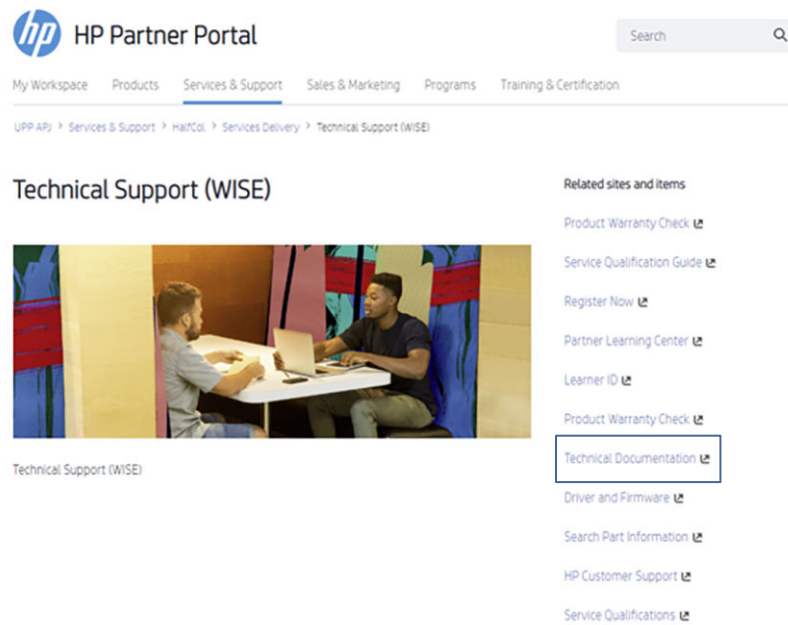

5. Use the WISE portal to search for printer information.

Figure 4-5 WISE portal home page

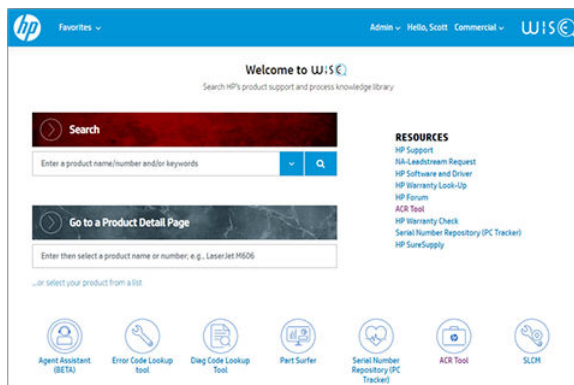

Accessing WISE for internal HP users

Learn how to access WISE if you are an internal HP user.

1. Open one of the Web-based Interactive Search Engines (WISE) URLs listed below.

Americas (AMS)

- [WISE - English](#)
- [WISE - Spanish](#)
- [WISE - Portuguese](#)
- [WISE - French](#)

Asia Pacific / Japan (APJ)


- [WISE - English](#)
- [WISE - Japanese](#)
- [WISE - Korean](#)
- [WISE - Chinese \(simplified\)](#)
- [WISE - Chinese \(traditional\)](#)
- [WISE - Thai](#)

Europe / Middle East / Africa (EMEA)


- [WISE - English](#)

2. Select **Commercial** from the drop-down menu.

Figure 4-6 Choose an experience

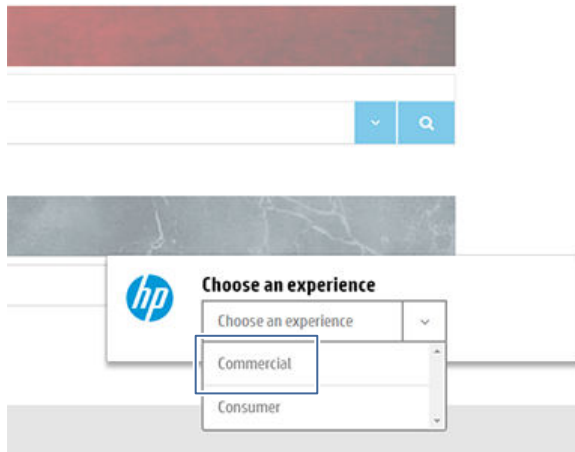

3. The WISE home page appears.

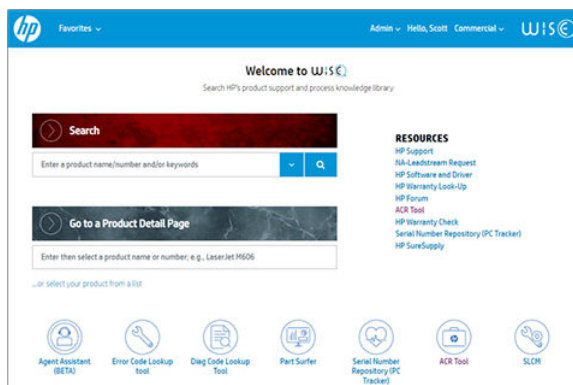

Play the video:



[View a video of how access WISE \(internal HP users\)](#)

Using WISE to search for error codes

Learn how to use WISE to look up error codes.



NOTE: The model used in the instructional videos is an example. The same steps apply to all printer models.

You will need the printer type (e.g. HP LaserJet), model number (e.g. M607), and bundle option (e.g. dn, dh, z).

Search for error codes using the lookup widget

Learn how to search for a specific error code using the WISE Error Code Lookup widget.

1. Enter a printer model number (for example, M606) in the **Go to a Product Detail page** dialog box.



TIP: To find a Product Detail Page (PDP) from a list of products by product type, select the **...or select your product from a list** item just below the dialog box.

2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.



NOTE: Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

3. Type the error code (for example, 13.E1.D3) in the **Error Code Lookup** field, and then select the search icon.

Error Code Lookup

Enter a specific error code in the field below, e.g. 13.b7 d7

1 2

Other Content

- Advisories (0)
- Bulletins (21)
- Guides, Manuals, etc. (76)
- Notices (1)
- Product Change Not... (0)
- Software-Drivers-F...
- Top Issues (7)
- Videos (127)

4. The error code troubleshooting content displays in the **All Search Results** area.

All Search Results

13.E1.D3 Fuser Area Jam
Last Modified Date: "2022/03/11"
ish_1686515-1408419-16
Public

Click on the article to see the full content.

Recommended action for customers

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size...

13.* errors
Last Modified Date: "2022/11/30"
ish_1690706-842345-16
Public

Click on the article to see the full content.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open....

HP LaserJet Enterprise M607, M608, M608nk, M609, M610, M611, M612, HP LaserJet Managed E60055-E60075, E60155-E60175 printers - Control Panel Messages Document (CPMD)
Last Modified Date: "2022/11/22"
pdf_3366820_en-US-6
For HP And Channel Partner Internal Use

Play the video:



[View a video of how to search for error codes using the Product Detail Page \(PDP\) or the Error Code Lookup tool.](#)

Search for error codes from the WISE home page

Learn how to search for a specific error code from the WISE home page.

1. On the WISE home page, enter a printer model number (for example, M606) in the **Search** dialog box.

Search

Enter a product name/number and/or keywords

Go to a Product Detail Page


Enter then select a product name or number; e.g., LaserJet M606

...or select your product from a list


2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.




NOTE: Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

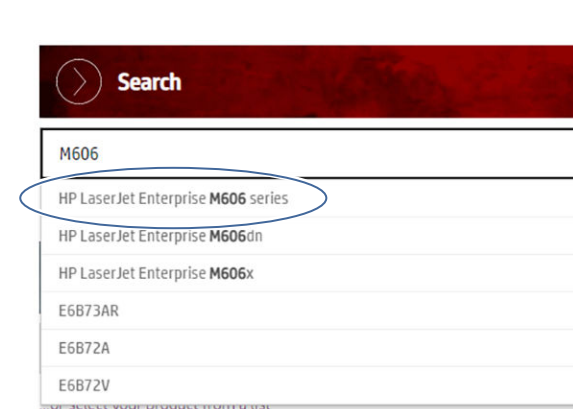

3. Type the error code (for example, 13.E1.D3) in the **Search** keyword field, and then select the search icon.

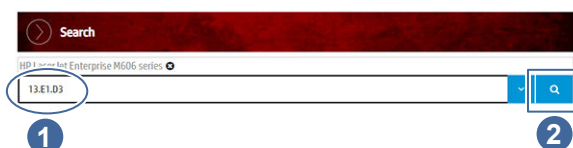

4. The error code troubleshooting content displays in the **All Search Results** area.

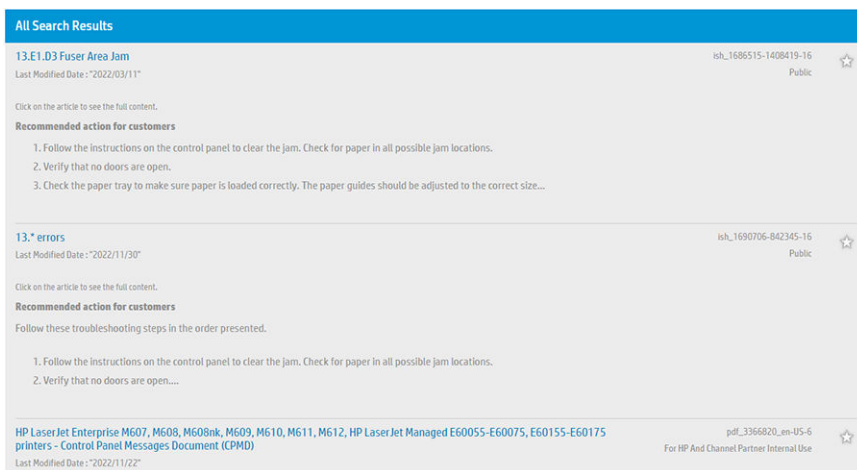

Using WISE to access repair and replace videos for FRUs

Learn how to use WISE to access repair and replace videos for FRUs.



NOTE: The model used in the instructional videos is an example. The same steps apply to all printer models.


You will need the printer type (e.g. HP LaserJet), model number (e.g. M607), and bundle option (e.g. dn, dh, z).

Search for videos using the Product Detail Page (PDP)

Learn how to search WISE for product specific information. Quickly review the steps and then play the video.


1. Enter a printer model number (for example, M606) in the **Go to a Product Detail page** dialog box.

 **TIP:** To find a Product Detail Page (PDP) from a list of products by product type, select the **...or select your product from a list** item just below the dialog box.

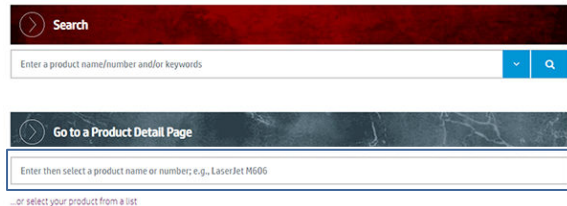


2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.

 **NOTE:** Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

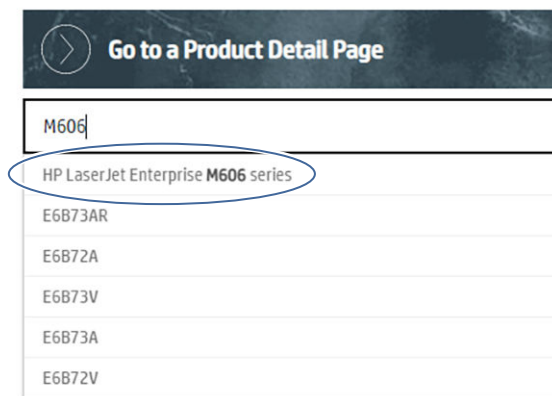


3. Select the link to **Videos** in the **Other Content** menu at the bottom-right of the screen.

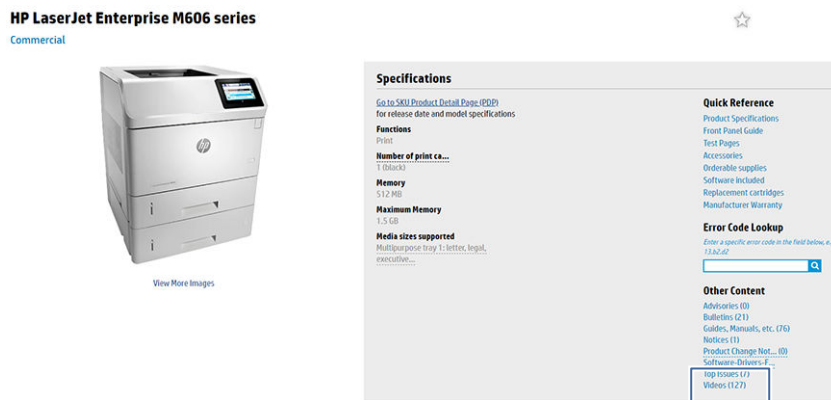

4. Select the desired video from the list of videos.



TIP: Select the **Add Or Remove Hardware & Customer Self Repair** filter under **Troubleshooting** to limit the search results to repair and replace videos.

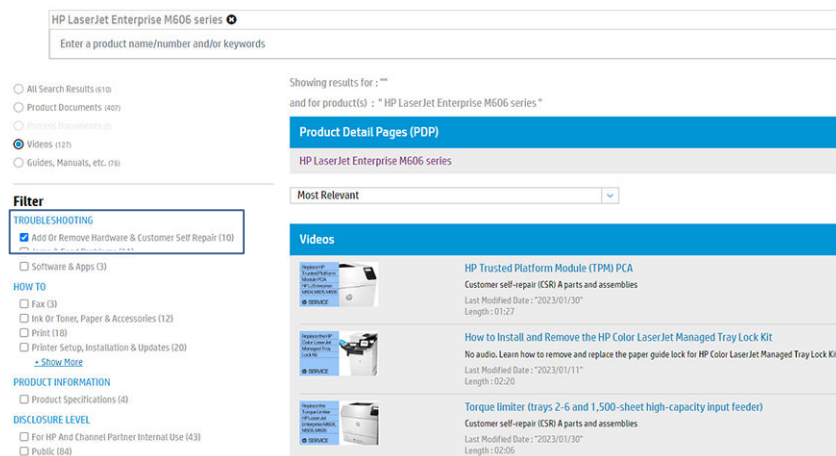

Play the video:




[View a video of how to search for the printer's Product Detail Page \(PDP\)](#)

Search for videos using the WISE search function


Learn how to search WISE using the model number. Quickly review the steps and then play the video.

1. On the WISE home page, enter a printer model number (for example, M606) in the **Search** dialog box.

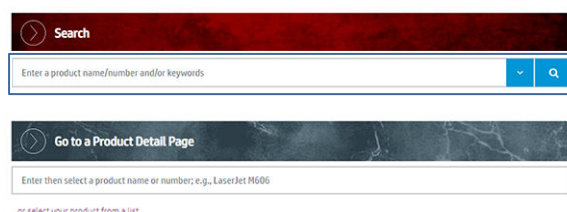


2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.


 **NOTE:** Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

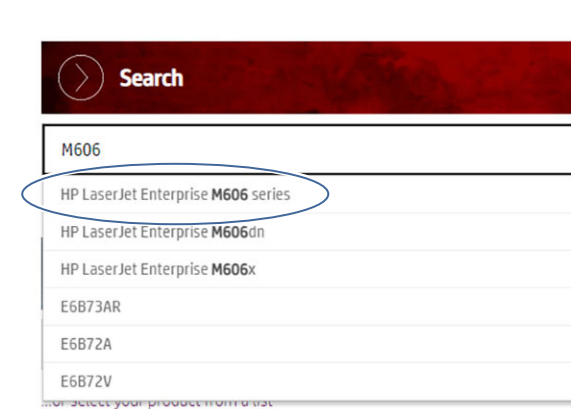

3. Select the search icon.

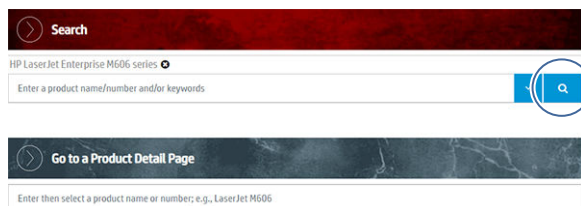

4. To refine the search results, select the radio button labeled **Videos** in the upper-right portion of the screen.

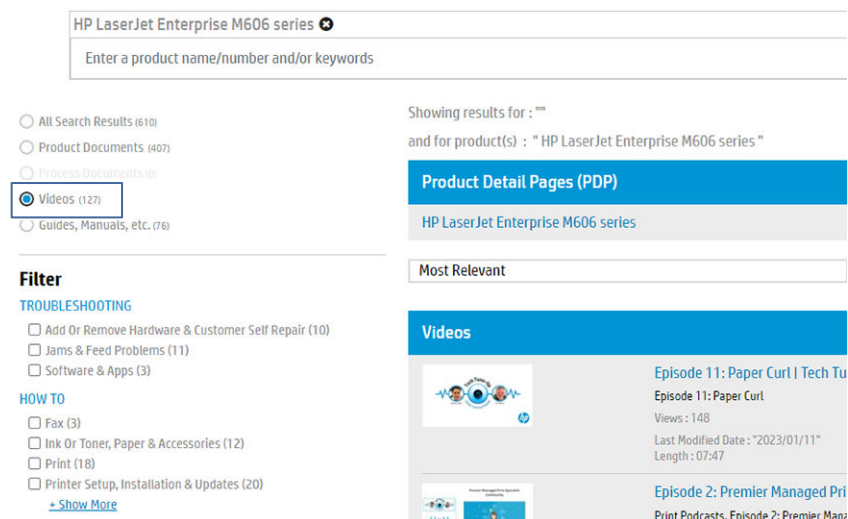

 **TIP:** To refine video search results, type a part name in the keyword search bar, and then select the search icon. For example, entering the word **fuser** to the keyword search bar returns videos related to repair and replacement of the fuser.

HP LaserJet Enterprise M606 series

Fuser

- ☐ All Search Results (34)
- ☐ Product Documents (28)
- ☐ Process Documents (0)
- ☒ Videos (2)
- ☐ Guides, Manuals, etc. (4)

Showing results for : "fuser"
and for product(s) : "HP LaserJet Enterprise M606 series"

Product Detail Pages (PDP)

HP LaserJet Enterprise M606 series

▼

Filter

TROUBLESHOOTING

- ☐ Add Or Remove Hardware & Customer Self Repair (1)
- ☐ Jams & Feed Problems (1)

DISCLOSURE LEVEL

- ☐ Public (2)

Videos

 Fuser jams HP LaserJet HP Fusion A4 Enterprise M606, M606 LBP NEW TO	Clear paper jams in the fuser area Clear paper jams Last Modified Date : "2022/08/03" Length : 01:51
 Replace the Fuser HP LaserJet Enterprise M606, M606 LBP NEW TO	Fuser No audio. Customer self-repair (CSR) A parts and assemblies. Last Modified Date : "2022/08/03" Length : 01:54

Play the video:



[View a video of how to perform a model number search](#)

5 Printer service information

The following information provides the document's last updated date and the printer service PIN.

Last update: August 4, 2025

Service mode PIN number:

M455, M480, E45028, E47528: 06045520



NOTE: When possible, always update the printer firmware to the latest available version at [HP.com](https://www.hp.com) as part of the troubleshooting performed for any of the following errors.

6 Numerical control panel messages

Use the following numerical error message troubleshooting to resolve your issue.

10.WX.YZ error messages

10.00.00, 10.01.00, 10.02.00, 10.03.00 Supply problem

The indicated supplies are not communicating correctly with the printer.

The printer is unable to authenticate the toner cartridge. The toner cartridge is detected but cannot be authenticated. When this error occurs, a question mark appears on the gas gauge of the supply or supplies with the error.”

If multiple supplies have this error, a 10.0X.00 error for the first supply detected with the error displays. After the user resolves the error that corresponds to the first supply, another 10.0X.00 error displays for the next supply. This continues for all supply memory errors.

- **10.00.00** Black toner cartridge
- **10.01.00** Cyan toner cartridge
- **10.02.00** Magenta toner cartridge
- **10.03.00** Yellow toner cartridge

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the front door and remove the toner cartridge causing the error.
2. Reinstall the toner cartridge.
3. Close the front door. If the message reappears, turn the printer off, and then on.
4. Verify if the cartridge is a genuine HP toner cartridge. To check the authenticity of your cartridges, go to hp.com/go/anticounterfeit and enter the serial number from the security label.



NOTE: This printer uses cartridges that have security chips or electronic circuitry. Cartridges using a non-HP chip or modified or non-HP circuitry may not work, and those that work today may not work in the future.

Non-HP Chips and modified or non-HP electronic circuitry are not produced or validated by HP. HP cannot guarantee that these chips or circuitry will work in your printer now or in the future. If you are using a non-original HP cartridge, please check with your supplier to ensure your cartridge has an original HP security chip or unmodified HP electronic circuitry.

5. If the error persists, and it is a genuine HP toner cartridge, contact HP customer care by phone for assistance in resolving the issue at: www.hp.com/go/contactHP.

6. If it is an aftermarket (non-hp) or re-manufactured toner cartridge, return the defective toner cartridge to the vendor where purchased.



NOTE: Service or repairs that are required as a result of using unsupported supplies is not covered under HP warranty.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: Do Not replace the engine control unit (ECU) or formatter for this issue. If the error persists after following the steps below, obtain the information requested in step 7, and then escalate the case to ATS.

1. Ensure the printer is turned on, and then open the front door to remove the toner cartridge that is in the error state.



NOTE: Toner cartridges that display a "10.0x11" or "**Supply Memory Error**" will continue to have this error if used in different printers.

Dispose or recycle the defective toner cartridge as these toner cartridges cannot be used in any printer.

2. Reinstall the toner cartridge.
3. Close the front door. If the message reappears, turn the printer off, and then on.
4. Verify if the cartridge is a genuine HP toner cartridge. To check the authenticity of the cartridges, go to hp.com/go/anticounterfeit or visit hp.com/go/ok and enter the serial number from the security label.

If authenticity cannot be verified, it might be a refilled or re-manufactured HP cartridge. Tell the customer to return the toner cartridge to the retailer or vendor where it was purchased and read the following statement:



NOTE: "This printer is enabled with dynamic security. It is intended to be used only with cartridges with an original HP chip. Cartridges using a non-HP chip might not work, and those that work today may not work in the future."

"Refilled or remanufactured supplies that still use an Original HP chip will continue to be accepted by the printer. If you are using a refilled or remanufactured cartridge and wish to continue to do so, then you should check with your toner cartridge supplier as to whether or not the cartridge has an Original HP chip."



NOTE: Service or repairs that are required as a result of using unsupported supplies is not covered under HP warranty.

5. If it is a genuine HP toner cartridge, replace the toner cartridge(s) in the error state with a new cartridge, and then close the cartridge door. Use the provided list to order the correct part number for the designated country/region when replacing the cartridge.



NOTE: Do not replace all the four toner cartridges. Make sure to replace only the affected toner cartridge.

Table 6-1 Toner cartridge part details

Part Number	Description	Region
W2020A	HP 414A Black LaserJet Toner Cartridge	ROW
W2021A	HP 414A Cyan LaserJet Toner Cartridge	ROW
W2022A	HP 414A Yellow LaserJet Toner Cartridge	ROW
W2023A	HP 414A Magenta LaserJet Toner Cartridge	ROW
W2020X	HP 414X Black LaserJet Toner Cartridge	ROW
W2021X	HP 414X Cyan LaserJet Toner Cartridge	ROW
W2022X	HP 414X Yellow LaserJet Toner Cartridge	ROW
W2023X	HP 414X Magenta LaserJet Toner Cartridge	ROW
W2030A	HP 415A Black LaserJet Toner Cartridge	EMEA
W2031A	HP 415A Cyan LaserJet Toner Cartridge	EMEA
W2032A	HP 415A Yellow LaserJet Toner Cartridge	EMEA
W2033A	HP 415A Magenta LaserJet Toner Cartridge	EMEA
W2030X	HP 415X Black LaserJet Toner Cartridge	EMEA
W2031X	HP 415X Cyan LaserJet Toner Cartridge	EMEA
W2032X	HP 415X Yellow LaserJet Toner Cartridge	EMEA
W2033X	HP 415X Magenta LaserJet Toner Cartridge	EMEA
W2040A	HP 416A Black LaserJet Toner Cartridge	APJ
W2041A	HP 416A Cyan LaserJet Toner Cartridge	APJ
W2042A	HP 416A Yellow LaserJet Toner Cartridge	APJ
W2043A	HP 416A Magenta LaserJet Toner Cartridge	APJ
W2040X	HP 416X Black LaserJet Toner Cartridge	APJ
W2041X	HP 416X Cyan LaserJet Toner Cartridge	APJ

Table 6-1 Toner cartridge part details (continued)

Part Number	Description	Region
W2042X	HP 416X Yellow LaserJet Toner Cartridge	APJ
W2043X	HP 416X Magenta LaserJet Toner Cartridge	APJ

6. Download the following firmware version for your printer model from [HP Support](#): 002.2118A
7. Wait for the firmware update to complete, and then print a Configuration Page.
8. On the Configuration Page, make sure that the firmware version installed is **002.2118A**.
9. Attempt to print and check if the issue persists.
10. If the issue persists, collect the following information and note it in a CDAX case:
 - a. Type "Supply memory error:10.0x.11" in the case subject.
 - b. Enter the error code and message displayed on the printer control panel.
 - c. Obtain pictures of the cartridge and with the electrical contact. Attach the pictures in the CDAX case.
 - d. Check for defect on the electrical contact of the toner and printer.
 - e. Check whether the toner used is an HP genuine toner.
 - f. Ask the customer to provide answers to the following questions:
 - i. When did the issue begin/start, OOB? While printing or when idle?
 - ii. Was there any preceding error or defect prior to this issue?
 - iii. Were there any parts replaced or software updates prior to this error?
 - iv. Was the cartridge used in multiple printers?
 - v. Did this issue happen on set-up cartridge or after market cartridge (trade)?
11. Ensure the information in the CDAX case is valid, and then elevate the case to elevate the case using your Standard Support Process.

10 . 0x . 0z Supply memory error

The indicated supplies are not communicating correctly with the printer.

The printer is unable to authenticate the toner cartridge. The toner cartridge is detected but cannot be authenticated.

When this error occurs, a question mark appears on the gas gauge of the supply or supplies with the error.

If multiple supplies have this error, a 10.0x.0z error for the first supply detected with the error displays. After the user resolves the error that corresponds to the first supply, another 10.0z.0y error displays for the next supply. This continues for all supply memory errors.

10.0x.0z

x = Toner cartridge color.

- **0** - Black toner cartridge
- **1** - Cyan toner cartridge
- **2** - Magenta toner cartridge
- **3** - Yellow toner cartridge

z = error and can be any number from 1-3 or 5-8.

Examples:

- **10.00.01, 10.00.02, 10.00.05** Black toner cartridge
- **10.01.02, 10.01.03, 10.01.07** Cyan toner cartridge
- **10.02.02, 10.02.05, 10.02.06** Magenta toner cartridge
- **10.03.03, 10.03.05, 10.03.08** Yellow toner cartridge

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the front door and remove the toner cartridge causing the error.
2. Reinstall the toner cartridge.
3. Close the front door. If the message reappears, turn the printer off, and then on.
4. Verify if the cartridge is a genuine HP toner cartridge. To check the authenticity of your cartridges, go to hp.com/go/anticounterfeit and enter the serial number from the security label.



NOTE: This printer uses cartridges that have security chips or electronic circuitry. Cartridges using a non-HP chip or modified or non-HP circuitry may not work, and those that work today may not work in the future.

Non-HP Chips and modified or non-HP electronic circuitry are not produced or validated by HP. HP cannot guarantee that these chips or circuitry will work in your printer now or in the future. If you are using a non-original HP cartridge, please check with your supplier to ensure your cartridge has an original HP security chip or unmodified HP electronic circuitry.

5. If the error persists, and it is a genuine HP toner cartridge, contact HP customer care by phone for assistance in resolving the issue at: www.hp.com/go/contactHP.
6. If it is an aftermarket (non-hp) or re-manufactured toner cartridge, return the defective toner cartridge to the vendor where purchased.



NOTE: Service or repairs that are required as a result of using unsupported supplies is not covered under HP warranty.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

 **NOTE:** Do Not replace the engine control unit (ECU) or formatter for this issue. If the error persists after following the steps below, obtain the information requested in step 7, and then escalate the case to ATS.

1. Ensure the printer is turned on, and then open the front door to remove the toner cartridge that is in the error state.

 **NOTE:** Toner cartridges that display a "10.0x11" or "**Supply Memory Error**" will continue to have this error if used in different printers.

Dispose or recycle the defective toner cartridge as these toner cartridges cannot be used in any printer.

2. Reinstall the toner cartridge.
3. Close the front door. If the message reappears, turn the printer off, and then on.
4. Verify if the cartridge is a genuine HP toner cartridge. To check the authenticity of the cartridges, go to hp.com/go/antcounterfeit or visit hp.com/go/ok and enter the serial number from the security label.

If authenticity cannot be verified, it might be a refilled or re-manufactured HP cartridge. Tell the customer to return the toner cartridge to the retailer or vendor where it was purchased and read the following statement:

 **NOTE:** "This printer is enabled with dynamic security. It is intended to be used only with cartridges with an original HP chip. Cartridges using a non-HP chip might not work, and those that work today may not work in the future."

"Refilled or remanufactured supplies that still use an Original HP chip will continue to be accepted by the printer. If you are using a refilled or remanufactured cartridge and wish to continue to do so, then you should check with your toner cartridge supplier as to whether or not the cartridge has an Original HP chip."

 **NOTE:** Service or repairs that are required as a result of using unsupported supplies is not covered under HP warranty.

5. If it is a genuine HP toner cartridge, replace the toner cartridge(s) in the error state with a new cartridge, and then close the cartridge door. Use the provided list to order the correct part number for the designated country/region when replacing the cartridge.

 **NOTE:** Do not replace all the four toner cartridges. Make sure to replace only the affected toner cartridge.

Table 6-2 Toner cartridge part details

Part Number	Description	Region
W2020A	HP 414A Black LaserJet Toner Cartridge	ROW
W2021A	HP 414A Cyan LaserJet Toner Cartridge	ROW

Table 6-2 Toner cartridge part details (continued)

Part Number	Description	Region
W2022A	HP 414A Yellow LaserJet Toner Cartridge	ROW
W2023A	HP 414A Magenta LaserJet Toner Cartridge	ROW
W2020X	HP 414X Black LaserJet Toner Cartridge	ROW
W2021X	HP 414X Cyan LaserJet Toner Cartridge	ROW
W2022X	HP 414X Yellow LaserJet Toner Cartridge	ROW
W2023X	HP 414X Magenta LaserJet Toner Cartridge	ROW
W2030A	HP 415A Black LaserJet Toner Cartridge	EMEA
W2031A	HP 415A Cyan LaserJet Toner Cartridge	EMEA
W2032A	HP 415A Yellow LaserJet Toner Cartridge	EMEA
W2033A	HP 415A Magenta LaserJet Toner Cartridge	EMEA
W2030X	HP 415X Black LaserJet Toner Cartridge	EMEA
W2031X	HP 415X Cyan LaserJet Toner Cartridge	EMEA
W2032X	HP 415X Yellow LaserJet Toner Cartridge	EMEA
W2033X	HP 415X Magenta LaserJet Toner Cartridge	EMEA
W2040A	HP 416A Black LaserJet Toner Cartridge	APJ
W2041A	HP 416A Cyan LaserJet Toner Cartridge	APJ
W2042A	HP 416A Yellow LaserJet Toner Cartridge	APJ
W2043A	HP 416A Magenta LaserJet Toner Cartridge	APJ
W2040X	HP 416X Black LaserJet Toner Cartridge	APJ
W2041X	HP 416X Cyan LaserJet Toner Cartridge	APJ
W2042X	HP 416X Yellow LaserJet Toner Cartridge	APJ
W2043X	HP 416X Magenta LaserJet Toner Cartridge	APJ

6. Download the following firmware version for your printer model from [HP Support](#): 002.2118A
7. Wait for the firmware update to complete, and then print a Configuration Page.
8. On the Configuration Page, make sure that the firmware version installed is **002.2118A**.
9. Attempt to print and check if the issue persists.
10. If the issue persists, collect the following information and note it in a CDAX case:
 - a. Type "Supply memory error:10.0x.11" in the case subject.
 - b. Enter the error code and message displayed on the printer control panel.
 - c. Obtain pictures of the cartridge and with the electrical contact. Attach the pictures in the CDAX case.
 - d. Check for defect on the electrical contact of the toner and printer.
 - e. Check whether the toner used is an HP genuine toner.
 - f. Ask the customer to provide answers to the following questions:
 - i. When did the issue begin/start, OOB? While printing or when idle?
 - ii. Was there any preceding error or defect prior to this issue?
 - iii. Were there any parts replaced or software updates prior to this error?
 - iv. Was the cartridge used in multiple printers?
 - v. Did this issue happen on set-up cartridge or after market cartridge (trade)?
11. Ensure the information in the CDAX case is valid, and then elevate the case to elevate the case using your Standard Support Process.

10.0x.10 or 10.0x.11 or 10.0x.12

Toner cartridge supply memory error.

When this error occurs, a question mark appears on the gas gauge of the supply or supplies with the error.

- **10.00.10** or **10.00.11** or **10.00.12** Black toner cartridge
- **10.01.10** or **10.01.11** or **10.01.12** Cyan toner cartridge
- **10.02.10** or **10.02.11** or **10.02.12** Magenta toner cartridge
- **10.03.10** or **10.03.11** or **10.03.12** Yellow toner cartridge



IMPORTANT: The cause of this issue can be related to a firmware defect.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the front door and remove the toner cartridge causing the error.
2. Reinstall the toner cartridge.

3. Close the front door. If the message reappears, turn the printer off, and then on.
4. Verify if the cartridge is a genuine HP toner cartridge. To check the authenticity of your cartridges, go to hp.com/go/antcounterfeit and enter the serial number from the security label.



NOTE: This printer uses cartridges that have security chips or electronic circuitry. Cartridges using a non-HP chip or modified or non-HP circuitry may not work, and those that work today may not work in the future.

Non-HP Chips and modified or non-HP electronic circuitry are not produced or validated by HP. HP cannot guarantee that these chips or circuitry will work in your printer now or in the future. If you are using a non-original HP cartridge, please check with your supplier to ensure your cartridge has an original HP security chip or unmodified HP electronic circuitry.

5. If the error persists, and it is a genuine HP toner cartridge, contact HP customer care by phone for assistance in resolving the issue at: www.hp.com/go/contactHP.
6. If it is an aftermarket (non-hp) or re-manufactured toner cartridge, return the defective toner cartridge to the vendor where purchased.



NOTE: Service or repairs that are required as a result of using unsupported supplies is not covered under HP warranty.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: Do Not replace the engine control unit (ECU) or formatter for this issue. If the error persists after following the steps below, obtain the information requested in step 7, and then escalate the case to ATS.

1. Ensure the printer is turned on, and then open the front door to remove the toner cartridge that is in the error state.



NOTE: Toner cartridges that display a "10.0x.11" or "**Supply Memory Error**" will continue to have this error if used in different printers.

Dispose or recycle the defective toner cartridge as these toner cartridges cannot be used in any printer.

2. Reinstall the toner cartridge.
3. Close the front door. If the message reappears, turn the printer off, and then on.
4. Verify if the cartridge is a genuine HP toner cartridge. To check the authenticity of the cartridges, go to hp.com/go/antcounterfeit or visit hp.com/go/ok and enter the serial number from the security label.

If authenticity cannot be verified, it might be a refilled or re-manufactured HP cartridge. Tell the customer to return the toner cartridge to the retailer or vendor where it was purchased and read the following statement:



NOTE: "This printer is enabled with dynamic security. It is intended to be used only with cartridges with an original HP chip. Cartridges using a non-HP chip might not work, and those that work today may not work in the future."

"Refilled or remanufactured supplies that still use an Original HP chip will continue to be accepted by the printer. If you are using a refilled or remanufactured cartridge and wish to continue to do so, then you should check with your toner cartridge supplier as to whether or not the cartridge has an Original HP chip."

 **NOTE:** Service or repairs that are required as a result of using unsupported supplies is not covered under HP warranty.

5. If it is a genuine HP toner cartridge, replace the toner cartridge(s) in the error state with a new cartridge, and then close the cartridge door. Use the provided list to order the correct part number for the designated country/region when replacing the cartridge.

 **NOTE:** Do not replace all the four toner cartridges. Make sure to replace only the affected toner cartridge.

Table 6-3 Toner cartridge part details

Part Number	Description	Region
W2020A	HP 414A Black LaserJet Toner Cartridge	ROW
W2021A	HP 414A Cyan LaserJet Toner Cartridge	ROW
W2022A	HP 414A Yellow LaserJet Toner Cartridge	ROW
W2023A	HP 414A Magenta LaserJet Toner Cartridge	ROW
W2020X	HP 414X Black LaserJet Toner Cartridge	ROW
W2021X	HP 414X Cyan LaserJet Toner Cartridge	ROW
W2022X	HP 414X Yellow LaserJet Toner Cartridge	ROW
W2023X	HP 414X Magenta LaserJet Toner Cartridge	ROW
W2030A	HP 415A Black LaserJet Toner Cartridge	EMEA
W2031A	HP 415A Cyan LaserJet Toner Cartridge	EMEA
W2032A	HP 415A Yellow LaserJet Toner Cartridge	EMEA
W2033A	HP 415A Magenta LaserJet Toner Cartridge	EMEA
W2030X	HP 415X Black LaserJet Toner Cartridge	EMEA
W2031X	HP 415X Cyan LaserJet Toner Cartridge	EMEA
W2032X	HP 415X Yellow LaserJet Toner Cartridge	EMEA
W2033X	HP 415X Magenta LaserJet Toner Cartridge	EMEA

Table 6-3 Toner cartridge part details (continued)

Part Number	Description	Region
W2040A	HP 416A Black LaserJet Toner Cartridge	APJ
W2041A	HP 416A Cyan LaserJet Toner Cartridge	APJ
W2042A	HP 416A Yellow LaserJet Toner Cartridge	APJ
W2043A	HP 416A Magenta LaserJet Toner Cartridge	APJ
W2040X	HP 416X Black LaserJet Toner Cartridge	APJ
W2041X	HP 416X Cyan LaserJet Toner Cartridge	APJ
W2042X	HP 416X Yellow LaserJet Toner Cartridge	APJ
W2043X	HP 416X Magenta LaserJet Toner Cartridge	APJ

6. Download the following firmware version for your printer model from [HP Support](#): 002.2118A
7. Wait for the firmware update to complete, and then print a Configuration Page.
8. On the Configuration Page, make sure that the firmware version installed is **002.2118A**.
9. Attempt to print and check if the issue persists.
10. If the issue persists, collect the following information and note it in a CDAX case:
 - a. Type "Supply memory error:10.0x.11" in the case subject.
 - b. Enter the error code and message displayed on the printer control panel.
 - c. Obtain pictures of the cartridge and with the electrical contact. Attach the pictures in the CDAX case.
 - d. Check for defect on the electrical contact of the toner and printer.
 - e. Check whether the toner used is an HP genuine toner.
 - f. Ask the customer to provide answers to the following questions:
 - i. When did the issue begin/start, OOB? While printing or when idle?
 - ii. Was there any preceding error or defect prior to this issue?
 - iii. Were there any parts replaced or software updates prior to this error?
 - iv. Was the cartridge used in multiple printers?
 - v. Did this issue happen on set-up cartridge or after market cartridge (trade)?
11. Ensure the information in the CDAX case is valid, and then elevate the case to elevate the case using your Standard Support Process.

10.00.30, 10.01.30, 10.02.30 or 10.03.30 Unauthorized <Color> supply

A used or non-HP toner cartridge has been detected while Cartridge Policy is set to Authorized HP.

Unauthorized Cartridge (Admin configures printer to only accept HP cartridges).

- **10.00.30** Black toner cartridge
- **10.01.30** Cyan toner cartridge
- **10.02.30** Magenta toner cartridge
- **10.03.30** Yellow toner cartridge

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Install a genuine HP toner cartridge in the corresponding slot.
2. If a genuine HP toner cartridge is installed, validate the authenticity of your cartridges, go to hp.com/go/anticounterfeit or visit hp.com/go/ok and enter the serial number from the security label.
3. If the error persists, and it is a genuine HP toner cartridge, contact HP customer care by phone for assistance in resolving the issue. Use the following link to contact the correct support center by region.

Recommended action onsite technician

Follow these troubleshooting steps in the order presented.

1. If the user is the administrator and no longer wants the setting to be configured, change the **Cartridge Policy** to **Off** or replace the cartridge to continue printing.
2. Install a genuine HP toner cartridge in the corresponding slot.
3. If a genuine HP toner cartridge is installed, validate the authenticity of your cartridges, go to hp.com/go/anticounterfeit or visit hp.com/go/ok and enter the serial number from the security label.
4. If the error persists, and it is a genuine HP toner cartridge, replace the toner cartridge.

 **NOTE:** Do not replace all the four toner cartridges. Make sure to replace only the affected toner cartridge.

 **IMPORTANT:** See the AGENT troubleshooting steps for part numbers:

Ensure you select the correct model and toner cartridge from the below tables.

5. If the error persists with a new toner cartridge, elevate the case using your Standard Support Process.

10.00.34, 10.01.34, 10.02.34, or 10.03.34, Used supply in use

The toner cartridge is used.

- **10.00.34** (event code) Black toner cartridge

- **10.01.34** (event code) Cyan toner cartridge
- **10.02.34** (event code) Magenta toner cartridge
- **10.03.34** (event code) Yellow toner cartridge

Recommended action

Follow these troubleshooting steps in the order presented.

- If you believe this is a genuine HP supply, go to www.hp.com/go/anticounterfeit.



NOTE: Removing a cartridge from one printer and then installing it in a different printer (for testing functionality) will cause this event code.

10.00.57, 10.01.57, 10.02.57, 10.03.57 Protected <Color> supply installed

A protected toner cartridge is installed.

The printer indicates when the supplies in use are protected for anti-theft.

- **10.00.57** Black toner cartridge
- **10.01.57** Cyan toner cartridge
- **10.02.57** Magenta toner cartridge
- **10.03.57** Yellow toner cartridge

Recommended action

There is no action needed for this message.

- No action necessary.

10.00.60, 10.01.60, 10.02.60, or 10.03.60, <Supply> low

The printer indicates when a supply level is low. Actual toner cartridge life might vary. You do not need to replace the toner cartridge at this time unless print quality is no longer acceptable.

The 10.OX.60 is an event log only message, it will not show on the control panel. The only message to display will be <Supply> low.

- **10.00.60** Black toner cartridge (event code)
- **10.01.60** Cyan toner cartridge (event code)
- **10.02.60** Magenta toner cartridge (event code)
- **10.03.60** Yellow toner cartridge (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

- If the print quality is no longer acceptable, replace the toner cartridge.



NOTE: HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

Table 6-4 Toner Cartridges

Item	Description	Part number (service)	Product number (new)
Toner cartridge	HP 414A Black Original LaserJet Toner Cartridge	W2020-67901	W2020A
Toner cartridge	HP 414X High Yield Black Original LaserJet Toner Cartridge	W2020-67902	W2020X
Toner cartridge	HP 414X High Yield (Contract) Black Original LaserJet Toner Cartridge	W2020-67903	W2020XC
Toner cartridge	HP 414A Cyan Original LaserJet Toner Cartridge	W2021-67901	W2021A
Toner cartridge	HP 414X High Yield Cyan Original LaserJet Toner Cartridge	W2021-67902	W2021X
Toner cartridge	HP 414X High Yield (Contract) Cyan Original LaserJet Toner Cartridge	W2021-67903	W2021XC
Toner cartridge	HP 414A Yellow Original LaserJet Toner Cartridge	W2022-67901	W2022A
Toner cartridge	HP 414X High Yield Yellow Original LaserJet Toner Cartridge	W2022-67902	W2022X
Toner cartridge	HP 414X High Yield (Contract) Yellow Original LaserJet Toner Cartridge	W2022-67903	W2022XC
Toner cartridge	HP 414A Magenta Original LaserJet Toner Cartridge	W2023-67901	W2023A
Toner cartridge	HP 414X High Yield Magenta Original LaserJet Toner Cartridge	W2023-67902	W2023X
Toner cartridge	HP 414X High Yield (Contract) Magenta Original LaserJet Toner Cartridge	W2023-67903	W2023XC
Toner cartridge	HP 415A Black Original LaserJet Toner Cartridge	W2030-67901	W2030A
Toner cartridge	HP 415X High Yield Black Original LaserJet Toner Cartridge	W2030-67902	W2030X
Toner cartridge	HP 415X High Yield (Contract) Black Original LaserJet Toner Cartridge	W2030-67903	W2030XC
Toner cartridge	HP 415A Cyan Original LaserJet Toner Cartridge	W2031-67901	W2031A

Table 6-4 Toner Cartridges (continued)

Item	Description	Part number (service)	Product number (new)
Toner cartridge	HP 415X High Yield Cyan Original LaserJet Toner Cartridge	W2031-67902	W2031X
Toner cartridge	HP 415X High Yield (Contract) Cyan Original LaserJet Toner Cartridge	W2031-67903	W2031XC
Toner cartridge	HP 415A Yellow Original LaserJet Toner Cartridge	W2032-67901	W2032A
Toner cartridge	HP 415X High Yield Yellow Original LaserJet Toner Cartridge	W2032-67902	W2032X
Toner cartridge	HP 415X High Yield (Contract) Yellow Original LaserJet Toner Cartridge	W2032-67903	W2032XC
Toner cartridge	HP 415A Magenta Original LaserJet Toner Cartridge	W2033-67901	W2033A
Toner cartridge	HP 415X High Yield Magenta Original LaserJet Toner Cartridge	W2033-67902	W2033X
Toner cartridge	HP 415X High Yield (Contract) Magenta Original LaserJet Toner Cartridge	W2033-67903	W2033XC
Toner cartridge	HP 416A Black Original LaserJet Toner Cartridge	W2040-67901	W2040A
Toner cartridge	HP 416X High Yield Black Original LaserJet Toner Cartridge	W2040-67902	W2040X
Toner cartridge	HP 416X High Yield (Contract) Black Original LaserJet Toner Cartridge	W2040-67903	W2040XC
Toner cartridge	HP 416A Cyan Original LaserJet Toner Cartridge	W2041-67901	W2041A
Toner cartridge	HP 416X High Yield Cyan Original LaserJet Toner Cartridge	W2041-67902	W2041X
Toner cartridge	HP 416X High Yield (Contract) Cyan Original LaserJet Toner Cartridge	W2041-67903	W2041XC
Toner cartridge	HP 416A Yellow Original LaserJet Toner Cartridge	W2042-67901	W2042A
Toner cartridge	HP 416X High Yield Yellow Original LaserJet Toner Cartridge	W2042-67902	W2042X
Toner cartridge	HP 416X High Yield (Contract) Yellow Original LaserJet Toner Cartridge	W2042-67903	W2042XC
Toner cartridge	HP 416A Magenta Original LaserJet Toner Cartridge	W2043-67901	W2043A

Table 6-4 Toner Cartridges (continued)

Item	Description	Part number (service)	Product number (new)
Toner cartridge	HP 416X High Yield Magenta Original LaserJet Toner Cartridge	W2043-67902	W2043X
Toner cartridge	HP 416X High Yield (Contract) Magenta Original LaserJet Toner Cartridge	W2043-67903	W2043XC

10.00.69, 10.01.69, 10.02.69, or 10.03.69 <Supply> very low

The printer indicates when a supply level is very low. Actual toner cartridge life might vary. You do not need to replace the toner cartridge at this time unless the print quality is no longer acceptable.

The 10.0x.69 is an event log only message, it will not show on the control panel. The only message to display will be <Supply> very low.

- **10.00.69** Black toner cartridge very low (event code)
- **10.01.69** Cyan toner cartridge very low (event code)
- **10.02.69** Magenta toner cartridge very low (event code)
- **10.03.69** Yellow toner cartridge very low (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

- If the print quality is no longer acceptable, replace the toner cartridge.



NOTE: HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

Table 6-5 Toner Cartridges

Item	Description	Part number (service)	Product number (new)
Toner cartridge	HP 414A Black Original LaserJet Toner Cartridge	W2020-67901	W2020A
Toner cartridge	HP 414X High Yield Black Original LaserJet Toner Cartridge	W2020-67902	W2020X
Toner cartridge	HP 414X High Yield (Contract) Black Original LaserJet Toner Cartridge	W2020-67903	W2020XC
Toner cartridge	HP 414A Cyan Original LaserJet Toner Cartridge	W2021-67901	W2021A
Toner cartridge	HP 414X High Yield Cyan Original LaserJet Toner Cartridge	W2021-67902	W2021X
Toner cartridge	HP 414X High Yield (Contract) Cyan Original LaserJet Toner Cartridge	W2021-67903	W2021XC

Table 6-5 Toner Cartridges (continued)

Item	Description	Part number (service)	Product number (new)
Toner cartridge	HP 414A Yellow Original LaserJet Toner Cartridge	W2022-67901	W2022A
Toner cartridge	HP 414X High Yield Yellow Original LaserJet Toner Cartridge	W2022-67902	W2022X
Toner cartridge	HP 414X High Yield (Contract) Yellow Original LaserJet Toner Cartridge	W2022-67903	W2022XC
Toner cartridge	HP 414A Magenta Original LaserJet Toner Cartridge	W2023-67901	W2023A
Toner cartridge	HP 414X High Yield Magenta Original LaserJet Toner Cartridge	W2023-67902	W2023X
Toner cartridge	HP 414X High Yield (Contract) Magenta Original LaserJet Toner Cartridge	W2023-67903	W2023XC
Toner cartridge	HP 415A Black Original LaserJet Toner Cartridge	W2030-67901	W2030A
Toner cartridge	HP 415X High Yield Black Original LaserJet Toner Cartridge	W2030-67902	W2030X
Toner cartridge	HP 415X High Yield (Contract) Black Original LaserJet Toner Cartridge	W2030-67903	W2030XC
Toner cartridge	HP 415A Cyan Original LaserJet Toner Cartridge	W2031-67901	W2031A
Toner cartridge	HP 415X High Yield Cyan Original LaserJet Toner Cartridge	W2031-67902	W2031X
Toner cartridge	HP 415X High Yield (Contract) Cyan Original LaserJet Toner Cartridge	W2031-67903	W2031XC
Toner cartridge	HP 415A Yellow Original LaserJet Toner Cartridge	W2032-67901	W2032A
Toner cartridge	HP 415X High Yield Yellow Original LaserJet Toner Cartridge	W2032-67902	W2032X
Toner cartridge	HP 415X High Yield (Contract) Yellow Original LaserJet Toner Cartridge	W2032-67903	W2032XC
Toner cartridge	HP 415A Magenta Original LaserJet Toner Cartridge	W2033-67901	W2033A
Toner cartridge	HP 415X High Yield Magenta Original LaserJet Toner Cartridge	W2033-67902	W2033X
Toner cartridge	HP 415X High Yield (Contract) Magenta Original LaserJet Toner Cartridge	W2033-67903	W2033XC

Table 6-5 Toner Cartridges (continued)

Item	Description	Part number (service)	Product number (new)
Toner cartridge	HP 416A Black Original LaserJet Toner Cartridge	W2040-67901	W2040A
Toner cartridge	HP 416X High Yield Black Original LaserJet Toner Cartridge	W2040-67902	W2040X
Toner cartridge	HP 416X High Yield (Contract) Black Original LaserJet Toner Cartridge	W2040-67903	W2040XC
Toner cartridge	HP 416A Cyan Original LaserJet Toner Cartridge	W2041-67901	W2041A
Toner cartridge	HP 416X High Yield Cyan Original LaserJet Toner Cartridge	W2041-67902	W2041X
Toner cartridge	HP 416X High Yield (Contract) Cyan Original LaserJet Toner Cartridge	W2041-67903	W2041XC
Toner cartridge	HP 416A Yellow Original LaserJet Toner Cartridge	W2042-67901	W2042A
Toner cartridge	HP 416X High Yield Yellow Original LaserJet Toner Cartridge	W2042-67902	W2042X
Toner cartridge	HP 416X High Yield (Contract) Yellow Original LaserJet Toner Cartridge	W2042-67903	W2042XC
Toner cartridge	HP 416A Magenta Original LaserJet Toner Cartridge	W2043-67901	W2043A
Toner cartridge	HP 416X High Yield Magenta Original LaserJet Toner Cartridge	W2043-67902	W2043X
Toner cartridge	HP 416X High Yield (Contract) Magenta Original LaserJet Toner Cartridge	W2043-67903	W2043XC

10.00.70, 10.01.70, 10.02.70, 10.03.70 Printing past very low <Color> supply

The printer indicates when one of the supplies is printing past very low. The actual remaining supply life might vary.

The 10.0x.70 is an event log only message, it will not show on the control panel. The only message to display will be a warning message **<Supply> very low**.

- **10.00.70** Black toner cartridge (event code)
- **10.01.70** Cyan toner cartridge (event code)
- **10.02.70** Magenta toner cartridge (event code)
- **10.03.70** Yellow toner cartridge (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

- If the print quality is no longer acceptable, replace the toner cartridge.



NOTE: HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

Table 6-6 Toner Cartridges

Item	Description	Part number (service)	Product number (new)
Toner cartridge	HP 414A Black Original LaserJet Toner Cartridge	W2020-67901	W2020A
Toner cartridge	HP 414X High Yield Black Original LaserJet Toner Cartridge	W2020-67902	W2020X
Toner cartridge	HP 414X High Yield (Contract) Black Original LaserJet Toner Cartridge	W2020-67903	W2020XC
Toner cartridge	HP 414A Cyan Original LaserJet Toner Cartridge	W2021-67901	W2021A
Toner cartridge	HP 414X High Yield Cyan Original LaserJet Toner Cartridge	W2021-67902	W2021X
Toner cartridge	HP 414X High Yield (Contract) Cyan Original LaserJet Toner Cartridge	W2021-67903	W2021XC
Toner cartridge	HP 414A Yellow Original LaserJet Toner Cartridge	W2022-67901	W2022A
Toner cartridge	HP 414X High Yield Yellow Original LaserJet Toner Cartridge	W2022-67902	W2022X
Toner cartridge	HP 414X High Yield (Contract) Yellow Original LaserJet Toner Cartridge	W2022-67903	W2022XC
Toner cartridge	HP 414A Magenta Original LaserJet Toner Cartridge	W2023-67901	W2023A
Toner cartridge	HP 414X High Yield Magenta Original LaserJet Toner Cartridge	W2023-67902	W2023X
Toner cartridge	HP 414X High Yield (Contract) Magenta Original LaserJet Toner Cartridge	W2023-67903	W2023XC
Toner cartridge	HP 415A Black Original LaserJet Toner Cartridge	W2030-67901	W2030A
Toner cartridge	HP 415X High Yield Black Original LaserJet Toner Cartridge	W2030-67902	W2030X
Toner cartridge	HP 415X High Yield (Contract) Black Original LaserJet Toner Cartridge	W2030-67903	W2030XC

Table 6-6 Toner Cartridges (continued)

Item	Description	Part number (service)	Product number (new)
Toner cartridge	HP 415A Cyan Original LaserJet Toner Cartridge	W2031-67901	W2031A
Toner cartridge	HP 415X High Yield Cyan Original LaserJet Toner Cartridge	W2031-67902	W2031X
Toner cartridge	HP 415X High Yield (Contract) Cyan Original LaserJet Toner Cartridge	W2031-67903	W2031XC
Toner cartridge	HP 415A Yellow Original LaserJet Toner Cartridge	W2032-67901	W2032A
Toner cartridge	HP 415X High Yield Yellow Original LaserJet Toner Cartridge	W2032-67902	W2032X
Toner cartridge	HP 415X High Yield (Contract) Yellow Original LaserJet Toner Cartridge	W2032-67903	W2032XC
Toner cartridge	HP 415A Magenta Original LaserJet Toner Cartridge	W2033-67901	W2033A
Toner cartridge	HP 415X High Yield Magenta Original LaserJet Toner Cartridge	W2033-67902	W2033X
Toner cartridge	HP 415X High Yield (Contract) Magenta Original LaserJet Toner Cartridge	W2033-67903	W2033XC
Toner cartridge	HP 416A Black Original LaserJet Toner Cartridge	W2040-67901	W2040A
Toner cartridge	HP 416X High Yield Black Original LaserJet Toner Cartridge	W2040-67902	W2040X
Toner cartridge	HP 416X High Yield (Contract) Black Original LaserJet Toner Cartridge	W2040-67903	W2040XC
Toner cartridge	HP 416A Cyan Original LaserJet Toner Cartridge	W2041-67901	W2041A
Toner cartridge	HP 416X High Yield Cyan Original LaserJet Toner Cartridge	W2041-67902	W2041X
Toner cartridge	HP 416X High Yield (Contract) Cyan Original LaserJet Toner Cartridge	W2041-67903	W2041XC
Toner cartridge	HP 416A Yellow Original LaserJet Toner Cartridge	W2042-67901	W2042A
Toner cartridge	HP 416X High Yield Yellow Original LaserJet Toner Cartridge	W2042-67902	W2042X
Toner cartridge	HP 416X High Yield (Contract) Yellow Original LaserJet Toner Cartridge	W2042-67903	W2042XC

Table 6-6 Toner Cartridges (continued)

Item	Description	Part number (service)	Product number (new)
Toner cartridge	HP 416A Magenta Original LaserJet Toner Cartridge	W2043-67901	W2043A
Toner cartridge	HP 416X High Yield Magenta Original LaserJet Toner Cartridge	W2043-67902	W2043X
Toner cartridge	HP 416X High Yield (Contract) Magenta Original LaserJet Toner Cartridge	W2043-67903	W2043XC

11.WX.YZ error messages

11.* errors

Errors in the 11.* family are related to the printer real-time clock.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Set the time and date on the printer control panel.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Set the time and date on the printer control panel.
2. If the error persists, remove and reinstall the formatter. Make sure it is fully seated.
3. If the error still persists, replace the formatter.

11.00.01 or 11.00.02 Internal clock error

The printer real time clock has experienced an error.

01=dead clock

02=dead real time clock

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Whenever the printer is turned off and then turned on, set the time and date on the control panel.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Have the end-user turn the printer off, and then turned on, set the time and date on the control panel.
2. If the error persists, dispatch service to remove and reinstall the formatter and replace the formatter if needed.

Table 6-7 Part numbers

Description	Part number	Model numbers
Formatter (SFP)	3PZ95-67903	M455dn, E45028dn
Formatter (China/India; SFP)	3PZ95-67904	M455dn, E45028dn
Formatter (MFP)	3QA55-67901	M480f, E47528f
Formatter (China/India; MFP)	3QA55-67902	M480f, E47528f

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Have the end-user turn the printer off, and then turned on, set the time and date on the control panel.
2. If the error persists, dispatch service to remove and reinstall the formatter and replace the formatter if needed.

For instructions: *Removal and replacement: Formatter assembly* See the Repair Service Manual for this product.

Table 6-8 Part numbers

Description	Part number	Model numbers
Formatter (SFP)	3PZ95-67903	M455dn, E45028dn
Formatter (China/India; SFP)	3PZ95-67904	M455dn, E45028dn
Formatter (MFP)	3QA55-67901	M480f, E47528f
Formatter (China/India; MFP)	3QA55-67902	M480f, E47528f

13.WX.YZ error messages

13 . A3 . D3 Paper is jam in Tray 3

Paper jam when printing from tray 3.

Paper failed to reach the tray 3 feed sensor.

13.A3 jam error in tray 3


Use the following procedure to check for a paper jam in tray 3.

Recommended action for customers


When a jam occurs, the control panel displays a message and an animation that assists in clearing the jam.

- 13.A3.D3 - Jam in tray 3


1. Pull the tray completely out of the printer.

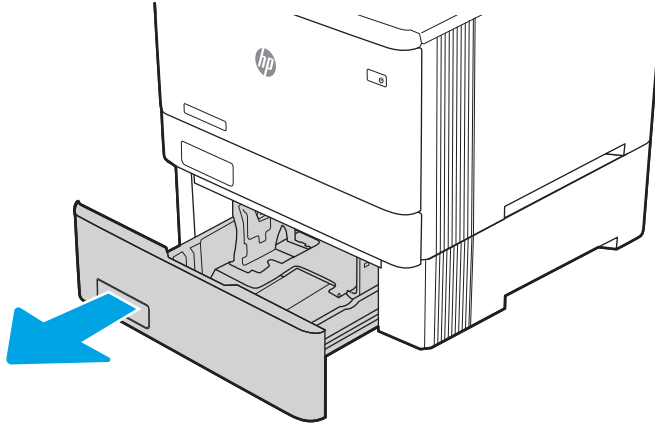

2. Remove any jammed or damaged sheets of paper.

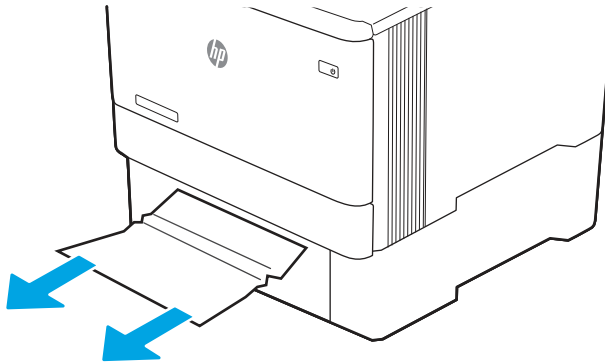


3. Reinsert and close Tray 3.

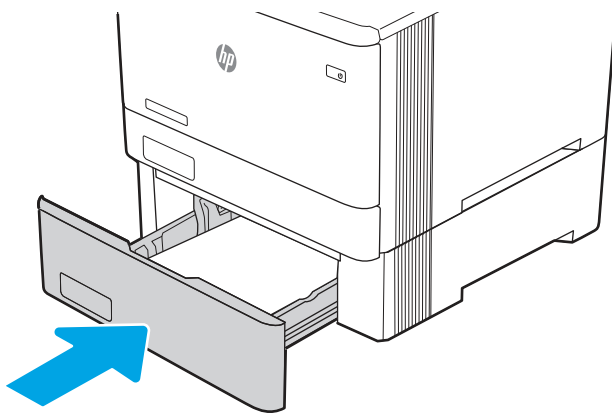


 **NOTE:** When reinserting the paper, make sure the paper guides are adjusted properly for the paper size.


4. Open the rear door and look for and clear any paper present or obstructions in the paper path.

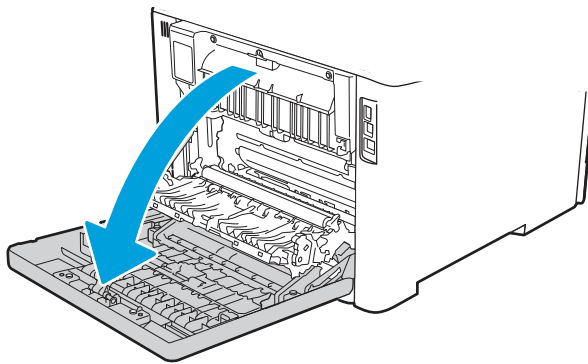

5. Check the following are for paper. Remove paper by gently pulling paper out.

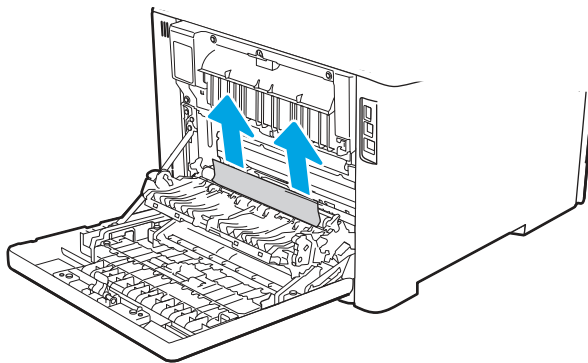

6. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab (line below 3 triangles). See following images.

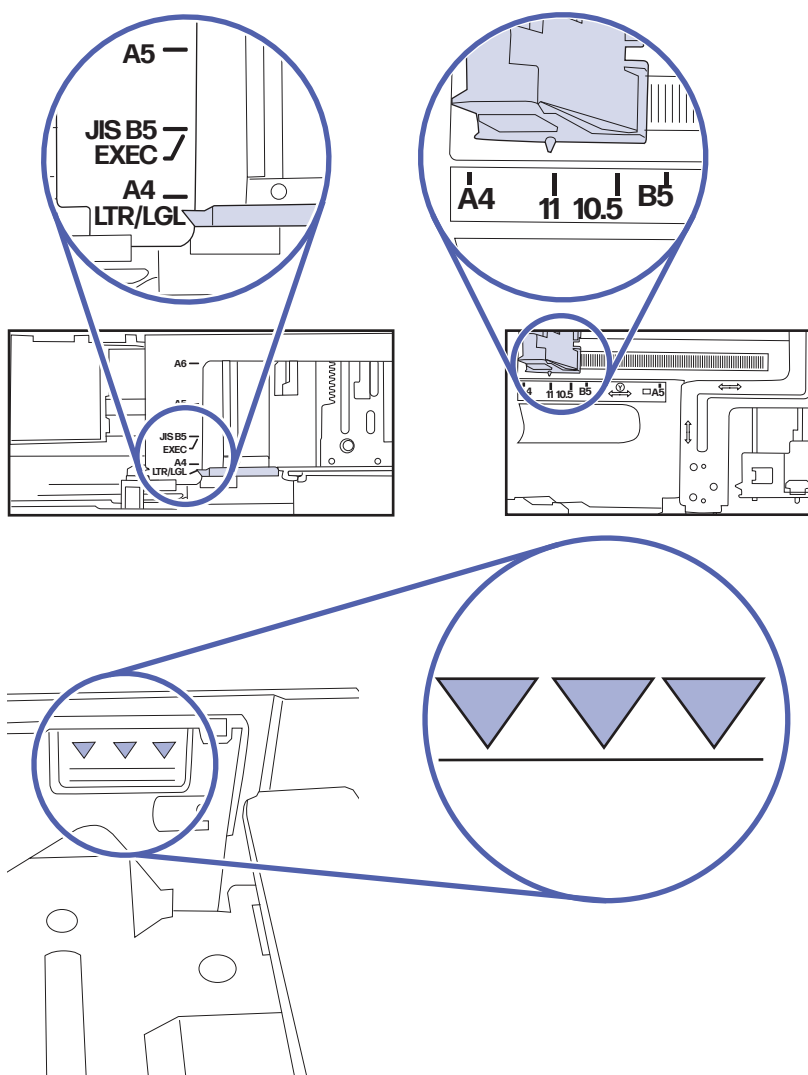


7. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
8. If the error persists, contact customer support at www.hp.com/go/contactHP, or contact an HP-authorized service or support provider.


Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.


1. Pull the tray completely out of the printer.

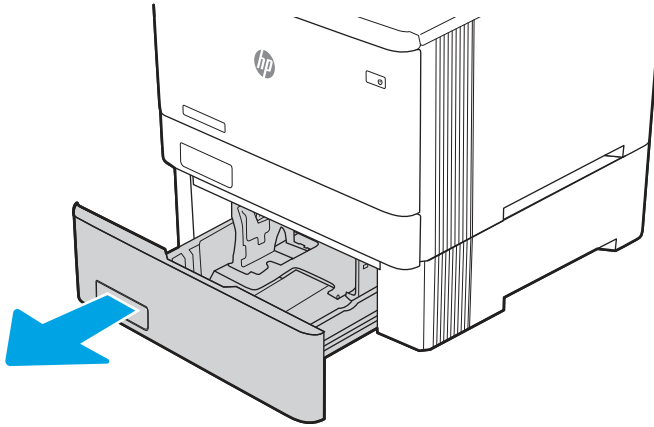

2. Remove any jammed or damaged sheets of paper.

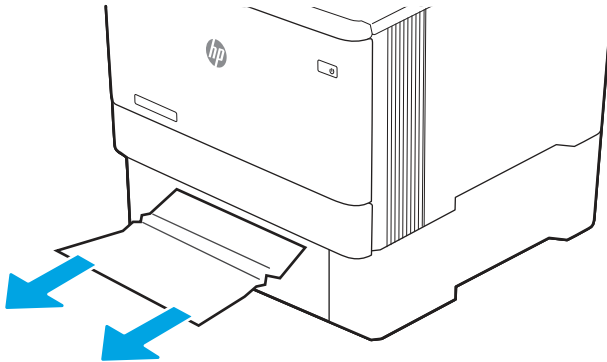

3. Reinsert and close Tray 3.

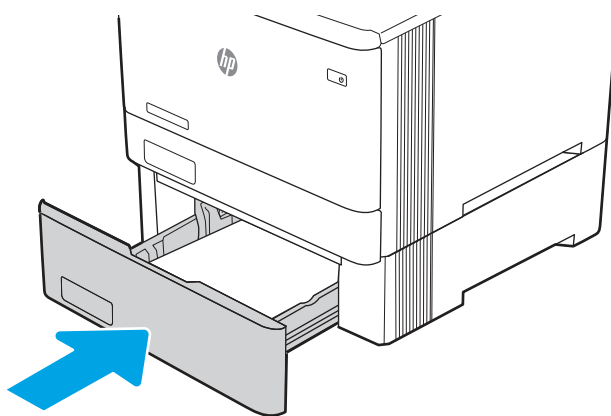

NOTE: When reinserting the paper, make sure the paper guides are adjusted properly for the paper size.

4. Open the rear door and look for and clear any paper present or obstructions in the paper path.



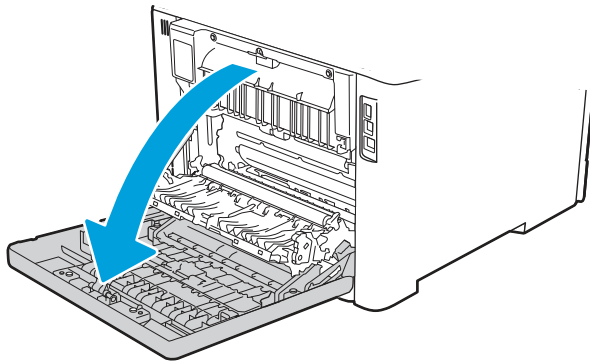


Figure 6-1 Clear Jam



5. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab (line below 3 triangles). See following images.

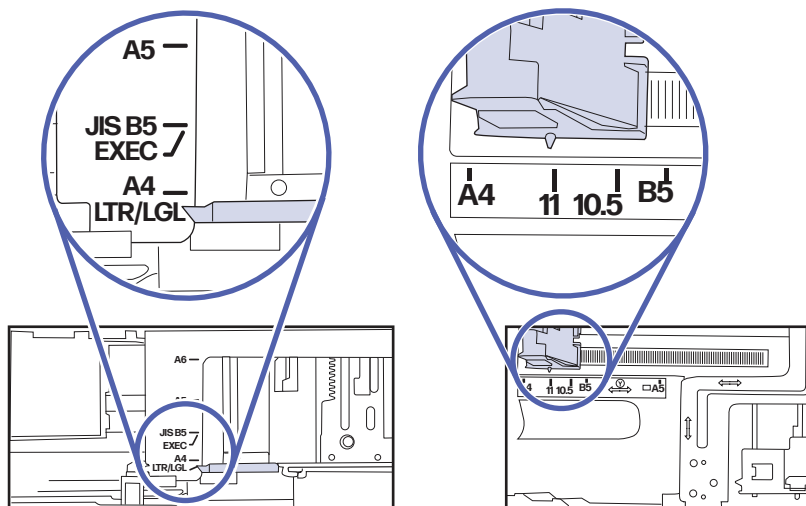

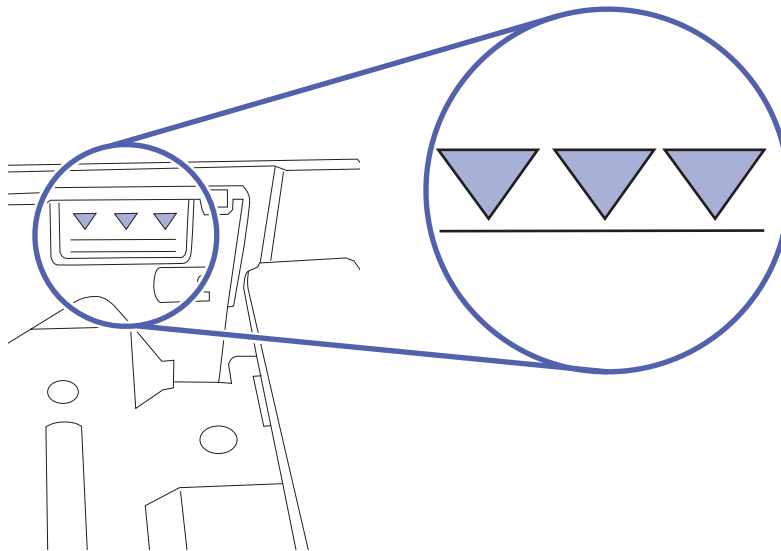

7. Ensure that the tray pickup, feed, and separation rollers are installed correctly and show no damage or wear.
8. Clean or replace the pickup, feed, and separation rollers as needed.
Roller, paper pickup assembly part number: RM2-5576-000CN
Roller, feed assembly part number: RM2-5577-000CN
Roller, separation part number: RM2-5881-000CN
9. If the jam persists, replace the Tray 3 Assembly.
Optional 550-sheet paper feeder part number: CF404-67901

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Pull the tray completely out of the printer.
2. Remove any jammed or damaged sheets of paper.
3. Reinsert and close Tray 3.



NOTE: When reinserting the paper, make sure the paper guides are adjusted properly for the paper size.

4. Open the rear door and look for and clear any paper present or obstructions in the paper path.



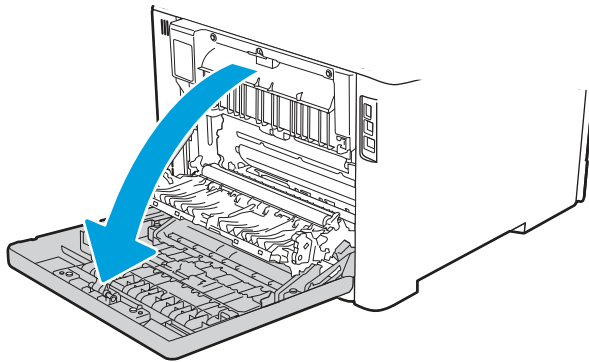


Figure 6-2 Clear Jam



5. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab (line below 3 triangles). See following images.

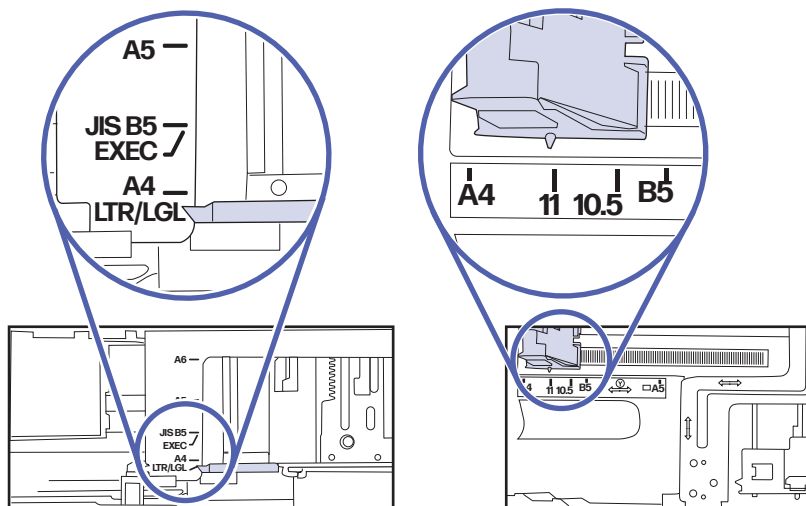

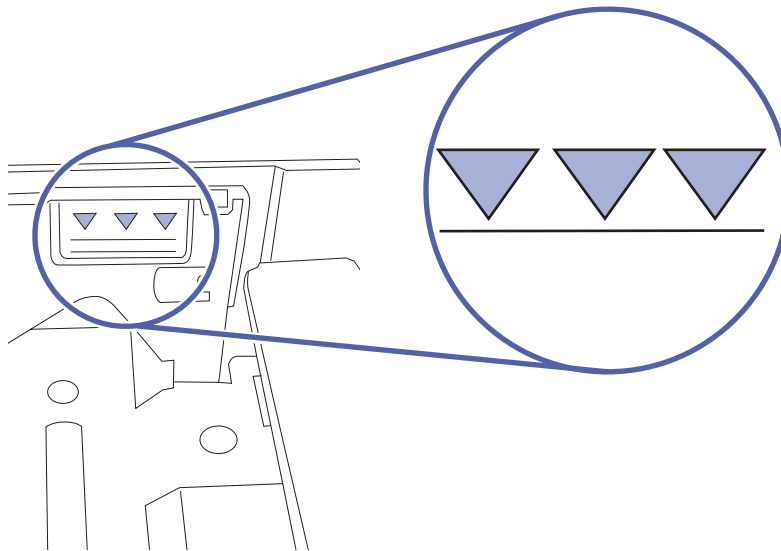

7. Ensure that the tray pickup, feed, and separation rollers are installed correctly and show no damage or wear.

8. Clean or replace the pickup, feed, and separation rollers as needed.

Roller, paper pickup assembly part number: RM2-5576-000CN

For Instructions: *Removal and replacement: 550 sheet feeder pickup assembly* See the Repair Service Manual for this product.

Roller, feed assembly part number: RM2-5577-000CN

Roller, separation part number: RM2-5881-000CN

9. If the jam persists, replace the Tray 3 assembly.

Optional 550-sheet paper feeder part number: CF404-67901

13 . B2 . D1 Jam in Tray 1

Paper jam when printing from tray 1.

Paper did not reach the registration sensor when printing from tray 1.

13.B2.D1 jam error in tray 1


Use the following procedure to clear paper jams in tray 1.

Recommended action for customers


When a jam occurs, the control panel displays a message and an animation that assists in clearing the jam.

- 13.B2.D1 Jam in tray 1


1. If you can see the jammed sheet in Tray 1, remove the jammed sheet by pulling it straight out.

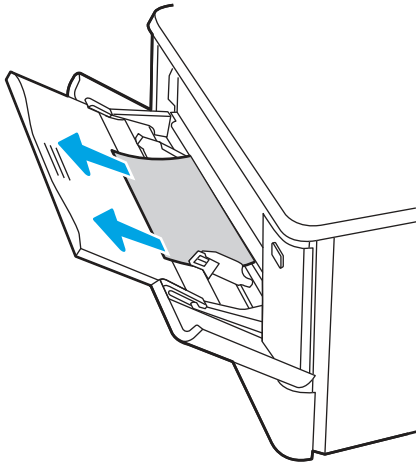


2. If you cannot see the jammed sheet, close Tray 1, and then remove Tray 2.

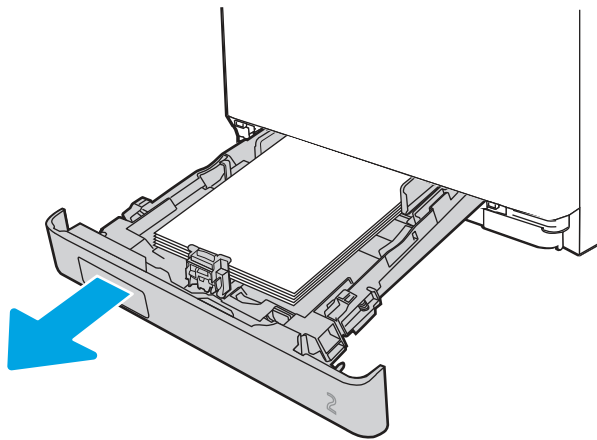


3. At the left side of the Tray 2 cavity, press the tab to lower the tray plate, and then remove any paper. Remove the jammed sheet by gently pulling it straight out.

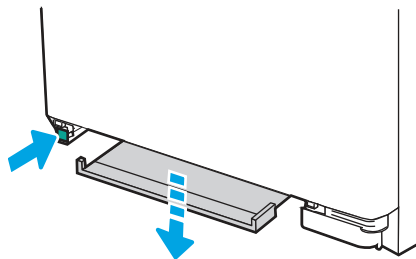


4. Push the tray plate back up into place.

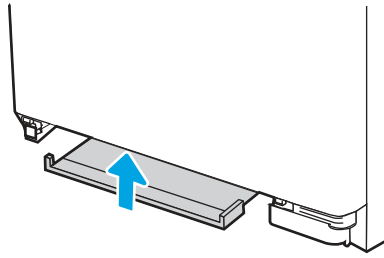


5. Reinstall Tray 2.

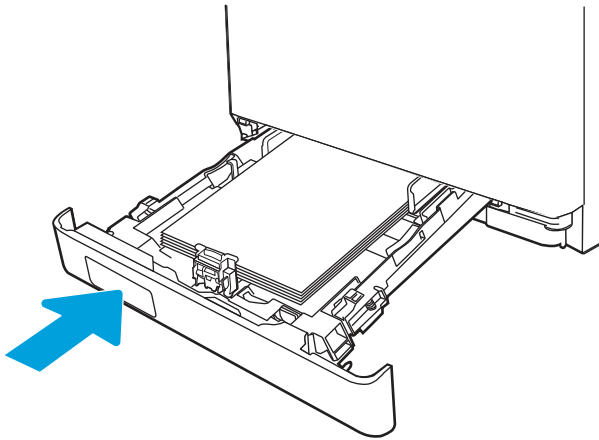

6. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
7. Reopen Tray 1 and load paper into the tray. Ensure the tray guides are set to the correct paper size.

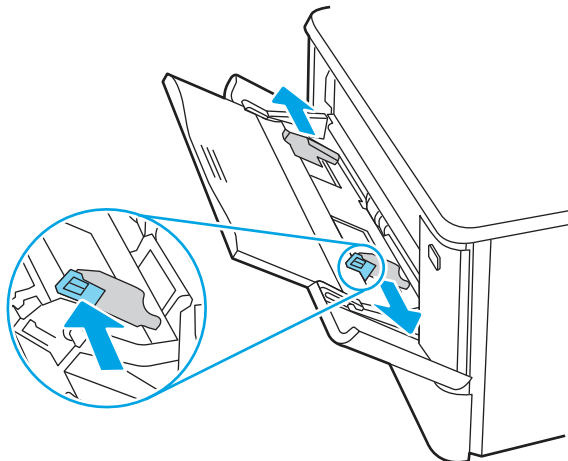

8. Ensure the tray is not overfilled. Paper should be below the 3 triangles in the following image.

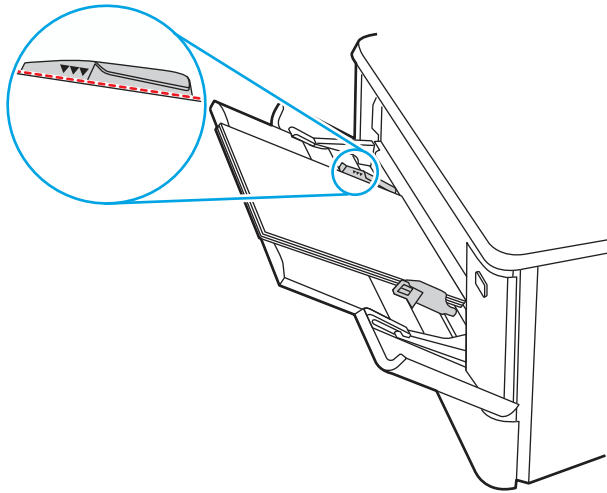


9. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents


Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Remove all paper from tray 1.
 - b. If you cannot see the jammed sheet, close Tray 1, and then remove Tray 2.

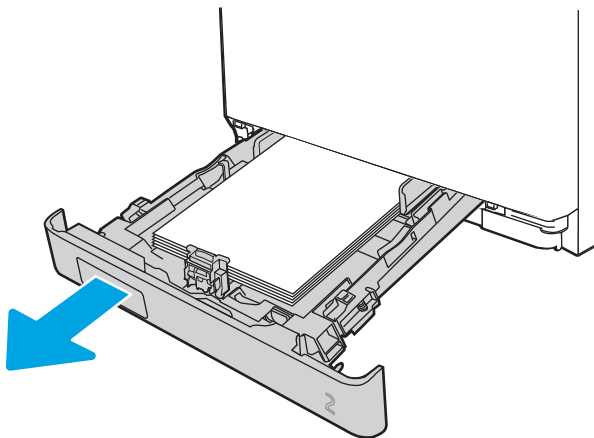


- c. Open the jam access area inside the tray 2 opening. Press the green button on the right side to drop open the access area.


Figure 6-3 Open jam access

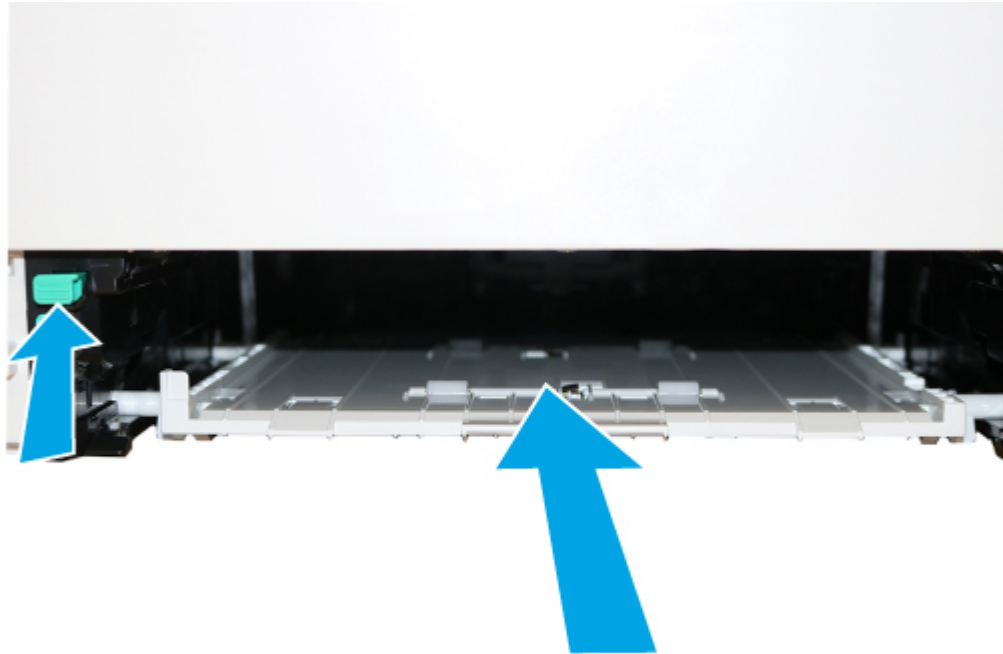

- d. Look for and clear any paper present or obstructions in the paper path.
 - e. Raise the access plate up to the closed position and reinstall tray 2.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
 3. Ensure that the tray 1 width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

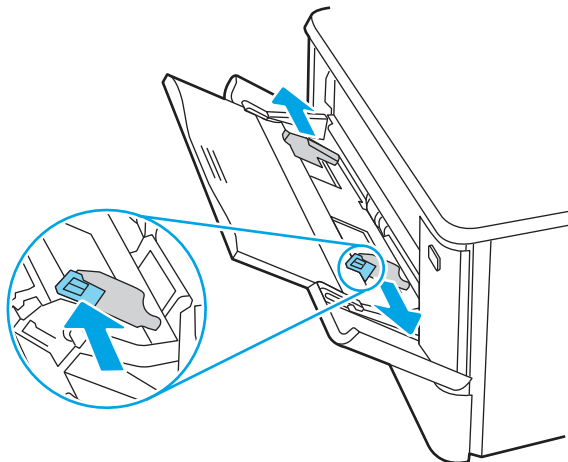


4. Ensure the tray is not overfilled. Paper should be below the 3 triangles in the following image.

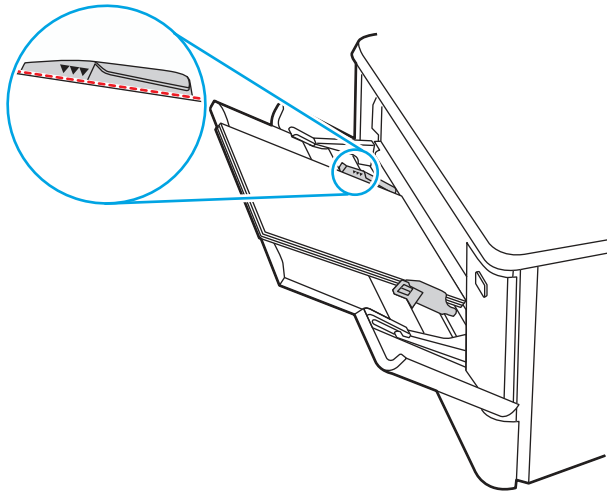


5. Ensure that the Tray 1 pickup roller and separation pad are installed correctly and show no damage or wear.
6. Clean or replace the pickup roller and separation pad as needed.
 - a. Open the front door.

Figure 6-4 Open the front door

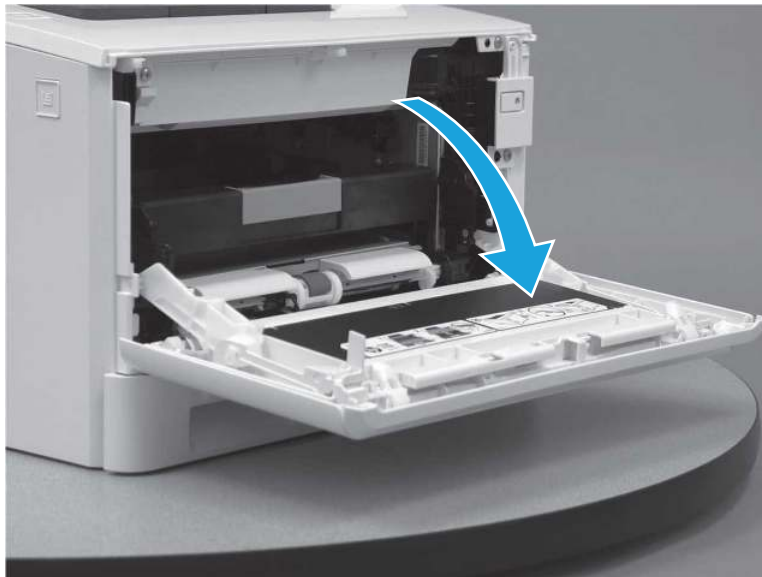


- b. Press down on the separation pad holder (callout 1) and release two tabs (callout 2).

Figure 6-5 Press down and release tabs

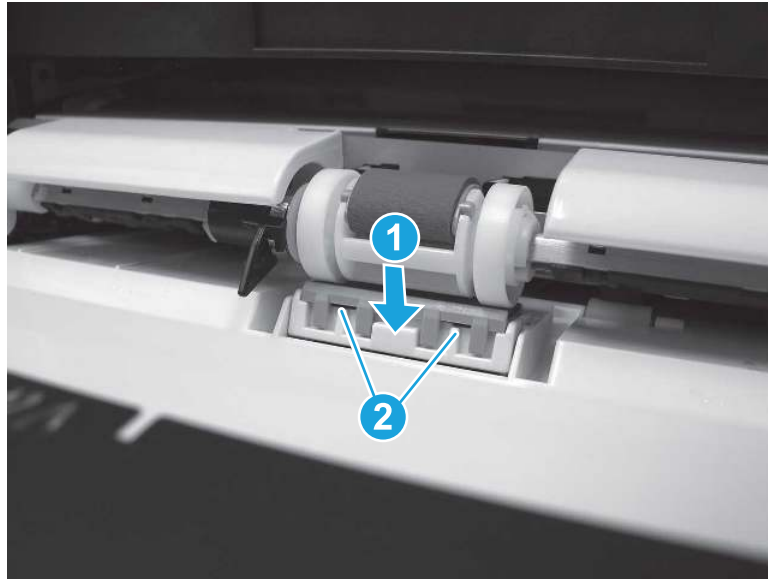


- c. Continue to press down on the separation pad holder (callout 1), and then slide the separation pad (callout 2) away from the printer to remove it.

Figure 6-6 Remove the separation pad

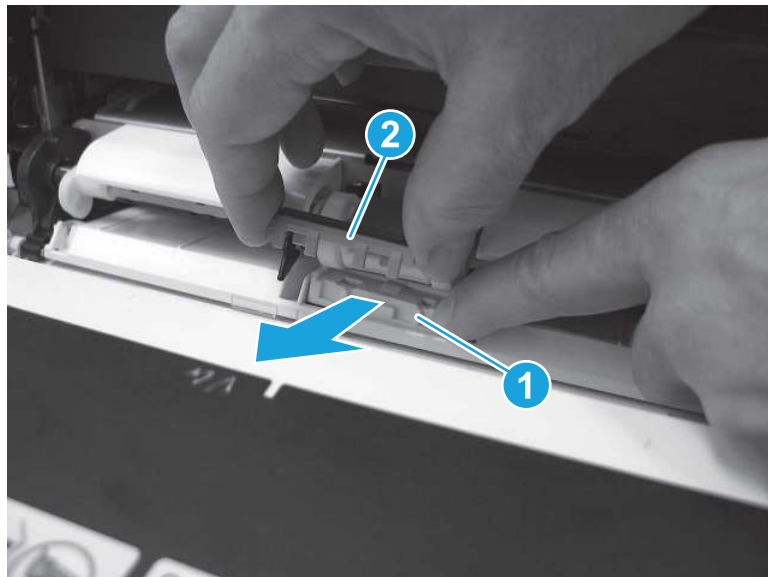


- d. Release two tabs (callout 1).

Figure 6-7 Release two tabs

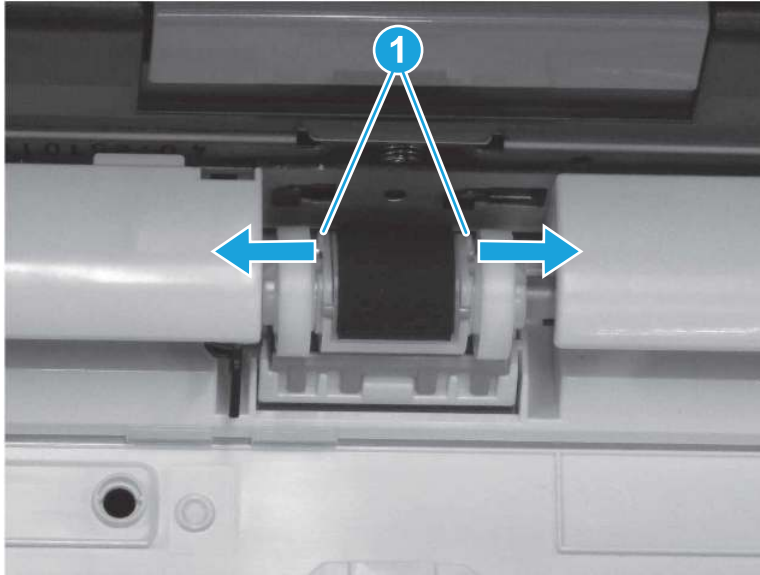

- e. Remove the pickup roller.


Figure 6-8 Remove the pickup roller

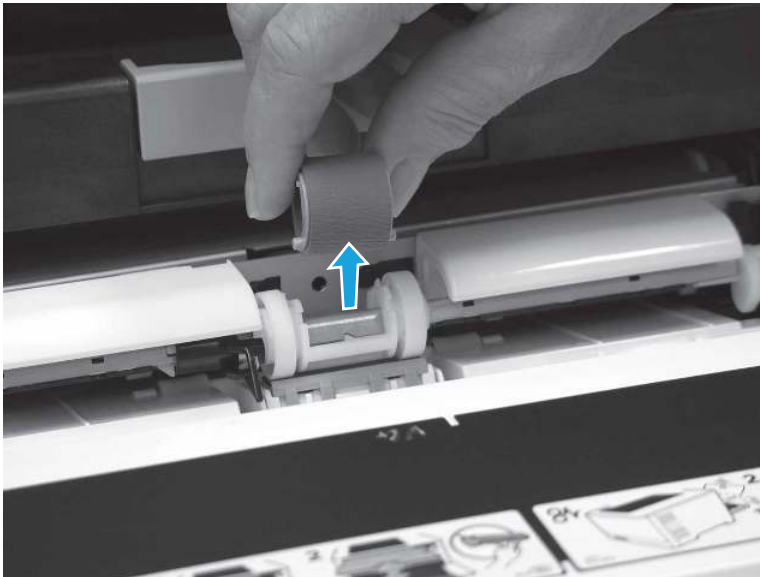

- f. Use a damp, lint-free cloth to gently clean the roller and pad.

CAUTION: When handling the roller and/or pad, avoid touching the spongy surfaces. Skin oils and fingerprints on a roller surface can cause print-quality problems.

Figure 6-9 Clean the roller and pad

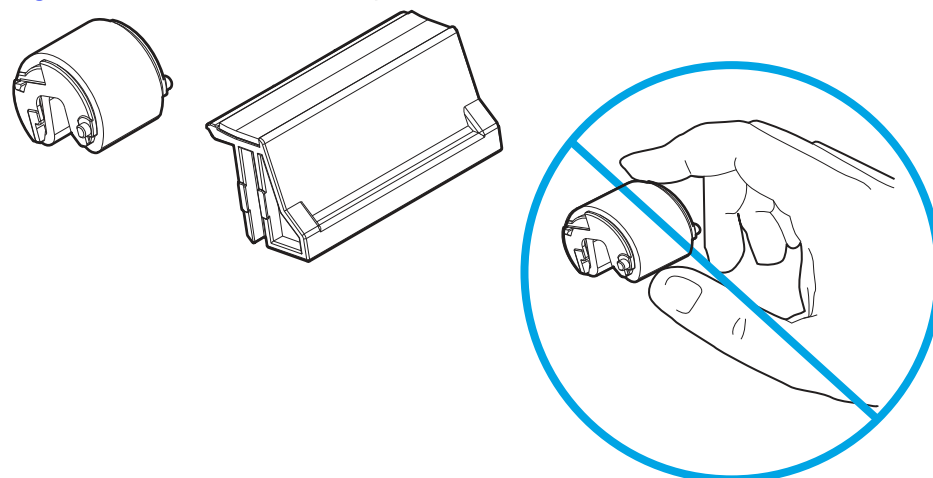


Tray 1 pickup roller part number: RL1-2593-000CN

Tray 1 separation pad assembly part number: RM2-6406-000CN

Recommended action for onsite technicians


Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Remove all paper from tray 1.
 - b. If you cannot see the jammed sheet, close Tray 1, and then remove Tray 2.

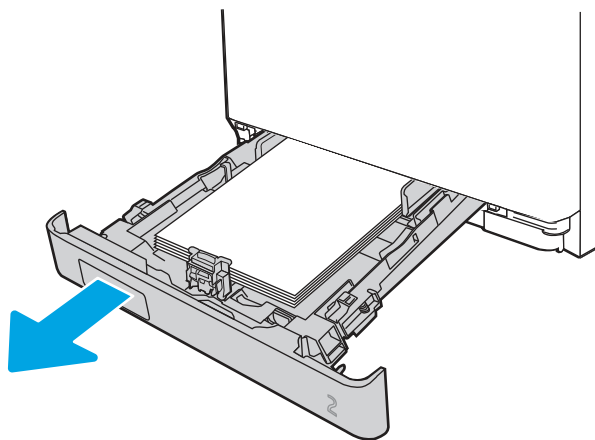


- c. Open the jam access area inside the tray 2 opening. Press the green button on the right side to drop open the access area.


Figure 6-10 Open jam access

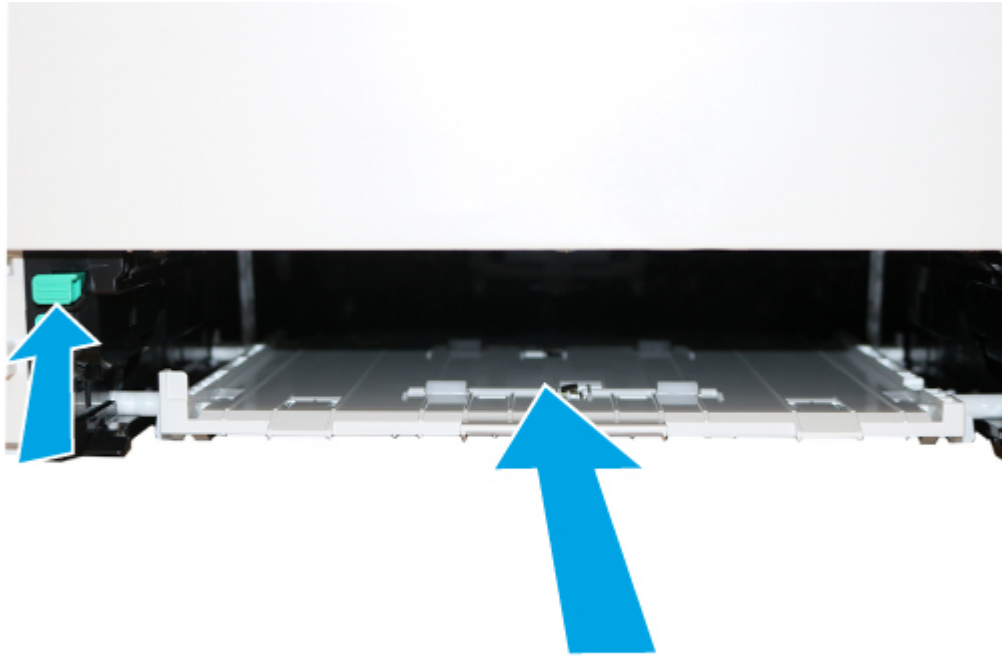

- d. Look for and clear any paper present or obstructions in the paper path.
 - e. Raise the access plate up to the closed position and reinstall tray 2.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
 3. Ensure that the tray 1 width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

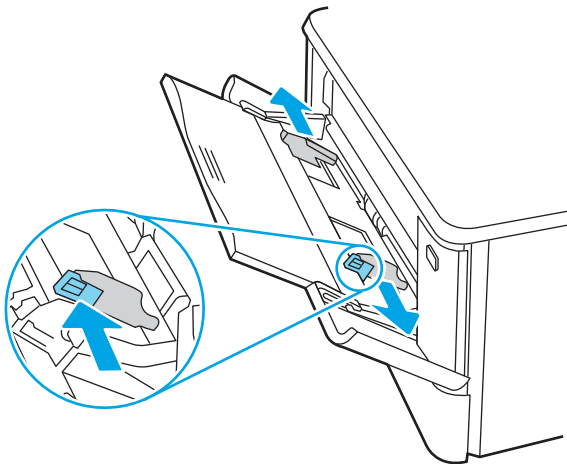


4. Ensure the tray is not overfilled. Paper should be below the 3 triangles in the following image.

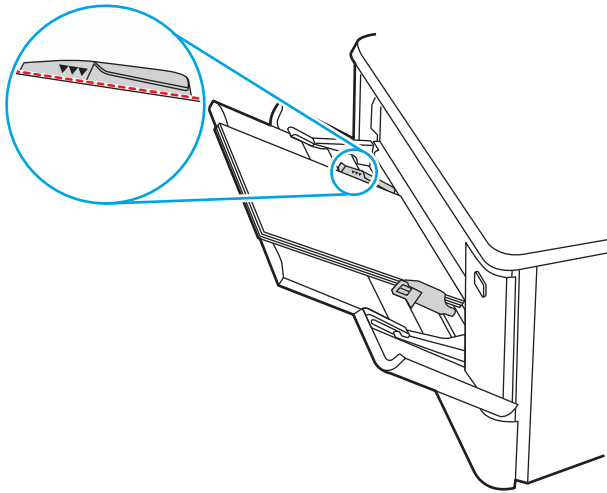


5. Ensure that the Tray 1 pickup roller and separation pad are installed correctly and show no damage or wear.
6. Clean or replace the pickup roller and separation pad as needed.
 - a. Open the front door.

Figure 6-11 Open the front door

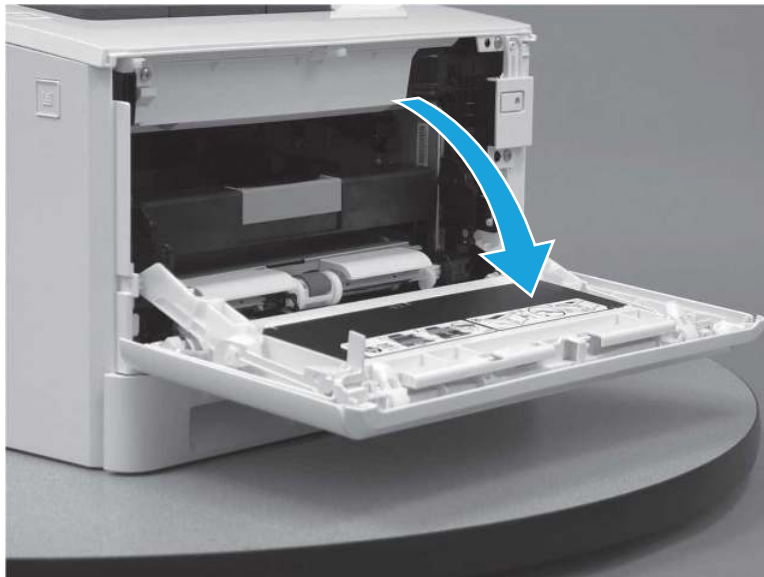


- b. Press down on the separation pad holder (callout 1) and release two tabs (callout 2).

Figure 6-12 Press down and release tabs

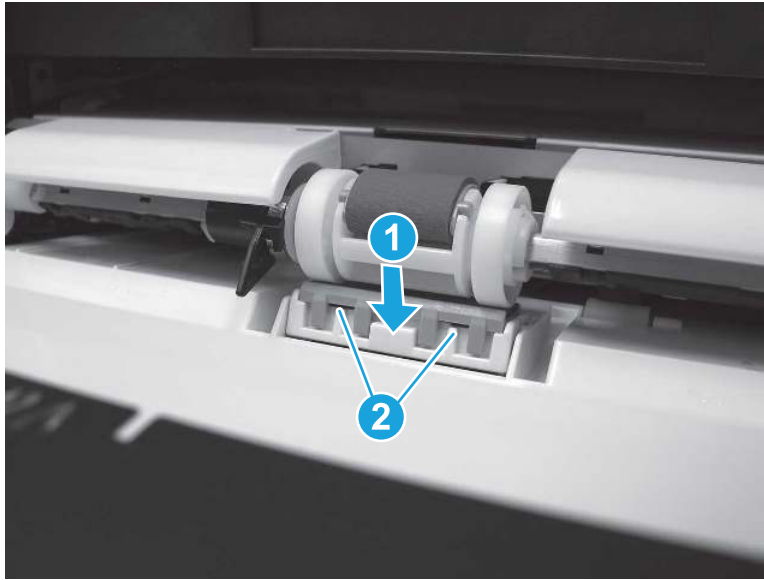


- c. Continue to press down on the separation pad holder (callout 1), and then slide the separation pad (callout 2) away from the printer to remove it.

Figure 6-13 Remove the separation pad

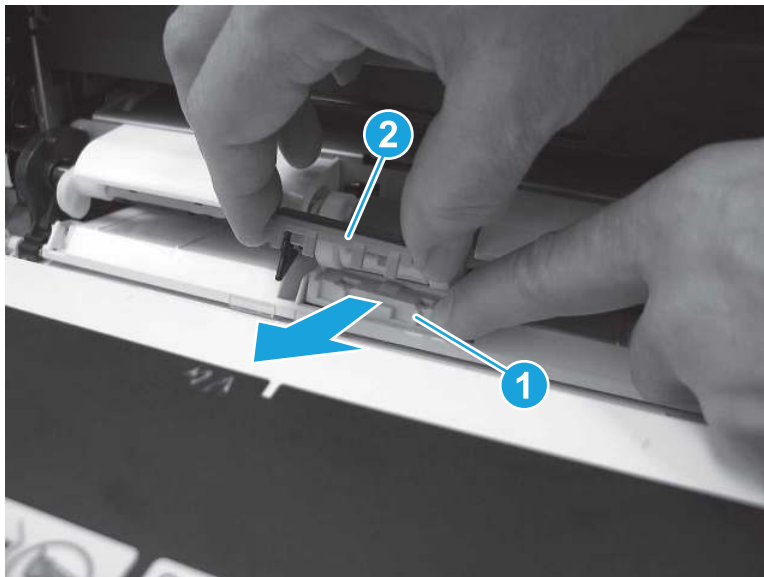


- d. Release two tabs (callout 1).

Figure 6-14 Release two tabs

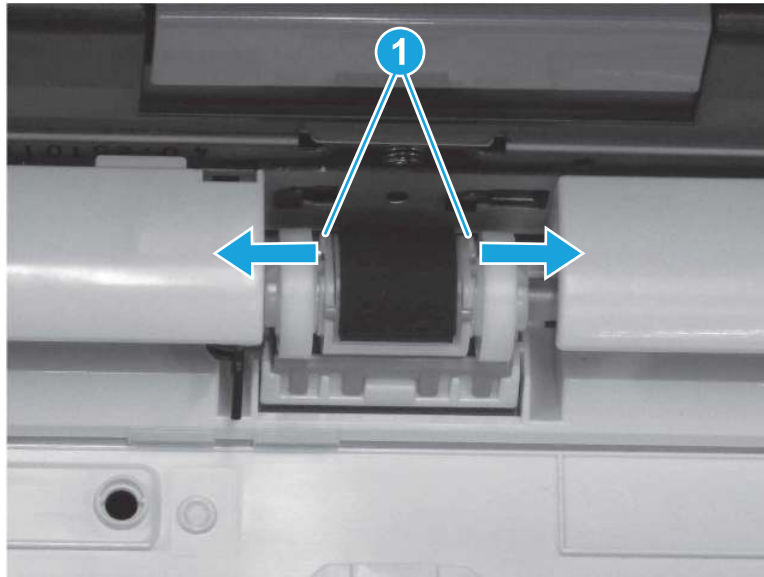

- e. Remove the pickup roller.


Figure 6-15 Remove the pickup roller

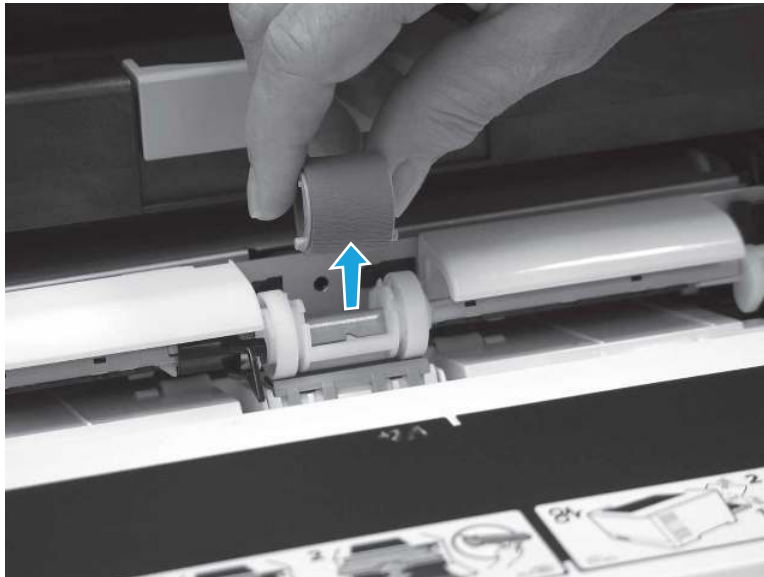

- f. Use a damp, lint-free cloth to gently clean the roller and pad.

CAUTION: When handling the roller and/or pad, avoid touching the spongy surfaces. Skin oils and fingerprints on a roller surface can cause print-quality problems.

Figure 6-16 Clean the roller and pad

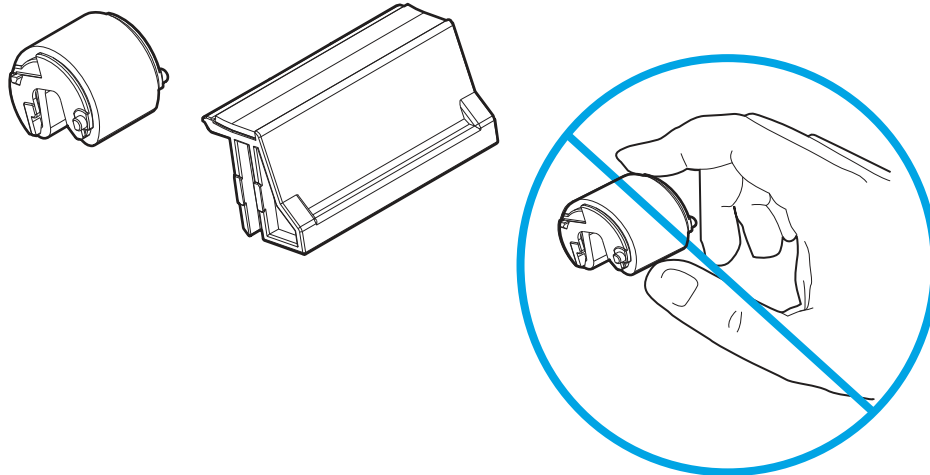

Tray 1 pickup roller part number: RL1-2593-000CN

Tray 1 separation pad assembly part number: RM2-6406-000CN

13 . B2 . D2 Paper jam in Tray 2

Paper jam when printing from tray 2


Paper did not reach the registration sensor when printing from tray 2.

13.B2.D2 jam error in tray 2


Use the following procedure to check for a paper jam in tray 2.

When a jam occurs, the control panel displays a message and an animation that assists in clearing the jam.


- 13.B2.D2 Paper jam in tray 2
1. Pull the tray completely out of the printer.

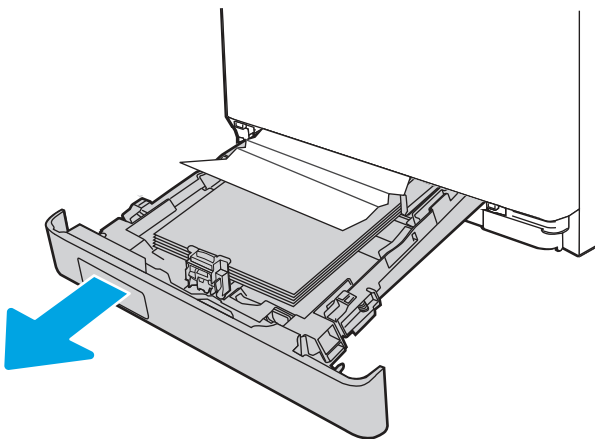

2. Remove any jammed or damaged sheets of paper.

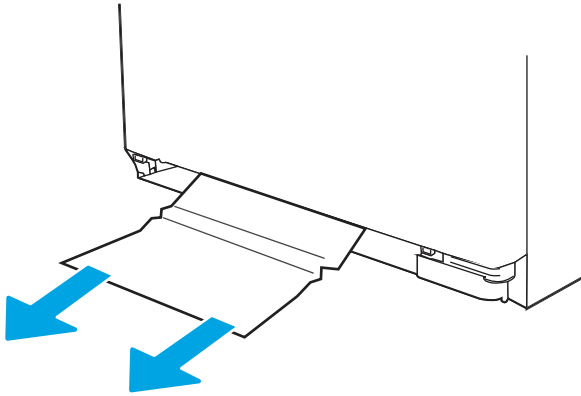



3. Reinsert and close Tray 2.

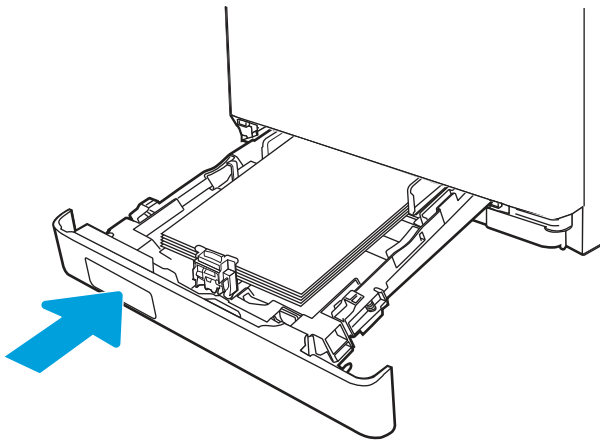


 **NOTE:** When reinserting the paper, make sure the paper guides are adjusted properly for the paper size.

4. Open the rear door and look for and clear any paper present or obstructions in the paper path.

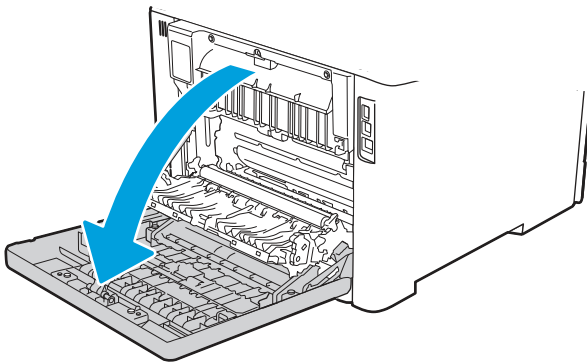

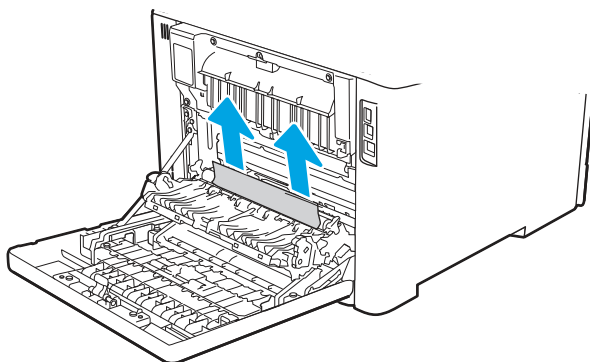

5. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab (line below 3 triangles). See following images.

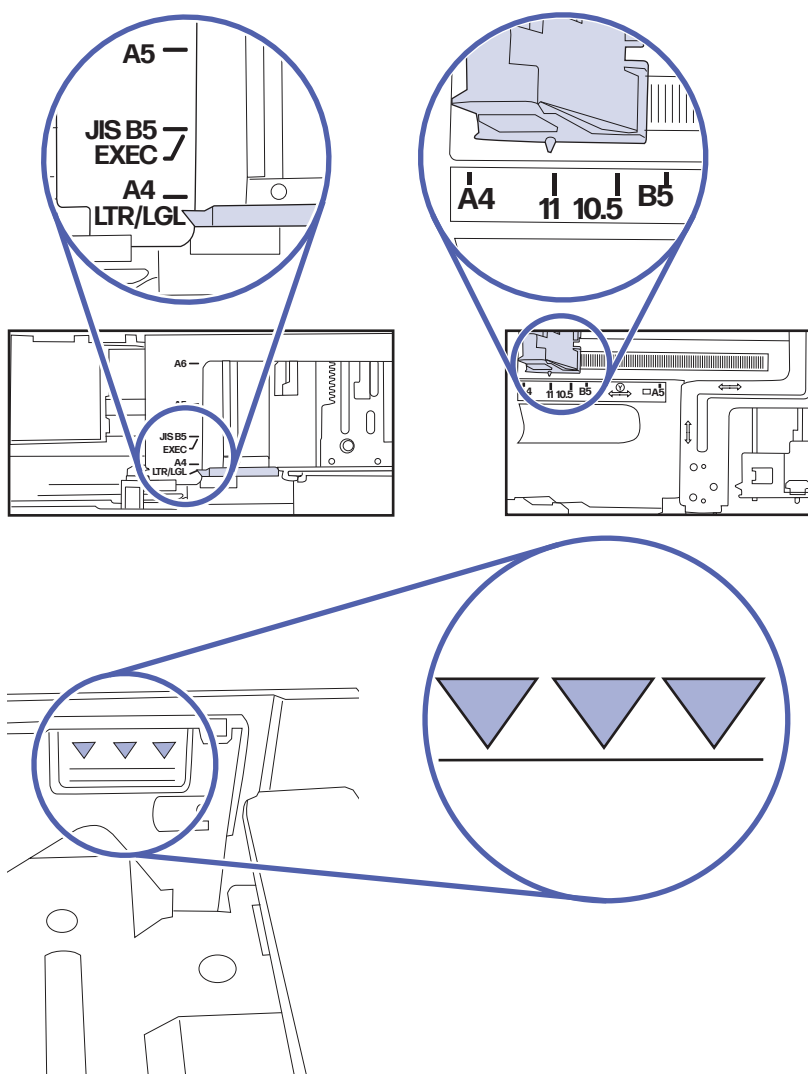


7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.


Recommended action for call-center

Use the following procedure to check for a paper jam in Tray 2.


1. Pull the tray completely out of the printer.

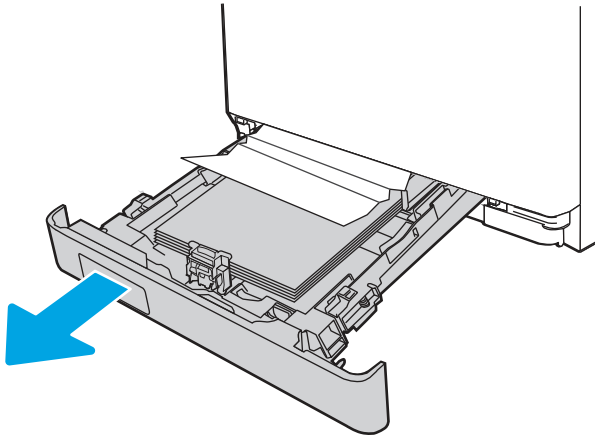

2. Remove any jammed or damaged sheets of paper.

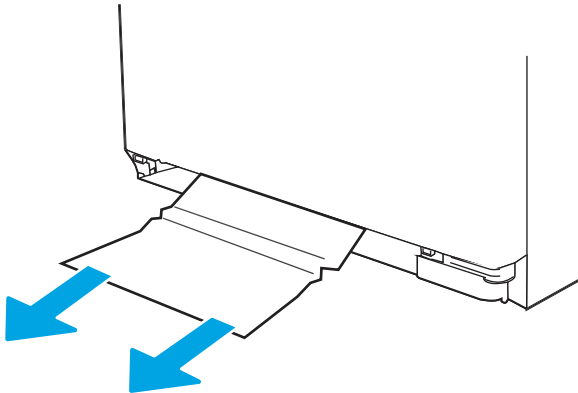

3. Reinsert and close Tray 2.

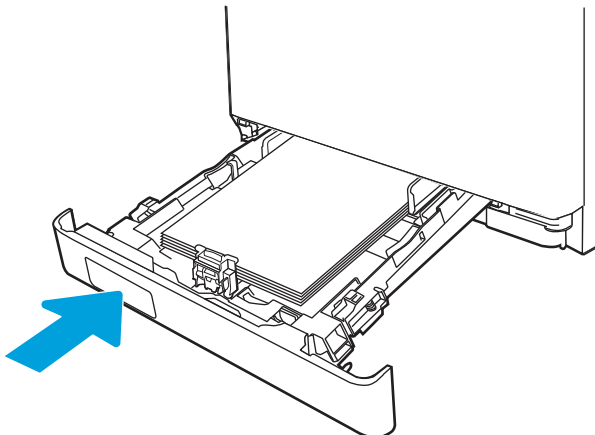

4. Open the rear door and look for and clear any paper present or obstructions in the paper path.


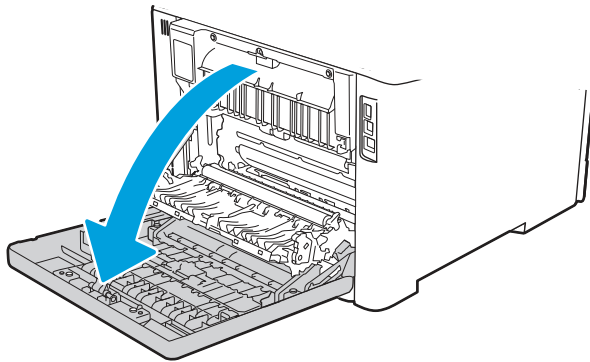


Figure 6-17 Clear Jam



5. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab (line below 3 triangles). See following images.

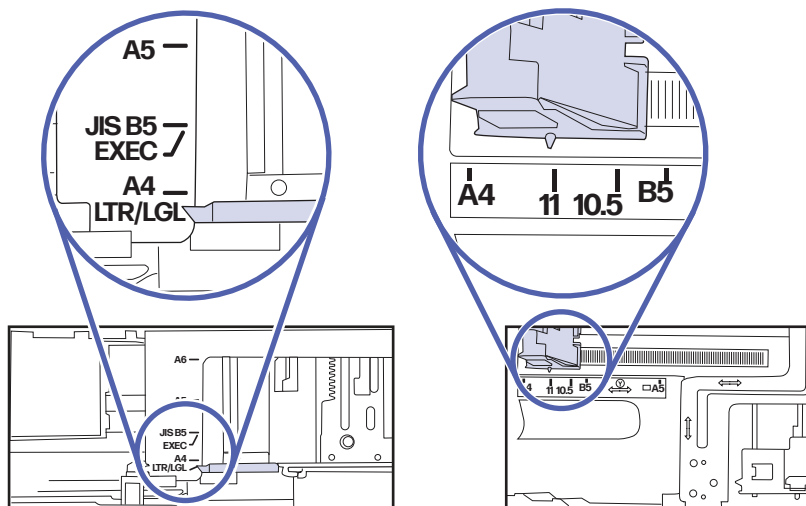


7. Ensure that the tray 2 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
8. Clean or replace the pickup, feed, and separation rollers as needed.
Roller, paper pickup assembly part number: RM2-5576-000CN
Roller, feed assembly part number: RM2-5577-000CN
Roller, separation part number: RM2-5881-000CN
9. If the issue persists, try to engage the registration sensor with a piece of paper, if there are no obstructions close the rear door and see if the error clears.
10. If the error persists, replace the following parts as needed.
Paper pick up assembly part number: RM2-6372-000CN
Registration assembly part number: RM2-1839-000CN
11. If the issue persists, elevate the case using the Standard Support Process.

Recommended action for onsite technicians


Use the following procedure to check for a paper jam in Tray 2.

1. Pull the tray completely out of the printer.
2. Remove any jammed or damaged sheets of paper.
3. Reinsert and close Tray 2.
4. Open the rear door and look for and clear any paper present or obstructions in the paper path.

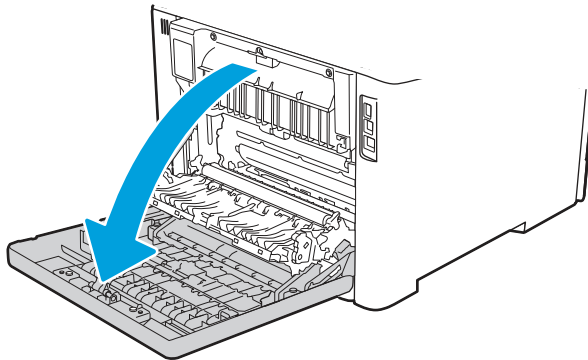



5. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab (line below 3 triangles). See following images.

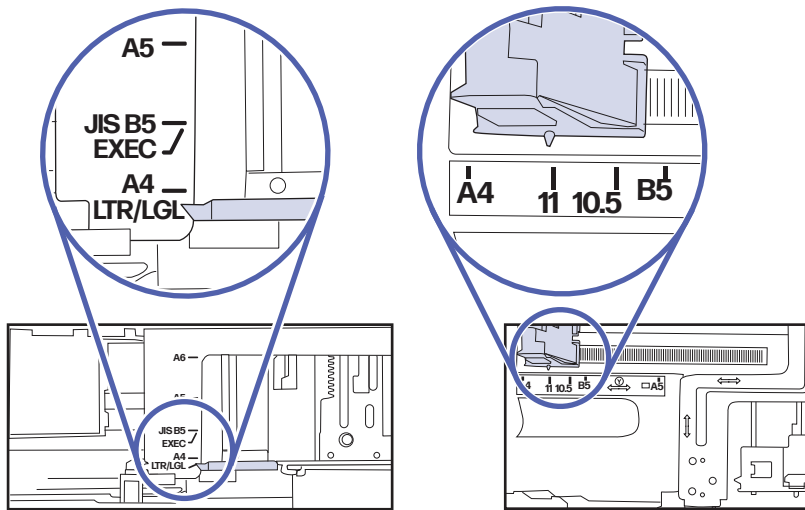

7. Ensure that the tray 2 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
8. Clean or replace the pickup, feed, and separation rollers as needed.
 Roller, paper pickup assembly part number: RM2-5576-000CN
 Roller, feed assembly part number: RM2-5577-000CN
 Roller, separation part number: RM2-5881-000CN
9. If the issue persists, try to engage the registration sensor with a piece of paper, if there are no obstructions close the rear door and see if the error clears.
10. If the error persists, replace the following parts as needed.
 Paper pick up assembly part number: RM2-6372-000CN
 Registration assembly part number: RM2-1839-000CN

For instructions: *Removal and replacement: Paper pickup assembly* See the Repair Service Manual for this product.

For instructions: *Remove and replace: Registration assembly* See the Repair Service Manual for this product.

11. If the issue persists, elevate the case using the Standard Support Process.

13 . B2 . Dz Paper jam in rear door

Paper jam at registration assembly.

The paper failed to reach the registration sensor when printing from tray z.

The paper reached the Tray 3 feed sensor but did not get to the registration sensor in time.

- **13.B2.D2:** Paper jam when printing from tray 2.
- **13.B2.D3:** Paper jam when printing from tray 3.
- **13.B2.DD:** Paper jam when printing from duplexer.

13.B2 jam error in rear door


Use the following procedure to check for a paper jam in the rear door.

Recommended action for customers


When a jam occurs, the control panel displays a message and an animation that assists in clearing the jam.

- 13.B2.A1 - Jam in rear door
- 13.B2.D1 - Jam in rear door
- 13.B2.A2 - Jam in rear door
- 13.B2.D2 - Jam in rear door
- 13.B2.A3 - Jam in rear door
- 13.B2.D3 - Jam in rear door
- 13.B2.AD - Jam in rear door
- 13.B2.DD - Jam in rear door


1. Pull the tray completely out of the printer.

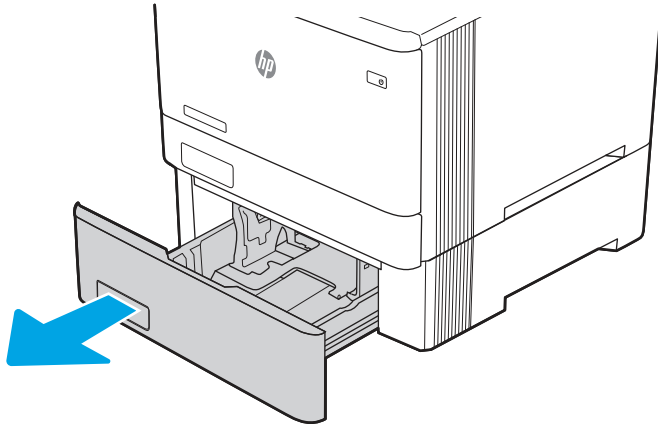

2. Remove any jammed or damaged sheets of paper.

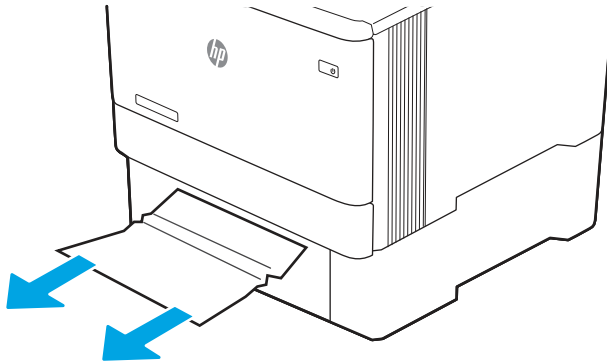


3. Reinsert and close Tray 3.

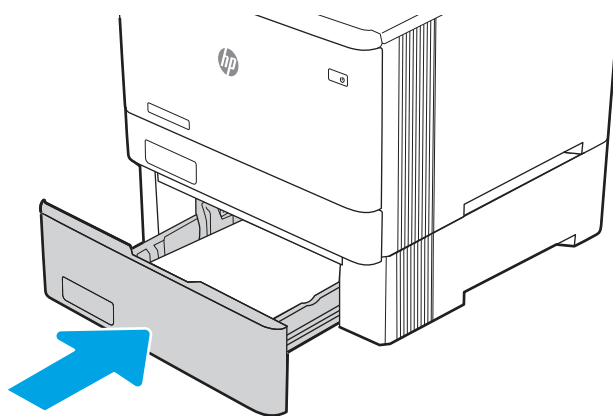



NOTE: When reinserting the paper, make sure the paper guides are adjusted properly for the paper size.

4. Open the rear door and look for and clear any paper present or obstructions in the paper path.

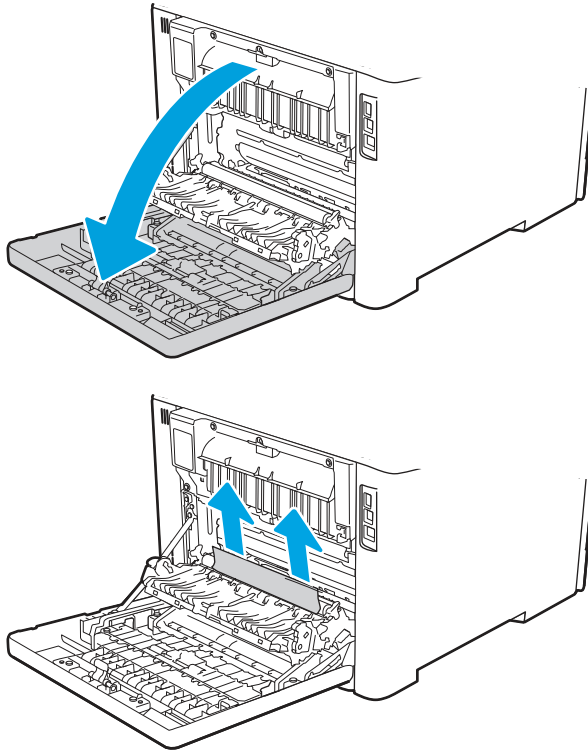

5. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab (line below 3 triangles). See following images.

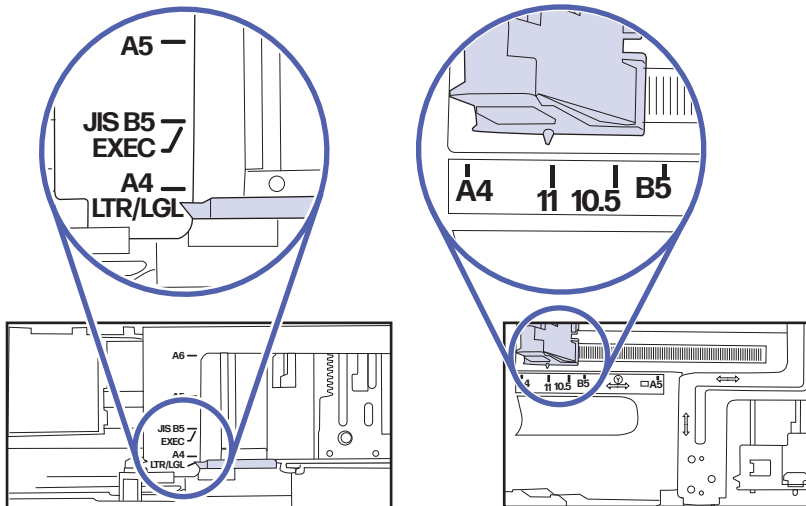

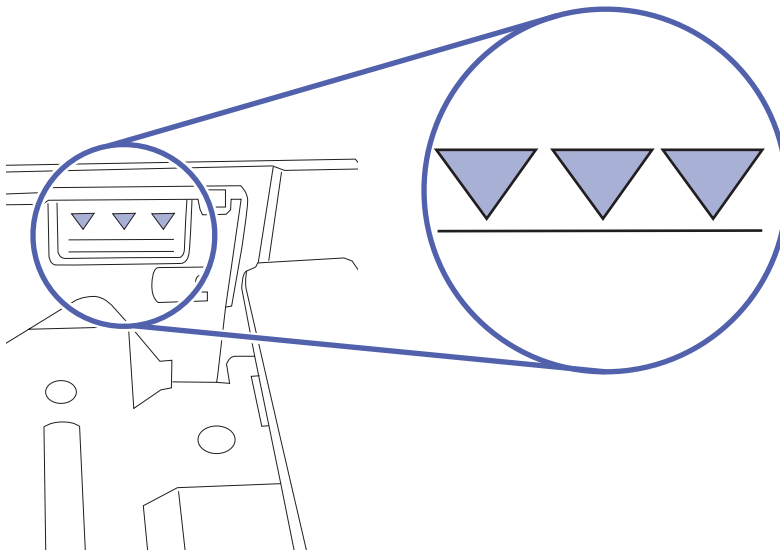


6. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
7. If the error persists, contact customer support at www.hp.com/go/contactHP, or contact an HP-authorized service or support provider.


Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.


1. Pull the tray the job was printing from completely out of the printer.

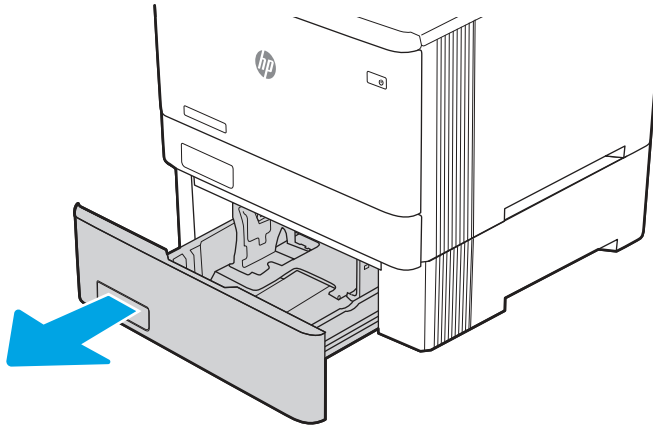

2. Remove any jammed or damaged sheets of paper.

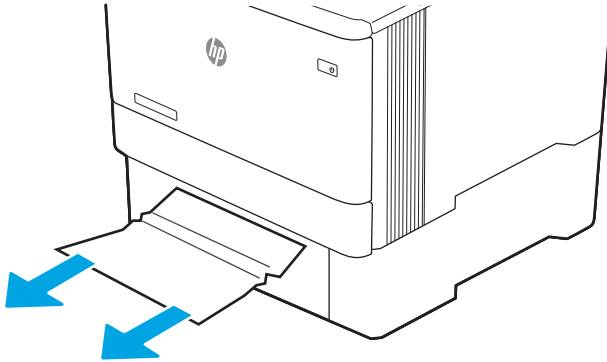

3. Reinsert and close the tray.

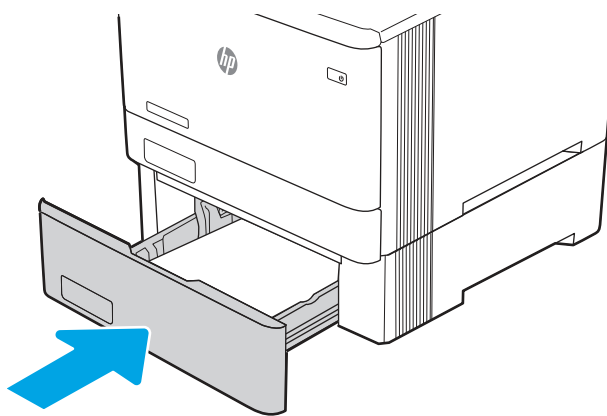

NOTE: When reinserting the paper, make sure the paper guides are adjusted properly for the paper size.

4. Open the rear door and look for and clear any paper present or obstructions in the paper path.



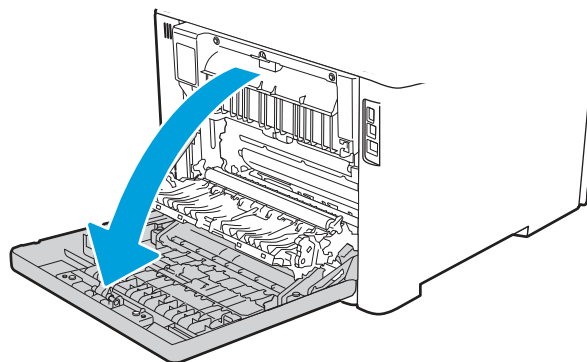


Figure 6-18 Clear Jam



5. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab (line below 3 triangles). See following images.

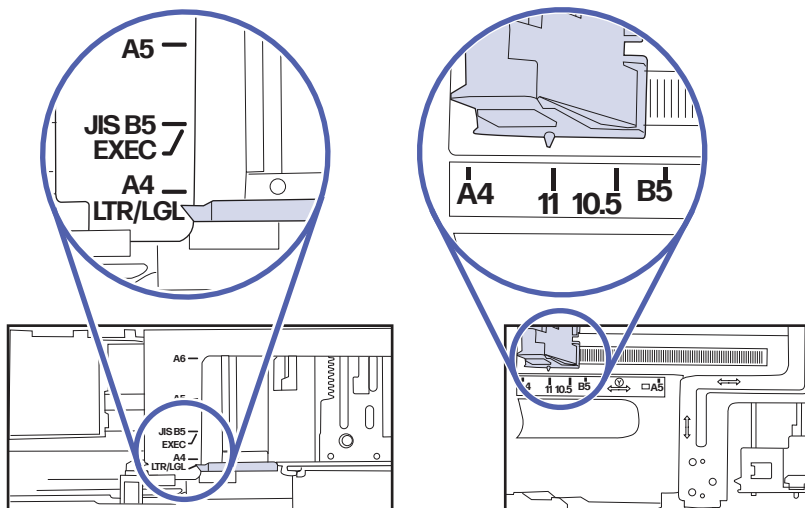

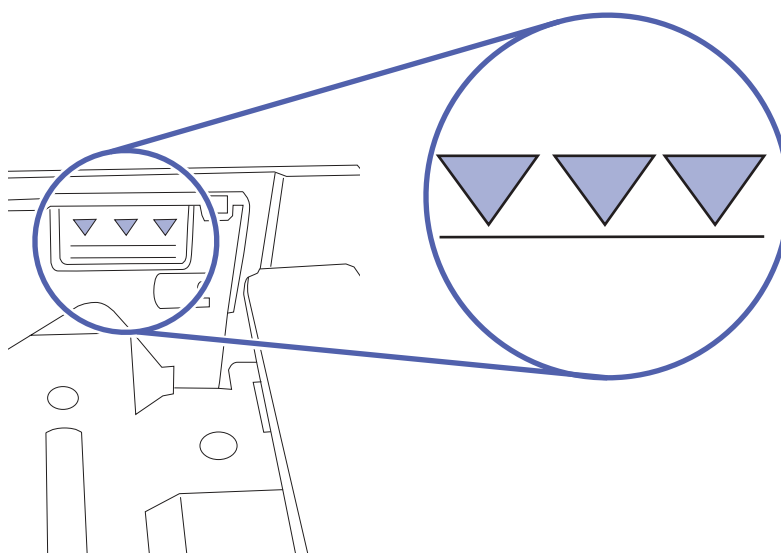

7. Ensure that the tray pickup, feed, and separation rollers are installed correctly and show no damage or wear.
8. Clean or replace the pickup, feed, and separation rollers as needed.
Roller, paper pickup assembly part number: RM2-5576-000CN
Roller, feed assembly part number: RM2-5577-000CN
Roller, separation part number: RM2-5881-000CN
9. If the issue persists, try to engage the registration sensor with a piece of paper, if there are no obstructions close the rear door and see if the error clears.
10. If the error persists, replace the following parts as needed.
Paper pick up assembly part number: RM2-6372-000CN
Registration assembly part number: RM2-1839-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Pull the tray completely out of the printer.
2. Remove any jammed or damaged sheets of paper.
3. Reinsert and close the tray.



NOTE: When reinserting the paper, make sure the paper guides are adjusted properly for the paper size.

4. Open the rear door and look for and clear any paper present or obstructions in the paper path.



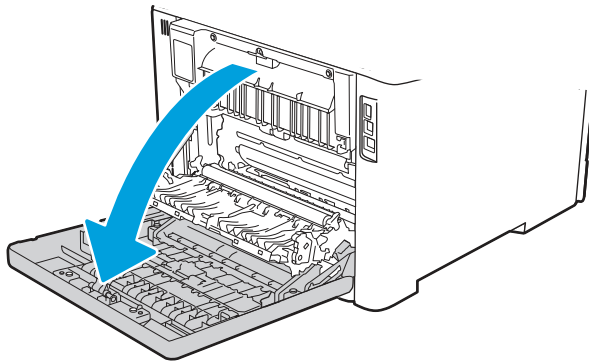


Figure 6-19 Clear Jam



5. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab (line below 3 triangles). See following images.

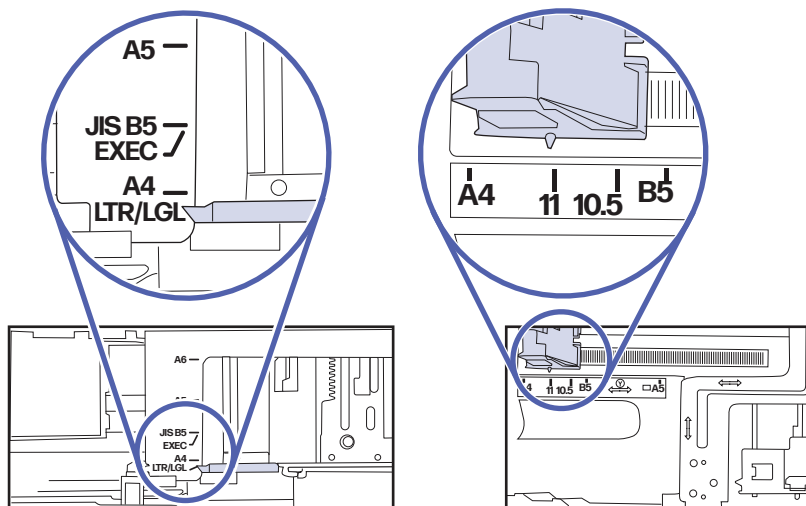

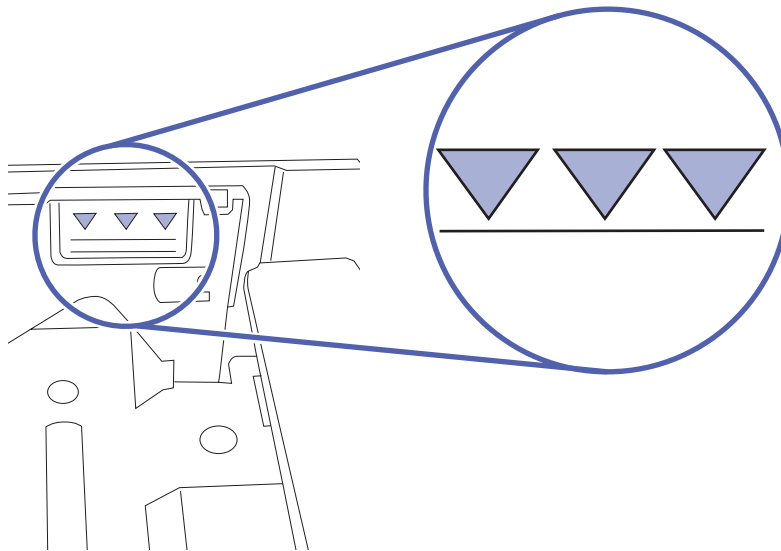

7. Ensure that the tray pickup, feed, and separation rollers are installed correctly and show no damage or wear.

8. Clean or replace the pickup, feed, and separation rollers as needed.

Roller, paper pickup assembly part number: RM2-5576-000CN

For Instructions: *Removal and replacement: 550 sheet feeder pickup assembly* See the Repair Service Manual for this product.

Roller, feed assembly part number: RM2-5577-000CN

Roller, separation part number: RM2-5881-000CN

9. If the issue persists, try to engage the registration sensor with a piece of paper, if there are no obstructions close the rear door and see if the error clears.

10. If the error persists, replace the following parts as needed.

Paper pick up assembly part number: RM2-6372-000CN

Registration assembly part number: RM2-1839-000CN

For instructions: *Removal and replacement: Paper pickup assembly* See the Repair Service Manual for this product.

For instructions: *Remove and replace: Registration assembly* See the Repair Service Manual for this product.

13.B4.yz, 13.B5.yz Paper jam in rear door

Paper is jammed at the fuser loop sensor inside the rear door of the printer.

Y = A (Stay jam) or D (Delay jam)

Z = Tray number or duplexer (1, 2, 3, D)

13.B4, 13.B5 jam error in fuser input

Use the following procedure to check for paper in all possible jam locations in the fuser area.

Recommended action for customers

When a jam occurs, the control panel displays a message and an animation that assists in clearing the jam.

- 13.B4.yz Jam in rear door
- 13.B5.yz Jam in rear door

y = jam type (A or D)

z = paper type that is being printed on. This can be 0-9 or A-F.




CAUTION:




The fuser can be hot while the printer is in use. Wait for the fuser to cool before handling it.


1. Open the rear door.

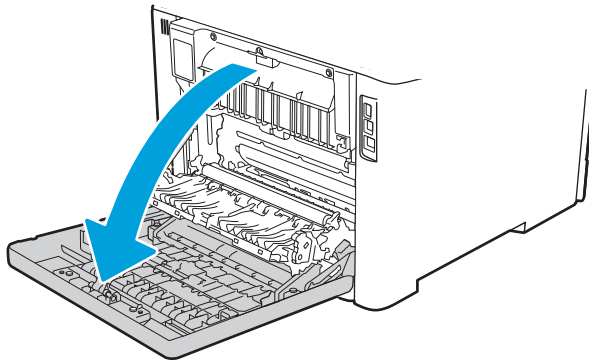


2. Gently pull out any jammed paper from the rollers in the rear door area.

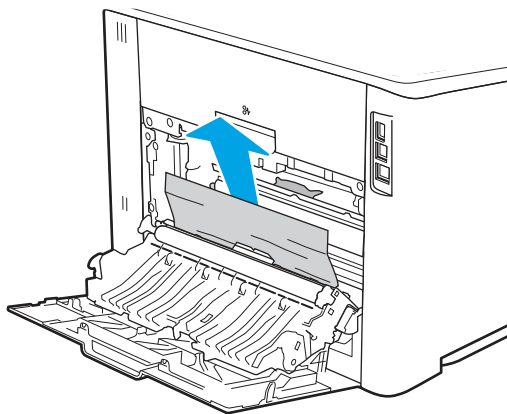

3. If paper is present in the upper rollers, gently pull out any jammed paper from the rollers in the rear door area.

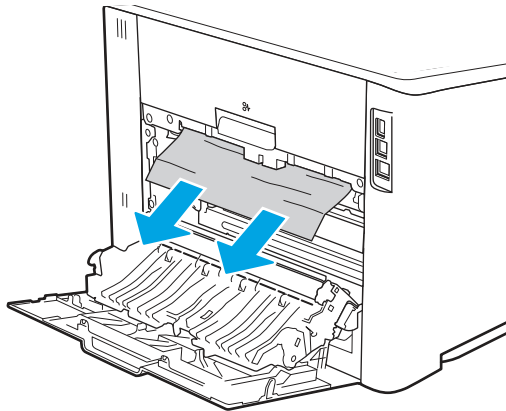

4. Close the rear door.

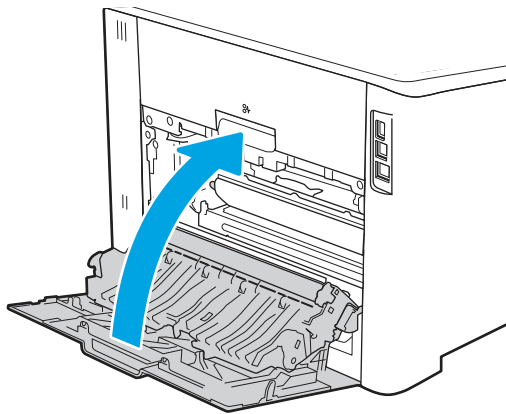

5. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. Ensure the paper tray guides are set to the correct size for the paper loaded.
7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.

- a. Open the rear door and look for and clear any paper present or obstructions in the paper path.

Figure 6-20 Open rear cover


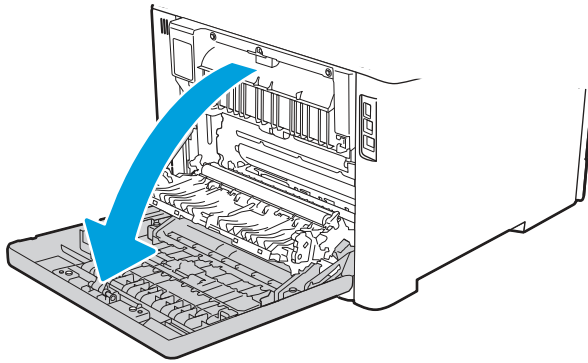


Figure 6-21 Check these areas

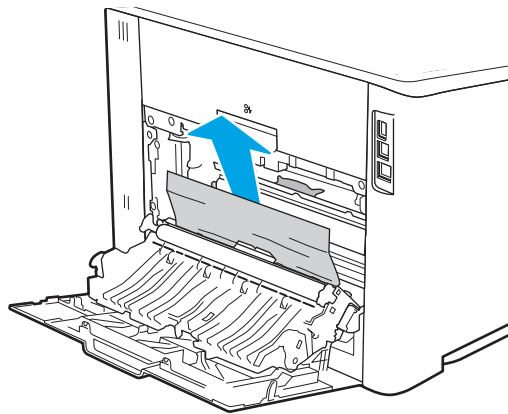

- b. Close the rear door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. Make sure the printer is located in an area meets the environmental specifications for the printer.
4. Adjust the paper guides in the tray. Ensure the front paper guide is pushing the paper against the back edge of the tray.
5. If the paper stopped before the fuser, complete these troubleshooting steps:
 - Check the ITB and T2 roller at the transfer area, ensure that everything is correctly seated and that there are no damaged parts. Replace the ITB or T2 roller as needed.

ITB part number: RM2-6454-000CN
Secondary transfer roller (T2) part number: RM2-6397-000CN
6. If the paper stopped in or at the fuser, complete these troubleshooting steps:
 - Remove the fuser and inspect the fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.

Fuser assembly (110-127V) part number: RM2-6460-000CN
Fuser assembly (220-240V) part number: RM2-6461-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open the rear door and look for and clear any paper present or obstructions in the paper path.

Figure 6-22 Open rear cover

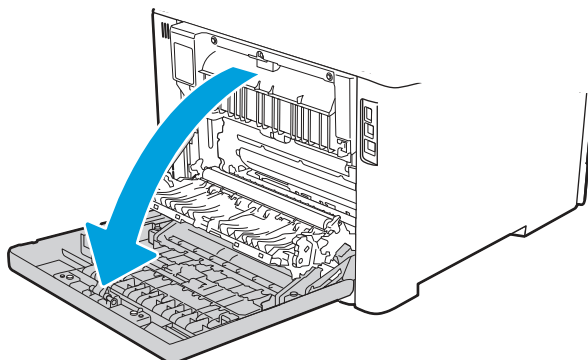


Figure 6-23 Check these areas



- b. Close the rear door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. Make sure the printer is located in an area meets the environmental specifications for the printer.
4. Adjust the paper guides in the tray. Ensure the front paper guide is pushing the paper against the back edge of the tray.
5. If the paper stopped before the fuser, complete these troubleshooting steps:
 - Check the ITB and T2 roller at the transfer area, ensure that everything is correctly seated and that there are no damaged parts. Replace the ITB or T2 roller as needed.

Intermediate transfer belt (ITB) assemblyRM2-6454-000CN

For instructions: *Removal and replacement: Intermediate transfer belt* See the Repair Service Manual for this product.

Secondary transfer assemblyRM2-6397-000CN

For instructions: *Removal and replacement: Secondary transfer assembly* See the Repair Service Manual for this product.

6. If the paper stopped in or at the fuser, complete these troubleshooting steps:

- Remove the fuser and inspect the fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.

Fuser assembly (110-127V) part number: RM2-6460-000CN

Fuser assembly (220-240V) part number: RM2-6461-000CN

For instructions: *Removal and replacement: Fuser assembly* See the Repair Service Manual for this product.

13.B9.Az

Paper is jammed inside the rear door of the printer.

Z = fuser mode and is a variable and can be any of the following 0-9 or A-F.

13.B9 jam error in fuser output

Use the following procedure to check for paper in all possible jam locations in the fuser area.

Recommended action for customers

When a jam occurs, the control panel displays a message and an animation that assists in clearing the jam.

- 13.B9.yz Jam in rear door

y = jam type (A, C, or D)

z = paper type that is being printed on. This can be 0-9 or A-F.




CAUTION:




The fuser can be hot while the printer is in use. Wait for the fuser to cool before handling it.


1. Open the rear door.

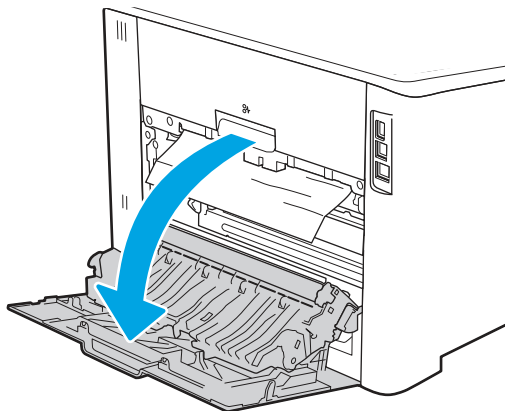

2. Gently pull out any jammed paper from the rollers in the rear door area.

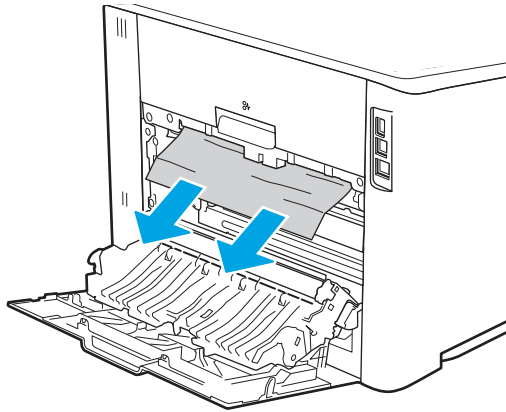

3. Close the rear door.

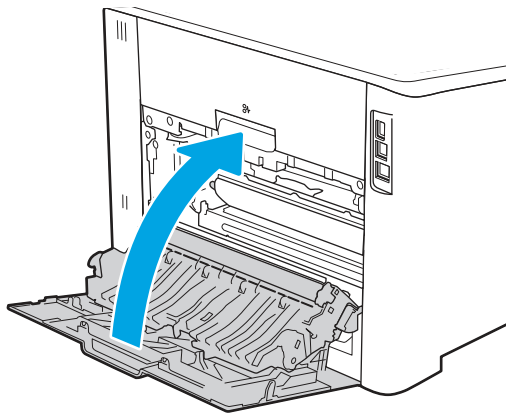

4. If the error persists, ensure the type and quality of the paper being used meets the HP specifications for the printer.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.

- a. Open the rear door and look for and clear any paper present or obstructions in the paper path.

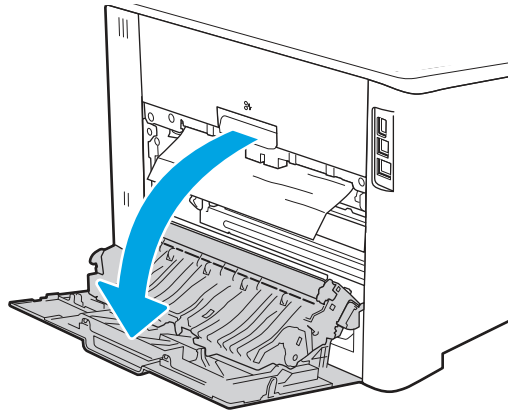


Figure 6-24 Check these areas



- b. Close the rear door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
 3. Make sure the printer is located in an area meets the environmental specifications for the printer.
 4. Adjust the paper guides in the tray. Ensure the front paper guide is pushing the paper against the back edge of the tray.
 5. If the paper stopped before the fuser, complete these troubleshooting steps:
 - Check the ITB and T2 roller at the transfer area, ensure that everything is correctly seated and that there are no damaged parts. Replace the ITB or T2 roller as needed.
ITB part number: RM2-6454-000CN
Secondary transfer roller (T2) part number: RM2-6397-000CN
 6. If the paper stopped in or at the fuser, complete these troubleshooting steps:
 - a. Remove the fuser and inspect the fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.
Fuser assembly (110-127V) part number: RM2-6460-000CN
Fuser assembly (220-240V) part number: RM2-6461-000CN

- b. Check the exit area and see if there is any obstructions blocking the paper from exiting.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open the rear door and look for and clear any paper present or obstructions in the paper path.

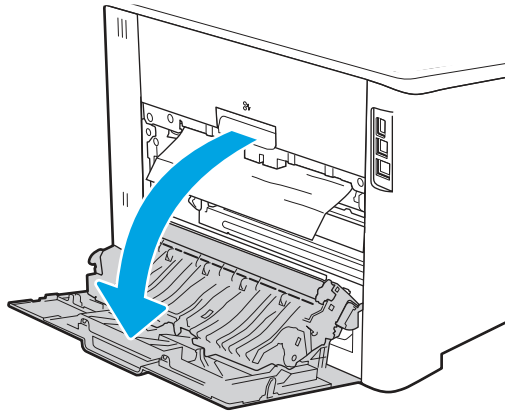


Figure 6-25 Check these areas



- b. Close the rear door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
 3. Make sure the printer is located in an area meets the environmental specifications for the printer.
 4. Adjust the paper guides in the tray. Ensure the front paper guide is pushing the paper against the back edge of the tray.
 5. If the paper stopped before the fuser, complete these troubleshooting steps:
 - Check the ITB and T2 roller at the transfer area, ensure that everything is correctly seated and that there are no damaged parts. Replace the ITB or T2 roller as needed.

Intermediate transfer belt (ITB) assemblyRM2-6454-000CN

For instructions: *Removal and replacement: Intermediate transfer belt* See the Repair Service Manual for this product.

Secondary transfer assemblyRM2-6397-000CN

For instructions: *Removal and replacement: Secondary transfer assembly*See the Repair Service Manual for this product.

6. If the paper stopped in or at the fuser, complete these troubleshooting steps:
 - a. Remove the fuser and inspect the fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.

Fuser assembly (110-127V) part number: RM2-6460-000CN

Fuser assembly (220-240V) part number: RM2-6461-000CN

For instructions: *Removal and replacement: Fuser assembly*See the Repair Service Manual for this product.

- b. Check the exit area and see if there is any obstructions blocking the paper from exiting.

13.B9.Cz

Fuser wrap jam inside the rear door of the printer.

Z is a variable and can be any of the following 0-9 or A-F.

13.B9 jam error in fuser output

Use the following procedure to check for paper in all possible jam locations in the fuser area.

Recommended action for customers

When a jam occurs, the control panel displays a message and an animation that assists in clearing the jam.

- 13.B9.yz Jam in rear door

y = jam type (A, C, or D)

z = paper type that is being printed on. This can be 0-9 or A-F.




CAUTION:




The fuser can be hot while the printer is in use. Wait for the fuser to cool before handling it.


1. Open the rear door.

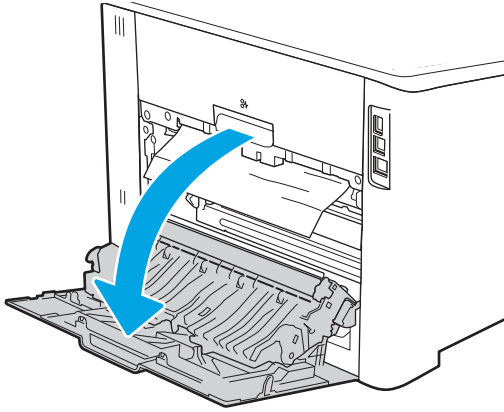

2. Gently pull out any jammed paper from the rollers in the rear door area.

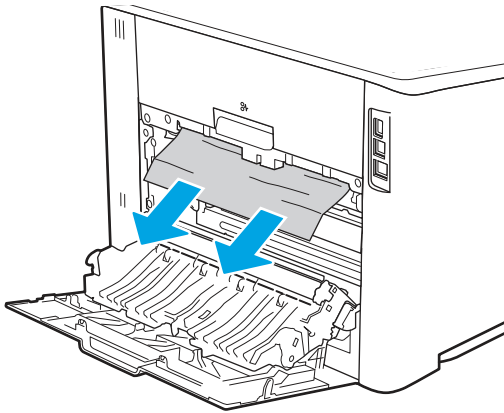

3. Close the rear door.

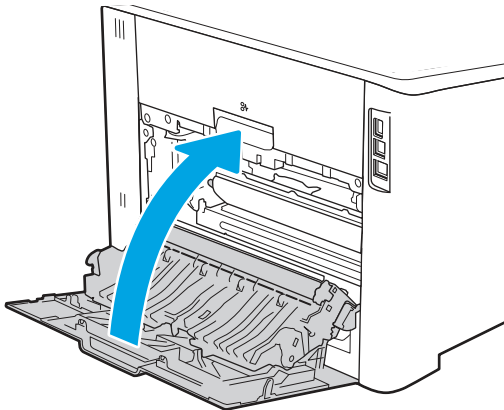

4. If the error persists, ensure the type and quality of the paper being used meets the HP specifications for the printer.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open the rear door and look for and clear any paper present or obstructions in the paper path.

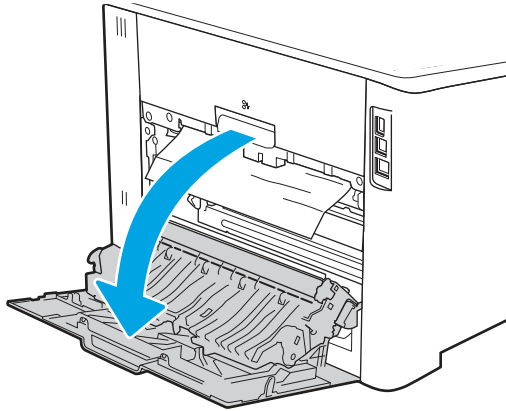


Figure 6-26 Check these areas



- b. Close the rear door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. Make sure the printer is located in an area meets the environmental specifications for the printer.
4. Adjust the paper guides in the tray. Ensure the front paper guide is pushing the paper against the back edge of the tray.
5. If the paper stopped before the fuser, complete these troubleshooting steps:
 - Check the ITB and T2 roller at the transfer area, ensure that everything is correctly seated and that there are no damaged parts. Replace the ITB or T2 roller as needed.

ITB part number: RM2-6454-000CN
Secondary transfer roller (T2) part number: RM2-6397-000CN
6. If the paper stopped in or at the fuser, complete these troubleshooting steps:

- Remove the fuser and inspect the fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.

Fuser assembly (110-127V) part number: RM2-6460-000CN

Fuser assembly (220-240V) part number: RM2-6461-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open the rear door and look for and clear any paper present or obstructions in the paper path.

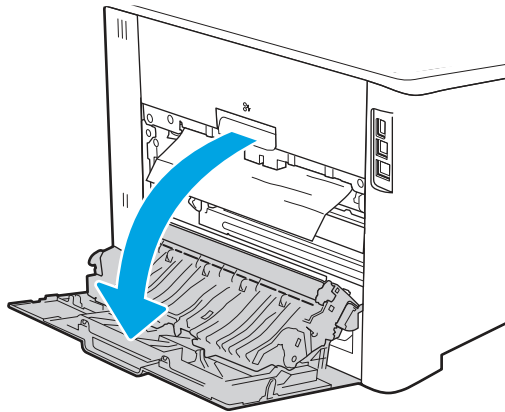


Figure 6-27 Check these areas



- b. Close the rear door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
 3. Make sure the printer is located in an area meets the environmental specifications for the printer.
 4. Adjust the paper guides in the tray. Ensure the front paper guide is pushing the paper against the back edge of the tray.
 5. If the paper stopped before the fuser, complete these troubleshooting steps:

- Check the ITB and T2 roller at the transfer area, ensure that everything is correctly seated and that there are no damaged parts. Replace the ITB or T2 roller as needed.

Intermediate transfer belt (ITB) assembly RM2-6454-000CN

For instructions: *Removal and replacement: Intermediate transfer belt* See the Repair Service Manual for this product.

Secondary transfer assembly RM2-6397-000CN

For instructions: *Removal and replacement: Secondary transfer assembly* See the Repair Service Manual for this product.

6. If the paper stopped in or at the fuser, complete these troubleshooting steps:

- Remove the fuser and inspect the fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.

Fuser assembly (110-127V) part number: RM2-6460-000CN

Fuser assembly (220-240V) part number: RM2-6461-000CN

For instructions: *Removal and replacement: Fuser assembly* See the Repair Service Manual for this product.

13.B9.Dz

Paper is jammed inside the rear door of the printer.

Paper delay jam to fuser sensor.

Z is a variable and can be any of the following 0-9 or A-F.

13.B9 jam error in fuser output

Use the following procedure to check for paper in all possible jam locations in the fuser area.

Recommended action for customers

When a jam occurs, the control panel displays a message and an animation that assists in clearing the jam.

- 13.B9.yz Jam in rear door

y = jam type (A, C, or D)

z = paper type that is being printed on. This can be 0-9 or A-F.




CAUTION:




The fuser can be hot while the printer is in use. Wait for the fuser to cool before handling it.


1. Open the rear door.

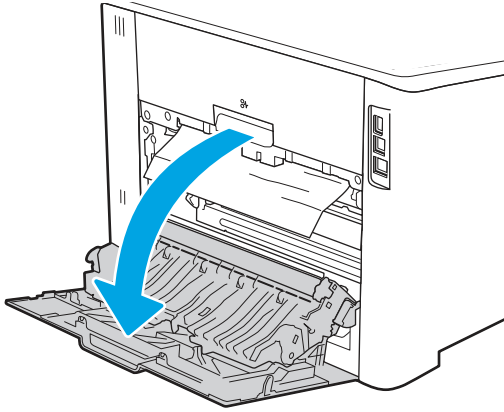

2. Gently pull out any jammed paper from the rollers in the rear door area.

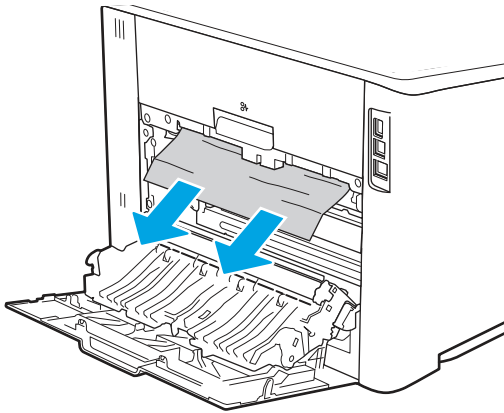

3. Close the rear door.

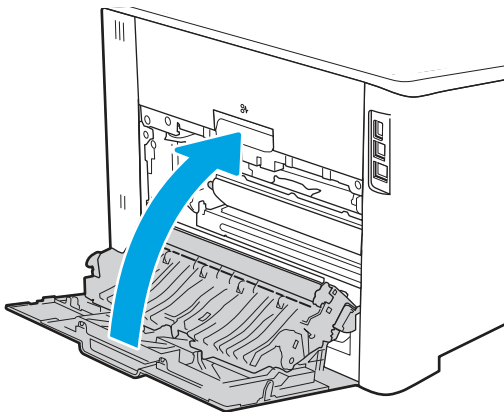

4. If the error persists, ensure the type and quality of the paper being used meets the HP specifications for the printer.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open the rear door and look for and clear any paper present or obstructions in the paper path.

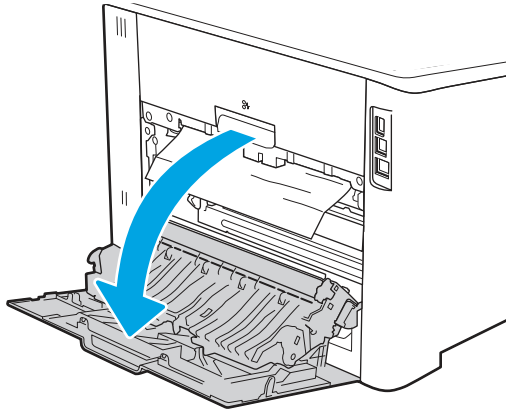


Figure 6-28 Check these areas



- b. Close the rear door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. Make sure the printer is located in an area meets the environmental specifications for the printer.
4. Adjust the paper guides in the tray. Ensure the front paper guide is pushing the paper against the back edge of the tray.
5. If the paper stopped before the fuser, complete these troubleshooting steps:
 - Check the ITB and T2 roller at the transfer area, ensure that everything is correctly seated and that there are no damaged parts. Replace the ITB or T2 roller as needed.

ITB part number: RM2-6454-000CN
Secondary transfer roller (T2) part number: RM2-6397-000CN
6. If the paper stopped in or at the fuser, complete these troubleshooting steps:

- Remove the fuser and inspect the fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.

Fuser assembly (110-127V) part number: RM2-6460-000CN

Fuser assembly (220-240V) part number: RM2-6461-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open the rear door and look for and clear any paper present or obstructions in the paper path.

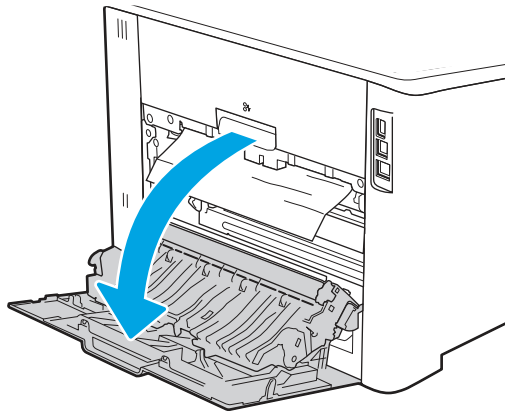


Figure 6-29 Check these areas



- b. Close the rear door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
 3. Make sure the printer is located in an area meets the environmental specifications for the printer.
 4. Adjust the paper guides in the tray. Ensure the front paper guide is pushing the paper against the back edge of the tray.
 5. If the paper stopped before the fuser, complete these troubleshooting steps:

- Check the ITB and T2 roller at the transfer area, ensure that everything is correctly seated and that there are no damaged parts. Replace the ITB or T2 roller as needed.

Intermediate transfer belt (ITB) assembly RM2-6454-000CN

For instructions: *Removal and replacement: Intermediate transfer belt* See the Repair Service Manual for this product.

Secondary transfer assembly RM2-6397-000CN

For instructions: *Removal and replacement: Secondary transfer assembly* See the Repair Service Manual for this product.

6. If the paper stopped in or at the fuser, complete these troubleshooting steps:

- Remove the fuser and inspect the fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.

Fuser assembly (110-127V) part number: RM2-6460-000CN

Fuser assembly (220-240V) part number: RM2-6461-000CN

For instructions: *Removal and replacement: Fuser assembly* See the Repair Service Manual for this product.

13.D1.Az

Paper is jammed in the upper area of the duplexer.

Paper stay jam

Z is a variable and can be any of the following 0-9 or A-F.

13.D1, 13.D3 jam error in the duplexer

Use the following procedure to check for paper in all possible jam locations in the automatic duplexer.

Recommended action for customers

When a jam occurs, the control panel displays a message and an animation that assists in clearing the jam.


- 13.D1.yz Paper jam in duplexer (upper area of duplexer)
- 13.D3.yz Paper jam in duplexer (lower area of duplexer)

y = A or D

x = 0-9 or A-F

1. Check the out area of the printer. If paper is extruding out slowly pull it out of the printer.

2. At the rear of the printer, open the duplexer.

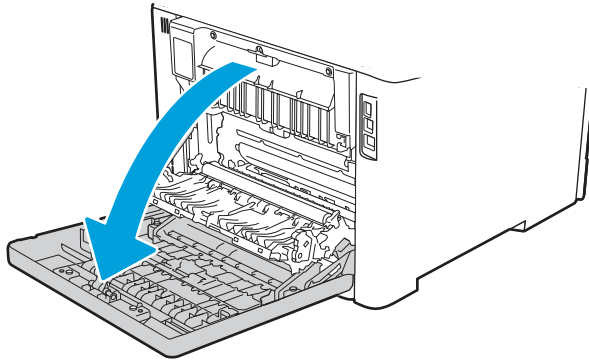

3. Remove any jammed or damaged sheets of paper from the rear door of the printer.





CAUTION:




The fuser is located above the rear door, and it is hot. Do not attempt to reach into the area above the rear door until the fuser is cool.




NOTE: There are 3 areas to check for paper, above the fuser, entering in the duplexer and the exit of the duplexer.

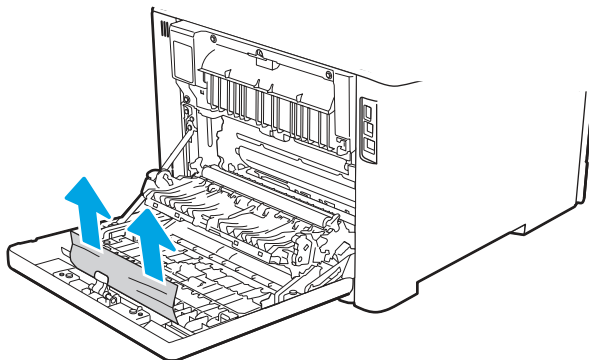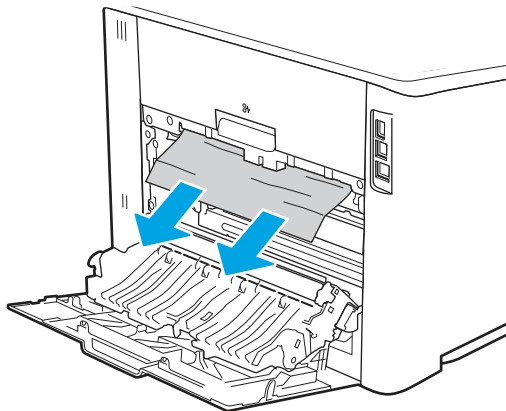

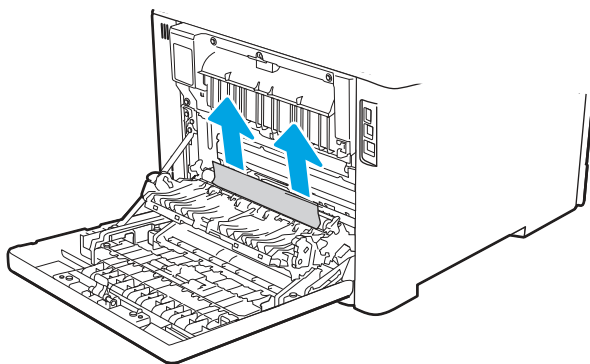

4. Close the duplexer.

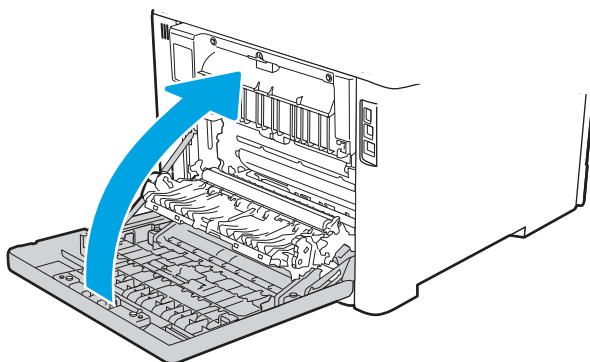


5. If the error persists, ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Check the out area of the printer. If paper is extruding out slowly pull it out of the printer.
2. At the rear of the printer, open the duplexer.

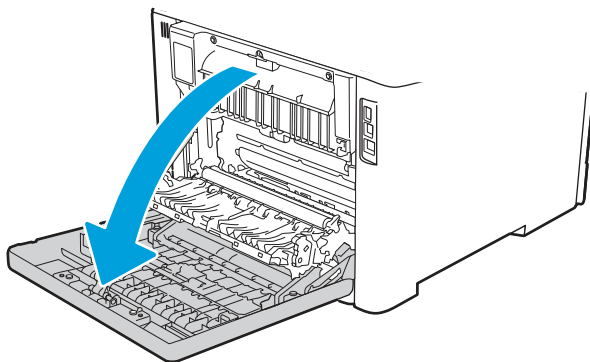

3. Remove any jammed or damaged sheets of paper from the read door of the printer..






CAUTION:




The fuser is located above the rear door, and it is hot. Do not attempt to reach into the area above the rear door until the fuser is cool.



NOTE: There are 3 areas to check for paper, above the fuser, entering in the duplexer and the exit of the duplexer.

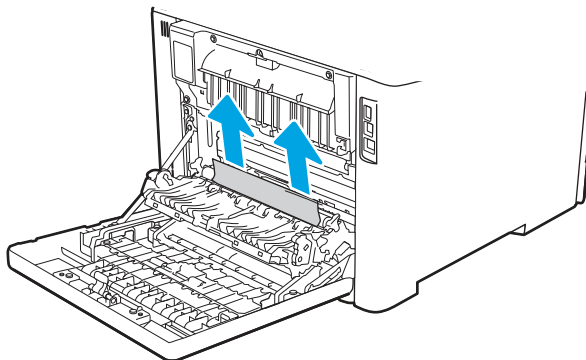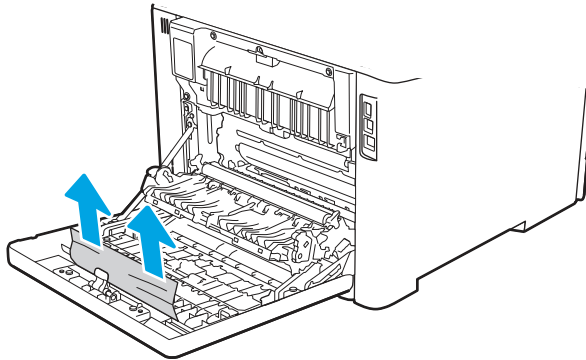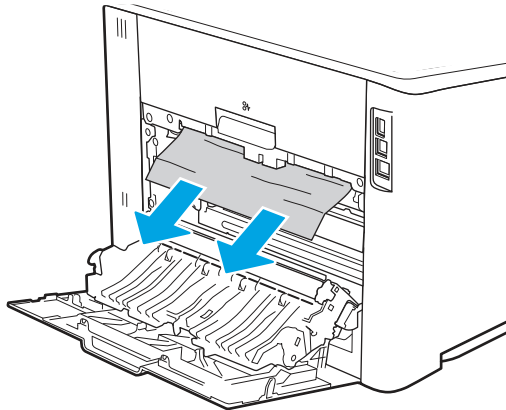

4. Close the duplexer.

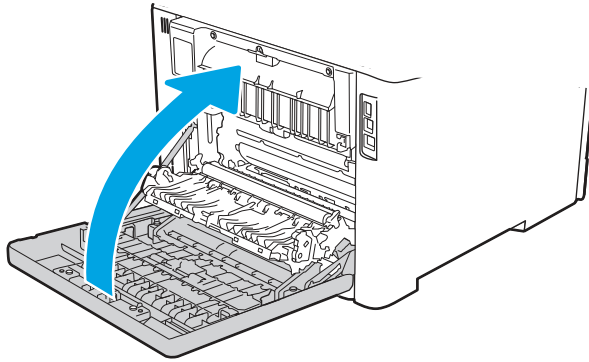

5. If the error persists, ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. Ensure the printer is located in an area meets the environmental specifications for the printer.
7. If the paper is stuck in the upper area of the duplexer, replace the reverse drive assembly.
Reverse drive assembly part number: RM2-6389-000CN
8. If the paper is jammed inside the duplex area of the rear door, replace the duplexing door assembly.
Duplexing door assembly part number: RM2-1838-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Follow the instructions on the control panel to clear the jammed paper.
2. Open the rear door and look for and clear any paper present or obstructions in the paper path.
3. If the error persists, ensure the type and quality of the paper being used meets the HP specifications for the printer.
4. Ensure the printer is located in an area meets the environmental specifications for the printer.
5. If the paper is stuck in the upper area of the duplexer, replace the reverse drive assembly.
Reverse drive assembly part number: RM2-6389-000CN
For instructions: *Removal and replacement: reversing drive assembly* See the Repair Service Manual for this product.
6. If the paper is jammed inside the duplex area of the rear door, replace the duplexing door assembly.
Duplexing door assembly part number: RM2-1838-000CN
For instructions: *Removal and replacement: Duplexing door assembly* See the Repair Service Manual for this product.

13.D1.Dz

Paper is jammed in the upper are of the duplexer.

Paper delay jam to duplex sensor.

Z is a variable and can be any of the following 0-9 or A-F.

13.D1, 13.D3 jam error in the duplexer

Use the following procedure to check for paper in all possible jam locations in the automatic duplexer.

Recommended action for customers


When a jam occurs, the control panel displays a message and an animation that assists in clearing the jam.

- 13.D1.yz Paper jam in duplexer (upper area of duplexer)
- 13.D3.yz Paper jam in duplexer (lower area of duplexer)

y = A or D

x = 0-9 or A-F


1. Check the out area of the printer. If paper is extruding out slowly pull it out of the printer.
2. At the rear of the printer, open the duplexer.

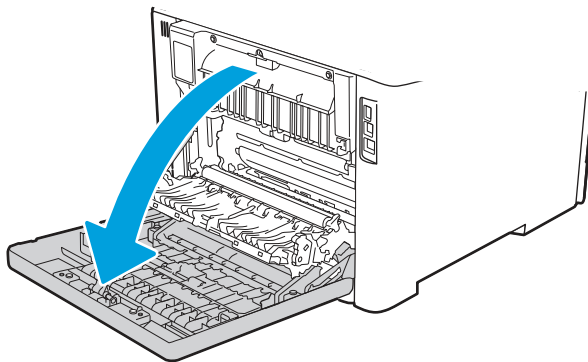


3. Remove any jammed or damaged sheets of paper from the rear door of the printer.

 **CAUTION:**  The fuser is located above the rear door, and it is hot. Do not attempt to reach into the area above the rear door until the fuser is cool.

 **NOTE:** There are 3 areas to check for paper, above the fuser, entering in the duplexer and the exit of the duplexer.

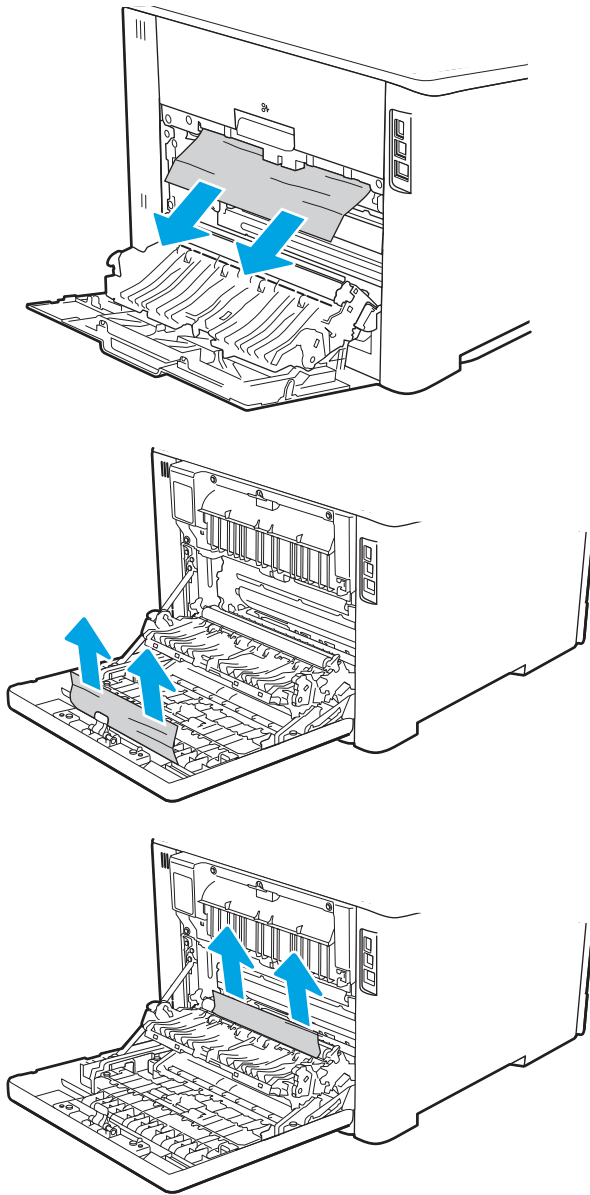

4. Close the duplexer.

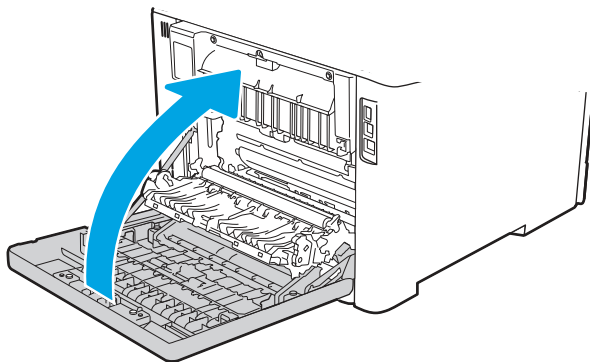


5. If the error persists, ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.


1. Check the out area of the printer. If paper is extruding out slowly pull it out of the printer.
2. At the rear of the printer, open the duplexer.


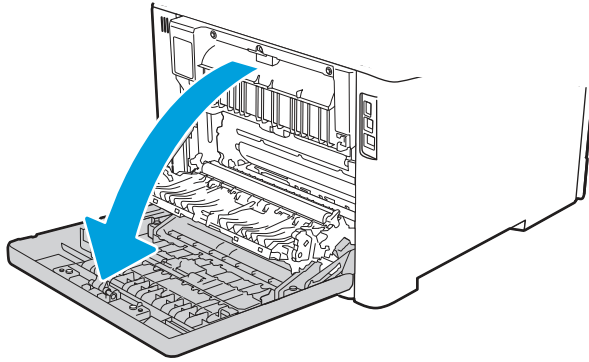


3. Remove any jammed or damaged sheets of paper from the rear door of the printer.


 **CAUTION:**  The fuser is located above the rear door, and it is hot. Do not attempt to reach into the area above the rear door until the fuser is cool.

 **NOTE:** There are 3 areas to check for paper, above the fuser, entering in the duplexer and the exit of the duplexer.

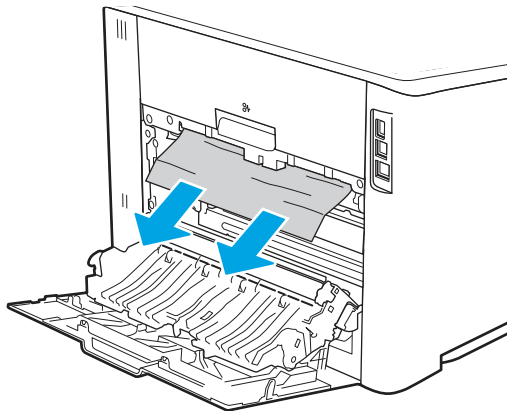

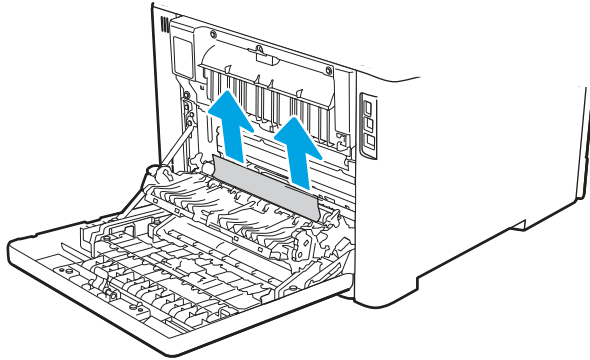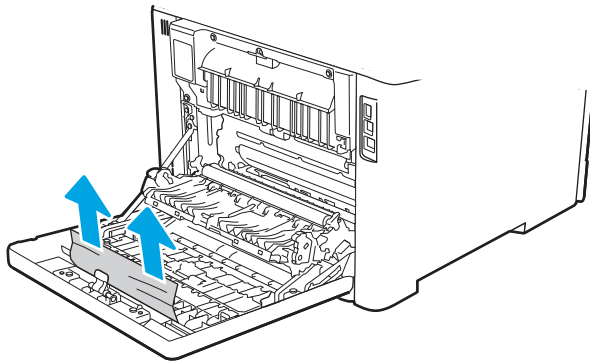

4. Close the duplexer.

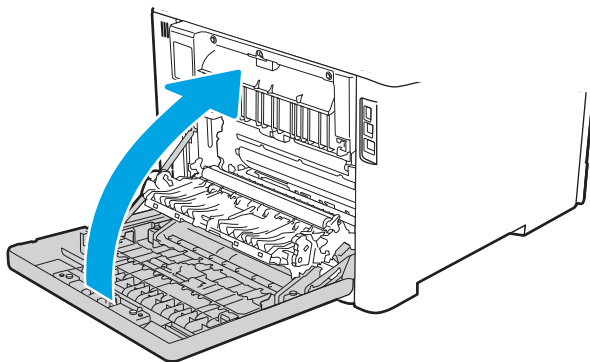

5. If the error persists, ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. Ensure the printer is located in an area meets the environmental specifications for the printer.
7. If the paper is stuck in the upper area of the duplexer, replace the reverse drive assembly.
Reverse drive assembly part number: RM2-6389-000CN
8. If the paper is jammed inside the duplex area of the rear door, replace the duplexing door assembly.
Duplexing door assembly part number: RM2-1838-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Follow the instructions on the control panel to clear the jammed paper.
2. Open the rear door and look for and clear any paper present or obstructions in the paper path.
3. If the error persists, ensure the type and quality of the paper being used meets the HP specifications for the printer.
4. Ensure the printer is located in an area meets the environmental specifications for the printer.
5. If the paper is stuck in the upper area of the duplexer, replace the reverse drive assembly.
Reverse drive assembly part number: RM2-6389-000CN
For instructions: *Removal and replacement: reversing drive assembly* See the Repair Service Manual for this product.
6. If the paper is jammed inside the duplex area of the rear door, replace the duplexing door assembly.
Duplexing door assembly part number: RM2-1838-000CN
For instructions: *Removal and replacement: Duplexing door assembly* See the Repair Service Manual for this product.

13.D3.Az

Paper is jammed in the duplexer area.

Paper stay jam at duplex re-pick sensor.

Z is a variable and can be any of the following 0-9 or A-F.

13.D1, 13.D3 jam error in the duplexer

Use the following procedure to check for paper in all possible jam locations in the automatic duplexer.

Recommended action for customers

When a jam occurs, the control panel displays a message and an animation that assists in clearing the jam.


- 13.D1.yz Paper jam in duplexer (upper area of duplexer)
- 13.D3.yz Paper jam in duplexer (lower area of duplexer)

y = A or D

x = 0-9 or A-F

1. Check the out area of the printer. If paper is extruding out slowly pull it out of the printer.

2. At the rear of the printer, open the duplexer.

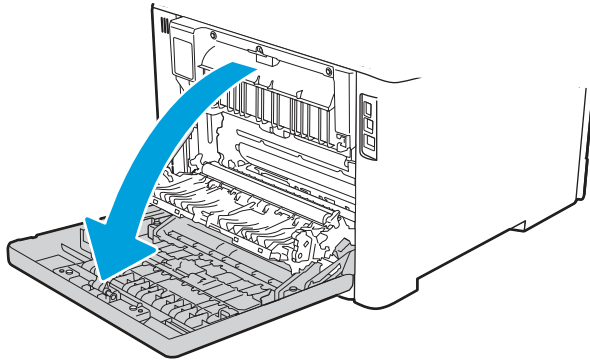

3. Remove any jammed or damaged sheets of paper from the rear door of the printer.





CAUTION:




The fuser is located above the rear door, and it is hot. Do not attempt to reach into the area above the rear door until the fuser is cool.




NOTE: There are 3 areas to check for paper, above the fuser, entering in the duplexer and the exit of the duplexer.

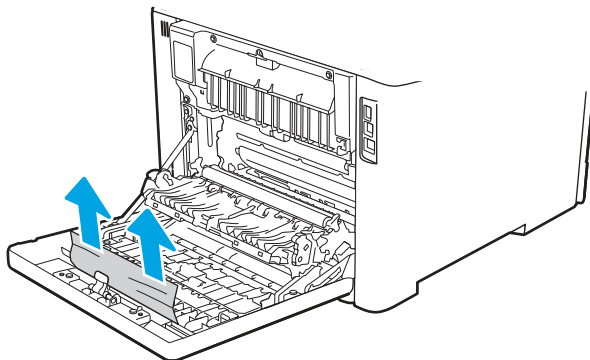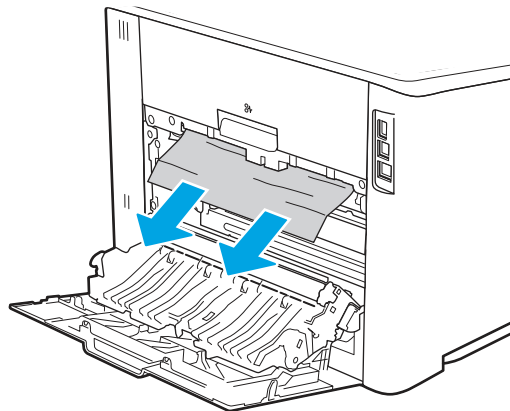

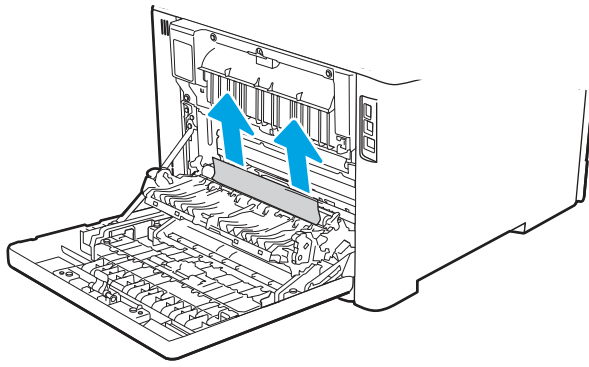

4. Close the duplexer.

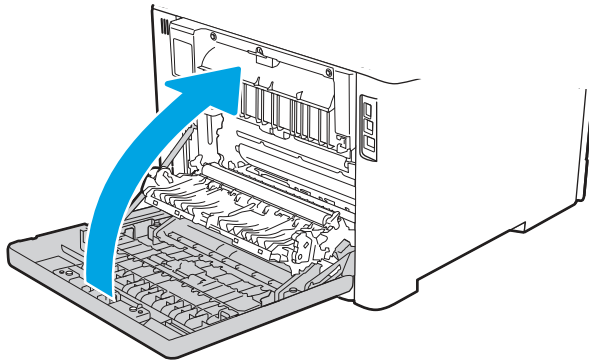


5. If the error persists, ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Check the out area of the printer. If paper is extruding out slowly pull it out of the printer.
2. At the rear of the printer, open the duplexer.

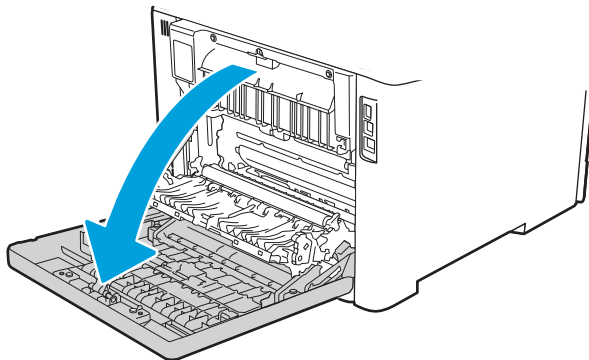

3. Remove any jammed or damaged sheets of paper from the rear door of the printer.





CAUTION:




The fuser is located above the rear door, and it is hot. Do not attempt to reach into the area above the rear door until the fuser is cool.



NOTE: There are 2 areas to check for paper, entering in the duplexer and the exit of the duplexer.

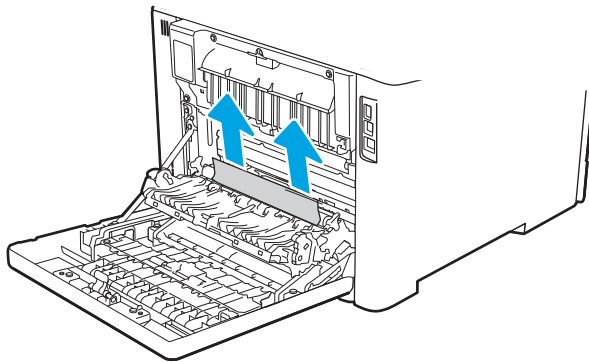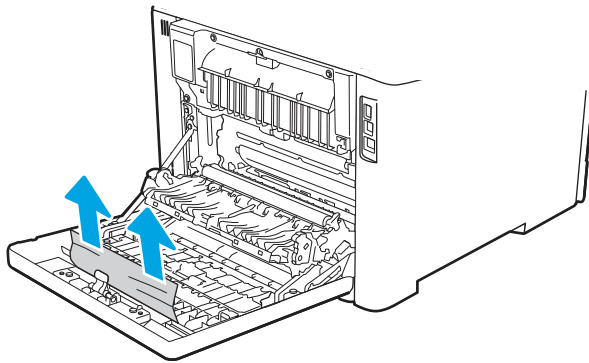

4. Close the duplexer.

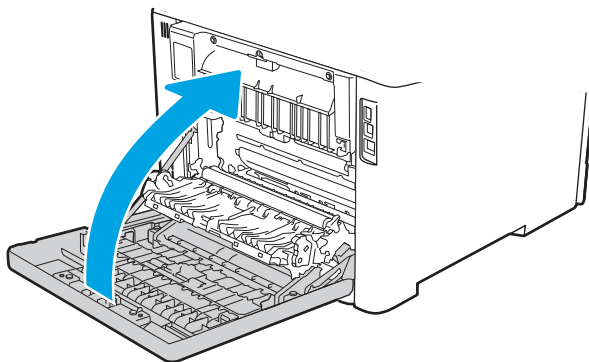

5. If the error persists, ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. Ensure the printer is located in an area meets the environmental specifications for the printer.


7. If the error persists, replace the duplexing door assembly.

Duplexing door assembly part number: RM2-1838-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.


1. Check the out area of the printer. If paper is extruding out slowly pull it out of the printer.
2. At the rear of the printer, open the duplexer.

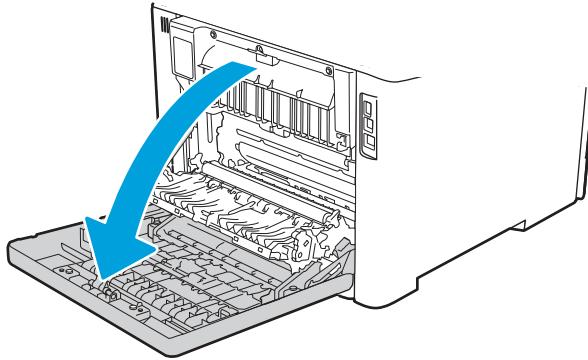


3. Remove any jammed or damaged sheets of paper from the rear door of the printer.


 **CAUTION:**  The fuser is located above the rear door, and it is hot. Do not attempt to reach into the area above the rear door until the fuser is cool.

 **NOTE:** There are 2 areas to check for paper, entering in the duplexer and the exit of the duplexer.

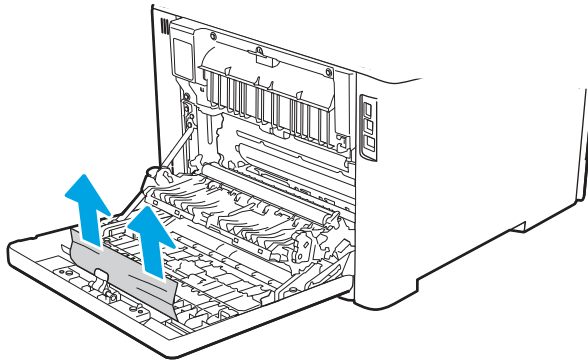

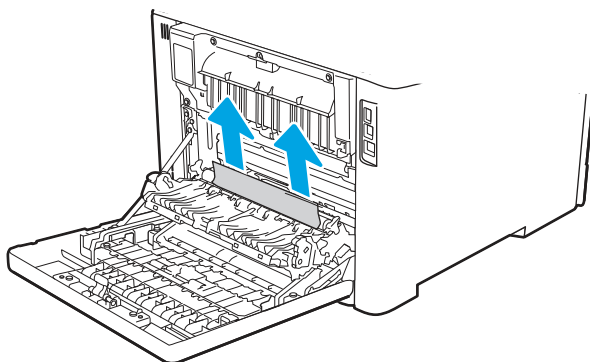

4. Close the duplexer.

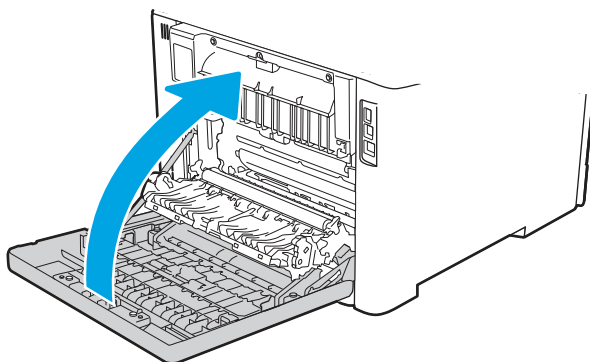

5. If the error persists, ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. Ensure the printer is located in an area meets the environmental specifications for the printer.
7. If the error persists, replace the duplexing door assembly.

Duplexing door assembly part number: RM2-1838-000CN

For instructions: *Removal and replacement: Duplexing door assembly* See the Repair Service Manual for this product.

13.D3.Dz

Paper is jammed in the duplexer area.

Paper delay jam at duplex re-pick sensor.

Z is a variable and can be any of the following 0-9 or A-F.

13.D1, 13.D3 jam error in the duplexer

Use the following procedure to check for paper in all possible jam locations in the automatic duplexer.

Recommended action for customers


When a jam occurs, the control panel displays a message and an animation that assists in clearing the jam.

- 13.D1.yz Paper jam in duplexer (upper area of duplexer)
- 13.D3.yz Paper jam in duplexer (lower area of duplexer)

y = A or D

x = 0-9 or A-F


1. Check the out area of the printer. If paper is extruding out slowly pull it out of the printer.
2. At the rear of the printer, open the duplexer.


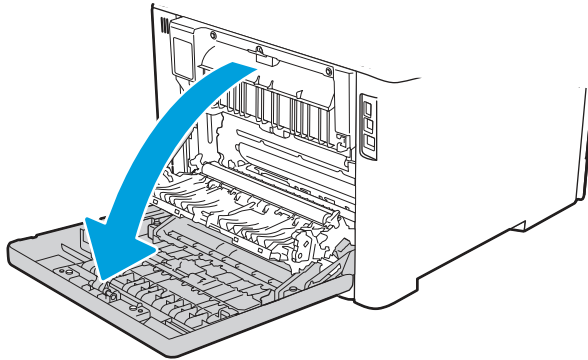


3. Remove any jammed or damaged sheets of paper from the rear door of the printer.


 **CAUTION:**  The fuser is located above the rear door, and it is hot. Do not attempt to reach into the area above the rear door until the fuser is cool.

 **NOTE:** There are 3 areas to check for paper, above the fuser, entering in the duplexer and the exit of the duplexer.

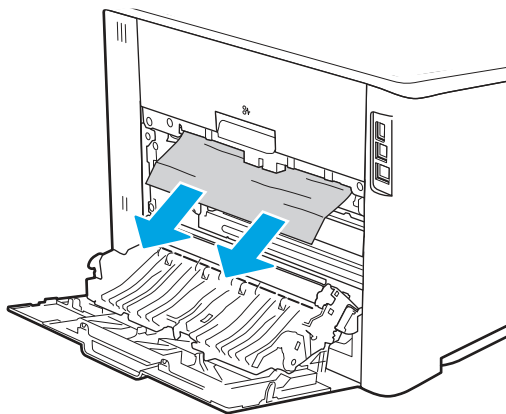

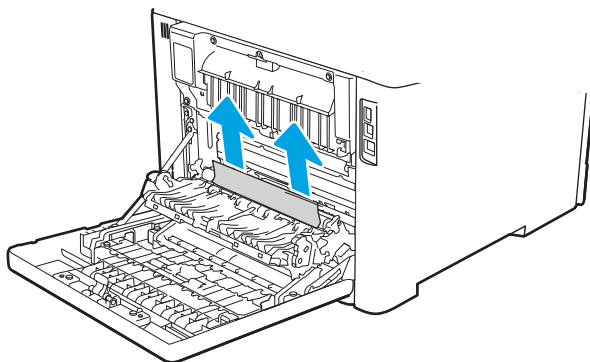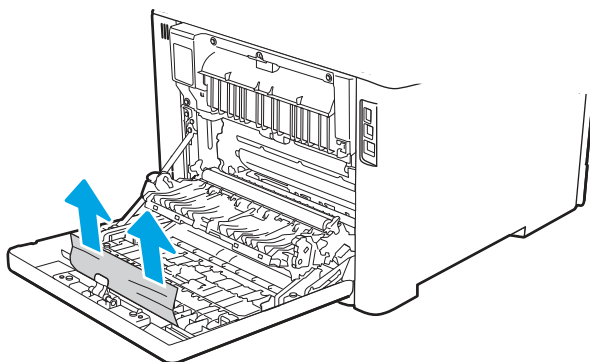

4. Close the duplexer.

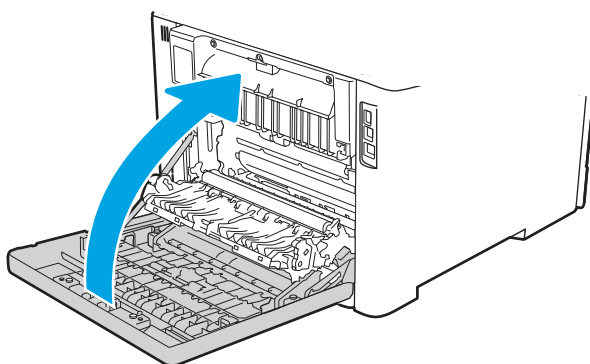


5. If the error persists, ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Check the out area of the printer. If paper is extruding out slowly pull it out of the printer.

2. At the rear of the printer, open the duplexer.

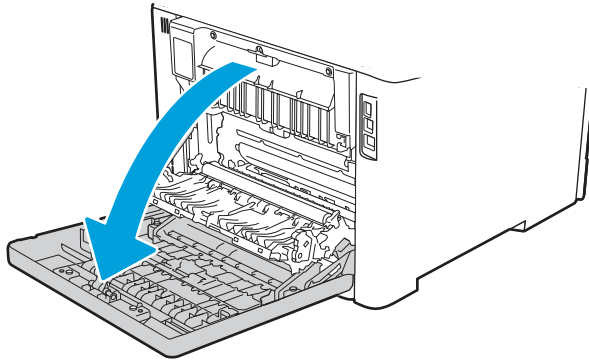

3. Remove any jammed or damaged sheets of paper from the rear door of the printer.





CAUTION:




The fuser is located above the rear door, and it is hot. Do not attempt to reach into the area above the rear door until the fuser is cool.



NOTE: There are 2 areas to check for paper, entering in the duplexer and the exit of the duplexer.

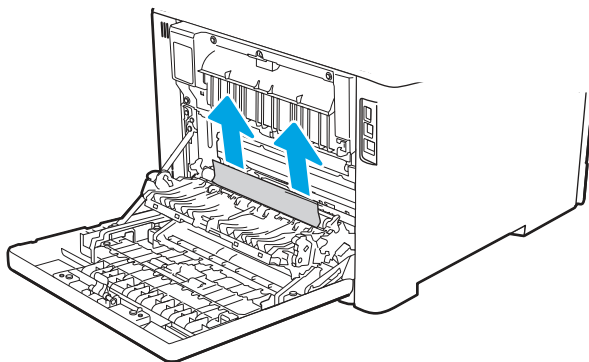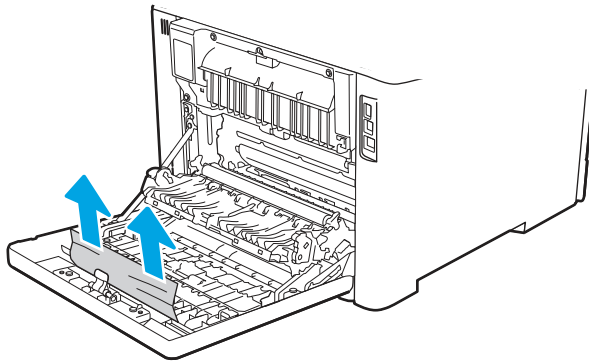

4. Close the duplexer.

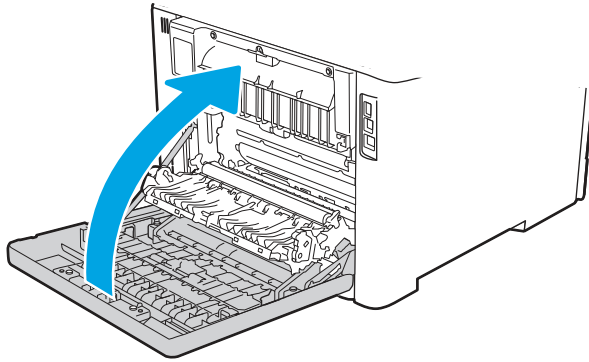


5. If the error persists, ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. Ensure the printer is located in an area meets the environmental specifications for the printer.
7. If the error persists, replace the duplexing door assembly.

Duplexing door assembly part number: RM2-1838-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Check the out area of the printer. If paper is extruding out slowly pull it out of the printer.
2. At the rear of the printer, open the duplexer.

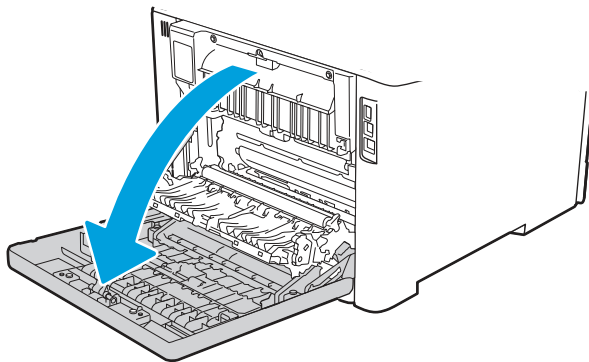

3. Remove any jammed or damaged sheets of paper from the rear door of the printer.





CAUTION:




The fuser is located above the rear door, and it is hot. Do not attempt to reach into the area above the rear door until the fuser is cool.



NOTE: There are 2 areas to check for paper, entering in the duplexer and the exit of the duplexer.

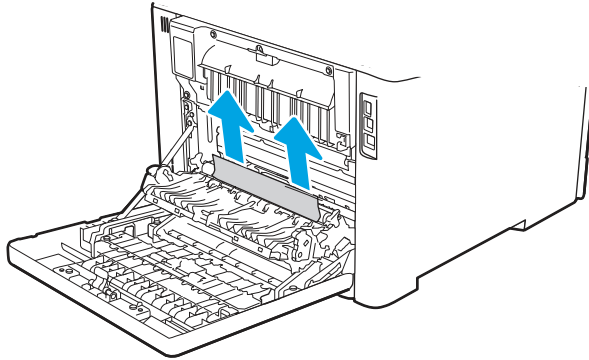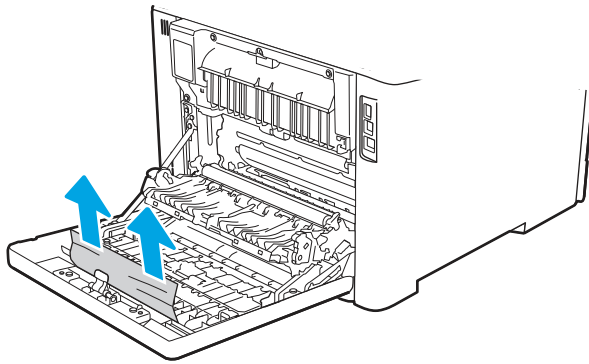

4. Close the duplexer.

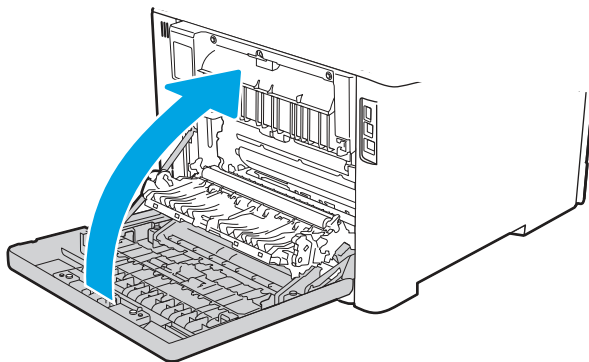

5. If the error persists, ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. Ensure the printer is located in an area meets the environmental specifications for the printer.
7. If the error persists, replace the duplexing door assembly.

Duplexing door assembly part number: RM2-1838-000CN

For instructions: *Removal and replacement: Duplexing door assembly* See the Repair Service Manual for this product.

20.WX.YZ error messages

20.* errors

Errors in the 20.* family are related to the printer memory. The page might require more memory than the printer has available.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Touch the **OK** button to continue.
2. Reduce the page complexity.
3. Add product memory.

20.00.00 Insufficient memory <device>

The printer does not have enough memory to print the page.

Event log message 20.00.00.

The printer received more data than can fit in the available memory. You might have tried to transfer too many macros, soft fonts, or complex graphics.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to print the transferred data. Some data might be lost. Reduce the page complexity or add printer memory.

21.WX.YZ error messages

21.* errors

Errors in the 21.* family are related to the printer memory and complexity of the image being printed. The page might require more memory than the printer has available.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Touch the **OK** button to clear the error.
2. Reduce the page complexity.
3. Add product memory.

30.WX.YZ error messages

30 . 01 . 08 Home position error

The scanner optic failed to return to the home position.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. Verify that the (flat flexible cables (FFC's) (callout 1) to the scanner assembly are seated correctly on the formatter board and the scanner.

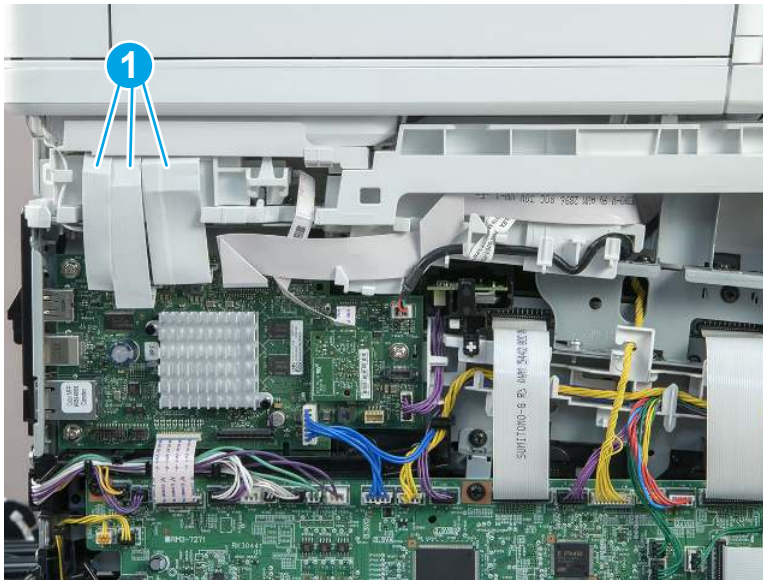

4. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

30 . 01 . 14 Scan system EEPROM error

SCB EEPROM error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. Verify that the (flat flexible cables (FFC's) (callout 1) to the scanner assembly are seated correctly on the formatter board and the scanner.

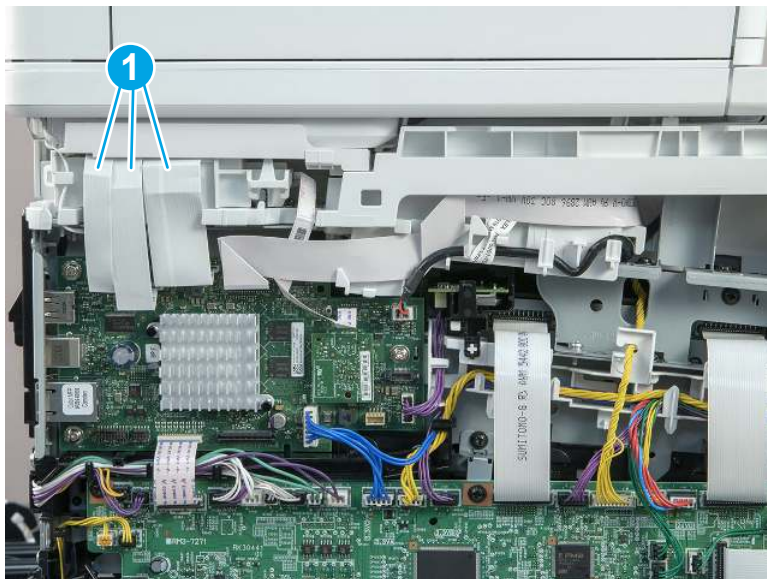

4. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

30.01.41 Scanner error

The formatter lost connections with the SCB or communication was corrupted.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. Verify that the (flat flexible cables (FFC's) (callout 1) to the scanner assembly are seated correctly on the formatter board and the scanner.

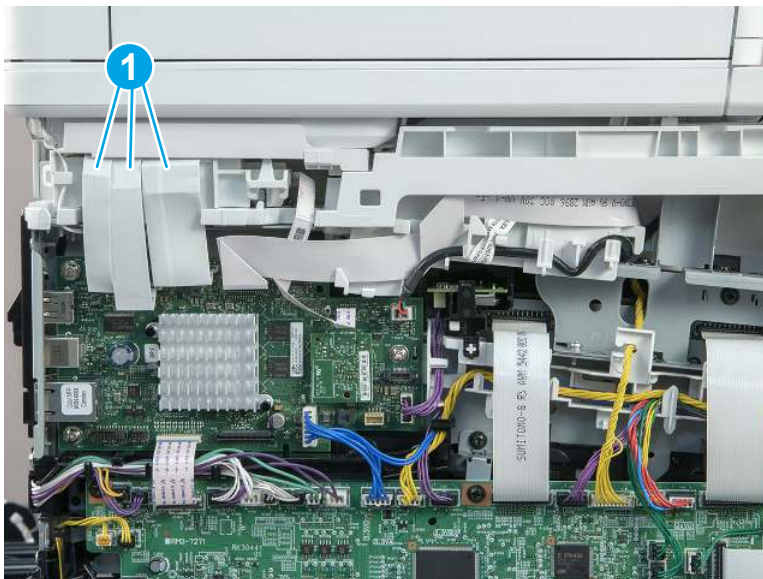

4. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

5. If the error persists, replace the formatter.

Table 6-9 Part numbers

Description	Part number	Model numbers
Formatter (SFP)	3PZ95-67903	M455dn, E45028dn
Formatter (China/India; SFP)	3PZ95-67904	M455dn, E45028dn
Formatter (MFP)	3QA55-67901	M480f, E47528f

Table 6-9 Part numbers (continued)

Description	Part number	Model numbers
Formatter (China/India; MFP)	3QA55-67902	M480f, E47528f

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

30.01.43 Scanner error

SCB memory failure.

The scanner control board (SCB) cannot communicate with the flatbed scanner motor.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. Verify that the (flat flexible cables (FFC's) (callout 1) to the scanner assembly are seated correctly on the formatter board and the scanner.

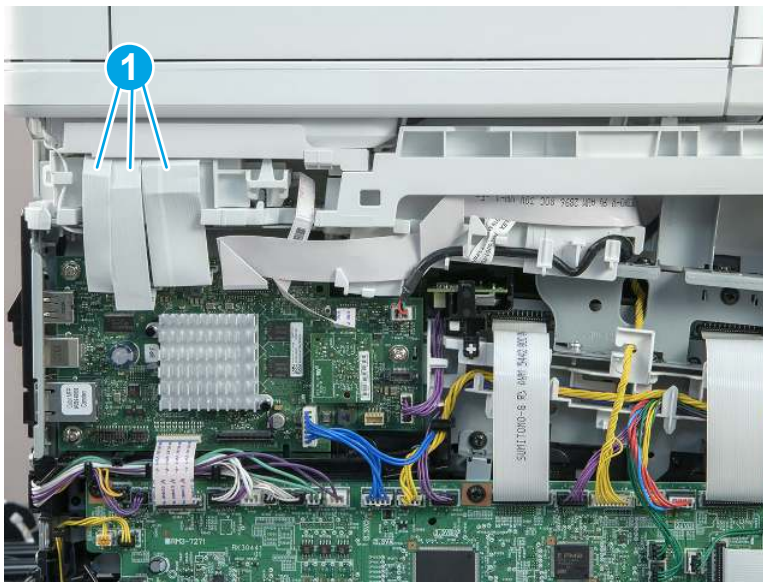

4. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

5. If the error persists, replace the formatter.

Table 6-10 Part numbers

Description	Part number	Model numbers
Formatter (SFP)	3PZ95-67903	M455dn, E45028dn
Formatter (China/India; SFP)	3PZ95-67904	M455dn, E45028dn
Formatter (MFP)	3QA55-67901	M480f, E47528f
Formatter (China/India; MFP)	3QA55-67902	M480f, E47528f

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

30.01.44 Scanner error

SCB communication error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. Verify that the (flat flexible cables (FFC's) (callout 1) to the scanner assembly are seated correctly on the formatter board and the scanner.

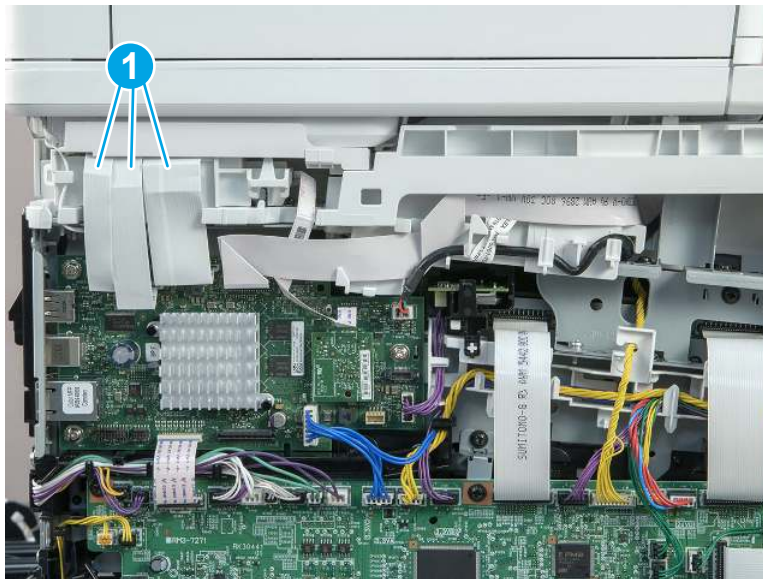

4. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

30.01.46 Scanner error

Scanner firmware error.

Formatter can't find ONYX ASIC. Power OFF/ON is required.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. Verify that the (flat flexible cables (FFC's) (callout 1) to the scanner assembly are seated correctly on the formatter board and the scanner.

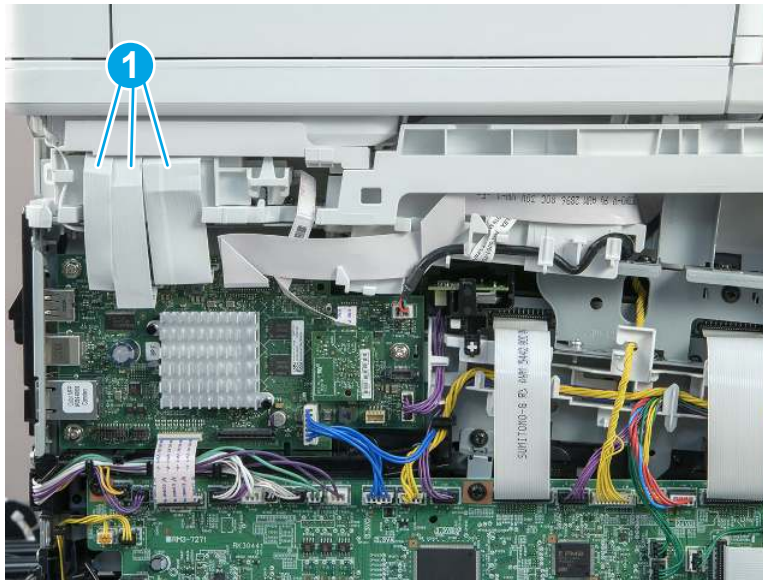

4. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

30 . 03 . 14 Scanner error

Front side scanner EEPROM (NVM) error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. Verify that the (flat flexible cables (FFC's) (callout 1) to the scanner assembly are seated correctly on the formatter board and the scanner.

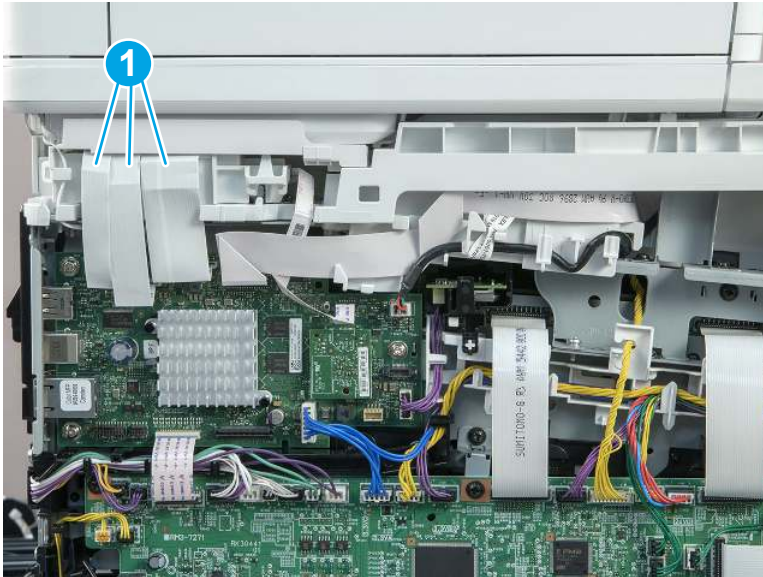

4. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

30.03.20 Scanner error

Front side scanner (flatbed scanner) not detected.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. Verify that the (flat flexible cables (FFC's) (callout 1) to the scanner assembly are seated correctly on the formatter board and the scanner.

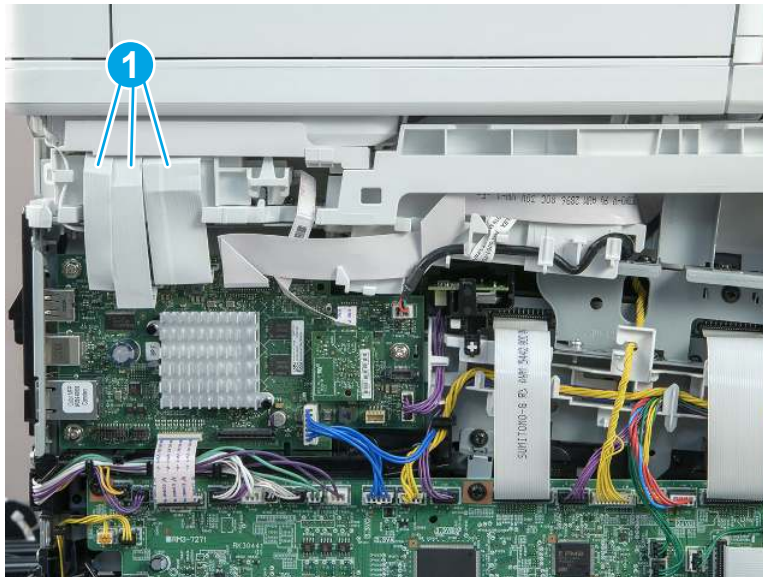

4. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

30.03.22 Scanner failure

Front side illumination calibration failure.

The scan module cannot see the illumination module, or the illumination is marginal.

The optical assembly might not be parked under the calibration strip.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. Verify that the (flat flexible cables (FFC's) (callout 1) to the scanner assembly are seated correctly on the formatter board and the scanner.

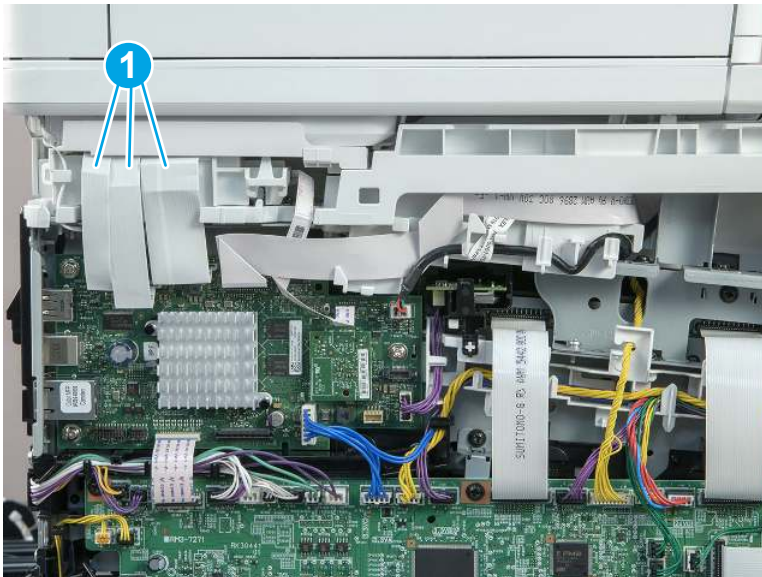

4. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

30 . 03 . 23 Scanner failure

Flatbed alignment calibration failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. Verify that the (flat flexible cables (FFC's) (callout 1) to the scanner assembly are seated correctly on the formatter board and the scanner.

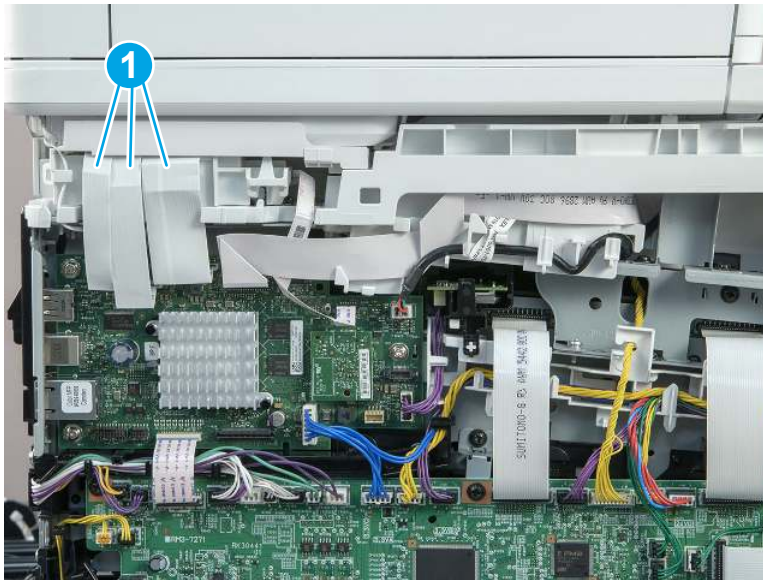

4. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

30.03.30 Scanner Failure

Flatbed motor shutdown.

The scanner control board (SCB) cannot communicate with the flatbed scanner motor.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. Verify that the (flat flexible cables (FFC's) (callout 1) to the scanner assembly are seated correctly on the formatter board and the scanner.

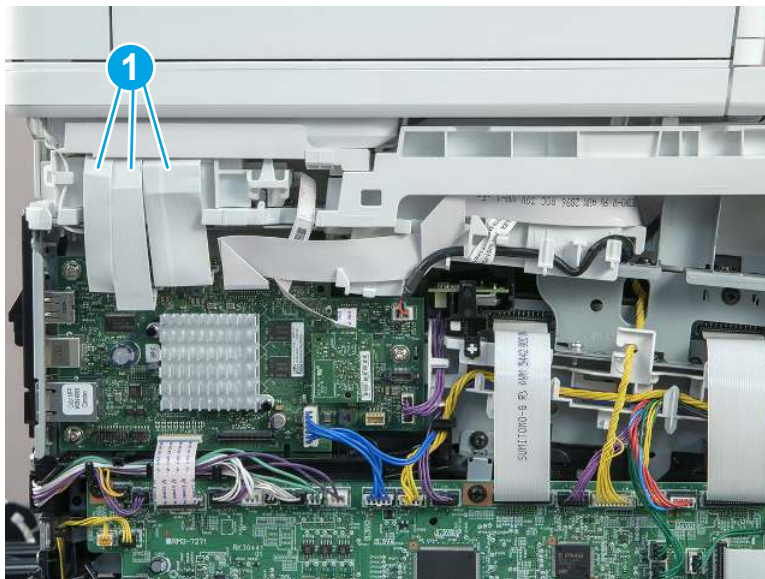

4. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

30 . 03 . 45 Scanner Error To continue turn off then on

SCB firmware assertion failure. SCB firmware assertion controls the scan head motor.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. Verify that the (flat flexible cables (FFC's) (callout 1) to the scanner assembly are seated correctly on the formatter board and the scanner.

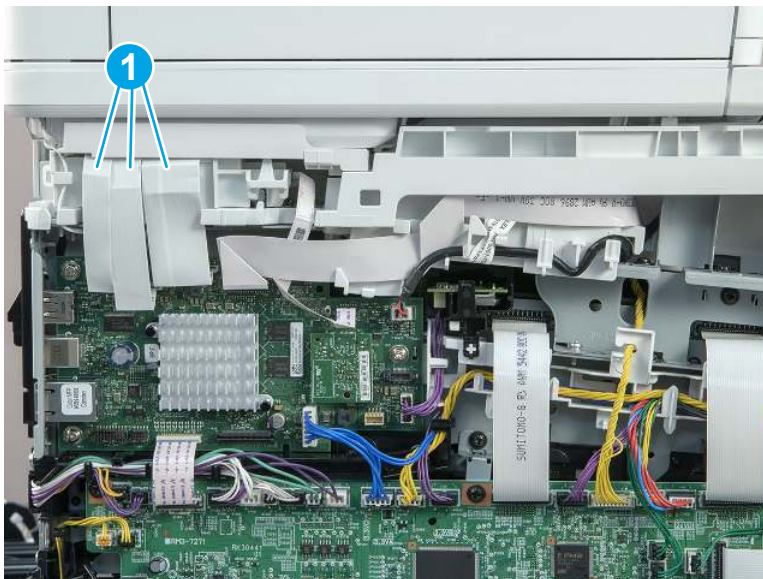

4. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

31.WX.YZ error messages

31 . 01 . 47 Document feeder not detected

The document feeder was not detected. The document feeder might not be connected.

The flatbed glass is still available for scanning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

31 . 03 . 14 Backside scanner EEPROM error

Backside scanner EEPROM (NVM) error.

A non-fatal error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the issue persists, integrated scanner assembly (ISA).

Integrated scanner assembly part number: 3PZ55-60117


Recommended action for onsite technician

Follow these troubleshooting steps in the order presented.

1. Turn the printer off and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. Verify that the (flat flexible cables (FFC's) to the scanner assembly are seated correctly on the formatter board.

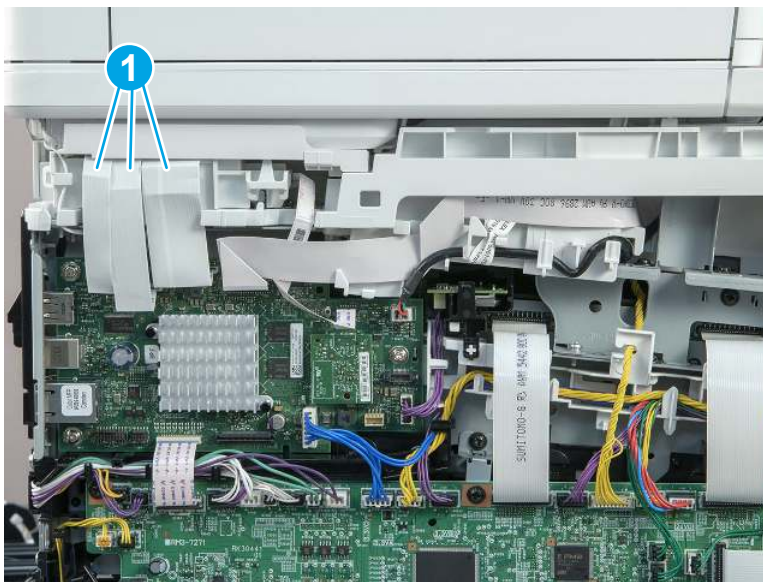

4. If the issue persists, replace the integrated scanning assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

31 . 03 . 20 backside scanner not detected

Backside scanner is not detected.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the issue persists, integrated scanner assembly (ISA).

Integrated scanner assembly part number: 3PZ55-60117


Recommended action for onsite technician

Follow these troubleshooting steps in the order presented.

1. Turn the printer off and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. Verify that the (flat flexible cables (FFC's) to the scanner assembly are seated correctly on the formatter board.

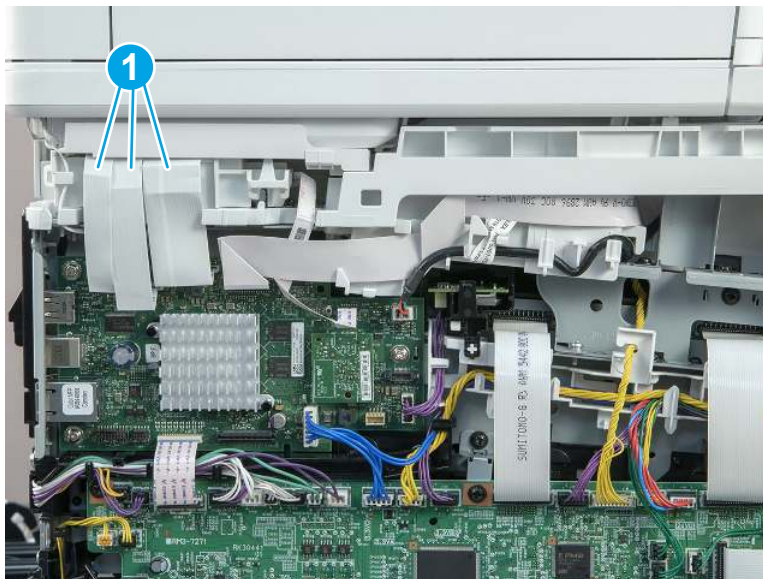

4. If the issue persists, replace the integrated scanning assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

31.03.22 Scanner calibration failure

Backside illumination calibration failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the issue persists, integrated scanner assembly (ISA).

Integrated scanner assembly part number: 3PZ55-60117


Recommended action for onsite technician

Follow these troubleshooting steps in the order presented.

1. Turn the printer off and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. Verify that the (flat flexible cables (FFC's) to the scanner assembly are seated correctly on the formatter board.

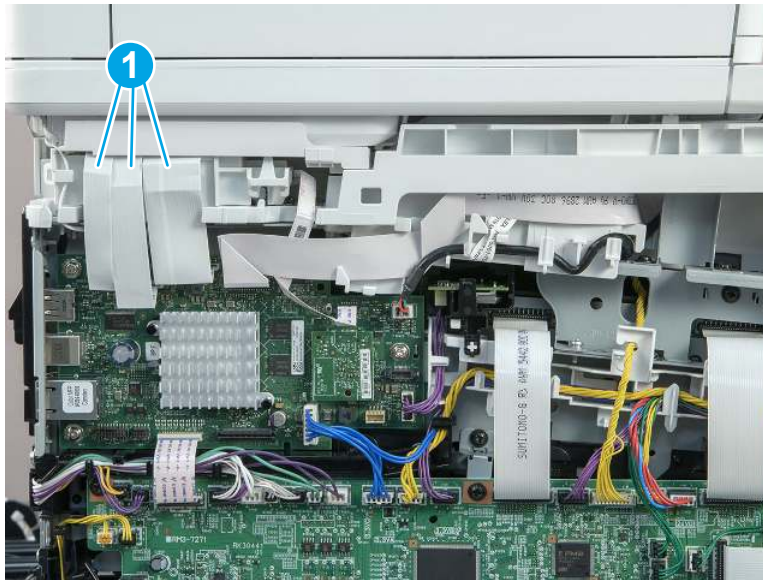

4. If the issue persists, replace the integrated scanning assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

31 . 03 . 31 Document feeder motor stall

The document feeder feed motor is not turning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the issue persists, integrated scanner assembly (ISA).

Integrated scanner assembly part number: 3PZ55-60117


Recommended action for onsite technician

Follow these troubleshooting steps in the order presented.

1. Turn the printer off and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. Verify that the (flat flexible cables (FFC's) to the scanner assembly are seated correctly on the formatter board.

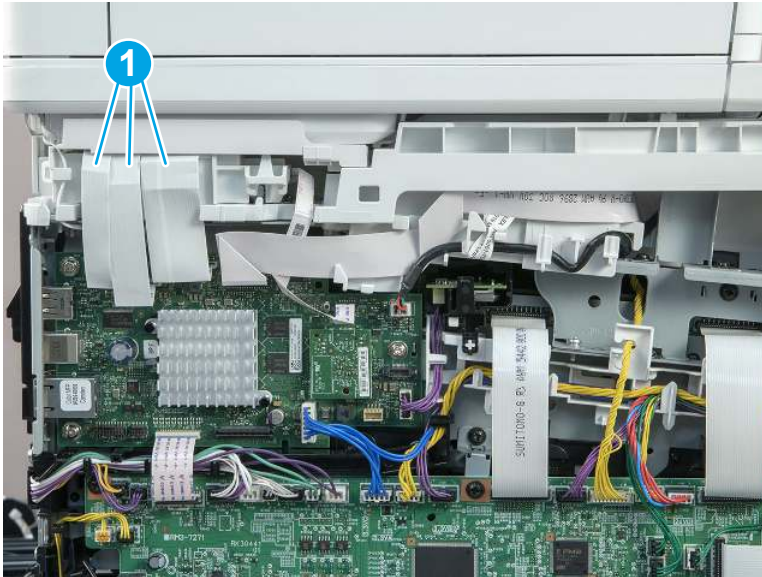

4. If the issue persists, replace the integrated scanning assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

31.13.01 Document feeder pick error

Document feeder job error, pick error.

Paper pick was initiated, but the page didn't make it to the pick success sensor.

31.13 jam error in the document feeder

Use the following procedure to check for paper in all possible jam locations related to the document feeder.

Recommended action for customers

When a jam occurs, the control panel displays a message and an animation that assists in clearing the jam.

- 31.13.01 Jam in document feeder


- 31.13.02 Jam in document feeder
- 31.13.13 Jam in document feeder

In addition to the instructions provided below




NOTE: The printer model referenced in this video might be different from your printer model, but the steps to clear the jam are the same.


1. Open the document feeder cover.

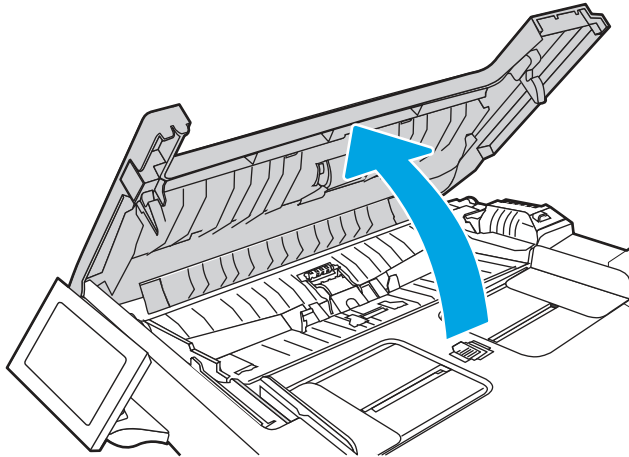


2. Remove any jammed paper.

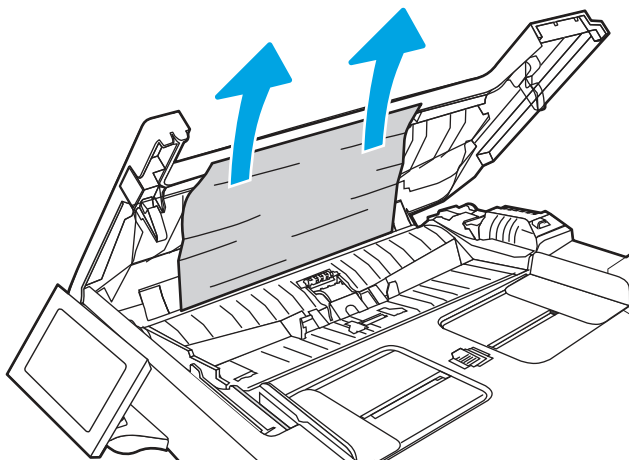


3. Close the document feeder cover.

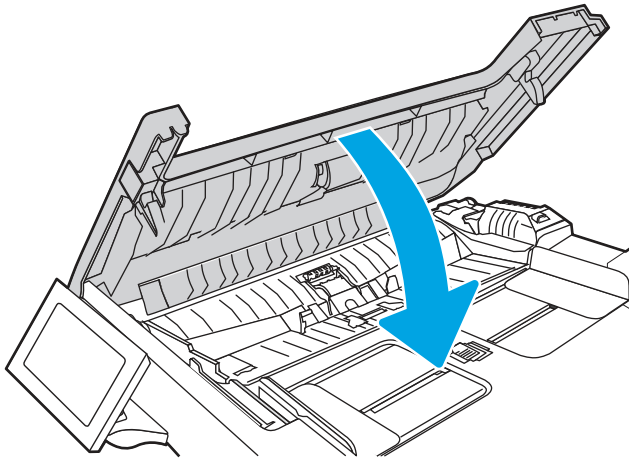


4. Lift the document feeder input tray to provide better access to the document feeder output bin, and then remove any jammed paper from the output area.

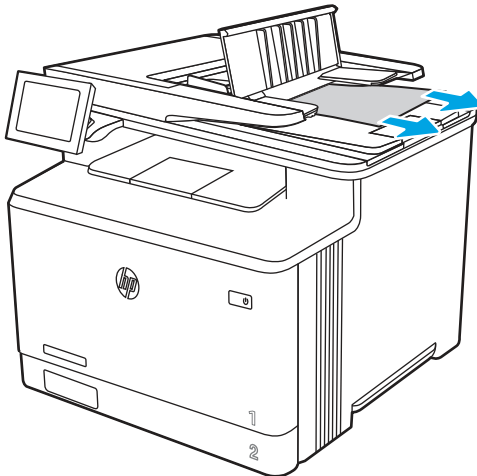

5. Open the scanner lid. If paper is jammed behind the white plastic backing, gently pull it out.

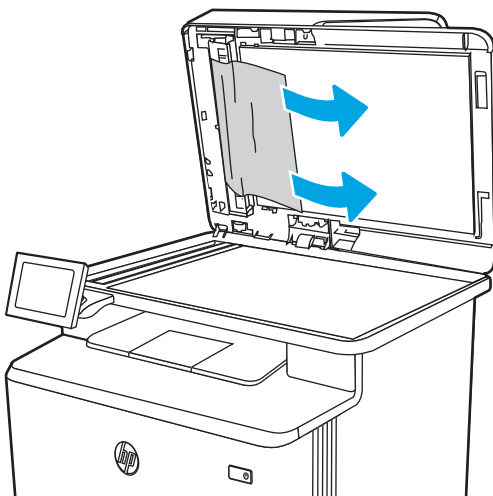


6. Lower the scanner lid.

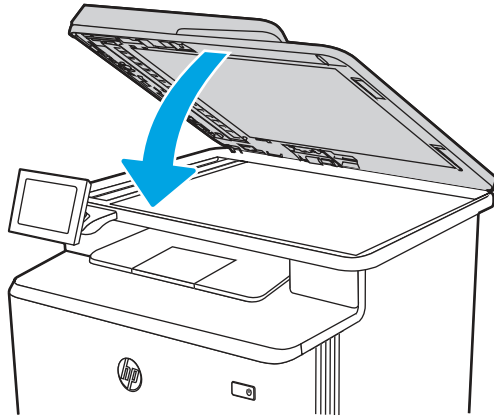

7. If the error persists, ensure that the paper meets the document feeder (ADF) specifications for the printer.
8. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.

Figure 6-30 Set the ADF guides

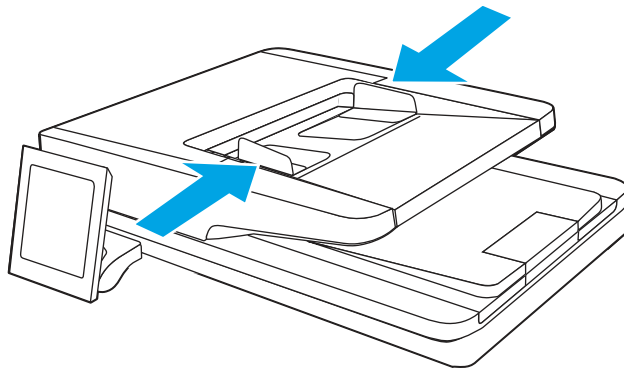

 **NOTE:** To avoid jams, make sure the guides in the document feeder input tray are adjusted correctly. Remove all staples, paper clips, or tape from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

9. Open the document feeder and check and clean the Document Feeder Kit rollers and separation pad by removing any visible lint or dust from each of the feed rollers and the separation pad using

a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.



 **NOTE:** Lift up the roller assembly to access and clean the second roller

10. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

 **NOTE:** To avoid jams, make sure the guides in the document feeder input tray are adjusted tightly against the document. Remove all staples and paper clips from original documents.


 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

Recommended action for call-center agents


Follow these troubleshooting steps in the order presented.

 **IMPORTANT:** **DO NOT** replace any parts before reviewing the firmware version. (See step 7)


1. Open the document feeder cover.

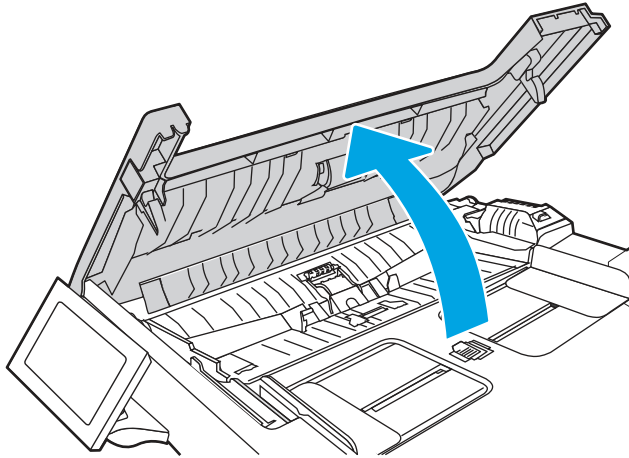


2. Remove any jammed paper.

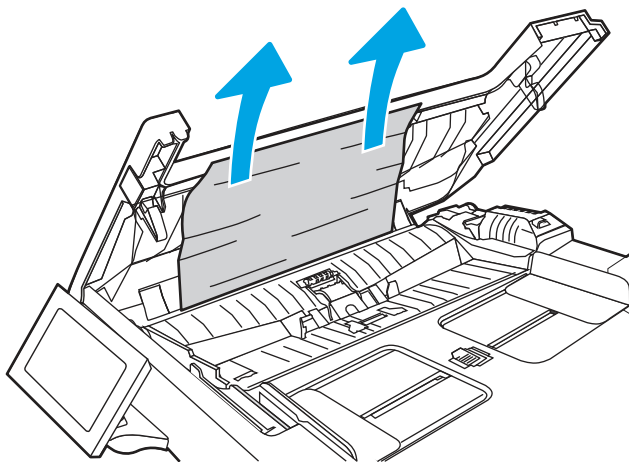


3. Close the document feeder cover.

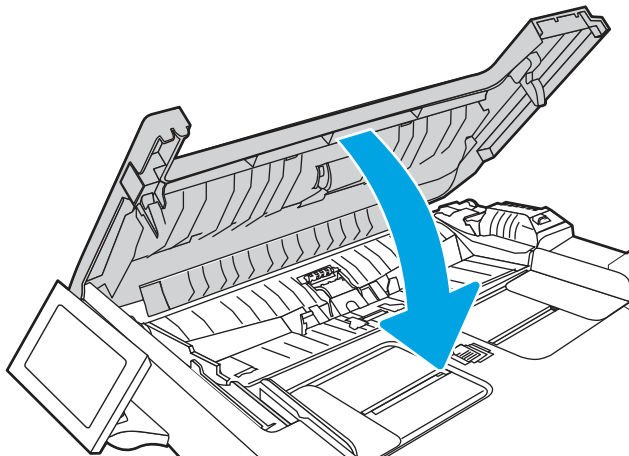


4. Lift the document feeder input tray to provide better access to the document feeder output bin, and then remove any jammed paper from the output area.

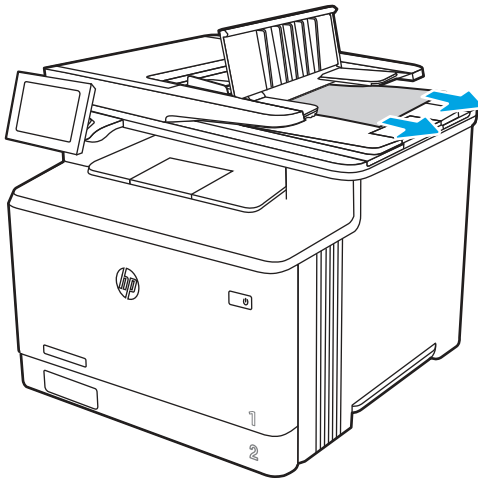

5. Open the scanner lid. If paper is jammed behind the white plastic backing, gently pull it out.

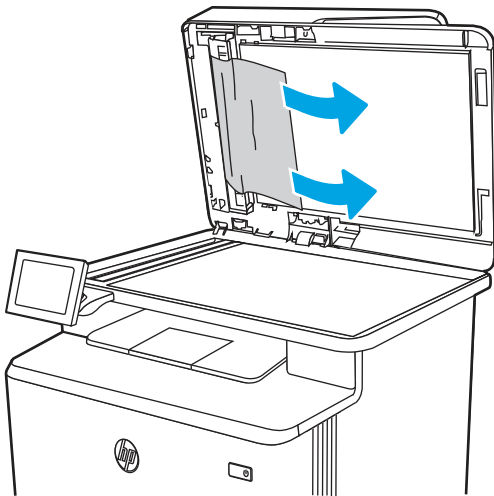

6. Lower the scanner lid.

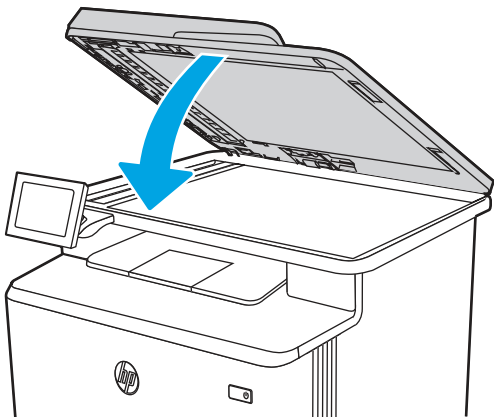


7. If no actual paper jam is found, check the firmware version. If not FW is not 5.8 or greater, upgrade the firmware.

 **NOTE:** On some units, when making copies or scanning documents using the Automatic Document Feeder, a jam error occurs with the event code of 31.13.02. This is the result of a spring in the ADF moving up and down too fast (bouncing) and is reported to firmware as a jam in the ADF, even when there is no actual jam.

Firmware version 5.8 helps resolve this issue.

8. If there error persists, ensure that the paper meets the document feeder (ADF) specifications for the printer.
9. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.

Figure 6-31 Set the ADF guides

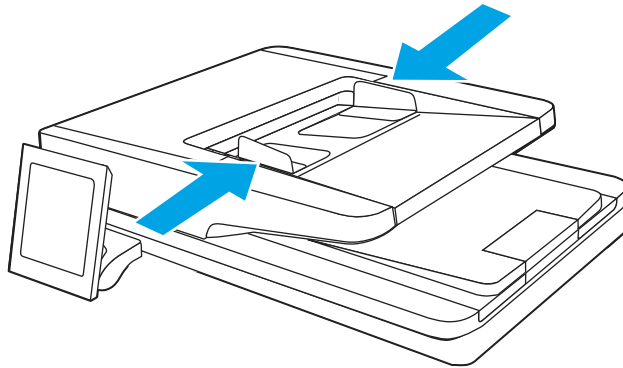


 **NOTE:** To avoid jams, make sure the guides in the document feeder input tray are adjusted correctly. Remove all staples, paper clips, or tape from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

10. Check and clean the Document Feeder Kit rollers and separation pad by removing any visible lint or dust from each of the feed rollers and the separation pad using a clean lint-free cloth moistened

with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

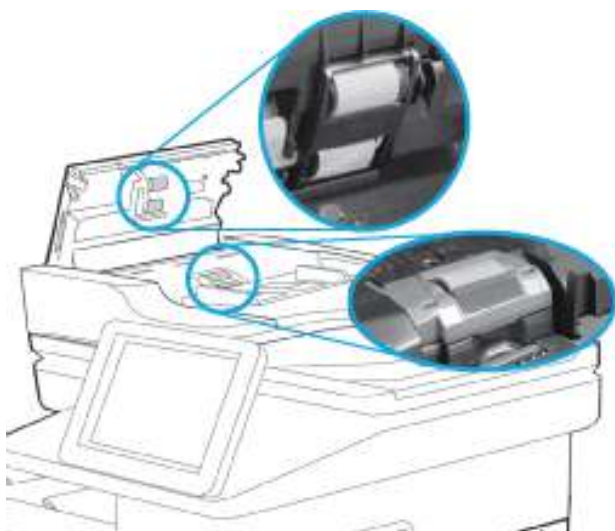

 **NOTE:** Lift up the roller assembly to access and clean the second roller

11. If the issue persists, Replace the document feeder top cover assembly.

Document feeder top cover assembly part number: W1A77-67903

 **NOTE:** This part contains the rollers.

12. If the issue persists, integrated scanner assembly (ISA).

Integrated scanner assembly part number: 3PZ55-60117

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

 **IMPORTANT:** **DO NOT** replace any parts before reviewing the firmware version. (See step 2)


1. Open the document feeder lid, pull the sheets back into the input tray, and then resume the job.
2. If no actual paper jam is found, check the firmware version. If not FW is not 5.8 or greater, upgrade the firmware.

 **NOTE:** On some units, when making copies or scanning documents using the Automatic Document Feeder, a jam error occurs with the event code of 31.13.02. This is the result of a spring in the ADF moving up and down too fast (bouncing) and is reported to firmware as a jam in the ADF, even when there is no actual jam.

Firmware version 5.8 helps resolve this issue.

3. Check the paper guides and make sure that they are set to the correct paper width.

Figure 6-32 Set the ADF guides

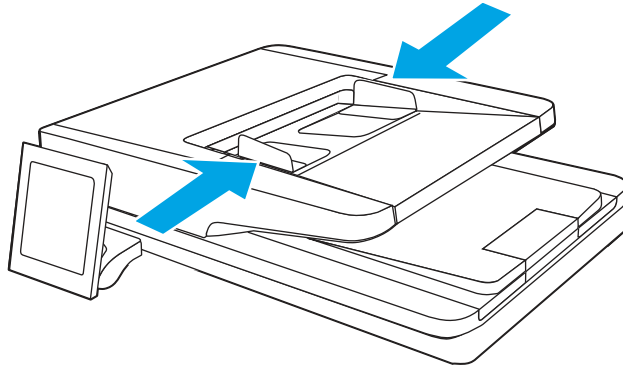

4. Make sure that the input tray is not overloaded and the tray guides are correctly aligned to both edges of the paper.
5. Verify that the paper meets the printer specifications.
6. Check and clean the Document Feeder Kit rollers and separation pad by removing any visible lint or dust from each of the feed rollers and the separation pad using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.



 **NOTE:** Lift up the roller assembly to access and clean the second roller

7. If the issue persists, Replace the document feeder top cover assembly.

Document feeder top cover assembly part number: W1A77-67903

 **NOTE:** This part contains the rollers.

8. If the issue persists, replace the integrated scanning assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

31.13.02 Jam in document feeder

Document feeder jam error.

The paper passed the pick-success sensor, and then jammed in the automatic document feeder paper path.

This issue might be describe as the following:

- Automatic document feeder jam
- ADF Jamming
- ADF paper jam
- Jams in document feeder

31.13 jam error in the document feeder

Use the following procedure to check for paper in all possible jam locations related to the document feeder.

Recommended action for customers

When a jam occurs, the control panel displays a message and an animation that assists in clearing the jam.


- 31.13.01 Jam in document feeder
- 31.13.02 Jam in document feeder
- 31.13.13 Jam in document feeder

In addition to the instructions provided below




NOTE: The printer model referenced in this video might be different from your printer model, but the steps to clear the jam are the same.


1. Open the document feeder cover.

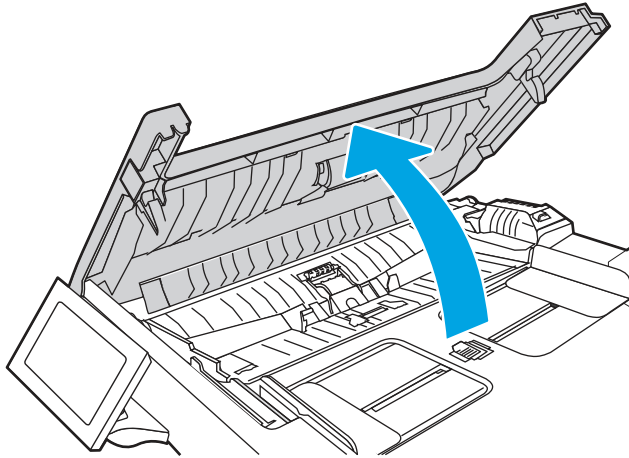


2. Remove any jammed paper.

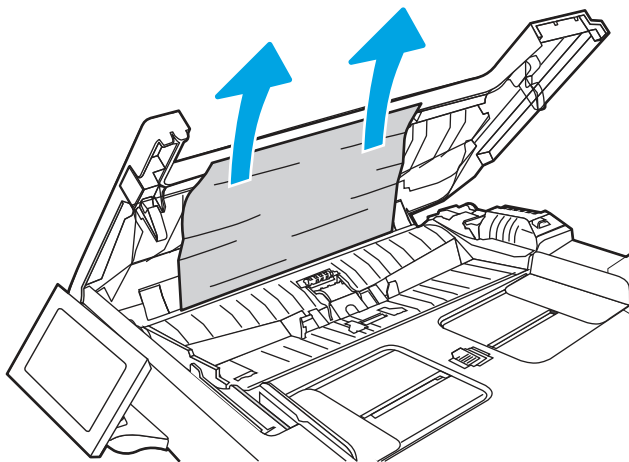


3. Close the document feeder cover.

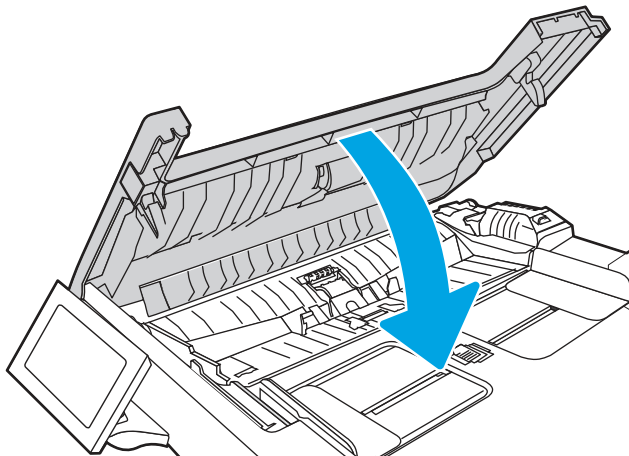


4. Lift the document feeder input tray to provide better access to the document feeder output bin, and then remove any jammed paper from the output area.

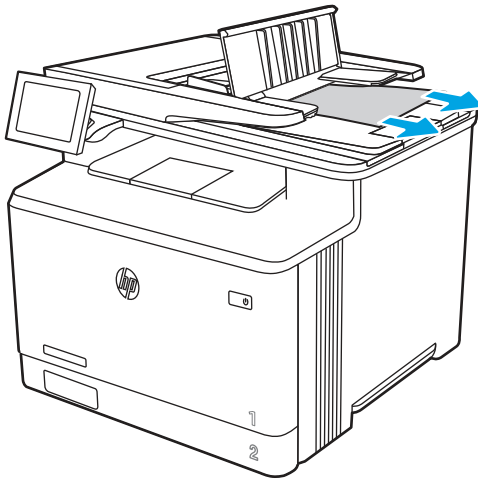

5. Open the scanner lid. If paper is jammed behind the white plastic backing, gently pull it out.

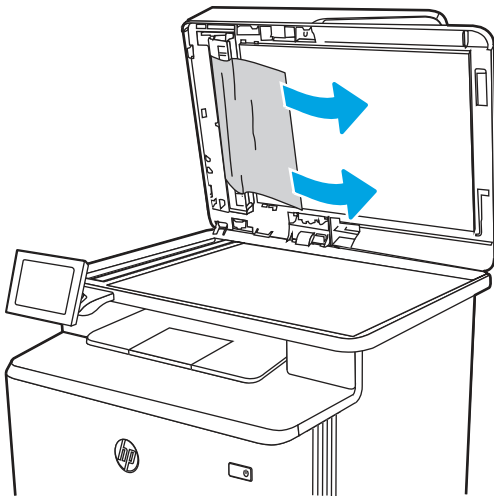


6. Lower the scanner lid.

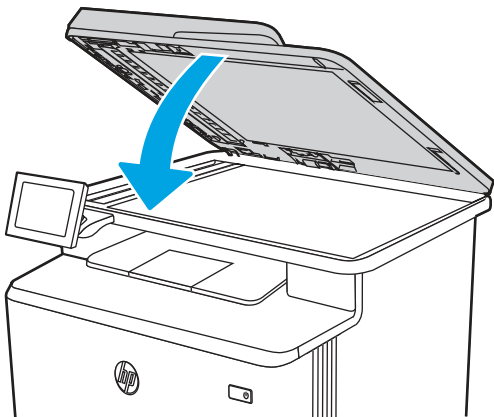

7. If the error persists, ensure that the paper meets the document feeder (ADF) specifications for the printer.
8. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.

Figure 6-33 Set the ADF guides

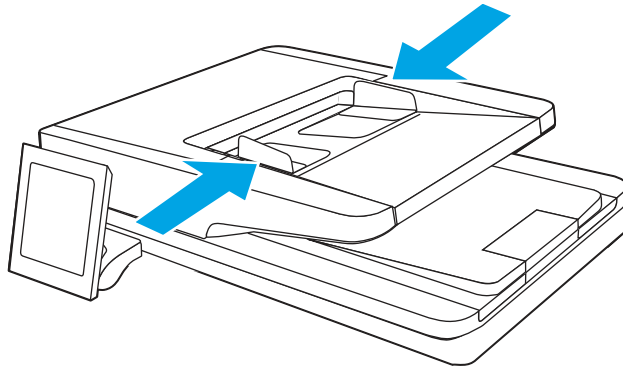

 **NOTE:** To avoid jams, make sure the guides in the document feeder input tray are adjusted correctly. Remove all staples, paper clips, or tape from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

9. Open the document feeder and check and clean the Document Feeder Kit rollers and separation pad by removing any visible lint or dust from each of the feed rollers and the separation pad using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.



 **NOTE:** Lift up the roller assembly to access and clean the second roller

10. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

 **NOTE:** To avoid jams, make sure the guides in the document feeder input tray are adjusted tightly against the document. Remove all staples and paper clips from original documents.


 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

Recommended action for call-center agents


Follow these troubleshooting steps in the order presented.

 **IMPORTANT:** **DO NOT** replace any parts before reviewing the firmware version. (See step 7)


1. Open the document feeder cover.

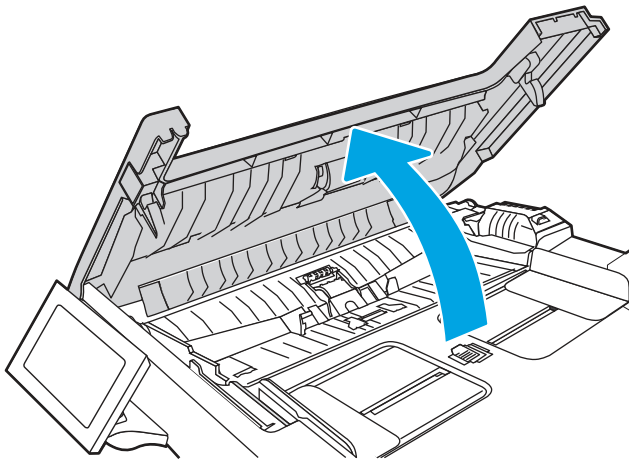


2. Remove any jammed paper.

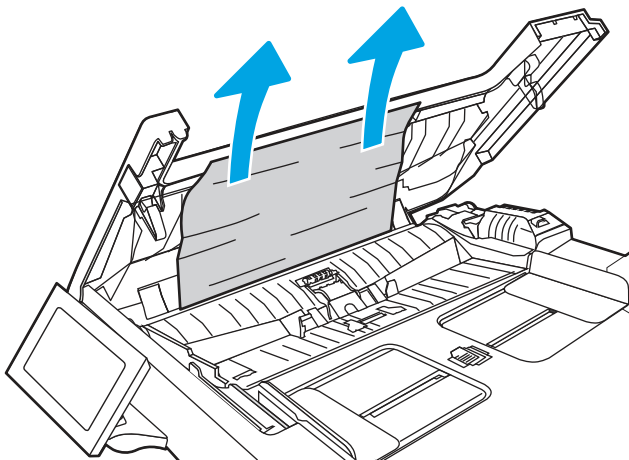


3. Close the document feeder cover.

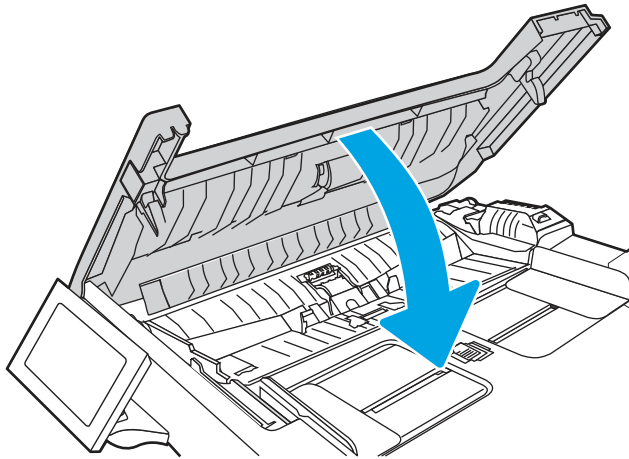


4. Lift the document feeder input tray to provide better access to the document feeder output bin, and then remove any jammed paper from the output area.

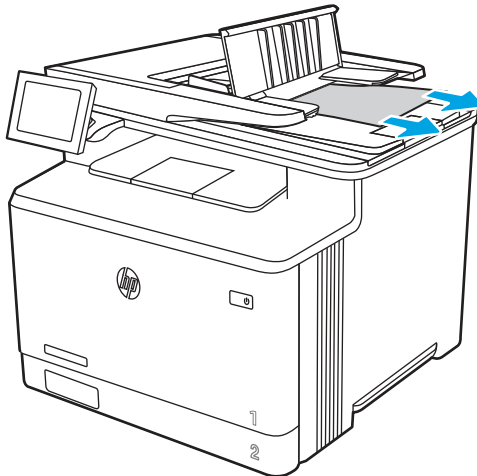

5. Open the scanner lid. If paper is jammed behind the white plastic backing, gently pull it out.

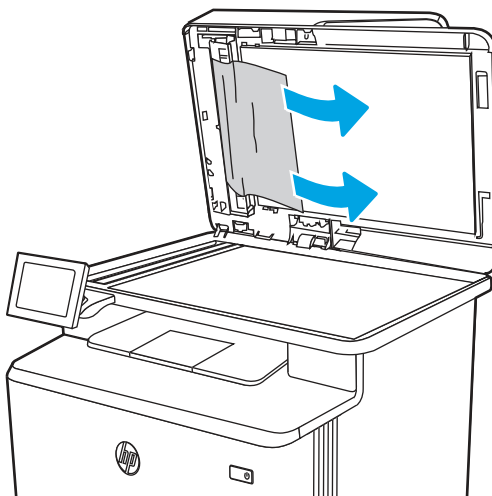

6. Lower the scanner lid.

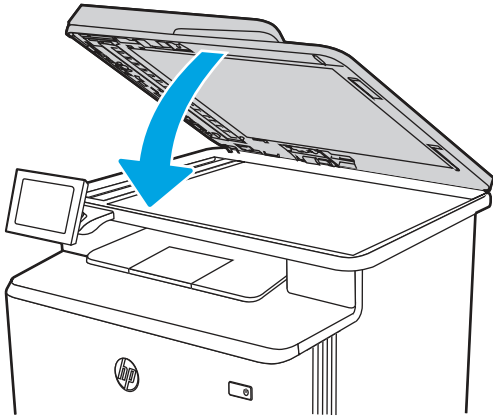

7. If no actual paper jam is found, check the firmware version. If not FW is not 5.8 or greater, upgrade the firmware.




NOTE: On some units, when making copies or scanning documents using the Automatic Document Feeder, a jam error occurs with the event code of 31.13.02. This is the result of a spring in the ADF moving up and down too fast (bouncing) and is reported to firmware as a jam in the ADF, even when there is no actual jam.

Firmware version 5.8 helps resolve this issue.

8. If there error persists, ensure that the paper meets the document feeder (ADF) specifications for the printer.
9. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.

Figure 6-34 Set the ADF guides

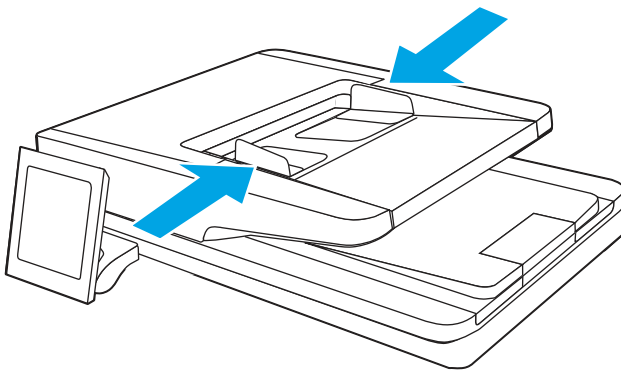

NOTE: To avoid jams, make sure the guides in the document feeder input tray are adjusted correctly. Remove all staples, paper clips, or tape from original documents.



NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

10. Check and clean the Document Feeder Kit rollers and separation pad by removing any visible lint or dust from each of the feed rollers and the separation pad using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.



 **NOTE:** Lift up the roller assembly to access and clean the second roller

11. If the issue persists, Replace the document feeder top cover assembly.

Document feeder top cover assembly part number: W1A77-67903

 **NOTE:** This part contains the rollers.

12. If the issue persists, integrated scanner assembly (ISA).

Integrated scanner assembly part number: 3PZ55-60117

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

 **IMPORTANT:** **DO NOT** replace any parts before reviewing the firmware version. (See step 2)


1. Open the document feeder lid, pull the sheets back into the input tray, and then resume the job.
2. If no actual paper jam is found, check the firmware version. If not FW is not 5.8 or greater, upgrade the firmware.

 **NOTE:** On some units, when making copies or scanning documents using the Automatic Document Feeder, a jam error occurs with the event code of 31.13.02. This is the result of a spring in the ADF moving up and down too fast (bouncing) and is reported to firmware as a jam in the ADF, even when there is no actual jam.

Firmware version 5.8 helps resolve this issue.

3. Check the paper guides and make sure that they are set to the correct paper width.

Figure 6-35 Set the ADF guides

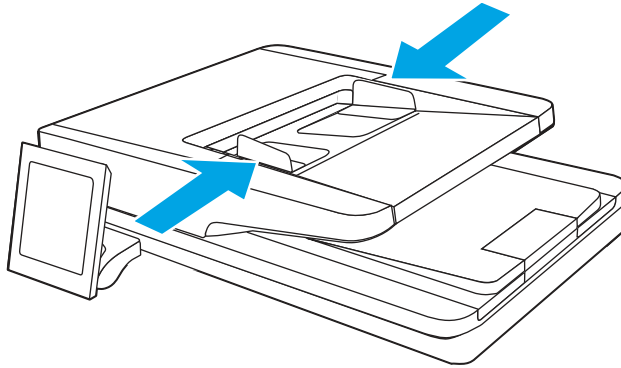

4. Make sure that the input tray is not overloaded and the tray guides are correctly aligned to both edges of the paper.
5. Verify that the paper meets the printer specifications.
6. Check and clean the Document Feeder Kit rollers and separation pad by removing any visible lint or dust from each of the feed rollers and the separation pad using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.



 **NOTE:** Lift up the roller assembly to access and clean the second roller

7. If the issue persists, Replace the document feeder top cover assembly.

Document feeder top cover assembly part number: W1A77-67903

 **NOTE:** This part contains the rollers.

8. If the issue persists, replace the integrated scanning assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

32.WX.YZ error messages

32.* errors

Errors in the 32.* family are related to either product start events or to backup and restore events.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. Retry the job.

32.08.A1, 32.08.A2, 32.08.A3

An event related to starting the printer.

32.08.A1 (event code)

Shutdown event. Boot after abnormal shutdown.

32.08.A2 (event code)

Boot from normal shutdown event.

32.08.A3 (event code)

Regular boot event.

Recommended action

There is no action needed for this message.

- No action necessary.

32.1C.05

The restore job ticket was submitted with invalid credentials.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Verify the credentials that were submitted.
2. Check the domain, user name, and password.

32.1C.06 (event code)

The backup job ticket was submitted with invalid credentials.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Verify the credentials that were submitted.
2. Check the domain, user name, and password.

32 . 1C . 07 (event code)

Backup restore permissions error.

There was an error during the creation, read, or write of the restore file.

Recommended action

Follow these troubleshooting steps in the order presented.

- Retry the job.

32 . 1C . 08 (event code)

Not enough disk space to perform backup/restore, or a network share issue.

There was an error during the creation, read, or write of the backup file.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Retry the job.
2. Remove stored jobs and retry.
3. If the error persists, try using a larger capacity storage device for the share location and check the network share settings.
4. Check the network share or try setting up a new shared network drive or folder.

32 . 1C . 09 (event code)

Tried to restore a backup file that was not valid for this printer.

The data in the backup file specified in the restore job ticket is no longer valid due to a corruption of the data, or the data is no longer present.

Recommended action

Follow these troubleshooting steps in the order presented.

- Use a valid backup file.

32 . 1C . 0A (event code)

Backup file is invalid.

The data in the backup file specified in the restore job ticket is no longer valid due to a corruption of the data, or the data is no longer present.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Use a valid backup file.
2. Reboot, and then observe the state of the printer.
3. If the error persists, perform a partition clean from the **Preboot** menu.

32.1C.0D (event code)

Backup/restore failed, auto-reboot failed, or the printer might be busy.

Recommended action

Follow these troubleshooting steps in the order presented.

- Reboot, and then retry the backup/restore.

32.1C.11 (event code)

Backup/restore time-out while communicating with the engine.

The backup operation was aborted because the printer is busy.

Recommended action

Follow these troubleshooting steps in the order presented.

- Wait until the printer is idle, and then try again.

32.1C.13, 32.1C.14

Not enough space exists to perform the backup.

The backup was aborted because the disk is at a critical level or full.

Scheduled backup failure.

Recommended action

Follow these troubleshooting steps in the order presented.

- Free up disk space, and then try again.

32.1C.15

The restore operation was aborted because the backup file was created by a previous version of firmware no longer supported by the feature.

Recommended action

Follow these troubleshooting steps in the order presented.

- Use the current backup file.

32.1C.2E

The restore operation was aborted because the printer is busy.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Wait until the printer is idle, and then retry.
2. Turn the printer off then on, and then retry.

32.1C.2F

Reset failure.

Recommended action

Follow these troubleshooting steps in the order presented.

- Turn the printer off, and then on. Retry the job.

32.1C.40

The backup operation completed successfully (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.41

The backup operation encountered an error (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.42

The backup operation completed, but with a warning message (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.43

A component in the backup file is not supported by the current version of firmware and will not be restored (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.44

A component in the backup file is not transferable to another printer and will not be restored (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.45

Some data was not included in the backup file (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.46

An expected component could not be found and was thus not backed up. Because components should be known on backups, this code is a warning (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.47

Some data was not restored from the backup file (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.48

The backup job ticket was submitted using an invalid network path.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Check that a shared folder was provided as part of the network path and not left blank.
2. Check that the server and the shared folder exists.
3. Check that you (or the applicable user) has permission to access the shared folder on the provided server.

32.1C.49

The backup job ticket was submitted with a bad encryption.



NOTE: This would only apply to a web services call to perform a backup with a blank PIN

Recommended action

Follow these troubleshooting steps in the order presented.

- Verify that the encryption personal identification number (PIN) meets the restrictions for the printer.

32.1C.4A

An error occurred when creating the temporary directories used to store the backup files in transition to and from the compressed (ZIP) file.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Retry the job.
2. If this does not resolve the issue, turn the printer off then on again and retry the job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

32.1C.56

Reset aborted. Backup/restore in progress (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.57

Reset aborted (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.58

Unknown reset error (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.60

The restore operation completed successfully (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.61

The restore operation encountered an error.

Recommended action

Follow these troubleshooting steps in the order presented.

- Review the printer's event log to see specific details about the failure.

32.1C.62

The restore operation completed, but with a warning message.

Recommended action

Follow these troubleshooting steps in the order presented.

- Review the error log to see specific details about the failure.

32.1C.68

The restore job ticket was submitted using an invalid network path.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Check that a shared folder was provided as part of the network path and not left blank.
2. Check that the server and the shared folder exist.
3. Check that you (or the applicable user) has permission to access the shared folder on the provided server.
4. Check that the path includes the compressed .ZIP file name as part of the path.

32.1C.69

The restore job ticket was submitted with a bad encryption personal identification number (PIN).

Recommended action

Follow these troubleshooting steps in the order presented.

- Verify the encryption personal identification number (PIN) is the same PIN used to encrypt the backup file.

32.1C.6A

An error occurred when creating the temporary directories used to store the restore files in transition to and from the compressed (ZIP) file.

Recommended action

Follow these troubleshooting steps in the order presented.

- Retry the job.

32.1C.6D

An unusual error occurred when running the restore operation.

Recommended action

Follow these troubleshooting steps in the order presented.

- Retry the job.

33.WX.YZ error messages

33.* errors

Errors in the 33.* family are related to the printer's storage system or the formatter. The component might have been previously installed in another printer and is therefore locked to that other printer. Or, the component might be incorrect for this printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, investigate if the solid state drive (SSD) or hard disk drive (HDD) or formatter are the original ones. If recently swapped or replaced, turn the printer off, install the original SSD/HDD and/or formatter, and then turn the printer on.
3. If the issue persists, locate and notate the complete 33.WX.YZ error message as displayed on the control panel of the printer and contact your HP-authorized service or support provider, or contact customer support at <http://www.hp.com/go/contactHP>.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. If the issue persists, investigate if the solid state drive (SSD) or hard disk drive (HDD) or formatter are the original ones. If recently swapped or replaced, turn the printer off, install the original SSD or HDD and/or formatter, and then turn the printer on.
3. If the formatter/SSD or HDD were recently replaced and the original is unavailable verify the correct formatter/SSD or HDD are installed by referencing the part numbers.

4. If the issue persists, locate and notate the complete 33.WX.YZ error message as displayed on the control panel of the printer. Reference support content for the specific error and take the necessary action.
5. If the error cannot be cleared and you are unable to get the complete error code from the printer, perform a **Partial Clean** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

 **CAUTION:** A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

6. If the error persists, download and from the **Preboot** menu install the latest version of printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

7. If the error persists, elevate the case using the Standard Support Process.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. If the issue persists, investigate if the solid state drive (SSD) or hard disk drive (HDD) or formatter are the original ones. If recently swapped or replaced, turn the printer off, install the original SSD or HDD and/or formatter, and then turn the printer on.
3. If the formatter/SSD or HDD were recently replaced and the original is unavailable verify the correct formatter/SSD or HDD are installed by referencing the part numbers.
4. If the issue persists, locate and notate the complete 33.WX.YZ error message as displayed on the control panel of the printer. Reference support content for the specific error and take the necessary action.
5. If the error cannot be cleared and you are unable to get the complete error code from the printer, perform a **Partial Clean** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

 **CAUTION:** A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

6. If the error persists, download and from the **Preboot** menu install the latest version of printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

7. If the error persists, elevate the case using the Standard Support Process.

33.01.xx

A save or restore process has occurred.

- **33.01.01** (event code)

A restore process has occurred.

- **33.01.02** (event code)

A save process has occurred.

- **33.01.03** (event code)

Save recover functionality OK after previously being disabled.

Recommended action

See recommended action.

- No action necessary.

33.02.01 Used board/disk installed

Used board or disk installed.

An encrypted board or disk with existing data previously locked to a different printer has replaced the original. If you continue, data is permanently lost.



IMPORTANT: Do not install used formatter boards in HP LaserJet, HP PageWide Enterprise or Managed printers. Only replace the formatter when specifically directed to do so during troubleshooting using the Control Panel Message Document (CPMD). If you see the 33.02.01 event code, it means a used board has been installed, and the settings may be incorrect.

For more information go to, or search for: [HP LaserJet Enterprise, HP LaserJet Managed, HP PageWide Enterprise, HP PageWide Managed - 33.02.01 error or printer name and/or product number changes after replacing the formatter](#) (c06360930).

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. If this error appears after updating the firmware, please go to **WISE** and search for the following document: HP FutureSmart - '33.02.01 Used board/disk installed' error received after updating the firmware from HP FutureSmart 4.8.1 or 4.9 to a newer version.
2. Reinstall the used board or disk back into its original printer.

3. To save the data on the board or disk, turn the printer off. Replace the board or disk with another board or disk.

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

Table 6-11 Part numbers

Description	Part number	Model numbers
Formatter (SFP)	3PZ95-67903	M455dn, E45028dn
Formatter (China/India; SFP)	3PZ95-67904	M455dn, E45028dn
Formatter (MFP)	3QA55-67901	M480f, E47528f
Formatter (China/India; MFP)	3QA55-67902	M480f, E47528f

4. To delete the data on the board or disk and continue, touch the **OK** button.

33.03.02

Data size mismatch. Unable to recover DCC NVRAM.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

33.03.03 Incompatible formatter installed

This is an EFI BIOS event to prevent booting with the wrong formatter installed.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

- Turn the printer off, and then install the correct formatter in the printer.

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

Table 6-12 Part numbers

Description	Part number	Model numbers
Formatter (SFP)	3PZ95-67903	M455dn, E45028dn
Formatter (China/India; SFP)	3PZ95-67904	M455dn, E45028dn
Formatter (MFP)	3QA55-67901	M480f, E47528f
Formatter (China/India; MFP)	3QA55-67902	M480f, E47528f

33.04.05

TPM (Trusted Platform Module) Security Error

This system contains a TPM module that is not supported on the device or belongs to another device.

TPM is unique for each device.

For units that shipped with a TPM on board standard (most newer models): If the original TPM installed in the factory is unavailable or damaged, DO NOT replace any parts. Follow the recommended action.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order they are listed.

The technician will need to re-establish the trusted platform module state in the printer.



NOTE: Never replace the TPM on a unit that shipped with one. The TPM that can be ordered is only available for adding a level of security on a device that never had a TPM paired from the factory. A new TPM cannot be installed for security reasons.

1. Do **not** replace the formatter or HDD. It will not solve this issue.
2. Perform a Format Disk procedure, select **Continue** in the Pre-boot menu, and then reboot the device.
 - If the unit boots to a 33.04.05 error, reseal the eMMC or HDD.
 - If the unit continues to boot to a 33.04.05 error, continue to the next step.
3. Perform a Format Disk procedure again, and then reboot the device.
 - If the unit boots to a 99.09.67 error, reboot the device, and then update the firmware. This should resolve the issue.

- If the unit continues to boot to a 33 . 04 . 05 error, continue to the next steps.
 - 4. Remove the TPM and eMMC or HDD, open **Startup Options**, and then perform a Cold Reset.
-
-  **WARNING!** When removing the TPM, take extreme care as the connector on the TPM board can become dislodged and break. If this happens, a printer replacement will be required.
-
- 5. Reinstall the eMMC or HDD, open the Pre-boot menu, select **Manage Disk**, select **Boot Device**, and then select **Erase Unlock**.
 - If unit boots to a 99 . 09 . 67 error, reboot the device, and then update the firmware. This should resolve the issue.
 - If the unit continues to boot to a 33 . 04 . 05 error, continue to the next step.
 - 6. Reseat the TPM and eMMC or HDD, perform a Format Disk, open Diagnostics, and then run diagnostics for all components.
 - If the Diagnostics fail, elevate the case to ATS and include all details.
 - If Diagnostics passes, continue to the next steps.
 - 7. Remove the TPM and eMMC or HDD, open **Startup Options**, and then perform a Cold Reset.
 - 8. Reinstall the eMMC or HDD, open the Pre-boot menu, select **Manage Disk**, select **Boot Device**, select **Erase Unlock**, and then reboot the device.
 - If the unit boots to a 99.09.67 error, reboot and then update the firmware. This should resolve the issue.
 - If the unit continues to boot to a 33 . 04 . 05 error, continue to the next step.
 - 9. Include the following information in the CDAX case notes, and then elevate the case to ATS. No additional feedback is needed.
-
-  **NOTE:** Ensure that all original printer parts are installed on the unit at the time of elevation.
-
- Printer serial number.
 - Collect the Diagnostic log file (.jdp file).
 - Information when the 33 . 04 . 05 error displayed on the printer control panel.
 - Parts replaced prior to the error displaying on the printer control panel.

33 . 05 . 0z SureStart errors

A SureStart error has occurred.

The printer detected and recovered from a corrupted version of BIOS.

- **33.05.01** Boot code corrupt (event code)
- **33.05.02** Boot code corrupt (event code)
- **33.05.03** Boot code corrupt (event code)

The newly downloaded firmware failed to cryptographically validate the BIOS code.

- **33.05.04** Security alert
- **33.05.04** Upgrade corrupt (event code)
- **33.05.05** Security alert
- **33.05.05** Boot code corrupt (event code)
- **33.05.06** Security alert
- **33.05.06** Upgrade corrupt (event code)
- **33.05.07** Security alert
- **33.05.07** Upgrade corrupt (event code)
- **33.05.08** Invalid boot attempt (event code)
- **33.05.09** Downgrade attempted (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

- **For 33.05.01, 33.05.02, and 33.05.03 errors:** No action is necessary.
- **For all other errors:** Download a firmware bundle to the printer from the Preboot menu.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)



NOTE: For more information on SureStart, search for: "SureStart Whitelisting and Intrusion Detection Troubleshooting Manual" (c04863614).

33.05.1x Whitelisting errors

An error occurred with a firmware file digital signature or an error with the certificate used to validate the firmware file certificate.

- **33.05.10** Security alert
- **33.05.10** Firmware verification Error: XX (Event code)
- **33.05.11** Security alert
- **33.05.11** Firmware verification Error: XX (Event code)
- **33.05.12** Security alert
- **33.05.12** Firmware verification Error: XX (Event code)

Recommended action

Follow these troubleshooting steps in the order presented.

1. Perform a [Format Disk](#) procedure.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16).

2. If the device does not reboot to **Ready**, download a firmware bundle to the device from the Preboot menu.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)



NOTE: Performing a Format Disk procedure is required before downloading a firmware bundle.

For more information on SureStart, go to: (Doc ID: c04863614). [HP SureStart Whitelisting and Intrusion Detection Troubleshooting Manual](#)

33.05.2x Intrusion detection errors

The intrusion detection system has encountered an error.

The intrusion detection memory process determined an unauthorized change in system memory.

- **33.05.21** Security alert
- **33.05.21** Potential intrusion (Event code)

The intrusion detection memory process heartbeat was not detected.

- **33.05.22** Security alert
- **33.05.22** Cannot scan for potential intrusions (Event code)

The intrusion detection memory process did not initialize.

- **33.05.23** Security alert
- **33.05.23** Intrusion detection not initialized (Event code)
- **33.05.24** Intrusion detection initialization error (Event code)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.



NOTE: Selecting **Continue** from the Preboot menu will not resolve the error. The printer must be turned off, and then on to clear the error allowing the printer to reboot to a **Ready** state.

Information on the Intrusion Detection error.

For more information on SureStart, go to: [HP SureStart - Whitelisting and Intrusion Detection Troubleshooting Manual](#) (Doc ID: c04863614).

33.05.5z Intrusion detection errors

The intrusion detection system has encountered an error.

The intrusion detection memory process determined an unauthorized change in system memory.

- **33.05.51** Security alert
- **33.05.51** Potential intrusion (Event code)

The intrusion detection memory process heartbeat was not detected.

- **33.05.52** Security alert
- **33.05.52** Cannot scan for potential intrusions (Event code)

The intrusion detection memory process did not initialize.

- **33.05.53** Security alert
- **33.05.53** Intrusion detection not initialized (Event code)
- **33.05.54** Intrusion detection initialization error (Event code)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.



NOTE: Selecting **Continue** from the Preboot menu will not resolve the error. The printer must be turned off, and then on to clear the error allowing the printer to reboot to a **Ready** state.

Information on the Intrusion Detection error.

For more information on SureStart, go to: [HP SureStart - Whitelisting and Intrusion Detection Troubleshooting Manual](#) (Doc ID: c04863614).

40.WX.YZ error messages

40.* errors

Errors in the 40.* family are related to input/output accessories, such as USB storage devices, Jetdirect cards, or EIO cards or on-board network functions.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Touch the **OK** button to clear the error.
2. Remove and then reinstall the accessory.

40 . 00 . 01 USB I/O buffer overflow To continue, touch “OK”

The USB buffer has overflowed.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to print the transferred data (some data might be lost).
2. Check the host configuration.

40 . 00 . 02 Embedded I/O buffer overflow To continue, touch “OK”

The product has experienced a JetDirect buffer overflow.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to print the transferred data (some data might be lost).
2. Check the host configuration.

40 . 00 . 03 EIO [x] buffer overflow To continue, touch “OK”

Too much data was sent to the EIO card in the specified slot (x). An incorrect communications protocol might be in use.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to print the transferred data (some data might be lost).

40 . 00 . 04 EIO [x] bad transmission To continue, touch “OK”

The connection between the product and the USB device has been broken.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to clear the error message and continue printing.
2. Remove, and then reinstall the USB device.

40 . 00 . 05 Embedded I/O bad transmission To continue, touch OK

The USB device has been removed.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to clear the error message (data will be lost).
2. Install the USB device.

40 . 08 . 0x USB storage accessory removed

The USB storage accessory has been removed.

x = 0 or 1; information code.

Secure file erase is enabled.

Recommended action

See recommended action.

- No action necessary.

41.WX.YZ error messages

41.* errors

Errors in the 41.* family are related to printing problems, such as a mismatch between the paper that is in the printer and the paper the printer is configured to use.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Verify the tray is loaded with the correct paper type, and that the guides are adjusted correctly.
2. Verify the paper type and size settings on the control panel match the paper in the tray.
3. Verify the paper type and size settings in the print driver match the paper in the tray.
4. Use the Tray/Bin manual sensor test to verify the media switch in the cassette is working correctly.
5. Turn the printer off and then on.
6. If the issue persists, replace the DC controller.

41 . 01 . YZ error

An unknown misprint error occurred on the printer.

Event log error message: 41.01.YZ.

Y = Type, Z = Tray

- Y = 0: Photo Media (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light media 1, 2, or 3 mode
- Y = 4: Heavy media 1
- Y = 5: Heavy media 2
- Y = 6: Heavy media 3
- Y = 7: Glossy media 1
- Y = 8: Glossy media 2
- Y = 9: Glossy media 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode
- Z = 0: From unknown tray
- Z = 1: From Tray 1
- Z = 2: From Tray 2
- Z = 3: From Tray 3
- Z = 4: From Tray 4
- Z = 5: From Tray 5
- Z = 6: From Tray 6
- Z = 7: From Tray 7
- Z = 8: From Tray 8
- Z = 9: From Tray 9
- Z = D: From duplex

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. If the error is not cleared, turn the printer off, and then on.
3. If the error persists, replace the laser/scanner assembly.

Laser scanner assembly part number: RM2-5612-000CN

4. Replace the DC controller.

DC controller part number: RM3-7272-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. If the error is not cleared, turn the printer off, and then on.
3. If the error returns, check the wire harness from the laser/scanner to the DC controller.
4. If the error persists, replace the laser/scanner assembly.

Laser scanner assembly part number: RM2-5612-000CN

For Single function printer instructions: *Removal and replacement: Laser scanner assembly* See the Repair Service Manual for this product.

For MFP instructions: *Removal and replacement: Laser scanner assembly* See the Repair Service Manual for this product.

5. Replace the DC controller.

DC controller part number: RM3-7272-000CN

For instructions: *Removal and replacement: DC Controller* See the Repair Service Manual for this product.

41.02.00 Error

A beam detected misprint error occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. To clear the error message, touch **OK**.
2. If the error persists, turn the printer off, and then on.
3. Verify that all toner cartridge are in good condition and the shutters work correctly.
4. If the error persists, replace the laser/scanner assembly and the laser/scanner cable.

Laser scanner assembly part number: RM2-5612-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. To clear the error message, touch **OK**.
2. If the error persists, turn the printer off, and then on.
3. Verify that all toner cartridges are in good condition and the shutters work correctly. If other toner cartridges are available, swap the toner cartridge to test as needed.

If using a different cartridge resolves the issue, replace the toner cartridge.

4. If the error returns, check the wire harness from the laser/scanners to the DC controller.
5. If the error persists, replace the laser/scanner assembly and the laser/scanner cable.

Laser scanner assembly part number: RM2-5612-000CN

For Single function printer instructions: *Removal and replacement: Laser scanner assembly* See the Repair Service Manual for this product.

For MFP instructions: *Removal and replacement: Laser scanner assembly* See the Repair Service Manual for this product.

41.03.01, 41.03.A1, 41.03.B1, 41.03.C1 Error

The printer detected a different paper size than expected.

Paper Size mismatch (0,A,B) or inter-page gap (C) error from Tray 1.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Print the configuration page to verify the size and type to which the trays are set.
3. Make sure that the tray is loaded with the correct paper size and that the sliding paper guides are correctly adjusted to the correct paper size.
4. Print internal pages from all trays to verify that this error only occurs when printing from the PC.
5. Set Tray 1 Size to ANY, and attempt to print again.

6. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Print the configuration page to verify the size and type to which the trays are set.
3. Set Tray 1 Size to ANY and attempt to print again.
4. Make sure that the tray is loaded with the correct paper size and that the sliding paper guides are correctly adjusted to the correct paper size.
5. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
6. Print internal pages from all trays to verify that this error only occurs when printing from the PC. If the error only occurs from the PC, check the print driver settings and ensure they are correct.
7. Verify that the toner cartridge and the 2nd transfer roller are seated correctly.
8. If the error only happens from tray 1, check the paper tray rollers and make sure they are not worn smooth, or coated with paper dust or other debris. If the rollers are causing the issue, replace the pick roller and separation pad.

Tray 1 pickup roller part number: RL1-2593-000CN
Tray 1 separation pad assembly part number: RM2-6406-000CN
9. If the error is present from all trays replace the registration assembly.

Registration assembly part number: RM2-1839-000CN
10. If the error persists, elevate the issue using the Standard Support Process for a possible printer replacement.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Print the configuration page to verify the size and type to which the trays are set.
3. Set Tray 1 Size to ANY and attempt to print again.
4. Make sure that the tray is loaded with the correct paper size and that the sliding paper guides are correctly adjusted to the correct paper size.
5. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
6. Print internal pages from all trays to verify that this error only occurs when printing from the PC. If the error only occurs from the PC, check the print driver settings and ensure they are correct.

7. Verify that the toner cartridge and the 2nd transfer roller are seated correctly.
8. If the error only happens from tray 1, check the paper tray rollers and make sure they are not worn smooth, or coated with paper dust or other debris. If the rollers are causing the issue, replace the pick roller and separation pad.

Tray 1 pickup roller part number: RL1-2593-000CN
Tray 1 separation pad assembly part number: RM2-6406-000CN
9. Remove and reconnect the connectors for the paper path sensors, intermediate-transfer belt, and the DC controller PCA.
10. Test the registration assembly motor and clutch. If they do not function correctly replace the registration assembly.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

Registration assembly part number: RM2-1839-000CN

For instructions: *Remove and replace: Registration assembly* See the Repair Service Manual for this product.
11. Check the paper path sensors for correct operation and ensure that they do not stick at all. If the issue persists, elevate the issue using the Standard Support Process for a possible printer replacement.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

41.03.02, 41.03.A2, 41.03.B2, 41.03.C2 Error

The printer detected a different paper size than expected.

Paper Size mismatch (0,A,B) or inter-page gap (C) error from Tray 2.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Print the configuration page to verify the size and type to which the trays are set.
3. Make sure that the tray is loaded with the correct paper size and that the sliding paper guides are correctly adjusted to the correct paper size.
4. Print internal pages from all trays to verify that this error only occurs when printing from the PC.
5. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Print the configuration page to verify the size and type to which the trays are set.
3. Make sure that the tray is loaded with the correct paper size and that the sliding paper guides are correctly adjusted to the correct paper size.
4. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
5. Print internal pages from all trays to verify that this error only occurs when printing from the PC. If the error only occurs from the PC, check the print driver settings and ensure they are correct.
6. Check the rollers and make sure they are not worn smooth, or coated with paper dust or other debris. If the rollers are causing the issue, replace the roller kit.

 Roller, paper pickup assembly part number: RM2-5576-000CN
 Roller, feed assembly part number: RM2-5577-000CN
 Roller, separation part number: RM2-5881-000CN
7. If error occurs from all trays, replace the registration assembly.

 Registration assembly part number: RM2-1839-000CN
8. If the error persists, elevate the issue using the Standard Support Process for a possible printer replacement.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Print the configuration page to verify the size and type to which the trays are set.
3. Make sure that the tray is loaded with the correct paper size and that the sliding paper guides are correctly adjusted to the correct paper size.
4. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
5. Print internal pages from all trays to verify that this error only occurs when printing from the PC. If the error only occurs from the PC, check the print driver settings and ensure they are correct.
6. Verify that the toner cartridge and the transfer roller are seated correctly.
7. Check the rollers and make sure they are not worn smooth, or coated with paper dust or other debris. If the rollers are causing the issue, replace the roller kit.

 Roller, paper pickup assembly part number: RM2-5576-000CN
 Roller, feed assembly part number: RM2-5577-000CN
 Roller, separation part number: RM2-5881-000CN
8. Use the Tray/Bin manual sensor test to verify that the cassette media switch is functioning correctly.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

9. Check the paper path sensors for correct operation and ensure that they do not stick at all. If the issue persists, elevate the issue using the Standard Support Process.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

10. Remove and reconnect the connectors for the paper path sensors, intermediate-transfer belt, and the DC controller PCA.
11. Test the registration assembly motor and clutch. If they do not function correctly replace the registration assembly.

Registration assembly part number: RM2-1839-000CN

For instructions: *Remove and replace: Registration assembly* See the Repair Service Manual for this product.

41.03.03, 41.03.A3, 41.03.B3, 41.03.C3 Error

The printer detected a different paper size than expected.

Paper Size mismatch (0,A,B) or inter-page gap (C) error from Tray 3.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Print the configuration page to verify the size and type to which the trays are set.
3. Make sure that the tray is loaded with the correct paper size and that the sliding paper guides are correctly adjusted to the correct paper size.
4. Print internal pages from all trays to verify that this error only occurs when printing from the PC.
5. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Print the configuration page to verify the size and type to which the trays are set.
3. Make sure that the tray is loaded with the correct paper size and that the sliding paper guides are correctly adjusted to the correct paper size.
4. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
5. Print internal pages from all trays to verify that this error only occurs when printing from the PC. If the error only occurs from the PC, check the print driver settings and ensure they are correct.

6. Check the rollers and make sure they are not worn smooth, or coated with paper dust or other debris. If the rollers are causing the issue, replace the roller kit.

Roller, paper pickup assembly part number: RM2-5576-000CN

Roller, feed assembly part number: RM2-5577-000CN

Roller, separation part number: RM2-5881-000CN

7. If error occurs from all trays, replace the registration assembly.

Registration assembly part number: RM2-1839-000CN

8. If the error persists, elevate the issue using the Standard Support Process for a possible printer replacement.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Print the configuration page to verify the size and type to which the trays are set.
3. Make sure that the tray is loaded with the correct paper size and that the sliding paper guides are correctly adjusted to the correct paper size.
4. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
5. Print internal pages from all trays to verify that this error only occurs when printing from the PC. If the error only occurs from the PC, check the print driver settings and ensure they are correct.
6. Verify that the toner cartridge and the transfer roller are seated correctly.
7. Check the rollers and make sure they are not worn smooth, or coated with paper dust or other debris. If the rollers are causing the issue, replace the roller kit.

Roller, paper pickup assembly part number: RM2-5576-000CN

Roller, feed assembly part number: RM2-5577-000CN

Roller, separation part number: RM2-5881-000CN

8. Use the Tray/Bin manual sensor test to verify that the cassette media switch is functioning correctly.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

9. Check the paper path sensors for correct operation and ensure that they do not stick at all. If the issue persists, elevate the issue using the Standard Support Process.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

10. Remove and reconnect the connectors for the paper path sensors, intermediate-transfer belt, and the DC controller PCA.

11. Test the registration assembly motor and clutch. If they do not function correctly replace the registration assembly.

Registration assembly part number: RM2-1839-000CN

For instructions: *Remove and replace: Registration assembly* See the Repair Service Manual for this product.

41 . 03 . FZ Unknown Misprint Error

This is a general misprint error.

Either the paper is loaded off-center with the side guides in the tray or a paper width sensor failure occurred from an unknown tray. The error will be one of the following:

- 41.03.F0
- 41.03.F1
- 41.03.F2
- 41.03.F3
- 41.03.F4
- 41.03.F5
- 41.03.FD

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call center agents

Follow these troubleshooting steps in the order presented.

1. Remove the paper from the tray and ensure that the paper tray size guides are set to the correct size for the paper loaded in the tray.
2. Try the print job again.
3. If the error persists, print a Configuration Page and note the paper size for the tray in question.
 - If the size is not reported correctly, run the tray size sensor test in the **Diagnostic** menu.
 - If the tray size sensors test as **GOOD**, replace the paper tray.
 - If the tray size sensors test as **BAD**, check the cable connections between the tray size sensor and the DC Controller.

If the cable connections are plugged in correctly and the cables are not damaged, elevate the issue using the Standard Support Process.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Remove the paper from the tray and ensure that the paper tray size guides are set to the correct size for the paper loaded in the tray.
2. Try the print job again.
3. If the error persists, print a Configuration Page and note the paper size for the tray in question.
 - If the size is not reported correctly, run the tray size sensor test in the **Diagnostic** menu.
 - If the tray size sensors test as **GOOD**, replace the paper tray.
 - If the tray size sensors test as **BAD**, check the cable connections between the tray size sensor and the DC Controller.

If the cable connections are plugged in correctly and the cables are not damaged, elevate the issue using the Standard Support Process.

41.04.YZ Printer Error

An unknown misprint error occurred on the printer.

Y = Type, Z = Tray

- Y = 0: Photo Media (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light media 1, 2, or 3 mode
- Y = 4: Heavy media 1
- Y = 5: Heavy media 2
- Y = 6: Heavy media 3
- Y = 7: Glossy media 1
- Y = 8: Glossy media 2
- Y = 9: Glossy media 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode
- Z = D Source is the duplexer.

- Z = 0 Source is the envelope feeder.
- Z = 1 Source is Tray 1.
- Z = 2 Source is Tray 2.
- Z = 3 Source is Tray 3.
- Z = 4 Source is Tray 4.
- Z = 5 Source is Tray 5.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. If the error does not clear, turn the printer off, and then on.
3. Swap out or re-seat the toner cartridge to test it.
4. Check the toner cartridges before replacing any other parts. Verify the cartridges are HP original cartridges and that the cartridges are fully seated.
5. If the error persists, replace the laser/scanner.

Laser scanner assembly part number: RM2-5612-000CN

6. If the error persists, replace the DC controller.

DC controller part number: RM3-7272-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. If the error does not clear, turn the printer off, and then on.
3. Swap out or re-seat the toner cartridge to test it.
4. Check the toner cartridges before replacing any other parts. Verify the cartridges are HP original cartridges and that the cartridges are fully seated.
5. Re-seat the connections to the and the DC controller.
6. If the error persists, replace the laser/scanner.

Laser scanner assembly part number: RM2-5612-000CN

For Single function printer instructions: *Removal and replacement: Laser scanner assembly* See the Repair Service Manual for this product.

For MFP instructions: *Removal and replacement: Laser scanner assembly* See the Repair Service Manual for this product.

7. If the error persists, replace the DC controller.

DC controller part number: RM3-7272-000CN

For instructions: *Removal and replacement: DC Controller* See the Repair Service Manual for this product.

41.07.Y2 Error To continue, touch "OK"

Media transportation error: Printer has detected delay in input source from Tray 2 where the Paper Type is set as one of the following Variable Type:

Y = Variable Paper Type


- 41.07.02: Photo paper (1, 2, or 3)
- 41.07.12: Auto Sense (Normal)
- 41.07.22: Normal (typed not from Auto Sense)
- 41.07.32: Light paper 1, 2, or 3 mode
- 41.07.42: Heavy paper 1
- 41.07.52: Heavy paper 2
- 41.07.62: Heavy paper 3
- 41.07.72: Glossy paper 1
- 41.07.82: Glossy paper 2
- 41.07.92: Glossy paper 3
- 41.07.A2: Glossy film
- 41.07.B2: OHT
- 41.07.C2: Label
- 41.07.D2: Envelope 1, 2, or 3 mode
- 41.07.E2: Rough
- 41.07.F2: Other mode

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Ensure the type and quality of the paper being used meets the HP specifications for the printer.

2. Make sure that Tray 2 width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab (line below 3 triangles). See following images.

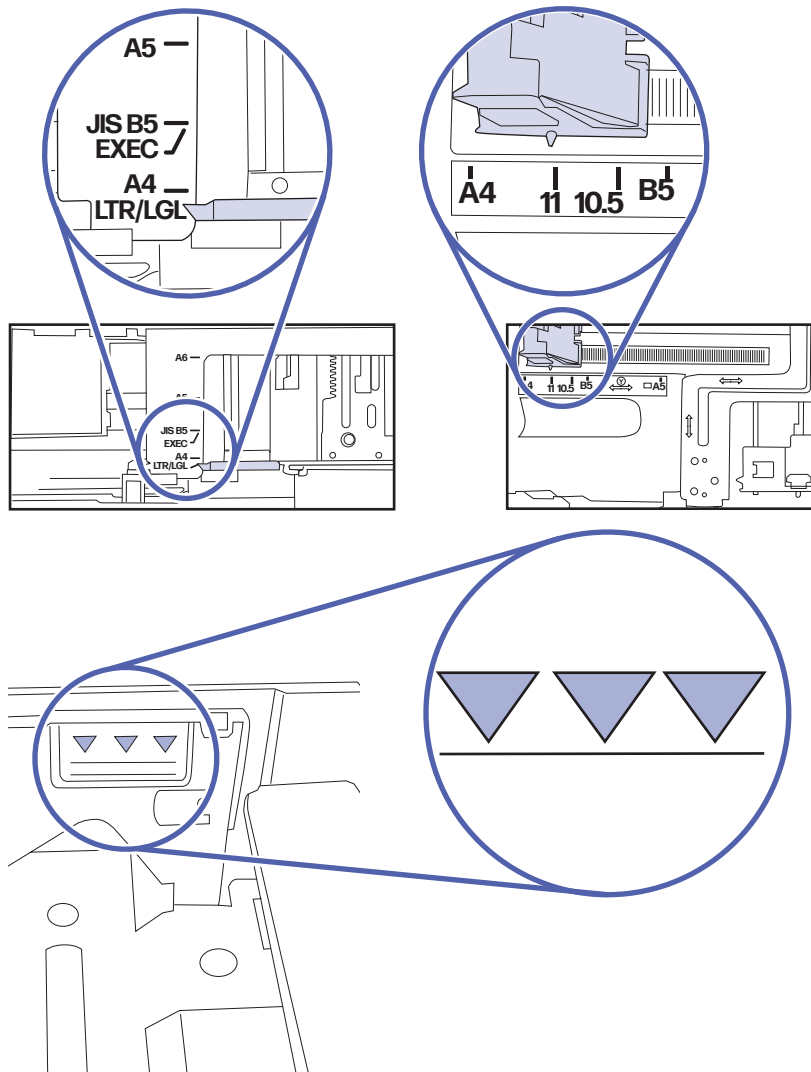

3. Turn the printer off, and then on.
4. Inspect the Tray 2 rollers. If The rollers are contaminated, clean the rollers with a lint-free cloth dampened with warm water. If the rollers are worn out replace the rollers.

Roller, paper pickup assembly part number: RM2-5576-000CN

Roller, feed assembly part number: RM2-5577-000CN

Roller, separation part number: RM2-5881-000CN

5. If the error persists, please contact customer support.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.

2. Print the configuration page to verify the size and type to which the trays are set.
3. Make sure that the tray is loaded with the correct paper size and that the sliding paper guides are correctly adjusted to the correct paper size.
4. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
5. Print internal pages from all trays to verify that this error only occurs when printing from the PC. If the error only occurs from the PC, check the print driver settings and ensure they are correct.
6. Check the rollers and make sure they are not worn smooth, or coated with paper dust or other debris. If the rollers are causing the issue, replace the roller kit.

Roller, paper pickup assembly part number: RM2-5576-000CN

Roller, feed assembly part number: RM2-5577-000CN

Roller, separation part number: RM2-5881-000CN

7. If the error persists, elevate the issue using the Standard Support Process for a possible printer replacement.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.


1. Touch **OK** to use another tray.
2. Print the configuration page to verify the size and type to which the trays are set.
3. Make sure that the tray is loaded with the correct paper size and that the sliding paper guides are correctly adjusted to the correct paper size.
4. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
5. Print internal pages from all trays to verify that this error only occurs when printing from the PC. If the error only occurs from the PC, check the print driver settings and ensure they are correct.
6. Verify that the toner cartridge and the transfer roller are seated correctly.
7. Check the tray 2 rollers and make sure they are not worn smooth, or coated with paper dust or other debris. If the rollers are causing the issue, replace the roller kit.

Roller, paper pickup assembly part number: RM2-5576-000CN

Roller, feed assembly part number: RM2-5577-000CN

Roller, separation part number: RM2-5881-000CN

8. Using the configuration page, verify the paper type setting matches that of paper installed for the error tray.

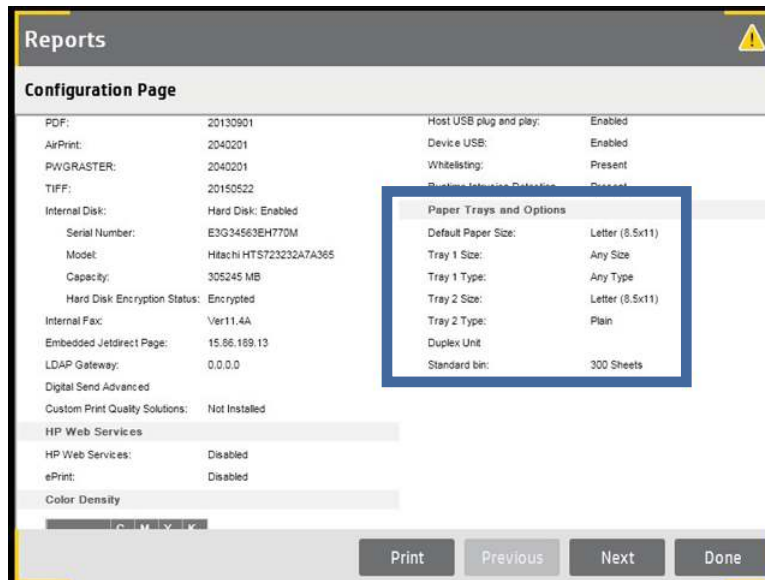

If the tray media type doesn't match the installed paper change media type settings.

9. If the issue persists, check the Event Log for DC Controller related errors (specifically 55.00.yz errors). If DCC errors are seen, replace the DC Controller.

DC controller part number: RM3-7272-000CN

For instructions: *Removal and replacement: DC Controller* See the Repair Service Manual for this product.

10. If the error persists, elevate the issue using the Standard Support Process for a possible printer replacement.

42.WX.YZ error messages

42.XX.YZ

Internal system failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on. Retry the job.

2. If the error persists, clear the firmware image from the active partition by using the [Partial Clean](#) item in the [Preboot](#) menu.
3. Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

42.B0.01 or 42.B0.02

Missing string in firmware error.

42.B0.01: UI or EWS requests a string ID that does not exist in the localization database.

42.B0.02: UI requests an image ID or media file that does not exist.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on. Retry the job.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents, and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on. Retry the print job.
2. If the error persists, clear the firmware image from the active partition by using the [Partial Clean](#) item in the [Preboot](#) menu.



NOTE: The Partial Clean option erases all data from the partitions, except for the firmware repository where a backup copy of the firmware file is stored. This allows the disk drive to be reformatted without having to download a firmware upgrade file to return the printer to a bootable state. Characteristics of a Partial Clean

- Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted
- Rebooting the printer restores the firmware files from the Repository location, but does not restore any customer-defined settings.
- For previous HP products, a Hard Disk Initialization is similar to executing the Partial Clean function for this printer



CAUTION: HP recommends backing-up printer configuration data before executing a Partial Clean to retain customer-defined settings (if needed). See the Backup/Restore item in the Device Maintenance menu.

3. How to execute a Partial Clean from a touchscreen control panel.

- a. Touch in the middle of the control panel display when you see the 1/8 under the HP logo.

Figure 6-36 Open the Pre-Boot menu



- b. Use the down arrow button to highlight the **+3:Administrator** item, and then touch the **OK** button.
- c. Use the down arrow button to highlight **Partial Clean** and then touch the **OK** button.
- d. Touch the **OK** button again.
- e. Touch the **Home** button to highlight Continue, and then touch the **OK** button.



NOTE: The printer initializes.

44.WX.YZ error messages

44.* errors

Errors in the 44.* family are related to the digital send functionality: fax, email, send to SharePoint, or save to folder.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. In many cases, the error will automatically clear, and you can try the job again.
2. Verify the digital send feature has been correctly configured at the control panel and with the HP Embedded Web Server (EWS).



NOTE: To access the EWS, open a Web browser, and in the address line, enter the printer IP address.

3. Turn the printer off, and then on. Retry the job.
4. For fax errors, verify the fax card is correctly installed on the formatter.
5. For SharePoint or save-to-folder errors, verify the permissions are set correctly for access to the SharePoint or network folder.
6. For email errors, verify connectivity to the network, and verify the SMTP gateway is configured correctly. Also verify if there is a size limit on email attachments.

7. If the error persists, reset the printer to factory settings, and then upgrade the firmware to the latest version.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

44 . 01 . xx Error Event log message

A digital send error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. No action necessary. This error message should automatically clear.
2. Try to send the job again.
3. If the error does not clear or it returns:
 - a. Use optimal resolution and image quality settings.
 - b. Wait until all the digital send jobs have been processed.
 - c. Turn the printer off, and then on. Retry the job.
 - d. Verify if there is an attachment limit on the email.
 - e. Verify network connectivity, SMTP gateways, access to folder share.

44 . 02 . xx Error Event log message (*Multifunction product only*)

Personal address book error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the digital send configuration and address book.

44 . 03 . xx Error Event log message

A digital send error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

- Try to send the job again.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Use optimal resolution and image quality settings.
2. Wait until all the digital send jobs have been processed.
3. Turn the printer off, and then on and retry the job.

4. Verify if there is an attachment limit on the email.
5. Verify network connectivity, SMTP gateways, access to folder share.

44 . 04 . xx Error Event log message (*Multifunction product only*)

A Digital Send Email error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the digital send configuration.

44 . 05 . xx Error Event log message (*Multifunction product only*)

A Digital Send Folder Job error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the digital send configuration.

44 . 07 . xx Error Event log message (*Multifunction product only*)

Digital Send Remote Printer Job Error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the digital send configuration.

44 . 08 . xx Error Event log message (*Multifunction product only*)

SharePoint Job Error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, cancel and then restart the job.
2. If the error occurs repeatedly, reboot the engine and retry the job.
3. If error still persists, reset to factory settings. Upgrade to most current firmware.

44 . 10 . xx Error Event log message (*Multifunction product only*)

A send to email error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the digital send configuration.

For more information, Go to: [Or click here: HP LaserJet Enterprise MFP - Set up Scan to Email.](#)

44 . 11 . 0E Error Event log message (*Multifunction product only.*)

The attachment filename already exists at the destination, and the fail-on-filename-collisions flag was set. This file will not be sent.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, use a different filename or verify that the filename is not already in use.
2. If the issue persists, use a unique filename or disable the fail-on-filename-collisions flag.

44 . 11 . xx Error Event log message (*Multifunction product only.*)

A digital send error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

Try to send the job again.

Check the digital send configuration.

44 . 12 . 0E Error Event log message (*Multifunction product only.*)

A digital send error has occurred.

The attachment filename already exists at the destination, and the fail-on-filename-collisions flag is set. This file will not be sent.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, use a different filename or verify that the filename is not already in use.
2. If the issue persists, use a unique filename or disable the fail-on-filename-collisions flag.

44 . 12 . xx Error Event log message (*Multifunction product only.*)

A digital send error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the digital send configuration.

44 . 16 . 01 Error Event log message (*Multifunction product only*)

A digital send error has occurred while trying to create file type.

XX =

- 01 – RTF File
- 03 – CSV File
- 04 – HTML File
- 05 – XML File
- 06 – XPS File
- 07 – PDF File

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the digital send configuration.

44 . 16 . 02 Error Event log message (*Multifunction product only*)

The destination URL was found to be invalid or unreachable.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, cancel and then restart the job.
2. If the error persists, turn the product off and then on and retry the job.
3. If the error still persists, reset to factory settings. Upgrade to the current firmware version.

44 . 16 . 03 Error Event log message (*Multifunction product only*)

The destination URL is not a SharePoint site.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, verify settings in job configuration and then restart the job.
2. If the error persists:
 - Check network connection settings.
 - Verify access to the SharePoint site.

44 . 1 6 . 04 Error Event log message (*Multifunction product only*)

Credentials associated with the SharePoint destination were found to be invalid or missing.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, verify settings in job configuration and then restart the job.
2. If the error persists:
 - Check network connection settings.
 - Verify access to the SharePoint site.

44 . 1 6 . 05 Error Event log message (*Multifunction product only*)

Credentials do not have write access to the SharePoint destination.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, verify settings in job configuration and then restart the job.
2. If the error persists:
 - Check network connection settings.
 - Verify access to the SharePoint site.

44 . 1 6 . 06 Error Event log message (*Multifunction product only*)

Upload of image file failed. Reason unknown.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, verify settings in job configuration and then restart the job.
2. If the error persists, turn the product off then on again and retry the job.
3. If the error still persists, reset to factory settings. Upgrade to the current firmware version.

44 . 1 6 . 07 Error Event log message (*Multifunction product only*)

Upload of image file failed.

The file exceeded the maximum form submission length on the Web server.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, send fewer pages in the job, lower the DPI of the scanned pages, or select a file type that splits pages into separate files (for example, jpeg).
2. If the error occurs repeatedly, contact the SharePoint site administrator to increase the Web server's maximum form submission length.

44 . 16 . 08 Error Event log message (*Multifunction product only*)

Upload of image file failed. The SharePoint site storage quota limit was exceeded.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, make space on the SharePoint site by deleting some files, and then retry the job.
2. If the error occurs repeatedly, contact the SharePoint site administrator to increase the storage quota limit.

44 . 16 . 09 Error Event log message (*Multifunction product only*)

Upload of image file failed. A folder or filename length is too long.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, check the destination URL and filename in the SharePoint job configuration to verify no folder or filename exceeds the maximum of 128 characters.
2. If the error occurs repeatedly, try sending to a different folder on the SharePoint site or changing the filename (which could include prefix or suffix).

44 . 16 . 0A Error Event log message (*Multifunction product only*)

Upload of the image file failed.

The image file already exists on the server and is checked out for editing by another user.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, verify that the filename used by the job is not checked out on the SharePoint site.
2. If the error persists, use a different filename for the job.

44 . 16 . 0B Error Event log message (*Multifunction product only*)

Upload of the image file failed.

The image file already exists on the server and the job was set to not overwrite files.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, set the job to overwrite existing files.
2. If the error persists, use a different filename for the job.

44 . 1 6 . 0D Error Event log message (*Multifunction product only*)

Encountered an unexpected processing error while transferring attachments to the destination SharePoint.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, verify settings in job configuration and restart the job.
2. If the error persists, turn the product off, and then on and retry the job.
3. If the error persists, reset to factory settings. Upgrade to the current firmware version.

44 . 1 6 . 0E Error Event log message (*Multifunction product only*)

The attachment filename already exists at the destination, and the fail-on-filename-collisions flag was set. This file will not be sent.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, use a different filename or verify that the filename is not already in use.
2. If the error persists, use a unique filename or disable the fail-on-filename-collisions flag.

44 . 1 6 . 0F Error Event log message (*Multifunction product only*)

Not enough memory to process the current SharePoint Job.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, cancel and/or restart the job, breaking it up into small jobs.
2. Repeat this process if the error persists until job goes through.

44 . 1 6 . 10 Error Event log message (*Multifunction product only*)

The SharePoint server is using an invalid certificate.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, send the SharePoint job to a non-secure address, or send the job to a SharePoint server that has a valid certificate.
2. If the error occurs repeatedly, send the job to a different, trusted SharePoint server.

44 . 16 . FF Error Event log message (*Multifunction product only*)

An unexpected error occurred in the SharePoint resource device code.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If this is the first time the error has occurred, verify settings in job configuration and restart the job.
2. If error persists, turn the product off, and then on and retry the job.
3. If the error persists, reset to factory settings. Upgrade to the current firmware version.

44 . 34 . xx Error Event log message

A fax error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the fax settings to make sure they are set to the proper settings for the environment.
3. If the issue persists, for additional fax troubleshooting information go to [HP LaserJet Enterprise MFP, HP PageWide Enterprise MFP - Checklist for solving fax problems](#).

44 . 34 . 03 Fax Modem Failure

Digital Send error. Fax result modem fail.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off. and then on.
2. Ensure all fax settings are correctly set.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Verify the fax card is correctly installed on the formatter. Ensure that the fax card is aligned with slot on the formatter chassis and is firmly seated against the formatter board.
3. Turn the printer on.
4. If the issue persists, replace the fax kit.

Fax PCA with plug kit (USA) part number: 3PZ55-67980

Fax PCA with plug kit (EURO) part number:3PZ55-67981

Fax PCA with plug kit (BRAZIL) part number: 3PZ55-67982
Fax PCA with plug kit (AP) part number: 3PZ55-67983

Removal and replacement: Fax PCA assembly See the Repair Service Manual for this product.

44.34.E5 Fax Modem Failure

A fax error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure all fax settings are correctly set.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Verify the fax card is correctly installed on the formatter. Ensure that the fax card is aligned with slot on the formatter chassis and is firmly seated against the formatter board.
3. If the issue persists, download and reinstall the firmware.
4. If the issue persists, perform a Partial Clean:
 - a. Turn the printer off, and then on.
 - b. The HP logo displays on the printer control panel. When a "1/8" with an underscore displays below the HP logo, touch the logo to open the **Pre-boot** menu.
 - c. Use the arrow buttons on the touchscreen to navigate the pre-boot menu.
 - d. Use the down arrow to highlight **Partial Clean**, and then touch the **OK** button.
 - e. Touch the **OK** button again.
 - f. Touch the **Back** button to highlight **Continue**, and then touch the **OK** button.

The printer will continue to boot to **Ready**.

5. If the issue persists, replace the fax kit.

Fax PCA with plug kit (USA) part number: 3PZ55-67980

Fax PCA with plug kit (EURO) part number: 3PZ55-67981

Fax PCA with plug kit (BRAZIL) part number: 3PZ55-67982

Fax PCA with plug kit (AP) part number: 3PZ55-67983

Removal and replacement: Fax PCA assembly See the Repair Service Manual for this product.

44 . 92 . yz Error Event log message

A fax error has occurred.

Recommended action

Use the following steps to resolve the error.

1. Try to send the job again.
2. Check the fax settings to ensure they are set to the correct settings for the environment.
3. If the issue persists, for additional fax troubleshooting information go to [HP LaserJet Enterprise MFP, HP PageWide Enterprise MFP - Checklist for solving fax problems](#)

44 . 90 . xx, 44 . 91 . xx, 44 . 92 . xx Error Event log message

A fax error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the fax settings to make sure they are set to the proper settings for the environment.
3. If the issue persists, for additional fax troubleshooting information go to [HP LaserJet Enterprise MFP, HP PageWide Enterprise MFP - Checklist for solving fax problems](#).

47.WX.YZ error messages

47.* errors

Errors in the 47.* family indicate an internal error has occurred.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Resend the print job.

3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.00.xx

Back channel internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.01.xx

Image transformer internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.

3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.02.xx

Job parser internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.03.xx

Print job internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.

3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.04.xx

Print spooler 9100 internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.05.xx

Print spooler framework internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.

3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.06.xx

Print application internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the **Format Disk** item in the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

48.WX.YZ error messages

48.* errors

Errors in the 48.* family indicate an internal error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to HP FutureSmart - Latest Firmware Versions

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. In most cases, no action is necessary.
2. If the error persists, upgrade the printer firmware.
3. If the error persists, continue troubleshooting with the flowcharts for either Intermittent or Persistent 48 error troubleshooting (whichever is appropriate) in document c03122817. Search for the following document on **WISE**: HP LaserJet FutureSmart Devices - 49 Error Troubleshooting (Persistent and Intermittent).



NOTE: 48.wx.yz errors are similar to 49.wx.yz errors and use the same troubleshooting steps and procedures.

49.WX.YZ error messages

49 . xx . yx Error To continue turn off then on

A firmware error occurred.

Possible causes:

- Corrupted print jobs
- Software application issues
- Non-product specific print drivers
- Poor quality USB or network cables
- Bad network connections or incorrect configurations
- Invalid firmware operations
- Unsupported accessories

A 49 error might happen at any time for multiple reasons. Although some types of 49 errors can be caused by hardware failures, it is more common for 49 errors to be caused by printing a specific document or performing some task on the printer.

49 errors most often occur when a printer is asked to perform an action that the printer firmware is not capable of and might not have been designed to comply with, such as:

- Printing files with unsupported programming commands
- A unique combination of user environment and user interactions with the printer
- Interfacing with a third-party solution that was not designed to work with the printer
- Specific timing, network traffic, or concurrent processing of jobs

Recommended action for customers

Follow these troubleshooting steps in the order presented.



NOTE: LaserJet formatter PCAs are rarely the root cause of 49 service errors. Please do not replace the formatter unless troubleshooting has identified the formatter as the root cause.

1. Turn the printer off, and then on.
2. If the error persists, check the following:
 - The error might be caused by a network connectivity problem, such as a bad USB or network interface cable, a bad USB port, or an invalid network configuration setting.
 - The error might be caused by the print job, due to an invalid print driver, a problem with the software application, or a problem with the file being printed.
 - Upgrading the printer firmware might help resolve the error.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: LaserJet formatter PCAs are rarely the root cause of 49 service errors. Please do not replace the formatter unless troubleshooting has identified the formatter as the root cause.

1. Turn the printer off, and then on.
2. If the error persists, check the following:
 - The error might be caused by a network connectivity problem, such as a bad interface cable, a bad USB port, or an invalid network configuration setting.
 - The error might be caused by the print job, due to an invalid print driver, a problem with the software application, or a problem with the file being printed.
 - Upgrading the printer firmware might help resolve the error.
3. If the error persists, continue troubleshooting with the flowcharts for either Intermittent or Persistent 49 error troubleshooting (whichever is appropriate) in document c03122817. Search for the following document on **WISE**: HP LaserJet FutureSmart Devices - 49 Error Troubleshooting (Persistent and Intermittent).



NOTE: 48 errors are similar to 49 errors.

50.WX.YZ error messages

50.* errors

Errors in the 50.* family indicate a problem with the fuser.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and remove the fuser. Check the fuser for damage or obstructions. Reinstall or replace the fuser as needed.

 **CAUTION:** The fuser might be hot.

2. Check the connectors between the fuser and the DC controller and from the fuser to the printer.
3. Replace the fuser. If it has already been replaced, replace the fuser power supply.

50.1x.yz

Low fuser temperature failure

x = fuser mode, y = previous printer sleep state, and z = next printer sleep state.

Recommended action for customers

Use the following steps to resolve the error.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.

4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. Remove and reinstall the fuser. ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

7. Ensure that there is no residual paper in the fuser.
8. If the error persists, replace the fuser assembly.

Fuser assembly (110-127V) part number: RM2-6460-000CN

Fuser assembly (220-240V) part number: RM2-6461-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. Remove and reinstall the fuser. ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

7. Ensure that there is no residual paper in the fuser.
8. If the error persists, replace the fuser assembly.

Fuser assembly (110-127V) part number: RM2-6460-000CN

Fuser assembly (220-240V) part number: RM2-6461-000CN

For instructions: *Removal and replacement: Fuser assembly* See the Repair Service Manual for this product.

50.2x.yz

Fuser warmup error.

x = fuser mode, y = previous printer sleep state, and z = next printer sleep state.

Recommended action for customers

Use the following steps to resolve the error.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.

2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
3. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
4. Remove the fuser and check the fuser for damage or obstructions. Reinstall or replace the fuser as needed. Ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

5. Ensure that there is no residual paper in the fuser.
6. If the error persists, replace the fuser assembly.

Fuser assembly (110-127V) part number: RM2-6460-000CN

Fuser assembly (220-240V) part number: RM2-6461-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
3. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
4. Remove the fuser and check the fuser for damage or obstructions. Reinstall or replace the fuser as needed. Ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

5. Ensure that there is no residual paper in the fuser.
6. If the error persists, replace the fuser assembly.

Fuser assembly (110-127V) part number: RM2-6460-000CN

Fuser assembly (220-240V) part number: RM2-6461-000CN

For instructions: *Removal and replacement: Fuser assembly* See the Repair Service Manual for this product.

50.3x.yz

High fuser temperature.

x = fuser mode, y = previous printer sleep state, and z = next printer sleep state.

Recommended action for customers

Use the following steps to resolve the error.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

4. Ensure that there is no residual paper in the fuser.
5. Check the paper type setting in the printer control panel menus and in the print driver. Ensure that the settings match and are correct for the type of paper being used.
6. If the error persists, replace the fuser assembly.

Fuser assembly (110-127V) part number: RM2-6460-000CN

Fuser assembly (220-240V) part number: RM2-6461-000CN

7. If the error persists, replace the low-voltage power assembly.

LV power supply PCA (110-127V)RM3-7278-000CN

LV power supply PCA (220-240V)RM3-7279-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.

2. Turn on the power and wait for the product to initialize
3. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

4. Ensure that there is no residual paper in the fuser.
5. Check the paper type setting in the printer control panel menus and in the print driver. Ensure that the settings match and are correct for the type of paper being used.
6. If the error persists, replace the fuser assembly.

Fuser assembly (110-127V) part number: RM2-6460-000CN

Fuser assembly (220-240V) part number: RM2-6461-000CN

For instructions: *Removal and replacement: Fuser assembly* See the Repair Service Manual for this product.

7. If the error persists, replace the low-voltage power assembly.

LV power supply PCA (110-127V) RM3-7278-000CN

LV power supply PCA (220-240V) RM3-7279-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

50.4x.yz

Fuser drive circuit fault.

x = fuser mode, y = previous printer sleep state, and z = next printer sleep state.

Recommended action for customers

Use the following steps to resolve the error.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize

3. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

4. Check the printer power source. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.

 **NOTE:** If the printer does not meet the power requirement of 43 to 67Hz frequency, the fuser temperature control does not work correctly and this will cause the error.

5. If the error persists, replace the low-voltage power assembly.

LV power supply PCA (110-127V)RM3-7278-000CN

LV power supply PCA (220-240V)RM3-7279-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

4. Check the printer power source. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.

 **NOTE:** If the printer does not meet the power requirement of 43 to 67Hz frequency, the fuser temperature control does not work correctly and this will cause the error.

5. Reconnect the connector (J116) on the DC controller PCA.
6. Check the following connectors on the DC controller PCA (J124, J125, J126, J127, and J129). Ensure each connector is seated correctly and not damaged.
7. If the error persists, replace the low-voltage power assembly.

LV power supply PCA (110-127V)RM3-7278-000CN

LV power supply PCA (220-240V)RM3-7279-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

50 . 6x . yz

Open fuser circuit (heating element failure).

x = fuser mode, y = previous printer sleep state, and z = next printer sleep state.

Recommended action for customers

Use the following steps to resolve the error.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.

2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. Remove and reinstall the fuser. ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

7. Ensure that there is no residual paper in the fuser.
8. If the error persists, replace the fuser assembly.

Fuser assembly (110-127V) part number: RM2-6460-000CN

Fuser assembly (220-240V) part number: RM2-6461-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. Remove and reinstall the fuser. ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

7. Ensure that there is no residual paper in the fuser.

8. If the error persists, replace the fuser assembly.

Fuser assembly (110-127V) part number: RM2-6460-000CN

Fuser assembly (220-240V) part number: RM2-6461-000CN

For instructions: *Removal and replacement: Fuser assembly* See the Repair Service Manual for this product.

50.7x.yz

Fuser pressure-release mechanism failure.

x = fuser mode, y = previous printer sleep state, and z = next printer sleep state.

Recommended action for customers

Use the following steps to resolve the error.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. Remove and reinstall the fuser.

 **CAUTION:** The fuser might be hot.

 **NOTE:** if a 50.7 occurs at power-on or is followed immediately by a jam error, there might be a small piece of paper stuck in the fuser.

4. Check for jammed paper in the fuser.
5. If the error persists, replace the fuser.
Fuser assembly (110-127V) part number: RM2-6460-000CN
Fuser assembly (220-240V) part number: RM2-6461-000CN
6. If the error persists, replace the fuser motor M4.
Assembly, fixing motor RM2-7349-000CN
7. If the error persists, replace the printer.

Recommended action for onsite technicians


Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. Remove and reinstall the fuser.

 **CAUTION:** The fuser might be hot.

 **NOTE:** if a 50.7 occurs at power-on or is followed immediately by a jam error, there might be a small piece of paper stuck in the fuser.


4. Remove the fuser and checked for any jammed paper inside the fuser.
 - a. Check the fuser input area.

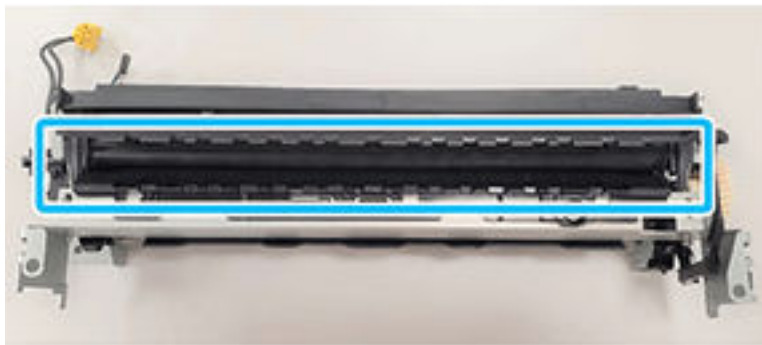

- b. Check the fuser output area.



- c. Lift the release lever.

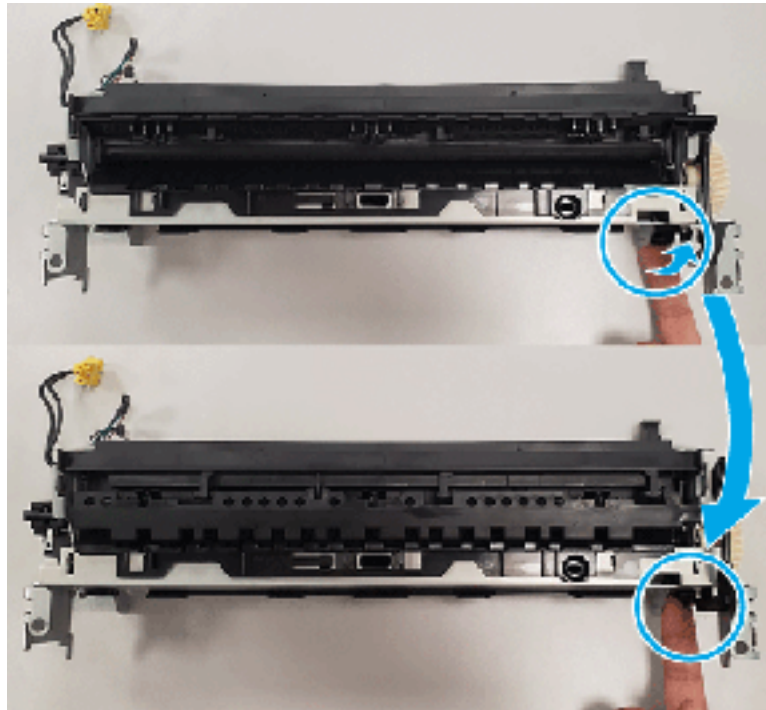

- d. Release the locking tab and slide the plastic cover to the right.



- e. Remove the plastic cover.



- f. Rotate the gear on the right side and check if any jammed paper is between pressure roller and the fuser film.



5. Reinstall the fuser.
6. If the error persists, replace the fuser.

Fuser assembly (110-127V) part number: RM2-6460-000CN
Fuser assembly (220-240V) part number: RM2-6461-000CN

For instructions: *Removal and replacement: Fuser assembly* See the Repair Service Manual for this product.
7. If the error persists, replace the fuser motor M4.

Assembly, fixing motor RM2-7349-000CN

For instructions: *Removal and replacement: Fuser motor assembly* See the Repair Service Manual for this product.

50.8x.yz

Low fuser temperature 2.

x = fuser mode, y = previous printer sleep state, and z = next printer sleep state.

Recommended action for customers

Use the following steps to resolve the error.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. Remove and reinstall the fuser. ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

7. Ensure that there is no residual paper in the fuser.
8. If the error persists, replace the fuser assembly.
Fuser assembly (110-127V) part number: RM2-6460-000CN
Fuser assembly (220-240V) part number: RM2-6461-000CN
9. If the error persists, replace the low-voltage power assembly.
LV power supply PCA (110-127V)RM3-7278-000CN
LV power supply PCA (220-240V)RM3-7279-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. Remove and reinstall the fuser. ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

7. Ensure that there is no residual paper in the fuser.
8. If the error persists, replace the fuser assembly.
Fuser assembly (110-127V) part number: RM2-6460-000CN
Fuser assembly (220-240V) part number: RM2-6461-000CN
For instructions: *Removal and replacement: Fuser assembly* See the Repair Service Manual for this product.

9. If the error persists, replace the low-voltage power assembly.

LV power supply PCA (110-127V)RM3-7278-000CN

LV power supply PCA (220-240V)RM3-7279-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

50.9x.yz

High fuser temperature 2.

x = fuser mode, y = previous printer sleep state, and z = next printer sleep state.

Recommended action for customers

Use the following steps to resolve the error.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. Remove and reinstall the fuser. ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

7. Ensure that there is no residual paper in the fuser.
8. If the error persists, replace the fuser assembly.
Fuser assembly (110-127V) part number: RM2-6460-000CN
Fuser assembly (220-240V) part number: RM2-6461-000CN

9. If the error persists, replace the low-voltage power assembly.

LV power supply PCA (110-127V)RM3-7278-000CN

LV power supply PCA (220-240V)RM3-7279-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. Remove and reinstall the fuser. ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

7. Ensure that there is no residual paper in the fuser.
8. If the error persists, replace the fuser assembly.
Fuser assembly (110-127V) part number: RM2-6460-000CN
Fuser assembly (220-240V) part number: RM2-6461-000CN
For instructions: *Removal and replacement: Fuser assembly* See the Repair Service Manual for this product.
9. If the error persists, replace the low-voltage power assembly.
LV power supply PCA (110-127V)RM3-7278-000CN
LV power supply PCA (220-240V)RM3-7279-000CN
For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

50 .Ax .yz

Low fuser temperature 3.

x = fuser mode, y = previous printer sleep state, and z = next printer sleep state.

Recommended action for customers

Use the following steps to resolve the error.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize

3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. Remove and reinstall the fuser. ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

7. Ensure that there is no residual paper in the fuser.
8. If the error persists, replace the fuser assembly.
Fuser assembly (110-127V) part number: RM2-6460-000CN
Fuser assembly (220-240V) part number: RM2-6461-000CN
9. If the error persists, replace the low-voltage power assembly.
LV power supply PCA (110-127V)RM3-7278-000CN
LV power supply PCA (220-240V)RM3-7279-000CN

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.

6. Remove and reinstall the fuser. ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

7. Ensure that there is no residual paper in the fuser.

8. If the error persists, replace the fuser assembly.

Fuser (duplex; 110-127V) part number: RM2-6460-000CN

Fuser (duplex; 220-240V) part number: RM2-6461-000CN

Fuser (simplex; 220-240V) part number: RM2-6436-000CN

For instructions: [Removal and replacement: Fuser \(duplex models\)](#) See the Service Manual for this printer.

[Removal and replacement: Fuser \(simplex models\)](#)

9. If the error persists, replace the low-voltage power assembly.

110v Low-voltage power supply part number: RM3-7241-000CN

220v Low-voltage power supply part number: RM3-7242-000CN

For instructions: [Removal and replacement: Low-voltage power supply \(LVPS\)](#) See the Service Manual for this printer.

50 . Bx . yz

High fuser temperature 3.

x = fuser mode, y = previous printer sleep state, and z = next printer sleep state.

Recommended action for customers

Use the following steps to resolve the error.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.

4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. Remove and reinstall the fuser. ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

7. Ensure that there is no residual paper in the fuser.
8. If the error persists, replace the fuser assembly.
Fuser assembly (110-127V) part number: RM2-6460-000CN
Fuser assembly (220-240V) part number: RM2-6461-000CN
9. If the error persists, replace the low-voltage power assembly.
LV power supply PCA (110-127V)RM3-7278-000CN
LV power supply PCA (220-240V)RM3-7279-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. Remove and reinstall the fuser. ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

7. Ensure that there is no residual paper in the fuser.
8. If the error persists, replace the fuser assembly.
Fuser assembly (110-127V) part number: RM2-6460-000CN
Fuser assembly (220-240V) part number: RM2-6461-000CN
For instructions: *Removal and replacement: Fuser assembly* See the Repair Service Manual for this product.
9. If the error persists, replace the low-voltage power assembly.
LV power supply PCA (110-127V)RM3-7278-000CN
LV power supply PCA (220-240V)RM3-7279-000CN
For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

51.WX.YZ error messages

51.* errors

Errors in the 51.* family are related to the laser scanner.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Ensure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Check all connections on the laser/scanner and from the laser/scanner to the DC controller, and reseal them if necessary.
3. If the error persists, replace the laser scanner.

51.00.10

Laser/scanner error.

Laser/scanner beam detect error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, replace the laser/scanner.

Laser scanner assembly part number: RM2-5612-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Reconnect the all connectors on the laser/scanner assembly.
3. Reconnect connectors (J111) on the DC controller.
4. If the error persists, replace the laser/scanner.

Laser scanner assembly part number: RM2-5612-000CN

For Single function printer instructions: *Removal and replacement: Laser scanner assembly* See the Repair Service Manual for this product.

For MFP instructions: *Removal and replacement: Laser scanner assembly* See the Repair Service Manual for this product.

52.WX.YZ error messages

52.* errors

Errors in the 52.* family are related to the laser scanner.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Ensure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Check all connections on the laser/scanner and from the laser/scanner to the DC controller, and reseal them if necessary.
3. If the error persists, replace the laser scanner.

52.XX.00

Laser/scanner error.

- XX = 00
laser/scanner motor startup error.
- XX = 20
Laser/scanner rotation error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, replace the laser/scanner.

Laser scanner assembly part number: RM2-5612-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Reconnect connectors (J801) and (J802) on the laser/scanner.
3. Reconnect connectors (J110) and (J123) on the DC controller.
4. If either cable is damaged, replace the cable to the laser/scanner.

Cable, flexible flat scanner (J110-J801) part number: RM2-8662-000CN

Cable, flexible flat scanner (J123-J802) part number: RM2-8663-000CN

5. If the error persists, replace the laser/scanner.

Laser scanner assembly part number: RM2-5612-000CN

For Single function printer instructions: *Removal and replacement: Laser scanner assembly* See the Repair Service Manual for this product.

For MFP instructions: *Removal and replacement: Laser scanner assembly* See the Repair Service Manual for this product.

53.WX.YZ error messages

53.A0.y0

Tray "Y" side guide misalignment resolved.

The engine detected that the tray guide misalignment has been resolved.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A0.10:** Tray 1 Side guide misalignment resolved.
- **53.A0.20:** Tray 2 side guide misalignment resolved.
- **53.A0.30:** Tray 3 side guide misalignment resolved.
- **53.A0.40:** Tray 4 side guide misalignment resolved.
- **53.A0.50:** Tray 5 side guide misalignment resolved.
- **53.A0.60:** Tray 6 side guide misalignment resolved.

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.A0.y1

Tray "Y" Side guide misalignment proactive warning.

The engine detected a tray "Y" side guide misalignment.

This is a proactive warning intended to avoid a jam event.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A0.11:** Tray 1 side guide misalignment warning.
- **53.A0.21:** Tray 2 side guide misalignment warning.
- **53.A0.31:** Tray 3 side guide misalignment warning.
- **53.A0.41:** Tray 4 side guide misalignment warning.
- **53.A0.51:** Tray 5 side guide misalignment warning.
- **53.A0.61:** Tray 6 side guide misalignment warning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Ensure that the paper size in the tray matches the tray size in the [Trays](#) menu.
2. If the trays are **not** locked, ensure the tray guides are correctly aligned to the size of paper being installed.
3. If the trays are locked, contact your managed print provider if you need to change the paper size from the one selected.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Ask the customer to check the paper size loaded in the tray to see if it matches the size listed in the [Trays](#) menu or on the Configuration Page.
2. If the trays are **not** locked, educate the customer on the correct way to align the side guides when refilling paper in the tray.
3. Instruct the customer to contact the managed print provider if the paper size needs to be changed from the one selected.

53.A1.y0 Enter error message

Tray "Y" paper delivery direction misalignment resolved.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A1.10:** Tray 1 Side guide misalignment resolved.
- **53.A1.20:** Tray 2 side guide misalignment resolved.
- **53.A1.30:** Tray 3 side guide misalignment resolved.
- **53.A1.40:** Tray 4 side guide misalignment resolved.
- **53.A1.50:** Tray 5 side guide misalignment resolved.
- **53.A1.60:** Tray 6 side guide misalignment resolved.

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.A1.y1

Tray "Y" paper delivery direction misalignment warning.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A1.11:** Tray 1 paper delivery direction misalignment warning.
- **53.A1.21:** Tray 2 paper delivery direction misalignment warning.
- **53.A1.31:** Tray 3 paper delivery direction misalignment warning.
- **53.A1.41:** Tray 4 paper delivery direction misalignment warning.
- **53.A1.51:** Tray 5 paper delivery direction misalignment warning.
- **53.A1.61:** Tray 6 paper delivery direction misalignment warning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Ensure that the paper size in the tray matches the tray size in the [Trays](#) menu.
2. If the trays are **not** locked, ensure the tray guides are correctly aligned to the size of paper being installed.
3. If the trays are locked, contact your managed print provider if you need to change the paper size from the one selected.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Ensure that the paper tray guides are set to the correct paper size that is being loaded into the paper tray.



NOTE: Check the event log for the following messages to determine which tray guides need to be adjusted.

- **53.A1.11:** Tray 1 paper delivery direction misalignment warning.
 - **53.A1.21:** Tray 2 paper delivery direction misalignment warning.
 - **53.A1.31:** Tray 3 paper delivery direction misalignment warning.
 - **53.A1.41:** Tray 4 paper delivery direction misalignment warning.
 - **53.A1.51:** Tray 5 paper delivery direction misalignment warning.
 - **53.A1.61:** Tray 6 paper delivery direction misalignment warning.
2. Ensure that the rear paper guide is set to the correct paper length.
 3. Ask the customer to check the paper size loaded in the tray to see if it matches the size listed in the [Trays](#) menu or on the Configuration Page.
 4. If the trays are **not** locked, educate the customer on the correct way to align the guides when refilling paper in the tray.
 5. Inspect the quality and condition of the customer paper to identify conditions that may lead to paper skewing.
 6. Inspect the condition of the feed and separation rollers of the listed tray, and ensure they are not worn, or damaged. Replace the rollers as needed.

53.A2.y0

Tray "Y" overload resolved.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A2.10:** Tray 1 overload resolved.
- **53.A2.20:** Tray 2 overload resolved.

- **53.A2.30:** Tray 3 overload resolved.
- **53.A2.40:** Tray 4 overload resolved.
- **53.A2.50:** Tray 5 overload resolved.
- **53.A2.60:** Tray 6 overload resolved.

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.A2.y1

Tray "Y" overload warning.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A2.11:** Tray 1 overload warning.
- **53.A2.21:** Tray 2 overload warning.
- **53.A2.31:** Tray 3 overload warning.
- **53.A2.41:** Tray 4 overload warning.
- **53.A2.51:** Tray 5 overload warning.
- **53.A2.61:** Tray 6 overload warning.

Recommended action

Follow these troubleshooting steps in the order presented.

- Remove paper from the specified tray until it is below the paper fill level mark.

53.B0.0z

Tray "Z" feed roller nearing end of life.

Prepare to replace tray pick rollers



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B0.01:** Tray 1 feed roller nearing end of life.
- **53.B0.02:** Tray 2 feed roller nearing end of life.
- **53.B0.03:** Tray 3 feed roller nearing end of life.
- **53.B0.04:** Tray 4 feed roller nearing end of life.
- **53.B0.05:** Tray 5 feed roller nearing end of life.

- **53.B0.06:** Tray 6 feed roller nearing end of life.

Recommended action

Follow these troubleshooting steps in the order presented.

- The paper tray rollers will need to be replaced soon. Be prepared to replace the tray rollers for the specified tray.



NOTE: Check the event log for the following messages to determine which tray rollers need to be changed.

- **53.B0.01:** Tray 1 feed roller nearing end of life.
- **53.B0.02:** Tray 2 feed roller nearing end of life.
- **53.B0.03:** Tray 3 feed roller nearing end of life.
- **53.B0.04:** Tray 4 feed roller nearing end of life.
- **53.B0.05:** Tray 5 feed roller nearing end of life.
- **53.B0.06:** Tray 6 feed roller nearing end of life.

53.B1.0z

Tray "Z" feed roller at end of life.



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B1.01:** Tray 1 feed roller at end of life.
- **53.B1.02:** Tray 2 feed roller at end of life.
- **53.B1.03:** Tray 3 feed roller at end of life.
- **53.B1.04:** Tray 4 feed roller at end of life.
- **53.B1.05:** Tray 5 feed roller at end of life.
- **53.B1.06:** Tray 6 feed roller at end of life.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

- Replace the feed and separation rollers for the specified tray.

53.B2.0z

Tray "Z" feed roller brand new.



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B2.01:** Tray 1 feed roller brand new.
- **53.B2.02:** Tray 2 feed roller brand new.
- **53.B2.03:** Tray 3 feed roller brand new.
- **53.B2.04:** Tray 4 feed roller brand new.
- **53.B2.05:** Tray 5 feed roller brand new.
- **53.B2.06:** Tray 6 feed roller brand new.

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.B3.0z

Tray "Z" pick roller brand new (engine detected).

The engine detected that new tray feed rollers have been installed.



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B3.01:** Tray 1 feed roller brand new (engine detected).
- **53.B3.02:** Tray 2 feed roller brand new (engine detected).
- **53.B3.03:** Tray 3 feed roller brand new (engine detected).
- **53.B3.04:** Tray 4 feed roller brand new (engine detected).
- **53.B3.05:** Tray 5 feed roller brand new (engine detected).
- **53.B3.06:** Tray 6 feed roller brand new (engine detected).

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.C1.0z Tray "Z" size mismatch.

The specified tray contains a size that does not match the configured size.

Complete screen message:

The specified tray contains a size that does not match the configured size.

The tray is configured to support the only size indicated

Confirm guides are in correct position.

This issue occurs when the managed print provider has locked the paper tray to either letter or A4 and the tray has a different size paper loaded.



NOTE: This can occur if the tray was swapped out or the physical trays locks in the tray were removed and the guides changed.

- **53.C1.02:** Tray 2 size mismatch.
- **53.C1.03:** Tray 3 size mismatch.
- **53.C1.04:** Tray 4 size mismatch.
- **53.C1.05:** Tray 5 size mismatch.
- **53.C1.06:** Tray 6 size mismatch.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Ensure that the paper size in the tray matches the tray size in the [Trays](#) menu.
2. Contact your managed print provider if you need to change the paper size from the one selected.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Ask the customer to check the media size loaded in the tray to see if it matches the size listed in the [Trays](#) menu or on the Configuration Page.
2. Instruct the customer to contact the managed print provider if the paper size needs to be changed from the one selected.

54.WX.YZ error messages

54.* errors

Errors in the 54.* family are related to the image-formation system.

- For HP LaserJet printers, they can indicate a problem with the toner cartridges or the transfer unit (color printers only), or they can indicate a problem with a sensor, such as with the laser/scanner.
- For HP PageWide printers, they can indicate a problem with the calibration process.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Make sure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Check the supplies status page using the [Supplies](#) menu on the control panel to verify that toner cartridges, toner collection unit (TCU), or the transfer belt kit are not past their useful life. Replace the supplies and maintenance parts as necessary.

To print a Supplies Status Page:

- a. From the Home screen on the printer control panel, select [Administration](#).
- b. Open the following menus:
 - i. [Reports](#)
 - ii. [Configuration/Status Pages](#)
- c. Scroll to and select [Supplies Status Page](#).
- d. Select [Print](#) to print the page.

To order parts, go to <https://www.hp.com/buy/parts>.

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Check the supplies status page to verify that the toner cartridges, TCU, or the transfer belt kit are not past their useful life. Replace the supplies and maintenance parts as necessary.
3. For color printers, inspect the transfer belt for damage. Replace the transfer belt if necessary or instruct the customer to replace it.
4. For color printers, if the error persists, replace the registration assembly.
5. Check the connections between the laser/scanner and the DC controller, and from the laser/scanner to the printer. Reseat them if necessary. If the error persists, replace the laser scanner.

54.00.01

Environment sensor error

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Replace the environment sensor PCA assembly.

Environment sensor PCB assembly Part number: RM3-7236-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure that the connector for the environment sensor on the engine controller J121 is correctly seated and not damaged.
3. Replace the environment sensor PCA assembly.

Environment sensor PCB assembly Part number: RM3-7236-000CN

Removal and replacement: Environmental sensor See the Repair Service Manual for this product.

54.00.06, 54.00.18, 54.00.19

Density/ITB sensor error.

- **54.00.06:** Dmax density sensor. Density sensor abnormality warning. Event log only.
- **54.00.18:** The ITB top sensor malfunctioned.
- **54.00.19:** ITB/Top sensor abnormality. Event log only.

Recommended action for customers

Use the following steps to resolve the error.

1. Turn the printer off, and then on.
2. From the [Printer Maintenance](#) menu run the [Full Calibration](#).
3. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.
2. From the [Printer Maintenance](#) menu run the [Full Calibration](#).
3. If the error persists, replace the density detect sensor assembly.

Density detect sensor part number: RM2-7399-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.
2. From the [Printer Maintenance](#) menu run the [Full Calibration](#).
3. If the error persists, replace the density detect sensor assembly.

Density detect sensor part number: RM2-7399-000CN

Removal and replacement: Density detect sensor assembly See the Repair Service Manual for this product.

54.14.00

CPR sensor error

Recommended action for customers

Use the following steps to resolve the error.

1. Turn the printer off, and then on.
2. From the [Printer Maintenance](#) menu run the [Full Calibration](#).
3. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.
2. From the [Printer Maintenance](#) menu run the [Full Calibration](#).
3. If the error persists, replace the density detect sensor assembly.

Density detect sensor part number: RM2-7399-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.
2. From the [Printer Maintenance](#) menu run the [Full Calibration](#).
3. If the error persists, replace the density detect sensor assembly.

Density detect sensor part number: RM2-7399-000CN

Removal and replacement: Density detect sensor assembly See the Repair Service Manual for this product.

54.00.15, 54.01.15, 54.02.15, or 54.03.15

Toner level sensor error

- **54.00.15** – Black toner level sensor error.

- **54.01.15** – Cyan toner level sensor error.
- **54.02.15** – Magenta toner level sensor error.
- **54.03.15** – Yellow toner level sensor error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. If the error persists, and a surge protector is in use, perform the following:
 - a. Turn the printer off.
 - b. Remove the surge protector and plug the printer directly into the wall socket.
 - c. Turn the printer on.
4. If the error persists, replace the density detect sensor assembly.

Density detect sensor part number: RM2-7399-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. If the error persists, and a surge protector is in use, perform the following:
 - a. Turn the printer off.
 - b. Remove the surge protector and plug the printer directly into the wall socket.
 - c. Turn the printer on.
4. If the error persists, reseal the density sensor connections on the DC Controller.
5. If the error persists, replace the density detect sensor assembly.

Density detect sensor part number: RM2-7399-000CN

Removal and replacement: Density detect sensor assembly See the Repair Service Manual for this product.

54 . 0x . 0B, 54 . 0x . 0C, 54 . 0x . 0D, or 54 . 0x . 0E (Event log only)

Density sensor out of range error or Dhalf calibration failure.

Misregistration measurement abnormality error.

- 54.00.0B, 54.00.0C 54.00.0D, 54.00.0E – Black
- 54.01.0B, 54.01.0C 54.01.0D, 54.01.0E – Cyan
- 54.02.0B, 54.02.0C 54.02.0D, 54.02.0E – Magenta
- 54.03.0B, 54.03.0C 54.03.0D, 54.03.0E – Yellow

Recommended action for customers

Use the following steps to resolve the error.

1. Turn the printer off, and then on.
2. From the [Printer Maintenance](#) menu run the [Full Calibration](#).
3. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. If the error persists, and a surge protector is in use, perform the following:
 - a. Turn the printer off.
 - b. Remove the surge protector and plug the printer directly into the wall socket.
 - c. Turn the printer on.
4. If the error persists, replace the density detect sensor assembly.
Density detect sensor part number: RM2-7399-000CN
5. If the error persists, elevate the case using the Standard Support Procedure.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. If the error persists, and a surge protector is in use, perform the following:
 - a. Turn the printer off.
 - b. Remove the surge protector and plug the printer directly into the wall socket.
 - c. Turn the printer on.

4. If the error persists, reseal the density sensor connections on the DC Controller.
5. If the error persists, replace the density detect sensor assembly.

Density detect sensor part number: RM2-7399-000CN

Removal and replacement: Density detect sensor assembly See the Repair Service Manual for this product.

6. If the error persists, elevate the case using the Standard Support Procedure.

54.05.07 or 54.06.07 or 54.07.07 or 54.08.07

The printer experienced drum phase control sensor error.

- **54.05.07** - Black Drum Phase Control Sensor Error
- **54.06.07** - Cyan Drum Phase Control Sensor Error
- **54.07.07** - Magenta Drum Phase Control Sensor Error
- **54.08.07** - Yellow Drum Phase Control Sensor Error

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, replace the drum motor.

Drum motor (M2) Part number: RM2-7342-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, replace the drum motor.

Drum motor (M2) Part number: RM2-7342-000CN

For instructions: *Removal and replacement: Drum motor* See the Repair Service Manual for this product.

54.21.00

Laser/scanner beam detect error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, replace the laser/scanner assembly.

Laser scanner assembly part number: RM2-5612-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error returns, check the wire harness from the laser/scanner to the DC controller.
 - a. Check the following connectors on DC controller J110, 111 and J123.
 - b. Check the connectors on the laser/scanner J801 and J802.
3. If the error persists, replace the laser/scanner assembly.

Laser scanner assembly part number: RM2-5612-000CN

For Single function printer instructions: *Removal and replacement: Laser scanner assembly* See the Repair Service Manual for this product.

For MFP instructions: *Removal and replacement: Laser scanner assembly* See the Repair Service Manual for this product.

54.0B.yz Event log only

Density sensor out of range or density measurement abnormality.

- 54.0B.00 or 54.0B.10– Black
- 54.0B.01 or 54.0B.11– Cyan
- 54.0B.02 or 54.0B.12– Magenta
- 54.0B.03 or 54.0B.13– Yellow

Recommended action for customers

Use the following steps to resolve the error.

1. Turn the printer off, and then on.
2. From the [Printer Maintenance](#) menu run the [Full Calibration](#).

3. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.
2. Check the supplies status page to ensure that the toner cartridges are not past their useful life.



NOTE: After an HP supply has reached the very low threshold, the HP premium protection warranty ends and the customer is responsible for replacing the part(s).

3. Check the Intermediate transfer belt (ITB) for damage and replace the Intermediate transfer belt (ITB) as needed.

Intermediate transfer belt (ITB) assembly RM2-6454-000CN

4. From the [Printer Maintenance](#) menu run the [Full Calibration](#).
5. If the error persists, replace the density detect sensor assembly.

Density detect sensor part number: RM2-7399-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.
2. Check the supplies status page to ensure that the toner cartridges are not past their useful life.



NOTE: After an HP supply has reached the very low threshold, the HP premium protection warranty ends and the customer is responsible for replacing the part(s).

3. Check the Intermediate transfer belt (ITB) for damage and replace the Intermediate transfer belt (ITB) as needed.

Intermediate transfer belt (ITB) assembly RM2-6454-000CN

For instructions: *Removal and replacement: Intermediate transfer belt* See the Repair Service Manual for this product.

4. From the [Printer Maintenance](#) menu run the [Full Calibration](#).
5. If the error persists, replace the density detect sensor assembly.

Density detect sensor part number: RM2-7399-000CN

Removal and replacement: Density detect sensor assembly See the Repair Service Manual for this product.

54.0C.0z or 54.0D.0z

DHalf warning..

- **54.0C.00, 54.0D.00** – Black DHalf warning.
- **54.0C.01, 54.0D.01** – Cyan DHalf warning.
- **54.0C.02, 54.0D.02** – Magenta DHalf warning.

54.0C.03, 54.0D.03 – Yellow DHalf warning.

Recommended action for customers

Use the following steps to resolve the error.

1. Turn the printer off, and then on.
2. From the [Printer Maintenance](#) menu run the [Full Calibration](#).
3. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.
2. Check the supplies status page to ensure that the toner cartridges are not past their useful life.



NOTE: After an HP supply has reached the very low threshold, the HP premium protection warranty ends and the customer is responsible for replacing the part(s).

3. Check the Intermediate transfer belt (ITB) for damage and replace the Intermediate transfer belt (ITB) as needed.

Intermediate transfer belt (ITB) assembly RM2-6454-000CN

4. From the [Printer Maintenance](#) menu run the [Full Calibration](#).
5. If the error persists, replace the density detect sensor assembly.

Density detect sensor part number: RM2-7399-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.
2. Check the supplies status page to ensure that the toner cartridges are not past their useful life.



NOTE: After an HP supply has reached the very low threshold, the HP premium protection warranty ends and the customer is responsible for replacing the part(s).

3. Check the Intermediate transfer belt (ITB) for damage and replace the Intermediate transfer belt (ITB) as needed.

Intermediate transfer belt (ITB) assembly RM2-6454-000CN

For instructions: *Removal and replacement: Intermediate transfer belt* See the Repair Service Manual for this product.

4. From the [Printer Maintenance](#) menu run the [Full Calibration](#).
5. If the error persists, replace the density detect sensor assembly.

Density detect sensor part number: RM2-7399-000CN

Removal and replacement: Density detect sensor assembly See the Repair Service Manual for this product.

54.0F.00, 54.0F.01, 54.0F.02, or 54.0F.03 Event log only

Density sensor or CPR out of range.

Misregistration measurement abnormality error.

- **54.0F.00** – Black
- **54.0F.01** – Cyan
- **54.0F.02** – Magenta
- **54.0F.03** – Yellow

Recommended action for customers

Use the following steps to resolve the error.

1. Turn the printer off, and then on.
2. From the [Printer Maintenance](#) menu run the [Full Calibration](#).
3. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. If the error persists, and a surge protector is in use, perform the following:
 - a. Turn the printer off.
 - b. Remove the surge protector and plug the printer directly into the wall socket.
 - c. Turn the printer on.
4. If the error persists, replace the density detect sensor assembly.
Density detect sensor part number: RM2-7399-000CN
5. If the error persists, elevate the case using the Standard Support Procedure.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. If the error persists, and a surge protector is in use, perform the following:
 - a. Turn the printer off.

- b. Remove the surge protector and plug the printer directly into the wall socket.
- c. Turn the printer on.
- 4. If the error persists, reseal the density sensor connections on the DC Controller.
- 5. If the error persists, replace the density detect sensor assembly.

Density detect sensor part number: RM2-7399-000CN

Removal and replacement: Density detect sensor assembly See the Repair Service Manual for this product.

- 6. If the error persists, elevate the case using the Standard Support Procedure.

55.WX.YZ error messages

55.* errors

Errors in the 55.* family often indicate a problem with the DC controller.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

- 1. Turn the printer off, and then on.
- 2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

- 1. Reset the printer:
 - a. Turn the printer off using the power switch, and then wait at least 30 seconds.
 - b. Turn the printer on and wait for it to initialize.
- 2. Make sure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
- 3. If the error persists, replace the DC controller.

55.00.00, 55.01.00, 55.30.00 or 55.40.00

Engine communication or memory error.

- **55.00.00** Engine communication error.
- **55.01.00** DC Controller memory error.
- **55.30.00** Engine communication error.

- **55.40.00** Engine communication timeout error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. If the error persists, replace the DC Controller PCB Assembly:

DC controller part number: RM3-7272-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. If the error persists, replace the Engine Controller PCB Assembly:

DC controller part number: RM3-7272-000CN

For instructions: *Removal and replacement: DC Controller PCA* See the Repair Service Manual for this product.

55 . 00 . 05 Engine Firmware RFU Error

The DC controller firmware upgrade failed.

Recommended action for customers

Use the following steps to resolve the error.

1. Turn the printer off, and then on.
2. If issue remains, perform a firmware upgrade.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: HP FutureSmart - Latest Firmware Versions

3. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If issue remains, perform a firmware upgrade.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, replace the DC controller PCA.

DC controller part number: RM3-7272-000CN

4. If the error still persists, replace the formatter.

Table 6-13 Part numbers

Description	Part number	Model numbers
Formatter (SFP)	3PZ95-67903	M455dn, E45028dn
Formatter (China/India; SFP)	3PZ95-67904	M455dn, E45028dn
Formatter (MFP)	3QA55-67901	M480f, E47528f
Formatter (China/India; MFP)	3QA55-67902	M480f, E47528f

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If issue remains, perform a firmware upgrade.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, replace the DC controller PCA.

DC controller part number: RM3-7272-000CN

For instructions: *Removal and replacement: DC Controller PCA* See the Repair Service Manual for this product.

4. If the error still persists, replace the formatter.

Table 6-14 Part numbers

Description	Part number	Model numbers
Formatter (SFP)	3PZ95-67903	M455dn, E45028dn
Formatter (China/India; SFP)	3PZ95-67904	M455dn, E45028dn
Formatter (MFP)	3QA55-67901	M480f, E47528f
Formatter (China/India; MFP)	3QA55-67902	M480f, E47528f

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

55.01.06 or 55.02.06

DC controller NVRAM memory error.

- **55.01.06** - DC controller NVRAM data error
- **55.02.06** - DC controller NVRAM access error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. If the error persists, replace the DC controller PCA.

DC controller part number: RM3-7272-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. If the error persists, replace the DC controller PCA.

DC controller part number: RM3-7272-000CN

For instructions: *Removal and replacement: DC Controller PCA* See the Repair Service Manual for this product.

56.WX.YZ error messages

56.* errors

Errors in the 56.* family indicate a communication problem with an optional paper tray or other external accessory.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. If any third-party hardware is installed, remove it and try printing again.
3. If an optional paper tray is installed, remove it. Check the connectors on the tray for damage. If the connector is damaged, replace the tray.
4. Reinstall the tray, and make sure it is correctly seated.

56.01.00

The printer experienced an illegal input.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, then on.
2. Remove any third-party hardware and test again.

57.WX.YZ error messages

57.* errors

Errors in the 57.* family indicate a problem with a fan.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.
2. Press the Power button again to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Use the printer troubleshooting manual to identify the locations of each fan. Turn the printer off and then on, and listen for noise coming from the area of each fan. Replace any fan that is not making noise.
2. Update the firmware to the latest version. If the latest version firmware is already installed, reinstall it now.

For more information, see:

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. Remove enough parts to access the DC controller or the power supply PCA. Check the connections from each fan to the DC controller or power supply PCA. Reseat them if necessary.
4. With the DC controller or power supply PCA exposed, turn the printer on. Immediately measure the voltage between the connectors for each fan and the DC controller. If the voltage changes from 0V to approximately 24V during the power-on cycle, replace the affected fan. If the voltage remains at 0V, replace the DC controller.

57.00.01 Fan failure

Power supply fan FM1 failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, then on.
2. If the error persists, replace the power supply fan FM1.

Fan assembly Part number: RK2-6270-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, then on.
2. Disconnect and reconnect J205 on the driver PCA.
3. If the error persists, replace the power supply fan FM1.

Fan assembly Part number: RK2-6270-000CN

For instructions: *Removal and replacement: Power supply fan FM1* See the Repair Service Manual for this product.

57.00.01 Fan failure

Cartridge fan FM2 error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, replace the cartridge fan FM2..

Fan assembly Part number: RK2-6270-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Disconnect and reconnect J206 on the driver PCA.
3. If the error persists, replace the cartridge fan FM2..

Fan assembly Part number: RK2-6270-000CN

For instructions: *Removal and replacement: Power supply fan FM* See the Repair Service Manual for this product.

58.WX.YZ error messages

58.* errors

Errors in the 58.* family indicate an electrical problem inside the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Make sure the printer is connected to a dedicated power outlet and not to a surge protector or other type of extension cord.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Make sure the printer is connected to a dedicated power outlet and not to a surge protector or other type of extension cord.
3. Check all connections on the DC Controller and the power supply. Trace the connections from the DC Controller and power supply to the sensors and other components and reseal them if necessary.

58.04.00

AC/LVPS Power Failure.

Recommended action for customers

Use the following steps to resolve the error.

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues.

Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.



NOTE: This error might be caused by source power related issues.

Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the printer is plug into a dedicated power outlet.
6. Check the voltage label on the back of the product. If the product is rated 220V and is plugged into a 110V outlet, this error might occur. In most cases, no damage is caused to the product. If a power transformer is used to convert 220V power to 110V, verify that the transformer power rating is sufficient to operate the product.
7. If the error persists, replace the low-voltage power assembly.
LV power supply PCA (110-127V)RM3-7278-000CN
LV power supply PCA (220-240V)RM3-7279-000CN
8. If the error persists, elevate the case using the Standard Support Process.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize

3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.



NOTE: This error might be caused by source power related issues.

Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the printer is plug into a dedicated power outlet.
6. Check the voltage label on the back of the product. If the product is rated 220V and is plugged into a 110V outlet, this error might occur. In most cases, no damage is caused to the product. If a power transformer is used to convert 220V power to 110V, verify that the transformer power rating is sufficient to operate the product.
7. If the error persists, replace the low-voltage power supply (LVPS).

LV power supply PCA (110-127V)RM3-7278-000CN

LV power supply PCA (220-240V)RM3-7279-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

59.WX.YZ error messages

59.* errors

Errors in the 59.* family indicate a problem with one of the motors or with the lifter drive assembly for one of the trays.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Check all connections on the main control board of the printer, (DC controller, Engine control board ECB) each motor, and to the paper feeder drive PCA (for an optional paper feeder). Reseat them if necessary.

59.00.30 or 59.00.40 Fuser error

Fuser motor M4 start up error or fuser motor M4 rotational error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. If the error persists, replace the fuser motor M4.

Assembly, fixing motor RM2-7349-000CN



NOTE: Add notes: Before replacing the motor, the service technician should ensure that the fuser assembly is not damaged and causing the issue.

5. If the error persists after the motor has been replaced, replace the DC controller.

DC controller part number: RM3-7272-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. If the error persists, replace the fuser motor M4.

Assembly, fixing motor RM2-7349-000CN



NOTE: Before replacing the motor, the service technician should ensure that the fuser assembly is not damaged and causing the issue.

For instructions: *Removal and replacement: Fuser motor assembly* See the Repair Service Manual for this product.

5. If the error persists after the motor has been replaced, replace the DC controller.

DC controller part number: RM3-7272-000CN

For instructions: *Removal and replacement: DC Controller* See the Repair Service Manual for this product.

59.09.00 or 59.0A.00

Main motor error.

An ITB motor error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. If the error persists, replace the drum motor M2.
Drum motor (M2) Part number: RM2-7342-000CN
5. If the error persists after the motor has been replaced, replace the DC controller.
DC controller part number: RM3-7272-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. If the error persists, replace the drum motor M2.
Drum motor (M2) Part number: RM2-7342-000CN
For instructions: *Removal and replacement: Drum motor* See the Repair Service Manual for this product.
5. If the error persists after the motor has been replaced, replace the DC controller.
DC controller part number: RM3-7272-000CN

For instructions: *Removal and replacement: DC Controller* See the Repair Service Manual for this product.

59.00.C0 or 59.00.F0

ITB alienation mechanism failure or developer motor issue.



NOTE: The M3 Developer motor is uses switches for the contact/alienation of developer roller from the ITB also.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. If the error persists, replace the Intermediate transfer belt (ITB).

Intermediate transfer belt (ITB) assemblyRM2-6454-000CN

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.



NOTE: There is an Emerging Issue document that should be followed for any 59.00.F0 error.

Go to: *HP Color LaserJet Enterprise M455, M480, E45028, E47528 - 59.00.F0 (ITB alienation mechanism failure) Emerging Issue*

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. If the error persists, replace the Intermediate transfer belt (ITB).

Intermediate transfer belt (ITB) assemblyRM2-6454-000CN

For instructions: *Removal and replacement: Intermediate transfer belt* See the Repair Service Manual for this product.

5. If the error persists, replace the developer motor assembly M3.

Developing motor (M3) part number: RM2-7344-000CN



IMPORTANT: The service technician should check the connectors on the DC controller for the specific motor before replacing any parts. This is especially important if any previous parts have been replaced.

For instructions: *Removal and replacement: Developer motor M3* See the Repair Service Manual for this product.

59.5x.00 or 59.6x.00

The printer experienced drum motor M2 error.

- **59.05.50** Image drum motor startup error - black.
- **59.05.60** Image drum rotation startup error - black.
- **59.06.50** Image drum motor startup error - cyan.
- **59.06.60** Image drum rotation startup error - cyan.
- **59.07.50** Image drum motor startup error - magenta.
- **59.07.60** Image drum rotation startup error - magenta.
- **59.08.50** Image drum motor startup error - yellow.
- **59.08.60** Image drum rotation startup error - yellow.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. Open the front cover and remove the indicated toner cartridge. Ensure the toner cartridge is an authentic HP supply. Inspect the toner cartridge for damage that might cause it not to rotate correctly. Replace the toner cartridge as needed.



NOTE: If the toner cartridge is damaged or if the drum in the cartridge does not rotate correctly it might cause this error

4. If the error persists, replace the drum motor assembly.

Drum motor (M2) Part number: RM2-7342-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. Open the front cover and remove the indicated toner cartridge. Ensure the toner cartridge is an authentic HP supply. Inspect the toner cartridge for damage that might cause it not to rotate correctly. Replace the toner cartridge as needed.



NOTE: If the toner cartridge is damaged or if the drum in the cartridge does not rotate correctly it might cause this error

4. If the error persists, replace the drum motor assembly.

Drum motor (M2) Part number: RM2-7342-000CN

For instructions: *Removal and replacement: Drum motor* See the Repair Service Manual for this product.

59.0x.70 or 59.0x.80

The printer experienced a developer motor M3 error.

- **59.05.70** Black developer motor startup error.
- **59.05.80** Black developer motor rotation error.
- **59.06.70** Cyan developer motor startup error.
- **59.06.80** Cyan developer motor rotation error.
- **59.07.70** Magenta developer motor startup error.
- **59.07.80** Magenta developer motor rotation error.
- **59.08.70** Yellow developer motor startup error.
- **59.08.80** Yellow developer motor rotation error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize

3. If the error persists, replace the developer motor assembly M3.

Developing motor (M3) part number: RM2-7344-000CN

 **IMPORTANT:** Add notes: The service technician should check the connectors on the DC controller for the specific motor before replacing any parts. This is especially important if any previous parts have been replaced.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error persists, replace the developer motor assembly M3.

Developing motor (M3) part number: RM2-7344-000CN

 **IMPORTANT:** The service technician should check the connectors on the DC controller for the specific motor before replacing any parts. This is especially important if any previous parts have been replaced.
For instructions: *Removal and replacement: Developer motor M3* See the Repair Service Manual for this product.

60.WX.YZ error messages

60.* errors

Errors in the 60.* family are related to one of the optional trays.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

 **NOTE:** You can determine the tray number from the last digit in the error number. For example:

- 60.00.02 or 60.01.02 = Tray 2
- 60.00.03 or 60.01.03 = Tray 3

-
1. Open the failing tray and remove all paper from the tray.
 2. Close the tray to check if the error persists.
 3. Reload the paper and test the printer.
 4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Use the [Tray/Bin Manual Sensor](#) test to verify that the sensors for each tray are functioning correctly.
2. Check all connectors on the paper feeder PCA.
3. Replace the optional paper feeder.

60.00.02

Tray 2 lift motor error.

Recommended action for customers

Use the following steps to resolve the error.

1. Open the indicated tray and remove all the paper.
2. Close the tray and see if the error still persists.
3. Reload the paper tray making sure the tray guides are set correctly and the tray is not over loaded.
4. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Open tray 2 and remove all the paper from the cassette.
2. Close the tray to see if it will lift successfully.
3. If the error persists, remove the tray 2 cassette and check the tray for any damage or defects that might keep it from lifting. If the tray is damaged, replace the cassette tray.

Cassette (Tray 2) assembly part number: RM2-6377-000CN

4. If the tray is not damaged and the error persists, replace the lifter drive assembly.

Lifter drive assembly part number: RM2-6370-000CN

For instructions: *Removal and replacement: Lifter drive assembly* See the Repair Service Manual for this product.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open tray 2 and remove all the paper from the cassette.
2. Close the tray to see if it will lift successfully.
3. If the error persists, remove the tray 2 cassette and check the tray for any damage or defects that might keep it from lifting. If the tray is damaged, replace the cassette tray.

Cassette (Tray 2) assembly part number: RM2-6377-000CN

4. If the tray is not damaged and the error persists, replace the lifter drive assembly.

Lifter drive assembly part number: RM2-6370-000CN

For instructions: *Removal and replacement: Lifter drive assembly* See the Repair Service Manual for this product.

60.00.03

Tray 3 lift motor error.

Recommended action for customers

Use the following steps to resolve the error.

1. Open the indicated tray and remove all the paper.
2. Close the tray and see if the error still persists.
3. Reload the paper tray making sure the tray guides are set correctly and the tray is not over loaded.
4. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Open tray 3 and remove all the paper from the cassette.
2. Close the tray to see if it will lift successfully.
3. If the error persists, remove the tray 3 cassette and check the tray for any damage or defects that might keep it from lifting. If the tray is damaged, replace the cassette tray.

Cassette assembly, Tray 3 (550-sheet paper feeder) part number: RM2-6486-000CN

4. If the tray is not damaged and the error persists, replace the lifter drive assembly.

Paper pickup assembly (550-sheet paper feeder) part number: RM2-6490-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open tray 3 and remove all the paper from the cassette.
2. Close the tray to see if it will lift successfully.
3. If the error persists, remove the tray 3 cassette and check the tray for any damage or defects that might keep it from lifting. If the tray is damaged, replace the cassette tray.

Cassette assembly, Tray 3 (550-sheet paper feeder) part number: RM2-6486-000CN

4. If the tray is not damaged and the error persists, replace the lifter drive assembly.

Paper pickup assembly (550-sheet paper feeder) part number: RM2-6490-000CN

For Instructions: *Removal and replacement: 550 sheet feeder pickup assembly* See the Repair Service Manual for this product.

62.WX.YZ error messages

62 . 00 . 00 To continue turn off then on.

Internal system failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, reload the firmware. If the error still persists, perform a firmware upgrade.
3. If the firmware upgrade does not resolve the problem, replace the eMMC.

Single function printer: eMMC 4GB part number: 3PZ15-67905

MFP Printer: eMMC 16GB Part number: B5L32-60002

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, reload the firmware. If the error still persists, perform a firmware upgrade.
3. If the firmware upgrade does not resolve the problem, replace the hard disk.

Single function printer: eMMC 4GB part number: 3PZ15-67905

MFP Printer: eMMC 16GB Part number: B5L32-60002

Removal and replacement: eMMC See the Repair Service Manual for this product.

70.WX.YZ error messages

70.* errors

Messages in the 70.* family indicate a problem with the DC controller or Formatter (ECB) depending on your printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Replace the DC controller or the Formatter as needed.

80.WX.YZ, 81.WX.YZ error messages

80.* errors

Errors in the 80.* family indicate a problem with an external I/O device, such as a Jetdirect card, an EIO card, or an external hard disk.

- **80.00.00 error:** Managed device lost connection to service provider. The product is under a service contract and has lost network connectivity for license validation.
- **80.01.01 error:** HP Accessibility Assistant connection error. Managed device is unable to establish a connection with the HP Accessibility Assistant.
- **80.01.02 error:** Managed Device Unknown HP Accessibility Assistant error.
- **80.01.03 error:** HP Accessibility Assistant connection lost. The product lost communication with the HP Accessibility Assistant.
- **80.01.04 error:** HP Accessibility Assistant disconnected. The HP Accessibility Assistant was disconnected from the product.
- **80.01.05 error:** HP Accessibility Assistant detected. Restart required. The HP Accessibility Assistant was connected to the product after turn on. The HP Accessibility Assistant is not a plug-and-play device.

Recommended action for customers

Customer actions for 80.* errors.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. Reload the printer firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call center agents

Call center agent actions for 80.* errors.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. If the error persists, perform a [Partial Clean](#) procedure using the [Preboot](#) menu.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

- a. Turn the printer on.
 - b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
 - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Partial Clean](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Press the back button once to highlight [Continue](#), and then press the [OK](#) button.
 - g. The printer automatically initializes and then returns to a Ready state.
4. If the error persists, perform a [Format Disk](#) procedure using the [Preboot](#) menu, and then upgrade the firmware to the latest version.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

- a. Turn the printer on.
 - b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
 - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Format Disk](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Wait for the printer to automatically initialize. The message **99.09.67** appears on the control panel.
 - g. Reload the firmware using a USB flash drive. See [99.09.67 error](#) for more information.
5. If the error persists, dispatch an onsite technician (no replacement parts required).

Recommended action for call center agents

Call center agent actions for 80.* errors.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.

3. If the error persists, perform a [Partial Clean](#) procedure using the [Preboot](#) menu.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

- a. Turn the printer on.
 - b. Press the HP logo that displays in the middle of the screen when you see the [1/8](#) under the logo.
 - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Partial Clean](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Press the back button once to highlight [Continue](#), and then press the [OK](#) button.
 - g. The printer automatically initializes and then returns to a Ready state.
4. If the error persists, perform a [Format Disk](#) procedure using the [Preboot](#) menu, and then upgrade the firmware to the latest version.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

- a. Turn the printer on.
- b. Press the HP logo that displays in the middle of the screen when you see the [1/8](#) under the logo.
- c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
- d. Press the down arrow button to highlight [Format Disk](#), and then press the [OK](#) button.
- e. Press the [OK](#) button again.
- f. Wait for the printer to automatically initialize. The message **99.09.67** appears on the control panel.
- g. Reload the firmware using a USB flash drive. See [99.09.67 error](#) for more information.

80 . 0x . yy Embedded Jetdirect Error

An Embedded HP JetDirect print server critical error has occurred.

- **80.01.80:** (event log) No heartbeat
- **80.01.81:** (event log) Reclaim timeout
- **80.01.82:** (event log) Invalid data length
- **80.01.8B:** (event log) Invalid max outstanding packet header field
- **80.01.8C:** (event log) Invalid channel mapping response
- **80.03.01:** (event log) No PGP buffers

- **80.03.02:** (event log) Channel table full
- **80.03.03:** (event log) Producer index not reset
- **80.03.04:** (event log) Consumer index not reset
- **80.03.05:** (event log) Queue position size too small
- **80.03.06:** (event log) Transport overflow
- **80.03.07:** (event log) No overflow packets
- **80.03.08:** (event log) Invalid identify response
- **80.03.09:** (event log) Invalid channel map return status
- **80.03.10:** (event log) Invalid reclaim return status
- **80.03.12:** (event log) Datagram invalid buffer
- **80.03.13:** (event log) Max stream channels
- **80.03.14:** (event log) Max datagram channels
- **80.03.15:** (event log) Card reset failed
- **80.03.16:** (event log) Self-test failure
- **80.03.17:** (event log) Unknown PGP packet
- **80.03.18:** (event log) Duplicate I/O channel

Recommended action for customers

Use the following steps to resolve the error.

1. Turn the printer off, and then on.
2. Remove the RJ45 cable.
3. Turn the printer off, and then on.
4. Reconnect the RJ45 cable.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Remove the RJ45 cable.
3. Turn the printer off, and then on.
4. Reconnect the RJ45 cable.

5. If the error persists, replace the formatter.

Table 6-15 Part numbers

Description	Part number	Model numbers
Formatter (SFP)	3PZ95-67903	M455dn, E45028dn
Formatter (China/India; SFP)	3PZ95-67904	M455dn, E45028dn
Formatter (MFP)	3QA55-67901	M480f, E47528f
Formatter (China/India; MFP)	3QA55-67902	M480f, E47528f

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Remove the RJ45 cable.
3. Turn the printer off, and then on.
4. Reconnect the RJ45 cable.
5. If the error persists, replace the formatter.

Table 6-16 Part numbers

Description	Part number	Model numbers
Formatter (SFP)	3PZ95-67903	M455dn, E45028dn
Formatter (China/India; SFP)	3PZ95-67904	M455dn, E45028dn
Formatter (MFP)	3QA55-67901	M480f, E47528f
Formatter (China/India; MFP)	3QA55-67902	M480f, E47528f

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

81.09.00 Error

Internal Jetdirect Inside Networking event.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technician

Follow these troubleshooting steps in the order presented.

1. Verify that the issue occurs with the latest version of firmware.

- a. Obtain the latest public firmware version for the device from hp.com.
 - b. Update the device firmware.
 - c. The device will reboot during the firmware update process.
 - d. If available (from HP Advance Technical Support), obtain the latest interim version of firmware to perform the same update test.
 - e. If the issue persists, continue with the next troubleshooting step.
2. Verify that the issue occurs when the device has the latest firmware and is not connected to the network.
 - a. Disconnect the network cable from the network I/O port on the device.
 - b. Turn the printer off, and then on.
 - c. If the error persists, continue with the next troubleshooting step.
3. Verify that the issue occurs when disconnected from the network and with default configuration.
 - a. Run a partial clean.

 For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .
 - b. If the error persists, continue with the next troubleshooting step.
4. **Call center agents:** Dispatch an onsite technician to re-establish the trusted platform module state in the printer.

 **IMPORTANT:** Never replace the TPM on a unit that shipped with one. The TPM that can be ordered is only available for adding a level of security on a device that never had a TPM paired from the factory. A new TPM cannot be installed for security reasons.

82.WX.YZ error messages

82.* errors

Errors in the 82.* family indicate a problem with an external I/O device, such as a Jetdirect card, an EIO card, or an external hard disk.

- **82.00.00 error:** Memory Error.
- **82.73.45 error:** Memory Error. Disk successfully cleaned. Event log only.
- **82.73.46 error:** Memory Error. A hard disk or compact flash disk cleaning failed. Usually caused by a failure of the disk hardware. Event log only.
- **82.73.47 error:** Memory Error. Some of sanitized disk did not correctly verify. Event log only.

Recommended action for customers

Customer actions for 80.* errors.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. Reload the printer firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call center agents

Call center agent actions for 80.* errors.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. If the error persists, perform a [Partial Clean](#) procedure using the [Preboot](#) menu.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

- a. Turn the printer on.
 - b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
 - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Partial Clean](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Press the back button once to highlight [Continue](#), and then press the [OK](#) button.
 - g. The printer automatically initializes and then returns to a Ready state.
4. If the error persists, perform a [Format Disk](#) procedure using the [Preboot](#) menu, and then upgrade the firmware to the latest version.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

- a. Turn the printer on.
- b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
- c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
- d. Press the down arrow button to highlight [Format Disk](#), and then press the [OK](#) button.
- e. Press the [OK](#) button again.

- f. Wait for the printer to automatically initialize. The message **99.09.67** appears on the control panel.
 - g. Reload the firmware using a USB flash drive. See [99.09.67 error](#) for more information.
5. If the error persists, dispatch an onsite technician (no replacement parts required).

Recommended action for call center agents

Call center agent actions for 80.* errors.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. If the error persists, perform a [Partial Clean](#) procedure using the [Preboot](#) menu.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

- a. Turn the printer on.
 - b. Press the HP logo that displays in the middle of the screen when you see the [1/8](#) under the logo.
 - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Partial Clean](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Press the back button once to highlight [Continue](#), and then press the [OK](#) button.
 - g. The printer automatically initializes and then returns to a Ready state.
4. If the error persists, perform a [Format Disk](#) procedure using the [Preboot](#) menu, and then upgrade the firmware to the latest version.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

- a. Turn the printer on.
- b. Press the HP logo that displays in the middle of the screen when you see the [1/8](#) under the logo.
- c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
- d. Press the down arrow button to highlight [Format Disk](#), and then press the [OK](#) button.
- e. Press the [OK](#) button again.
- f. Wait for the printer to automatically initialize. The message **99.09.67** appears on the control panel.
- g. Reload the firmware using a USB flash drive. See [99.09.67 error](#) for more information.

82.73.46, 82.73.47

A hard disk or compact flash disk cleaning failed.

This error is usually caused by a failure of the disk hardware.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the product off, and then on.
2. Reload the printer firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Use the [Format Disk](#) item in the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

3. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

98.WX.YZ error messages

98.* errors

Errors in the 98.* family are related to data corruption in the firmware.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Download and install the most current version of the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Use the [Format Disk](#) item in the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

4. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

98 . 00 . 01 or 98 . 01 . 00 Corrupt data in firmware volume

Data corruption has occurred in the firmware volume.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Use the [Format Disk](#) item in the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

3. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

98 . 00 . 02 Corrupt data in the solutions volume

Data corruption has occurred in the solutions volume.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.

2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Use the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

3. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

98 . 00 . 03 Corrupt data in the configuration volume

Data corruption has occurred in the configuration volume.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.

2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Download the firmware again, and then attempt the upgrade again.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Use the [Format Disk](#) item in the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

4. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

98.00.04 Corrupt data in the job data volume

Data corruption has occurred in the job data volume.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Make sure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Rerun the file erase function.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

99.WX.YZ error messages

99.* errors

Errors in the 99.* family are related to the firmware upgrade process.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Make sure the connection to the network is good, and then try the firmware upgrade again.
2. If the error persists, try using the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Make sure the connection to the network is good, and then try the upgrade again.

2. Try using the USB upgrade method.
3. If the error persists, run the [Format Disk](#) process from the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

4. If the issue persists, replace the hard disk drive (HDD).



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-17 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41616-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

99 . 00 . 01 Upgrade not performed file is corrupt

A remote firmware upgrade (RFU) was not performed.

This is a CRC error in the firmware image (bad image).

Recommended action

Follow these troubleshooting steps in the order presented.

- Download the firmware upgrade file, and then attempt the upgrade again.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)

99 . 00 . 02 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading the header number and size. It indicates a problem with the network environment, not the product.

Recommended action

Follow these troubleshooting steps in the order presented.

The most common cause is an issue with the network environment.

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



NOTE: If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which

signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99 . 00 . 03 Upgrade not performed error writing to disk

A remote firmware upgrade (RFU) was not performed.

This is a disk error. It might indicate a problem or a hard disk failure. It might be necessary to check the connection to the hard disk or replace the hard disk.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Download the RFU file, and then attempt the upgrade again.
2. If the error persists, run the **Clean Disk** process from the **Preboot** menu.

You will need to download the firmware from the **Preboot** menu.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, replace the eMMC.

Single function printer: eMMC 4GB part number: 3PZ15-67905

MFP Printer: eMMC 16GB Part number: B5L32-60002

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Download the RFU file, and then attempt the upgrade again.
2. If the error persists, run the **Clean Disk** process from the **Preboot** menu.

You will need to download the firmware from the **Preboot** menu.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, replace the eMMC.

Single function printer: eMMC 4GB part number: 3PZ15-67905

MFP Printer: eMMC 16GB Part number: B5L32-60002

Removal and replacement: eMMC See the Repair Service Manual for this product.

99 . 00 . 04 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading the header.

The most common cause is an issue with the network environment.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



NOTE: If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99 . 00 . 05 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading image data.

The most common cause is an issue with the network environment.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



NOTE: If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99 . 00 . 06 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

The issue is an unexpected read error when reading the header number and size.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Download the RFU file, and then attempt the upgrade again.

Go to [HP FutureSmart - Latest Firmware Versions](#).

2. If the error persists, replace the eMMC.

Single function printer: eMMC 4GB part number: 3PZ15-67905

MFP Printer: eMMC 16GB Part number: B5L32-60002

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Download the RFU file, and then attempt the upgrade again.

Go to [HP FutureSmart - Latest Firmware Versions](#).

2. If the error persists, replace the eMMC.

Single function printer: eMMC 4GB part number: 3PZ15-67905

MFP Printer: eMMC 16GB Part number: B5L32-60002

Removal and replacement: eMMC See the Repair Service Manual for this product.

99 . 00 . 07 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

The issue is an unexpected read error when reading the rest of the header.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Download the RFU file, and then attempt the upgrade again.

Go to [HP FutureSmart - Latest Firmware Versions](#).

2. If the error persists, replace the eMMC.

Single function printer: eMMC 4GB part number: 3PZ15-67905

MFP Printer: eMMC 16GB Part number: B5L32-60002

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Download the RFU file, and then attempt the upgrade again.

2. If the error persists, replace the hard disk drive.

Single function printer: eMMC 4GB part number: 3PZ15-67905

MFP Printer: eMMC 16GB Part number: B5L32-60002

Removal and replacement: eMMC See the Repair Service Manual for this product.

99 . 00 . 08 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

The issue is an unexpected read error when reading image data.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Download the RFU file, and then attempt the upgrade again.

Go to [HP FutureSmart - Latest Firmware Versions](#).

2. If the error persists, replace the eMMC.

Single function printer: eMMC 4GB part number: 3PZ15-67905

MFP Printer: eMMC 16GB Part number: B5L32-60002

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Download the RFU file, and then attempt the upgrade again.
2. If the error persists, replace the hard disk drive.

Single function printer: eMMC 4GB part number: 3PZ15-67905

MFP Printer: eMMC 16GB Part number: B5L32-60002

Removal and replacement: eMMC See the Repair Service Manual for this product.

99 . 00 . 10 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled when reading the header number and size.

Recommended action

Follow these troubleshooting steps in the order presented.

- Resend the remote firmware upgrade (RFU).

99 . 00 . 11 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled when reading the rest of the header, after reading the header number and size.

Recommended action

Follow these troubleshooting steps in the order presented.

- Resend the remote firmware upgrade (RFU).

99 . 00 . 12 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The header number is 1, but the header size does not match version 1 size.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the remote firmware upgrade (RFU) file again.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Resend the RFU.

99 . 00 . 13 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The header number is 2, but the header size does not match version 2 size.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the remote firmware upgrade (RFU) file again.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Resend the RFU.

99 . 00 . 14 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The file is invalid.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the remote firmware upgrade (RFU) file again.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Resend the RFU.

99 . 00 . 2x

There is a compatibility issue with the firmware.

The specific message varies depending on the cause, but the solution for each message is the same.

- 99 . 00 . 20 (event log)

The bundle is not for this product.

- 99 . 00 . 21 (event log)

The bundle is not signed with the correct signature, or the signature is invalid.

- 99 . 00 . 22 (event log)

The bundle header version is not supported by this firmware.

- 99 . 00 . 23 (event log)

The package header version is not supported by this firmware.

- 99 . 00 . 24 (event log)

The format of the bundle is invalid.

- 99 . 00 . 25 (event log)
The format of the package is invalid.
- 99 . 00 . 26 (event log)
A CRC32 check did not pass.
- 99 . 00 . 27 (event log)
An I/O error occurred while downloading the bundle.

Recommended action

Follow these troubleshooting steps in the order presented.

1. **99.00.27 only:** Turn the product off, and then on.
2. Download the correct firmware file, and then resend the firmware upgrade.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#) For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)
3. If the error persists, try installing the upgrade by another method (USB or Embedded Web Server).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)

99 . 01 . xx

A firmware install error has occurred.

The specific message varies depending on the cause, but the solution for each message is the same.

- 99 . 01 . 00
- 99 . 01 . 10
- 99 . 01 . 20
- 99 . 01 . 21

Recommended action

Follow these troubleshooting steps in the order presented.

- Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
Firmware update steps,

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)

99 . 02 . 01

Firmware installation was successful.

Recommended action

See recommended action.

- No action necessary.

99.02.09

Firmware upgrade cancelled by user.

Recommended action

See recommended action.

- No action necessary.

99.09.61 Unsupported disk

The hard disk drive installed is not support in this printer.

The hard disk drive (HDD) is not encrypted and the printer is configured for an encrypted HDD.

Recommended action

Follow these troubleshooting steps in the order presented.



NOTE: Do NOT replace the formatter board, it will not resolve this error.

- Access the [Preboot](#) menu, and then select [Lock Disk](#) to lock the disk.
 - a. Access the [Preboot](#) menu
 - b. Turn the product on.
 - c. Touch the HP logo that displays in the center of the touchscreen until the [Preboot](#) menu item opens.
 - d. Use the arrow buttons on the touchscreen to navigate the [Preboot](#) menu.
 - e. Touch the [OK](#) button to select a menu item.

99.09.62 Unknown disk

This error indicates that there is an encryption mismatch between the HDD and the formatter.

This typically happens because an HDD was swapped into a device from another device.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.



NOTE: Do NOT replace the formatter board, it will not resolve this error.

1. Use the [Preboot](#) menu to unlock the disk.
 - a. Access the [Preboot](#) menu

- b. Turn the product on.
 - c. Touch the HP logo that displays in the center of the touchscreen until the **Preboot** menu item opens.
 - d. Use the arrow buttons on the touchscreen to navigate the **Preboot** menu.
 - e. Touch the **OK** button to select a menu item.
 2. If a disk is to be reused in a different product, execute the **Erase and Unlock** procedure from the **Preboot** menu, and then reload the firmware.
 - From the **Preboot** menu, open the following menus:
 - **Administration** (select 3)
 - **Manage Disks** (select 6)
 - **Boot Device** (select 6)
 - **Erase / Unlock** (select 2)
 3. If the issue persists, replace the HDD/SSD as needed.



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-18 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41616-011
Solid state drive (SSD)	0950-5111
Federal Information Processing Standards Drive, FIPS	6HN31-67001
See NOTE above.	See NOTE above.

99 . 09 . 63 Incorrect disk

This error indicates that the expected encrypted HDD is not present.

This is expected behavior when installing a new HDD in a device where the previous HDD was encrypted.

Recommended action

Follow these troubleshooting steps in the order presented.

- Follow the procedure to load firmware on a new hard disk drive, and then lock the disk to this printer.

Do NOT replace the formatter board, it will not resolve this.

99 . 09 . 65 Disk data error

Disk data corruption has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.



NOTE: Do NOT replace the formatter board, it will not resolve this error.

- Use the [Format Disk](#) procedure from the [Preboot](#) menu, and then resend the remote firmware upgrade (RFU).

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

7 Alphabetical control panel messages

Use the following alphabetical message to see further information on the message.

Alphabetical messages

Canceling...<jobname>

The printer is canceling the current job <jobname>.

Recommended action

See recommended action.

- No action necessary.

Wrong cartridges in slot

The printer displays this message when 1 or more toner cartridges are installed in the wrong slot.

Recommended action

Follow these troubleshooting steps in the order presented.

- Reinstall the toner cartridges in the correct slots.

From front to back, the toner cartridges should be installed in this order:

- Black
- Cyan
- Magenta
- Yellow

Cartridge Memory Error

Unable to read cartridge data from the indicated cartridges.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the front door and remove the toner cartridge causing the error.
2. Reinstall the toner cartridge.
3. Close the front door. If the message reappears, turn the printer off, and then on.

4. Verify if the cartridge is a genuine HP toner cartridge. To check the authenticity of your cartridges, go to hp.com/go/anticounterfeit and enter the serial number from the security label.



NOTE: This printer uses cartridges that have security chips or electronic circuitry. Cartridges using a non-HP chip or modified or non-HP circuitry may not work, and those that work today may not work in the future.

Non-HP Chips and modified or non-HP electronic circuitry are not produced or validated by HP. HP cannot guarantee that these chips or circuitry will work in your printer now or in the future. If you are using a non-original HP cartridge, please check with your supplier to ensure your cartridge has an original HP security chip or unmodified HP electronic circuitry.

5. If the error persists, and it is a genuine HP toner cartridge, contact HP customer care by phone for assistance in resolving the issue at: www.hp.com/go/contactHP.
6. If it is an aftermarket (non-hp) or re-manufactured toner cartridge, return the defective toner cartridge to the vendor where purchased.



NOTE: Service or repairs that are required as a result of using unsupported supplies is not covered under HP warranty.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: Do Not replace the engine control unit (ECU) or formatter for this issue. If the error persists after following the steps below, obtain the information requested in step 7, and then escalate the case to ATS.

1. Ensure the printer is turned on, and then open the front door to remove the toner cartridge that is in the error state.



NOTE: Toner cartridges that display a "10.0x11" or "**Supply Memory Error**" will continue to have this error if used in different printers.

Dispose or recycle the defective toner cartridge as these toner cartridges cannot be used in any printer.

2. Reinstall the toner cartridge.
3. Close the front door. If the message reappears, turn the printer off, and then on.
4. Verify if the cartridge is a genuine HP toner cartridge. To check the authenticity of the cartridges, go to hp.com/go/anticounterfeit or visit hp.com/go/ok and enter the serial number from the security label.

If authenticity cannot be verified, it might be a refilled or re-manufactured HP cartridge. Tell the customer to return the toner cartridge to the retailer or vendor where it was purchased and read the following statement:



NOTE: "This printer is enabled with dynamic security. It is intended to be used only with cartridges with an original HP chip. Cartridges using a non-HP chip might not work, and those that work today may not work in the future."

"Refilled or remanufactured supplies that still use an Original HP chip will continue to be accepted by the printer. If you are using a refilled or remanufactured cartridge and wish to continue to do so,

then you should check with your toner cartridge supplier as to whether or not the cartridge has an Original HP chip."

 **NOTE:** Service or repairs that are required as a result of using unsupported supplies is not covered under HP warranty.

5. If it is a genuine HP toner cartridge, replace the toner cartridge(s) in the error state with a new cartridge, and then close the cartridge door. Use the provided list to order the correct part number for the designated country/region when replacing the cartridge.

 **NOTE:** Do not replace all the four toner cartridges. Make sure to replace only the affected toner cartridge.

Table 7-1 Toner cartridge part details

Part Number	Description	Region
W2020A	HP 414A Black LaserJet Toner Cartridge	ROW
W2021A	HP 414A Cyan LaserJet Toner Cartridge	ROW
W2022A	HP 414A Yellow LaserJet Toner Cartridge	ROW
W2023A	HP 414A Magenta LaserJet Toner Cartridge	ROW
W2020X	HP 414X Black LaserJet Toner Cartridge	ROW
W2021X	HP 414X Cyan LaserJet Toner Cartridge	ROW
W2022X	HP 414X Yellow LaserJet Toner Cartridge	ROW
W2023X	HP 414X Magenta LaserJet Toner Cartridge	ROW
W2030A	HP 415A Black LaserJet Toner Cartridge	EMEA
W2031A	HP 415A Cyan LaserJet Toner Cartridge	EMEA
W2032A	HP 415A Yellow LaserJet Toner Cartridge	EMEA
W2033A	HP 415A Magenta LaserJet Toner Cartridge	EMEA
W2030X	HP 415X Black LaserJet Toner Cartridge	EMEA
W2031X	HP 415X Cyan LaserJet Toner Cartridge	EMEA
W2032X	HP 415X Yellow LaserJet Toner Cartridge	EMEA
W2033X	HP 415X Magenta LaserJet Toner Cartridge	EMEA
W2040A	HP 416A Black LaserJet Toner Cartridge	APJ

Table 7-1 Toner cartridge part details (continued)

Part Number	Description	Region
W2041A	HP 416A Cyan LaserJet Toner Cartridge	APJ
W2042A	HP 416A Yellow LaserJet Toner Cartridge	APJ
W2043A	HP 416A Magenta LaserJet Toner Cartridge	APJ
W2040X	HP 416X Black LaserJet Toner Cartridge	APJ
W2041X	HP 416X Cyan LaserJet Toner Cartridge	APJ
W2042X	HP 416X Yellow LaserJet Toner Cartridge	APJ
W2043X	HP 416X Magenta LaserJet Toner Cartridge	APJ

6. Download the following firmware version for your printer model from [HP Support](#): 002.2118A
7. Wait for the firmware update to complete, and then print a Configuration Page.
8. On the Configuration Page, make sure that the firmware version installed is **002.2118A**.
9. Attempt to print and check if the issue persists.
10. If the issue persists, collect the following information and note it in a CDAX case:
 - a. Type "Supply memory error:10.0x.11" in the case subject.
 - b. Enter the error code and message displayed on the printer control panel.
 - c. Obtain pictures of the cartridge and with the electrical contact. Attach the pictures in the CDAX case.
 - d. Check for defect on the electrical contact of the toner and printer.
 - e. Check whether the toner used is an HP genuine toner.
 - f. Ask the customer to provide answers to the following questions:
 - i. When did the issue begin/start, OOB? While printing or when idle?
 - ii. Was there any preceding error or defect prior to this issue?
 - iii. Were there any parts replaced or software updates prior to this error?
 - iv. Was the cartridge used in multiple printers?
 - v. Did this issue happen on set-up cartridge or after market cartridge (trade)?
11. Ensure the information in the CDAX case is valid, and then elevate the case to elevate the case using your Standard Support Process.

Cartridge Memory Missing

Unable to read cartridge data from the indicated cartridges.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the front door and remove the toner cartridge causing the error.
2. Reinstall the toner cartridge.
3. Close the front door. If the message reappears, turn the printer off, and then on.
4. Verify if the cartridge is a genuine HP toner cartridge. To check the authenticity of your cartridges, go to hp.com/go/anticounterfeit and enter the serial number from the security label.



NOTE: This printer uses cartridges that have security chips or electronic circuitry. Cartridges using a non-HP chip or modified or non-HP circuitry may not work, and those that work today may not work in the future.

Non-HP Chips and modified or non-HP electronic circuitry are not produced or validated by HP. HP cannot guarantee that these chips or circuitry will work in your printer now or in the future. If you are using a non-original HP cartridge, please check with your supplier to ensure your cartridge has an original HP security chip or unmodified HP electronic circuitry.

5. If the error persists, and it is a genuine HP toner cartridge, contact HP customer care by phone for assistance in resolving the issue at: www.hp.com/go/contactHP.
6. If it is an aftermarket (non-hp) or re-manufactured toner cartridge, return the defective toner cartridge to the vendor where purchased.



NOTE: Service or repairs that are required as a result of using unsupported supplies is not covered under HP warranty.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: Do Not replace the engine control unit (ECU) or formatter for this issue. If the error persists after following the steps below, obtain the information requested in step 7, and then escalate the case to ATS.

1. Ensure the printer is turned on, and then open the front door to remove the toner cartridge that is in the error state.



NOTE: Toner cartridges that display a "10.0x11" or "**Supply Memory Error**" will continue to have this error if used in different printers.

Dispose or recycle the defective toner cartridge as these toner cartridges cannot be used in any printer.

2. Reinstall the toner cartridge.
3. Close the front door. If the message reappears, turn the printer off, and then on.

4. Verify if the cartridge is a genuine HP toner cartridge. To check the authenticity of the cartridges, go to hp.com/go/antcounterfeit or visit hp.com/go/ok and enter the serial number from the security label.

If authenticity cannot be verified, it might be a refilled or re-manufactured HP cartridge. Tell the customer to return the toner cartridge to the retailer or vendor where it was purchased and read the following statement:



NOTE: "This printer is enabled with dynamic security. It is intended to be used only with cartridges with an original HP chip. Cartridges using a non-HP chip might not work, and those that work today may not work in the future."

"Refilled or remanufactured supplies that still use an Original HP chip will continue to be accepted by the printer. If you are using a refilled or remanufactured cartridge and wish to continue to do so, then you should check with your toner cartridge supplier as to whether or not the cartridge has an Original HP chip."



NOTE: Service or repairs that are required as a result of using unsupported supplies is not covered under HP warranty.

5. If it is a genuine HP toner cartridge, replace the toner cartridge(s) in the error state with a new cartridge, and then close the cartridge door. Use the provided list to order the correct part number for the designated country/region when replacing the cartridge.



NOTE: Do not replace all the four toner cartridges. Make sure to replace only the affected toner cartridge.

Table 7-2 Toner cartridge part details

Part Number	Description	Region
W2020A	HP 414A Black LaserJet Toner Cartridge	ROW
W2021A	HP 414A Cyan LaserJet Toner Cartridge	ROW
W2022A	HP 414A Yellow LaserJet Toner Cartridge	ROW
W2023A	HP 414A Magenta LaserJet Toner Cartridge	ROW
W2020X	HP 414X Black LaserJet Toner Cartridge	ROW
W2021X	HP 414X Cyan LaserJet Toner Cartridge	ROW
W2022X	HP 414X Yellow LaserJet Toner Cartridge	ROW
W2023X	HP 414X Magenta LaserJet Toner Cartridge	ROW
W2030A	HP 415A Black LaserJet Toner Cartridge	EMEA
W2031A	HP 415A Cyan LaserJet Toner Cartridge	EMEA
W2032A	HP 415A Yellow LaserJet Toner Cartridge	EMEA

Table 7-2 Toner cartridge part details (continued)

Part Number	Description	Region
W2033A	HP 415A Magenta LaserJet Toner Cartridge	EMEA
W2030X	HP 415X Black LaserJet Toner Cartridge	EMEA
W2031X	HP 415X Cyan LaserJet Toner Cartridge	EMEA
W2032X	HP 415X Yellow LaserJet Toner Cartridge	EMEA
W2033X	HP 415X Magenta LaserJet Toner Cartridge	EMEA
W2040A	HP 416A Black LaserJet Toner Cartridge	APJ
W2041A	HP 416A Cyan LaserJet Toner Cartridge	APJ
W2042A	HP 416A Yellow LaserJet Toner Cartridge	APJ
W2043A	HP 416A Magenta LaserJet Toner Cartridge	APJ
W2040X	HP 416X Black LaserJet Toner Cartridge	APJ
W2041X	HP 416X Cyan LaserJet Toner Cartridge	APJ
W2042X	HP 416X Yellow LaserJet Toner Cartridge	APJ
W2043X	HP 416X Magenta LaserJet Toner Cartridge	APJ

6. Download the following firmware version for your printer model from [HP Support](#): 002.2118A
7. Wait for the firmware update to complete, and then print a Configuration Page.
8. On the Configuration Page, make sure that the firmware version installed is **002.2118A**.
9. Attempt to print and check if the issue persists.
10. If the issue persists, collect the following information and note it in a CDAX case:
 - a. Type " Supply memory error:10.0x.11" in the case subject.
 - b. Enter the error code and message displayed on the printer control panel.
 - c. Obtain pictures of the cartridge and with the electrical contact. Attach the pictures in the CDAX case.
 - d. Check for defect on the electrical contact of the toner and printer.
 - e. Check whether the toner used is an HP genuine toner.
 - f. Ask the customer to provide answers to the following questions:
 - i. When did the issue begin/start, OOB? While printing or when idle?

- ii. Was there any preceding error or defect prior to this issue?
 - iii. Were there any parts replaced or software updates prior to this error?
 - iv. Was the cartridge used in multiple printers?
 - v. Did this issue happen on set-up cartridge or after market cartridge (trade)?
11. Ensure the information in the CDAX case is valid, and then elevate the case to elevate the case using your Standard Support Process.

Checking engine

The printer is conducting an internal test.

Recommended action

See recommended action.

- No action necessary.

Checking paper path

The printer is checking for possible paper jams.

Recommended action

See recommended action.

- No action necessary.

Cleaning

The printer is performing an automatic cleaning cycle. Printing will continue after the cleaning is complete.

Recommended action

See recommended action.

- No action necessary.

Close the cartridge access door

The front cartridge access door is open.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Close the front cartridge access door.
2. If the error persists with the door closed, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Close the front cartridge access door.
2. Check the flat projection part on the top left on the inside of the door. If it is damaged, replace the front door assembly.

Figure 7-1 Check front door flag



Front (cartridge) door assembly (SFP) part number: RM2-1823-000CN

Front (cartridge) door assembly (MFP) part number: RM2-1824-000CN

3. If the problem persists, replace the front door switch SW7.
Door open switch (SW7, SW501) part number: RK2-0534-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Close the front cartridge access door.
2. Check the flat projection part on the top left on the inside of the door. If it is damaged, replace the front door assembly.

Figure 7-2 Check front door flag



Front (cartridge) door assembly (SFP) part number: RM2-1823-000CN

Front (cartridge) door assembly (MFP) part number: RM2-1824-000CN

For instructions: *Removal and replacement: Front door assembly* See the Service Manual for this printer.

3. Check the connection for switch SW7 Front door switch (micro-switch) on the DC controller PCA J211.
4. If the problem persists, replace the front door switch SW7.

Door open switch (SW7, SW501) part number: RK2-0534-000CN

For instructions: [Removal and replacement: Front door switch](#) See the Service Manual for this printer.

<Color> cartridge low

The indicated toner cartridge is nearing the end of its useful life.

<Color> =

Black

Cyan

Magenta

Yellow

Recommended action

Follow these troubleshooting steps in the order presented.

- Printing can continue, but consider having a replacement supply on hand.

<Color> cartridge very low

The indicated toner cartridge is very low.

The indicated toner cartridge is at the end of its useful life. A customer configurable option on this product is "Low threshold" this can be set to the percentage for the very low message. This option is provided as a customer convenience and is not an indication these pages will have acceptable print quality.

<Color> =

Black

Cyan

Magenta

Yellow

Recommended action

Follow these troubleshooting steps in the order presented.

- To ensure optimal print quality, HP recommends replacing the toner cartridge at this point. You can continue printing until you notice a decrease in print quality. Actual cartridge life might vary.



NOTE: Once an HP supply has reached Very Low, HP's Premium Protection Warranty on that supply has ended. All print defects or cartridge failures incurred when an HP supply is used in Continue at very low mode will not be considered to be defects in materials or workmanship in the supply under the HP Print Cartridge Warranty Statement.

Cooling device

The printer is cooling.

Recommended action

See recommended action.

- No action necessary.

Data received To print last page press "OK"

The printer is waiting for the command to print the last page.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the "OK" button on the control panel to print the last page of the job.

Device error. Press [OK] to continue

Paper has been delayed as it moves through the product.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Press the OK button to clear the message.
2. To avoid this problem, try the following solutions:
 - Adjust the paper guides in the tray. Ensure the front paper guide is pushing the paper against the back edge of the tray.
 - Use paper that meets HP specifications. Store paper unopened in its original packaging.
 - Use the product in an area that meets the environmental specifications for this product.

Device is busy. Tray again later

The product is currently in use.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Wait for the product to finish the current job, or to finish initializing.

2. Turn the product off, then on, to see whether it comes to a [Ready](#) state.
3. Restore the device to the factory default settings. ([Setup Menu](#) -> [Service Menu](#) -> [Restore Defaults](#))
4. If the issue persists, upgrade to the latest firmware.

Document feeder jam. Clear and reload

Paper is jammed in the document feeder tray or a sensor has incorrectly detected media in the document feeder paper path.

31.13 jam error in the document feeder

Use the following procedure to check for paper in all possible jam locations related to the document feeder.

Recommended action for customers

When a jam occurs, the control panel displays a message and an animation that assists in clearing the jam.


- 31.13.01 Jam in document feeder
- 31.13.02 Jam in document feeder
- 31.13.13 Jam in document feeder

In addition to the instructions provided below




NOTE: The printer model referenced in this video might be different from your printer model, but the steps to clear the jam are the same.


1. Open the document feeder cover.

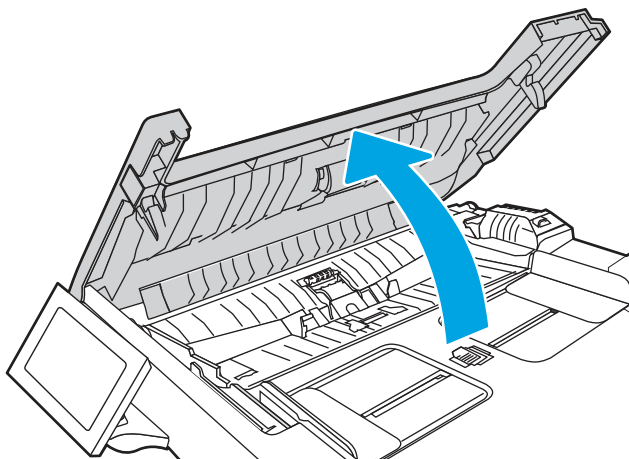


2. Remove any jammed paper.

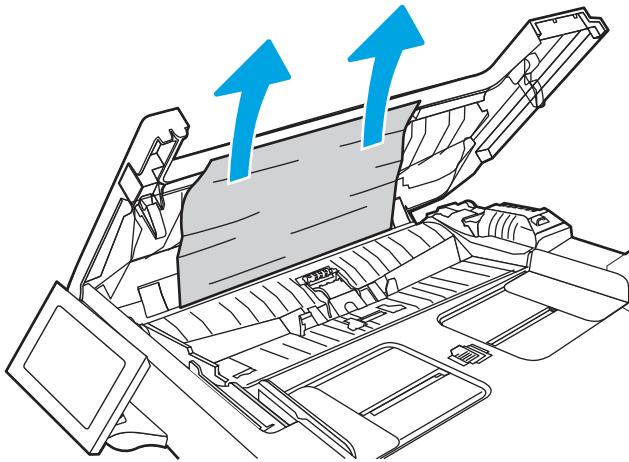


3. Close the document feeder cover.

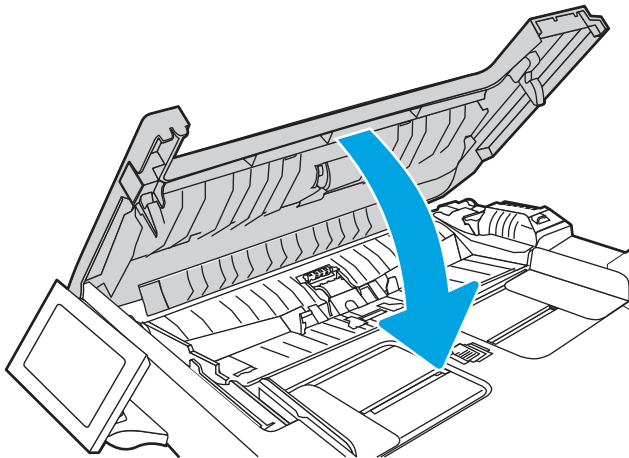


4. Lift the document feeder input tray to provide better access to the document feeder output bin, and then remove any jammed paper from the output area.

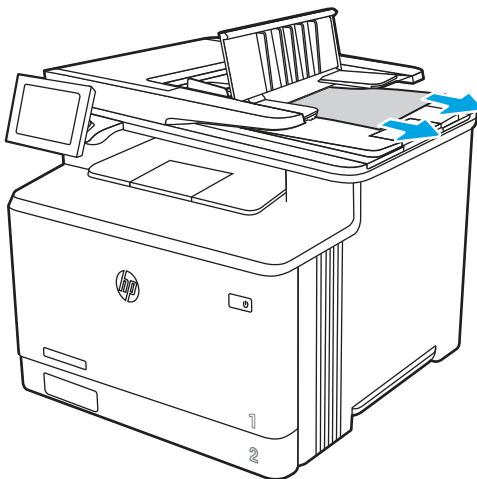

5. Open the scanner lid. If paper is jammed behind the white plastic backing, gently pull it out.

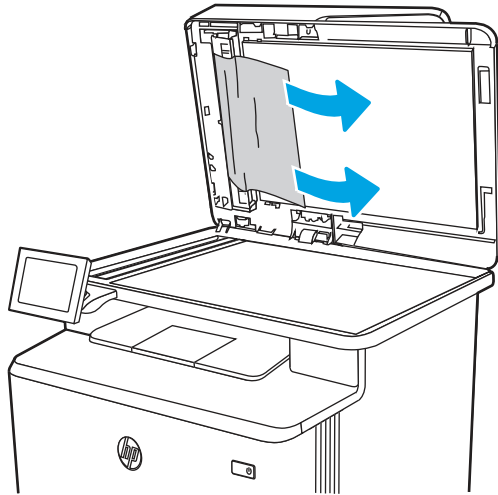


6. Lower the scanner lid.

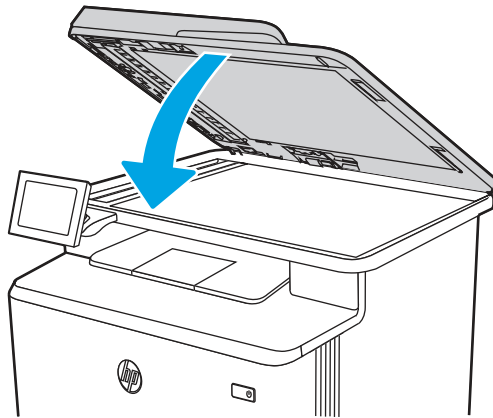

7. If the error persists, ensure that the paper meets the document feeder (ADF) specifications for the printer.
8. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is

loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 7-3 Set the ADF guides

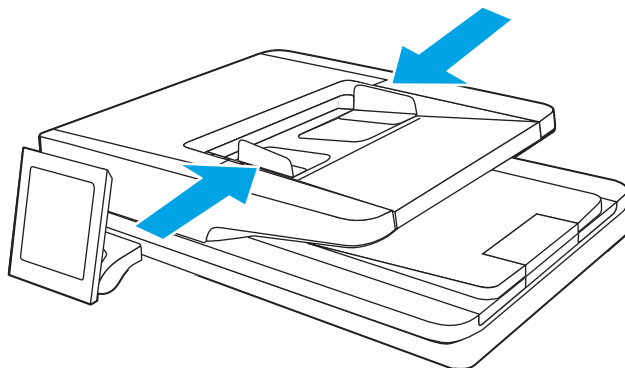

 **NOTE:** To avoid jams, make sure the guides in the document feeder input tray are adjusted correctly. Remove all staples, paper clips, or tape from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

9. Open the document feeder and check and clean the Document Feeder Kit rollers and separation pad by removing any visible lint or dust from each of the feed rollers and the separation pad using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

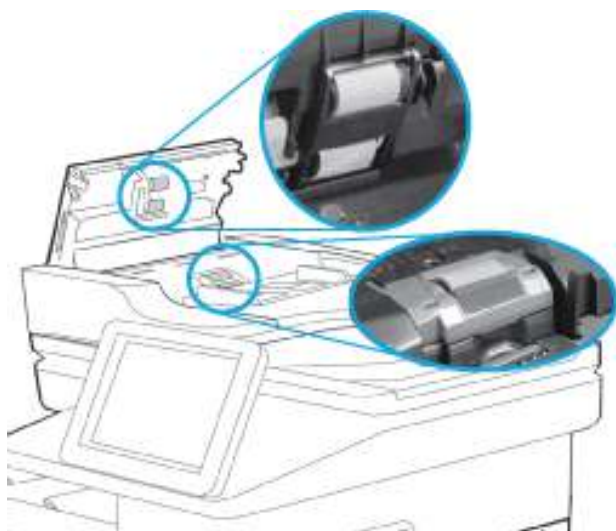

 **NOTE:** Lift up the roller assembly to access and clean the second roller

10. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

 **NOTE:** To avoid jams, make sure the guides in the document feeder input tray are adjusted tightly against the document. Remove all staples and paper clips from original documents.


 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

Recommended action for call-center agents


Follow these troubleshooting steps in the order presented.

 **IMPORTANT:** **DO NOT** replace any parts before reviewing the firmware version. (See step 7)


1. Open the document feeder cover.

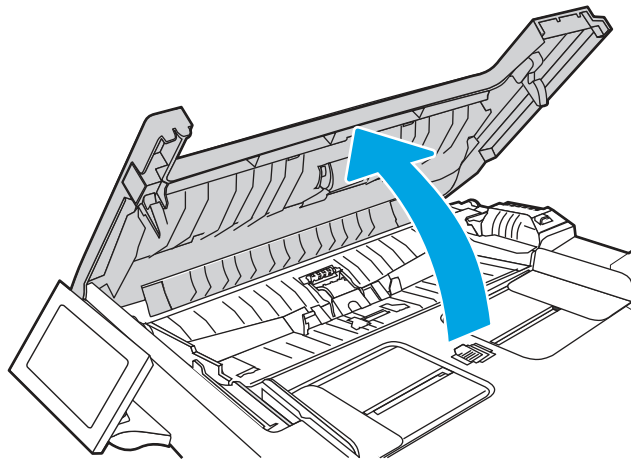


2. Remove any jammed paper.

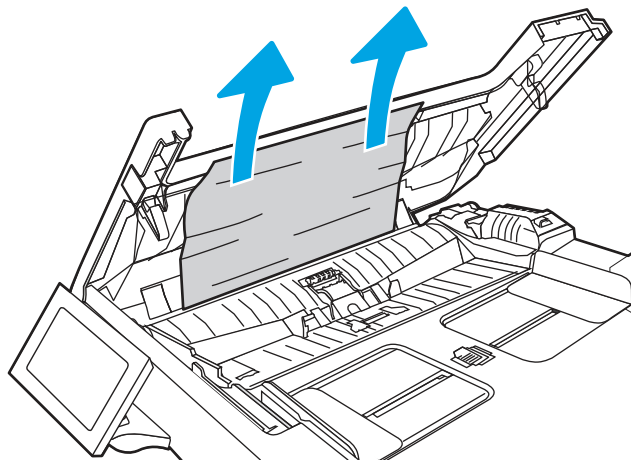


3. Close the document feeder cover.

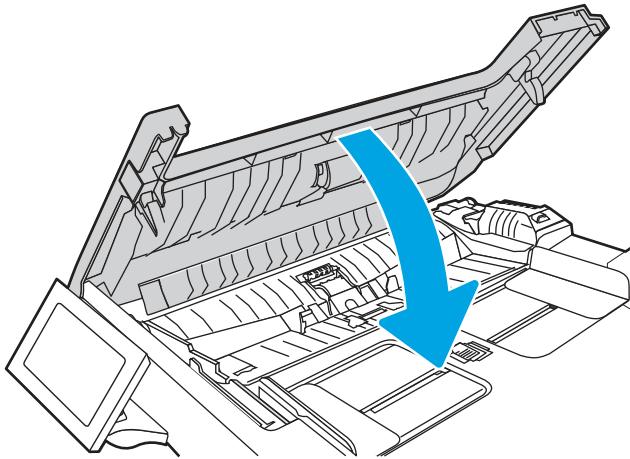


4. Lift the document feeder input tray to provide better access to the document feeder output bin, and then remove any jammed paper from the output area.

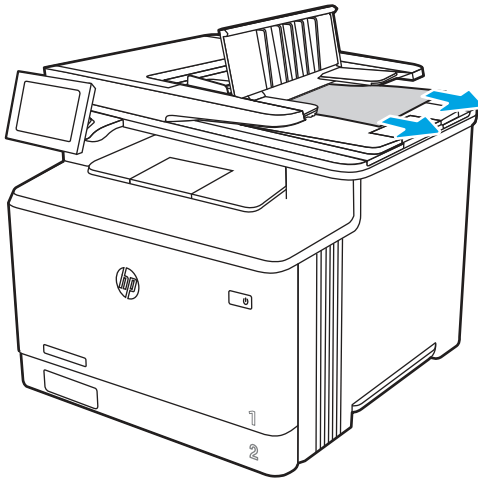

5. Open the scanner lid. If paper is jammed behind the white plastic backing, gently pull it out.

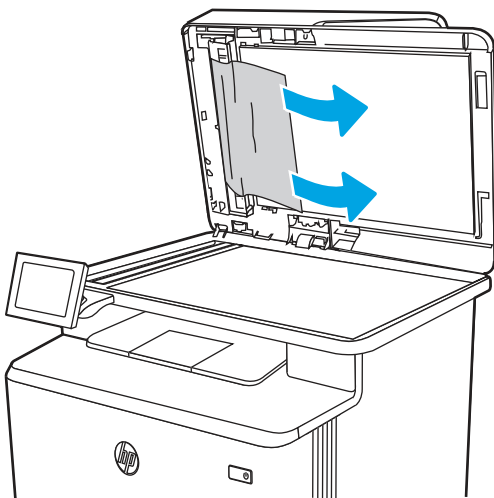

6. Lower the scanner lid.

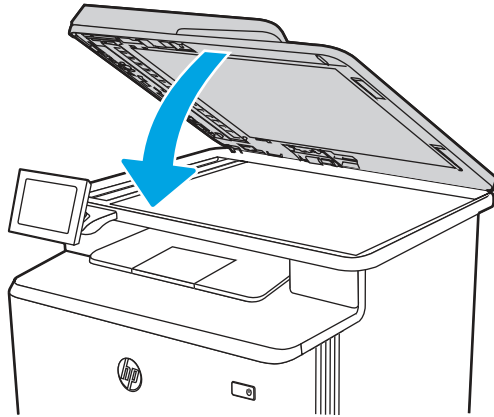


7. If no actual paper jam is found, check the firmware version. If not FW is not 5.8 or greater, upgrade the firmware.

 **NOTE:** On some units, when making copies or scanning documents using the Automatic Document Feeder, a jam error occurs with the event code of 31.13.02. This is the result of a spring in the ADF moving up and down too fast (bouncing) and is reported to firmware as a jam in the ADF, even when there is no actual jam.

Firmware version 5.8 helps resolve this issue.

8. If there error persists, ensure that the paper meets the document feeder (ADF) specifications for the printer.
9. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.

Figure 7-4 Set the ADF guides

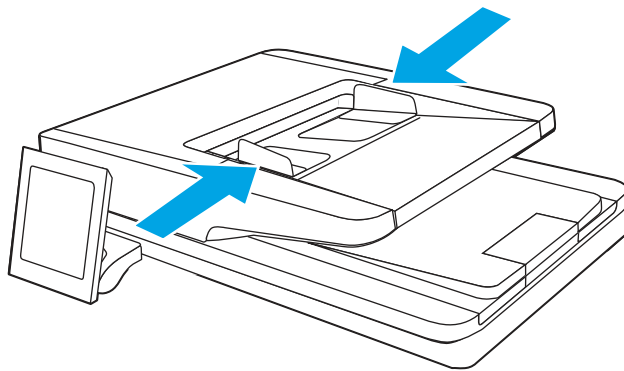

 **NOTE:** To avoid jams, make sure the guides in the document feeder input tray are adjusted correctly. Remove all staples, paper clips, or tape from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

10. Check and clean the Document Feeder Kit rollers and separation pad by removing any visible lint or dust from each of the feed rollers and the separation pad using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.



 **NOTE:** Lift up the roller assembly to access and clean the second roller

11. If the issue persists, Replace the document feeder top cover assembly.

Document feeder top cover assembly part number: W1A77-67903

 **NOTE:** This part contains the rollers.

12. If the issue persists, integrated scanner assembly (ISA).

Integrated scanner assembly part number: 3PZ55-60117

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

 **IMPORTANT:** **DO NOT** replace any parts before reviewing the firmware version. (See step 2)


1. Open the document feeder lid, pull the sheets back into the input tray, and then resume the job.
2. If no actual paper jam is found, check the firmware version. If not FW is not 5.8 or greater, upgrade the firmware.

 **NOTE:** On some units, when making copies or scanning documents using the Automatic Document Feeder, a jam error occurs with the event code of 3113.02. This is the result of a spring in the ADF moving up and down too fast (bouncing) and is reported to firmware as a jam in the ADF, even when there is no actual jam.

Firmware version 5.8 helps resolve this issue.

3. Check the paper guides and make sure that they are set to the correct paper width.

Figure 7-5 Set the ADF guides

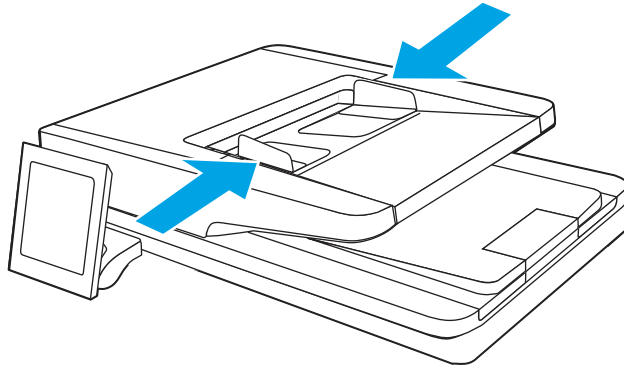

4. Make sure that the input tray is not overloaded and the tray guides are correctly aligned to both edges of the paper.
5. Verify that the paper meets the printer specifications.
6. Check and clean the Document Feeder Kit rollers and separation pad by removing any visible lint or dust from each of the feed rollers and the separation pad using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.



 **NOTE:** Lift up the roller assembly to access and clean the second roller

7. If the issue persists, Replace the document feeder top cover assembly.

Document feeder top cover assembly part number: W1A77-67903

 **NOTE:** This part contains the rollers.

8. If the issue persists, replace the integrated scanning assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

Document feeder miss-pick. reload

Document feeder did not pick the paper from the tray correctly.

31.13 jam error in the document feeder

Use the following procedure to check for paper in all possible jam locations related to the document feeder.

Recommended action for customers

When a jam occurs, the control panel displays a message and an animation that assists in clearing the jam.


- 31.13.01 Jam in document feeder
- 31.13.02 Jam in document feeder
- 31.13.13 Jam in document feeder

In addition to the instructions provided below




NOTE: The printer model referenced in this video might be different from your printer model, but the steps to clear the jam are the same.


1. Open the document feeder cover.

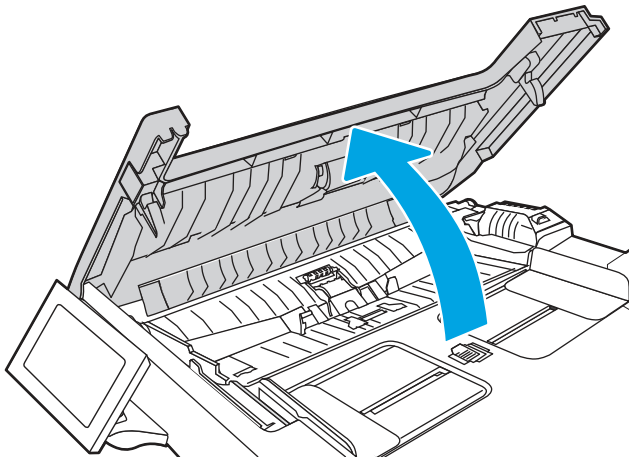


2. Remove any jammed paper.

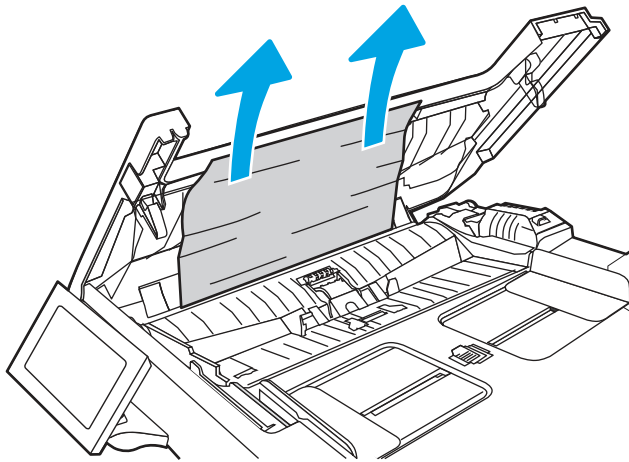


3. Close the document feeder cover.

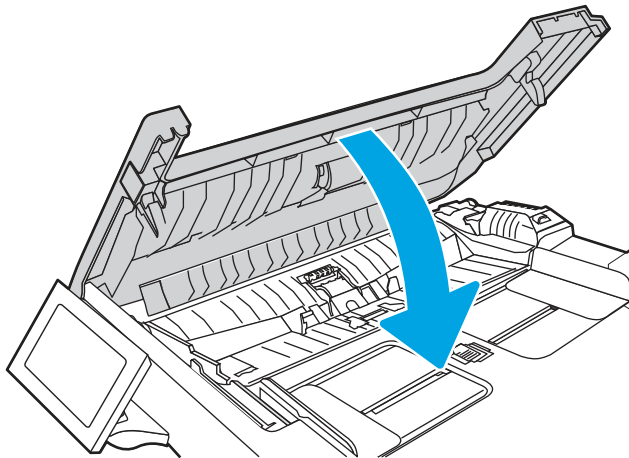


4. Lift the document feeder input tray to provide better access to the document feeder output bin, and then remove any jammed paper from the output area.

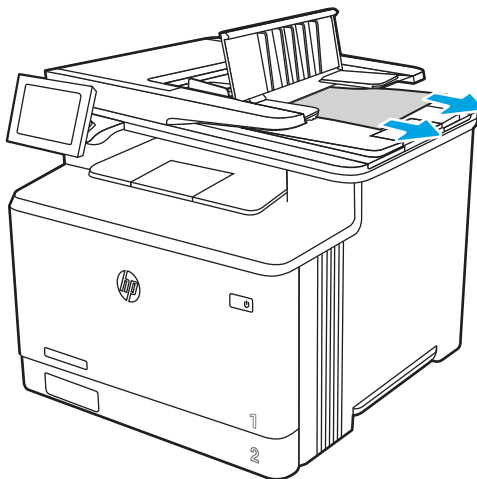

5. Open the scanner lid. If paper is jammed behind the white plastic backing, gently pull it out.

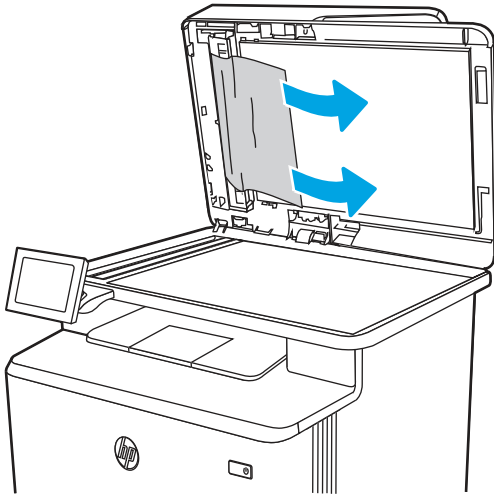


6. Lower the scanner lid.

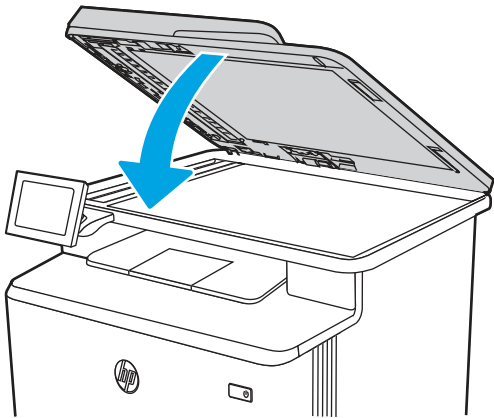

7. If the error persists, ensure that the paper meets the document feeder (ADF) specifications for the printer.
8. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is

loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.

Figure 7-6 Set the ADF guides

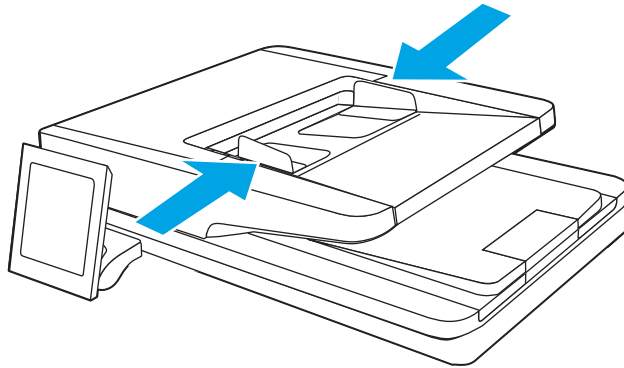

 **NOTE:** To avoid jams, make sure the guides in the document feeder input tray are adjusted correctly. Remove all staples, paper clips, or tape from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

9. Open the document feeder and check and clean the Document Feeder Kit rollers and separation pad by removing any visible lint or dust from each of the feed rollers and the separation pad using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.



 **NOTE:** Lift up the roller assembly to access and clean the second roller

10. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

 **NOTE:** To avoid jams, make sure the guides in the document feeder input tray are adjusted tightly against the document. Remove all staples and paper clips from original documents.


 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

Recommended action for call-center agents


Follow these troubleshooting steps in the order presented.

 **IMPORTANT:** **DO NOT** replace any parts before reviewing the firmware version. (See step 7)


1. Open the document feeder cover.

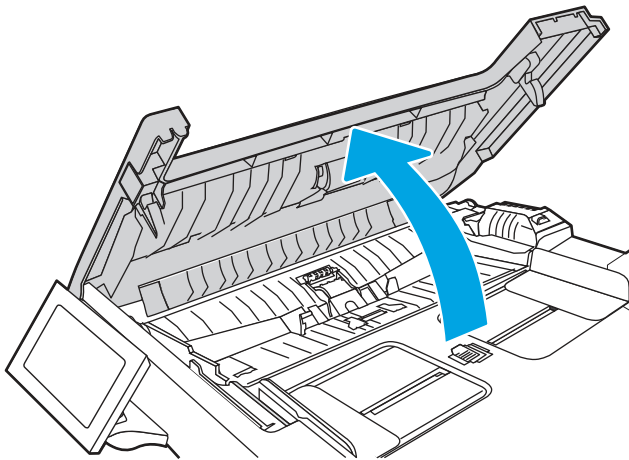


2. Remove any jammed paper.

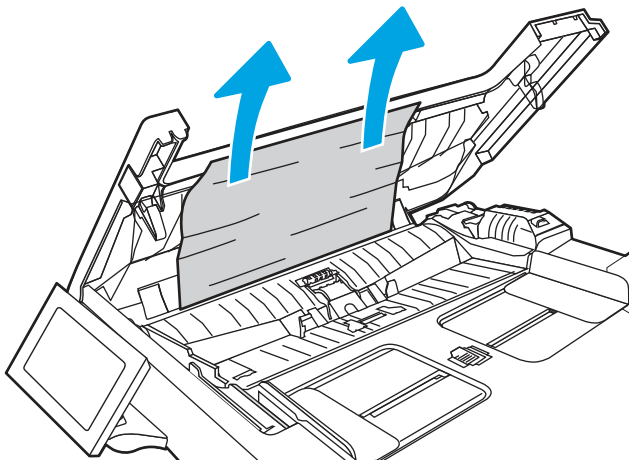


3. Close the document feeder cover.

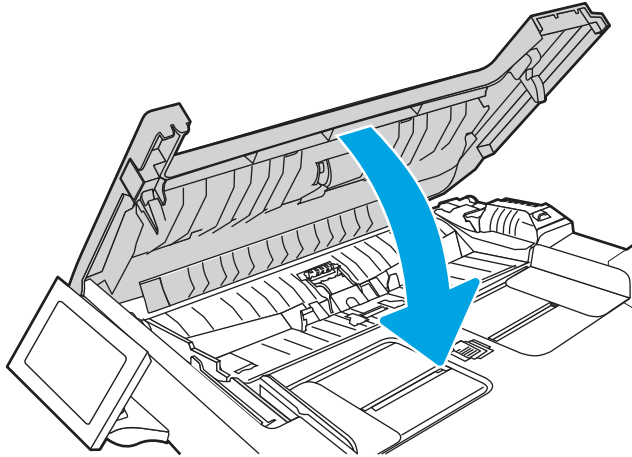


4. Lift the document feeder input tray to provide better access to the document feeder output bin, and then remove any jammed paper from the output area.

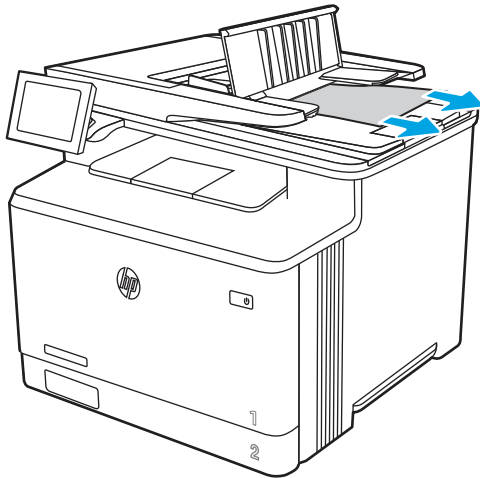

5. Open the scanner lid. If paper is jammed behind the white plastic backing, gently pull it out.

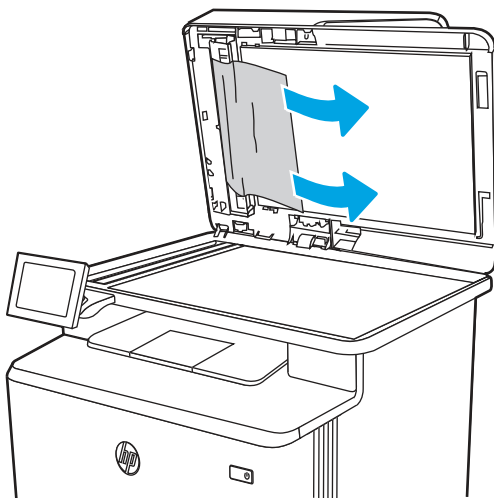

6. Lower the scanner lid.

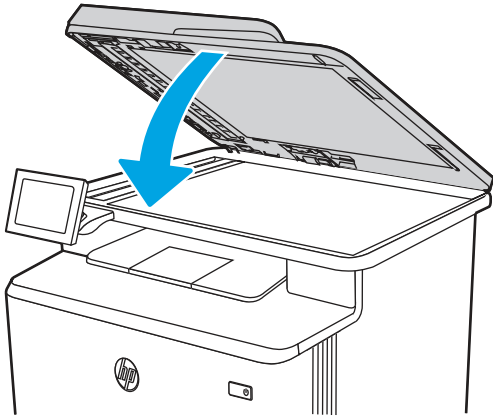

7. If no actual paper jam is found, check the firmware version. If not FW is not 5.8 or greater, upgrade the firmware.




NOTE: On some units, when making copies or scanning documents using the Automatic Document Feeder, a jam error occurs with the event code of 31.13.02. This is the result of a spring in the ADF moving up and down too fast (bouncing) and is reported to firmware as a jam in the ADF, even when there is no actual jam.

Firmware version 5.8 helps resolve this issue.

8. If there error persists, ensure that the paper meets the document feeder (ADF) specifications for the printer.
9. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.

Figure 7-7 Set the ADF guides

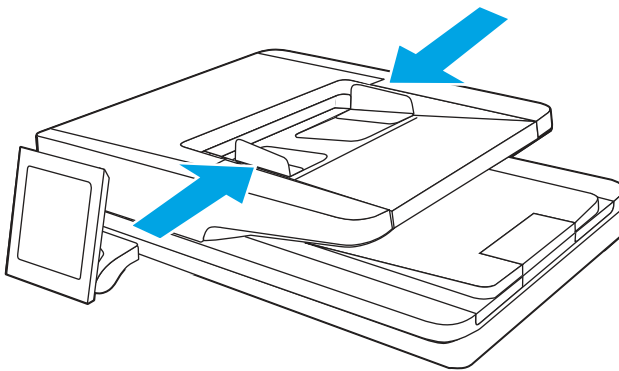

NOTE: To avoid jams, make sure the guides in the document feeder input tray are adjusted correctly. Remove all staples, paper clips, or tape from original documents.



NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

10. Check and clean the Document Feeder Kit rollers and separation pad by removing any visible lint or dust from each of the feed rollers and the separation pad using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.



 **NOTE:** Lift up the roller assembly to access and clean the second roller

11. If the issue persists, Replace the document feeder top cover assembly.

Document feeder top cover assembly part number: W1A77-67903

 **NOTE:** This part contains the rollers.

12. If the issue persists, integrated scanner assembly (ISA).

Integrated scanner assembly part number: 3PZ55-60117

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

 **IMPORTANT:** **DO NOT** replace any parts before reviewing the firmware version. (See step 2)


1. Open the document feeder lid, pull the sheets back into the input tray, and then resume the job.
2. If no actual paper jam is found, check the firmware version. If not FW is not 5.8 or greater, upgrade the firmware.

 **NOTE:** On some units, when making copies or scanning documents using the Automatic Document Feeder, a jam error occurs with the event code of 31.13.02. This is the result of a spring in the ADF moving up and down too fast (bouncing) and is reported to firmware as a jam in the ADF, even when there is no actual jam.

Firmware version 5.8 helps resolve this issue.

3. Check the paper guides and make sure that they are set to the correct paper width.

Figure 7-8 Set the ADF guides

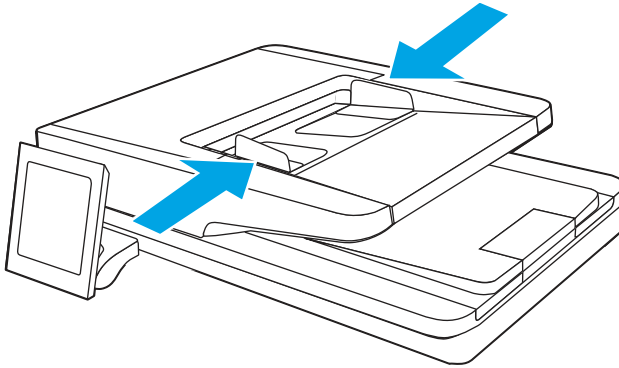

4. Make sure that the input tray is not overloaded and the tray guides are correctly aligned to both edges of the paper.
5. Verify that the paper meets the printer specifications.
6. Check and clean the Document Feeder Kit rollers and separation pad by removing any visible lint or dust from each of the feed rollers and the separation pad using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.



 **NOTE:** Lift up the roller assembly to access and clean the second roller

7. If the issue persists, Replace the document feeder top cover assembly.

Document feeder top cover assembly part number: W1A77-67903

 **NOTE:** This part contains the rollers.

8. If the issue persists, replace the integrated scanning assembly.

Integrated scanner assembly part number: 3PZ55-60117

For instructions: *Removal and replacement: Integrated scanner assembly* See the Repair Service Manual for this product.

Fax is busy. Canceled send

The fax line to which you were sending a fax was busy. The product has canceled sending the fax.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Call the recipient to ensure that the fax machine is on and ready.
2. Verify that the fax number is correct.
3. Verify that the [Redial if Busy](#) option is enabled.
4. Open the [Support](#) menu, and then touch the [Fax Diagnostics](#) menu. Touch the [Run Fax Test](#) button.



NOTE: This test verifies that the phone cord is connected to the correct port and that the phone line has a signal. The product prints a report with the results.

5. For additional fax sending/receiving troubleshooting go to this document.

[HP LaserJet Pro MFP - Solve problems sending or receiving faxes \(includes fax error messages and event log codes\)](#)

Fax line surge

The product experienced current on the fax line over 125 mA for more than 15 seconds.

Recommended action

Follow these troubleshooting steps in the order presented.

- Increase the default surge value of 125 mA to 145 mA:
 - a. Open the [Service](#) menu.
 - b. Select [System Configuration](#) menu.
 - c. Key in the number 141 and press [OK](#).
 - d. Change the default value of 178 to 186 and press [OK](#).
 - e. Turn the printer off, and then on to make the change effective.

Fax receive error

An error occurred while trying to receive a fax.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Ask the sender to resend the fax.

2. To verify that the telephone cord is securely connected, disconnect and reconnect the telephone cord.
3. Verify that you are using the telephone cord that came with the product.
4. Open the [Support](#) menu, and then touch the [Fax Diagnostics](#) menu. Touch the [Run Fax Test](#) button.



NOTE: This test verifies that the phone cord is connected to the correct port and that the phone line has a signal. The product prints a report with the results.

5. Decrease the fax speed. Ask the sender to resend the fax.
6. Turn off error-correction mode. Ask the sender to resend the fax.



NOTE: Turning off error-correction mode might reduce the quality of the fax image.

7. Connect the product to a different phone line.
8. For additional fax sending/receiving troubleshooting go to this document.

[HP LaserJet Pro MFP - Solve problems sending or receiving faxes \(includes fax error messages and event log codes\)](#)

Fax send error

An error occurred while trying to send a fax.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Resend the fax.
2. Try faxing to another fax number.
3. To verify that the telephone cord is securely connected, disconnect and reconnect the telephone cord. Check that the telephone cord is securely connected by unplugging and replugging the cord.
4. Verify that you are using the telephone cord that came with the product.
5. Open the [Support](#) menu, and then touch the [Fax Diagnostics](#) menu. Touch the [Run Fax Test](#) button.



NOTE: This test verifies that the phone cord is connected to the correct port and that the phone line has a signal. The product prints a report with the results.

6. Connect the product to a different phone line.
7. Set the fax resolution to [Standard](#) instead of the default of [Fine](#).
8. For additional fax sending/receiving troubleshooting go to this document.

[HP LaserJet Pro MFP - Solve problems sending or receiving faxes \(includes fax error messages and event log codes\)](#)

Fax storage is full. Canceling the fax send/receive.

The amount of available memory for storing faxes is insufficient to store an incoming fax.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If you are using the [Private Receive](#) feature, print all received faxes to regain some memory.
2. If the issue persists, clear faxes from memory:

Genuine HP cartridge installed

A new genuine HP toner cartridge has been installed. The message appears for about 6 seconds before the printer returns to the READY state.

Recommended action

See recommended action.

- No action necessary.

Genuine HP supply installed

A new genuine HP supply has been installed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the [Hide](#) button to remove this message.

Incompatible supplies

Print cartridges or other supply items are installed that were not designed for this printer. The printer cannot print with these supplies installed.

Event codes are supply specific.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the [OK](#) button to identify the incompatible supplies.

Replace the supplies with those that are designed for this printer.

Incompatible <Supply>

The indicated supply is not compatible with this printer.

- **10.00.35:** (event code) Black toner cartridge
- **10.23.35:** (event code) Fuser kit

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the supply with one that is designed for this printer.

Initializing...

The printer is starting.

Recommended action

See recommended action.

- No action necessary.

Insert or close Tray <X> to continue.

A paper tray is open causing a blocked paper path.

Recommended action

Follow these troubleshooting steps in the order presented.

- Insert or close Tray <X> to continue.

Install <color> cartridge

The indicated toner cartridge is missing or not seated correctly.

<Color> =

Black

Cyan

Magenta

Yellow

Recommended action

Follow these troubleshooting steps in the order presented.

1. If the toner cartridge is missing, install a new toner cartridge.
2. If the toner cartridge is installed, remove and reinstall the toner cartridge.

Jam in output bin. Open rear door and clear jam.

A paper jam occurred in the output bin area of the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Follow the instructions on the control panel to clear the jammed paper.

2. Open the rear door and look for and clear any paper present or obstructions in the paper path.

Figure 7-9 Open rear cover



3. Close the rear door to allow the printer to attempt to clear the jam message.
4. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
5. Ensure the printer is located in an area meets the environmental specifications for the printer.
6. Adjust the paper guides in the tray. Ensure the front paper guide is pushing the paper against the back edge of the tray.
7. If the error persists, please contact HP customer support.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Follow the instructions on the control panel to clear the jammed paper.
2. Open the rear door and look for and clear any paper present or obstructions in the paper path.
3. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
4. Ensure the printer is located in an area meets the environmental specifications for the printer.
5. Adjust the paper guides in the tray. Ensure the front paper guide is pushing the paper against the back edge of the tray.
6. Remove the fuser and inspect the fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.

Fuser (simplex; 110-127V) part number: RM2-1833-010CN

Fuser (simplex; 220-240V) part number: RM2-1834-010CN

Fuser (duplex; 110-127V) part number: RM2-6460-010CN

Fuser (duplex; 220-240V) part number: RM2-6461-010CN

For instructions: [Removal and replacement: Fuser \(simplex models\)](#) See the Service Manual for this printer.

For instructions: [Removal and replacement: Fuser \(duplex models\)](#)

Jam in print paper path. Open rear door and clear jam.

A paper jam occurred in the rear door/fuser area.

13.B9 jam error in fuser output

Use the following procedure to check for paper in all possible jam locations in the fuser area.

Recommended action for customers

When a jam occurs, the control panel displays a message and an animation that assists in clearing the jam.

- 13.B9.yz Jam in rear door

y = jam type (A, C, or D)

z = paper type that is being printed on. This can be 0-9 or A-F.




CAUTION:




The fuser can be hot while the printer is in use. Wait for the fuser to cool before handling it.


1. Open the rear door.

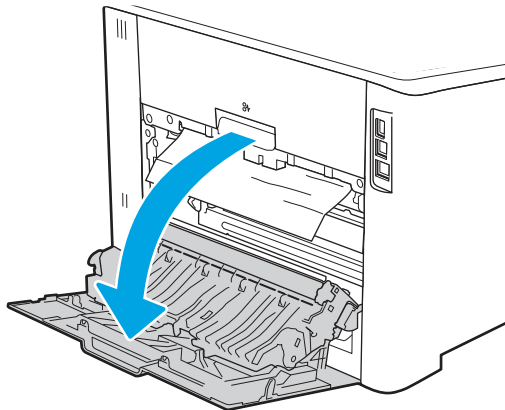

2. Gently pull out any jammed paper from the rollers in the rear door area.

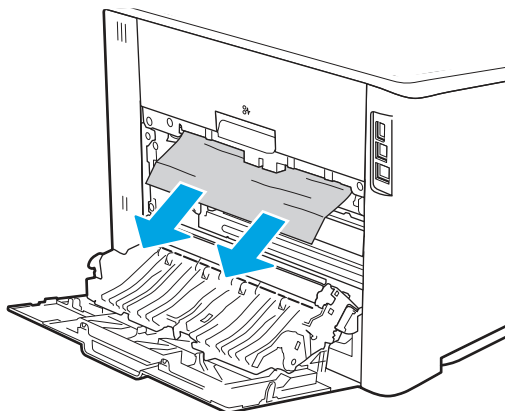

3. Close the rear door.

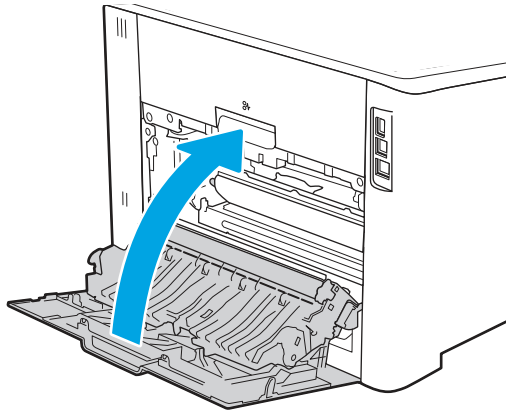


4. If the error persists, ensure the type and quality of the paper being used meets the HP specifications for the printer.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open the rear door and look for and clear any paper present or obstructions in the paper path.

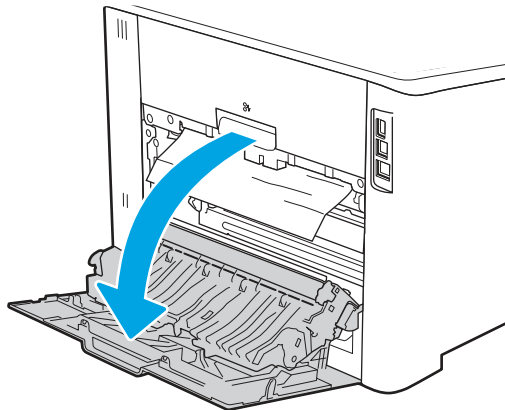

- ### Recommended action for onsite technicians

1. Clear the paper jam.

- a. Open the rear door and look for and clear any paper present or obstructions in the paper path.

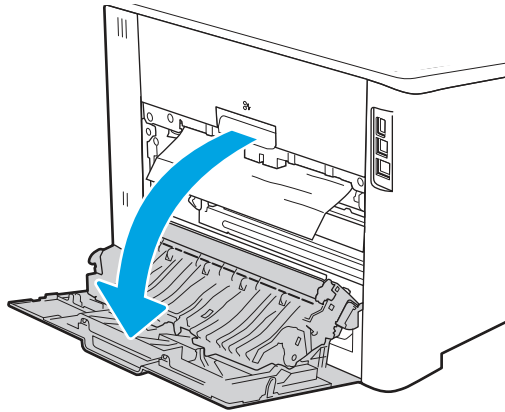


Figure 7-11 Check these areas



- b. Close the rear door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. Make sure the printer is located in an area meets the environmental specifications for the printer.
4. Adjust the paper guides in the tray. Ensure the front paper guide is pushing the paper against the back edge of the tray.
5. If the paper stopped before the fuser, complete these troubleshooting steps:
 - Check the ITB and T2 roller at the transfer area, ensure that everything is correctly seated and that there are no damaged parts. Replace the ITB or T2 roller as needed.

Intermediate transfer belt (ITB) assemblyRM2-6454-000CN

For instructions: *Removal and replacement: Intermediate transfer belt*See the Repair Service Manual for this product.

Secondary transfer assemblyRM2-6397-000CN

For instructions: *Removal and replacement: Secondary transfer assembly*See the Repair Service Manual for this product.
6. If the paper stopped in or at the fuser, complete these troubleshooting steps:

- Remove the fuser and inspect the fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.

Fuser assembly (110-127V) part number: RM2-6460-000CN

Fuser assembly (220-240V) part number: RM2-6461-000CN

For instructions: *Removal and replacement: Fuser assembly* See the Repair Service Manual for this product.

Jam in Tray 1. Clear the jam, and then press "OK".

A paper jam occurred while printing from tray 1.

13.B2.D1 jam error in tray 1


Use the following procedure to clear paper jams in tray 1.

Recommended action for customers


When a jam occurs, the control panel displays a message and an animation that assists in clearing the jam.

- **13.B2.D1 Jam in tray 1**


1. If you can see the jammed sheet in Tray 1, remove the jammed sheet by pulling it straight out.

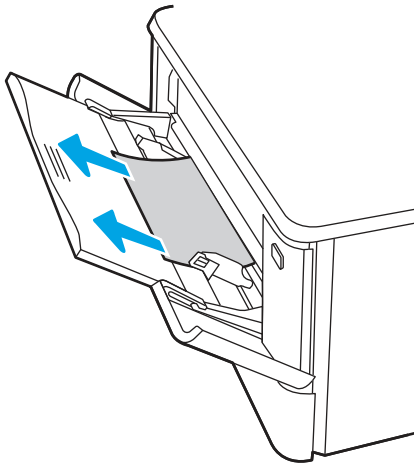


2. If you cannot see the jammed sheet, close Tray 1, and then remove Tray 2.

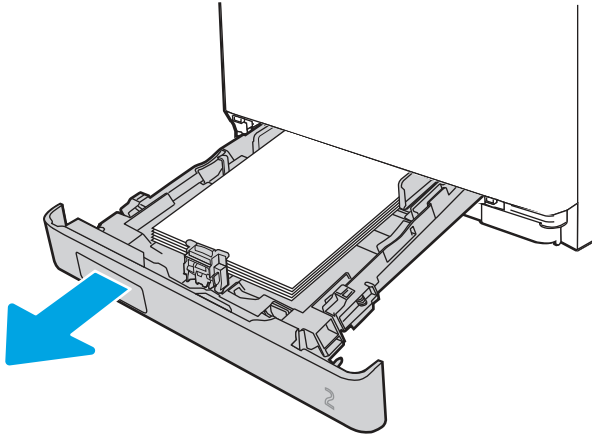


3. At the left side of the Tray 2 cavity, press the tab to lower the tray plate, and then remove any paper. Remove the jammed sheet by gently pulling it straight out.

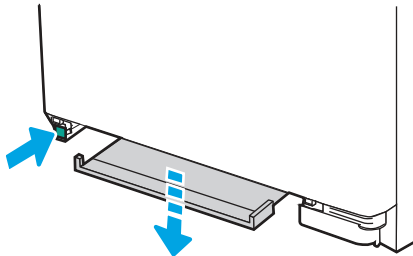


4. Push the tray plate back up into place.

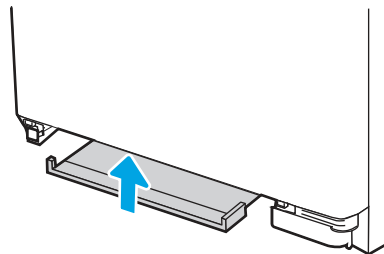


5. Reinstall Tray 2.

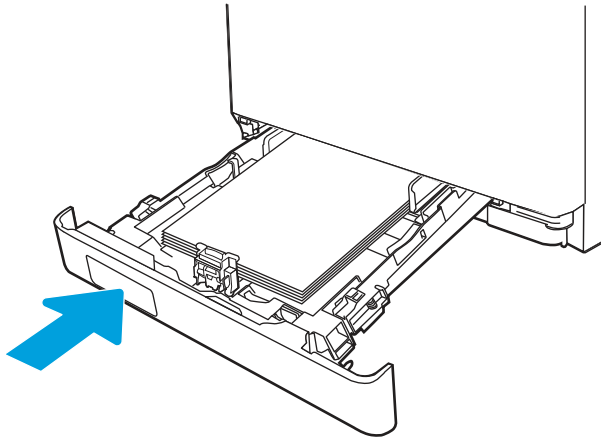

6. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
7. Reopen Tray 1 and load paper into the tray. Ensure the tray guides are set to the correct paper size.

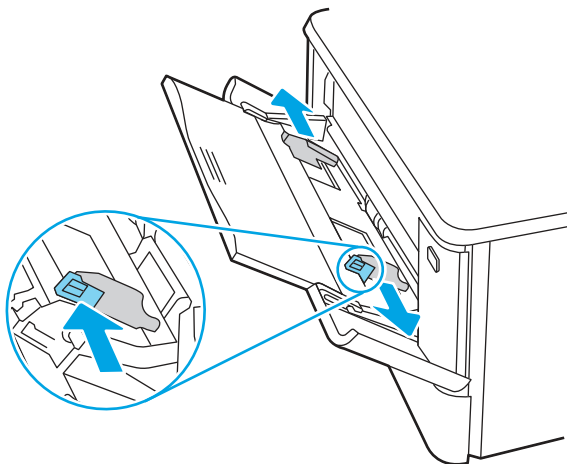

8. Ensure the tray is not overfilled. Paper should be below the 3 triangles in the following image.

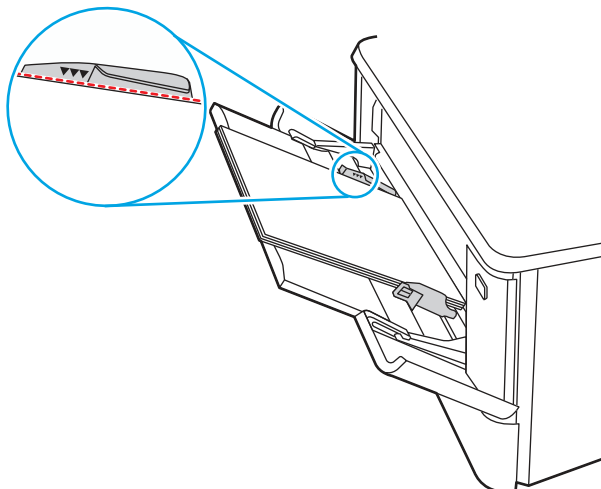


9. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents


Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Remove all paper from tray 1.
 - b. If you cannot see the jammed sheet, close Tray 1, and then remove Tray 2.

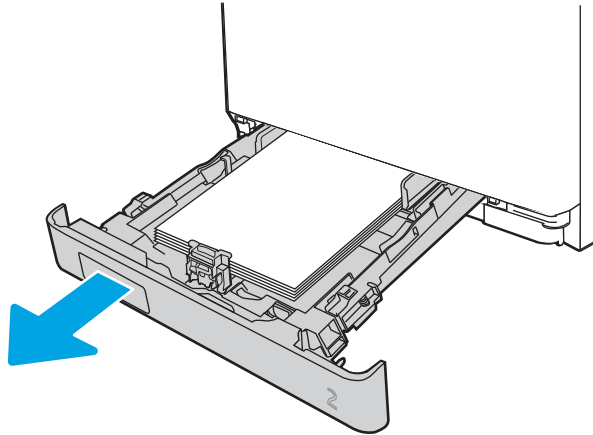


- c. Open the jam access area inside the tray 2 opening. Press the green button on the right side to drop open the access area.


Figure 7-12 Open jam access

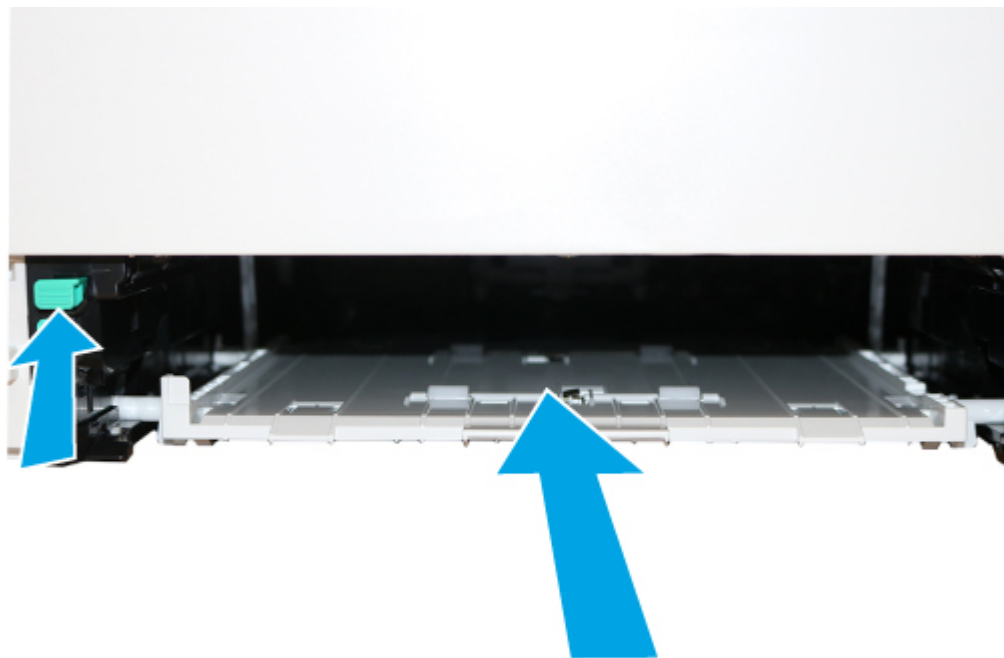

- d. Look for and clear any paper present or obstructions in the paper path.
 - e. Raise the access plate up to the closed position and reinstall tray 2.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
 3. Ensure that the tray 1 width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

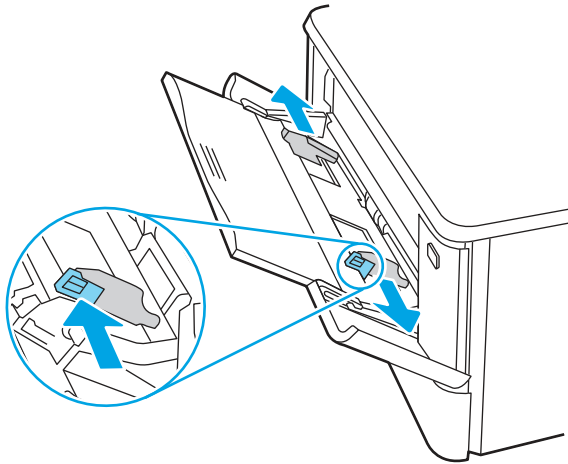


4. Ensure the tray is not overfilled. Paper should be below the 3 triangles in the following image.

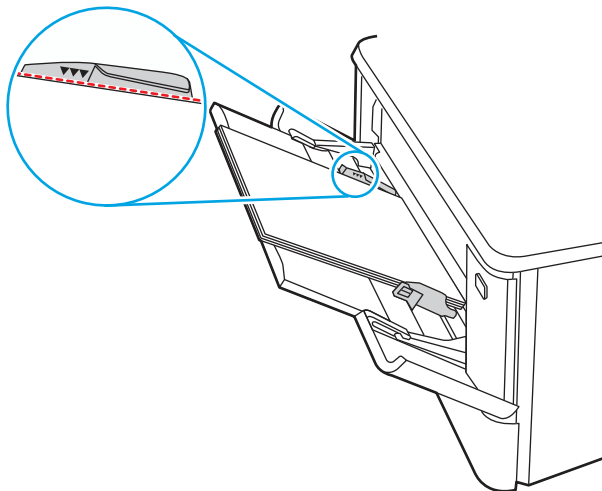

5. Ensure that the Tray 1 pickup roller and separation pad are installed correctly and show no damage or wear.
6. Clean or replace the pickup roller and separation pad as needed.


- a. Open the front door.

Figure 7-13 Open the front door

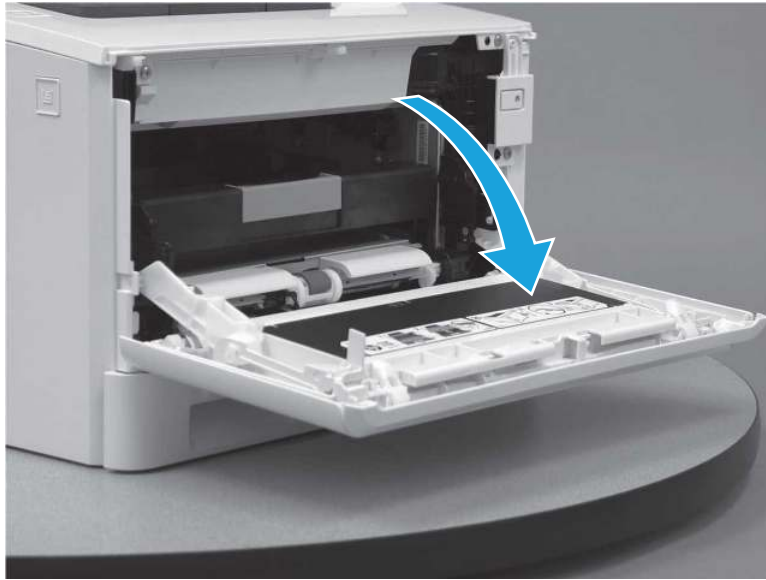


- b. Press down on the separation pad holder (callout 1) and release two tabs (callout 2).

Figure 7-14 Press down and release tabs

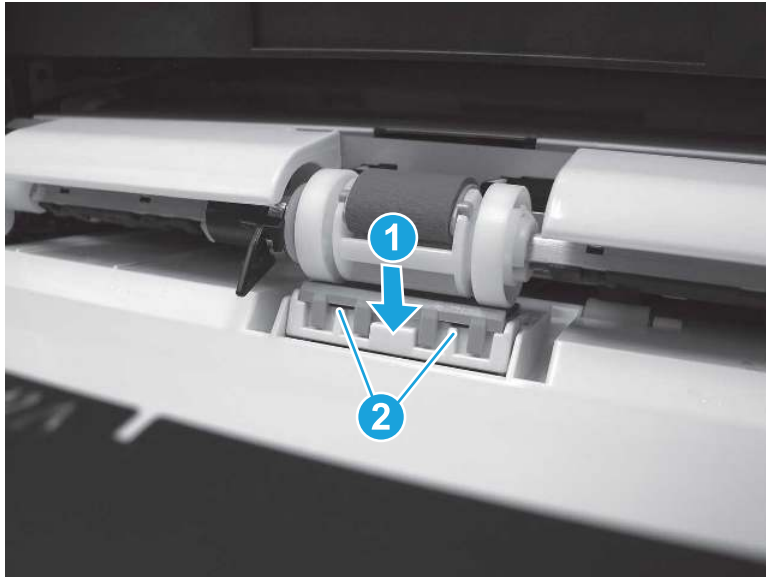


- c. Continue to press down on the separation pad holder (callout 1), and then slide the separation pad (callout 2) away from the printer to remove it.

Figure 7-15 Remove the separation pad

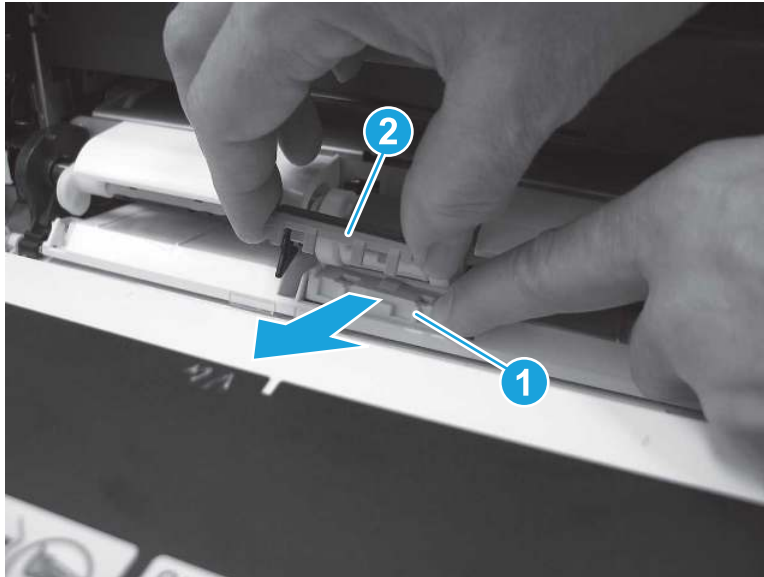


- d. Release two tabs (callout 1).

Figure 7-16 Release two tabs

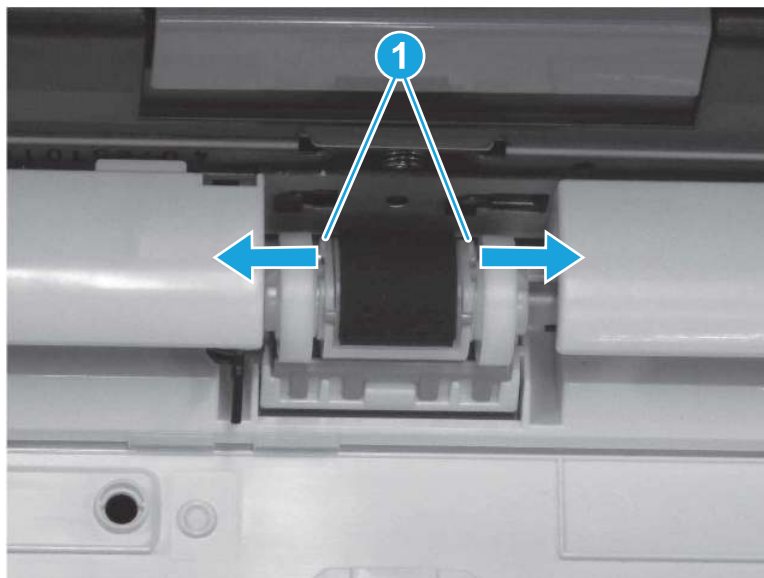

- e. Remove the pickup roller.


Figure 7-17 Remove the pickup roller

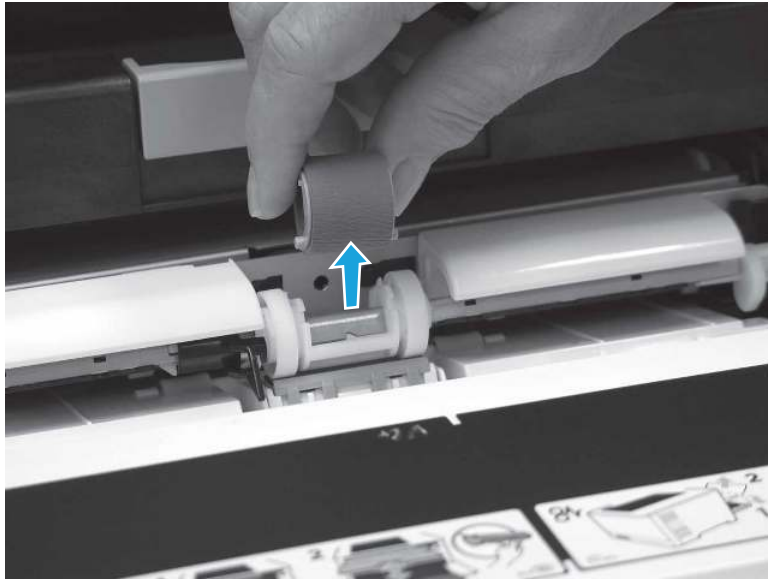

- f. Use a damp, lint-free cloth to gently clean the roller and pad.

CAUTION: When handling the roller and/or pad, avoid touching the spongy surfaces. Skin oils and fingerprints on a roller surface can cause print-quality problems.

Figure 7-18 Clean the roller and pad

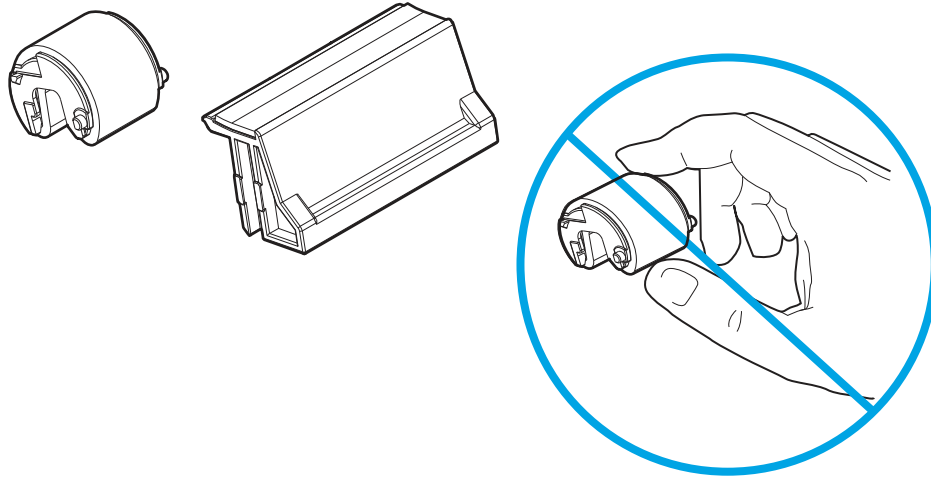

Tray 1 pickup roller part number: RL1-2593-000CN


Tray 1 separation pad assembly part number: RM2-6406-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.


1. Clear the paper jam.
 - a. Remove all paper from tray 1.

- b. If you cannot see the jammed sheet, close Tray 1, and then remove Tray 2.

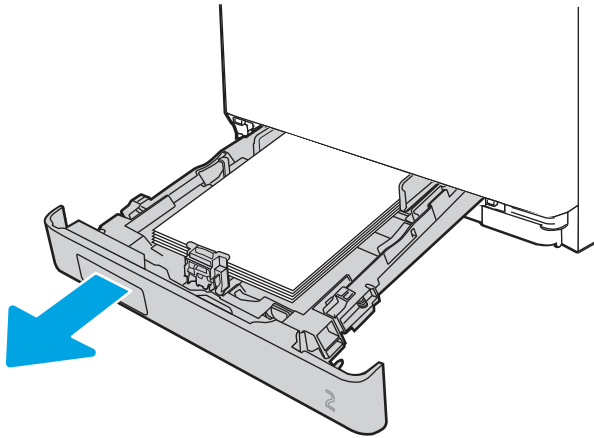


- c. Open the jam access area inside the tray 2 opening. Press the green button on the right side to drop open the access area.

Figure 7-19 Open jam access

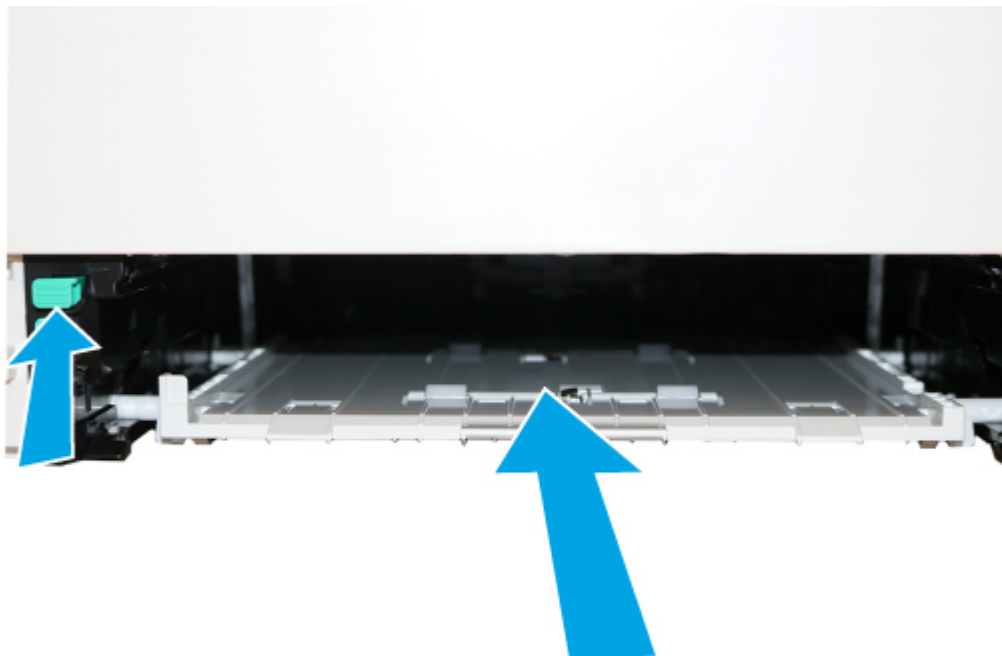


- d. Look for and clear any paper present or obstructions in the paper path.
 - e. Raise the access plate up to the closed position and reinstall tray 2.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.

3. Ensure that the tray 1 width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

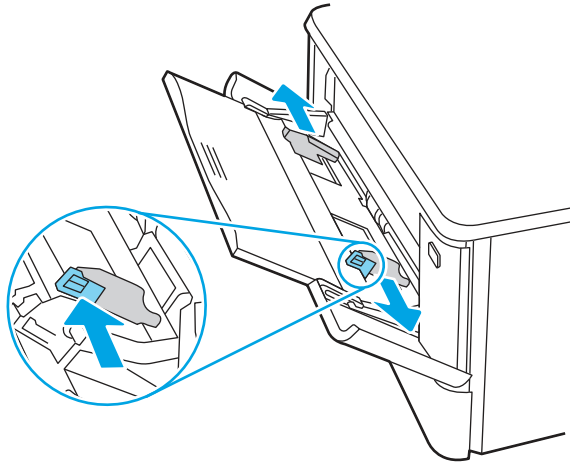


4. Ensure the tray is not overfilled. Paper should be below the 3 triangles in the following image.

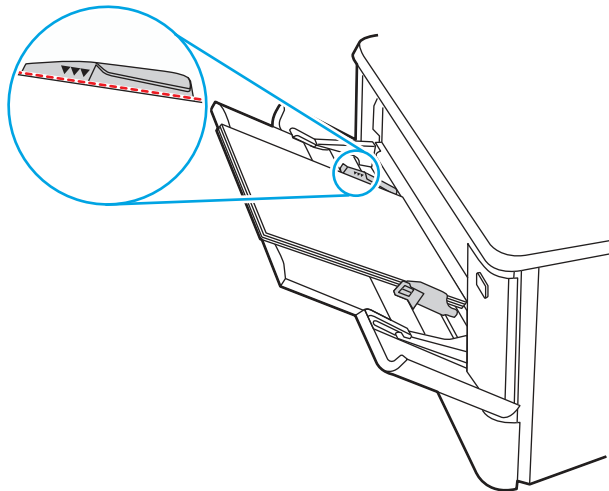

5. Ensure that the Tray 1 pickup roller and separation pad are installed correctly and show no damage or wear.
6. Clean or replace the pickup roller and separation pad as needed.


- a. Open the front door.

Figure 7-20 Open the front door

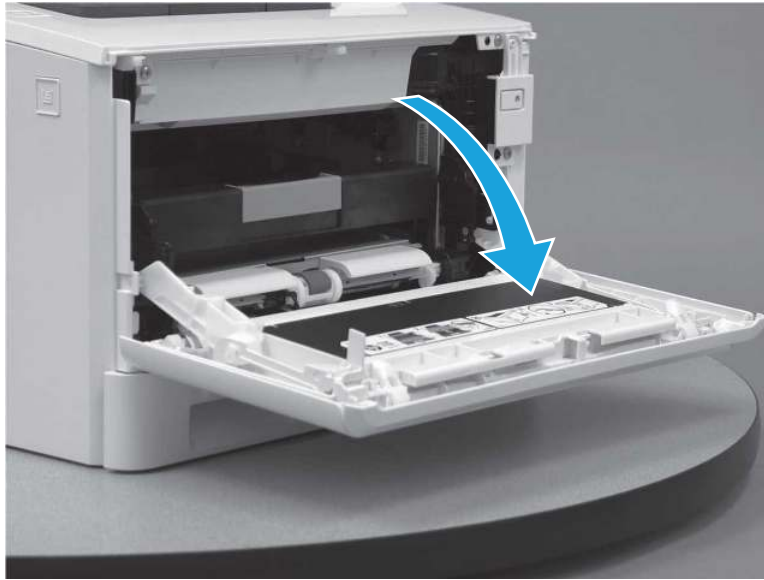


- b. Press down on the separation pad holder (callout 1) and release two tabs (callout 2).

Figure 7-21 Press down and release tabs

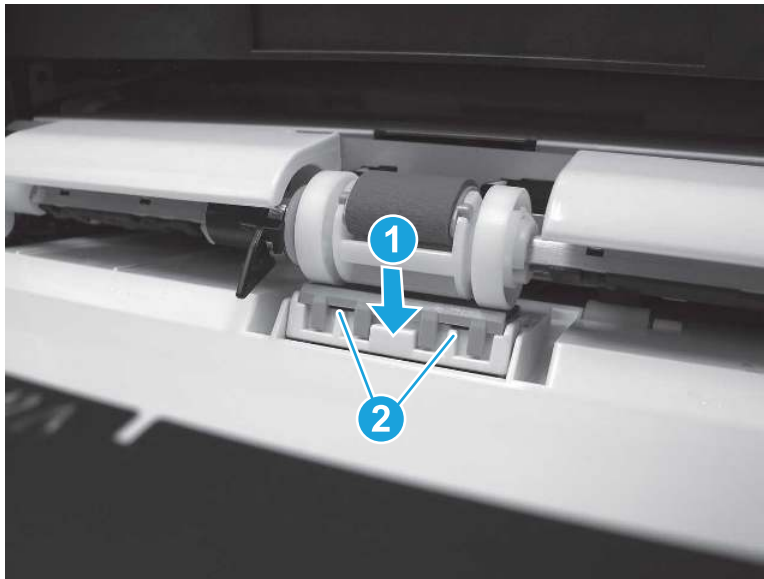


- c. Continue to press down on the separation pad holder (callout 1), and then slide the separation pad (callout 2) away from the printer to remove it.

Figure 7-22 Remove the separation pad

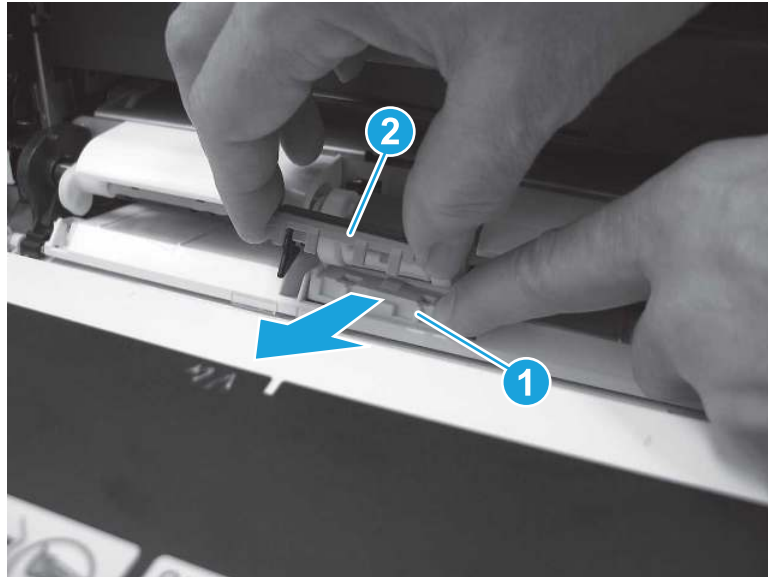


- d. Release two tabs (callout 1).

Figure 7-23 Release two tabs

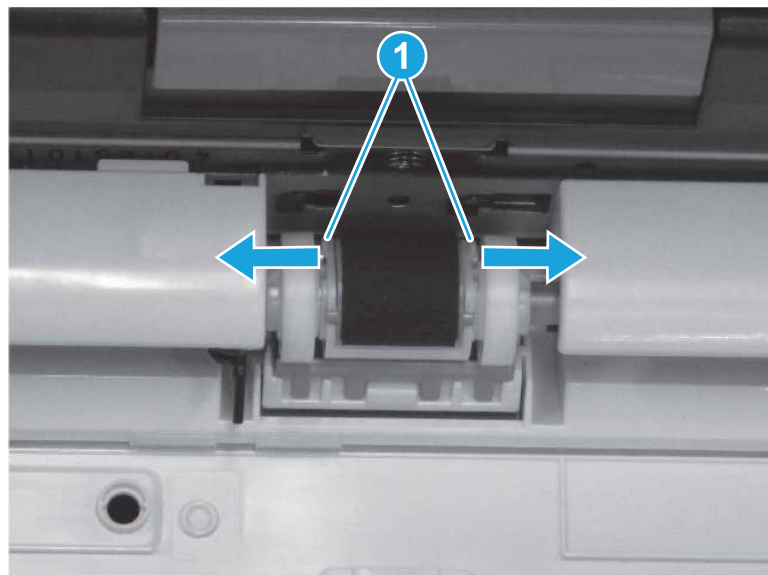

- e. Remove the pickup roller.


Figure 7-24 Remove the pickup roller

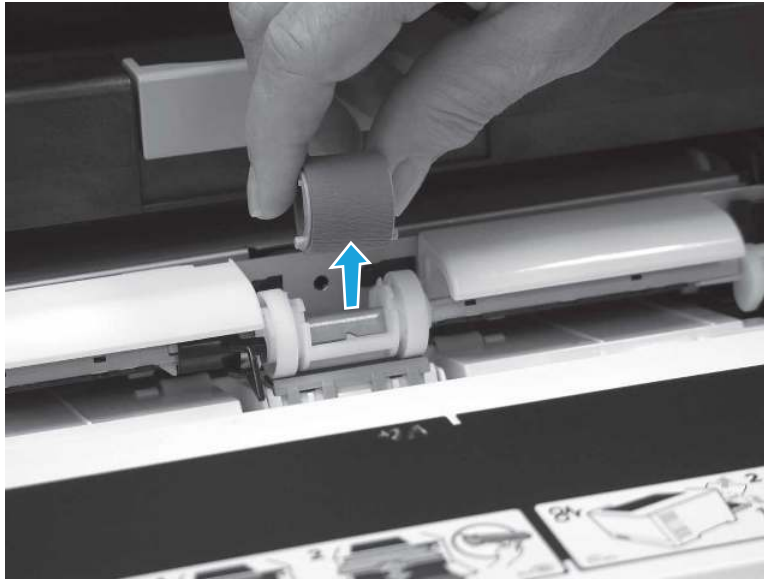

- f. Use a damp, lint-free cloth to gently clean the roller and pad.

CAUTION: When handling the roller and/or pad, avoid touching the spongy surfaces. Skin oils and fingerprints on a roller surface can cause print-quality problems.

Figure 7-25 Clean the roller and pad

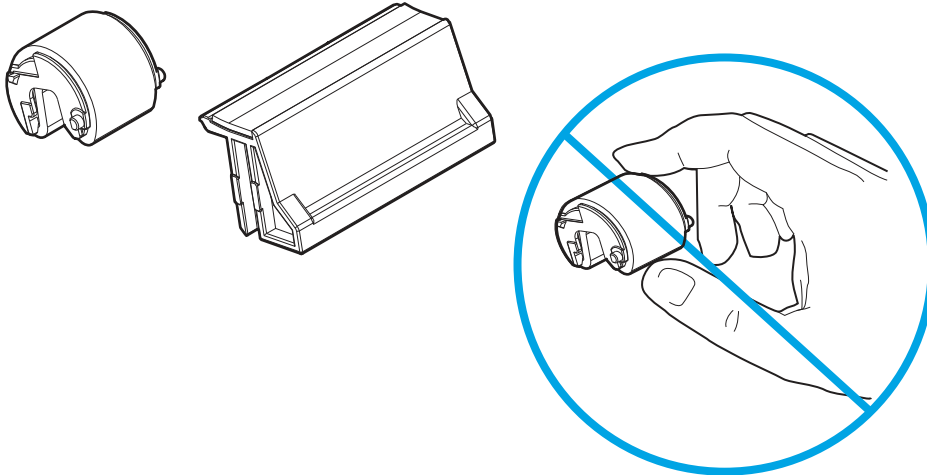

Tray 1 pickup roller part number: RL1-2593-000CN

Tray 1 separation pad assembly part number: RM2-6406-000CN

Jam in Tray 2. Clear the jam, and then press "OK".


A paper jam occurred when printing from tray 2.

13.B2.D2 jam error in tray 2


Use the following procedure to check for a paper jam in tray 2.

When a jam occurs, the control panel displays a message and an animation that assists in clearing the jam.


- 13.B2.D2 Paper jam in tray 2
1. Pull the tray completely out of the printer.

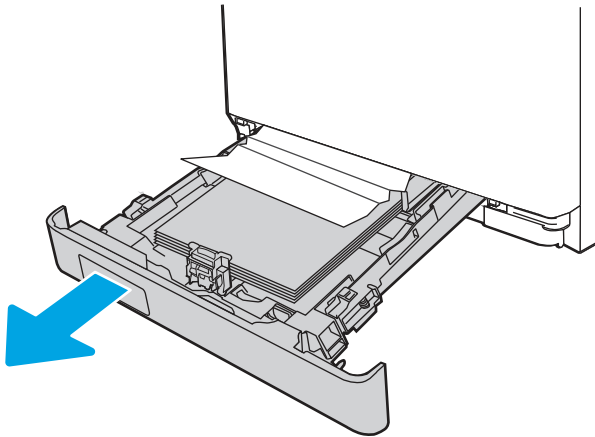

2. Remove any jammed or damaged sheets of paper.


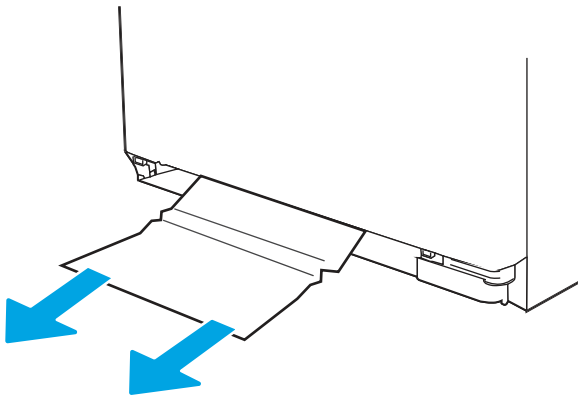


3. Reinsert and close Tray 2.

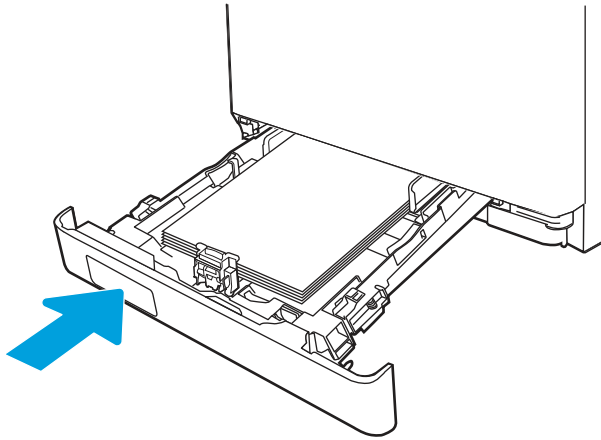


 **NOTE:** When reinserting the paper, make sure the paper guides are adjusted properly for the paper size.

4. Open the rear door and look for and clear any paper present or obstructions in the paper path.

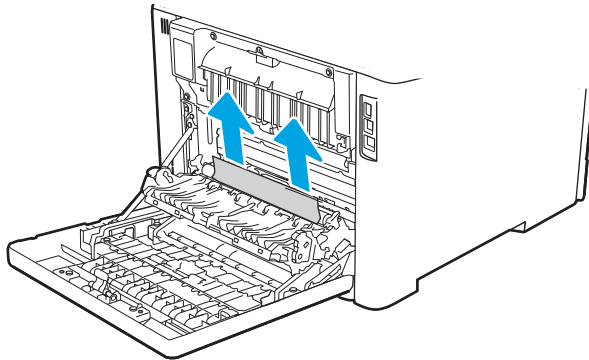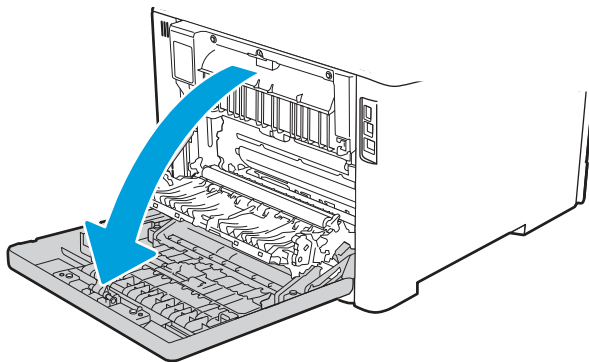

5. Ensure the type and quality of the paper being used meets the HP specifications for the printer.

6. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab (line below 3 triangles). See following images.

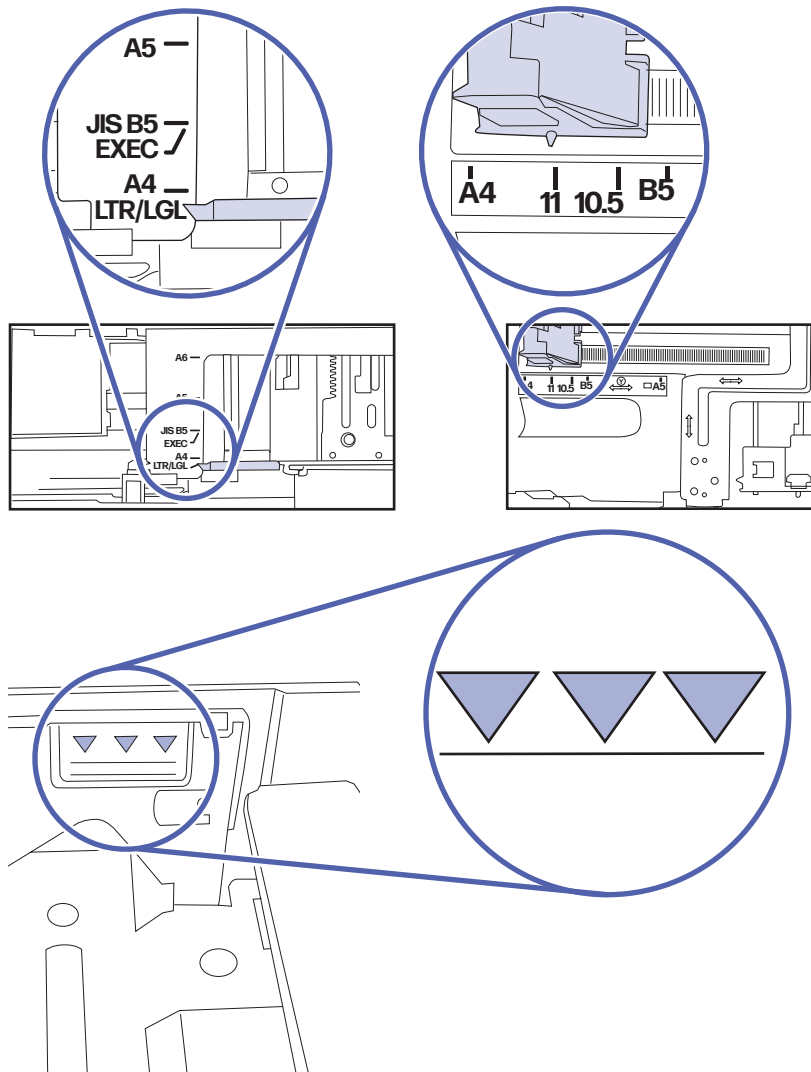


7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.


Recommended action for call-center

Use the following procedure to check for a paper jam in Tray 2.


1. Pull the tray completely out of the printer.

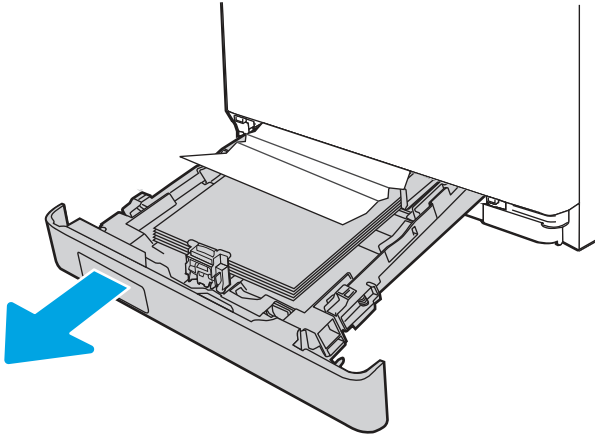

2. Remove any jammed or damaged sheets of paper.

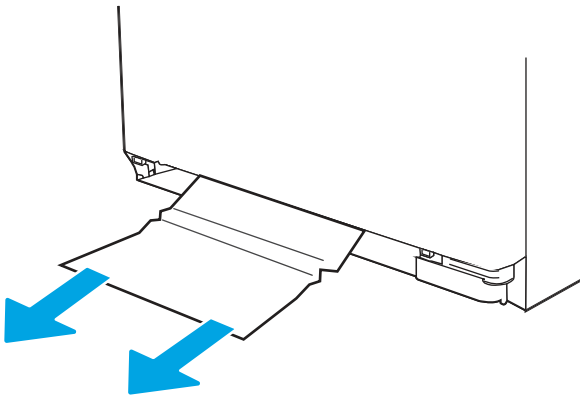

3. Reinsert and close Tray 2.

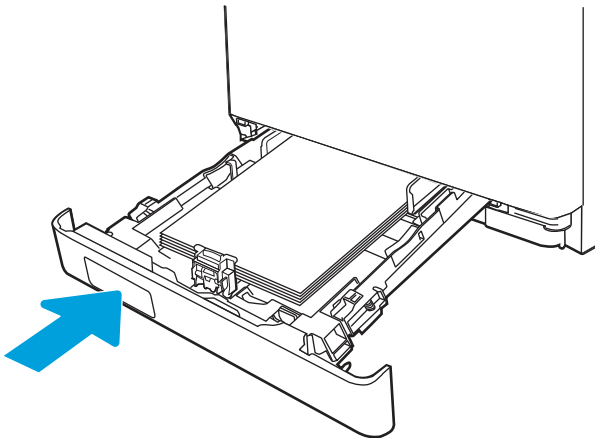

4. Open the rear door and look for and clear any paper present or obstructions in the paper path.


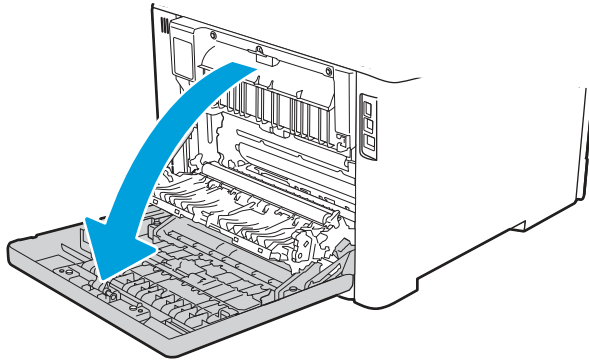


Figure 7-26 Clear Jam



5. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab (line below 3 triangles). See following images.

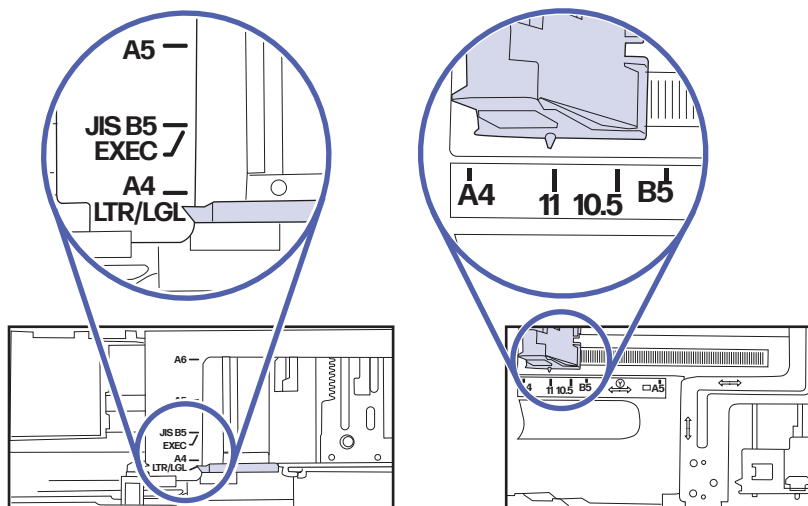


7. Ensure that the tray 2 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
8. Clean or replace the pickup, feed, and separation rollers as needed.
Roller, paper pickup assembly part number: RM2-5576-000CN
Roller, feed assembly part number: RM2-5577-000CN
Roller, separation part number: RM2-5881-000CN
9. If the issue persists, try to engage the registration sensor with a piece of paper, if there are no obstructions close the rear door and see if the error clears.
10. If the error persists, replace the following parts as needed.
Paper pick up assembly part number: RM2-6372-000CN
Registration assembly part number: RM2-1839-000CN
11. If the issue persists, elevate the case using the Standard Support Process.

Recommended action for onsite technicians


Use the following procedure to check for a paper jam in Tray 2.

1. Pull the tray completely out of the printer.
2. Remove any jammed or damaged sheets of paper.
3. Reinsert and close Tray 2.
4. Open the rear door and look for and clear any paper present or obstructions in the paper path.

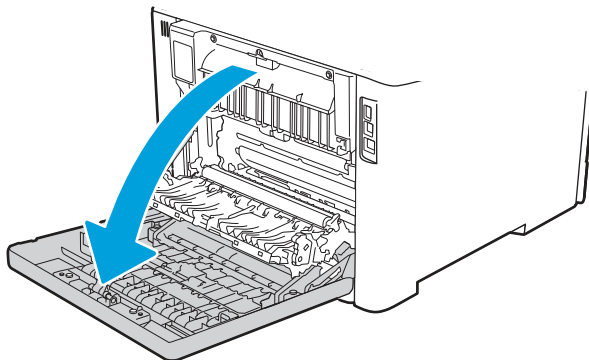



5. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab (line below 3 triangles). See following images.

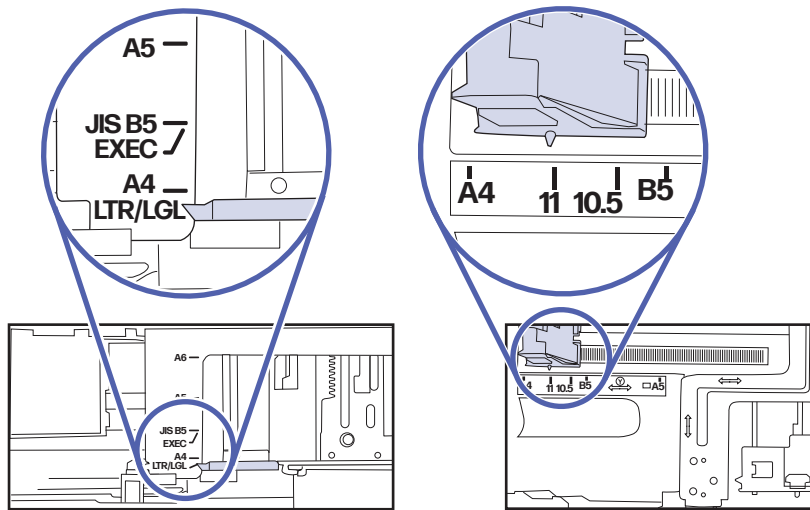

7. Ensure that the tray 2 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
8. Clean or replace the pickup, feed, and separation rollers as needed.
 Roller, paper pickup assembly part number: RM2-5576-000CN
 Roller, feed assembly part number: RM2-5577-000CN
 Roller, separation part number: RM2-5881-000CN
9. If the issue persists, try to engage the registration sensor with a piece of paper, if there are no obstructions close the rear door and see if the error clears.
10. If the error persists, replace the following parts as needed.
 Paper pick up assembly part number: RM2-6372-000CN
 Registration assembly part number: RM2-1839-000CN

For instructions: *Removal and replacement: Paper pickup assembly* See the Repair Service Manual for this product.

For instructions: *Remove and replace: Registration assembly* See the Repair Service Manual for this product.

11. If the issue persists, elevate the case using the Standard Support Process.

Jam in Tray 3. Clear the jam, and then press "OK".

Paper jam while printing from tray 3.

13.A3 jam error in tray 3


Use the following procedure to check for a paper jam in tray 3.

Recommended action for customers


When a jam occurs, the control panel displays a message and an animation that assists in clearing the jam.

- 13.A3.D3 - Jam in tray 3


1. Pull the tray completely out of the printer.

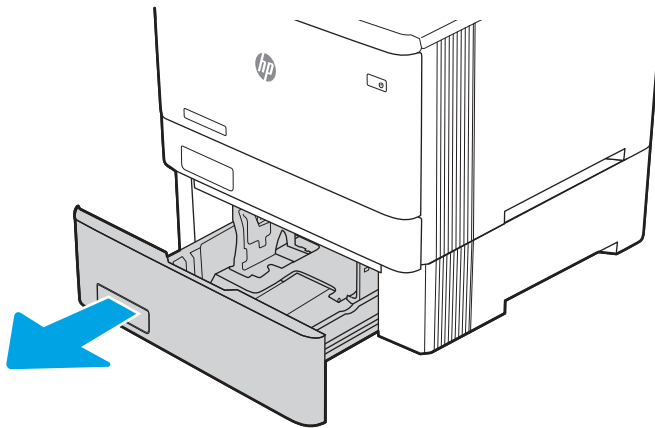

2. Remove any jammed or damaged sheets of paper.

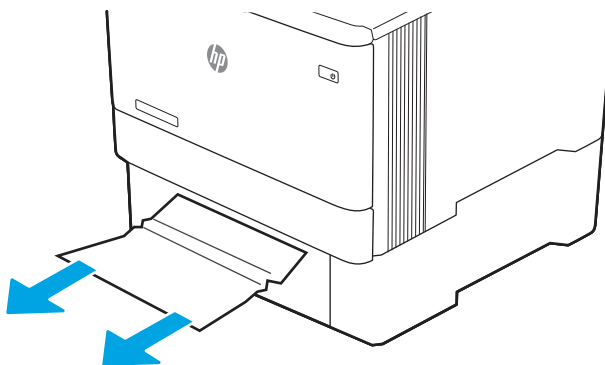


3. Reinsert and close Tray 3.

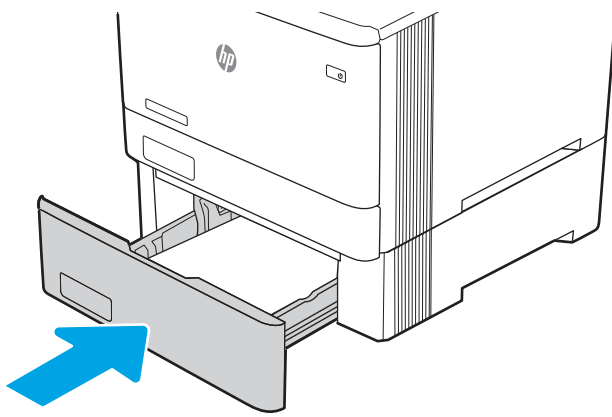


 **NOTE:** When reinserting the paper, make sure the paper guides are adjusted properly for the paper size.


4. Open the rear door and look for and clear any paper present or obstructions in the paper path.

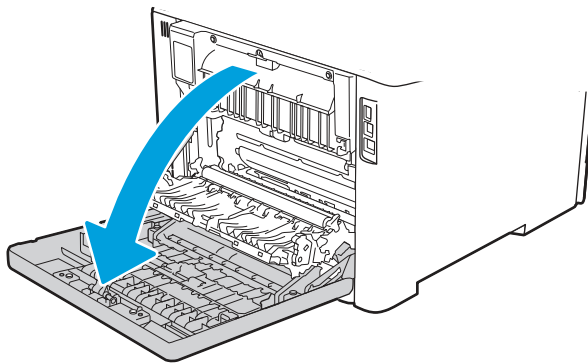

5. Check the following are for paper. Remove paper by gently pulling paper out.

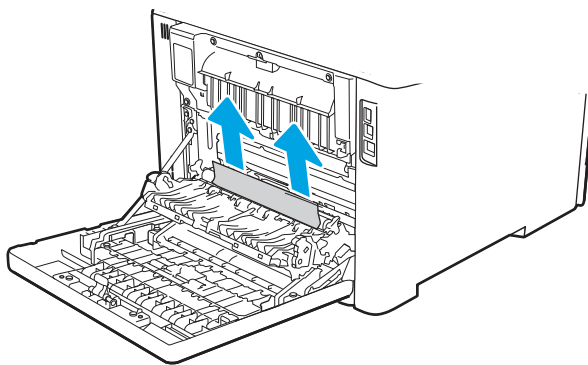

6. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab (line below 3 triangles). See following images.

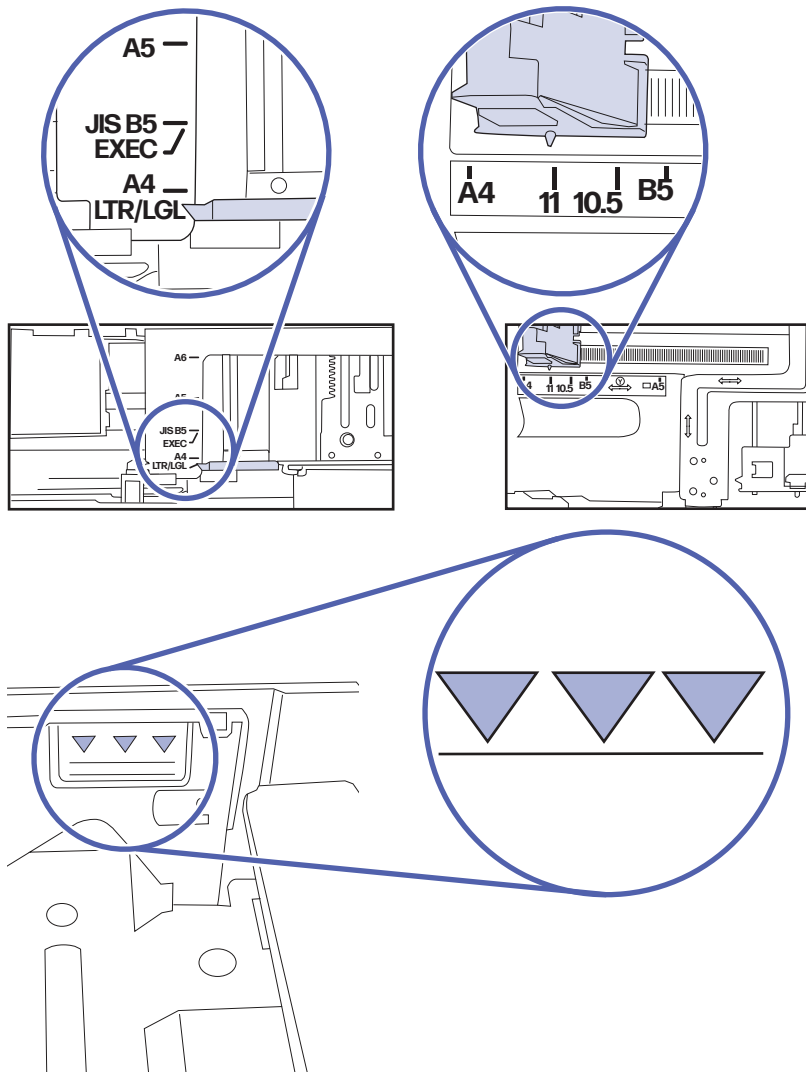


7. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
8. If the error persists, contact customer support at www.hp.com/go/contactHP, or contact an HP-authorized service or support provider.


Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.


1. Pull the tray completely out of the printer.

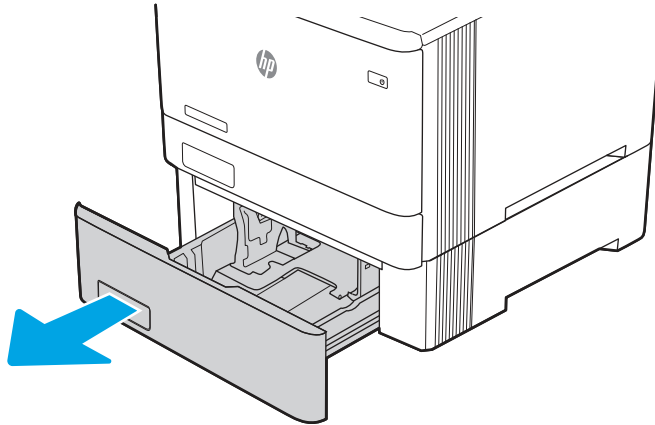

2. Remove any jammed or damaged sheets of paper.

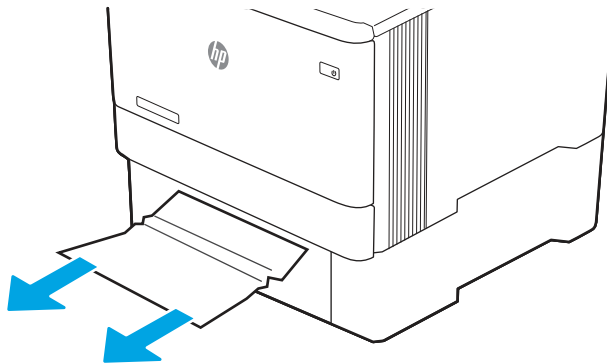

3. Reinsert and close Tray 3.

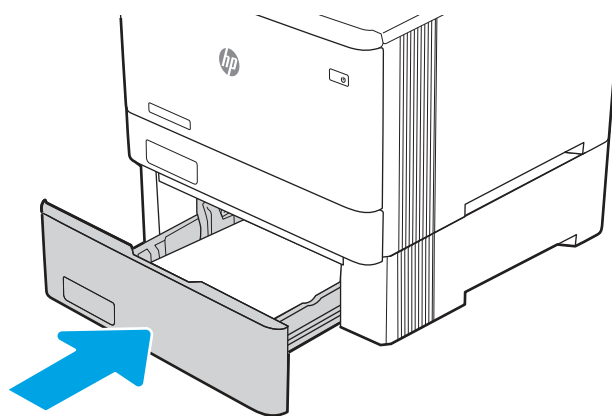

NOTE: When reinserting the paper, make sure the paper guides are adjusted properly for the paper size.

4. Open the rear door and look for and clear any paper present or obstructions in the paper path.



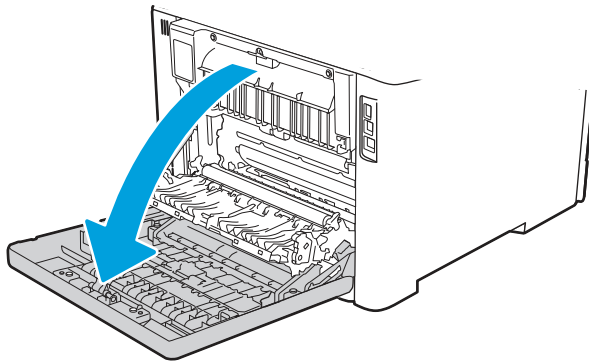


Figure 7-27 Clear Jam



5. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab (line below 3 triangles). See following images.

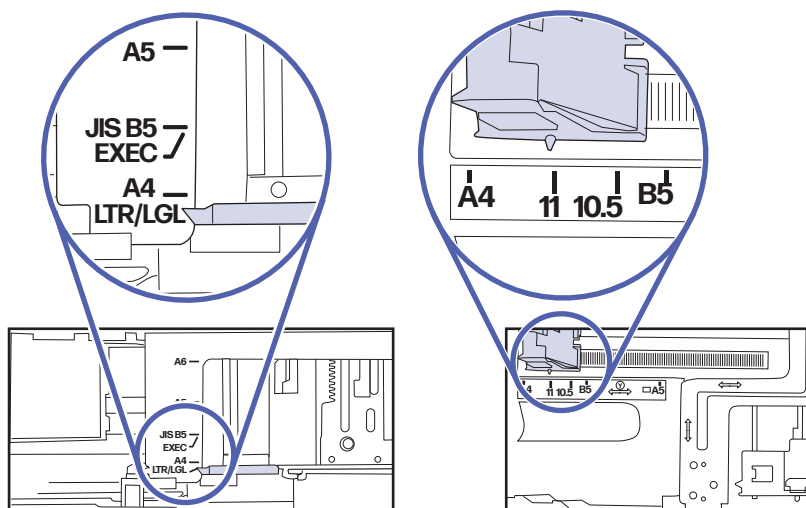

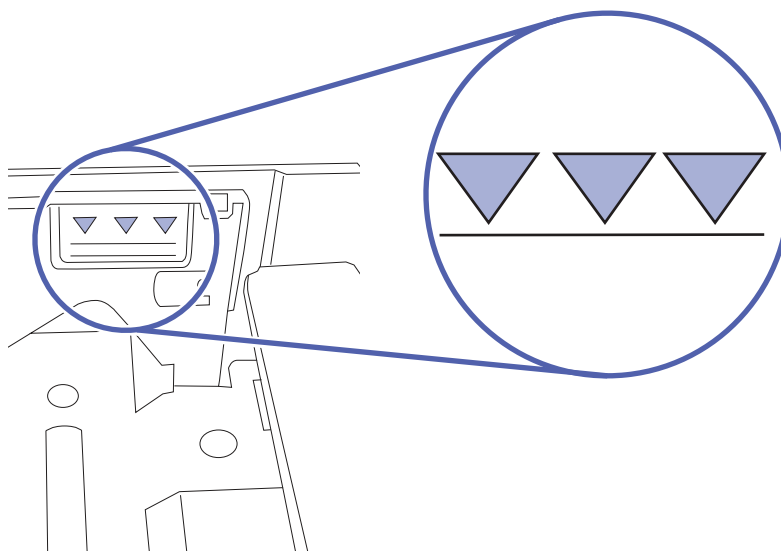

7. Ensure that the tray pickup, feed, and separation rollers are installed correctly and show no damage or wear.
8. Clean or replace the pickup, feed, and separation rollers as needed.
Roller, paper pickup assembly part number: RM2-5576-000CN
Roller, feed assembly part number: RM2-5577-000CN
Roller, separation part number: RM2-5881-000CN
9. If the jam persists, replace the Tray 3 Assembly.
Optional 550-sheet paper feeder part number: CF404-67901

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Pull the tray completely out of the printer.
2. Remove any jammed or damaged sheets of paper.
3. Reinsert and close Tray 3.



NOTE: When reinserting the paper, make sure the paper guides are adjusted properly for the paper size.

4. Open the rear door and look for and clear any paper present or obstructions in the paper path.



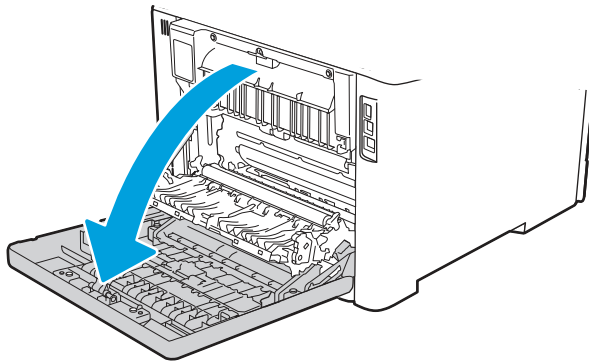


Figure 7-28 Clear Jam



5. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
6. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab (line below 3 triangles). See following images.

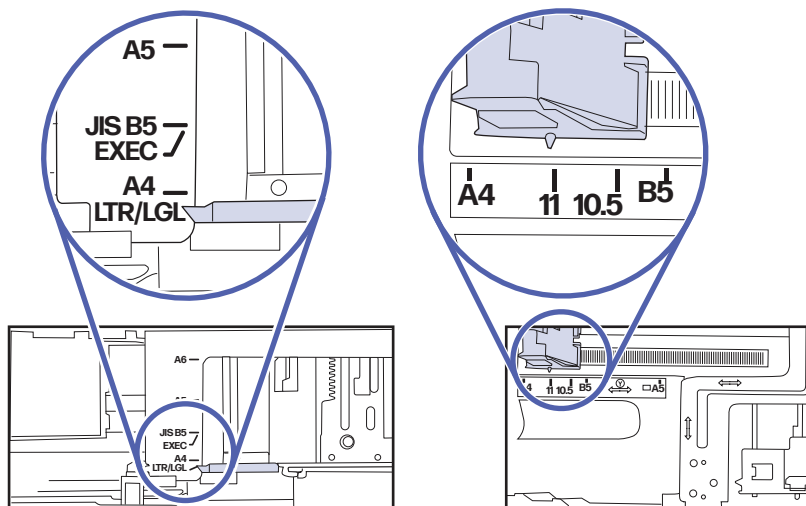

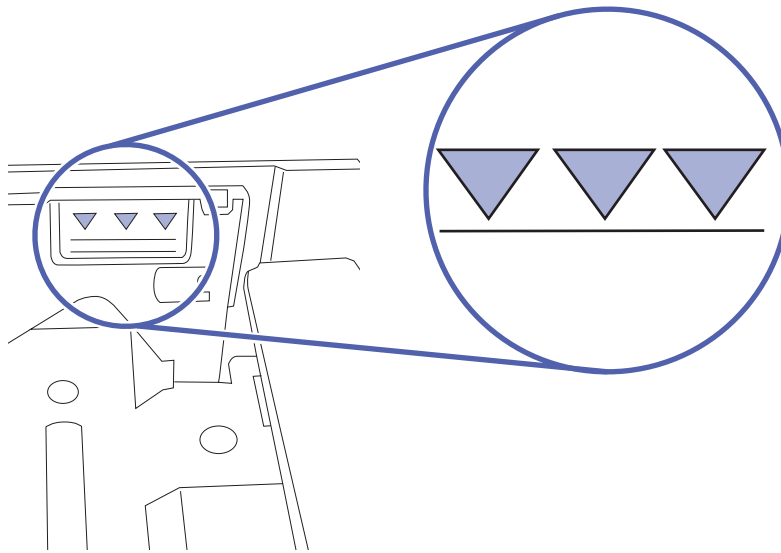

7. Ensure that the tray pickup, feed, and separation rollers are installed correctly and show no damage or wear.

8. Clean or replace the pickup, feed, and separation rollers as needed.

Roller, paper pickup assembly part number: RM2-5576-000CN

For Instructions: *Removal and replacement: 550 sheet feeder pickup assembly* See the Repair Service Manual for this product.

Roller, feed assembly part number: RM2-5577-000CN

Roller, separation part number: RM2-5881-000CN

9. If the jam persists, replace the Tray 3 assembly.

Optional 550-sheet paper feeder part number: CF404-67901

Load Tray <X>: [Type], [Size] To use another tray, press "OK"

This message displays when the indicated tray is selected, but is not loaded, and other paper trays are available for use.

It also displays when the tray is configured for a different paper type or size than the print job requires.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Load the correct paper in the tray.
2. If prompted, confirm the size and type of paper loaded.
3. Otherwise, press the **OK** button to select another tray.

Manually feed output stack Then touch "OK" to print second side

The printer has printed the first side of a manual duplex job and is waiting for you (or the applicable user) to insert the output stack to print the second side.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Maintaining the same orientation, remove the pages from the output bin.
2. Flip the document printed side up.
3. Load the document in Tray 1.
4. Touch the **OK** button to print the second side of the job.

Manually feed: <Type><Size>

This message appears when manual feed is selected, Tray 1 is not loaded, and other trays are empty.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Load the tray with requested paper.
2. If the paper is already in the tray, press the **Help** button to exit the message and then press the **OK** button to print.
3. To use another tray, clear paper from Tray 1, press the **Help** button to exit the message and then press the **OK** button.

Misprint. Press [OK] to continue.

Paper has been delayed as it moves through the printer.

Recommended action

Use the following steps to resolve the error.

1. Press the **OK** button to clear the message.
2. To avoid this problem, try the following solutions:
 - a. Adjust the paper guides in the tray. Make sure the front paper guide is pushing the paper against the back edge of the tray.
 - b. Make sure the type and quality of the paper being used meets the HP specifications for the printer. Store paper unopened in its original packaging.
 - c. Make sure to use the printer in an area that meets the environmental specifications for this printer.

No Dial tone

The product could not detect a dial tone.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Check for a dial tone on the phone line by touching the **Start Fax** button.

2. Unplug the telephone cord from both the product and the wall. Reconnect the cord at both ends ensuring you are using the FAX port on the back of the printer. Looking at the back of the printer, the FAX port is towards the middle. DO NOT connect the fax line to the port with the telephone icon.
3. Verify that you are using the telephone cord that came with the product.
4. Open the [Support](#) menu, and then touch the [Fax Diagnostics](#) menu. Touch the [Run Fax Test](#) button.



NOTE: This test verifies that the phone cord is connected to the correct port and that the phone line has a signal. The product prints a report with the results.

5. For additional fax sending/receiving troubleshooting go to this document.

[HP LaserJet Pro MFP - Solve problems sending or receiving faxes \(includes fax error messages and event log codes\)](#)

No Fax detected

The product answered the incoming call but did not detect that a fax machine was calling.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Open the [Support](#) menu, and then touch the [Fax Diagnostics](#) menu. Touch the [Run Fax Test](#) button.



NOTE: This test verifies that the phone cord is connected to the correct port and that the phone line has a signal. The product prints a report with the results.

2. For additional fax sending/receiving troubleshooting go to this document.

[HP LaserJet Pro MFP - Solve problems sending or receiving faxes \(includes fax error messages and event log codes\)](#)

3. If the error persists, replace the Fax PCA.

Fax PCA (M479; US) part number: W1A78-67906

Fax PCA (M479; Europe) part number: W1A78-67907

Fax PCA (M479; Brazil) part number: W1A78-67908

Fax PCA (M479; Philippines/AP) part number: W1A78-67909

No job to cancel

You have pressed the stop button but the printer is not actively processing any jobs.

Recommended action

See recommended action.

- No action necessary.

NON HP Supply Installed

This message is displayed for about 6 seconds when a new non-HP supply is installed.

10.99.31 (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

1. Use a genuine HP supply for the printer.
2. If you believe a genuine HP supply is being used, go to www.hp.com/go/anticounterfeit.

Printer out of memory, job too big

Printer out of memory, job too big.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to print the transferred data. Some data might be lost.
2. Reduce the page complexity or add printer memory.

Output Bin Full

This message displays when the output bin is full and paper must be removed before printing can continue.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Remove the paper from the output bin.
2. If the message persists and the tray is empty, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Remove the paper from the output bin.
2. If this message appears even though the output bin is not full.
 - Make sure that the output bin sensor flag is not damaged and can move freely. If the flag is damaged, replace the fuser/output assembly.

Fuser assembly (110-127V) part number: RM2-6460-000CN
Fuser assembly (220-240V) part number: RM2-6461-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Remove the paper from the output bin.
2. If this message appears even though the output bin is not full.

- Make sure that the output bin sensor flag is not damaged and can move freely. If the flag is damaged, replace the fuser/output assembly.

Fuser assembly (110-127V) part number: RM2-6460-000CN

Fuser assembly (220-240V) part number: RM2-6461-000CN

For instructions: *Removal and replacement: Fuser assembly* See the Repair Service Manual for this product.

Paused...

The printer is paused, and there are no error messages pending at the display. The I/O continues receiving data until the memory is full.

Recommended action

Follow these troubleshooting steps in the order presented.

- Press the [Stop](#) button.

Printing Configuration...

The printer is printing the Configuration page.

Recommended action

See recommended action.

- No action necessary.

Printing engine test...

The printer is printing an engine test page.

Recommended action

See recommended action.

- No action necessary.

Printing Event Log...

The printer is printing the Event Log page.

Recommended action

See recommended action.

- No action necessary.

Printing File Directory...

The printer is printing the File Directory pages.

Recommended action

See recommended action.

- No action necessary.

Printing Font List...

The printer is printing the Font List pages.

Recommended action

See recommended action.

- No action necessary.

Printing Help Page...

The printer is printing the Help page.

Recommended action

See recommended action.

- No action necessary.

Printing Menu Map...

The printer is printing the Menu Map pages.

Recommended action

See recommended action.

- No action necessary.

Printing Supplies Status Page...

The printer is printing the Supplies Status page.

Recommended action

See recommended action.

- No action necessary.

Printing Usage Page...

The printer is printing the Usage page.

Recommended action

See recommended action.

- No action necessary.

Power Failure Recovery

Recovering from power failure. Please wait.

Recommended action

There is no action needed for this message.

- No action necessary.

Power supply malfunction.

Power supply malfunction. Restart the printer.

Recommended action

Follow these troubleshooting steps in the order presented.

- Turn the printer on to restart it.

Protected <COLOR> cartridge

A previously protected cartridge was installed in a printer other than the one that initiated the cartridge protection.

The indicated cartridges can only be used in the printer or fleet of printers that initially protected the cartridges using the HP Cartridge Protection feature.

Recommended action

Follow these troubleshooting steps in the order presented.

- Please check the printer and replace the cartridge.



NOTE: The indicated cartridges can only be used in the printer or fleet of printers that initially protected the cartridges using the HP Cartridge Protection feature. These cartridges are not usable in this printer and must be replaced.

The HP Cartridge Protection feature allows a printer or fleet owner to restrict usage of a cartridge to their printer or fleet of printers. If you believe you purchased Genuine HP cartridges, visit us at: www.hp.com/go/anticounterfeit for more information or to report fraud.

Ready

The printer is online and ready for data. No status or printer attendance messages are pending at the display.

Recommended action

See recommended action.

- No action necessary.

Ready <IP Address>

The printer is online and ready for data. No status or printer attendance messages are pending at the display. The printer IP address displays.

Recommended action

See recommended action.

- No action necessary.

Rear door open

The rear door of the printer is open.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Close the rear door of the printer.
2. If the message persists with the rear door completely closed, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Close the rear door.
2. If the message persists, check the rear door sensor flag.

Figure 7-29 Check flag



3. If the flag is damaged or broken, replace the rear door.

Duplexing door assembly part number: RM2-1838-000CN

For instructions: *Removal and replacement: Duplexing door assembly* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Close the rear door.

2. If the message persists, check the rear door sensor flag.

Figure 7-30 Check flag



3. If the flag is damaged or broken, replace the rear door.

Duplexing door assembly part number: RM2-1838-000CN

For instructions: *Removal and replacement: Duplexing door assembly* See the Repair Service Manual for this product.

Replace Supplies

This alert displays only if the printer is configured to stop when a supply reaches the very low threshold. The printer indicates when a supply level is at its estimated end of life. The actual life remaining might be different than estimated.

The supply does not need to be replaced now unless the print quality is no longer acceptable.



NOTE: HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

The printer can be configured to stop when the supply level is very low. The supply might still be able to produce acceptable print quality.

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the specified supply.

Or, configure the printer to continue printing using the [Manage Supplies](#) menu on the printer control panel.

Restore Factory Settings

The printer is restoring factory settings.

Recommended action

See recommended action.

- No action necessary.

Supplies low

Multiple supplies on the printer have reached the low threshold.

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the supply when print quality is no longer acceptable.

Supply memory warning

The printer cannot read or write to the e-label or the e-label is missing.

Recommended action

See recommended action.

- No action necessary.

System Main has Failed

A 'System Main has Failed' error displays on the control panel of a new HP LaserJet Enterprise or HP LaserJet Managed printer.



NOTE: The 'System Main has Failed!' message is a low-level firmware error similar to a 49 error with different troubleshooting steps.

This error displays on the following HP LaserJet Enterprise and HP LaserJet Managed printer models.

HP LaserJet Enterprise

- HP LaserJet Enterprise M406dn
- HP LaserJet Enterprise M407dn
- HP LaserJet Enterprise MFP M430f
- HP LaserJet Enterprise MFP M431f
- HP Color LaserJet Enterprise M455dn
- HP Color LaserJet Enterprise MFP M480f
- HP Color LaserJet Enterprise 5700, 5700dn
- HP Color LaserJet Enterprise MFP 5800, 5800dn, 5800f
- HP Color LaserJet Enterprise Flow MFP 5800zf
- HP Color LaserJet Enterprise 6700, 6700dn
- HP Color LaserJet Enterprise 6701dn
- HP Color LaserJet Enterprise MFP 6800, 6800dn
- HP Color LaserJet Enterprise Flow MFP 6800
- HP Color LaserJet Enterprise Flow MFP 6801

- HP Color LaserJet Enterprise Flow MFP 8801
- HP LaserJet Enterprise Flow MFP 8601
- HP Color LaserJet Enterprise MFP 8801
- HP LaserJet Enterprise MFP 8601

HP LaserJet Managed

- HP LaserJet Managed E40040dn
- HP LaserJet Managed MFP E42540f
- HP Color LaserJet Managed E45028dn
- HP Color LaserJet Managed MFP E47528f
- HP LaserJet Managed E730, E731, E731dn, E731z
- HP LaserJet Managed MFP E73025, E73030
- HP LaserJet Managed MFP E73130, E73135, E73140
- HP Color LaserJet Managed MFP E785, E786, E786dn, E786z
- HP Color LaserJet Managed MFP E78523, E78528
- HP Color LaserJet Managed MFP E78625, E78630, E78635
- HP LaserJet Managed MFP E826, E826dn, E826z
- HP LaserJet Managed MFP E82650, E82660, E82670
- HP LaserJet Managed MFP E877, E877dn, E877z
- HP Color LaserJet Managed MFP E87740, E87750, E87760, E87770
- HP Color LaserJet X557
- HP Color LaserJet Enterprise X557dn
- HP Color LaserJet Enterprise MFP X57945, X57945dn
- HP Color LaserJet Enterprise Flow MFP X57945z, X57945zs
- HP Color LaserJet Enterprise MFP X58045, X58045dn
- HP Color LaserJet X654
- HP Color LaserJet Enterprise X654dn
- HP Color LaserJet Enterprise MFP X677, X677d, X677s
- HP Color LaserJet Enterprise Flow MFP X677z, X677zs


Recommended action

Follow these steps to clear the error or troubleshoot further as needed.

1. Select **Restart** on the printer control panel.



NOTE: If the printer does not restart, use the power button to turn off the printer, and to turn it on.

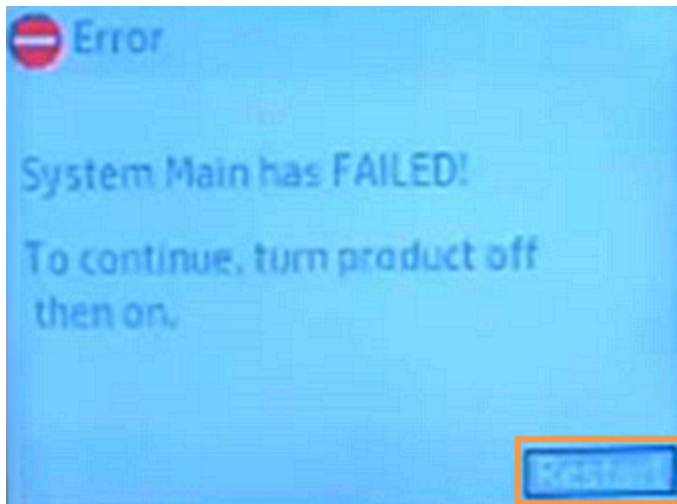

2. Check if the printer returns to a Ready state.
 - If the printer returns to a Ready state, the issue is solved.
 - If the error persists, see the next step.
3. If the printer reboots to the error again, or if the error returns later, perform a **Partial Clean** and then reconfigure the printer.
4. If the error returns after performing a **Partial Clean**, do the following tasks to check for a possible solution in the latest firmware release:
 - a. Go to HP Support or HP Software and Drivers (<https://support.hp.com/drivers>), select **Printer**, and then enter your printer model in the search field.
 - b. Expand the **Firmware** section, and then review the Readme file.
To view the Firmware Readme file, select the **See full details** link.
 - c. Upgrade the firmware if a possible solution is provided in the latest firmware release.
5. If the issue persists after upgrading the firmware, gather the Diagnostic log from the Preboot menu, and then elevate the case to HP Support.

Tray <X> empty: [Type], [Size]

The specified tray is empty and the current job does not need this tray to print.

- X = 1: Tray 1
- X = 2: Tray 2
- X = 3: Tray 3
- X = 4: Tray 4
- X = 5: Tray 5

Recommended action

Follow these troubleshooting steps in the order presented.

- Refill the tray at a convenient time.



NOTE: This could be a false message. If the tray is loaded without removing the shipping lock, the printer does not sense that the paper is loaded. Remove the shipping lock, and then load the tray.

Tray <X> lifting error

Tray "X" has experienced a tray lifting error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the indicated tray and check the paper guides.
2. Ensure the paper is correctly install in the paper tray and that the tray is not over-filled.
3. If the message persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the indicated tray and check the paper guides.
2. Ensure the paper is correctly install in the paper tray and that the tray is not over-filled.
3. If the error persists, check the event log for the following errors: 53.16.00, 53.17.00, 53.18.00, or 60.02.00, 60.03.00. Use these error codes to further troubleshoot the error message.

Tray <X> Overfilled

Too much paper has been loaded in Tray <X>

Recommended action

Follow these troubleshooting steps in the order presented.

- Open the tray and make sure the paper is below the paper stack tab or line shown on the tray.

Type mismatch Tray <x>

The specified tray contains a paper type that does not match the configured type.

Recommended action

Follow these troubleshooting steps in the order presented.

The specified tray will not be used until this condition is addressed. Printing can continue from other trays.

1. Load the correct paper in the specified tray.

2. On the printer control panel, make sure the paper type loaded in the tray matches the specified setting for the tray.

Used or Counterfeit in Use

A used cartridge has been installed.

Recommended action

Follow these troubleshooting steps in the order presented.

- A used cartridge has been installed. If you believe you purchased a genuine HP cartridge, visit us at <http://www.hp.com/go/anticounterfeit>.

Any printer repair required as a result of using used supplies is not covered under warranty. Supply status and features depending on supply status will not be available. Press "OK" to continue.

Used supply installed To continue, touch "OK" OR Used supply in use

The toner cartridges or supplies has been previously used.

Recommended action

Follow these troubleshooting steps in the order presented.

- If you believe a genuine HP supply is being used, go to www.hp.com/go/anticounterfeit.

Waiting for tray <x> to lift

The specified tray is in the process of lifting paper to the top of the tray (so it can correctly feed).

Recommended action

See recommended action.

- No action necessary.

Index

Symbols/Numerics

76.00.24 5

B

backup error
 32.WX.YZ error 4
 reset error 4
 restore error 4

C

connector error
 65.WX.YZ error 5

D

DC controller communication error
 55.WX.YZ error 4
DC controller firmware error
 70.WX.YZ error 5
digital sending error (firmware)
 44.WX.YZ error 4
document feeder
 jams 134, 144, 293, 302
document feeder error
 31.WX.YZ error 4
duplexer
 clear jams 92, 97, 101, 106
duplexer error
 69.WX.YZ error 5

E

Embedded Jetdirect error
 80.WX.YZ error 5
engine error (LaserJet)
 46.WX.YZ error 4
 63.WX.YZ error 5
engine error (PageWide)
 61.WX.YZ error 4
event log error (firmware)
 42.WX.YZ error 4

F

fan error
 58.WX.YZ error 4
firmware communication error
 49.WX.YZ error 4

firmware install error
 99.WX.YZ error 5
hard disk error 5
remote firmware upgrade
 error 5

fuser
 jams 75, 80, 84, 88, 316
fuser error
 41.WX.YZ error 4
 laser scanner error 4
 paper path error 4
fuser error (LaserJet)
 50.WX.YZ error 4

H

hard disk partition error
 98.WX.YZ error 5

I

input accessory error
 67.WX.YZ error 5
input/output error
 40.WX.YZ error 4
internal diagnostics error
 90.WX.YZ error 5
video display error 5

J

jam error (LaserJet)
 13.WX.YZ error 3
jam error (PageWide)
 13.WX.YZ error 4
jams
 document feeder 134, 144,
 293, 302
 duplexer 92, 97, 101, 106
 fuser 75, 80, 84, 88, 316
 rear door 67
 Tray 1 47, 320
 Tray 2 60, 333
 Tray 3 40, 340
job accounting error (firmware)
 48.WX.YZ error 4
job management error
 (firmware) 4
job pipeline error (firmware) 4

job parser error (firmware)
 47.WX.YZ error 4
printer calibration error 4

L

laser scanner error (LaserJet)
 51.WX.YZ error 4
 52.WX.YZ error 4
last update 1

M

memory error
 82.WX.YZ error 5
EMMC error 5
hard disk error 5
motor error (LaserJet)
 59.WX.YZ error 4

N

Near Field Communication error
 81.WX.YZ error 5
Bluetooth error 5
external I/O card error 5
internal EIO error 5
wireless error 5

O

output accessory error
 66.WX.YZ error 5
OXPd/Web kit error
 45.WX.YZ error 4

P

page error
 21.WX.YZ error 4
paper handling error (LaserJet)
 56.WX.YZ error 4
paper jams
 document feeder 134, 144,
 293, 302
 duplexer 92, 97, 101, 106
 fuser 75, 80, 84, 88, 316
 rear door 67
 Tray 1 47, 320
 Tray 2 60, 333
 Tray 3 40, 340

print bar error (PageWide)
62.WX.YZ error 5
printer memory error
20.WX.YZ error 4

R

real-time clock error
11.WX.YZ error 3
rear door
jams 67

S

scanner error
30.WX.YZ error 4
security error
33.WX.YZ error 4
sensor error
54.WX.YZ error 4
58.WX.YZ error 4
supplies error (LaserJet)
10.WX.YZ error 3
supplies error (PageWide)
17.WX.YZ error 4
system error (LaserJet)
62.WX.YZ error 5

T

Tray 1
jams 47, 320
Tray 2
jams 60, 333
Tray 3
jams 40, 340
tray motor error (LaserJet)
60.WX.YZ error 4