




HP Color LaserJet Enterprise M552, M553

HP Color LaserJet Managed E55040

HP Color LaserJet Enterprise MFP M577

HP Color LaserJet Managed MFP E57540

Control Panel Message Document (CPMD)

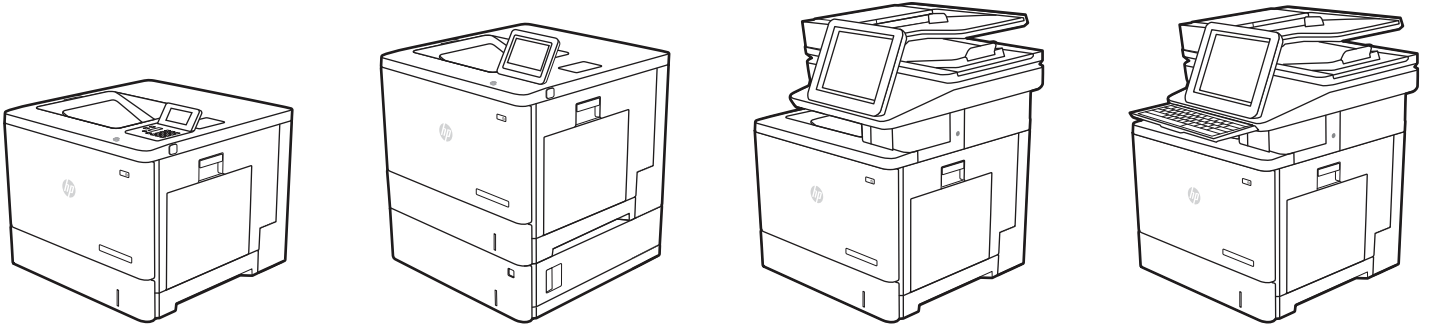

www.hp.com/support/colorlj552
www.hp.com/support/colorlj553
www.hp.com/colorljM577mfp

www.hp.com/colorljE55040
www.hp.com/colorljE57540mfp



HP Color LaserJet Enterprise, Managed M552, M553, M554, M555, E55040, MFP M577, M578, MFP E57540 - Control Panel Message Document (CPMD)

SUMMARY

This document provides error-code troubleshooting information

Legal information

Copyright and License

© Copyright 2022 HP Development Company, L.P.

Reproduction, adaptation, or translation without prior written permission is prohibited, except as allowed under the copyright laws.

The information contained herein is subject to change without notice.

The only warranties for HP products and services are set forth in the express warranty statements accompanying such products and services. Nothing herein should be construed as constituting an additional warranty. HP shall not be liable for technical or editorial errors or omissions contained herein.

Edition 10, 03/2025

Trademark Credits

Adobe®, Adobe Photoshop®, Acrobat®, and PostScript® are trademarks of Adobe Systems Incorporated.

Apple and the Apple logo are trademarks of Apple Inc., registered in the U.S. and other countries.

macOS is a trademark of Apple Inc., registered in the U.S. and other countries.

AirPrint is a trademark of Apple Inc., registered in the U.S. and other countries.

Google™ is a trademark of Google Inc.

Microsoft®, Windows®, and Windows Server® are U.S. registered trademarks of Microsoft Corporation.

UNIX® is a registered trademark of The Open Group.

Table of contents

1 Document last updated	1
2 About this document	2
3 Control-panel message types	3
Error-code and control-panel-message troubleshooting overview	3
Error codes (types and structure)	3
4 How to search for printer documentation	6
WISE - How to access and use	6
Accessing WISE	6
Using WISE to search for error codes	10
Using WISE to access repair and replace videos for FRUs	12
5 Printer service information	17
6 Numerical control panel messages	18
10.WX.YZ error messages	18
10.wx.yz error messages	18
10.0X.00 Supply memory error	19
10.0X.10 Supply memory error	20
10.0X.12 Supply memory error	20
10.0X.15 Install <supply>	21
10.0X.25 Wrong cartridge in <color> slot	21
10.0X.35 Incompatible <supply>	22
10.00.59	22
10.0X.60 <Supply> low	23
10.0X.69 <Supply> very low	23
10.0X.70 Printing past very low	23
10.0X.91 <supply> error	24
10.0X.92 <Cartridge> error	25
10.22.15 Install transfer unit	25
10.22.60 Transfer Kit low, 10.22.69 Transfer Kit very low	26
10.22.70 Transfer Kit Printing past very low	26
10.23.15 Install Fuser kit	27
10.23.60 Fuser Kit low	27
10.23.70 Replace Fuser Kit	27
10.31.60 Toner collection unit almost full	28
10.31.70 Replace Toner Collection Unit	28
10.39.60 Document feeder kit low	29
10.39.70 Document feeder kit very low	29
10.99.31 Non-HP supply in use	29
10.99.34 Used supply in use	30
10.99.40 Genuine HP supplies installed	30
10.99.41 Unsupported Supply in use	30

11.XX.YZ Error Messages.....	30
11.* errors.....	30
11.00.01 or 11.00.02 Internal clock error.....	31
13.WX.YZ error messages.....	34
13.* errors.....	34
13.00.00.....	40
13.00.EE.....	40
13.00.FF.....	40
13.A3.DX.....	41
13.A4.DX.....	45
13.A5.D5.....	48
13.Ax.FF.....	51
13.B2.Az Jam in Right door.....	52
13.B2.Dz Jam in Right Door.....	57
13.B2.FF Jam in Right door.....	64
13.B4.FF Jam in Right Door.....	69
13.B9.Az Fuser jam.....	70
13.B9.Bz Fuser jam.....	73
13.B9.Cz.....	76
13.B9.Dz.....	80
13.B9.FF.....	84
13.D3.Bz.....	87
13.D3.Dz.....	88
13.E5.FF.....	89
13.EA.FF.....	89
13.FF.EE.....	90
13.EE.FF.....	90
13.FF.FF.....	90
20.WX.YZ Error Messages.....	91
20.* errors.....	91
20.00.00 Insufficient memory <device>.....	91
21.00.00 Page Too ComplexEvent log error message 21.00.00.....	91
30.wx.yz error messages.....	92
30.* errors.....	92
30.01.01.....	92
30.01.08 Home position error.....	97
30.01.14 Scan system EEPROM error.....	101
30.01.41 Scanner error.....	102
30.01.43 SCB memory failure.....	105
30.01.44.....	107
30.01.45 Scanner error.....	110
30.01.46 Scanner Error.....	113
30.03.14.....	115
30.03.20.....	116
30.03.22 Scanner failure.....	117
30.03.23 Scanner failure.....	117
30.03.30 Scanner Failure.....	118
30.03.45 Scanner Error To continue turn off then on.....	119

31.wx.yz error messages.....	122
31.* errors	122
31.01.47 Document feeder not detected	122
31.03.14	124
31.03.20 Backside scanner not detected	124
31.03.22 Scanner calibration failure	127
31.03.30 Document feeder pick motor error	128
31.03.31 Document feeder motor stall	129
31.03.32	130
31.03.33 Backside scanner calibration area dirty	131
31.03.34 Background missing	132
31.13.00 Document feeder multi-pick error	132
31.13.01	151
31.13.02	170
31.13.13	189
31.13.14	191
32.WX.YX Error Messages	195
32.* errors	195
32.08.A1, 32.08.A2, 32.08.A3	196
32.1C.05	196
32.1C.06 (event code)	196
32.1C.07 (event code)	196
32.1C.08 (event code)	197
32.1C.09 (event code)	197
32.1C.0A (event code)	197
32.1C.0D (event code)	197
32.1C.11 (event code)	198
32.1C.13, 32.1C.14	198
32.1C.15	198
32.1C.2E	198
32.1C.2F	198
32.1C.40	199
32.1C.41	199
32.1C.42	199
32.1C.43	199
32.1C.44	199
32.1C.45	199
32.1C.46	200
32.1C.47	200
32.1C.48	200
32.1C.49	200
32.1C.4A	200
32.1C.56	201
32.1C.57	201
32.1C.58	201
32.1C.60	201
32.1C.61	201
32.1C.62	202

32.1C.68	202
32.1C.69	202
32.1C.6A	202
32.1C.6D	202
33.WX.YZ Error Messages	203
33.* errors	203
33.01.xx	204
33.02.01 Used board/disk installed	205
33.02.02	206
33.03.02	207
33.03.03 Incompatible formatter installed.....	207
33.03.05 EFI Boot error	209
33.03.06.....	211
33.04.01 Missing TPM.....	211
33.04.02 Missing TPM	211
33.04.03 Unknown TPM	212
33.04.05.....	212
33.04.15 TPM Authentication"	214
33.05.0z SureStart errors	217
33.05.1x Whitelisting errors	218
33.05.2x Intrusion detection errors	219
33.05.5z Intrusion detection errors	219
33.06.01.....	220
40.WX.YZ Error Messages	221
40.* errors	221
40.00.01 USB I/O buffer overflow To continue, touch "OK"	221
40.00.02 Embedded I/O buffer overflow To continue, touch "OK"	221
40.00.03 EIO [x] buffer overflow To continue, touch "OK"	222
40.00.04 EIO [x] bad transmission To continue, touch "OK"	222
40.00.05 Embedded I/O bad transmission To continue, touch OK	222
40.08.0x USB storage accessory removed	222
40.0x.05 USB storage accessory removed	222
40.80.04 Failed to read NVRAM.....	223
41.WX.YZ Error Messages	223
41.* errors	223
41.01.YZ	223
41.02.00 Error	226
41.03.FZ Unknown Misprint Error	226
41.03.YZ Unexpected size in tray <X>	227
41.04.YZ Printer Error	230
41.05.YZ Unexpected type in tray <X>.....	233
41.07.12 Press Exit to Continue	235
41.WX.YZ Error To continue, touch "OK"	240
42.WX.YZ Error Messages	244
42.* errors	244
44.WX.YZ Error Messages	245
44.* errors	245

44.01.xx Error Event log message	246
44.03.xx Error Event log message	246
44.10.xx Error Event log message (Multifunction product only.).....	246
44.34.xx Error Event log message	247
44.34.03 Fax Modem Failure	247
44.34.E5 Fax Modem Failure	247
44.90.xx, 44.91.xx, 44.92.xx Error Event log message	248
44.A0.YZ Error Event log message	248
46.WX.YZ Error Messages	249
46.* error messages	249
47.WX.YZ Error Messages	250
47.* errors	250
47.00.xx	250
47.01.xx	251
47.02.xx	251
47.03.xx	252
47.04.xx	252
47.05.xx	253
47.06.xx	253
47.FC.yz Printer Calibration Failed To continue, touch "OK"	254
48.WX.YZ Error Messages	255
48.* errors	255
49.WX.YZ Error Messages	256
49.XX.YY Error To continue turn off then on	256
49.38.07	258
50.WX.YZ Error Messages	258
50.* errors	258
50.1X.YZ	259
50.2X.YZ	261
50.3X.YZ	263
50.4X.YZ	265
50.6X.YZ	266
50.7X.YZ	268
50.8X.YZ	270
50.9X.YZ	272
50.AX.YZ	273
50.BX.YZ	275
51.WX.YZ Error Messages	277
51.* errors	277
51.00.YZ	278
52.WX.YZ Error Messages	279
52.* errors	279
52.00.00/52.00.20 Scanner Startup/Rotation error	279
53.WX.YZ Error Messages	280
53.B0.0z	280
53.B1.0z	281

53.B2.0z	281
53.B3.0z	282
53.C1.0z Tray "Z" size mismatch.	282
54.WX.YZ Error Messages	283
54.* errors.....	283
54.00.01 / 54.00.03 (event log only).....	284
54.00.06 or 54.00.14 or 54.00.19 (event log only)	284
54.01.05 (event log only).....	285
54.06.21 (event log only).....	286
54.14.00 (event log only).....	286
54.0B.YZ (event log only)	288
54.0C.0Z or 54.0D.0Z (event log only).....	289
54.0E.YZ (event log only).....	290
54.0F.YZ (event log only).....	291
54.0X.07 (event log only).....	292
54.0X.0B or 54.0X.0C or 54.0X.0D or 54.0X.0E (event log only).....	293
55.WX.YZ, 56.WX.YZ Error Messages.....	294
55.* errors.....	294
55.00.01, 55.00.03 or 55.00.04 DC Controller Error.....	295
55.00.05 Engine Firmware RFU Error	299
55.01.06, 55.02.06 DC controller error To continue turn off then on	299
56.* errors.....	303
56.00.YZ	303
56.00.01 Illegal Input Printer Error	303
57.WX.YZ Error Messages.....	303
57.* errors.....	303
57.00.01 Delivery Fan (FM3) failure.....	304
57.00.02 Cartridge fan (FM2) failure.....	306
57.00.03 Power supply fan (FM1) failure	308
57.00.04 Fuser Fan (FM4) failure.....	310
58.WX.YZ Error Messages.....	313
58.* errors.....	313
58.00.02 Error	313
58.00.03 Error	314
58.00.04 Error	316
58.01.04 Error	316
58.02.04 Error	317
59.WWX.YZ Error Messages	318
59.* errors	318
59.00.00 Motor error.....	318
59.00.04 Duplex Motor error	321
59.00.30 or 59.00.40: Fuser error	323
59.00.B0 Replace Toner Collection Unit	327
59.00.C0	327
59.00.F0	329
59.05.50 or 59.05.60	333
59.06.50 or 59.06.60 – 59.07.50 or 59.07.60.....	334

59.08.50 or 59.08.60.....	335
60.00.0Y, 62.00.0Y Error Messages.....	336
60.* errors.....	336
62.00.00 No system To continue turn off then on.....	337
70.WX.YZ Error Messages.....	338
70.* errors.....	338
70.00.00 Error To continue turn off then on	338
80.WX.YZ, 81.WX.YZ, 82.WX.YZ Error Messages	339
80.* errors.....	339
82.* errors.....	342
80.0X.YZ Embedded Jetdirect Error	344
81.WX.YZ EIO Error To continue turn off then on	346
81.09.00 Error	348
82.73.46, 82.73.47	349
90.WX.YZ error messages.....	350
90.* errors.....	350
90.15.00.....	350
90.15.01.....	350
98.0X.0Y Error Messages	351
98.* errors.....	351
98.00.01 or 98.01.00 Corrupt data in firmware volume	352
98.00.02 Corrupt data in the solutions volume	353
98.00.03 Corrupt data in the configuration volume	353
98.00.04 Corrupt data in the job data volume	354
99.WX.YZ Error Messages	354
99.* errors.....	354
99.00.01 Upgrade not performed file is corrupt	355
99.00.02 Upgrade not performed timeout during receive	355
99.00.03 Upgrade not performed error writing to disk	356
99.00.04 Upgrade not performed timeout during receive	356
99.00.05 Upgrade not performed timeout during receive	357
99.00.06 Upgrade not performed error reading upgrade	357
99.00.07 Upgrade not performed error reading upgrade	358
99.00.08 Upgrade not performed error reading upgrade	358
99.00.09 Upgrade canceled by user	359
99.00.10 Upgrade canceled by user	359
99.00.11 Upgrade canceled by user	359
99.00.12 Upgrade not performed the file is invalid	359
99.00.13 Upgrade not performed the file is invalid	360
99.00.14 Upgrade not performed the file is invalid	360
99.00.2x	360
99.01.xx	361
99.02.01	362
99.02.09	362
99.02.32 Downgrade error	362
99.07.YZ Firmware install error (MFP - fax only)	363
99.09.60 Unsupported disk	364

99.09.61 Unsupported disk	364
99.09.62 Unknown disk	364
99.09.63 Incorrect disk	365
99.09.64 Disk malfunction	366
99.09.65 Disk data error	367
99.09.66 No boot device.	367
99.09.67 Disk is not bootable please download firmware	367
99.39.64 eMMC Nonfunctional	369
99.39.67 eMMC Not Bootable	369

7 Alphabetical control panel messages.....370

Alphabetical messages	370
Authentication required.....	370
Calibration reset pending.....	370
Cartridge low <color>	370
Cartridge Memory Abnormal <color>	370
Cartridge out <color>	371
Cleaning disk <X> complete Do not power off	371
Clearing activity log	371
Close front door	371
Close lower right door	372
Close upper right door.....	372
Communication lost message appears on the control panel in five different languages	373
Gateways failed	374
Incompatible <Supply>	374
Incompatible supplies.....	375
Install fuser unit.....	375
Internal disk not functional.....	375
Load Tray <X>: [Type], [Size] To use another tray, press "OK"	376
Moving solenoid and motor	376
Moving solenoid To exit press	376
No USB drive or files found.....	377
Output Bin Full.....	383
Printing Demo Page	383
Remove toner cartridge.....	383
Replace <Supply>	383
Replace Supplies	384
Re-send external accessory firmware.....	384
RFU Load Error Send full RFU on <X> Port.....	384
Sanitizing disk <X> complete Do Not power off	385
Too many jobs in queue	385
Tray <X> [type] [size].....	385
Tray <X> lifting	385
Tray <X> open	385
Tray <X> overfilled	386
Tray <X> empty: [Type], [Size].....	387
Unsupported drive installed To continue, touch "OK"	387
Unsupported supply in use OR Unsupported supply installed To continue, touch "OK"	387
Used supply installed To continue, touch "OK"	388

Verifying, Please Wait.....	388
Index.....	389

1 Document last updated

The following is the last time this document was updated:

Last update: March 13, 2025

2 About this document

This document provides error-code troubleshooting information.



IMPORTANT: Procedures and part numbers change. For current information, use the browser-based format.

Verify PDF is the most current before use. PDF part numbers must be verified with web-based error code information or parts look-up before parts are ordered.

Choose the format that best meets your needs.

Table 2-1 Content format types

Format	Document title example	Recommended use
Web-based	Go to: Product Detail page > Error Code Look-up	Quick access to individual web-based error code troubleshooting TIP: Save Product Detail page URL location in favorites
Web-Base	Go To: WISE default Search page > Enter [Product] and error code	- Access to individual web-based error code troubleshooting - Web-based: Most up-to-date information available
PDF	[Product] - Control Panel Message Document (CPMD) PDF	- Use when support portals are NOT accessible at time of service - Use when a printable document is needed NOTE: Always refer to the printer service manual for removal and replacement procedures NOTE: For current information, use the Web-based format.

3 Control-panel message types

The control-panel messages and event code entries indicate the current printer status or situations that might require action.



NOTE: Event log errors do not appear on the control-panel display. Open the event log to view or print the event log errors.

A control-panel message displays temporarily and might require you (or the applicable user) to acknowledge the message by touching the **OK** button to resume printing or by touching the **Stop** button to cancel the job.

With certain messages, the job might not finish printing, or the print quality might be affected. If the message is related to printing and the auto-continue feature is on, the printer will attempt to resume printing after the message has appeared for 10 seconds without acknowledgement.

For some messages, restarting the printer might fix the problem. If a critical error persists, the printer might require service.

Error-code and control-panel-message troubleshooting overview

This section provides information on error codes and searching for information.

Error codes (types and structure)

Error codes and control-panel messages display on the printer control panel to indicate the current printer status or situations that might require action. Error codes are numerical, or alphanumerical, and have a set structure with six characters (example: 13.WX.YZ).

- The first two characters are numeric and represent the system component that is causing the error. For example, in error code 10 . 22 . 15, **10** = **Supplies** for HP LaserJets.
- The remaining four characters (W, X, Y, and Z values) further define the error.

HP LaserJet and HP PageWide Enterprise error codes are documented in the control panel message document (CPMD) for each printer.

The CPMD is a comprehensive list of error codes, diagnostic and troubleshooting steps to clear or resolve the error, and other helpful information such as service mode pins and part numbers.

The CPMD is continually updated and republished with the latest information for the following error codes.

Table 3-1 ERROR CODES: The first two characters

Error code	System Component	System Error Description
10.WX.YZ	Supplies (LaserJet)	Supply error or supply memory error.
11.WX.YZ	Real-time clock	Internal error with the clock on the formatter.
13.WX.YZ	Jam (LaserJet)	Paper jam or open door jam error.

Table 3-1 ERROR CODES: The first two characters (continued)

Error code	System Component	System Error Description
15.WX.YZ	Jam (PageWide)	Paper jam or open door jam error.
17.WX.YZ	Supplies (PageWide)	Supply error or supply memory error.
20.WX.YZ	Printer memory	Insufficient memory or buffering error.
21.WX.YZ	Page	Page complexity causing a decompression error when trying to process job.
30.WX.YZ	Scanner	Flatbed scanner error occurring inside the unit.
31.WX.YZ	Document feeder	Document feeder, scanner, or jam error.
32.WX.YZ	Backup, restore, or reset	Backup, restore, or reset notification or error.
33.WX.YZ	Security	Backup, Disk, EFI BIOS, Firmware integrity (SureStart), or Trusted Platform Module (TPM) notification or error.
40.WX.YZ	Input/Output (I/O)	Partition manager, secure erase, or USB accessory error.
41.WX.YZ	Fuser, Laser scanner, or Paper path	Miscellaneous error including general and misprint or mismatch errors typically involving (but not limited to) the fuser, the laser scanner, or the paper path.
42.WX.YZ	Firmware	Firmware failure involving the Event Log, Shell, System Manager, or other component.
44.WX.YZ	Firmware	Firmware failure involving a digital sending component.
45.WX.YZ	OXPd/Web Kit (PageWide)	Informational notifications involving the OXPd Web Kit (communications log).
46.WX.YZ	Engine (LaserJet)	Engine communication error.
47.WX.YZ	Firmware	Job parser or printer calibration error.
48.WX.YZ	Firmware	PJA job accounting, job management, or job pipeline error.
49.WX.YZ	Firmware	Firmware communication error.
50.WX.YZ	Fuser (LaserJet)	Fuser error.
51.WX.YZ	Laser scanner (LaserJet)	Laser scanner beam error.
52.WX.YZ	Laser scanner (LaserJet)	Laser scanner startup error.
54.WX.YZ	Sensor	Sensor error (not jam related).
55.WX.YZ	DC controller (LaserJet)	DC controller communication error.
56.WX.YZ	Paper handling (LaserJet)	Paper input/output or accessory error.
57.WX.YZ	Fan	Fan error.
58.WX.YZ	Sensor	Engine sensor failure.
59.WX.YZ	Motor (LaserJet)	Motor error.
60.WX.YZ	Tray motor error (LaserJet)	Tray lifting or pick up error.
61.WX.YZ	Engine (PageWide)	Print engine error with the 8-bit data package.

Table 3-1 ERROR CODES: The first two characters (continued)

Error code	System Component	System Error Description
62.WX.YZ	System (LaserJet)	LaserJet internal system error.
	Print bar (PageWide)	PageWide print system error.
63.WX.YZ	Engine (LaserJet)	General engine error (electrical, communication, etc.).
65.WX.YZ	Connector	Output accessory connection error.
66.WX.YZ	Output accessory	Output accessory error.
67.WX.YZ	Input accessory	Input accessory connection error
69.WX.YZ	Duplexer	Duplexer error.
70.WX.YZ	DC controller (LaserJet)	DC controller firmware error.
76.WX.YZ	DC controller (LaserJet)	Power supply fluctuations causes formatter and DC controller communication issue and results them not to be in synchronization.
80.WX.YZ	Managed device	Embedded Jetdirect error.
81.WX.YZ	Near Field Communication (NFC)	Wireless, Bluetooth or internal EIO error.
82.WX.YZ	Memory (hard disk, EMMC, etc.)	Disk hardware error.
90.WX.YZ	Internal diagnostics	Internal test of systems (i.e. disk, CPB, display) or interconnection error.
98.WX.YZ	Hard disk	Hard disk partition error.
99.WX.YZ	Firmware installer	Remote Firmware Upgrade (RFU), firmware install (engine or accessory), or disk error.

4 How to search for printer documentation

The CPMD, error codes, and other support documentation for each printer is available on the HP portals.

For HP internal access to WISE, go to [WISE](#).

For HP channel partners access WISE, see [Accessing WISE for HP channel partners \(HP Partner Portal\) on page 6](#) or [Accessing WISE for HP channel partners \(CSDP\)](#).

WISE is available to call agents, service technicians, and HP internal users. The level of detail available depends on your access credentials. To learn how to find support content in WISE, [watch the video here](#).

WISE - How to access and use

Learn how to access and use Web-based Interactive Search Engines (WISE) to locate available support information. WISE is a repository of technical support documentation including service manuals, user guides, videos, and general support information.

Accessing WISE

Learn how to access Web-based Interactive Search Engines (WISE) if you are an HP channel partner or an internal HP user.

Accessing WISE for HP channel partners (HP Partner Portal)


Learn how to access WISE by accessing the HP Partner Portal if you are an HP Channel Partner.

 **NOTE:** If this is your first visit to the HP Partner Portal, you will be asked to create an account. Follow the setup directions using your HP Partner credentials.

 [View a video of how to access WISE for HP channel partners](#)


1. Sign-in to the HP Partner Portal (click <https://partner.hp.com> to access the sign-in page).

Figure 4-1 HP Partner Portal sign-in page

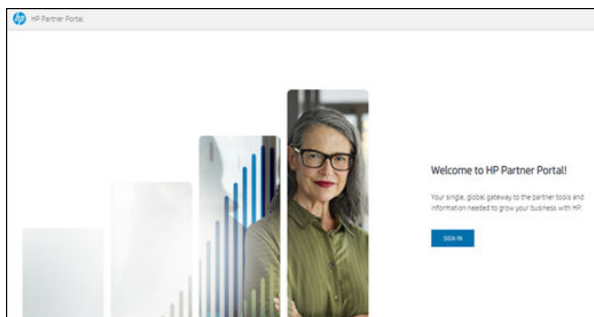


2. On the HP Partner Portal home page, click the **Services & Support** item.

Figure 4-2 HP Partner Portal home page

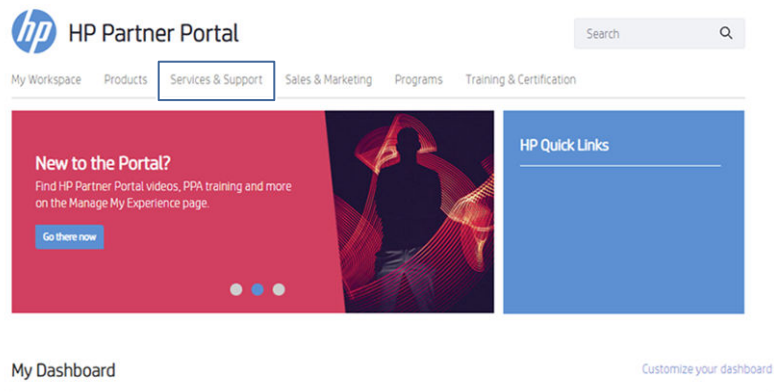


3. Select the **Technical Support (WISE)** item.

Figure 4-3 HP Partner Portal Service & Support page

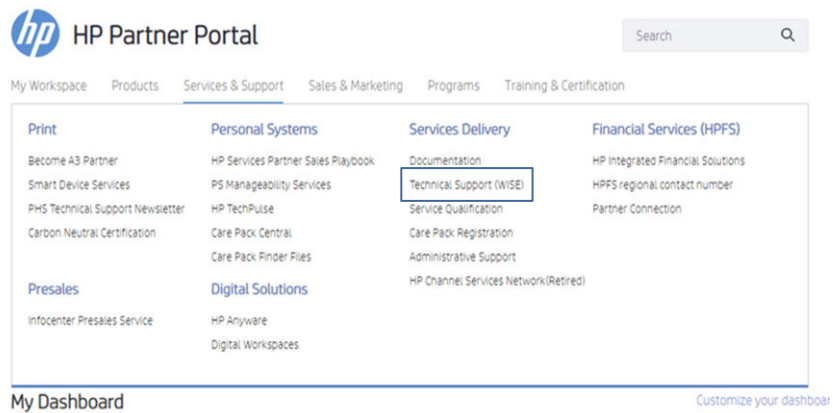


4. Select the **Technical Documentation** item.

Figure 4-4 HP Partner Portal Technical Support (WISE)page

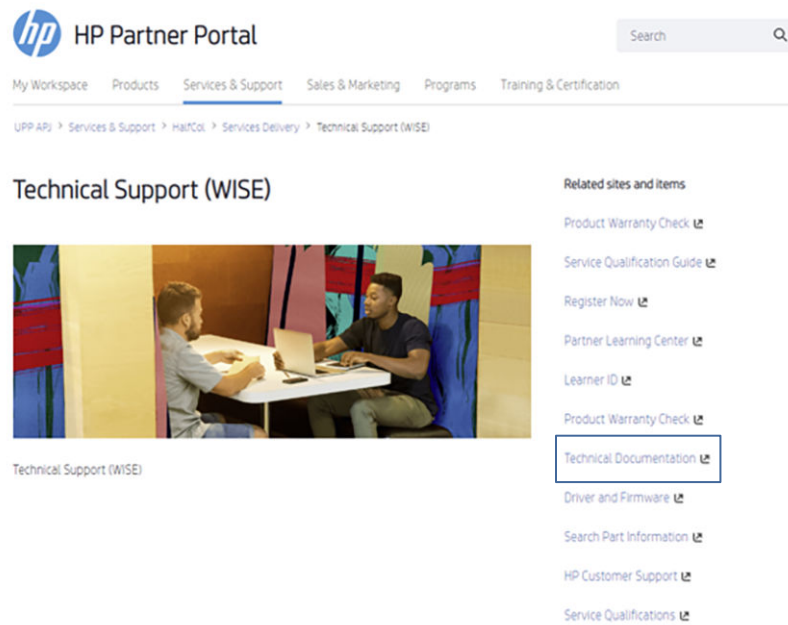

5. Use the WISE portal to search for printer information.

Figure 4-5 WISE portal home page

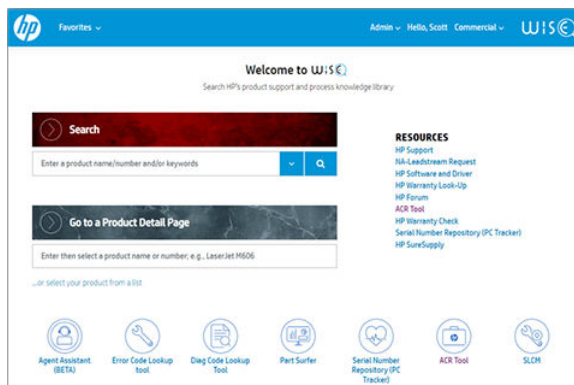

Accessing WISE for internal HP users

Learn how to access WISE if you are an internal HP user.

1. Open one of the Web-based Interactive Search Engines (WISE) URLs listed below.

Americas (AMS)

- [WISE - English](#)
- [WISE - Spanish](#)
- [WISE - Portuguese](#)
- [WISE - French](#)

Asia Pacific / Japan (APJ)


- [WISE - English](#)
- [WISE - Japanese](#)
- [WISE - Korean](#)
- [WISE - Chinese \(simplified\)](#)
- [WISE - Chinese \(traditional\)](#)
- [WISE - Thai](#)

Europe / Middle East / Africa (EMEA)


- [WISE - English](#)

2. Select **Commercial** from the drop-down menu.

Figure 4-6 Choose an experience

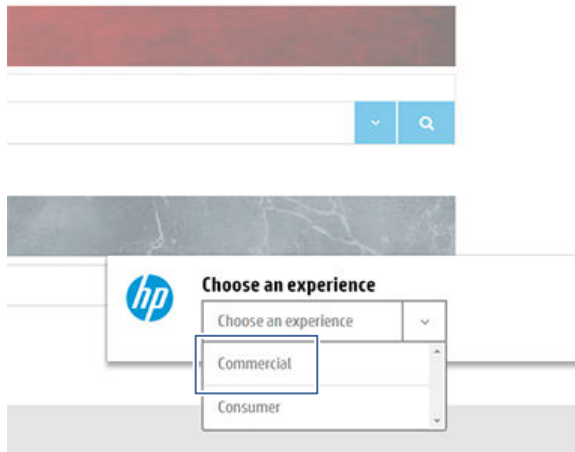

3. The WISE home page appears.

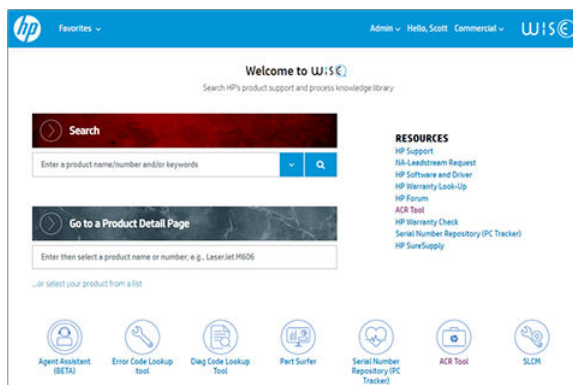

Play the video:



[View a video of how access WISE \(internal HP users\)](#)

Using WISE to search for error codes

Learn how to use WISE to look up error codes.



NOTE: The model used in the instructional videos is an example. The same steps apply to all printer models.

You will need the printer type (e.g. HP LaserJet), model number (e.g. M607), and bundle option (e.g. dn, dh, z).

Search for error codes using the lookup widget

Learn how to search for a specific error code using the WISE Error Code Lookup widget.

1. Enter a printer model number (for example, M606) in the **Go to a Product Detail page** dialog box.



TIP: To find a Product Detail Page (PDP) from a list of products by product type, select the **...or select your product from a list** item just below the dialog box.

2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.



NOTE: Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

3. Type the error code (for example, 13.E1.D3) in the **Error Code Lookup** field, and then select the search icon.

Error Code Lookup

Enter a specific error code in the field below, e.g. 13.b7 d7

1 2

Other Content

- Advisories (0)
- Bulletins (21)
- Guides, Manuals, etc. (76)
- Notices (1)
- Product Change Not... (0)
- Software-Drivers-F...
- Top Issues (7)
- Videos (127)

4. The error code troubleshooting content displays in the **All Search Results** area.

All Search Results

13.E1.D3 Fuser Area Jam
Last Modified Date: "2022/03/11"
ish_1686515-1408419-16
Public

Click on the article to see the full content.

Recommended action for customers

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size...

13.* errors
Last Modified Date: "2022/11/30"
ish_1690706-842345-16
Public

Click on the article to see the full content.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open....

HP LaserJet Enterprise M607, M608, M608nk, M609, M610, M611, M612, HP LaserJet Managed E60055-E60075, E60155-E60175 printers - Control Panel Messages Document (CPMD)
Last Modified Date: "2022/11/22"
pdf_3366820_en-US-6
For HP And Channel Partner Internal Use

Play the video:



[View a video of how to search for error codes using the Product Detail Page \(PDP\) or the Error Code Lookup tool.](#)

Search for error codes from the WISE home page

Learn how to search for a specific error code from the WISE home page.

1. On the WISE home page, enter a printer model number (for example, M606) in the **Search** dialog box.

Search

Enter a product name/number and/or keywords

Go to a Product Detail Page


Enter then select a product name or number; e.g., LaserJet M606

...or select your product from a list

2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.




NOTE: Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

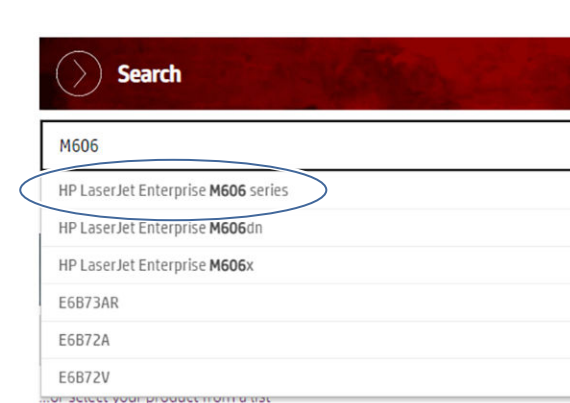

3. Type the error code (for example, 13.E1.D3) in the **Search** keyword field, and then select the search icon.



4. The error code troubleshooting content displays in the **All Search Results** area.

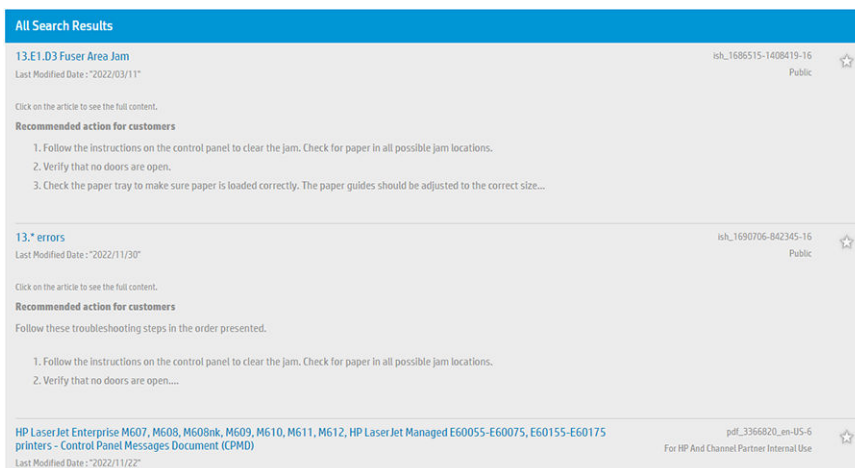

Using WISE to access repair and replace videos for FRUs

Learn how to use WISE to access repair and replace videos for FRUs.



NOTE: The model used in the instructional videos is an example. The same steps apply to all printer models.


You will need the printer type (e.g. HP LaserJet), model number (e.g. M607), and bundle option (e.g. dn, dh, z).

Search for videos using the Product Detail Page (PDP)

Learn how to search WISE for product specific information. Quickly review the steps and then play the video.


1. Enter a printer model number (for example, M606) in the **Go to a Product Detail page** dialog box.

 **TIP:** To find a Product Detail Page (PDP) from a list of products by product type, select the **...or select your product from a list** item just below the dialog box.

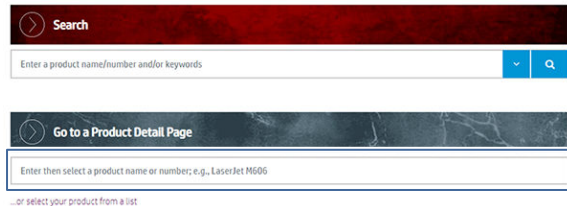


2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.

 **NOTE:** Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

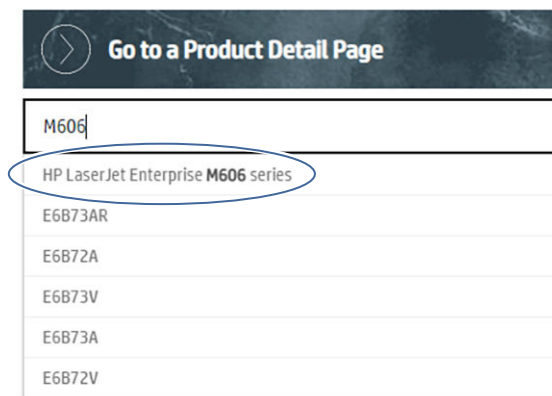


3. Select the link to **Videos** in the **Other Content** menu at the bottom-right of the screen.

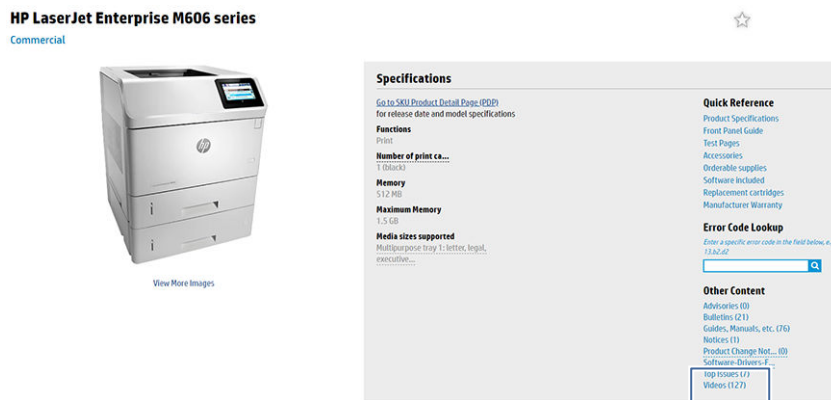

4. Select the desired video from the list of videos.



TIP: Select the **Add Or Remove Hardware & Customer Self Repair** filter under **Troubleshooting** to limit the search results to repair and replace videos.

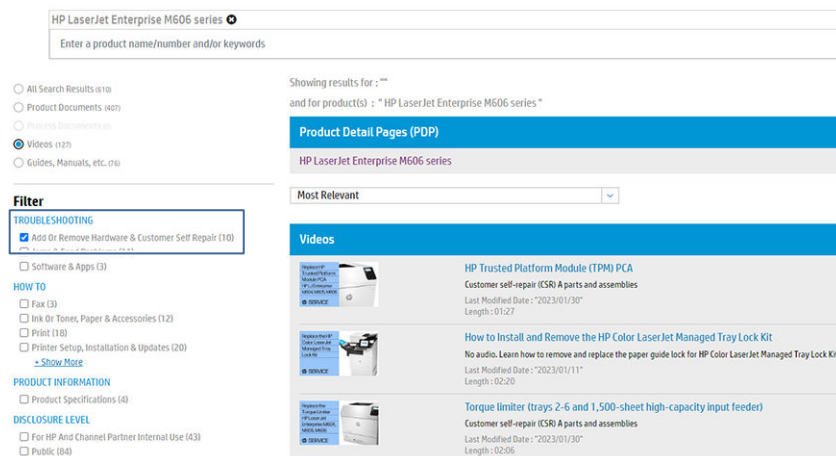

Play the video:




[View a video of how to search for the printer's Product Detail Page \(PDP\)](#)

Search for videos using the WISE search function


Learn how to search WISE using the model number. Quickly review the steps and then play the video.

1. On the WISE home page, enter a printer model number (for example, M606) in the **Search** dialog box.

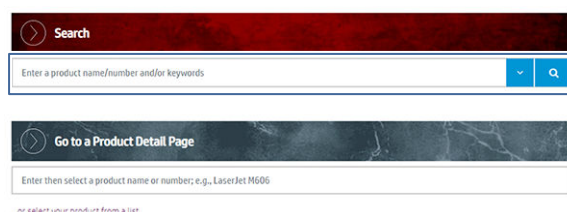


2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.


 **NOTE:** Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

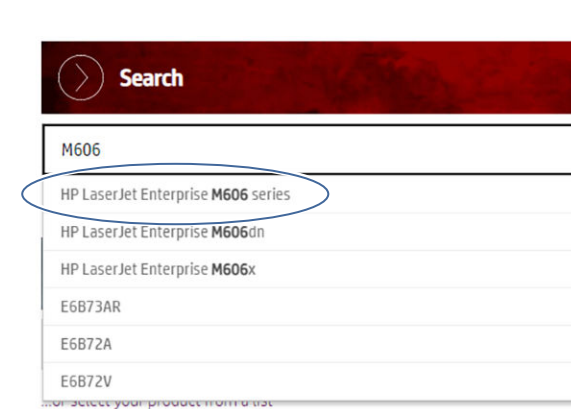

3. Select the search icon.

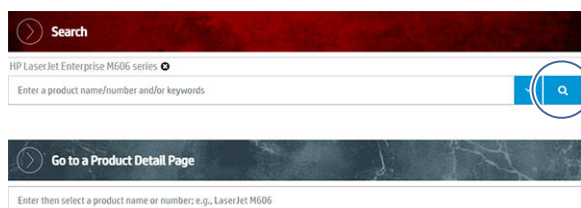

4. To refine the search results, select the radio button labeled **Videos** in the upper-right portion of the screen.

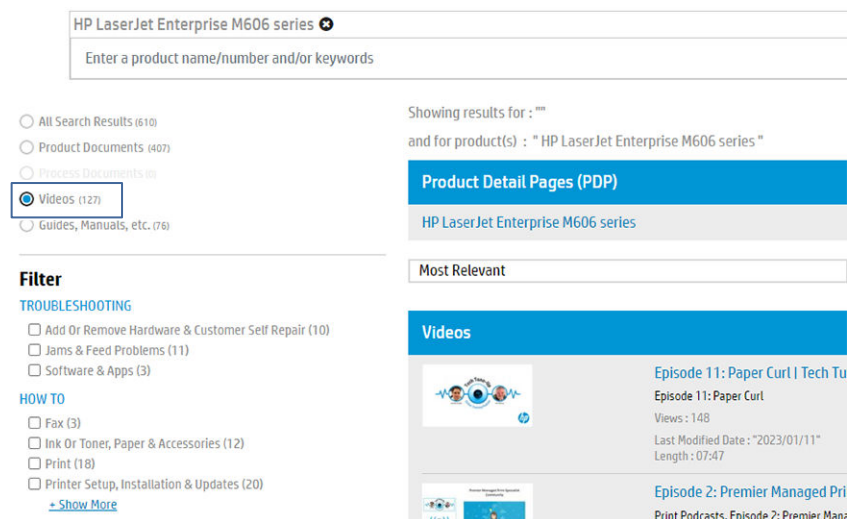

 **TIP:** To refine video search results, type a part name in the keyword search bar, and then select the search icon. For example, entering the word **fuser** to the keyword search bar returns videos related to repair and replacement of the fuser.

HP LaserJet Enterprise M606 series

Fuser

All Search Results (34)

Product Documents (28)

Process Documents (3)

Videos (2)

Guides, Manuals, etc. (4)

Filter

TRUBLESHOOTING

☐ Add Or Remove Hardware & Customer Self Repair (1)
 ☐ Jams & Feed Problems (1)

DISCLOSURE LEVEL

☐ Public (2)

Showing results for: "fuser"

and for product(s) : "HP LaserJet Enterprise M606 series"

Product Detail Pages (PDP)

HP LaserJet Enterprise M606 series

Most Relevant

Videos

Paper Jams

HP LaserJet Enterprise M606 series

HOW TO

Clear paper jams in the fuser area

Clear paper jams

Last Modified Date : "2022/08/03"

Length : 01:51

Replace the Fuser

HP LaserJet Enterprise M606 series

Service

Fuser

No audio. Customer self-repair (CSR) A parts and assemblies.

Last Modified Date : "2022/08/03"

Length : 01:54

Play the video:

[View a video of how to perform a model number search](#)

16 Chapter 4 How to search for printer documentation

5 Printer service information

Service pin for printer

Last update: March 13, 2025

Service mode PIN numbers:

- M552: 04055215
- M553: 04055315
- M577: 11057715
- M554: 10055420
- M555: 10055520
- M578: 10057820



NOTE: When possible, always update the printer firmware to the latest available version at [HP.com](https://www.hp.com) as part of the troubleshooting performed for any of the following errors.

6 Numerical control panel messages

Use the following numerical error message troubleshooting to resolve your issue.

10.WX.YZ error messages

10.wx.yz error messages

Errors in the 10.* family are related to toner cartridges and other supply items that require regular replacement as part of routine printer maintenance.

Order replacement supplies and install them as necessary. To order parts, go to <https://www.hp.com/buy/parts>.

Use the following list to identify the supply item affected:



NOTE: Not all printers have all of these supplies.

- 10.00.XX = Black toner cartridge
- 10.01.XX = Cyan toner cartridge
- 10.02.XX = Magenta toner cartridge
- 10.03.XX = Yellow toner cartridge
- 10.10.XX = Transfer roller
- 10.22.XX = Transfer Belt
- 10.23.XX = Fuser kit
- 10.31.XX = Toner collection unit
- 10.39.XX = Document feeder kit
- 10.99.XX = One or more supply items have been installed

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

To order parts, go to <https://www.hp.com/buy/parts>.

1. For toner cartridges:
 - a. Remove and reinstall the cartridge.

3. Reinstall the toner cartridge.
4. Close the front door.
5. If the message displays again, turn the printer off, then on again.
6. If the error persists, replace the toner cartridge.

10.0x.10 Supply memory error

The printer is unable to read the toner cartridge data. The toner cartridge is present but defective.

When this error occurs, a question mark appears on the gas gauge of the supply or supplies with the error.

If multiple supplies have this error, a 10.0X.10 error for the first supply detected with the error displays. After the user resolves the error that corresponds to the first supply, another 10.0X.Y0 error displays for the next supply. This continues for all supplies memory errors.

- **10.00.10** Black toner cartridge
- **10.01.10** Cyan toner cartridge
- **10.02.10** Magenta toner cartridge
- **10.03.10** Yellow toner cartridge

Recommended action

Follow these troubleshooting steps in the order presented.

1. Open the front door and remove the toner cartridge.
2. Check the supplies memory chip. If it is damaged, replace the toner cartridge.
3. Reinstall the toner cartridge.
4. Close the front door. If the message reappears, turn the printer off, and then on.
5. If the error persists, replace the toner cartridge.

10.0x.12 Supply memory error

The printer is unable to read the toner cartridge data. The toner cartridge is present but defective.

When this error occurs, a question mark appears on the gas gauge of the supply or supplies with the error.

If multiple supplies have this error, a 10.0X.12 error for the first supply detected with the error displays. After the user resolves the error that corresponds to the first supply, another 10.0X.Y0 error displays for the next supply. This continues for all supplies memory errors.

- **10.00.12** Black toner cartridge
- **10.01.12** Cyan toner cartridge
- **10.02.12** Magenta toner cartridge
- **10.03.12** Yellow toner cartridge

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the front door and remove the toner cartridge.
2. Check the electronic chip on the cartridge if it is visible. If the chip is damaged, replace the toner cartridge.
3. Reinstall the toner cartridge.
4. Close the front door. If the message reappears, turn the printer off, and then on.
5. If the error persists, replace the toner cartridge.
6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agent and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the front door and remove the toner cartridge.
2. Check the electronic chip on the cartridge if it is visible. If the chip is damaged, replace the toner cartridge.
3. Reinstall the toner cartridge.
4. Close the front door. If the message reappears, turn the printer off, and then on.
5. If the error persists, replace the toner cartridge.

10 . 0x . 15 Install <supply>

A supply is either not installed or not correctly installed in the printer.

The 10.XX.15 is an event log only message, it will not show on the control panel. The only message to display will be **Install <Supply>**.

- **10.00.15** Black toner cartridge
- **10.01.15** Cyan toner cartridge
- **10.02.15** Magenta toner cartridge
- **10.03.15** Yellow toner cartridge

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace or reinstall the toner cartridge correctly to continue printing.

10 . 0x . 25 Wrong cartridge in <color> slot

The printer displays this message when a toner cartridge is installed in the wrong slot.

The 10.XX.25 is an event log only message, it will not show on the control panel. The only message to display will be **Wrong cartridge in <color> slot**.

The indicated cartridge is installed in the wrong position:

- **10.00.25** Black toner cartridge (event code)
- **10.01.25** Cyan toner cartridge (event code)
- **10.02.25** Magenta toner cartridge (event code)
- **10.03.25** Yellow toner cartridge (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

- Reinstall the toner cartridges in the correct slots.

From left to right, the toner cartridges should be installed in this order:

- Yellow
- Magenta
- Cyan
- Black

10 . 0x . 35 Incompatible <supply>

The printer displays this message when the indicated supply is not compatible with this printer.

The 10.XX.35 is an event log only message, it will not show on the control panel. The only message to display will be **Incompatible <supply>**.

- **10.00.35** Black toner cartridge (event code)
- **10.01.35** Cyan toner cartridge (event code)
- **10.02.35** Magenta toner cartridge (event code)
- **10.03.35** Yellow toner cartridge (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

- Install a supply that is designed for this printer.

10 . 00 . 59

Black cartridge has been replaced with non-new cartridge

This is an **Event Log Only** message.

Recommended action

There is no action needed for this message.

- No action necessary.

10 . 0x . 60 <Supply> low

The printer indicates when a supply level is low. Actual toner cartridge life might vary. You do not need to replace the toner cartridge at this time unless print quality is no longer acceptable.

The 10.XX.60 is an event log only message, it will not show on the control panel. The only message to display will be **<Supply> low**.

- **10.00.60** Black toner cartridge (event code)
- **10.01.60** Cyan toner cartridge (event code)
- **10.02.60** Magenta toner cartridge (event code)
- **10.03.60** Yellow toner cartridge (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

- If the print quality is no longer acceptable, replace the toner cartridge.



NOTE: Advise the customer that HP recommends that they have replacement supplies available to install when the print quality is no longer acceptable.

10 . 0x . 69 <Supply> very low

The printer indicates when a supply level is very low. Actual toner cartridge life might vary. You do not need to replace the toner cartridge at this time unless the print quality is no longer acceptable.

The 10.XX.69 is an event log only message, it will not show on the control panel. The only message to display will be **<Supply> very low**.

- **10.00.69** Black toner cartridge very low (event code)
- **10.01.69** Cyan toner cartridge very low (event code)
- **10.02.69** Magenta toner cartridge very low (event code)
- **10.03.69** Yellow toner cartridge very low (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

- If the print quality is no longer acceptable, replace the toner cartridge.



NOTE: Advise the customer that HP recommends that they have replacement supplies available to install when the print quality is no longer acceptable.

10 . 0x . 70 Printing past very low

The printer indicates when one of the supplies is very low. The actual remaining supply life might vary. You do not need to replace the toner cartridge at this time unless the print quality is no longer acceptable.

The 10.XX.70 is an event log only message, it will not show on the control panel. The only message to display will be a warning message **<Supply> very low**.

- **10.00.70** Black toner cartridge (event code)
- **10.01.70** Cyan toner cartridge (event code)
- **10.02.70** Magenta toner cartridge (event code)
- **10.03.70** Yellow toner cartridge (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

- If the print quality is no longer acceptable, the customer must order and pay for a new toner cartridge.



NOTE: Advise the customer that HP recommends that they have replacement supplies available to install when the print quality is no longer acceptable.

10.0x.91 <supply> error

Toner cartridge motor stall.

- **10.00.91** Black toner cartridge
- **10.01.91** Cyan toner cartridge
- **10.02.91** Magenta toner cartridge
- **10.03.91** Yellow toner cartridge

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error is present, remove the toner cartridges and turn the printer off, and then on.
3. If the error persists with the toner cartridges out, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.
4. If the error is not present with the toner cartridges out, replace the cartridges one by one and observe the printer to see which toner cartridges causes the error. Replace the failing toner cartridge.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Check the event log for occurrences of 59.05.YZ, 59.06.YZ or 59.08.YZ errors. If these are seen troubleshooting that error.
2. Perform the image-drum motors component test under the [Troubleshooting menu](#).
3. If one of the motors fails the test, replace the motor.

Part number: RM2-0078-000CN

If the motors test good, replace the toner cartridge.

10 . 0x . 92 <Cartridge> error

Toner cartridges are not engaged.

- **10.00.92** Black toner cartridge
- **10.01.92** Cyan toner cartridge
- **10.02.92** Magenta toner cartridge
- **10.03.92** Yellow toner cartridge

Recommended action

Follow these troubleshooting steps in the order presented.

1. Open the front door, and then remove and reinstall the toner cartridge.
2. Check the toner cartridge for any damage or defects.
3. Replace the toner cartridge.

10 . 22 . 15 Install transfer unit

The transfer unit has been removed or is installed incorrectly.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Install the transfer unit. If already installed, remove the transfer unit and then reinstall it.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Install the transfer unit. If already installed, remove the transfer unit and then reinstall it.
2. If the printer could not find the ITB contact alienation home position, check the ITB alienation sensor SR5.
3. Open the Component Test menu and use the ITB Contact/Alienation test to verify that the ITB alienation mechanism is functioning correctly. If it is not, replace the fuser drive assembly.



NOTE: Replacing the fuser drive assembly involves removing the main drive assembly. Only perform this step after contacting HP support.

Part number:

Table 6-1 Part numbers

Description	HP Part Number
Fuser drive assembly (M553n)	RM2-0091-000CN
Fuser drive assembly (M552dn, M553dn, M553x, M577)	RM2-0009-000CN

4. Check and reconnect the connector (J15) of the T1 roller alienation sensor, connectors (J2504 and J2502) on the high-voltage power supply -T PCA, and connector (J131) on the DC controller PCA.

10 . 22 . 60 Transfer Kit low, 10 . 22 . 69 Transfer Kit very low

The printer indicates when a supply level is low or very low.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. If the print quality is no longer acceptable, the customer (at a minimum) must order and pay for a replacement intermediate transfer belt (ITB). However, HP recommends that the customer order and install the intermediate transfer belt kit at this time.

Part number: B5L24-67901



NOTE: HP recommends that they have replacement supplies available to install when the print quality is no longer acceptable.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

- Replace the ITB kit when print quality becomes unacceptable.

For instructions: See the Repair Service Manual for this product.

Part number: RM2-6576-000CN

10 . 22 . 70 Transfer Kit Printing past very low

The printer indicates when a supply level is very low.

The 10.WX.70 is an event log only message, it will not show on the control panel. The only message to display will be a warning message **<Supply> very low**.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. If the print quality is no longer acceptable, the customer (at a minimum) must order and pay for a replacement intermediate transfer belt (ITB). However, HP recommends that the customer order and install the intermediate transfer belt kit at this time.

Part number: B5L24-67901



NOTE: HP recommends that they have replacement supplies available to install when the print quality is no longer acceptable.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

- If the print quality is no longer acceptable, the customer (at a minimum) must order and pay for a replacement intermediate transfer belt (ITB). However, HP recommends that the customer order and install the intermediate transfer belt kit at this time.

For instructions: See the Repair Service Manual for this product.

Part number: RM2-6576-000CN



NOTE: Advise the customer that HP recommends that they have replacement supplies available to install when the print quality is no longer acceptable.

10 . 23 . 15 Install Fuser kit

The fuser is either not installed, or not correctly installed in the printer.

Recommended action

Follow these troubleshooting steps in the order presented.

- Remove, and then reinstall the fuser. Ensure that the fuser is fully seated.



CAUTION: The fuser might be hot.

10 . 23 . 60 Fuser Kit low

The printer indicates when a supply level is low.

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the fuser kit.

Table 6-2 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.



NOTE: After replacing the fuser kit, reset the fuser page counter by selecting the [New Fuser Kit](#) in the [Reset Supplies](#) menu.

10 . 23 . 70 Replace Fuser Kit

The 10.WX.70 is an event log only message, it will not show on the control panel. The only message to display will be a warning message **<Supply> very low**.

The printer indicates when the fuser kit is at its estimated end of life. The actual life remaining might be different than the estimation.

The fuser kit does not need to be replaced now unless the print quality is no longer acceptable.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If the print quality is no longer acceptable, the customer must order and pay for a replacement fuser kit.

For instructions: *Removal and replacement: Fuser*

Table 6-3 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.

 **CAUTION:** The fuser might be hot.

 **NOTE:** HP recommends that they have replacement supplies available to install when the print quality is no longer acceptable.

2. Open the right door.
3. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.
4. Install the replacement fuser.
5. Close the right door.

10 . 31 . 60 Toner collection unit almost full

The toner collection unit is almost full.

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the toner collection unit.

Part number: B5L37-67901

10 . 31 . 70 Replace Toner Collection Unit

The 10.WX.70 is an event log only message, it will not show on the control panel. The only message to display will be a warning message **<Supply> very low**.

The printer indicates when the toner collection unit is at its estimated end of life.

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the toner collection unit.

Part number: B5L37-67901



NOTE: Printing past the **Replace Toner Collection Unit** message is not a recommended option because of the risk of overfilling the toner collection unit, which could result in the need to service the printer.

10 . 39 . 60 Document feeder kit low

The printer indicates when a supply level is low.

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the document feeder kit.

10 . 39 . 70 Document feeder kit very low

The 10.WX.70 is an event log only message, it will not show on the control panel. The only message to display will be a warning message **<Supply> very low**.

The printer indicates when the document feeder maintenance kit is very low. The actual remaining document feeder maintenance kit life might vary.

Recommended action

Follow these troubleshooting steps in the order presented.

- The customer must order and pay for a replacement document feeder maintenance kit.



NOTE: After replacing the document feeder maintenance kit, reset the maintenance kit page counter by selecting **New Document Feeder Kit** in the **Manage Supplies** sub-menu.

10 . 99 . 31 Non-HP supply in use

The printer displays this message when a used supply (a remanufactured or refilled genuine HP or non-HP supply) has been installed.

The 10.99.31 is an event log only message, it will not show on the control panel. The only message to display will be **Used supply in use** message.

Recommended action

Follow these troubleshooting steps in the order presented.

- The toner cartridge has been previously used. Touch the **OK** button to continue.



NOTE: Removing a cartridge from one printer and then installing it in a different printer (for testing functionality) will cause this event code.



NOTE: If it is believed the customer purchased a genuine HP supply, go to www.hp.com/go/anticounterfeit.

10 . 99 . 34 Used supply in use

The printer displays this message when a used supply (a remanufactured or refilled genuine HP or non-HP supply) has been installed.

The 10.99.34 is an event log only message, it will not show on the control panel. The only message to display will be **Used supply in use**.

Recommended action

Follow these troubleshooting steps in the order presented.

- The toner cartridge has been previously used. Touch the **OK** button to continue.



NOTE: Removing a cartridge from one printer and then installing it in a different printer (for testing functionality) will cause this event code.



NOTE: If it is believed the customer purchased a genuine HP supply, go to www.hp.com/go/anticounterfeit.

10 . 99 . 40 Genuine HP supplies installed

The printer displays this message when a new cartridge has been installed and all cartridges are Genuine HP.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to continue.

10 . 99 . 41 Unsupported Supply in use

The indicated toner cartridge is for a different printer.

Recommended action

Follow these troubleshooting steps in the order presented.

- Remove the indicated toner cartridge, and then install the correct cartridge for this printer.

11.XX.YZ Error Messages

11.* errors

Errors in the 11.* family are related to the printer real-time clock.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Set the time and date on the printer control panel.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Set the time and date on the printer control panel.
2. If the error persists, remove and reinstall the formatter. Make sure it is fully seated.
3. If the error still persists, replace the formatter.

11.00.01 or 11.00.02 Internal clock error

The printer real time clock has experienced an error.

01=dead clock


02=dead real time clock

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Set the time and date on the control panel.

Go to **Settings > General > Date/Time Settings > Date/Time** and adjust the settings appropriate for the printer location.

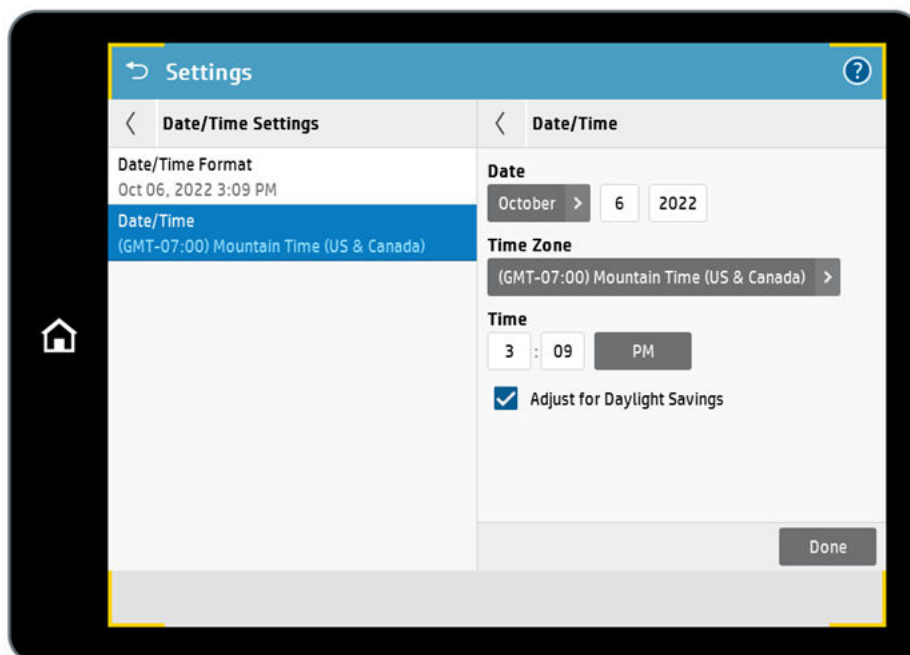


3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Set the time and date on the control panel.

Go to **Settings > General > Date/Time Settings > Date/Time** and adjust the settings appropriate for the printer location.

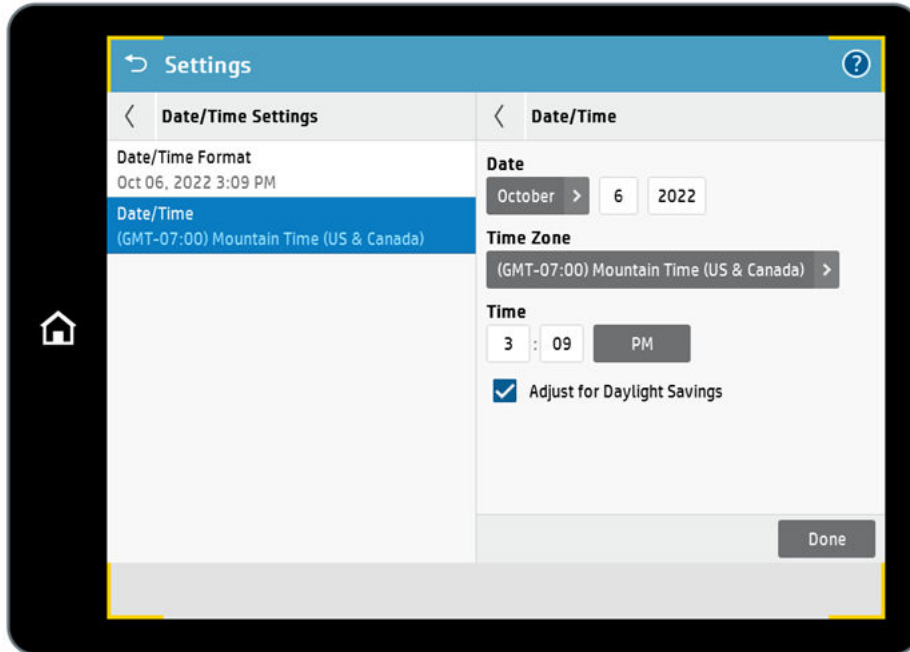

3. If the error persists, you might need to replace the formatter.

Table 6-4 Part numbers

Description	HP Part Number
Formatter (M552 models only)	B5L23-67903
Formatter (M552 models only)(India and China)	B5L23-67904
Formatter (M553n, M553dn, M553dh)	B5L24-67909
Formatter (M553n, M553dn, M553dh)(India and China)	B5L24-67908
Formatter (M553x models only)	B5L26-67901
Formatter (M553x models only)(India and China)	B5L26-67902
Formatter (M577 models only)	B5L46-67909
Formatter (M577 models only)(India and China)	B5L46-67911


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Set the time and date on the control panel.

Go to **Settings > General > Date/Time Settings > Date/Time** and adjust the settings appropriate for the printer location.

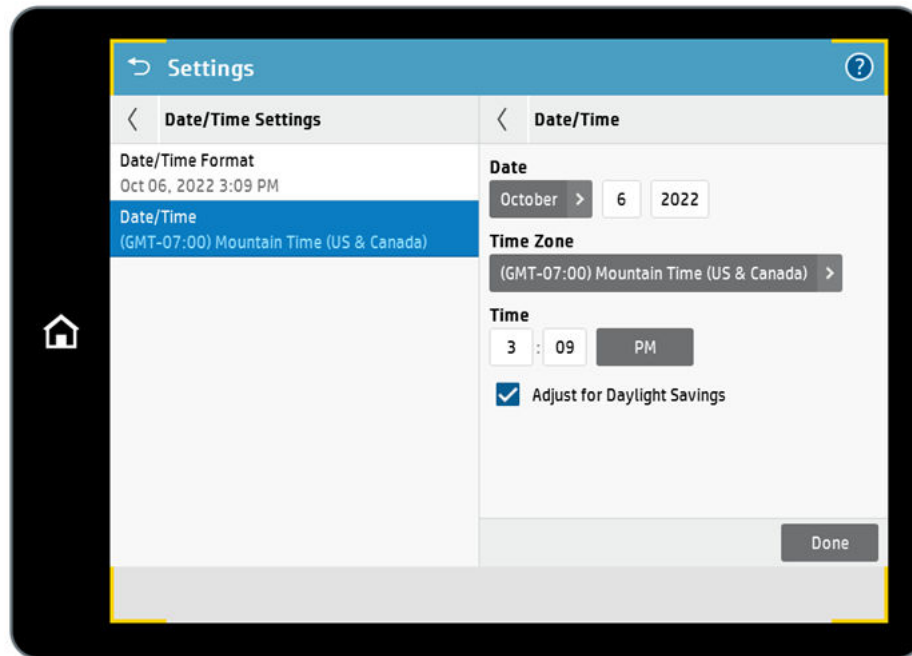

3. If the error persists, you might need to replace the formatter.

IMPORTANT: Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

For instructions: See the Repair Service Manual for this product.

For instructions: See the Repair Service Manual for this product.

Table 6-5 Part numbers

Description	HP Part Number
Formatter (M552 models only)	B5L23-67903
Formatter (M552 models only)(India and China)	B5L23-67904
Formatter (M553n, M553dn, M553dh)	B5L24-67909
Formatter (M553n, M553dn, M553dh)(India and China)	B5L24-67908
Formatter (M553x models only)	B5L26-67901
Formatter (M553x models only)(India and China)	B5L26-67902
Formatter (M577 models only)	B5L46-67909
Formatter (M577 models only)(India and China)	B5L46-67911

13.WX.YZ error messages

13.* errors

Errors in the 13.* family are related to jams.

More than 1000 unique error codes are possible. Use the following information to understand the jam code. Not all codes apply to all printers.

Message format: 13.WX.YZ

- W represents the jam location.
- X represents the sensor or door that triggered the jam.
- Y represents the jam condition (delay, stay, wrap, etc.)
- Z represents the paper source, fuser mode, or destination

Table 6-6 Potential values for W and X

W	Jam location	X	Sensor or door
A	Input area	0	Envelope feeder
A	Input area	1	Tray 1 feed (unless Tray 1 feed is the registration sensor)
A	Input area	2	Tray 2 feed (unless Tray 2 feed is the registration sensor)
A	Input area	3	Tray 3 feed
A	Input area	4	Tray 4 feed
A	Input area	5	Tray 5 feed
A	Input area	6	Tray 6 feed
A	Input area	7	Optional tray exit sensor
A	Input area	A	Door 1
A	Input area	B	Door 2
A	Input area	C	Door 3
A	Input area	D	Door 4
A	Input area	E	Door 5
A	Input area	F	Multiple sensors or doors
B	Image area	0	Media sensor for forbidden transparencies
B	Image area	2	Registration/top of page
B	Image area	3	Top of page
B	Image area	4	Loop
B	Image area	5	Fuser input
B	Image area	9	Fuser output
B	Image area	A	Door 1

Table 6-6 Potential values for W and X (continued)

W	Jam location	X	Sensor or door
B	Image area	B	Door 2
B	Image area	F	Multiple sensors or doors
C	Switchback area (between the fuser and the output bin)	1	Intermediate switchback sensor
C	Switchback area (between the fuser and the output bin)	2	Switchback media stay sensor
C	Switchback area (between the fuser and the output bin)	3	Paper delivery sensor
D	Duplex area	1	Duplex switchback
D	Duplex area	2	Duplex delivery
D	Duplex area	3	Duplex refeed
D	Duplex area	A	Door 1 (if different than the imaging area)
D	Duplex area	B	Door 2 (if different than the imaging area)
D	Duplex area	F	Multiple sensors or doors
E	Output or intermediate paper transport unit (IPTU) area	1	Output bin full sensor
E	Output or intermediate paper transport unit (IPTU) area	2	IPTU feed sensor 1
E	Output or intermediate paper transport unit (IPTU) area	3	IPTU sensor 2
E	Output or intermediate paper transport unit (IPTU) area	4	IPTU sensor 3
E	Output or intermediate paper transport unit (IPTU) area	5	IPTU bin full sensor 4
E	Output or intermediate paper transport unit (IPTU) area	6	Output sensor
E	Output or intermediate paper transport unit (IPTU) area	A	Door 1
E	Output or intermediate paper transport unit (IPTU) area	F	Multiple sensors or doors
F	Multiple subsystems (occurs when paper is stuck in several areas)	F	Multiple sensors or doors
1	Jetlink input device	4	Tray 4 feed sensor
1	Jetlink Input device	5	Tray 5 feed sensor
1	Jetlink Input device	6	Tray 6 feed sensor
1	Jetlink Input device	7	Tray 7 feed sensor
1	Jetlink Input device	8	Tray 8 feed sensor
1	Jetlink Input device	9	Tray 9 feed sensor
1	Jetlink Input device	A	Door 1
1	Jetlink Input device	B	Door 2

Table 6-6 Potential values for W and X (continued)

W	Jam location	X	Sensor or door
1	Jetlink Input device	F	Multiple sensors or doors
2	Buffer pass unit	0	Buffer pass inlet sensor
2	Buffer pass unit	9	Buffer pass exit sensor
2	Buffer pass unit	A	Door 1
3	Page insert unit	0	Page insertion inlet sensor
3	Page insert unit	1	Page insertion tray 1 feed sensor
3	Page insert unit	2	Page insertion tray 2 feed sensor
3	Page insert unit	3	Page insertion tray 3 feed sensor
3	Page insert unit	4	Page insertion tray 4 feed sensor
3	Page insert unit	7	Output path feed sensor
3	Page insert unit	9	Page insertion exit sensor
3	Page insert unit	A	Door 1
4	Punch unit	0	Puncher inlet sensor
4	Punch unit	1	Puncher jam sensor
4	Punch unit	9	Puncher exit sensor
4	Punch unit	A	Door 1
5	Folding unit	0	Folder inlet sensor
5	Folding unit	1	Folder sensor
5	Folding unit	9	Folder exit sensor
5	Folding unit	A	Door 1
6	Stacker unit	0	Stacker inlet sensor
6	Stacker unit	4	Stacker outlet sensor
6	Stacker unit	7	Stacker switchback entrance sensor
6	Stacker unit	8	Stacker switchback registration sensor
6	Stacker unit	9	Stacker switchback lower sensor
7	Multi-bin mailbox (MBM) unit	0	MBM inlet sensor
7	Multi-bin mailbox (MBM) unit	1	MBM middle sensor
7	Multi-bin mailbox (MBM) unit	9	Stapler sensor
7	Multi-bin mailbox (MBM) unit	A	Door 1
7	Multi-bin mailbox (MBM) unit	B	Door 2
7	Multi-bin mailbox (MBM) unit	C	Door 3
7	Multi-bin mailbox (MBM) unit	F	Multiple sensors or doors
8	Stapler/stacker (SS) unit	0	SS inlet sensor
8	Stapler/stacker (SS) unit	1	SS Bin Z

Table 6-6 Potential values for W and X (continued)

W	Jam location	X	Sensor or door
8	Stapler/stacker (SS) unit	3	SS unit middle sensor
8	Stapler/stacker (SS) unit	4	SS unit outlet sensor 1
8	Stapler/stacker (SS) unit	5	SS unit outlet sensor 2
8	Stapler/stacker (SS) unit	9	Stapler sensor
8	Stapler/stacker (SS) unit	A	Door 1
8	Stapler/stacker (SS) unit	B	Door 2
9	Booklet maker unit	0	Booklet maker input sensor
9	Booklet maker unit	2	Booklet maker feed sensor 2
9	Booklet maker unit	2	Booklet maker feed sensor 3
9	Booklet maker unit	4	Booklet maker delivery sensor
9	Booklet maker unit	5	Booklet maker vertical paper path sensor
9	Booklet maker unit	6	Booklet unit front staple sensor
9	Booklet maker unit	7	Booklet unit rear staple sensor
9	Booklet maker unit	8	Booklet unit outlet sensor
9	Booklet maker unit	A	Door 1
9	Booklet maker unit	B	Door 2
9	Booklet maker unit	C	Door 3
9	Booklet maker unit	F	Multiple sensors or doors
0	Unknown	0	Unknown

Table 6-7 Potential values for Y (jam condition)

Y	Jam condition
0	Unknown
1	Unexpected sheet (duplex)
2	Staple jam
3	Jam caused by an open door (duplex)
4	Stay jam (the page never left the tray - duplex)
A	Stay jam (the page never left the tray - simplex)
B	Multifeed
C	Wrap
D	Delay (the page did not reach the sensor within the expected time - simplex)
E	Door open
F	Residual (paper is detected in the paper path when it should not be there)

The information represented by the value for Z depends on where the paper is in the paper path.

Table 6-8 Potential values for Z (source, fuser mode, or destination)

Paper location	Z	Source, fuser mode, or destination
When paper has not reached the fuser, Z represents the paper source.	1	Tray 1
Z represents the paper source.	2	Tray 2
Z represents the paper source.	3	Tray 3
Z represents the paper source.	4	Tray 4
Z represents the paper source.	5	Tray 5
Z represents the paper source.	6	Tray 6
Z represents the paper source.	D	Duplexer
Z represents the paper source.	E	Envelope feeder
When paper has reached the fuser, is in the duplex path, or in the output path, Z represents the fuser mode.	0	Photo 1, 2, or 3 Designated 2 or 3
Jams can occur when there is a mismatch between the actual paper and the fuser mode setting.		
Z represents the fuser mode.	1	Normal (automatically sensed rather than based on the paper type set at the control panel)
Z represents the fuser mode.	2	Normal (based on the paper type set at the control panel)
Z represents the fuser mode.	3	Light 1, 2, or 3
Z represents the fuser mode.	4	Heavy 1
Z represents the fuser mode.	5	Heavy 2
Z represents the fuser mode.	6	Heavy 3
Z represents the fuser mode.	7	Glossy 1
Z represents the fuser mode.	8	Glossy 2
Z represents the fuser mode.	9	Glossy 3
Z represents the fuser mode.	A	Glossy Film
Z represents the fuser mode.	B	Transparency
Z represents the fuser mode.	C	Label
Z represents the fuser mode.	D	Envelope 1, 2, or 3
Z represents the fuser mode.	E	Rough
When paper has entered the output bin, Z represents the output bin, numbered from top to bottom.	0	Unknown bin
Z represents the output bin	1	Bin 1
Z represents the output bin	2	Bin 2
Z represents the output bin	3	Bin 3
Z represents the output bin	4	Bin 4

Table 6-8 Potential values for Z (source, fuser mode, or destination) (continued)

Paper location	Z	Source, fuser mode, or destination
Z represents the output bin	5	Bin 5
Z represents the output bin	6	Bin 6
Z represents the output bin	7	Bin 7
Z represents the output bin	8	Bin 8
Z represents the output bin	9	Bin 9
All paper locations	E	Door open jam
All paper locations	F	Residual jam
All paper locations	0	Forbidden OHT jam (when Y=2)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size, and the tray should not be filled above the maximum fill marks or tabs.
4. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
5. Use a damp, lint-free cloth to clean the rollers in the appropriate tray. Replace rollers that are worn.
6. Open all doors and covers and ensure the paper path is completely clear of paper or obstructions.
7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

To prevent future paper jams in the printer, follow these recommendations:

- Use only paper that meets HP specifications for this printer.
For more information, refer to the printer User Guide or search for the "HP LaserJet Printers - Print Media Guide" (c06117757)[Or click here: HP LaserJet Print Media Guide](#).
- Make sure the printing environment is within recommended specifications.
- Do not use paper that is wrinkled, folded, or damaged.
- Do not overload the tray with paper.
- Make sure that the paper guides in the tray are adjusted correctly for the size of paper.
- Make sure that the tray is fully inserted in the printer.
- If printing on heavy, embossed, or perforated paper, use the manual feed feature and feed sheets one at a time.

- Open the [Trays](#) menu on the printer control panel. Verify that the tray is configured correctly for the paper type and size.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size, and the tray should not be filled above the maximum fill marks or tabs.
4. Verify that the paper meets specifications for this printer.
5. Use a damp, lint-free cloth to clean the rollers in the appropriate tray. Replace rollers that are worn.
6. If the issue persists, open the [Administration > Troubleshooting > Diagnostic Tests > Component Test](#) menu, and perform the appropriate pickup/feed motor drive test. Replace the pickup assembly if the test fails.
7. Verify the sensors are functioning correctly. If the sensors fail the test, first verify that all connections on the DC controller are correctly seated. If possible, replace the sensor or assembly it is associated with.
8. If the sensors pass the test, look for blockage or damaged parts and replace any damaged parts.
9. If the error persists, elevate the case using the Standard Support Process.

13.00.00

Generic jam event code.

Recommended action

Follow these troubleshooting steps in the order presented.

- Check the printer for a jam.

13.00.EE

Unknown door open.

Recommended action

Follow these troubleshooting steps in the order presented.

- Ensure that all of the doors and covers are closed.

13.00.FF

Residual jam.

This error has no specific sensor designated. It could be any sensor in the paper feed path and the required jam access point has not been accessed.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Check the printer for a jam.
2. Look for and clear any paper present or obstructions in the paper path.

View event log to determine if other Jam errors are occurring and troubleshoot those errors.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Check the printer for a jam.
2. Look for and clear any paper present or obstructions in the paper path.

View event log to determine if other Jam errors are occurring and troubleshoot those errors.
3. Use the manual sensors test or the Tray/Bin manual sensors test to isolate a faulty door switch or sensor.
4. Replace parts as determined by sensor tests, obstructions or broken parts.

13.A3.DX

Paper delay jam in Tray X.

Paper did not reach the Tray 3 feed sensor (SR21) in the designated amount of time when printing from Tray X.

The 550 sheet feeders can be stacked for 3 extra trays. These trays have the same sensors and connectors.


- **13.A3.D3** Paper did not reach the Tray 3 feed sensor in the designated amount of time when printing from Tray 3.
- **13.A3.D4** Paper did not reach the Tray 3 feed sensor in the designated amount of time when printing from Tray 4.
- **13.A3.D5** Paper did not reach the Tray 3 feed sensor in the designated amount of time when printing from Tray 5.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open Tray X and remove any jammed paper, and then close the tray.

2. Open the lower right door and remove any jammed paper.

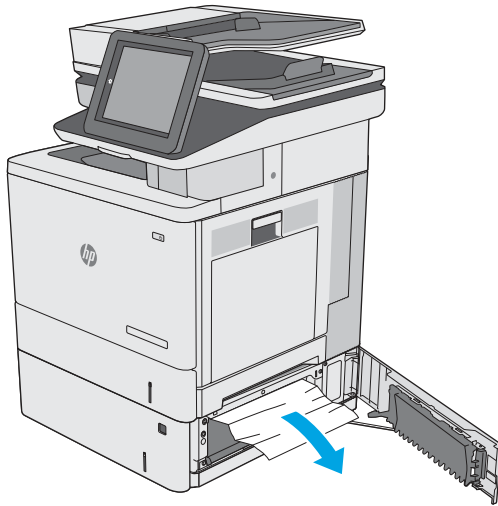

3. Open and close the upper right door to allow the printer to attempt to clear the jam.



4. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-1 Paper tray guides


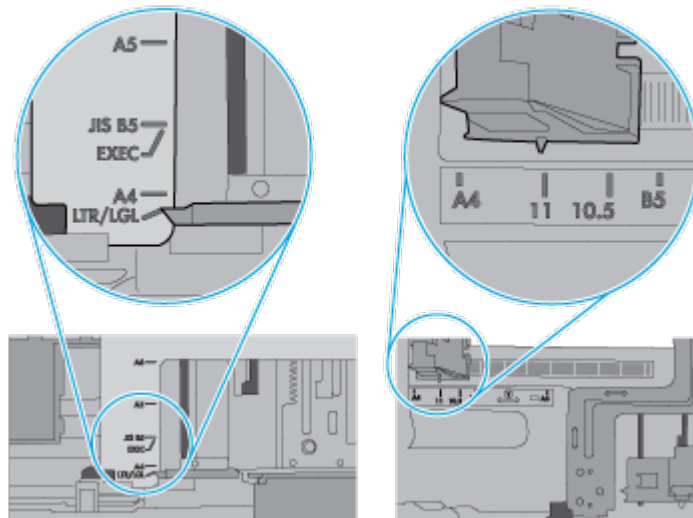


Figure 6-2 Paper height guides

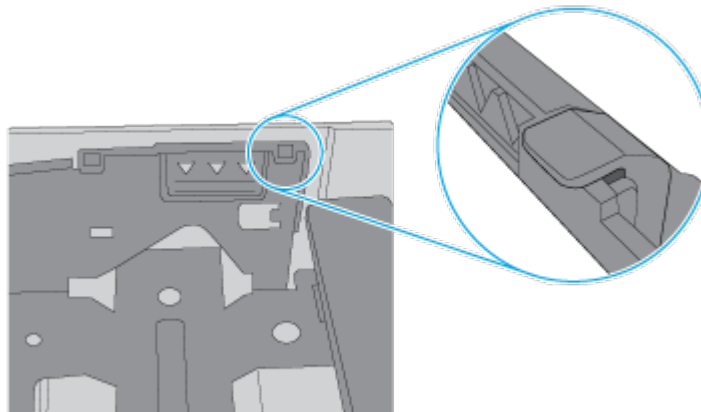

5. Ensure that the Tray X pickup, feed, and separation rollers are installed correctly and show no damage or wear.
6. Clean or replace the pickup, feed, and separation rollers as needed.
Part number: B5L24-67904
7. If the printer has multiple 550 sheet feeders, rearrange their positions and then test again.
8. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open Tray X and remove any jammed paper, and then close the tray.

2. Open and close the upper right door to allow the printer to attempt to clear the jam.
3. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-3 Paper tray guides


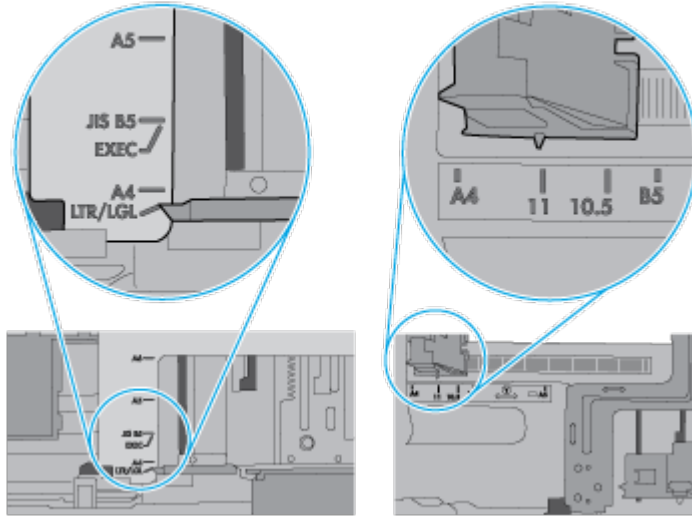


Figure 6-4 Paper height guides

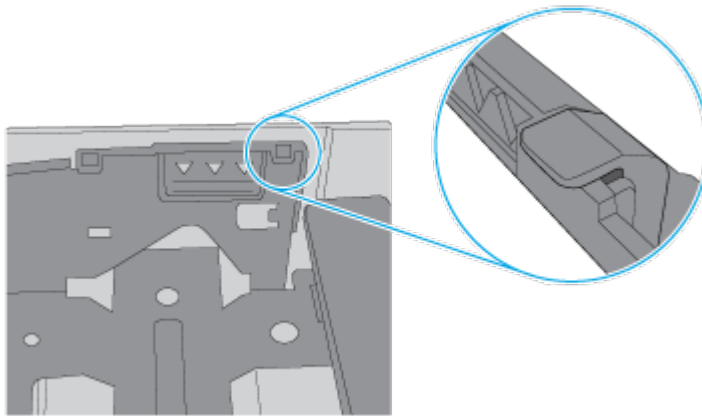

4. Ensure that the Tray X pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.
Part number: B5L24-67904
6. If the printer has multiple 550 sheet feeders, rearrange their positions and then test again.
7. Check the connectors at the sensor (J1904), feed motor (J1903), on the paper feeder controller PCA for Tray 3.
8. Open the following menus:
 - [Administration](#)

- [Troubleshooting](#)
 - [Diagnostic Tests](#)
9. Test SR21 using the Tray/Bin manual sensor test to verify that the sensor is functioning correctly. If it does not, replace the paper pickup assembly.

Part number: RM2-5154-000CN
 10. Run the Tray X Pickup/Feed motor drive test to verify that the feed motor is functioning correctly (listen for the motor to activate). If the motor does not function, replace the paper pickup assembly.
 11. If replacing the paper pickup assembly does not resolve the error, replace the 550 sheet feeder.

Part number: B5L34-67901

13.A4.DX

Paper delay jam in Tray X.

Paper did not reach the Tray 4 Feed sensor (SR21) in the designated amount of time when printing from Tray X.

The 550 sheet feeders can be stacked for 3 extra trays. These trays have the same sensors and connectors.

- **13.A4.D4** Paper did not reach the Tray 3 feed sensor in the designated amount of time when printing from Tray 4.
- **13.A4.D5** Paper did not reach the Tray 3 feed sensor in the designated amount of time when printing from Tray 5.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open Tray X and remove any jammed paper, and then close the tray.
2. Open and close the upper right door to allow the printer to attempt to clear the jam.

3. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-5 Paper tray guides


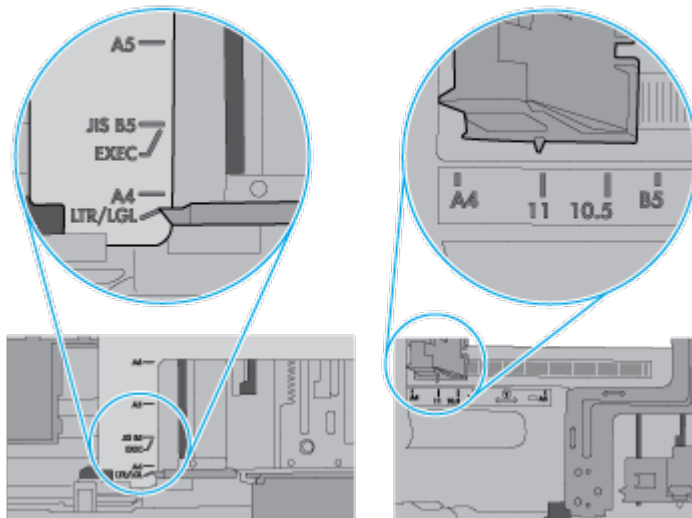


Figure 6-6 Paper height guides

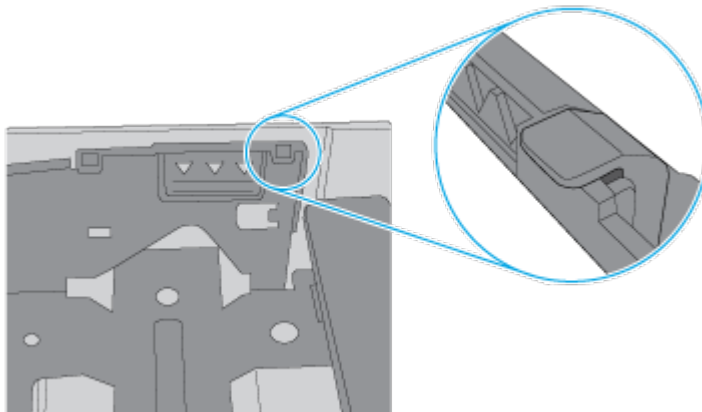

4. Ensure that the Tray X pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.
Part number: B5L24-67904
6. If printer has multiple 550 sheet feeders, rearrange their positions and then test again.
7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open Tray X and remove any jammed paper, and then close the tray.

2. Open and close the upper right door to allow the printer to attempt to clear the jam.
3. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-7 Paper tray guides


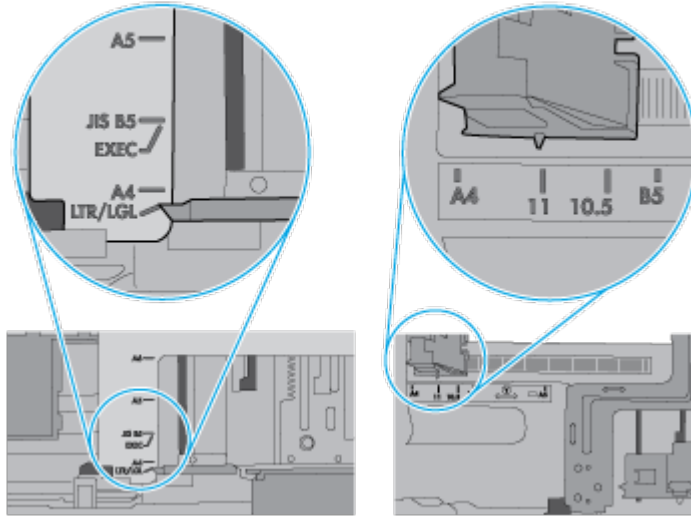


Figure 6-8 Paper height guides

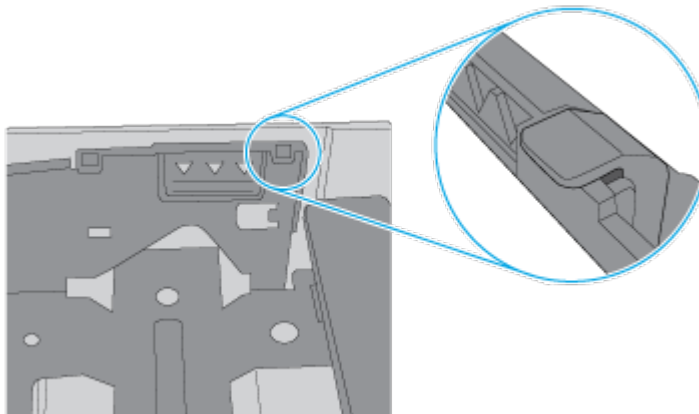

4. Ensure that the Tray X pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.
Part number: B5L24-67904
6. If printer has multiple 550 sheet feeders, rearrange their positions and then test again.
7. Check the connectors at the sensor (J1904), feed motor (J1903), on the paper feeder controller PCA for Tray 4.
8. Open the following menus:
 - [Administration](#)

- [Troubleshooting](#)
- [Diagnostic Tests](#)

9. Test SR21 using the Tray/Bin manual sensor test to verify that the sensor is functioning correctly. If it does not, replace the paper pickup assembly.

Part number: RM2-5154-000CN

10. Run the Tray X Pickup/Feed motor drive test to verify that the feed motor is functioning correctly (listen for the motor to activate). If the motor does not function, replace the paper pickup assembly.
11. If replacing the paper pickup assembly does not resolve the error, replace the 550 sheet feeder.

Part number: B5L34-67901

13.A5.D5

Paper delay jam in Tray X.

Paper did not reach the Tray 5 Feed sensor (SR21) in the designated amount of time when printing from Tray X.

• 13.A5.D5

Paper did not reach the Tray 5 feed sensor in the designated amount of time when printing from Tray 5.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open Tray 5 and remove any jammed paper, and then close the tray.
2. Open and close the upper right door to allow the printer to attempt to clear the jam.
3. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-9 Paper tray guides


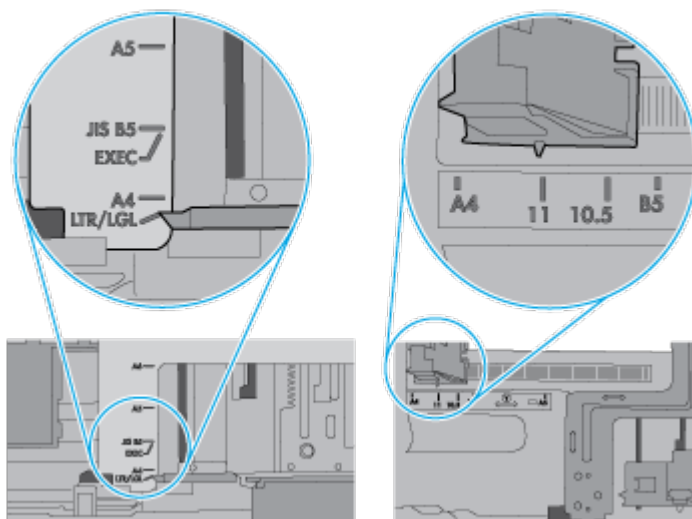


Figure 6-10 Paper height guides

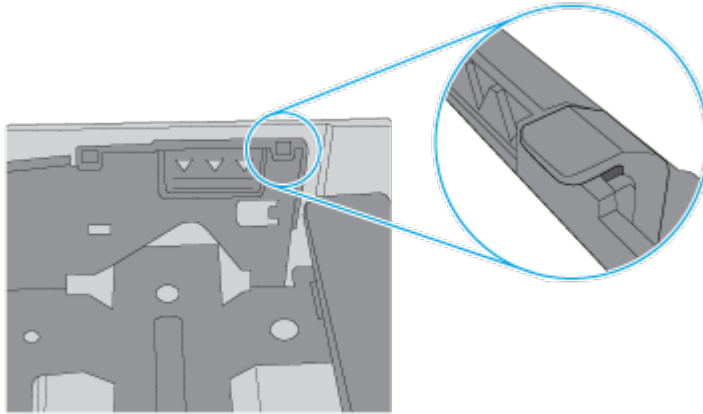

4. Ensure that the Tray 5 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.
Part number: B5L24-67904
6. If printer has multiple 550 sheet feeders, rearrange their positions and then test again.
7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open Tray 5 and remove any jammed paper, and then close the tray.
2. Open and close the upper right door to allow the printer to attempt to clear the jam.

3. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-11 Paper tray guides


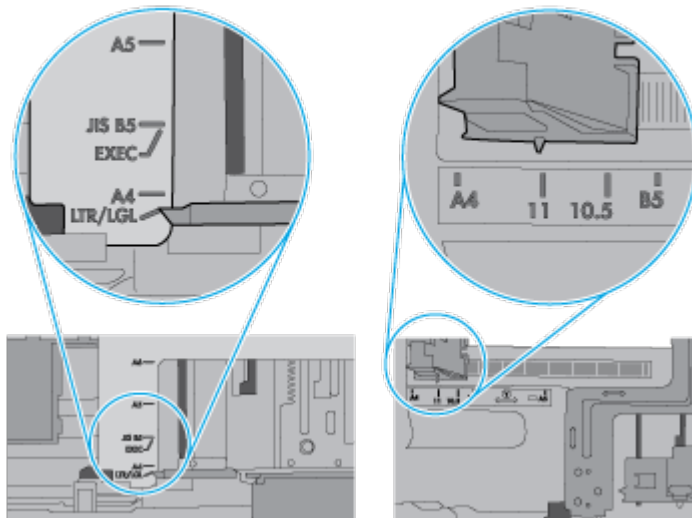


Figure 6-12 Paper height guides

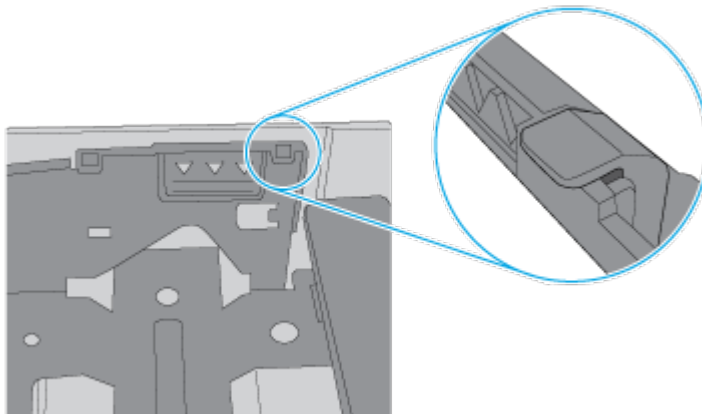

4. Ensure that the Tray 5 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.
Part number: B5L24-67904
6. If printer has multiple 550 sheet feeders, rearrange their positions and then test again.
7. Check the connectors at the sensor (J1904), feed motor (J1903), on the paper feeder controller PCA for Tray 5.
8. Open the following menus:
 - [Administration](#)
 - [Troubleshooting](#)

- [Diagnostic Tests](#)
- 9. Test SR21 using the Tray/Bin manual sensor test to verify that the sensor is functioning correctly. If it does not, replace the paper pickup assembly.
Part number: RM2-5154-000CN
- 10. Run the Tray X Pickup/Feed motor drive test to verify that the feed motor is functioning correctly (listen for the motor to activate). If the motor does not function, replace the paper pickup assembly.
- 11. If replacing the paper pickup assembly does not resolve the error, replace the 550 sheet feeder.
Part number: B5L34-67901

13.Ax.FF

Residual paper jam in Tray X.

This jam occurs when residual paper is detected at the Tray X feed sensor (SR21).

- **13.A3.FF** Residual Paper Jam in Tray 3.
- **13.A4.FF** Residual Paper Jam in Tray 4.
- **13.A5.FF** Residual Paper Jam in Tray 5.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open Tray X and remove any jammed paper, and then close the tray.
2. Open and close the upper right door to allow the printer to attempt to clear the jam.
3. Ensure that the Tray X pickup, feed, and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup, feed, and separation rollers as needed.
Part number: B5L24-67904
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open Tray X and remove any jammed paper, and then close the tray.
2. Open and close the upper right door to allow the printer to attempt to clear the jam.
3. Ensure that the Tray X pickup, feed, and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup, feed, and separation rollers as needed.
Part number: B5L24-67904
5. Check the connectors at the sensor (J1904), feed motor (1903), and the paper feeder controller PCA.

6. Open the following menus:
 - [Administration](#)
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
7. Test all SR21 sensors using the Tray/Bin manual sensor test to verify that the sensors are functioning correctly. If it does not, replace the paper pickup assembly.

Part number: RM2-5154-000CN
8. Run the Tray X Pickup/Feed motor drive test to verify that the feed motor is functioning correctly (listen for the motor to activate). If the motor does not function, replace the paper pickup assembly.
9. If replacing the paper pickup assembly does not resolve the error, replace the 550 sheet feeder.

Part number: B5L34-67901
10. If the issue persists, elevate the case using the Standard Support Process.

13 . B2 . Az Jam in Right door

Paper stay jam in the top cover at the image area.

Paper present at SR6 after a specified time limit has passed.

- **13.B2.A1**

This jam occurs when the registration sensor (SR6) detects paper present longer than the expected time based on the paper size when printing from Tray 1.
- **13.B2.A2**

This jam occurs when the registration sensor (SR6) detects paper present longer than the expected time based on the paper size when printing from Tray 2.
- **13.B2.A3**

This jam occurs when the registration sensor (SR6) detects paper present longer than the expected time based on the paper size when printing from Tray 3.
- **13.B2.A4**


This jam occurs when the registration sensor (SR6) detects paper present longer than the expected time based on the paper size when printing from Tray 4.
- **13.B2.AD**

This jam occurs when the registration sensor (SR6) detects paper present longer than the expected time based on the paper size when printing from the Duplexer.

Recommended action for customers


Follow these troubleshooting steps in the order presented.

1. Open the upper right door and check for paper jammed in the feed area.

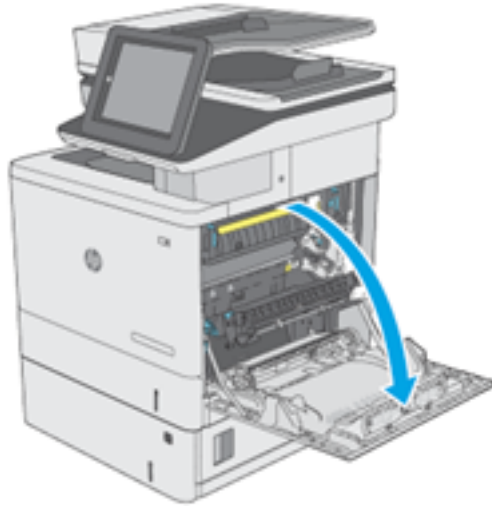

2. For Tray 1, ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-13 Tray 1 paper height and width guides

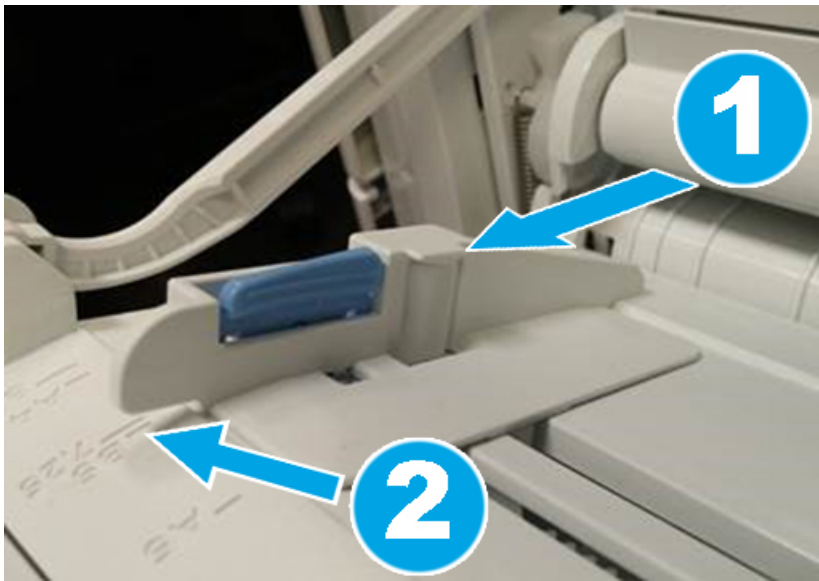

Callout 1 – Height guide

Callout 2 – Page size

Figure 6-14 Tray 1 paper height guides



3. For Tray 2, ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-15 Paper tray guides



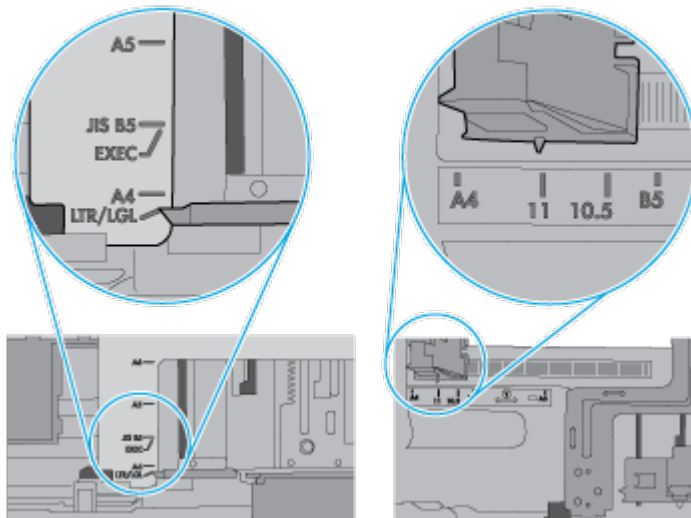


Figure 6-16 Paper height guides

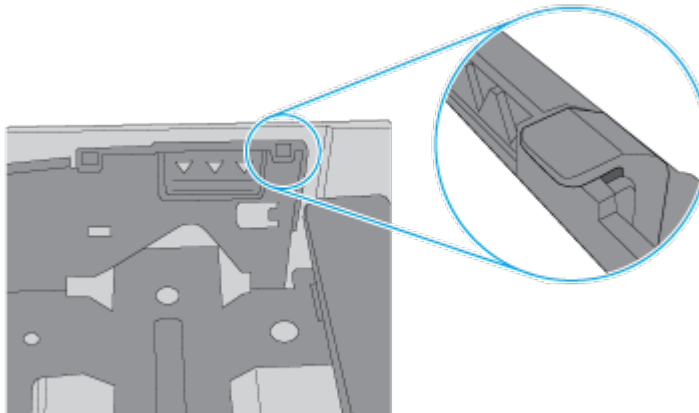

4. Check the ITB and T2 roller at the transfer area, ensure that everything is correctly seated and that there are no damaged parts.

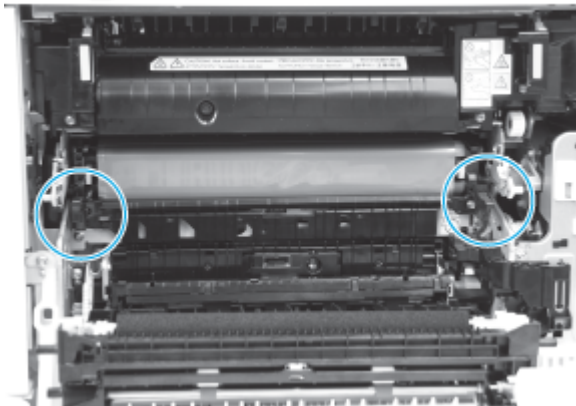

5. Ensure the type and quality of the paper that the customer is using meets HP specifications.
6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the upper right door and check for paper jammed in the feed area.
2. Test the top of page sensor (SR6) to ensure that it moves freely.
3. Check the ITB and T2 roller at the transfer area, ensure that everything is correctly seated and that there are no damaged parts.
4. Ensure the type and quality of the paper that the customer is using meets HP specifications.
5. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
6. Test the registration sensor (TOP sensor) (SR6) using the Tray/Bin manual sensor test to verify that the sensor is functioning correctly. If the sensor does not function, replace the registration assembly.

Table 6-9 Part number:

Description	HP Part Number
Registration assembly (M552dn, M553dn, M553x, M577)	RM2-0018-000CN
Registration assembly (M553n)	RM2-0093-000CN

7. Test the paper width sensors SR13 and SR14. If defective replace the registration assembly.
8. If the sensors functioning correctly, run a few pages to check where the leading edge of the paper actually stops.

9. Test the registration assembly and check connectors J118 and J16 on the DC controller.
10. If any test shows defective parts, replace the appropriate assembly.
11. If the issue persists, elevate the case using the Standard Support Process.

13 . B2 . Dz Jam in Right Door

Paper delay jam in the top cover at the image area.

Paper did not reach SR6 in specified time.

- **13.B2.D1**

Paper did not reach the registration sensor(SR6) in the designated amount of time when printing from Tray 1.

- **13.B2.D2**

Paper did not reach the registration sensor(SR6) in the designated amount of time when printing from Tray 2.

- **13.B2.D3**

Paper did not reach the registration sensor (SR6) in the designated amount of time when printing from Tray 3.

- **13.B2.D4**

Paper did not reach the registration sensor (SR6) in the designated amount of time when printing from Tray 4.


- **13.B2.DD**

Paper did not reach the registration sensor (SR6) in the designated amount of time when being re-fed from the duplexer.

Recommended action for customers


Follow these troubleshooting steps in the order presented.

1. Open the upper right door and check for paper jammed in the feed area.

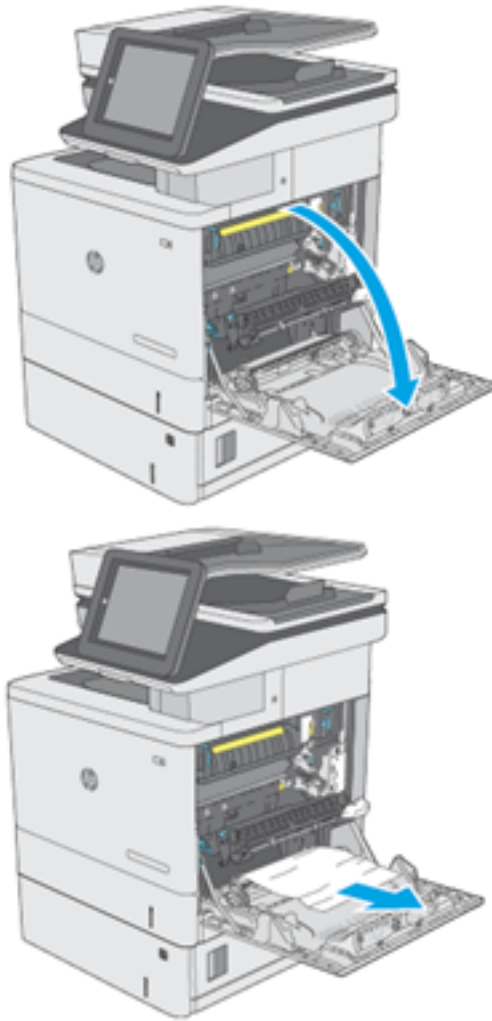

2. For Tray 1, ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-17 Tray 1 paper height and width guides

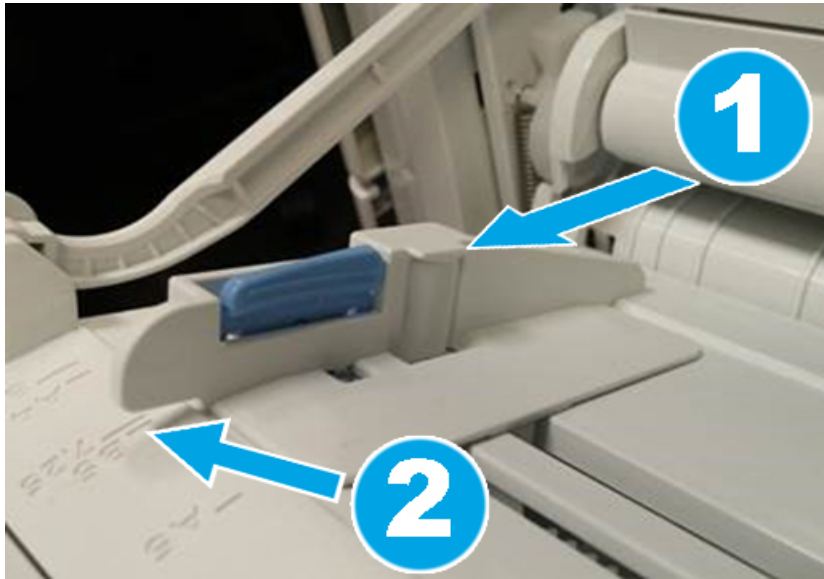

Callout 1 – Height guide

Callout 2 – Page size

Figure 6-18 Tray 1 paper height guides



3. For Tray 2, ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-19 Paper tray guides



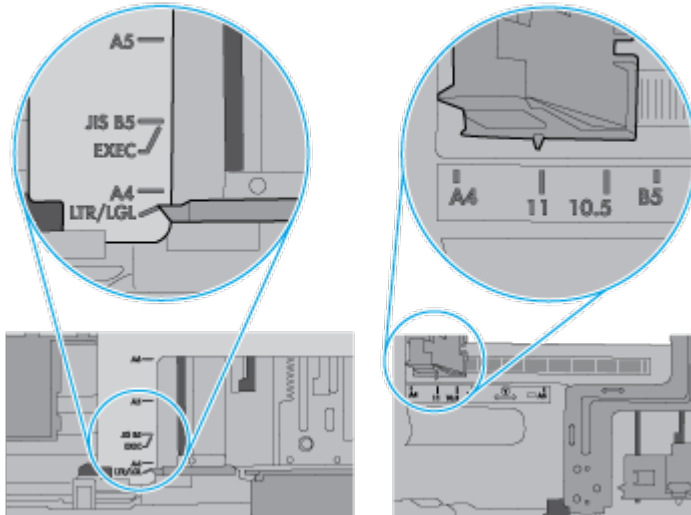


Figure 6-20 Paper height guides

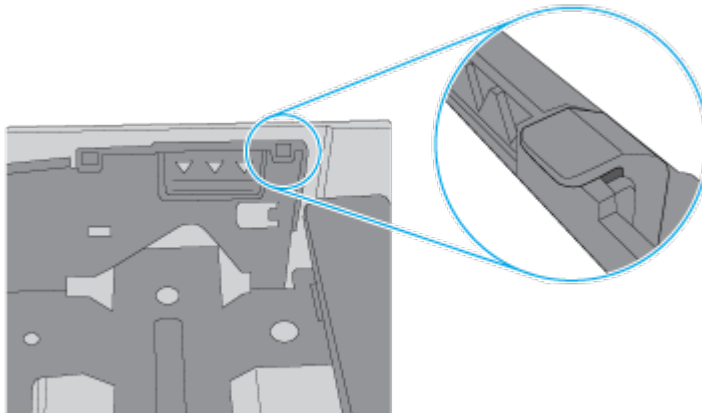

4. Check the ITB and T2 roller at the transfer area, ensure that everything is correctly seated and that there are no damaged parts.

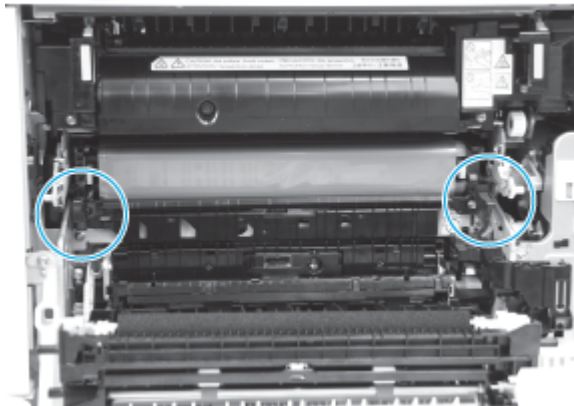


5. Ensure the type and quality of the paper that the customer is using meets HP specifications.
6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the upper right door and check for paper jammed in the feed area.
2. For Tray 1, ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-21 Tray 1 paper height and width guides

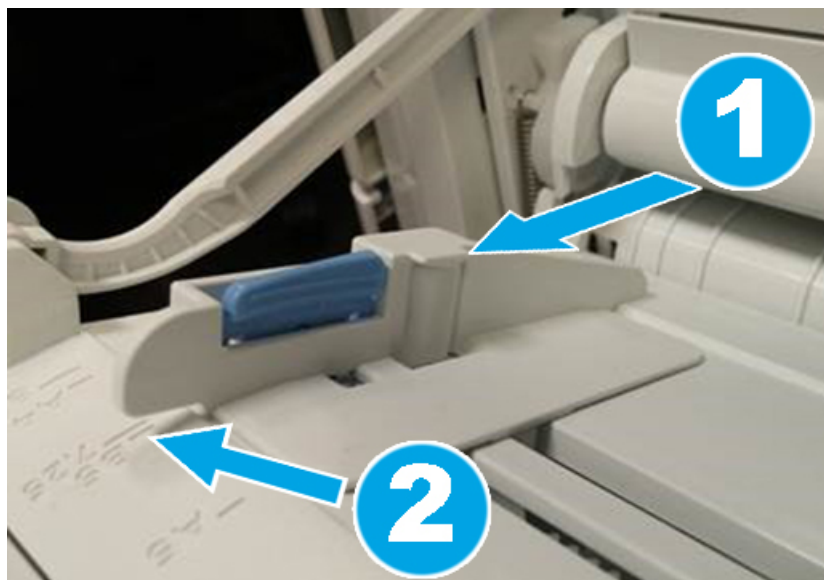

Callout 1 – Height guide

Callout 2 – Page size

Figure 6-22 Tray 1 paper height guides



3. For Tray 2, ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-23 Tray 2 paper guides


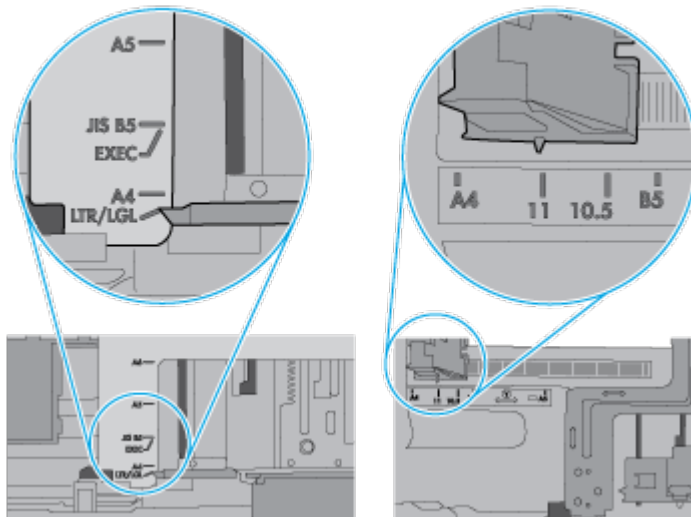


Figure 6-24 Tray 2 paper height guides

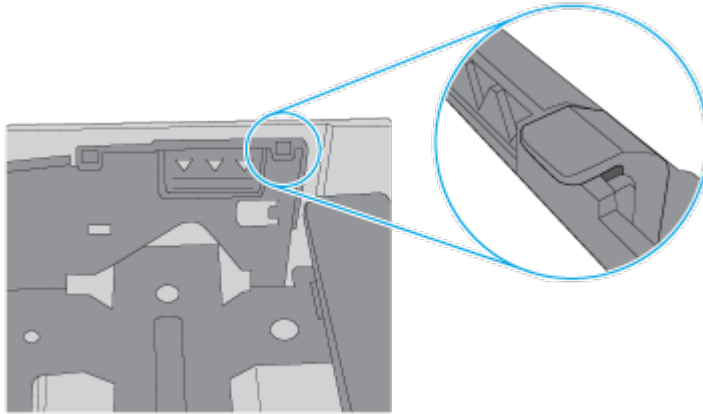


4. Ensure that the Tray X pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.

Part number: B5L24-67904

6. Check whether the printer is experiencing any noise issues.


If the printer emits any noise, open the right door and check the white idler rollers located on the right side of the engine with the secondary transfer assembly.

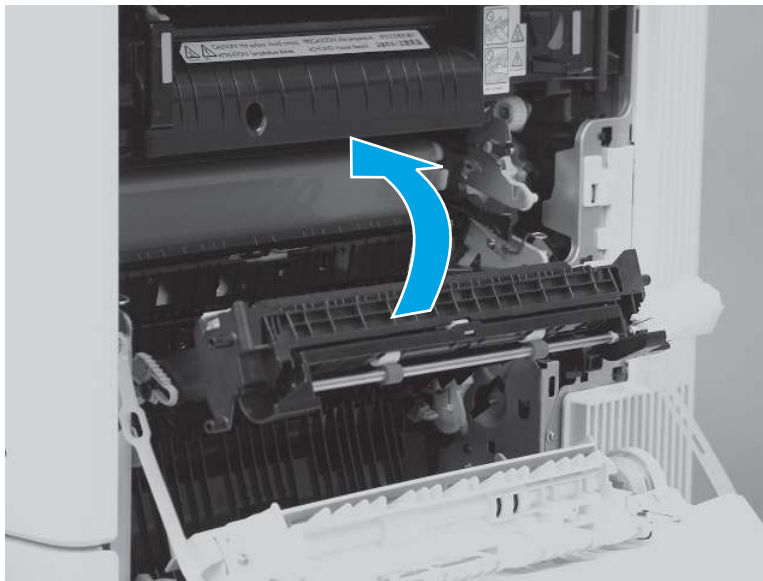

7. Visually inspect the white idler rollers and ensure that there is no toner debris collected on the idler roller and the customer is using genuine HP toner.

If toner debris is collected on the white idler rollers as indicated in the image (callout 1), clean the white idler rollers.

Figure 6-25 Toner debris on the duplex idler roller creates no gap between the idler roller and the guide

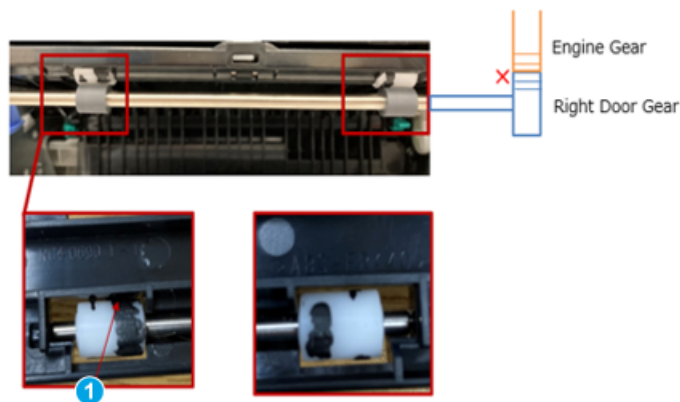

Callout 1 - Toner debris collected on the white roller

8. Ensure that the paper type settings are correct so that the printer operation is optimized to fuse the toner on a paper.
9. Test the top of page sensor (SR6) and the paper width sensors (SR13, SR14). If any of these sensors does not function correctly, replace the registration assembly.

Table 6-10 Part number:

Description	HP Part Number
Registration assembly (M552dn, M553dn, M553x, M577)	RM2-0018-000CN
Registration assembly (M553n)	RM2-0093-000CN

10. Test the registration assembly and check connectors J118 and J16 on the DC controller.
11. Replace parts as determined by tests.

13 . B2 . FF Jam in Right door


Paper residual jam in top cover at image area.

Paper present at SR6, SR13 or SR13 at power on or after clearing a jam.

Recommended action for customers


Follow these troubleshooting steps in the order presented.

1. Open the upper right door and check for paper jammed in the feed area.

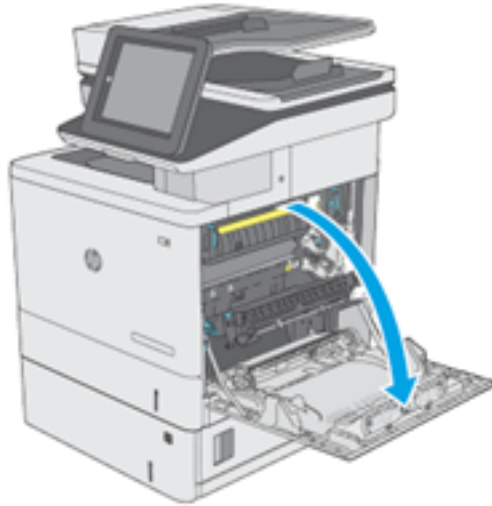

2. For Tray 1, ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-26 Tray 1 paper height and width guides

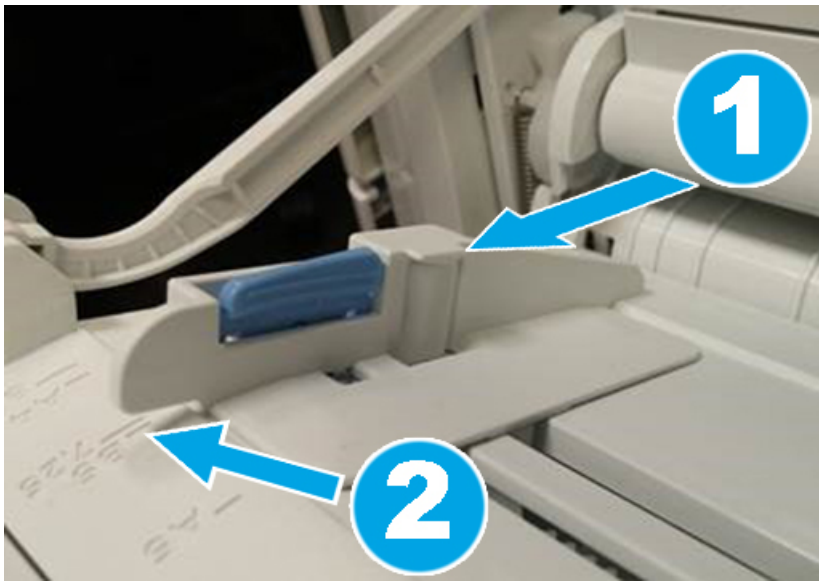

Callout 1 – Height guide

Callout 2 – Page size

Figure 6-27 Tray 1 paper height guides



3. For Tray 2, ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-28 Paper tray guides



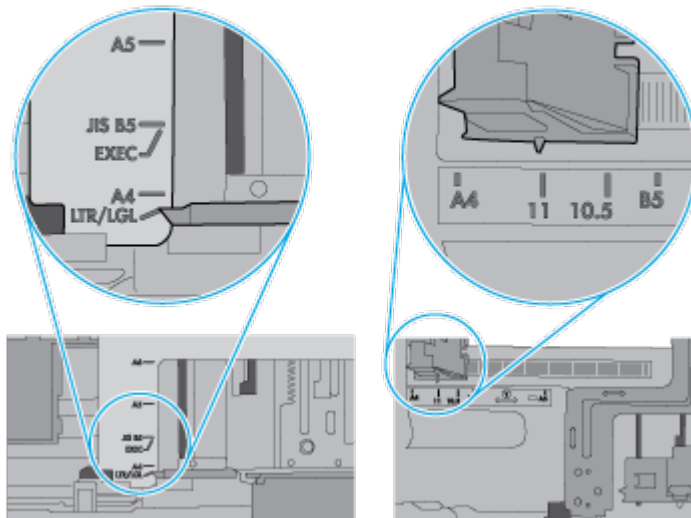


Figure 6-29 Paper height guides

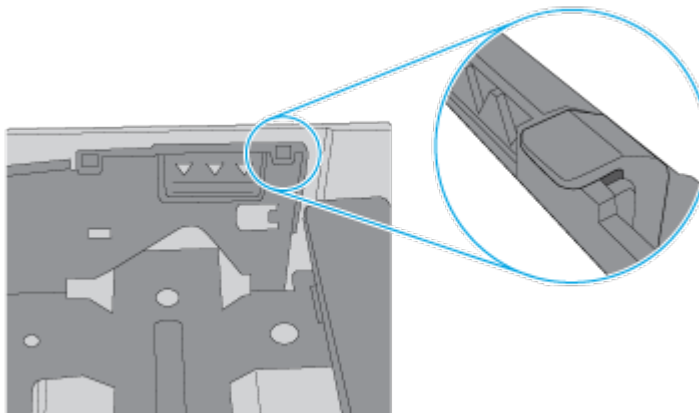

4. Check the ITB and T2 roller at the transfer area, ensure that everything is correctly seated and that there are no damaged parts.


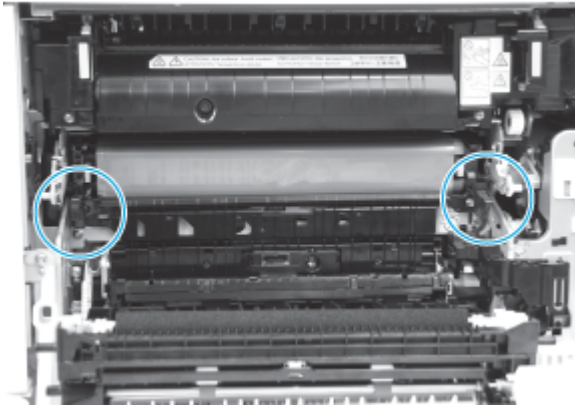


5. Ensure the type and quality of the paper that the customer is using meets HP specifications.
6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.



Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the corresponding tray and completely remove the tray from the printer. Check for any paper present in the feed assembly of the printer. If paper is present, remove the paper.
2. For trays 3 and 4, open the lower right side door and check for any jammed media. If paper is present, remove the paper.
3. Open the right side door and open the lower cover. If paper is present, remove the paper.

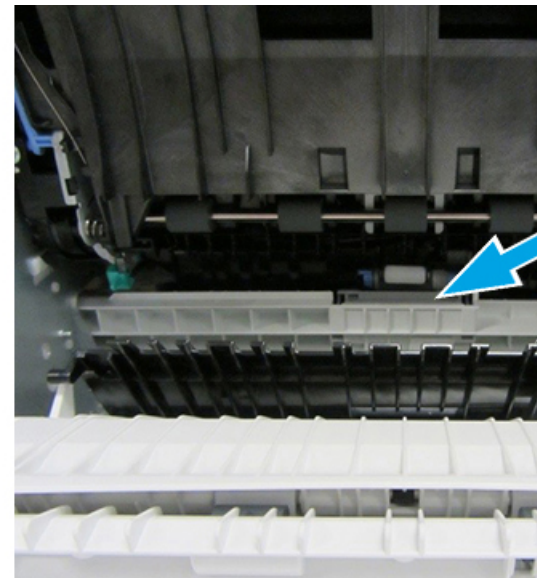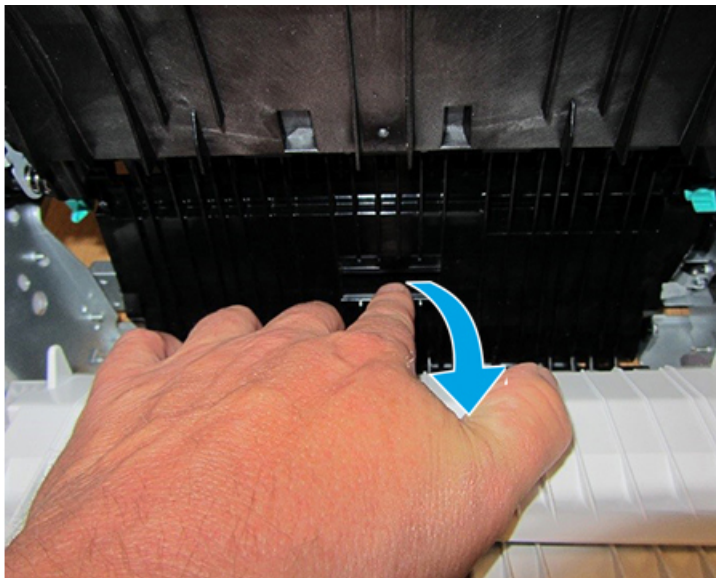

4. Open the registration assembly. Pull down on the blue tab on the left side of the assembly to expose the T2 roller and sensors. and pull down on the blue tab on the left. If paper is present, remove the paper.

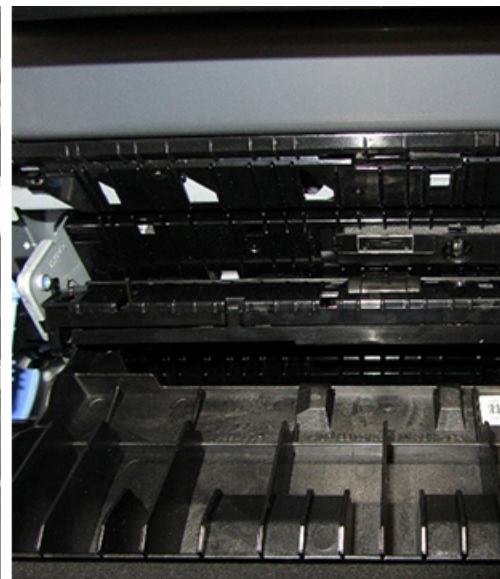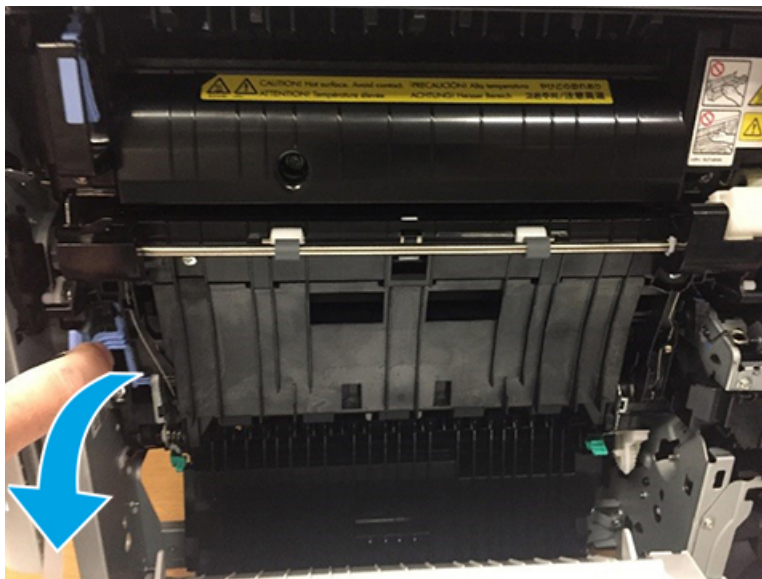

5. Test the top of page sensor (SR6) and the paper width sensors (SR13, SR14). If any of these sensors fail, replace the registration assembly.

Table 6-11 Part number:

Description	HP Part Number
Registration assembly (M552dn, M553dn, M553x, M577)	RM2-0018-000CN
Registration assembly (M553n)	RM2-0093-000CN

13 . B4 . FF Jam in Right Door

Paper residual jam at image area.

Paper present at fuser loop sensor PS1 or SR9 at power on or after clearing a jam.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Open right cover and check for paper jammed in the feed area.
2. Remove the fuser and check for paper and the correct movement of the sensors PS1 and SR9.

CAUTION: The fuser might be HOT.

3. Test the fuser Loop sensor PS1 and fuser exit sensor SR9.

If either sensor fails the test replace the fuser.

For instructions: *Removal and replacement: Fuser*

Part number:

Table 6-12 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

13.B9.Az Fuser jam

Fuser delivery stay jam.

Paper stay jam in the fuser area.

Paper present at SR9 after specified time limit.



This jam code can be caused by:


- An accordion paper jam at the fuser exit.
- Something blocking the paper before reaching the output rollers.
- The output bin rollers are not turning. Because there is very little distance from the fuser exit to the output bin, paper stopped at the rollers can cause a fuser jam.
- A sticky fuser exit flag. If the flag is stuck or even delayed momentarily in the activated position it can cause this jam.
- **13.B9.A1** Multi-feed jam is detected when printing from Tray 1.
- **13.B9.A2** Multi-feed jam is detected when printing from Tray 2.
- **13.B9.A3** Multi-feed jam is detected when printing from Tray 3.
- **13.B9.A4** Multi-feed jam is detected when printing from Tray 4.
- **13.B9.AD** Multi-feed jam is detected when printing from the Duplexer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.


1. Open the upper right door and then clear any jammed paper.

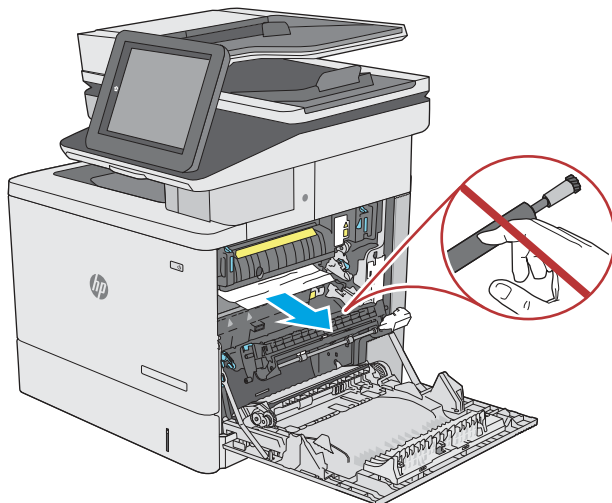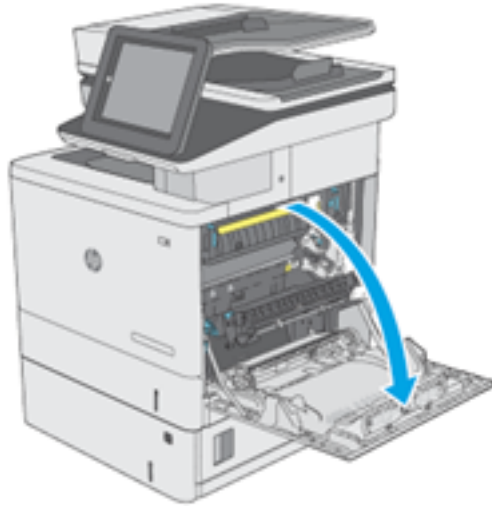

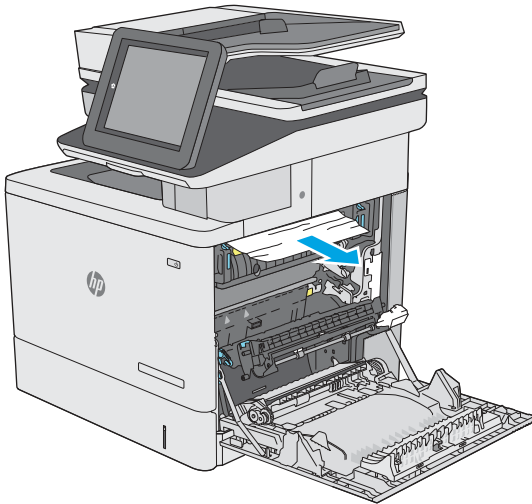

2. Ensure sure that the paper meets the HP printer specifications.
3. Verify there is no debris from a previous jam stuck in the fuser, or the rollers leading into and out of the fuser.

CAUTION: The fuser might be HOT.

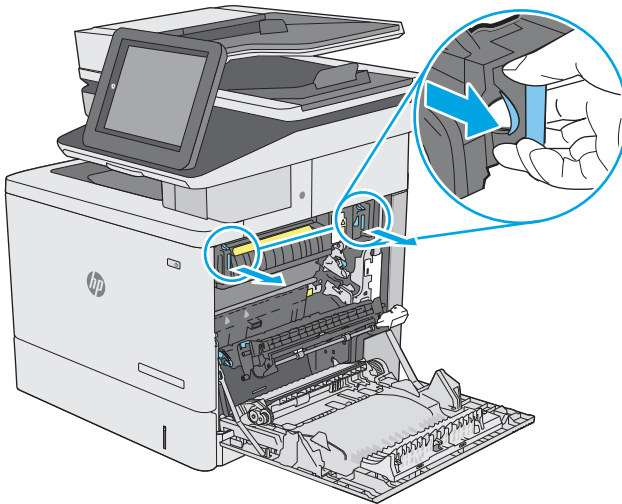

4. If damaged, replace the fuser.

Table 6-13 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.

NOTE: After replacing the fuser kit, reset the fuser page counter by selecting the [New Fuser Kit](#) in the [Reset Supplies](#) menu.

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the upper right door and then clear any jammed paper.
2. Ensure sure that the paper meets the HP printer specifications.
3. Check the fuser delivery sensor for correct functionality and movement.
4. Verify there is no debris from a previous jam stuck in the fuser, or the rollers leading into and out of the fuser.

 **CAUTION:** The fuser might be HOT.

5. Confirm that the output bin rollers are turning.
6. Remove the ITB and inspect it for any damage and debris. If damaged, replace the ITB.

For instructions:

Part number: RM2-6576-000CN

7. Perform a manual sensor test and check the fuser delivery sensor SR9. If the sensor test fails, replace the fuser assembly.
8. Replace the fuser.

Table 6-14 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.

 **NOTE:** After replacing the fuser kit, reset the fuser page counter by selecting the [New Fuser Kit](#) in the [Reset Supplies](#) menu.

13.B9.Bz Fuser jam

Multi-feed jam in fuser.


This jam occurs when a near complete overlap of paper is detected or a Multi-feed jam is detected.


- **13.B9.B1** Multi-feed jam is detected when printing from Tray 1.
- **13.B9.B2** Multi-feed jam is detected when printing from Tray 2.
- **13.B9.B3** Multi-feed jam is detected when printing from Tray 3.
- **13.B9.B4** Multi-feed jam is detected when printing from Tray 4.
- **13.B9.BD** Multi-feed jam is detected when printing from the duplexer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.


1. Open the upper right door and then clear any jammed paper.

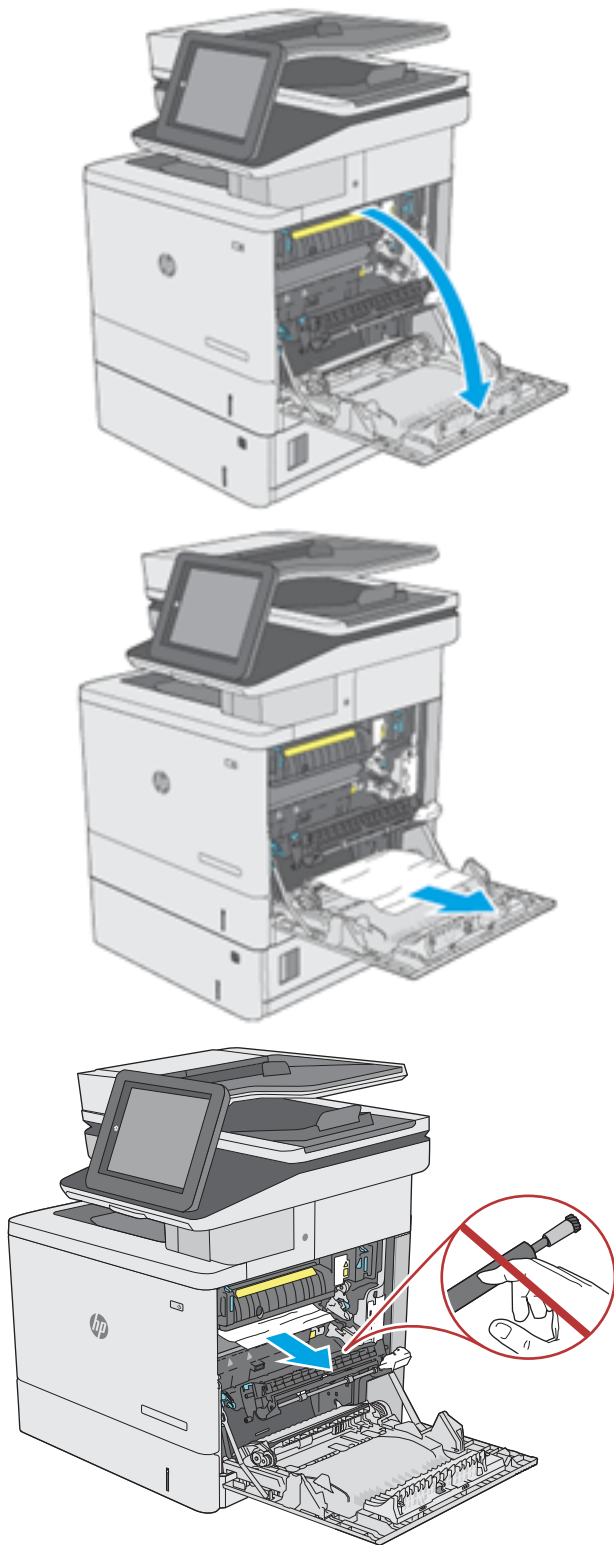

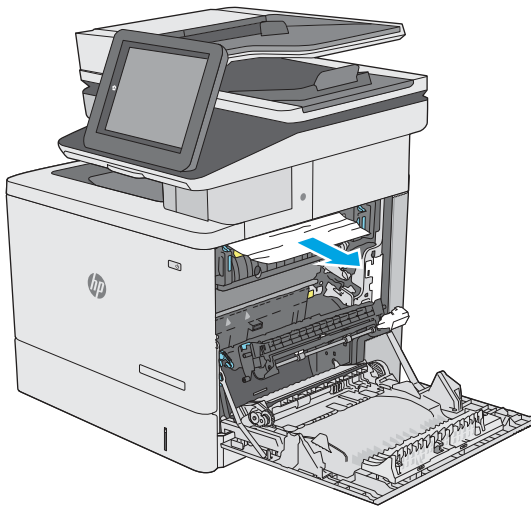

2. Ensure sure that the paper meets the HP printer specifications.
3. Verify there is no debris from a previous jam stuck in the fuser, or the rollers leading into and out of the fuser.

CAUTION: The fuser might be HOT.

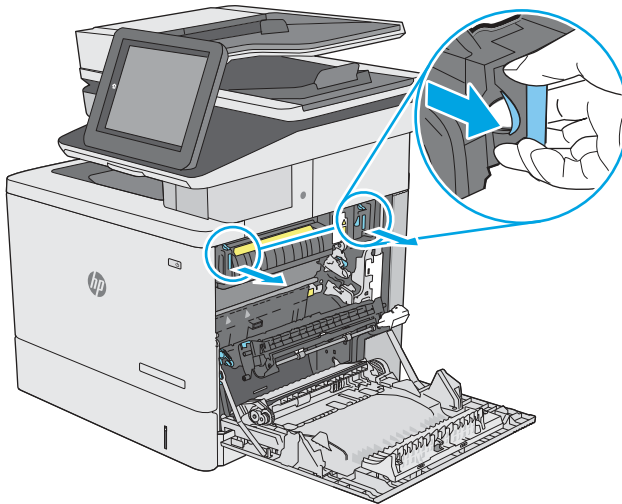

4. If damaged, replace the fuser.

Table 6-15 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.

NOTE: After replacing the fuser kit, reset the fuser page counter by selecting the [New Fuser Kit](#) in the [Reset Supplies](#) menu.

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the right door and clear the jam in the indicated area.
2. Close the door to allow the printer to attempt to clear the jam.
3. Ensure sure that the paper meets the HP printer specifications and is loaded in the trays correctly.
4. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
5. Ensure that the pickup, feed, and separation rollers for the specified tray are installed correctly and show no damage or wear.
6. Clean or replace the pickup, feed, and separation rollers as needed.

Part number: B5L24-67904

7. Check the fuser delivery sensor for correct functionality and movement.

 **CAUTION:** The fuser might be hot.

8. Verify there is no debris from a previous jam stuck in the fuser, or the rollers leading into and out of the fuser.
9. Confirm that the output bin rollers are turning.
10. Perform a manual sensor test and check the fuser delivery sensor SR9 and the fuser loop sensor PS1. If either sensor fails, replace the fuser assembly.
11. Replace the fuser assembly.

Table 6-16 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.

 **NOTE:** After replacing the fuser kit, reset the fuser page counter by selecting the [New Fuser Kit](#) in the [Reset Supplies](#) menu.

13.B9.Cz

Fuser Wrap Jam.

This jam occurs when the paper disappears from the fuser output sensor before a designated amount of time after the paper reached the fuser output sensor (SR9).

It is determined that the paper is being wrapped around the fuser roller.


Z = Fuser mode


- **13.B9.C1** Fuser wrap jam when **Auto Sense (Normal)**.
- **13.B9.C2** Fuser wrap jam when **Normal**.
- **13.B9.C3** Fuser wrap jam when **Light 1** or **Light 2**.
- **13.B9.C4** Fuser wrap jam when **Heavy 1**.
- **13.B9.C5** Fuser wrap jam when **Heavy 2**.
- **13.B9.C6** Fuser wrap jam when **Heavy Paper 3**.
- **13.B9.C7** Fuser wrap jam when **Glossy Paper 1**.
- **13.B9.C8** Fuser wrap jam when **Glossy Paper 2**.
- **13.B9.C9** Fuser wrap jam when **Glossy Paper 3**.
- **13.B9.CB** Fuser wrap jam when **Transparency**.
- **13.B9.CC** Fuser wrap jam when **Label**.
- **13.B9.CD** Fuser wrap jam when **Envelope 1** or **Envelope 2**.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the upper right door and then clear any jammed paper.

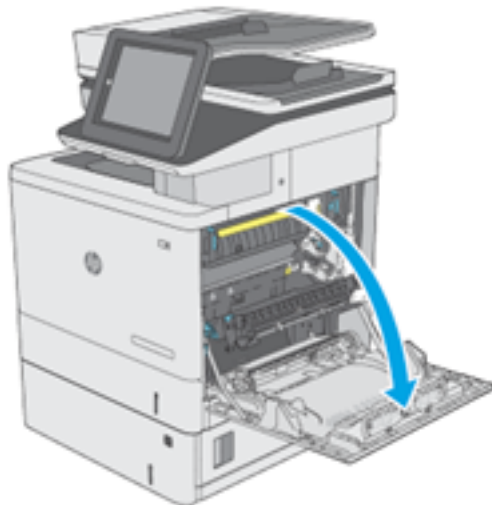


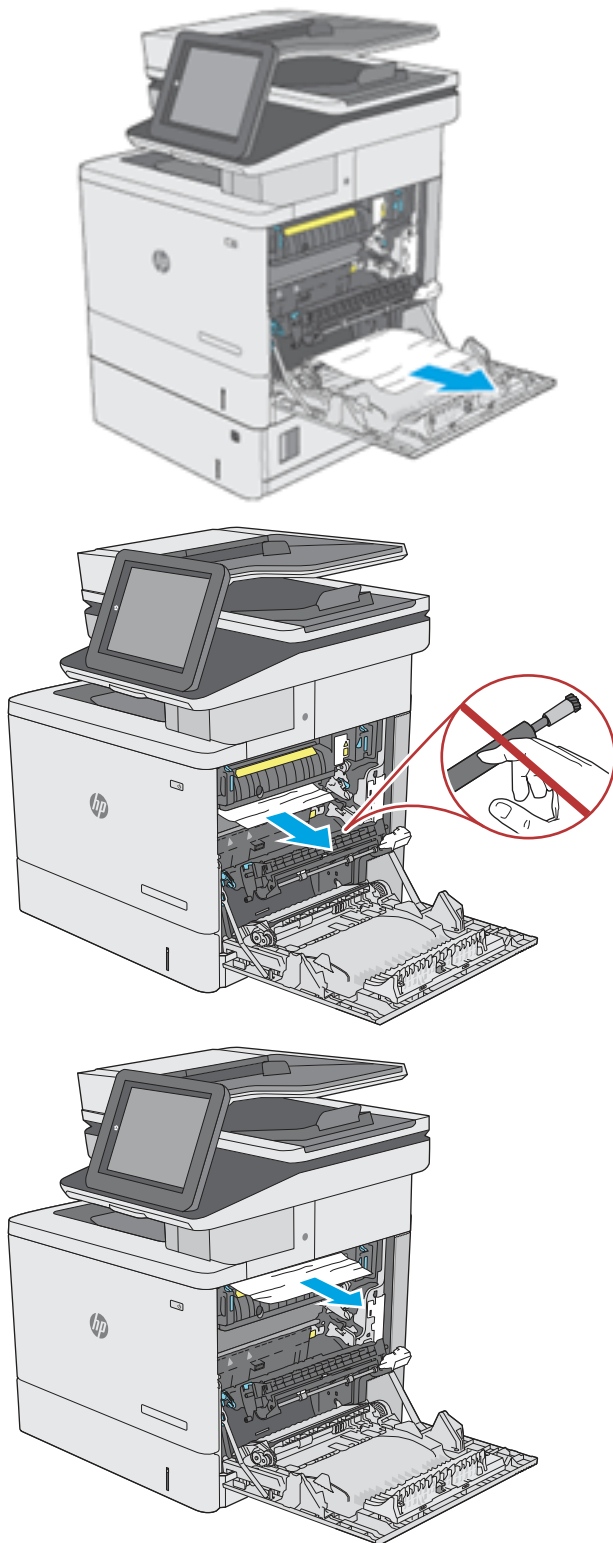

2. Ensure sure that the paper meets the HP printer specifications.

3. Verify there is no debris from a previous jam stuck in the fuser, or the rollers leading into and out of the fuser.

CAUTION: The fuser might be HOT.

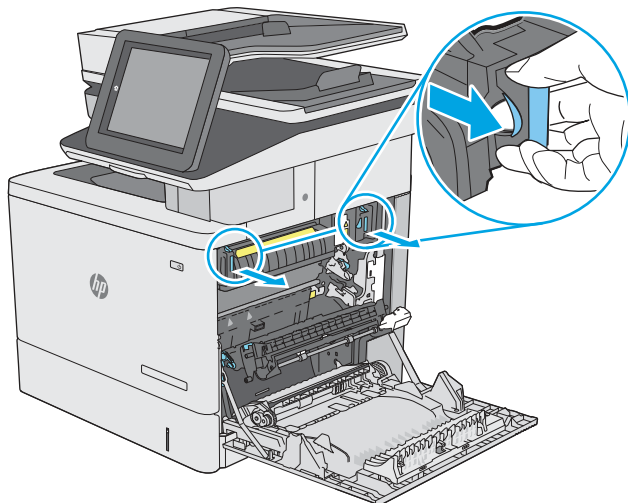

4. If damaged, replace the fuser.

Table 6-17 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.

NOTE: After replacing the fuser kit, reset the fuser page counter by selecting the [New Fuser Kit](#) in the [Reset Supplies](#) menu.

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the upper right door and then clear any jammed paper found.

CAUTION: The fuser might be hot.

2. Ensure sure that the paper meets the HP printer specifications.
3. Remove the fuser, and remove any paper wrapped around the fuser roller.
4. Reinstall the fuser, and then close the door.
5. Print a cleaning page to ensure that all of the toner is removed from the fuser roller.

6. Use the manual sensor tests to toggle the fuser output sensor (SR9). If the sensor is not functioning correctly, replace the fuser assembly.
7. If the error persists, the fuser roller or pressure roller might be damaged. Replace the fuser.

Table 6-18 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.



NOTE: After replacing the fuser kit, reset the fuser page counter by selecting the [New Fuser Kit](#) in the [Reset Supplies](#) menu.

13.B9.Dz

Fuser delivery delay jam.

Paper did not reach fuser sensor SR9 within the specified time.

- **13.B9.D1** Fuser delivery delay jam when printing from Tray 1.
- **13.B9.D2** Fuser delivery delay jam when printing from Tray 2.
- **13.B9.D3** Fuser delivery delay jam when printing from Tray 3.
- **13.B9.D4** Fuser delivery delay jam when printing from Tray 4.
- **13.B9.DD** Fuser delivery delay jam when printing with the Duplexer.



The following are possible causes and areas that should be investigated.


- The paper jam is found wrapped around the fuser roller. In this case it is a sign of a worn out fuser.
- The paper jam is found underneath the toner cartridge or in the transfer area. In this case it could be the drum drive or the broken white collar that holds the toner cartridge in position.
- A fuser drive or delivery issue.

Recommended action for customers

Follow these troubleshooting steps in the order presented.


1. Open the upper right door and then clear any jammed paper.

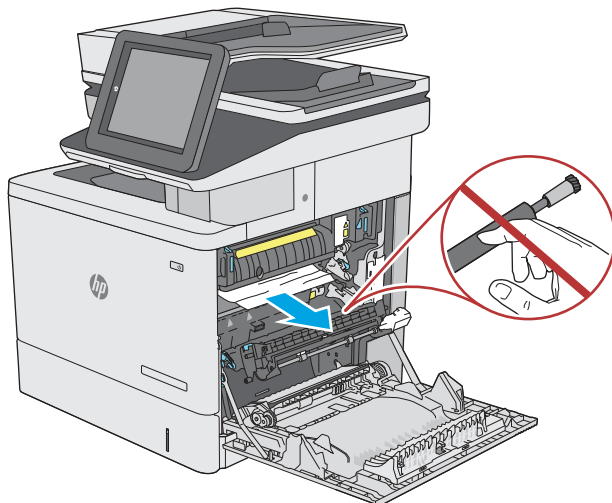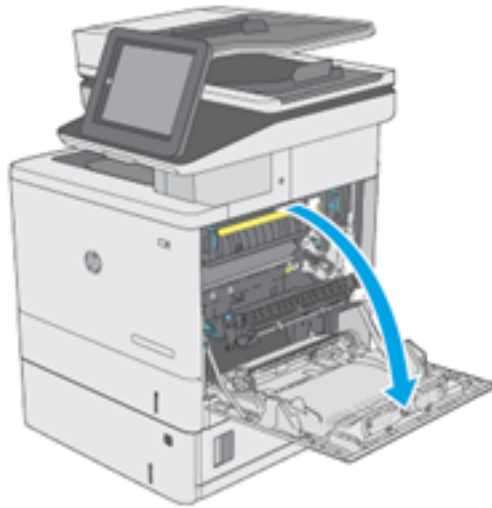

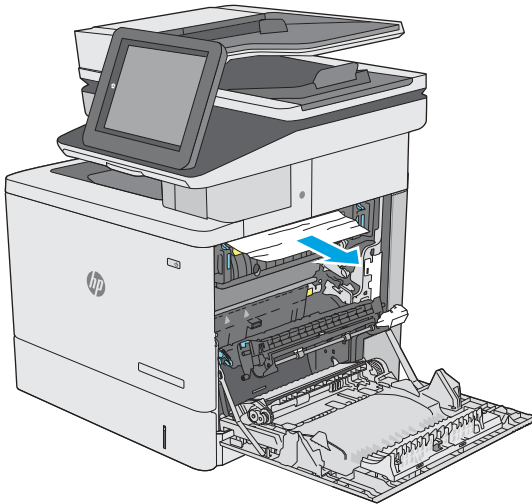

2. Ensure sure that the paper meets the HP printer specifications.
3. Verify there is no debris from a previous jam stuck in the fuser, or the rollers leading into and out of the fuser.

CAUTION: The fuser might be HOT.

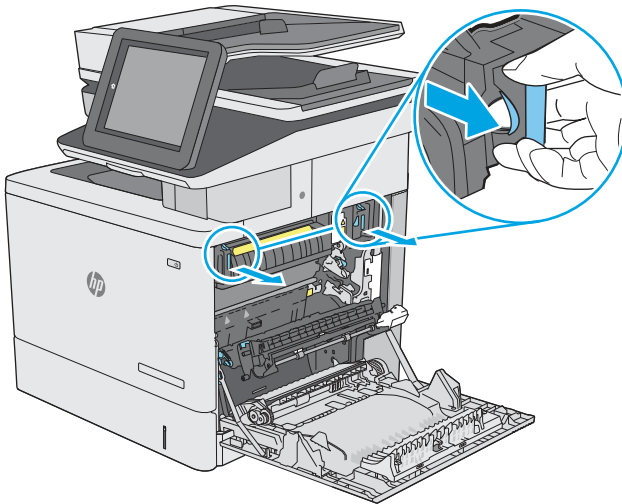

4. If damaged, replace the fuser.

Table 6-19 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.

NOTE: After replacing the fuser kit, reset the fuser page counter by selecting the [New Fuser Kit](#) in the [Reset Supplies](#) menu.

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Determine where the jam is located.
 - a. Open the upper right door and check for paper present in the paper path.
 - b. Remove the fuser and check for paper or obstructions.
2. Paper stopped before fuser.
 - a. Thoroughly check the duplex paper path and the ITB and transfer area for any issues with the rollers, jammed paper, or any obstructions that might be causing the jam.
 - b. Verify that the T2 transfer roller is seated correctly and not worn or deformed. Replace the T2 transfer roller as needed.

Part number: RM2-6575-000CN
 - c. Inspect the transfer feed assembly for debris or damage. Replace the right door sub assembly as needed.

Part number: RM2-0019-000CN
 - d. Remove the ITB and inspect it for any damage and debris. If damaged, replace the ITB.

Part number: RM2-6576-000CN
3. Follow these steps.
 - a. Remove the fuser and inspect fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.
 - b. Verify that fuser inlet guide is not detached or broken
 - c. Open the following menus:
 - [Administration](#)
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - d. Open the following menus:
 - [Administration](#)
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - e. Run the fuser motor drive test using the [Component test](#) to verify that the fuser drive and gears are functioning correctly. If they are not, replace the fuser motor assembly.

Part number: RM2-0077-000CN

13.B9.FF


Residual paper jam at the fuser output sensor.


Paper is present at SR9 at power on or after clearing a jam .

Recommended action for customers

Follow these troubleshooting steps in the order presented.


1. Open the upper right door and then clear any jammed paper.

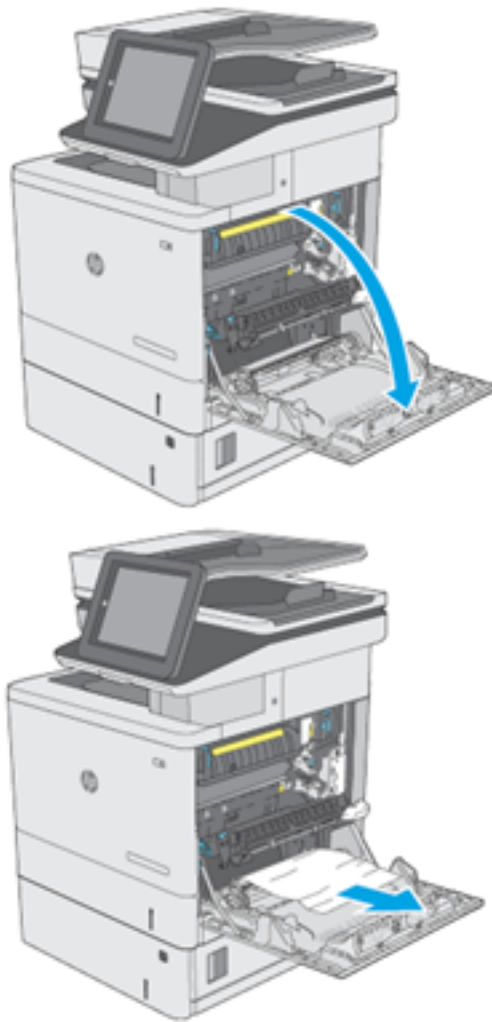

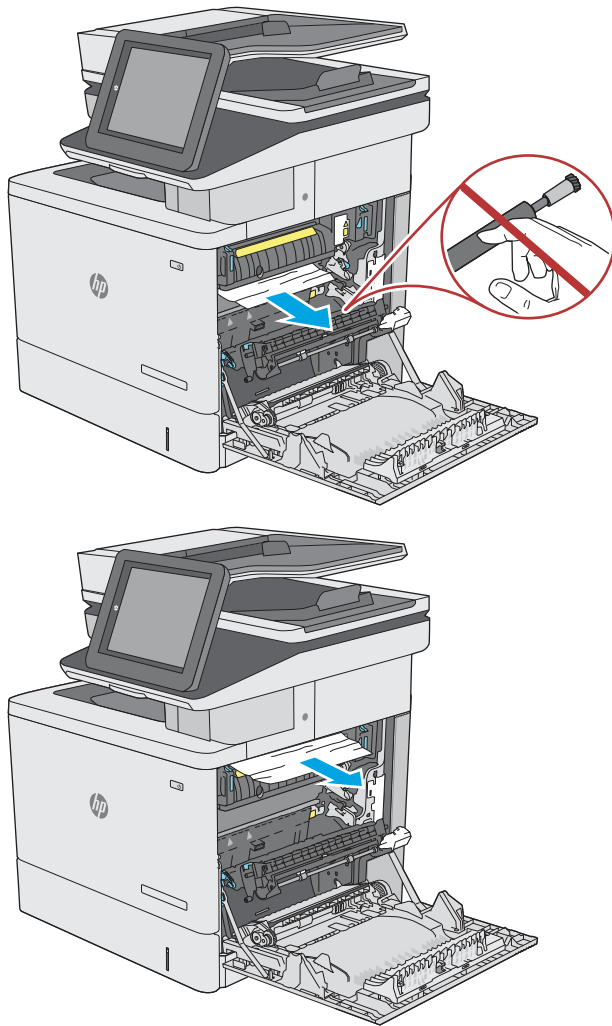

2. Ensure sure that the paper meets the HP printer specifications.
3. Verify there is no debris from a previous jam stuck in the fuser, or the rollers leading into and out of the fuser.

 **CAUTION:** The fuser might be HOT.

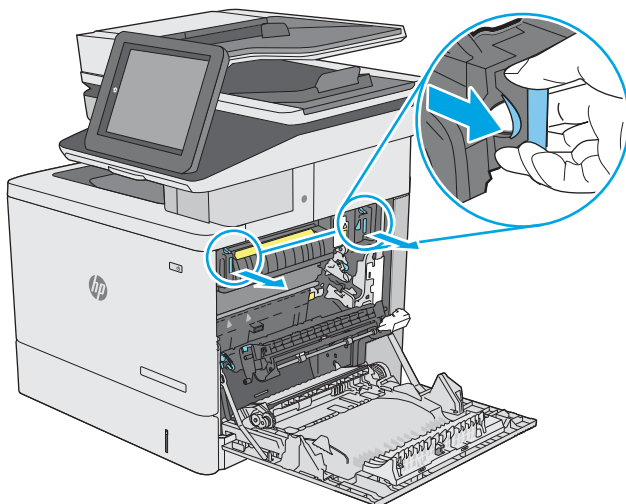

4. If damaged, replace the fuser.

Table 6-20 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.



NOTE: After replacing the fuser kit, reset the fuser page counter by selecting the [New Fuser Kit](#) in the [Reset Supplies](#) menu.

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the right cover and clear the jam in the indicated area.
2. Close the cover to allow the printer to attempt to clear the jam.
3. Verify the paper meets the HP printer specifications.
4. Remove the fuser and inspect the fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.



CAUTION: The fuser might be hot.

5. Open the following menus:

- [Administration](#)
- [Troubleshooting](#)
- [Diagnostic Tests](#)

6. Test the fuser delivery sensor (SR9) using the [Manual Sensor Test](#) to verify that the sensor is functioning correctly. If the test fails, replace the fuser.

Table 6-21 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.



NOTE: After replacing the fuser kit, reset the fuser page counter by selecting the [New Fuser Kit](#) in the [Reset Supplies](#) menu.

7. Run the fuser motor drive test using the [Component Test](#) to verify that the fuser drive and gears are functioning correctly. If they are not, replace the fuser motor assembly.

Part number: RM2-0077-000CN

8. Replace the fuser motor assembly and the fuser.

13.D3.Bz

Multi-feed to duplex re-feed jam

- **13.D3.B1**

The fuser is printing in fuser mode **Auto Sense**.

- **13.D3.B2** The fuser is printing in fuser mode **Normal**.
- **13.D3.B3** The fuser is printing in fuser mode **Light 1** or **Light 2**.
- **13.D3.B4** The fuser is printing in fuser mode **Heavy 1**.
- **13.D3.B5** The fuser is printing in fuser mode **Heavy 2**.
- **13.D3.B6** The fuser is printing in fuser mode **Heavy Paper 3**.
- **13.D3.B7** The fuser is printing in fuser mode **Glossy Paper 1**.
- **13.D3.B8** The fuser is printing in fuser mode **Glossy Paper 2**.
- **13.D3.B9** The fuser is printing in fuser mode **Glossy Paper 3**.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Perform a continuous paper path test in simplex mode of at least 50 pages to ensure that the issue isn't occurring while printing duplex only.
2. Test duplexing from multiple trays to see if the issue is tray specific. If the jam occurs from only one specific tray, troubleshoot the tray for pick and feed issues.
3. Ensure the tray is set correctly. If Tray 1 is set to ANY size ANY type, set it to the size the customer is trying to print on.

4. Check and clean the printer duplex path of any debris or dust.
5. Check and clean the T2 transfer area.
6. Ensure all the connections to the duplex assembly on the DC controller are correctly seated.
7. If needed, replace the duplexer and the fuser, and then test.

Table 6-22 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.



NOTE: After replacing the fuser kit, reset the fuser page counter by selecting the [New Fuser Kit](#) in the [Reset Supplies](#) menu.

13.D3.Dz

Late to duplex re-feed jam.

- **13.D3.D1** The fuser is printing in fuser mode **Auto Sense** special case distinguished from "typed" Normal.
- **13.D3.D2** The fuser is printing in fuser mode **Normal**.
- **13.D3.D3** The fuser is printing in fuser mode **Light 1** or **Light 2**.
- **13.D3.D4** The fuser is printing in fuser mode **Heavy 1**.
- **13.D3.D5** The fuser is printing in fuser mode **Heavy 2**.
- **13.D3.D6** The fuser is printing in fuser mode **Heavy Paper 3**.
- **13.D3.D7** The fuser is printing in fuser mode **Glossy Paper 1**.
- **13.D3.D8** The fuser is printing in fuser mode **Glossy Paper 2**.
- **13.D3.D9** The fuser is printing in fuser mode **Glossy Paper 3**.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Open the right door and clear all paper from the jam area.
2. Perform the continuous test in simplex mode at least 50 pages to ensure that issue is occurring while printing duplex printing only.
3. Test duplexing from multiple trays to see if issue is tray specific or not.

If the jam occurs from only one specific tray, troubleshoot the tray for pick and feed issues.



NOTE: This is the most likely cause of multi-pick jams in the printer.

4. Ensure the tray is set correctly. If Tray 1 is set to ANY size ANY type, set it to the size the customer is trying to print on.
5. Ensure all the connections to the duplex assembly on the DC controller are correctly seated.
6. If needed, replace the duplexer and the fuser, and then test.

Table 6-23 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.



NOTE: After replacing the fuser kit, reset the fuser page counter by selecting the [New Fuser Kit](#) in the [Reset Supplies](#) menu.

13.E5.FF

A power on jam has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Open the trays and covers and clear the any jams found.
2. Close the trays and covers to allow the printer to attempt to clear the jam.
3. Open the following menus:
 - [Administration](#)
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
4. Check the Event Log for any paper jam errors before this error occurred.

If there are specific jam errors listed this can help determine where this residual jam might be located.
5. Use the [Manual Sensor test](#) to check which sensor is active.
6. Depending on the results of testing, remove the paper from the printer or replace the defect part.

13.EA.FF

A door jam has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Check the printer for a open door. Ensure all doors are completely closed.

2. Use the manual sensors test or Tray/Bin manual sensors test to isolate a faulty door switch or sensor.

13.FF.EE

A power on jam has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Open the trays and covers and clear the any jams found.
2. Close the trays and covers to allow the printer to attempt to clear the jam.
3. Open the following menus:
 - [Administration](#)
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
4. Check the Event Log for any paper jam errors before this error occurred.

If there are specific jam errors listed this can help determine where this residual jam might be located.
5. Use the [Manual Sensor test](#) to check which sensor is active.
6. Depending on the results of testing, remove the paper from the printer or replace the defective part.

13.EE.FF

A door jam has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Check the printer for a open door. Ensure all doors are completely closed.
2. Use the manual sensors test or Tray/Bin manual sensors test to isolate a faulty door switch or sensor.

13.FF.FF

A power on residual paper jam has occurred.

This error has no specific sensor designated. It could be any sensor in the paper feed path.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Check the printer for a jam.
2. Look for paper present or obstructions in the paper path. View the event log to determine if other jam errors are occurring and troubleshoot those errors.

3. Use the [Manual Sensors Test](#) or [Tray/Bin Manual Sensors Test](#) to isolate a faulty door switch or sensor.
4. Replace parts as determined by sensor tests, damage, or obstructions.

20.WX.YZ Error Messages

20.* errors

Errors in the 20.* family are related to the printer memory. The page might require more memory than the printer has available.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Touch the **OK** button to continue.
2. Reduce the page complexity.
3. Add product memory.

20 . 00 . 00 Insufficient memory <device>

Event log message 20.00.00.

The printer does not have enough memory to print the page.

The printer received more data than can fit in the available memory. The customer might have tried to transfer too many macros, soft fonts, or complex graphics.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to print the transferred data. Some data might be lost. Reduce the page complexity or add printer memory.

21 . 00 . 00 Page Too ComplexEvent log error message 21.00.00.

The printer displays this message to indicate that the page decompression process was too slow for the printer.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to continue. There may be some data loss on the page that was being formatted when the error occurred.

30.wx.yz error messages

30.* errors

Errors in the 30.* family are related to the flatbed scanner.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Calibrate the scanner. Open these menus: [Device Maintenance > Calibrate-Cleaning > Calibrate Scanner](#).
2. Clean the scanner glass and glass strips.
3. Perform the tests for scanner diagnostics. Open these menus: [Administration > Troubleshooting > Diagnostic Tests > Scanner Tests](#).
4. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

5. Check all connections on the scanner control board and from the scanner control board to the formatter and the DC controller or the engine control board. If all connections are good, replace the scanner control board.
6. Replace the formatter.
7. If the error persists, replace the scanner assembly.

30.01.01

The flatbed cover sensor was interrupted.

The scanner flatbed cover is open.

This message appears only in the event log and is not posted on the control panel.

The control panel will read **Flatbed Cover Open**.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Close the cover. This error message should automatically clear.

2. If the issue persists, complete the following steps:
 - a. Check the sensor in the flatbed assembly to verify if it is damaged or stuck. If it is damaged, replace the image scanner assembly.




- b. Use the Manual Sensor Test to verify the functionality of the Flatbed Cover Sensor. Open the following menus: **Support Tools > Troubleshooting > Diagnostic Tests > Manual Sensor Test**

Open and close the flatbed cover.

The Flatbed cover sensor counter should advance from zero incrementing by one for each open and close of the cover.

Figure 6-30 Flatbed cover option in Manual Sensor Test menu on the printer control panel

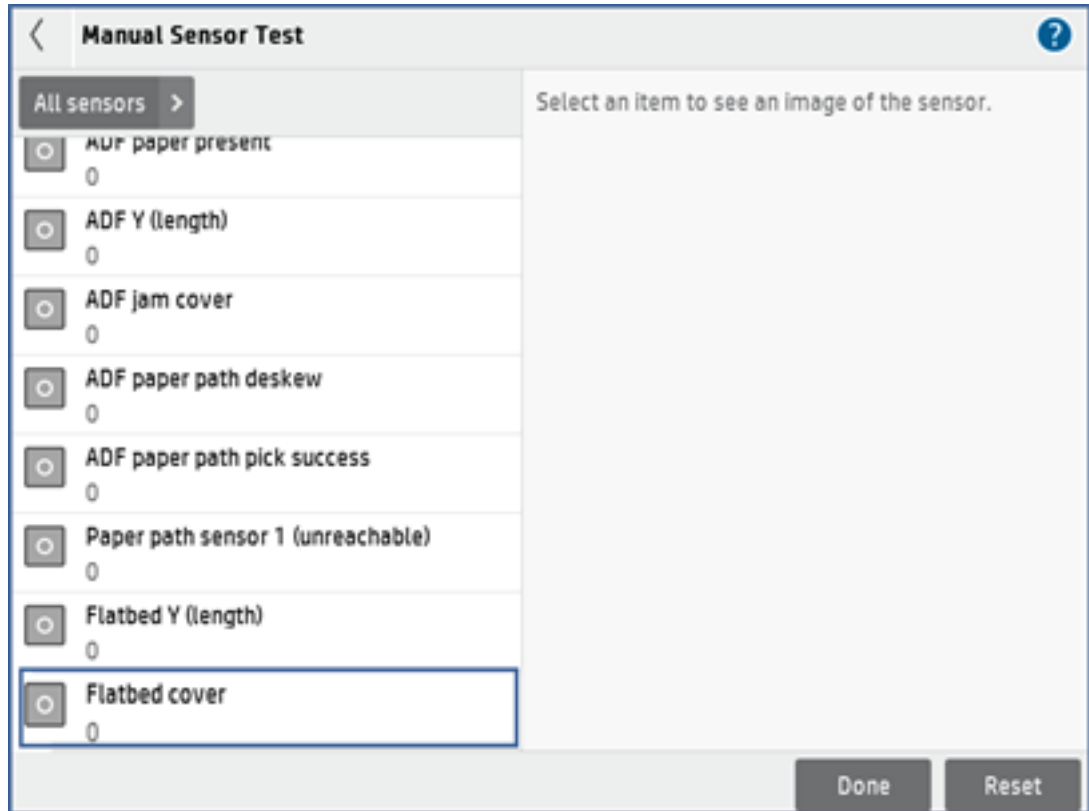

If the flatbed cover sensor not actuate and advance the counter replace the image scanner assembly.

Image scanner assembly, part number: B5L46-67912

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Close the cover. This error message should automatically clear.
2. If the issue persists, complete the following steps:

- a. Check the sensor in the flatbed assembly to verify if it is damaged or stuck. If it is damaged, replace the image scanner assembly.




- b. Use the Manual Sensor Test to verify the functionality of the Flatbed Cover Sensor. Open the following menus: **Support Tools > Troubleshooting > Diagnostic Tests > Manual Sensor Test**

Open and close the flatbed cover.

The Flatbed cover sensor counter should advance from zero incrementing by one for each open and close of the cover.

Figure 6-31 Flatbed cover option in Manual Sensor Test menu on the printer control panel

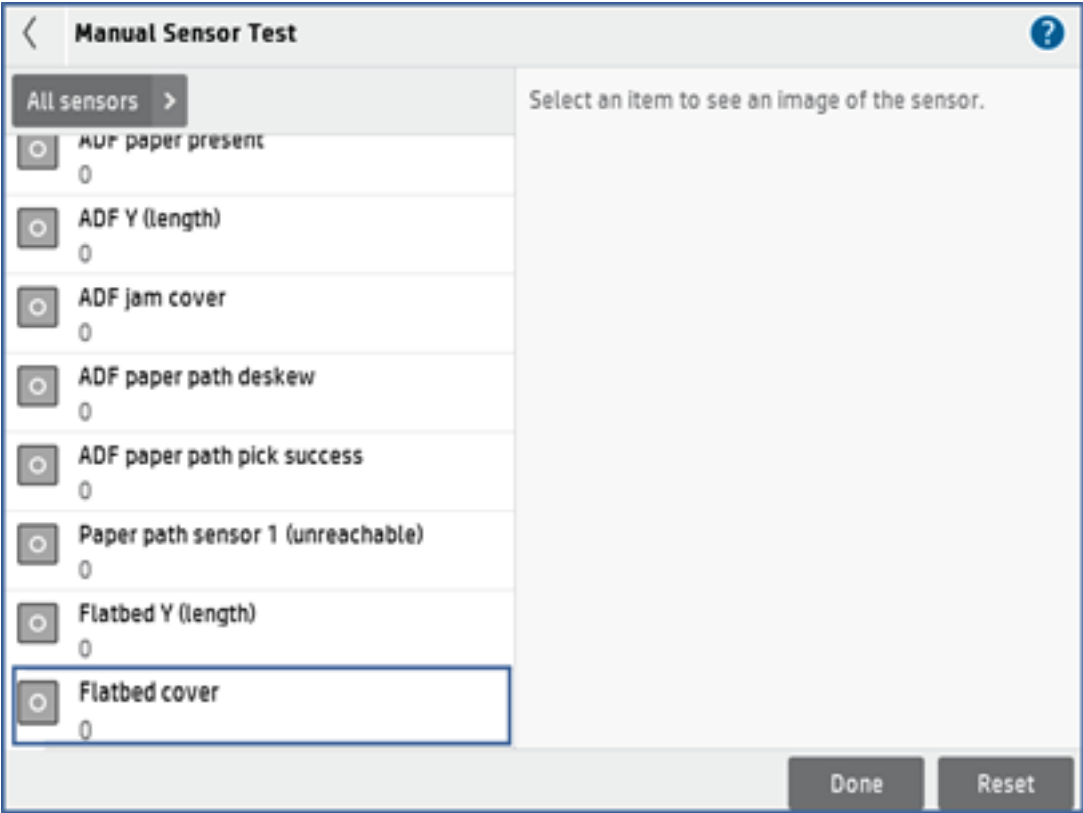


If the flatbed cover sensor not actuate and advance the counter replace the image scanner assembly.

Image scanner assembly, part number: B5L46-67912

For instructions: See the Repair Service Manual for this product.

- 3. If the error persists, disconnect and reconnect all the cables on the scanner control board (SCB).

Figure 6-32 Scanner control board (SCB) connections

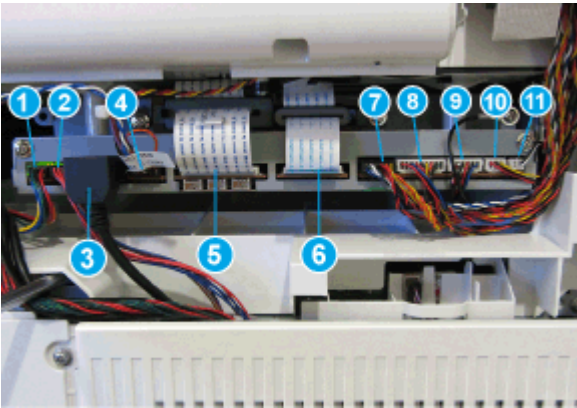

1	Stapler power
2	SCB power (24v)
3	PAB to SCAM communication (HDMI)

4	Flatbed sensors (document feeder open and flatbed paper length_ and cave LED)
5	Flatbed (S1) flat flexible cable (Scanner data and flatbed motor)
6	document feeder (S2) flat flexible cable (scanner data)
7	document feeder motors (feed and deskew)
8	document feeder sensors (prescan, paper present receiver and top hatch)
9	document feeder ultra sonic sensor receiver and deskew sensor
10	LTR/LGL (letter/legal) Input tray sensor
11	Ultra sonic sensor transmitter

4. If the error persists, replace the SCB

Part number: B5L47-67903

For instructions: See the Repair Service Manual for this product.

30 . 01 . 08 Home position error

The scanner optic failed to return to the home position.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware is installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).
For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).
3. Observe the movement of the optics assembly.
4. If the error persists after the firmware update and /or the optics assembly fails to move correctly, perform a Continuous Scan diagnostic test using the printer control panel to test the functionality of the scan optics.
 - a. From the Home screen on the control panel, scroll to and touch [Support Tools](#).




NOTE: The control panel menu options might vary depending on the printer model and firmware version installed.

- b. Open the following menus: **Troubleshooting > Diagnostic Tests**.
- c. Select [Continuous Scan](#).

- d. Select [Start](#) to run the test.

Figure 6-33 Start the Continuous Scan test

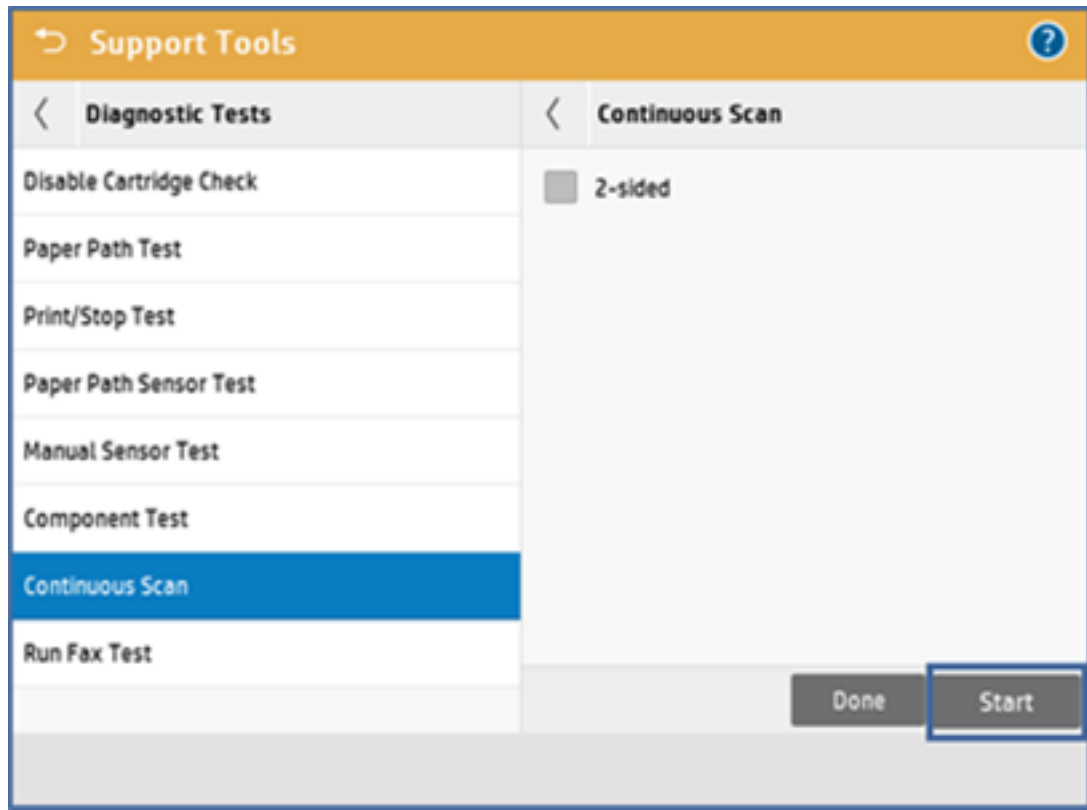

- e. Check if the scan head moves from the home position through the scan, and back to the home position.



NOTE: The scan head should actuate, moving from the home position through a scan, and back to the home position. This process will repeat until interrupted.

5. If the error persists, replace the image scanner assembly kit.

Part number: B5L46-67912

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware is installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. Observe the movement of the optics assembly.
4. If the error persists after the firmware update and /or the optics assembly fails to move correctly, perform a Continuous Scan diagnostic test using the printer control panel to test the functionality of the scan optics.


- a. From the Home screen on the control panel, scroll to and touch [Support Tools](#) .



NOTE: The control panel menu options might vary depending on the printer model and firmware version installed.

- b. Open the following menus: **Troubleshooting > Diagnostic Tests**.
- c. Select [Continuous Scan](#).
- d. Select [Start](#) to run the test.

Figure 6-34 Start the Continuous Scan test

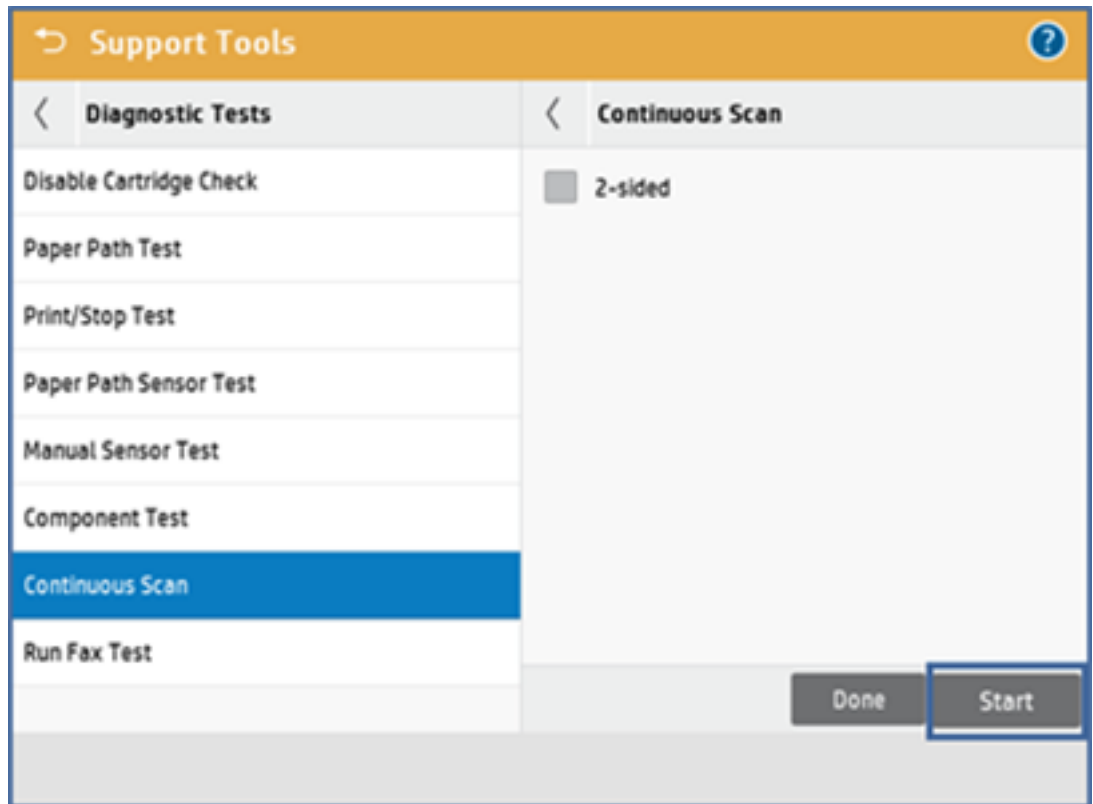

- e. Check if the scan head moves from the home position through the scan, and back to the home position.




NOTE: The scan head should actuate, moving from the home position through a scan, and back to the home position. This process will repeat until interrupted.

5. If the error persists, turn the printer off, and then disconnect and reconnect all the cables on the scanner control board (SCB) and retest for functionality.

Figure 6-35 Scanner connection



Figure 6-36 Scanner control board (SCB) connections

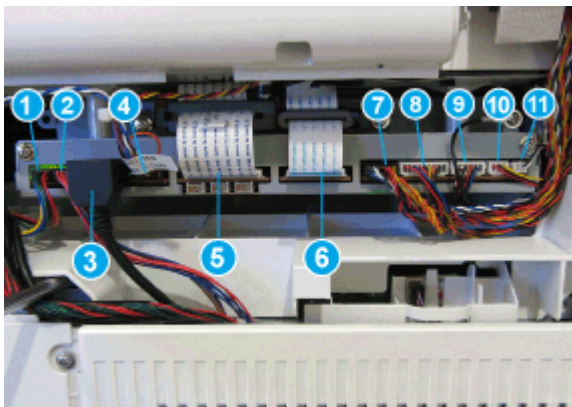

1	Stapler power
2	SCB power (24v)
3	PAB to SCAM communication (HDMI)
4	Flatbed sensors (document feeder open and flatbed paper length_ and cave LED)
5	Flatbed (S1) flat flexible cable (Scanner data and flatbed motor)
6	document feeder (S2) flat flexible cable (scanner data)
7	document feeder motors (feed and skew)
8	document feeder sensors (prescan, paper present receiver and top hatch)
9	document feeder ultra sonic sensor receiver and skew sensor
10	LTR/LGL (letter/legal) Input tray sensor
11	Ultra sonic sensor transmitter

6. If the error persists, replace the image scanner assembly kit.

Part number: B5L46-67912

For instructions: See the Repair Service Manual for this product.

30 . 01 . 14 Scan system EEPROM error

SCB EEPROM error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware is installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the issue persist with the latest firmware, replace the scanner control board (SCB).

Part number: B5L47-67903

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.


1. Turn the printer off, and then on.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware is installed. If the firmware is not on the latest version, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, turn the printer off, and then disconnect and reconnect all the cables on the scanner control board (SCB) and retest for functionality.

Figure 6-37 Scanner control board (SCB) connections

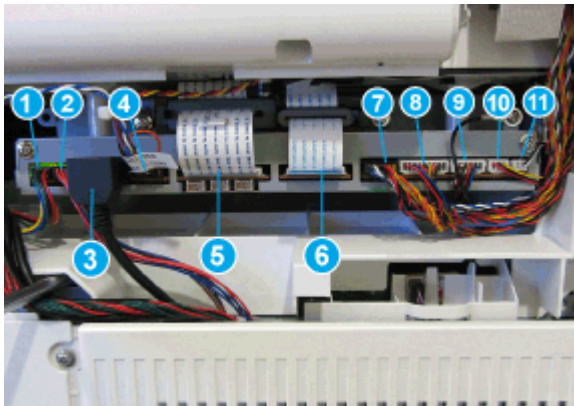

1	Stapler power
2	SCB power (24v)
3	PAB to SCAM communication (HDMI)
4	Flatbed sensors (document feeder open and flatbed paper length_ and cave LED
5	Flatbed (S1) flat flexible cable (Scanner data and flatbed motor)
6	document feeder (S2) flat flexible cable (scanner data)
7	document feeder motors (feed and deskew)
8	document feeder sensors (prescan, paper present receiver and top hatch)
9	document feeder ultra sonic sensor receiver and deskew sensor
10	LTR/LGL (letter/legal) Input tray sensor
11	Ultra sonic sensor transmitter

4. If the error persists, replace the SCB.

Part number: B5L47-67903

For instructions: See the Repair Service Manual for this product.

30 . 01 . 41 Scanner error

The formatter lost connections with the SCB or communication was corrupted.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, disconnect the power cable from the printer and wait 1-minute before reconnecting power and turning the printer on.
2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, dispatch a service technician to diagnosis the issue further.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.


1. Turn the printer off, disconnect the power cable from the printer, and wait 1-minute before reconnecting power and turning the printer on.
2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. if the error persists, turn the printer off, and then disconnect and reconnect all the cables on the scanner control board (SCB) and retest for functionality.


Figure 6-38 Scanner control board (SCB) connections

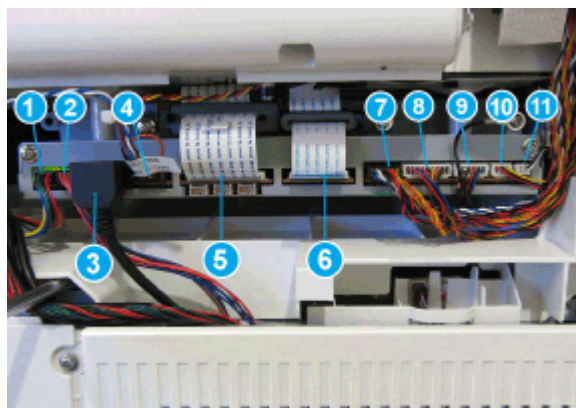

1	Stapler power
2	SCB power (24v)
3	PAB to SCAM communication (HDMI)
4	Flatbed sensors (document feeder open and flatbed paper length_ and cave LED
5	Flatbed (S1) flat flexible cable (Scanner data and flatbed motor)
6	document feeder (S2) flat flexible cable (scanner data)

7	document feeder motors (feed and deskew)
8	document feeder sensors (prescan, paper present receiver and top hatch)
9	document feeder ultra sonic sensor receiver and deskew sensor
10	LTR/LGL (letter/legal) Input tray sensor
11	Ultra sonic sensor transmitter

4. If the error persists, turn the product off, and then verify that all cables on the formatter and scanner control board (SCB) are correctly connected and seated.

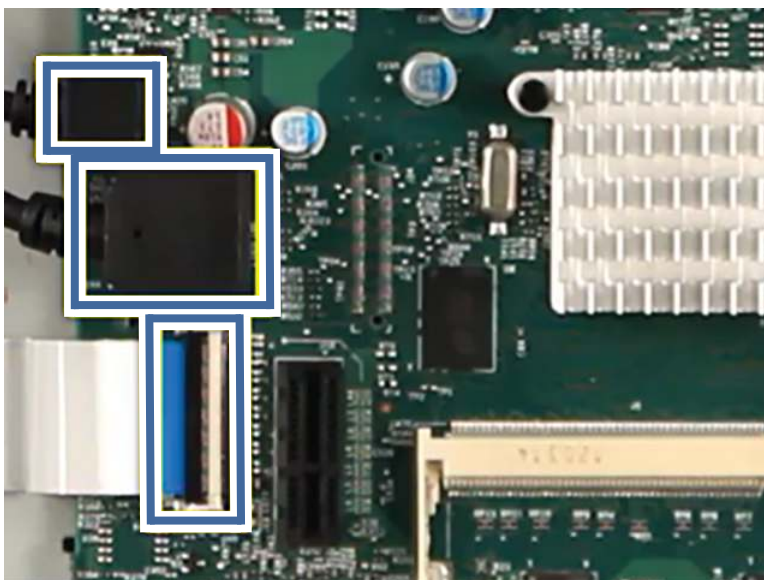

5. If the error persists, replace the SCB.

Part number: B5L47-67903

For instructions: See the Repair Service Manual for this product.

6. If the error persists, turn the printer off. Lift the ADF so the flatbed glass is visible. Turn the printer on.

- **Outcome 1:** Flatbed scanner lamp does NOT light and/or the scan head assembly does not move. Replace the Integrated Scanner Assembly (ISA).

Integrated Scanner Assembly (ISA), part number: B5L46-67912

For instructions: See the Repair Service Manual for this product.

- **Outcome 2:** Flatbed scanner lamp DOES light and/or scan head assembly moves, replace the Automatic Document Feeder (ADF).

Table 6-24 Document feeder part numbers

Description	HP Part Number
Document feeder (M577c/z) kit	B5L47-67909
Document feeder (M577dn/f) kit	B5L47-67908

For instructions: See the Repair Service Manual for this product.

7. If after replacing the ISA and the ADF and the error persists, elevate the case using your regional elevation process.

30 . 01 . 43 SCB memory failure

SCB memory error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, turn the printer off. Remove and reseal the formatter. Then turn the printer on.
3. If the error persists, replace the scanner control board (SCB).



IMPORTANT: Add notes for on-site technician to disconnect and reconnect all cables on the SCB for before replacing any parts.

Part number: B5L47-67903


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, turn the printer off. Remove and reseal the formatter. Then turn the printer on.

3. If the error persists, disconnect and reconnect all cables between the formatter and scanner control board.

Figure 6-39 Scanner control board (SCB) connections

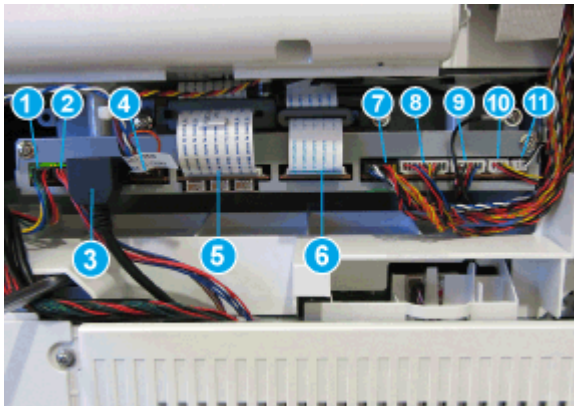

1	Stapler power
2	SCB power (24v)
3	PAB to SCAM communication (HDMI)
4	Flatbed sensors (document feeder open and flatbed paper length_ and cave LED
5	Flatbed (S1) flat flexible cable (Scanner data and flatbed motor)
6	document feeder (S2) flat flexible cable (scanner data)
7	document feeder motors (feed and deskew)
8	document feeder sensors (prescan, paper present receiver and top hatch)
9	document feeder ultra sonic sensor receiver and deskew sensor
10	LTR/LGL (letter/legal) Input tray sensor
11	Ultra sonic sensor transmitter

4. If the error persists, replace the scanner control board (SCB).
Part number: B5L47-67903
For instructions: See the Repair Service Manual for this product.
5. If the error persists, replace the HDMI cable connecting the SCB to the formatter.
Formatter to SCB HDMI Cable: F2A76-50004
6. If the error persists, replace the formatter.

Table 6-25 Part numbers

Description	HP Part Number
Formatter (E55040)	B5L26-67901
Formatter (E55040 India and China only)	B5L26-67902
Formatter (M577, E57540)	B5L46-67909
Formatter (M577 models only)(India and China)	B5L46-67911

Table 6-25 Part numbers (continued)

Description	HP Part Number
Formatter (M578)	7ZU85-67903
Formatter (M578 China/India)	7ZU85-67904

For instructions: See the Repair Service Manual for this product.

30.01.44

SCB communication error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, disconnect the power cable from the printer and wait 1-minute before reconnecting power and turning the printer on.
2. Update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, turn the printer off. Lift the ADF so the flatbed glass is visible. Turn the printer on.
 - **Outcome 1:** Flatbed scanner lamp does NOT light and/or scan head assembly doesn't move, replace the Integrated Scanner Assembly (ISA).

Integrated Scanner Assembly (ISA), part number: B5L46-67912

- **Outcome 2:** Flatbed scanner lamp DOES light and/or scan head assembly moves, replace the Automatic Document Feeder (ADF).

Table 6-26 Document feeder part numbers

Description	HP Part Number
Document feeder (M577c/z) kit	B5L47-67909
Document feeder (M577dn/f) kit	B5L47-67908

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.


1. Turn the printer off, disconnect the power cable from the printer and wait 1-minute before reconnecting power and turning the printer on.
2. If the error persists, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).


3. If the error persists, turn the printer off, and then disconnect and reconnect all the cables on the scanner control board (SCB) and retest for functionality.

Figure 6-40 Scanner control board (SCB) connections

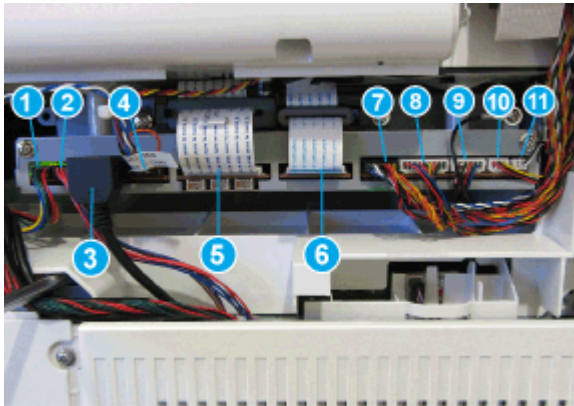

1	Stapler power
2	SCB power (24v)
3	PAB to SCAM communication (HDMI)
4	Flatbed sensors (document feeder open and flatbed paper length_ and cave LED
5	Flatbed (S1) flat flexible cable (Scanner data and flatbed motor)
6	document feeder (S2) flat flexible cable (scanner data)
7	document feeder motors (feed and skew)
8	document feeder sensors (prescan, paper present receiver and top hatch)
9	document feeder ultra sonic sensor receiver and skew sensor
10	LTR/LGL (letter/legal) Input tray sensor
11	Ultra sonic sensor transmitter

4. If the error persists, turn the product off, and then verify that all cables on the formatter and scanner control board (SCB) are correctly connected and seated.

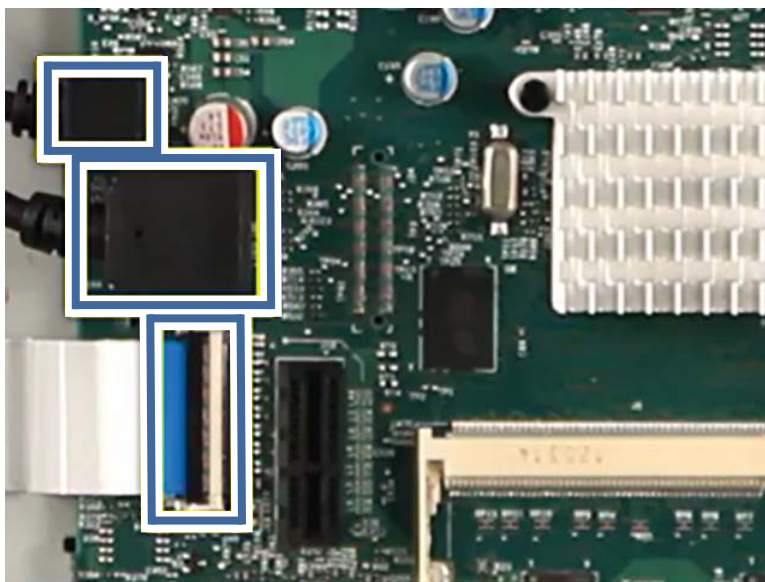

5. If the error persists, replace the Integrated Scanner Assembly (ISA).
Integrated Scanner Assembly (ISA), part number: B5L46-67912
For instructions: See the Repair Service Manual for this product.
6. If the error persists on a Flow model only, the failure might be in the second side scanner of the document feeder. Replace the document feeder.

Table 6-27 Document feeder part numbers

Description	HP Part Number
Document feeder (M577c/z) kit	B5L47-67909
Document feeder (M577dn/f) kit	B5L47-67908

For instructions: See the Repair Service Manual for this product.

7. If the ISA and ADF have been replaced, and the issue persists replace the Scanner Controller Board (SCB).

Scanner Controller Board (SCB), part number: B5L47-67903

For instructions:

See the Repair Service Manual for this product.

8. If the error persists, replace the formatter.

Table 6-28 Part numbers

Description	HP Part Number
Formatter (E55040)	B5L26-67901
Formatter (E55040 India and China only)	B5L26-67902

Table 6-28 Part numbers (continued)

Description	HP Part Number
Formatter (M577, E57540)	B5L46-67909
Formatter (M577 models only)(India and China)	B5L46-67911
Formatter (M578)	7ZU85-67903
Formatter (M578 China/India)	7ZU85-67904

For instructions: See the Repair Service Manual for this product.

9. If the error persists, replace the HDMI cable connecting the SCB to the formatter.

Formatter to SCB HDMI Cable: F2A76-50004

30.01.45 Scanner error

The formatter lost connections with the SCB or communication was corrupted.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, disconnect the power cable from the printer and wait 1-minute before reconnecting power and turning the printer on.
2. Update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, turn the printer off. Lift the ADF so the flatbed glass is visible. Turn the printer on.
 - **Outcome 1:** Flatbed scanner lamp does NOT light and/or scan head assembly doesn't move, replace the Integrated Scanner Assembly (ISA).
Integrated Scanner Assembly (ISA), part number: B5L46-67912
 - **Outcome 2:** Flatbed scanner lamp DOES light and/or scan head assembly moves, replace the Automatic Document Feeder (ADF).

Table 6-29 Document feeder part numbers

Description	HP Part Number
Document feeder (M577c/z) kit	B5L47-67909
Document feeder (M577dn/f) kit	B5L47-67908

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.


1. Turn the printer off, disconnect the power cable from the printer and wait 1-minute before reconnecting power and turning the printer on.
2. If the error persists, update the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).


3. If the error persists, turn the printer off, and then disconnect and reconnect all the cables on the scanner control board (SCB) and retest for functionality.

Figure 6-41 Scanner control board (SCB) connections

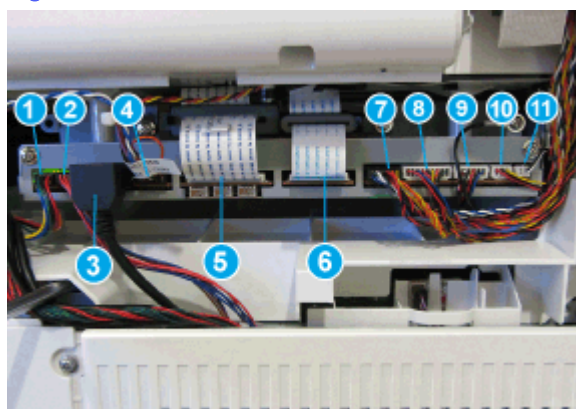

1	Stapler power
2	SCB power (24v)
3	PAB to SCAM communication (HDMI)
4	Flatbed sensors (document feeder open and flatbed paper length_ and cave LED)
5	Flatbed (S1) flat flexible cable (Scanner data and flatbed motor)
6	document feeder (S2) flat flexible cable (scanner data)
7	document feeder motors (feed and deskew)
8	document feeder sensors (prescan, paper present receiver and top hatch)
9	document feeder ultra sonic sensor receiver and deskew sensor
10	LTR/LGL (letter/legal) Input tray sensor
11	Ultra sonic sensor transmitter

4. If the error persists, turn the product off, and then verify that all cables on the formatter and scanner control board (SCB) are correctly connected and seated.

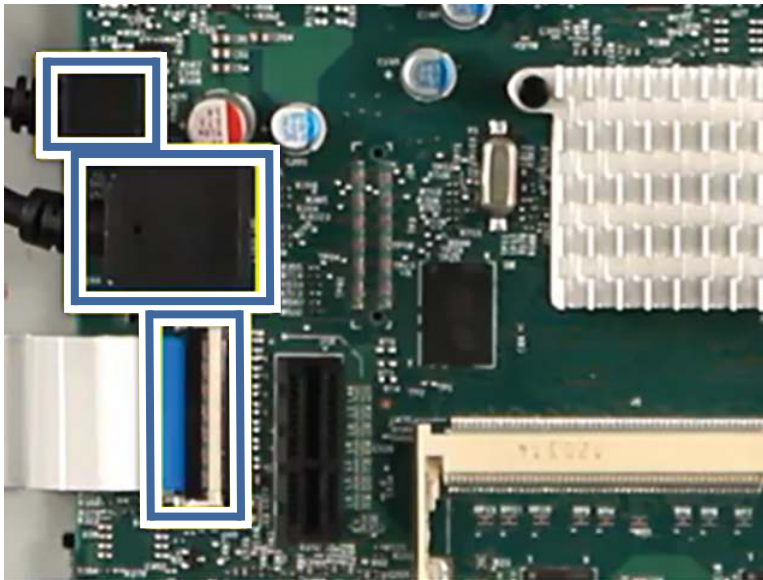

5. If the error persists, replace the Integrated Scanner Assembly (ISA).
Integrated Scanner Assembly (ISA), part number: B5L46-67912
For instructions: See the Repair Service Manual for this product.
6. If the error persists on a Flow model only, the failure might be in the second side scanner of the document feeder. Replace the document feeder.

Table 6-30 Document feeder part numbers

Description	HP Part Number
Document feeder (M577c/z) kit	B5L47-67909
Document feeder (M577dn/f) kit	B5L47-67908

For instructions: See the Repair Service Manual for this product.

7. If the ISA and ADF have been replaced, and the issue persists replace the Scanner Controller Board (SCB).

Scanner Controller Board (SCB), part number: B5L47-67903

For instructions:

See the Repair Service Manual for this product.

8. If the error persists, replace the formatter.

Table 6-31 Part numbers

Description	HP Part Number
Formatter (E55040)	B5L26-67901
Formatter (E55040 India and China only)	B5L26-67902

Table 6-31 Part numbers (continued)

Description	HP Part Number
Formatter (M577, E57540)	B5L46-67909
Formatter (M577 models only)(India and China)	B5L46-67911
Formatter (M578)	7ZU85-67903
Formatter (M578 China/India)	7ZU85-67904

For instructions: See the Repair Service Manual for this product.

9. If the error persists, replace the HDMI cable connecting the SCB to the formatter.

Formatter to SCB HDMI Cable: F2A76-50004

30 . 01 . 46 Scanner Error

Scanner firmware error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, turn the printer off and remove and reseal the formatter. Then turn the printer on.
3. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

4. If the error persists, replace the image scanner control board (SCB).

Part number: B5L47-67903

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.


1. Turn the printer off, and then on.

2. If the error persists, turn the printer off and remove and reseal the formatter. Then turn the printer on.
3. If the error persists, Upgrade the firmware.
Go to [HP FutureSmart - Latest Firmware Versions](#).
For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).
4. If the error persists, turn the printer off, and then disconnect and reconnect all the cables on the scanner control board (SCB) and retest for functionality.

Figure 6-42 Scanner connection



Figure 6-43 Scanner control board (SCB) connections

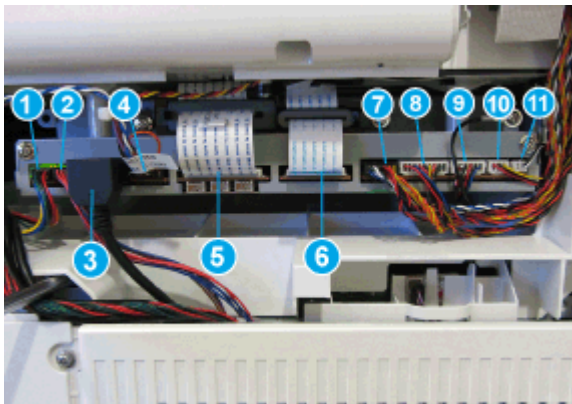

1	Stapler power
2	SCB power (24v)
3	PAB to SCAM communication (HDMI)
4	Flatbed sensors (document feeder open and flatbed paper length_ and cave LED
5	Flatbed (S1) flat flexible cable (Scanner data and flatbed motor)
6	document feeder (S2) flat flexible cable (scanner data)

7	document feeder motors (feed and deskew)
8	document feeder sensors (prescan, paper present receiver and top hatch)
9	document feeder ultra sonic sensor receiver and deskew sensor
10	LTR/LGL (letter/legal) Input tray sensor
11	Ultra sonic sensor transmitter

5. If the error persists, replace the scanner control board (SCB).

Part number: B5L47-67903

For instructions:

See the Repair Service Manual for this product.

30.03.14

A non-fatal error has occurred.

A scanner EEPROM (NVM) error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Validate that the error code is persistent.
3. If image quality is a problem, ask for an example image.
4. If the error occurs after simplex scanning or copying, replace the image scanner kit.

Part number: B5L46-67912

For instructions: See the Repair Service Manual for this product.

5. If the error persists after duplex scanning or copying, replace the document feeder.

For instructions: See the Repair Service Manual for this product.

Table 6-32 Part numbers

Description	HP Part Number
Document feeder (M577c/z) kit	B5L47-67907
Document feeder (M577dn/f) kit	B5L47-67906

30.03.20

Front side scanner not detected.

Recommended action for customers

Follow these troubleshooting steps in the order presented.


- 1. Turn the printer off, and then on.
- 2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

- 1. Turn the printer off, and then on.
- 2. Verify that the FFCs between scanner and the SCB are connected.

Figure 6-44 Scanner control board (SCB) connections

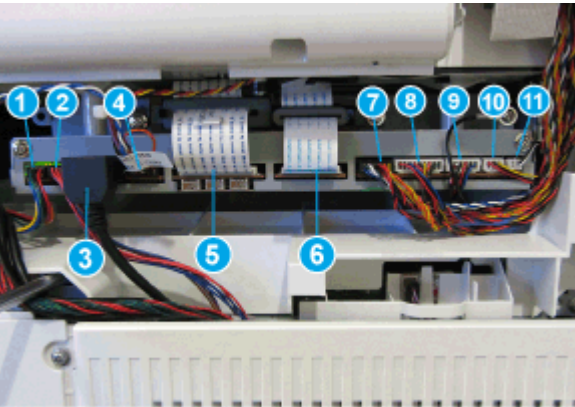

1	Stapler power
2	SCB power (24v)
3	PAB to SCAM communication (HDMI)
4	Flatbed sensors (document feeder open and flatbed paper length_ and cave LED
5	Flatbed (S1) flat flexible cable (Scanner data and flatbed motor)
6	document feeder (S2) flat flexible cable (scanner data)
7	document feeder motors (feed and deskew)
8	document feeder sensors (prescan, paper present receiver and top hatch)
9	document feeder ultra sonic sensor receiver and deskew sensor
10	LTR/LGL (letter/legal) Input tray sensor
11	Ultra sonic sensor transmitter

- 3. Replace the image scanner assembly.

Part number: B5L46-67912

For instructions: See the Repair Service Manual for this product.

30 . 03 . 22 Scanner failure

Front side illumination calibration failure.

The scan module cannot see the illumination module, or marginal illumination.

The optical assembly may not be parked under the calibration strip.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the printer and scanner firmware.
3. If the error persists, please contact customer support.

Recommended action call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the printer and scanner firmware.
3. If the error persists, please contact customer support.
4. Check the event log for other scanner errors. If the errors are present, resolve those errors.
5. Reseat the image scanner FFC connection.
6. Under the troubleshooting menu, run a "Continuous Scan" single sided to verify that the flatbed scan assembly moves freely and the scanner bulb is illuminated.
7. Replace the image scanner kit.

Table 6-33 Part number for image scanner kit (ISA)

Part description	Part number
Integrated scanner whole unit assembly	B5L46-67912

For instructions: See the Repair Service Manual for this product.

30 . 03 . 23 Scanner failure

Front side illumination calibration failure.

The scan module cannot see the illumination module, or marginal illumination.

The optical assembly may not be parked under the calibration strip.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.
3. Check the event log for other scanner errors. If the errors are present, resolve those errors.
4. Reseat the image scanner FFC connection.
5. Under the troubleshooting menu, run a “Continuous Scan” single sided to verify that the flatbed scan assembly moves freely and the scanner bulb is illuminated.
6. Replace the image scanner kit.

For instructions: See the Repair Service Manual for this product.

Part number: B5L46-67912

30 . 03 . 30 Scanner Failure

Flatbed motor shutdown.

The SCB cannot communicate with the flatbed scanner motor.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on. As the printer turns on, verify that the scan head moves.
2. Verify that the drive belt is in the correct position.
3. Run diagnostics on the flatbed scanner to see if the scan bar moves. For this test, run the continuous scan from the scanner test menu.
4. Check all the cable connections on the SCB.
5. Replace the image scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: B5L46-67912

30 . 03 . 45 Scanner Error To continue turn off then on

SCB firmware assertion failure. SCB firmware assertion controls the scan head motor.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, perform a Format Disk procedure using the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives*.

3. Install the latest version of printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

4. Check the printer event log for any errors that occurred prior to 30.03.45
 - If there are 31.XX.XX error codes listed prior to 30.03.45, replace the automatic document feeder (ADF).

Table 6-34 Part numbers

Description	HP Part Number
Document feeder (M577c/z) kit	B5L47-67909
Document feeder (M577dn/f) kit	B5L47-67908

- If there are 30.XX.XX error codes listed prior to 30.03.45, replace the image scanner assembly (ISA).

Part number: B5L46-67912

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technician

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, perform a Format Disk procedure using the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - Or click here: [HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#).

3. Install the latest version of printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

4. If the error persists, turn the printer off, and then disconnect and reconnect all the cables on the scanner control board (SCB) and retest for functionality.

Figure 6-45 Scanner connection


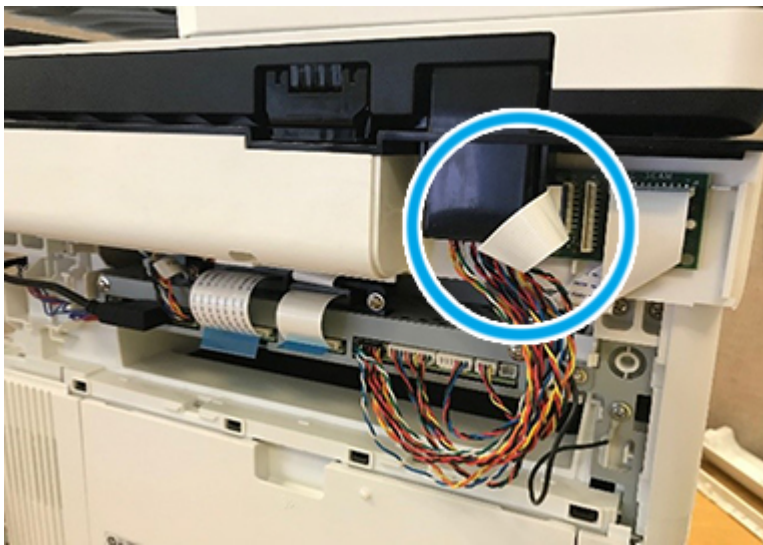


Figure 6-46 Scanner control board (SCB) connections

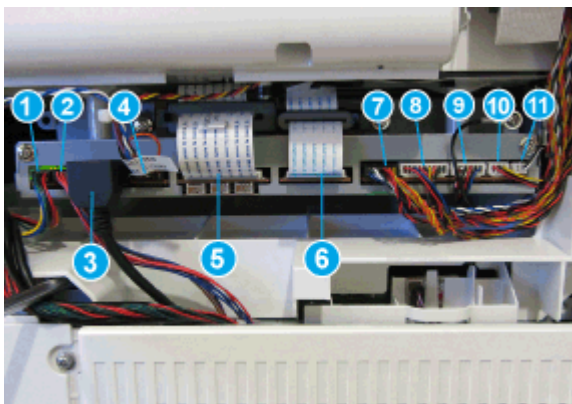

1	Stapler power
2	SCB power (24v)
3	PAB to SCAM communication (HDMI)

4	Flatbed sensors (document feeder open and flatbed paper length_ and cave LED)
5	Flatbed (S1) flat flexible cable (Scanner data and flatbed motor)
6	document feeder (S2) flat flexible cable (scanner data)
7	document feeder motors (feed and deskew)
8	document feeder sensors (prescan, paper present receiver and top hatch)
9	document feeder ultra sonic sensor receiver and deskew sensor
10	LTR/LGL (letter/legal) Input tray sensor
11	Ultra sonic sensor transmitter

5. Check the printer event log for any errors that occurred prior to 30.03.45

- If there are 31.XX.XX error codes listed prior to 30.03.45 replace the automatic document feeder (ADF).

Table 6-35 Part numbers

Description	HP Part Number
Document feeder (M577c/z) kit	B5L47-67909
Document feeder (M577dn/f) kit	B5L47-67908

For instructions:

See the Repair Service Manual for this product.

- If there are 30.XX.XX error codes listed prior to 30.03.45 replace the image scanner assembly (ISA).

Part number: B5L46-67912

For instructions:

See the Repair Service Manual for this product.

6. If the error persists, after checking/reseating the SCB cables, replacing the document feeder (ADF), and replacing the image scanner assembly (ISA), then replace the scanner control board (SCB).

- **Table 6-36 Part numbers**

Description	HP Part Number
Document feeder (M577c/z) kit	B5L47-67907
Document feeder (M577dn/f) kit	B5L47-67906

For instructions: See the Repair Service Manual for this product.

- Image scanner assembly (ISA) Part number: B5L46-67912

For instructions: See the Repair Service Manual for this product.

- Scanner control board Part number: B5L47-67903

For instructions: See the Repair Service Manual for this product.

31.wx.yz error messages

31.* errors

Errors in the 31.* family are related to the document feeder.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Verify the document feeder top cover is completely closed when feeding pages through it.
2. Verify the document feeder input tray is not overloaded and that the guides are adjusted correctly.
3. Open the document feeder top cover and check the rollers. Clean or replace them if necessary.
4. Clean the scanner glass and all the calibration strips.
5. Calibrate the scanner. Open these menus: [Device Maintenance > Calibrate-Cleaning > Calibrate Scanner](#).
6. Clean the scanner glass and glass strips, and clean the white strips used for calibration.
7. Perform the tests for scanner diagnostics. Open these menus: [Administration > Troubleshooting > Diagnostic Tests > Scanner Tests](#). Look for tests related to the document feeder, such as the [Jam Cover Sensor](#) test.
8. Upgrade the firmware.
For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)
9. Check all connections from the document feeder to the scanner control board, and reseal them if necessary.
10. If the error persists, replace the document feeder assembly.

31.01.47 Document feeder not detected

The document feeder was not detected, or the document feeder might not be connected. The flatbed glass is still available for scanning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, replace the document feeder.


For instructions: See the Repair Service Manual for this product.

Table 6-37 Part number:

Description	HP Part Number
Document feeder (M577c/z) kit	B5L47-67902
Document feeder (M577dn/f) kit	B5L47-67901

3. Before replacing the document feeder, the on-site technician should verify that the connections between the document feeder and the printer are correctly seated. The following connections: 6 – document feeder (side 2) FFC, 7 – document feeder motors (feed and deskew), 8 – document feeder sensors (pre-scan, paper presence and top hatch), 9 – document feeder ultra-sonic sensor receiver and deskew sensor)

Figure 6-47 Scanner control board (SCB) connections

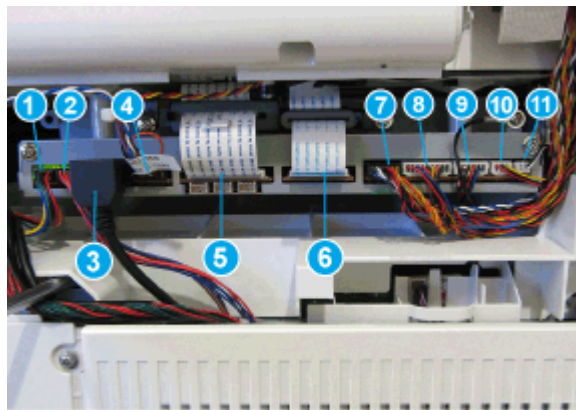

1	Stapler power
2	SCB power (24v)
3	PAB to SCAM communication (HDMI)
4	Flatbed sensors (document feeder open and flatbed paper length_ and cave LED)
5	Flatbed (S1) flat flexible cable (Scanner data and flatbed motor)
6	document feeder (S2) flat flexible cable (scanner data)
7	document feeder motors (feed and deskew)
8	document feeder sensors (prescan, paper present receiver and top hatch)
9	document feeder ultra sonic sensor receiver and deskew sensor
10	LTR/LGL (letter/legal) Input tray sensor
11	Ultra sonic sensor transmitter

31.03.14

Backside scanner EEPROM (NVM) error.

A non-fatal error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Validate that the error code is persistent.
3. If image quality is a problem, ask for an example image.
4. If the error persists, replace the document feeder.

For instructions: See the Repair Service Manual for this product.

Table 6-38 Part numbers

Description	HP Part Number
Document feeder (M577c/z) kit	B5L47-67907
Document feeder (M577dn/f) kit	B5L47-67906

31.03.20 Backside scanner not detected

Backside scanner not detected.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, please contact HP customer support.

Recommended action call-center agents

Follow these troubleshooting steps in the order presented.



IMPORTANT: Before troubleshooting please review the appropriate Service Action Advisory for the specific region needed.

- *HP LaserJet Enterprise MFP M527, M528, M577, M578, Managed MFP E52545, E52645, E57540, PageWide Enterprise MFP 586, Managed MFP E58650 - 31.03.20 error when duplexing from ADF, Workflow models (All regions, Service Action Advisory)*

- *HP LaserJet Enterprise MFP M527, M528, M577, M578, Managed MFP E52545, E52645, E57540, PageWide Enterprise MFP 586, Managed MFP E58650 - 31.03.20 error when duplexing from ADF, Non-workflow models (AMS, Service Action Advisory)*
 - *HP LaserJet Enterprise MFP M527, M528, M577, M578, Managed MFP E52545, E52645, E57540, PageWide Enterprise MFP 586, Managed MFP E58650 - 31.03.20 error when duplexing from ADF, Non-Workflow models (APJ/EMEA, Service Action Advisory)*
-

1. Turn the printer off, and then on.
2. Validate that the error code is persistent.
3. If image quality is a problem, ask for an example image.
4. Dispatch onsite service to check the following:

Instruct onsite service personnel to disconnect and reconnect the ADF FFC on the scanner control board (SCB) labeled 'ADF SCAN' and test for functionality.

Recommended action onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-48 Gate Closed



Figure 6-49 Proper Insertion

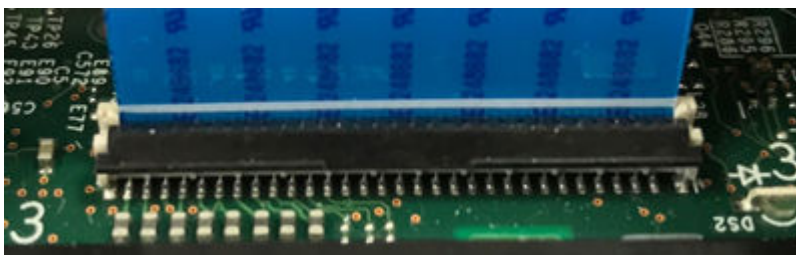


Figure 6-50 Improper insertion



1. Turn the printer off, and then on.
2. Turn the printer off, and then disconnect and reconnect all the cables on the scanner control board (SCB) and retest for functionality.

Figure 6-51 Scanner connection


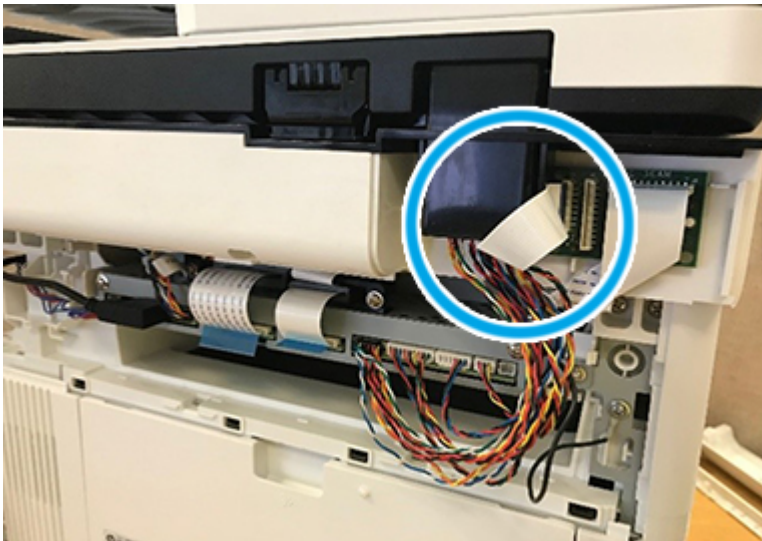


Figure 6-52 Scanner control board (SCB) connections

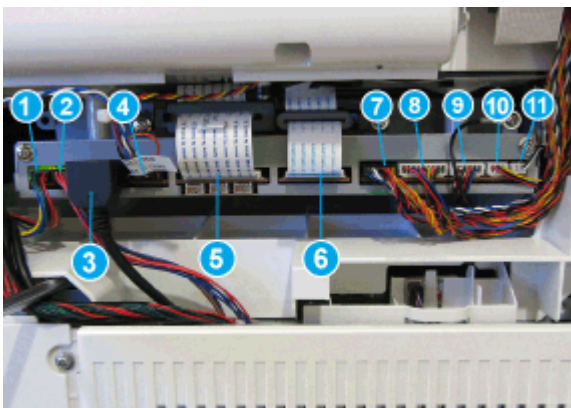

1	Stapler power
2	SCB power (24v)
3	PAB to SCAM communication (HDMI)
4	Flatbed sensors (document feeder open and flatbed paper length_ and cave LED
5	Flatbed (S1) flat flexible cable (Scanner data and flatbed motor)

6	document feeder (S2) flat flexible cable (scanner data)
7	document feeder motors (feed and deskew)
8	document feeder sensors (prescan, paper present receiver and top hatch)
9	document feeder ultra sonic sensor receiver and deskew sensor
10	LTR/LGL (letter/legal) Input tray sensor
11	Ultra sonic sensor transmitter

3. If the error persists, replace the document feeder assembly.

Table 6-39 Part numbers

Description	HP Part Number
Document feeder (M577c/z) kit	B5L47-67909
Document feeder (M577dn/f) kit	B5L47-67908

4. If the error persists, elevate the issue using the Standard Support Process.

31 . 03 . 22 Scanner calibration failure

Backside illumination calibration failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.


Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.

3. Verify the cables between the image scanner and the SCB are correctly connected.

Figure 6-53 Scanner control board (SCB) connections

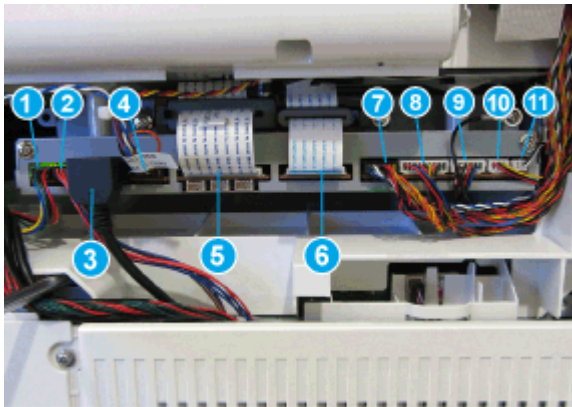

1	Stapler power
2	SCB power (24v)
3	PAB to SCAM communication (HDMI)
4	Flatbed sensors (document feeder open and flatbed paper length_ and cave LED
5	Flatbed (S1) flat flexible cable (Scanner data and flatbed motor)
6	document feeder (S2) flat flexible cable (scanner data)
7	document feeder motors (feed and deskew)
8	document feeder sensors (prescan, paper present receiver and top hatch)
9	document feeder ultra sonic sensor receiver and deskew sensor
10	LTR/LGL (letter/legal) Input tray sensor
11	Ultra sonic sensor transmitter

4. Replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Table 6-40 Part number:

Description	HP Part Number
Document feeder (M577c/z) kit	B5L47-67902
Document feeder (M577dn/f) kit	B5L47-67901

31 . 03 . 30 Document feeder pick motor error

The document feeder pick motor is not turning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.


1. Turn the printer off, and then on.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Verify that the paper meets the HP printer specifications.
2. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
3. Check the event log for other document feeder errors. If other errors are present, resolve those errors first.
4. Open and close the top cover to see if the pick motor turns without displaying the error. If the motor turns, the motor is good.
5. Verify that the motor cables are connected (7 – document feeder Motor feed and deskew).

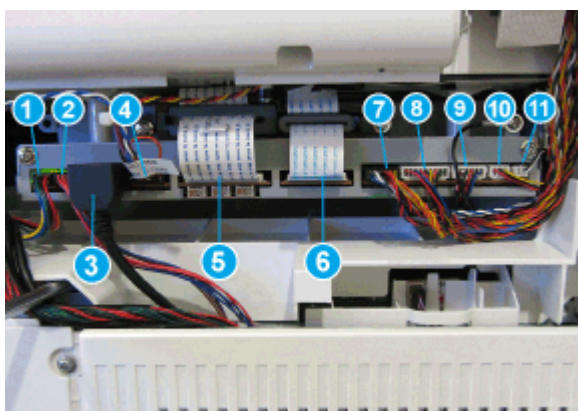

6. Re-seat the document feeder connections to the SCB.
7. Replace the document feeder.

For instructions: See the Repair Service Manual for this product.

Table 6-41 Part number:

Description	HP Part Number
Document feeder (M577c/z) kit	B5L47-67902
Document feeder (M577dn/f) kit	B5L47-67901

31 . 03 . 31 Document feeder motor stall

The document feeder feed motor is not turning.

Recommended action for customers


Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Verify that the paper meets the HP printer specifications.
2. Ensure that the input tray is not overloaded and the tray guides are set to the correct size.
3. Check the event log for other document feeder errors. If other errors are present, resolve those errors first.
4. Verify that the motor cables are connected (7 – document feeder Motor feed and deskew).

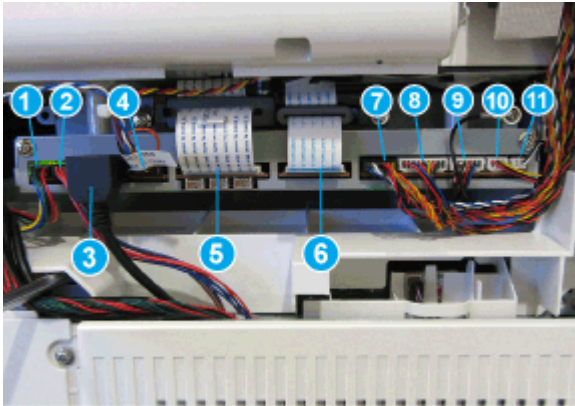

5. Re-seat the document feeder connections to the SCB.
6. Replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Table 6-42 Part number:

Description	HP Part Number
Document feeder (M577c/z) kit	B5L47-67902
Document feeder (M577dn/f) kit	B5L47-67901

31.03.32

The document feeder de-skew motor is not turning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.


1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Verify that the paper meets the HP printer specifications.

2. Ensure that the input tray is not overloaded.
3. Check the event log for other document feeder errors. If other errors are present, resolve those errors first.
4. Verify that the motor cables are connected (7 – document feeder feed and deskew motor).

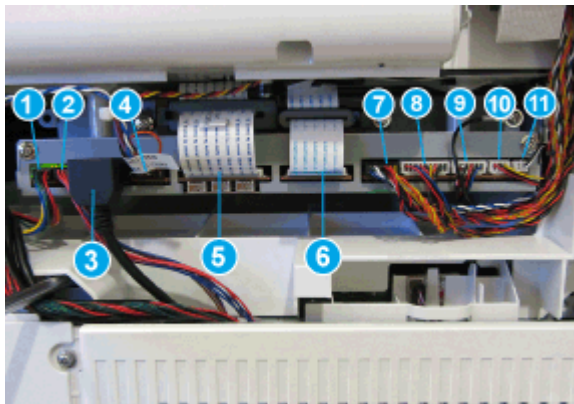

5. Re-seat the document feeder connections to SCB cables.
6. Replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Table 6-43 Part number:

Description	HP Part Number
Document feeder (M577c/z) kit	B5L47-67902
Document feeder (M577dn/f) kit	B5L47-67901

31 . 03 . 33 Backside scanner calibration area dirty

The white area used for backside scanner calibration is dirty.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Clean the white strip on platen glass and on the document feeder (side 2 glass).
2. Clean the scanner glass.
3. If the error remains replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Table 6-44 Part number:

Description	HP Part Number
Document feeder (M577c/z) kit	B5L47-67902
Document feeder (M577dn/f) kit	B5L47-67901

31.03.34 Background missing

The removable white backing for the backside scanner is either missing or not fully snapped into place.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Remove the white backing and clean it.
2. Clean the scanner and backside scanner glass.
3. If the error remains replace the white backing.

Part number (M577 only): 5851-6570

4. If the error remains replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Table 6-45 Part number:

Description	HP Part Number
Document feeder (M577c/z) kit	B5L47-67902
Document feeder (M577dn/f) kit	B5L47-67901

31.13.00 Document feeder multi-pick error


A multiple pick error was reported by the document feeder assembly.

Recommended action for customer



Follow these troubleshooting steps in the order presented.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

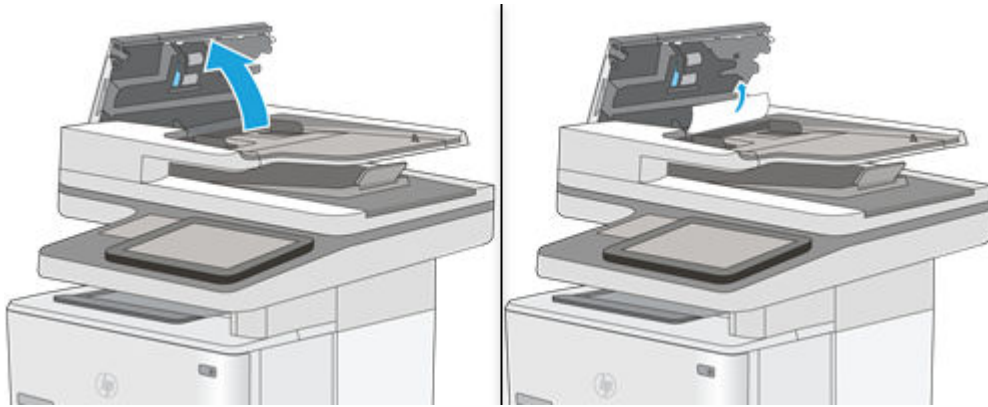

2. Lift the document-feeder input tray and remove any jammed paper.

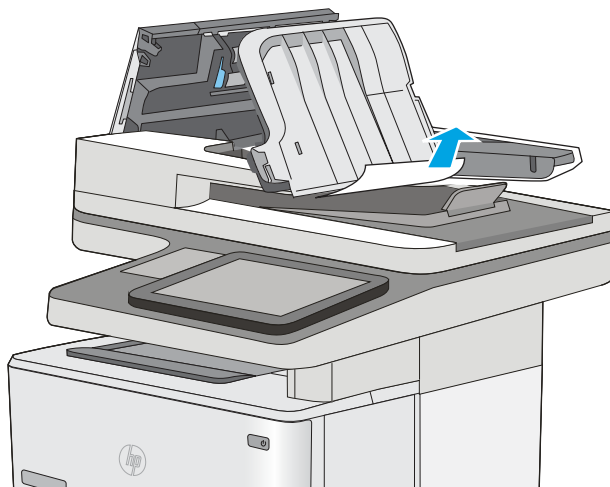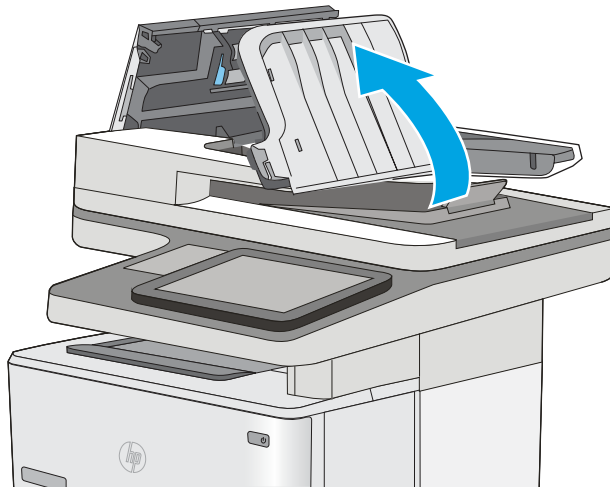

3. Lower the document-feeder input tray and then close the document feeder cover.



NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.


4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF): [Click here - c06601744](#)

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-54 Set the ADF guides

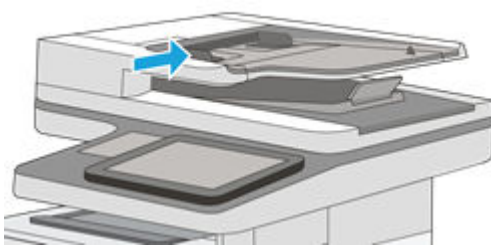


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

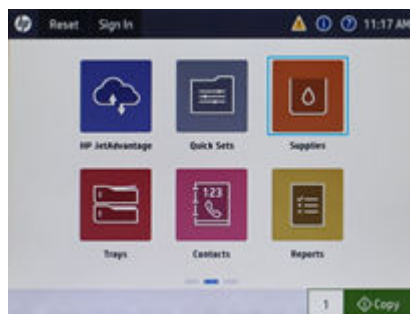

- b. Select **Document Feeder Kit**.

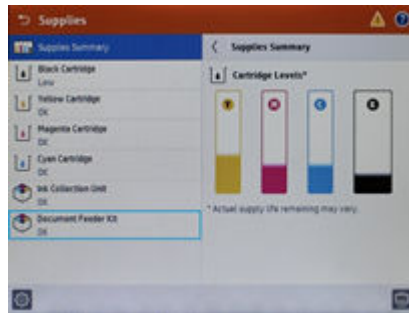

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

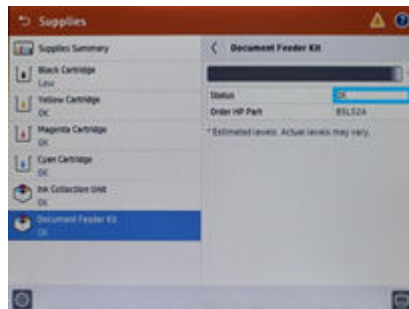


- d. Recommend that the customer replace the Document Feeder Kit if the status is **Low** or **Very Low**.

Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm

water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

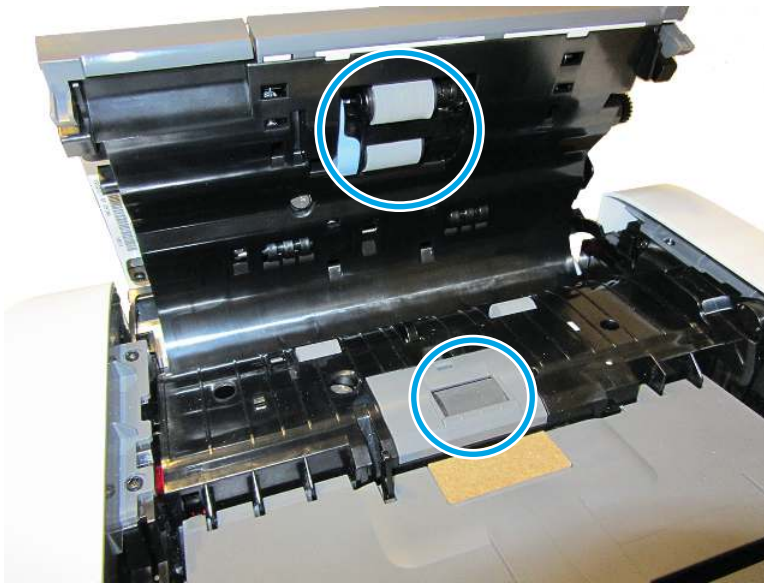

NOTE: Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: W5U23A/HP 200 ADF Roller Replacement Kit

To order parts, go to <https://store.hp.com>


9. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agent


Follow these troubleshooting steps in the order presented.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)


1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

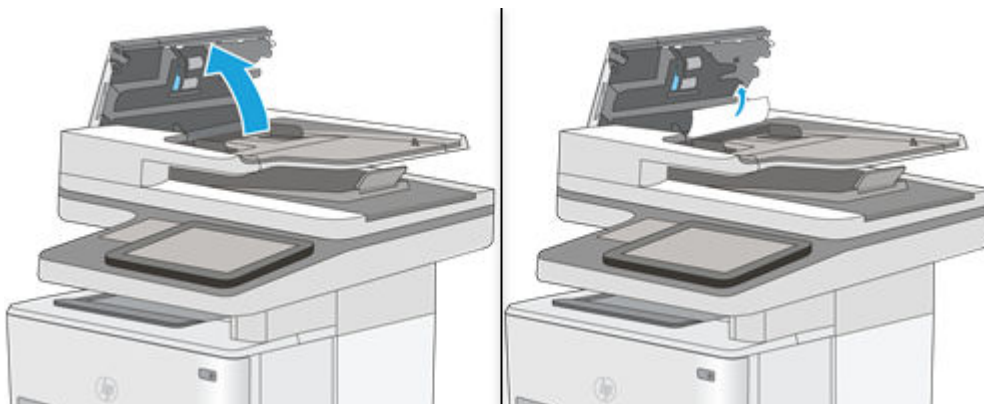

2. Lift the document-feeder input tray and remove any jammed paper.
 - a. Lift the document feeder input tray

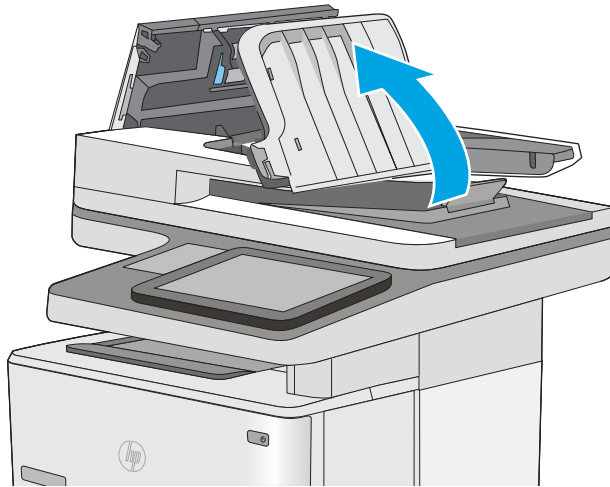

- b. Remove any paper found under the tray.

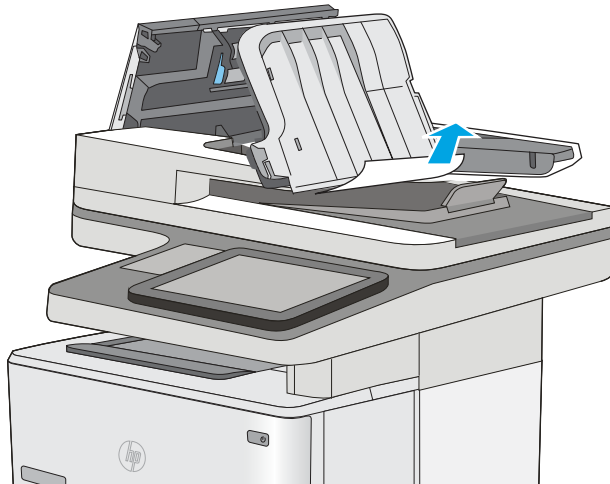


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

3. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path

- a. Open the ADF and remove any paper found.

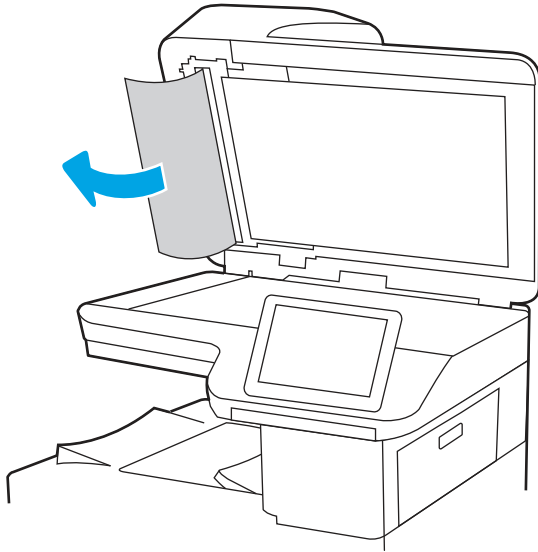

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

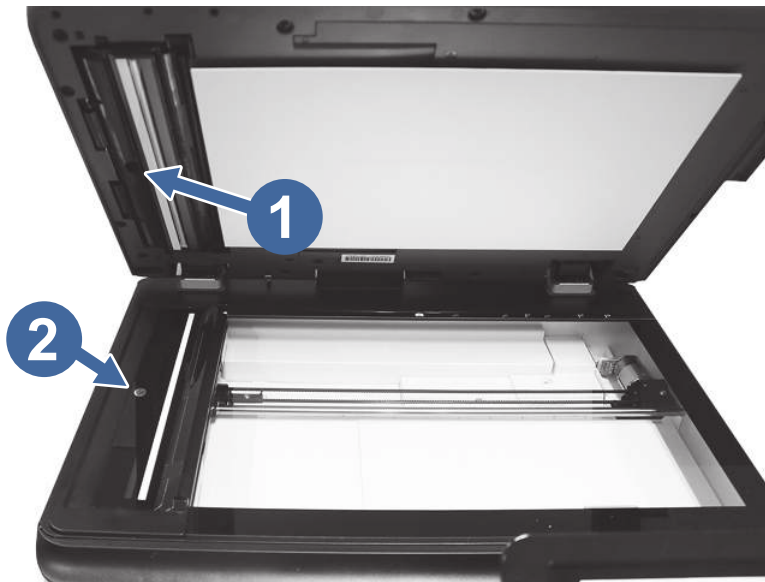

Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.


- c. Close the document feeder.
4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF): [Click here - c06601744](#)

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-55 Set the ADF guides

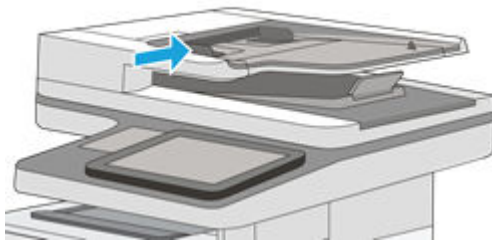


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

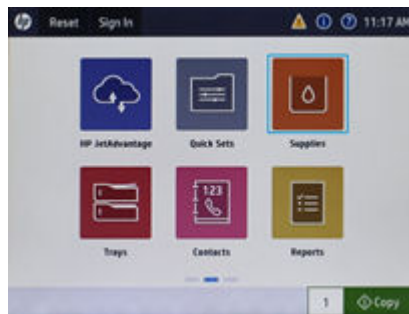

- b. Select **Document Feeder Kit**.

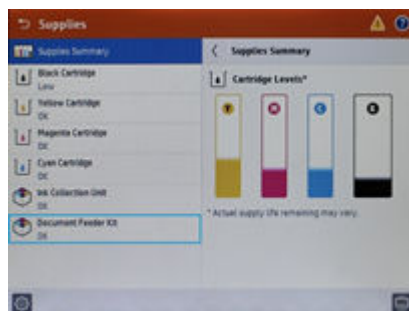

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

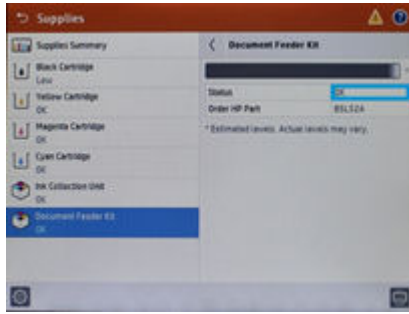

- d. If the status is **Low** or **Very Low**, recommend that the customer replace the Document Feeder Kit.


Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>



NOTE: Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace the (ADF maintenance replacement roller kit) - W5U23-67901

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

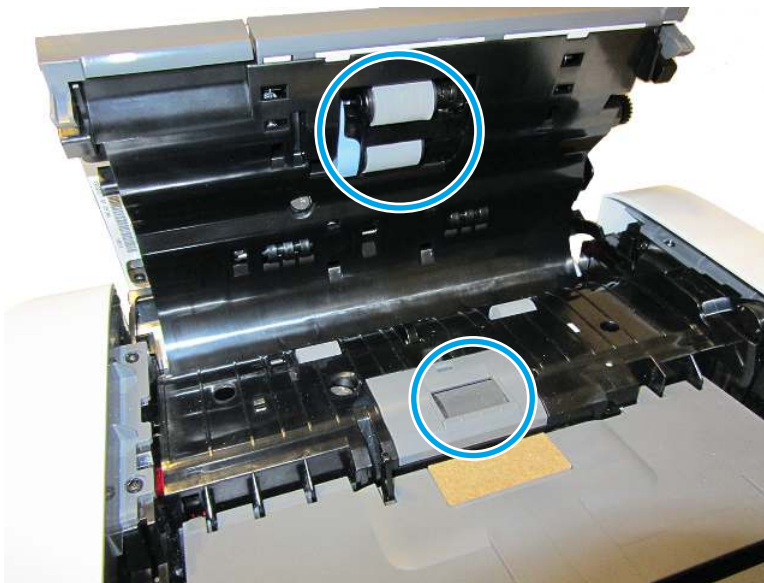

NOTE: Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: W5U23-67901 ADF maintenance replacement roller kit

 **NOTE:** Note: Should a grinding noise be reported or heard in conjunction with the pick/feed of paper through the ADF, replace the document feeder (ADF) unit.

Document Feeder whole unit (ADF) part number:


- Flow models part number: B5L47-67909
- Non-Flow models part number: B5L47-67908

Recommended action for onsite technicians


Follow these troubleshooting steps in the order presented.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)


1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

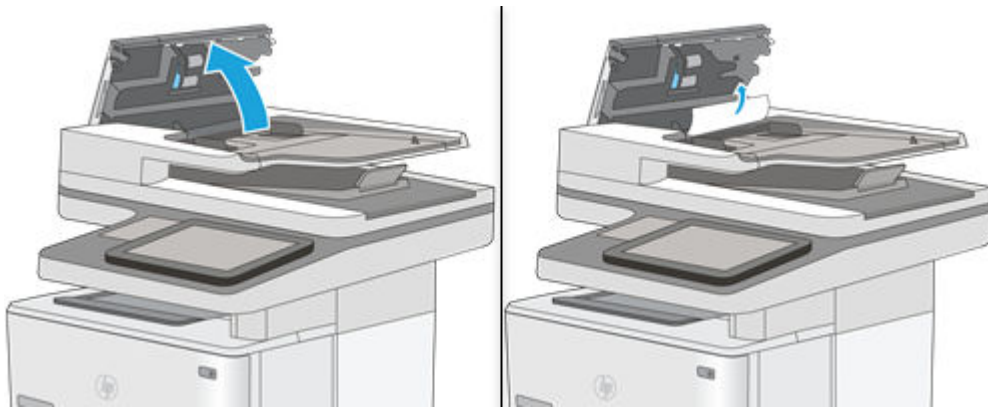

2. Lift the document-feeder input tray and remove any jammed paper.
 - a. Lift the document feeder input tray

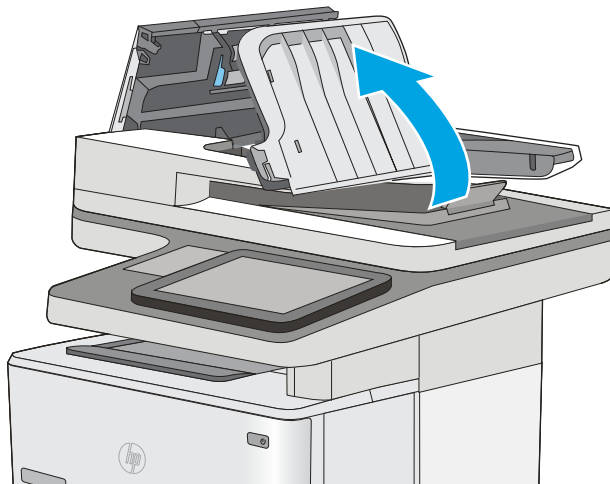

- b. Remove any paper found under the tray.

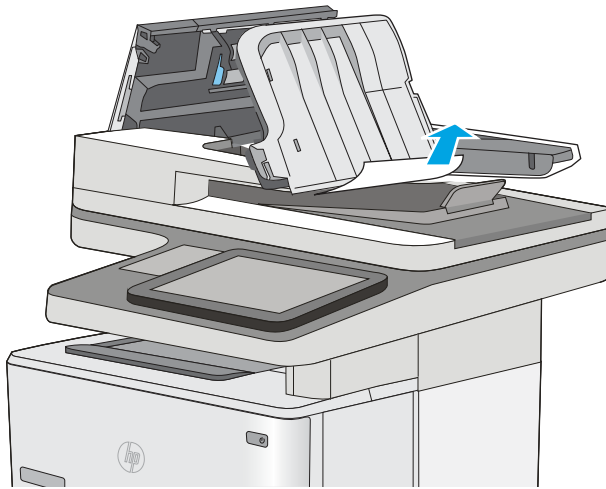


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

- 3. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path

- a. Open the ADF and remove any paper found.

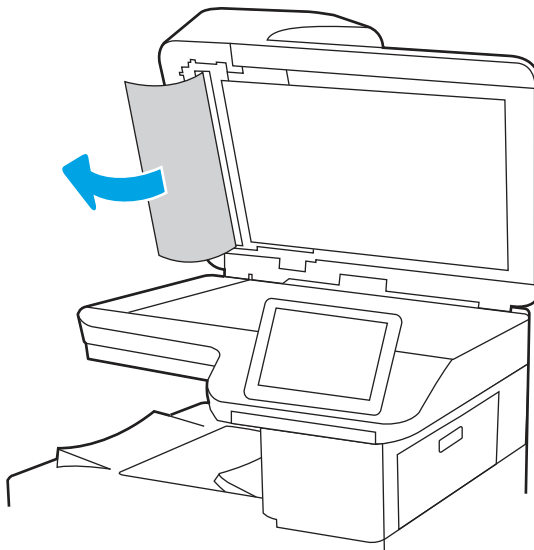

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

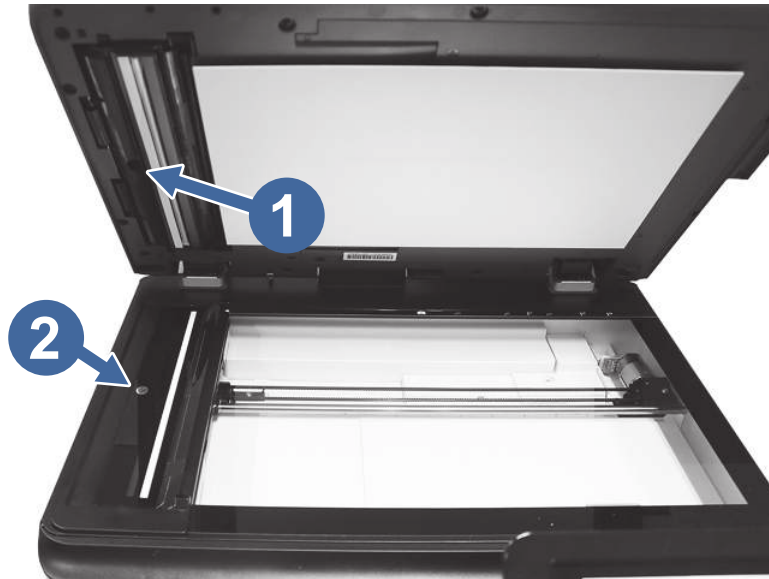


Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.
4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.
This document outlines the supported weights and sizes of the ADF including best practices:
Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF): [Click here - c06601744](#)
 5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
Make sure that the paper stack is correctly aligned at the center of the input tray when paper is

loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-56 Set the ADF guides

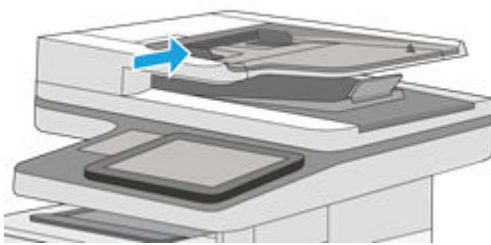


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

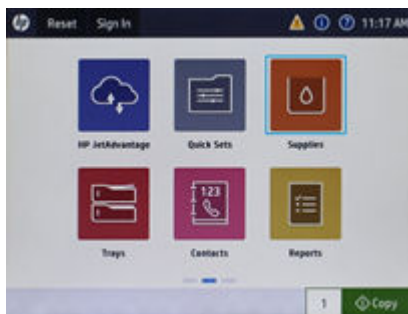

- b. Select **Document Feeder Kit**.

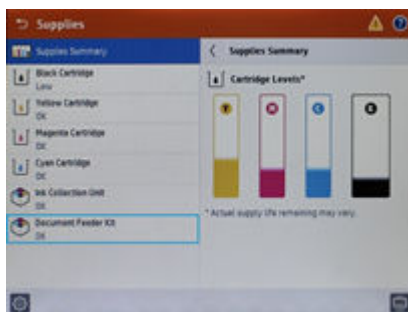

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

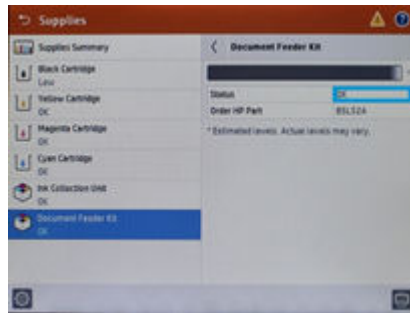


- d. If the status is **Low** or **Very Low**, recommend that the customer replace the Document Feeder Kit.

Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace the (ADF maintenance replacement roller kit) - W5U23-67901

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

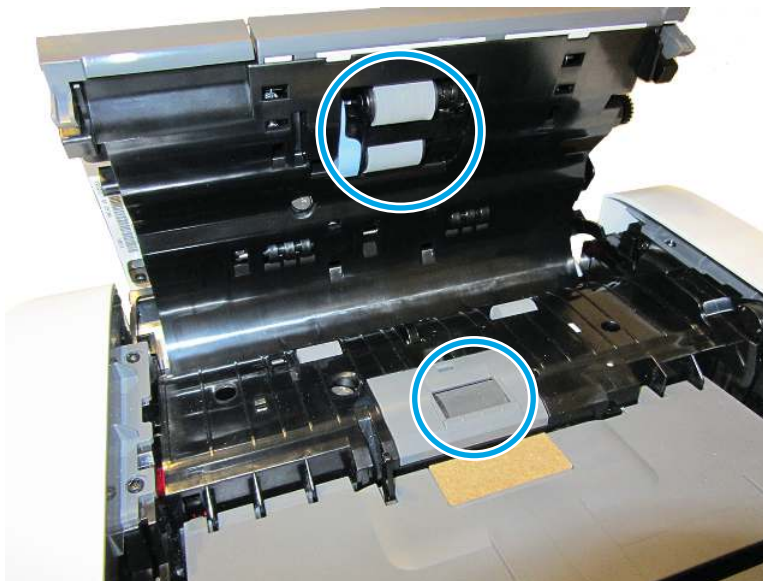


 **NOTE:** Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: W5U23-67901/(ADF maintenance replacement roller kit)


9. Inspect the ADF pick success sensor, cleaning both the REDI (paper pick success) sensor window and REDI (PAPER PICK SUCCESS) sensor reflector. If there is any dust or fiber remnants, clean by using a can of compressed air to blow out and clean.

Figure 6-57 ADF REDI sensor

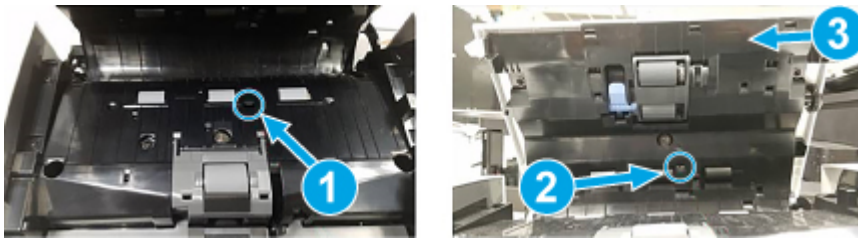

- 1 – REDI sensor window
- 2 – REDI sensor reflector
- 3 – ADF hatch

10. Check the REDI sensor reflector on flatbed. If there is any dust or fiber remnants, clean it by using a can of compressed air to blow out and clean. (related issue, ADF jam without paper inside)

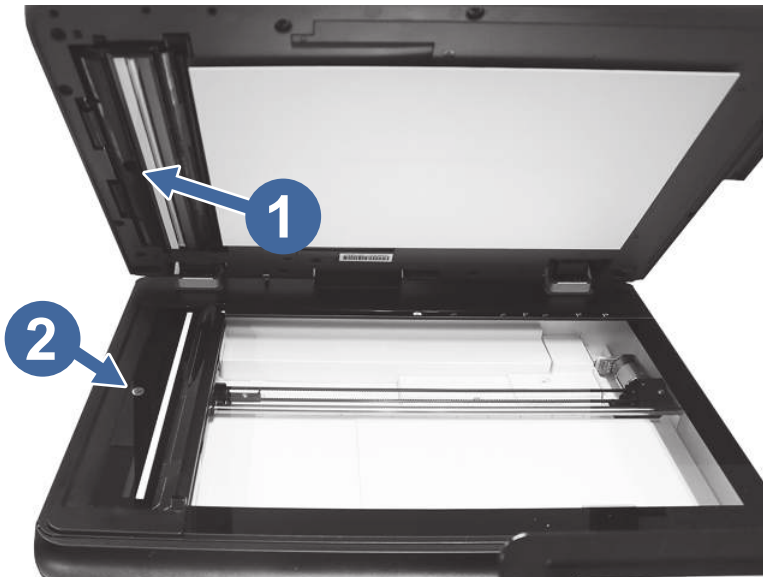


Callout 1: Check for paper blocking this area.


Callout 2: Clean this area with a damp lint free cloth.

11. Verify that the connections between the automatic document feeder and the SCB are correctly seated.


Figure 6-58 SCB connections

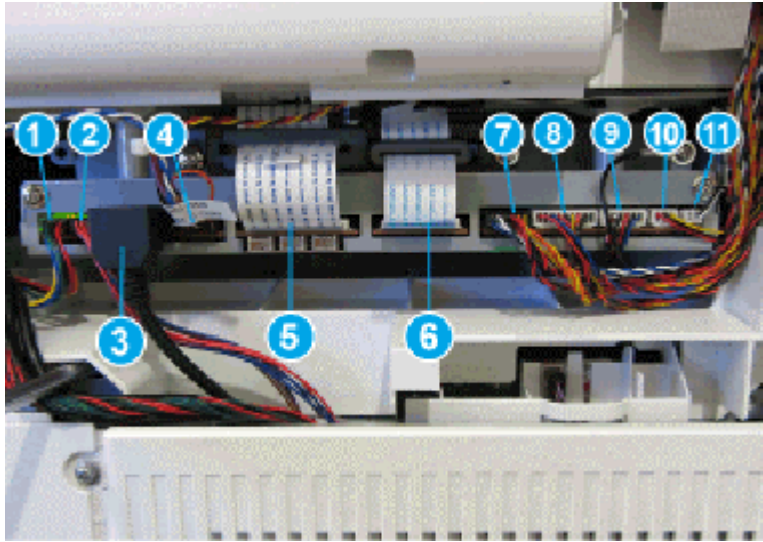


12. Using the Manual Scanner Sensor Test verify functionality of the ADF Paper Path Pick Success sensor.
 - a. Navigate to and select **Support Tools**.

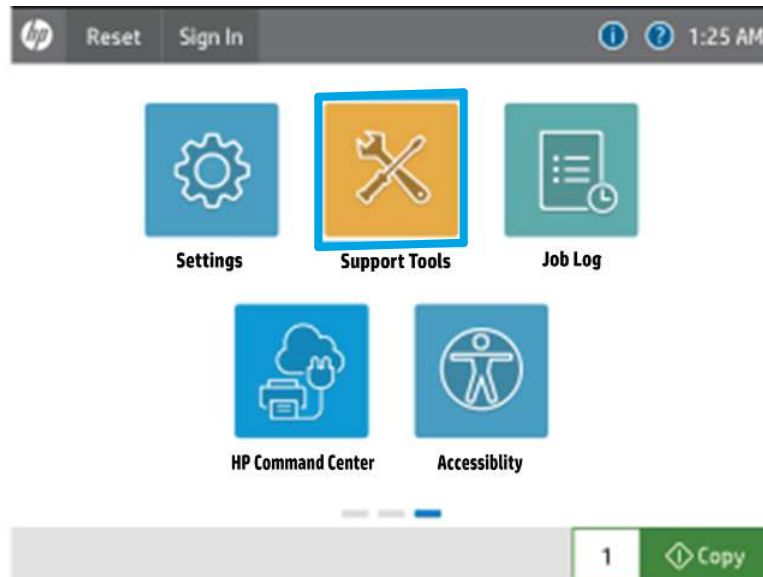


- b. Select **Troubleshooting**.

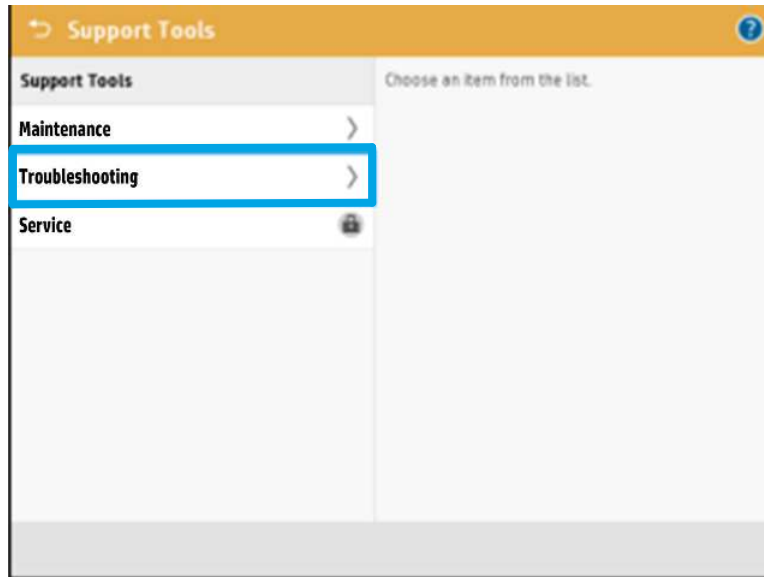


- c. Select **Diagnostic Tests**.

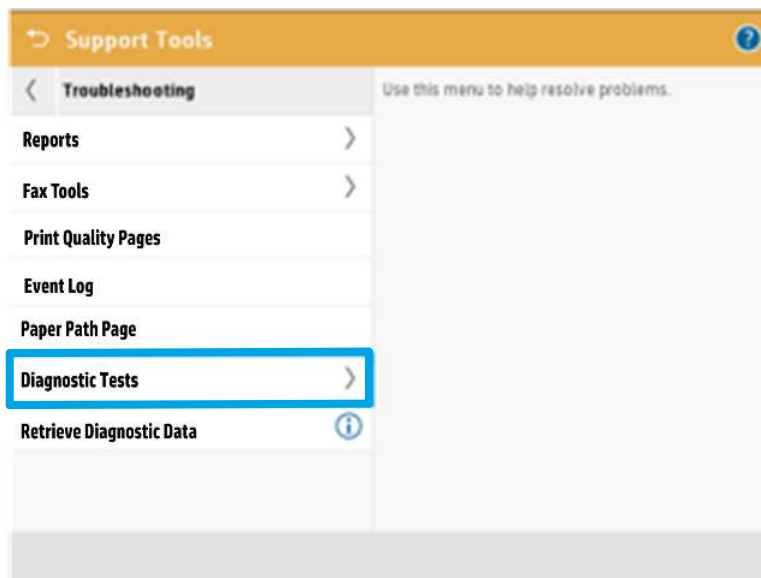


- d. Select **Continue**.

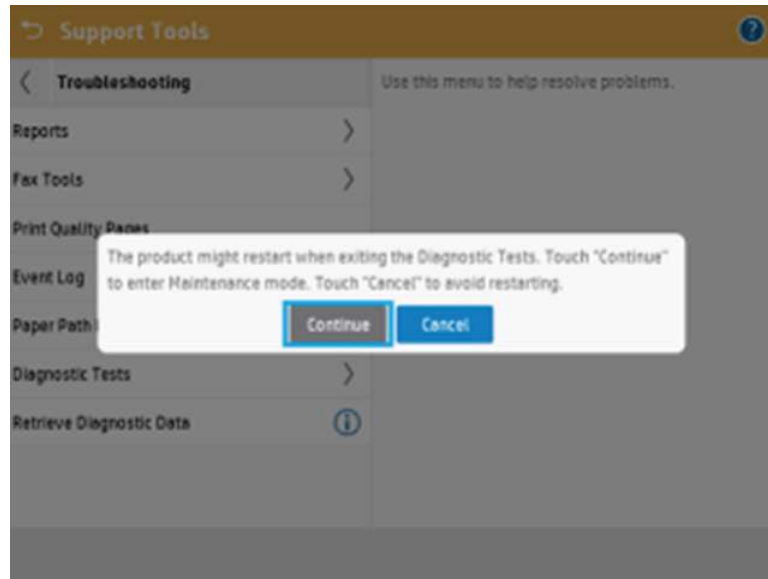

- e. Select **Manual Sensor Test**.

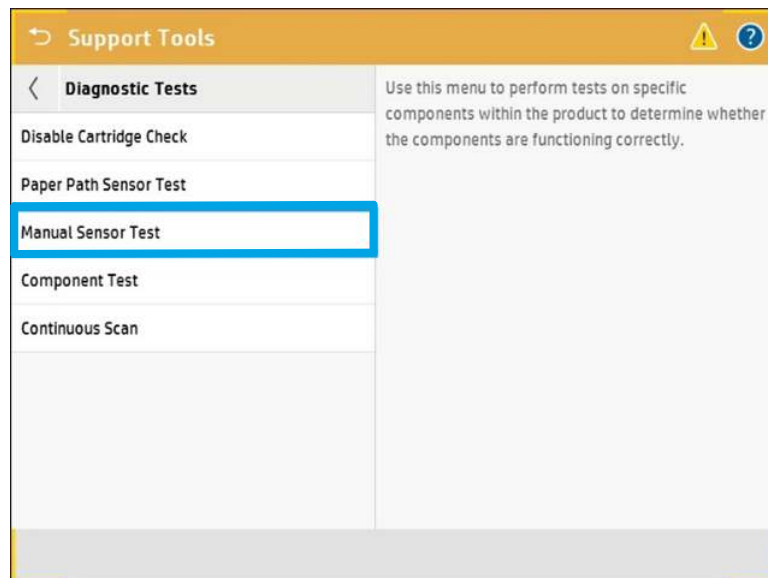

- f. Select **ADF Paper Path Deskew**.

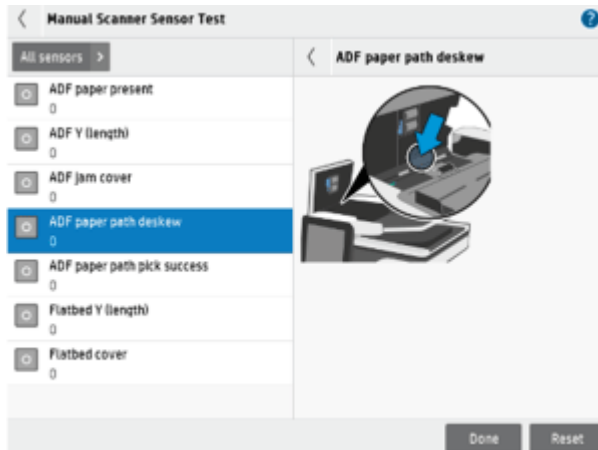


- g. Select **ADF Paper Path Pick Success**.

(Only in FLOW-MODELS)



NOTE: Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advancing.

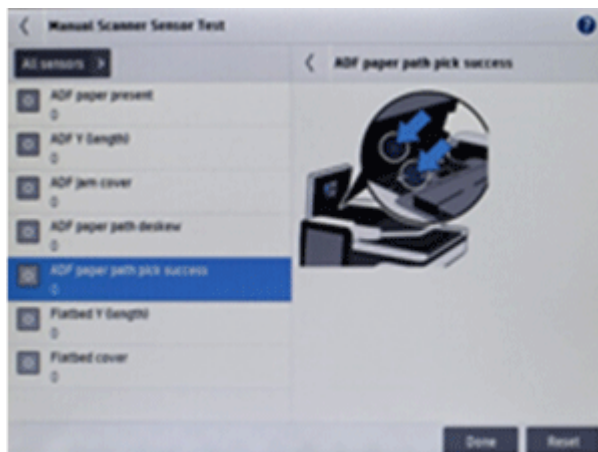

- h. Close the ADF cover and ensure that is secure and closed correctly.

13. Open and close the ADF cover to trigger the ADF Paper Path Pick Success sensor.



 **NOTE:** Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advanced.

14. If the ADF Paper Path Pick Success test fails to advance the count, replace the document feeder.

For instructions: See the Repair Service Manual for this product.

Part number

- Flow models part number: B5L47-67907
- Non-Flow models part number: B5L47-67906

 **NOTE:** Note: Should a grinding noise be reported or heard in conjunction with the pick/feed of paper through the ADF, replace the document feeder (ADF) unit.


Document Feeder whole unit (ADF) part number:

- Flow models part number: B5L47-67909
- Non-Flow models part number: B5L47-67908

31.13.01

Document feeder job error, pick error.

Paper pick was initiated but the page did not make it to the pick success sensor.

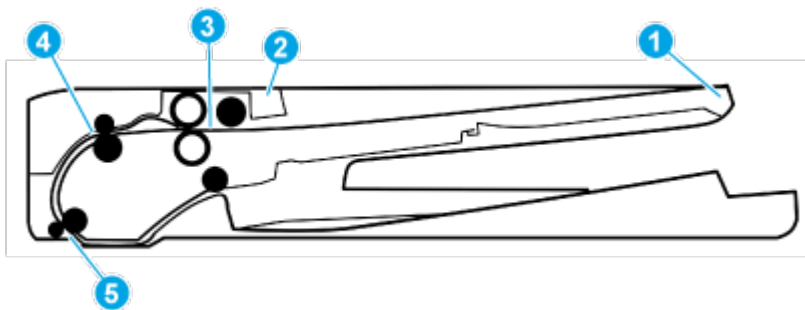


Sensor location 4

Recommended action for customer


Follow these troubleshooting steps in the order presented.


For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

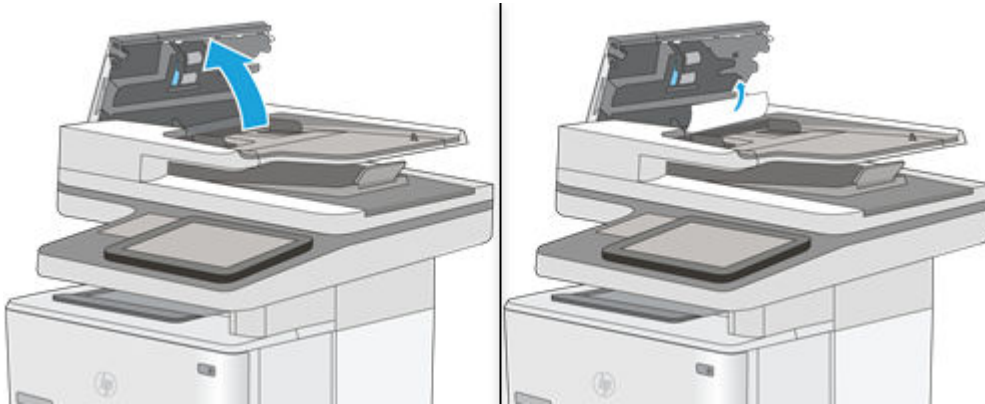

2. Lift the document-feeder input tray and remove any jammed paper.

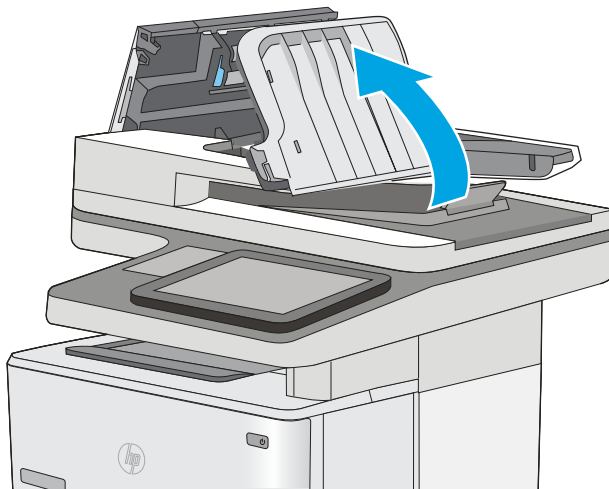

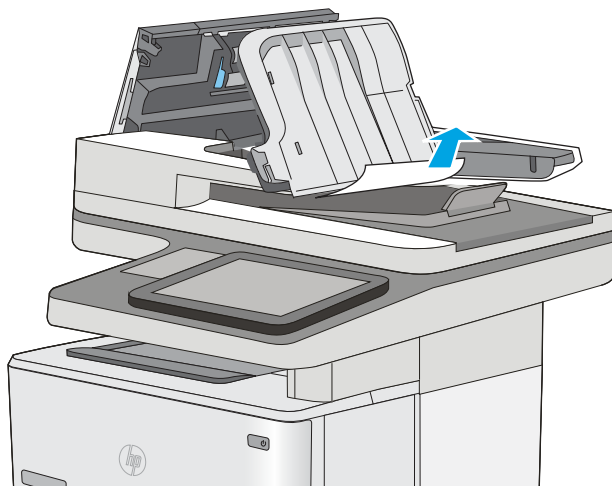

3. Lower the document-feeder input tray and then close the document feeder cover.



NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.


4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF): [Click here - c06601744](#)

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.

Figure 6-59 Set the ADF guides

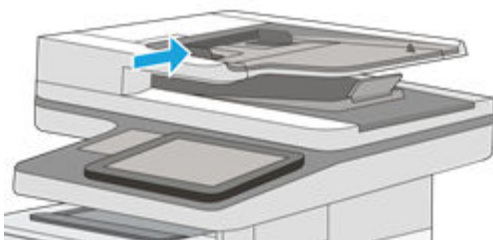


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.




NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

6. Check the Document Feeder Kit consumable status.


- a. Navigate to and select **Supplies** on the control panel.

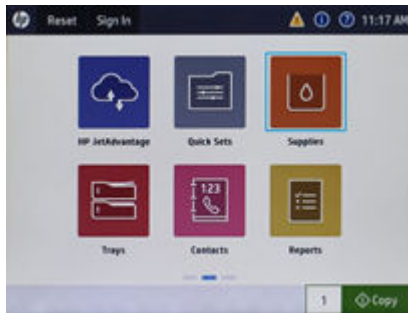

- b. Select **Document Feeder Kit**.

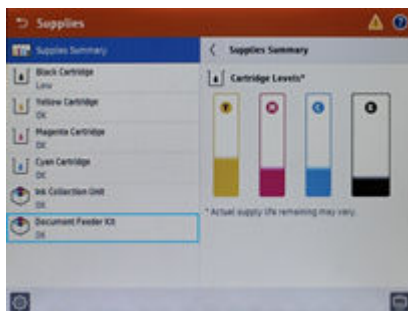

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

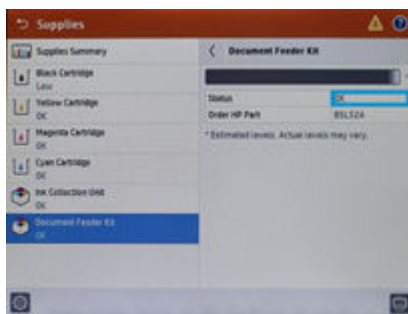


- d. Recommend that the customer replace the Document Feeder Kit if the status is **Low** or **Very Low**.

Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm

water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

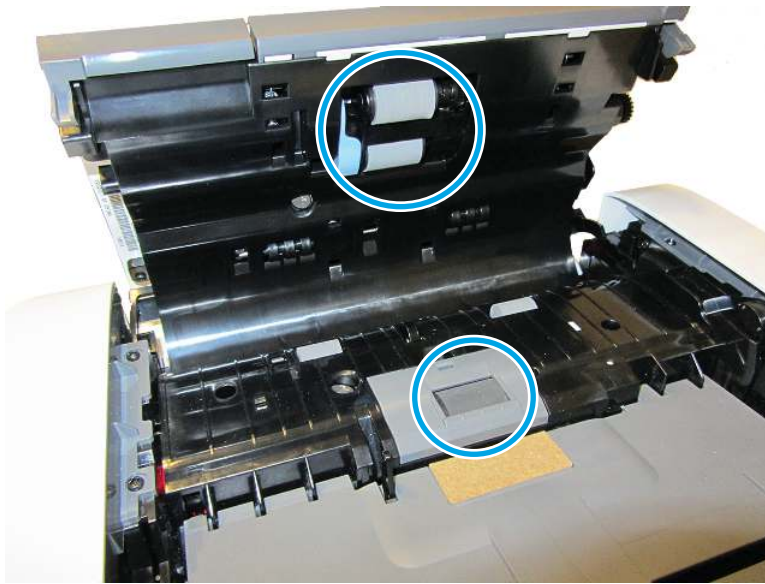

 **NOTE:** Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: W5U23A/HP 200 ADF Roller Replacement Kit

To order parts, go to <https://store.hp.com>


9. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agent


Follow these troubleshooting steps in the order presented.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)


1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

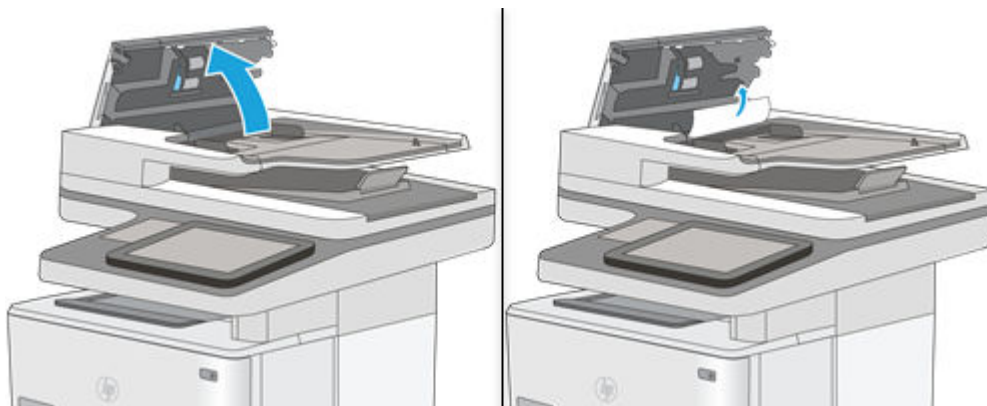

2. Lift the document-feeder input tray and remove any jammed paper.
 - a. Lift the document feeder input tray

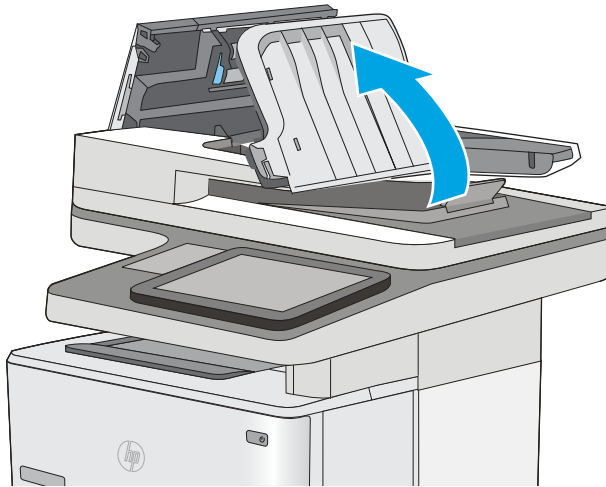

- b. Remove any paper found under the tray.

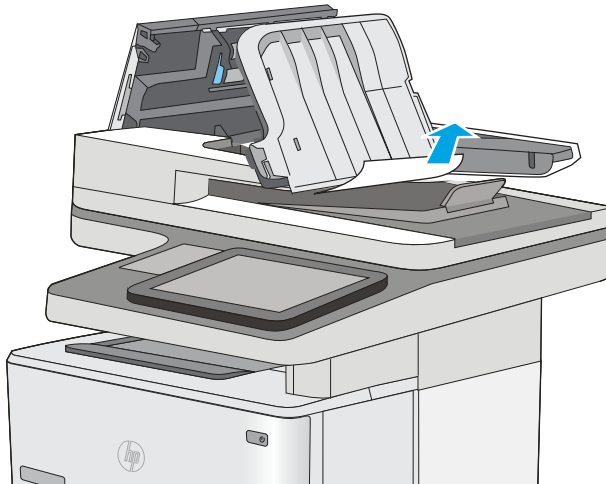


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

3. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path

- a. Open the ADF and remove any paper found.

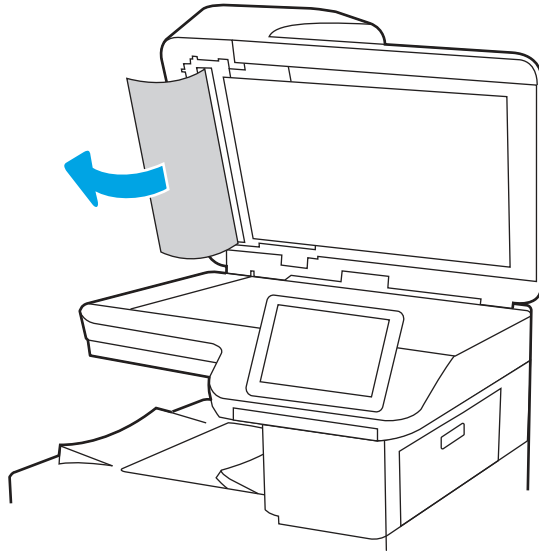

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

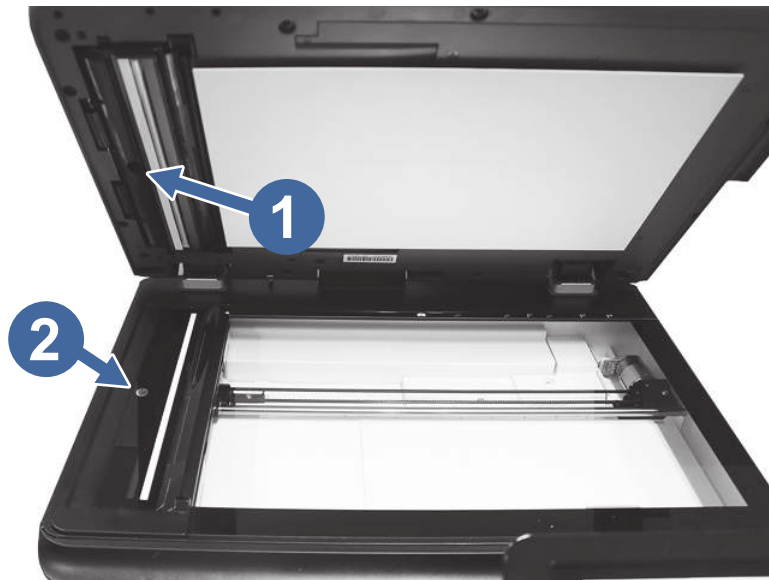

Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.


- c. Close the document feeder.
4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF): [Click here - c06601744](#)

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-60 Set the ADF guides

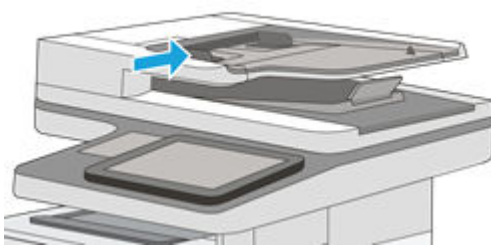


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

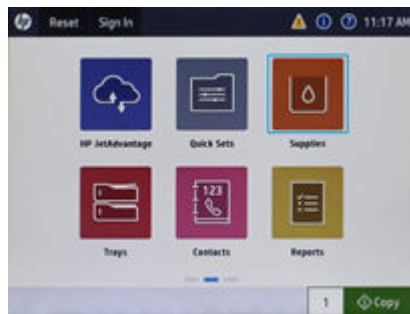

- b. Select **Document Feeder Kit**.

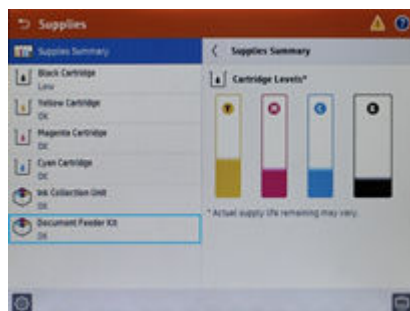

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

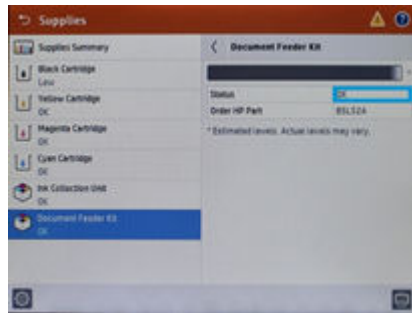


- d. If the status is **Low** or **Very Low**, recommend that the customer replace the Document Feeder Kit.

Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace the (ADF maintenance replacement roller kit) - W5U23-67901

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

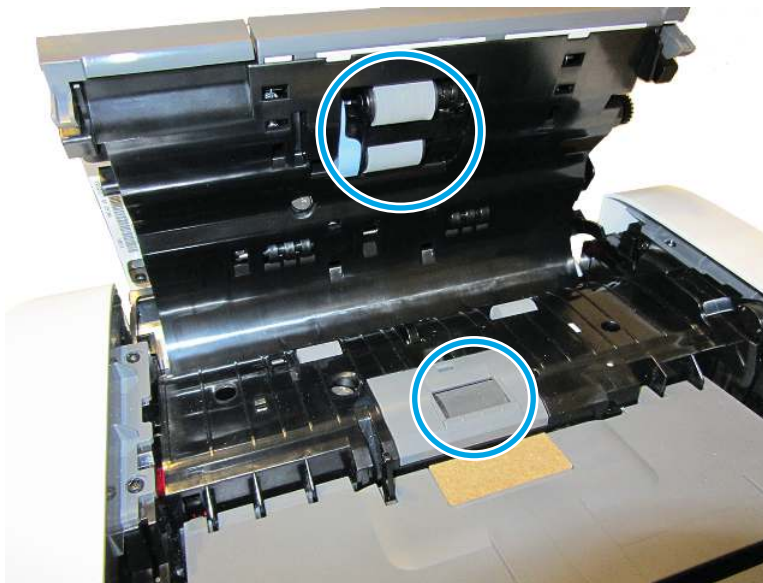

 **NOTE:** Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: W5U23-67901 ADF maintenance replacement roller kit



NOTE: Note: Should a grinding noise be reported or heard in conjunction with the pick/feed of paper through the ADF, replace the document feeder (ADF) unit.

Document Feeder whole unit (ADF) part number:


- Flow models part number: B5L47-67909
- Non-Flow models part number: B5L47-67908

Recommended action for onsite technicians


Follow these troubleshooting steps in the order presented.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)


1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

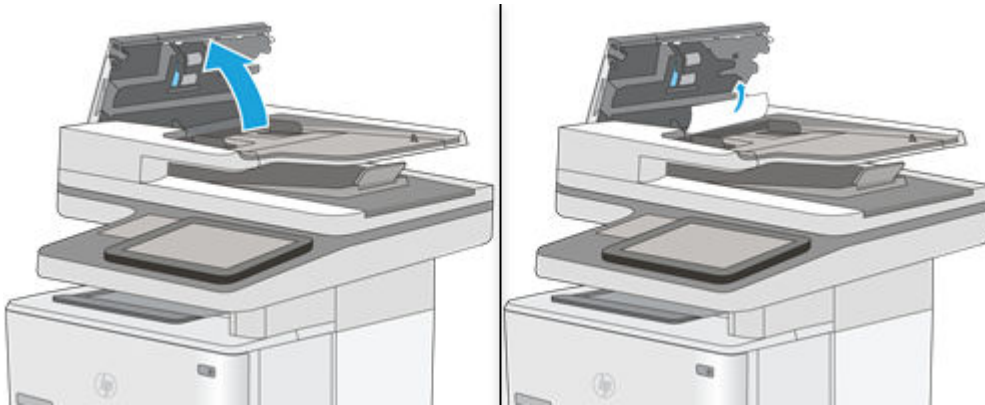

2. Lift the document-feeder input tray and remove any jammed paper.
 - a. Lift the document feeder input tray

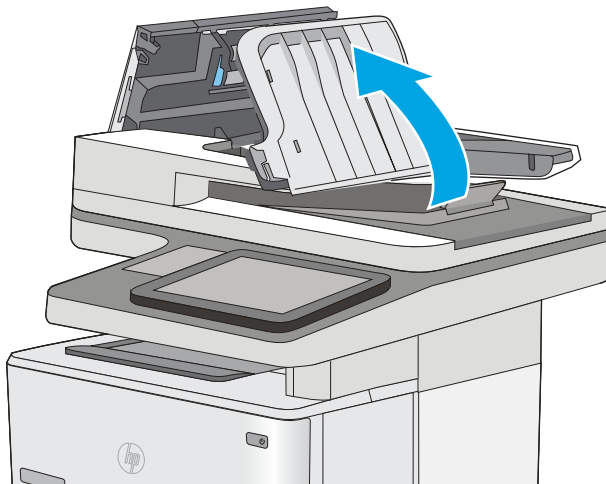

- b. Remove any paper found under the tray.

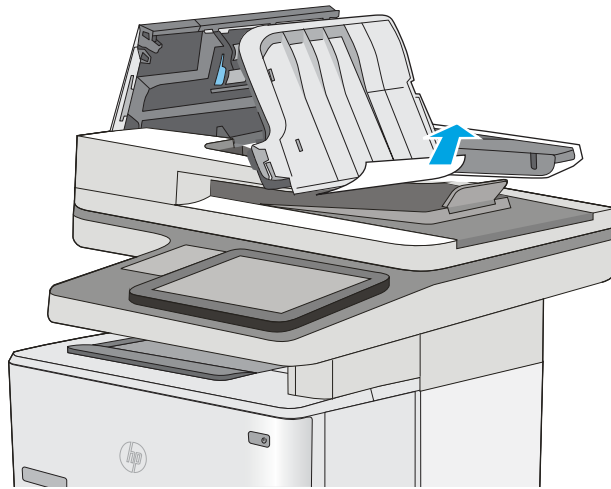


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

3. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path

- a. Open the ADF and remove any paper found.

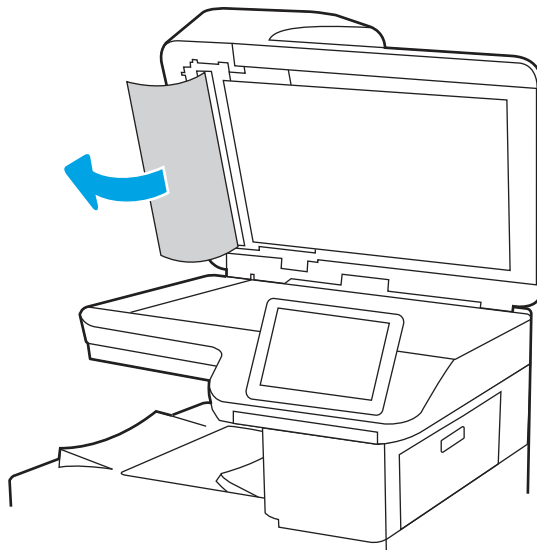

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

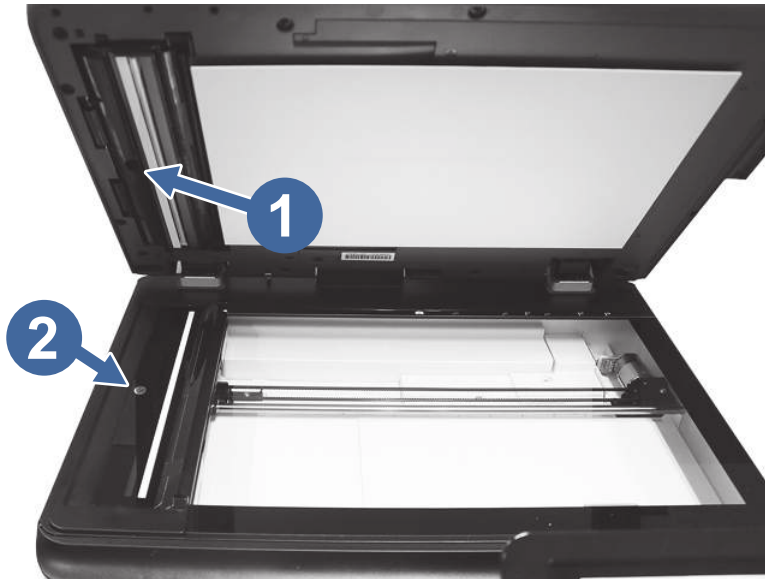


Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.
4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.
This document outlines the supported weights and sizes of the ADF including best practices:
Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF): [Click here - c06601744](#)
 5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
Make sure that the paper stack is correctly aligned at the center of the input tray when paper is

loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-61 Set the ADF guides

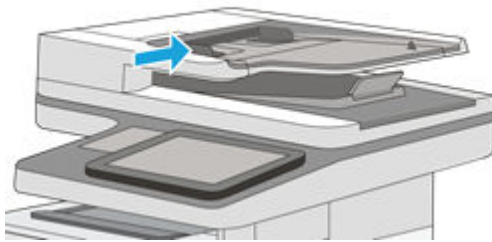


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

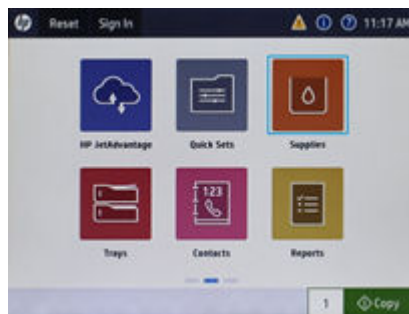

- b. Select **Document Feeder Kit**.

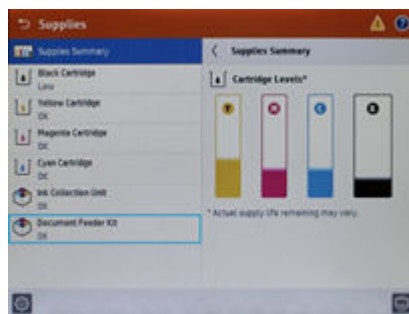

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

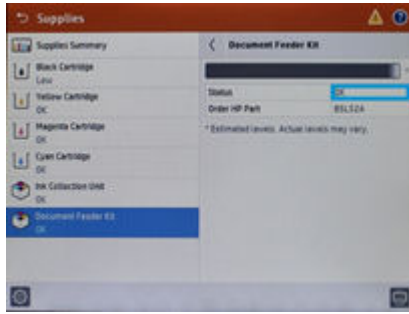

- d. If the status is **Low** or **Very Low**, recommend that the customer replace the Document Feeder Kit.


Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>



NOTE: Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace the (ADF maintenance replacement roller kit) - W5U23-67901

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

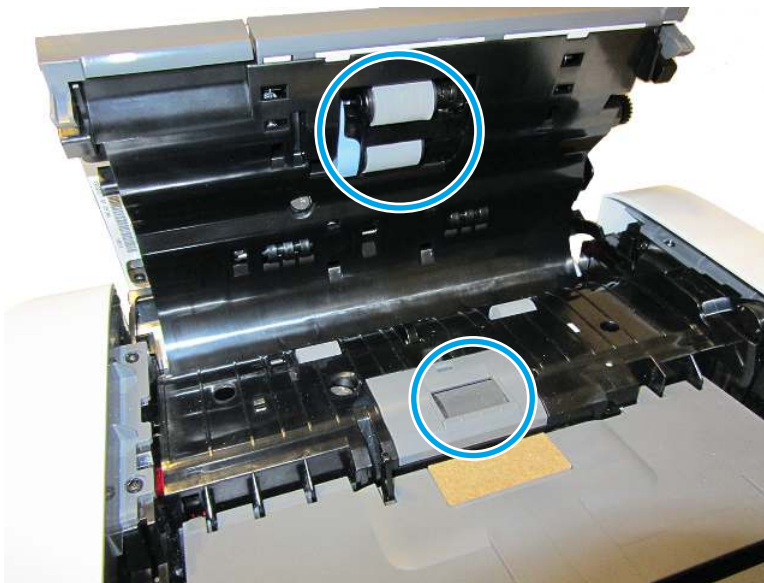

NOTE: Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: W5U23-67901/(ADF maintenance replacement roller kit)


9. Inspect the ADF pick success sensor, cleaning both the REDI (paper pick success) sensor window and REDI (PAPER PICK SUCCESS) sensor reflector. If there is any dust or fiber remnants, clean by using a can of compressed air to blow out and clean.

Figure 6-62 ADF REDI sensor



- 1 – REDI sensor window
- 2 – REDI sensor reflector
- 3 – ADF hatch

10. Check the REDI sensor reflector on flatbed. If there is any dust or fiber remnants, clean it by using a can of compressed air to blow out and clean. (related issue, ADF jam without paper inside)

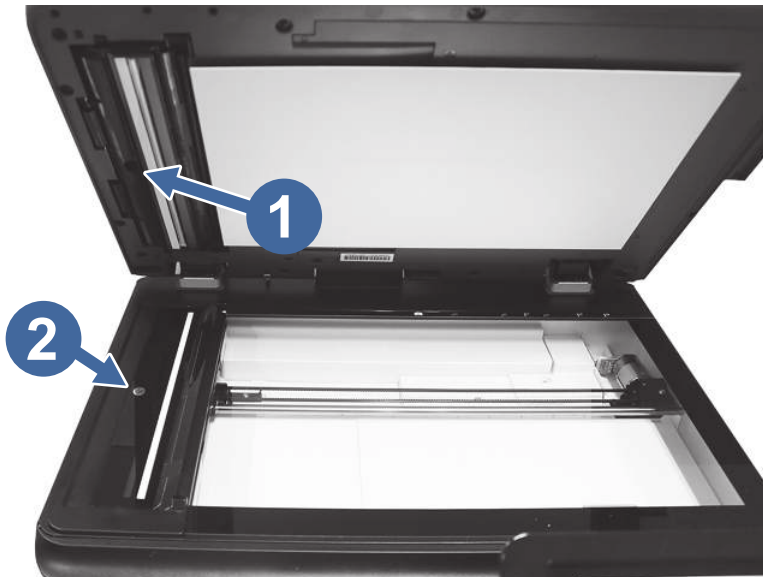


Callout 1: Check for paper blocking this area.


Callout 2: Clean this area with a damp lint free cloth.

11. Verify that the connections between the automatic document feeder and the SCB are correctly seated.


Figure 6-63 SCB connections

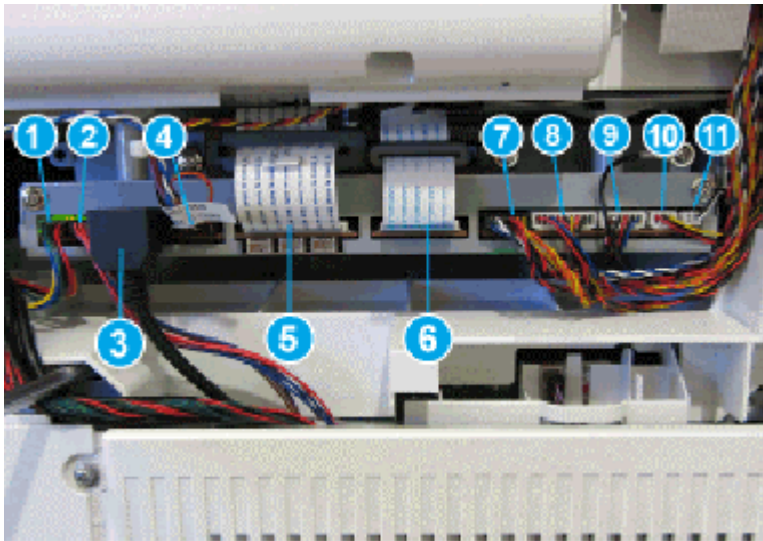


12. Using the Manual Scanner Sensor Test verify functionality of the ADF Paper Path Pick Success sensor.
 - a. Navigate to and select **Support Tools**.

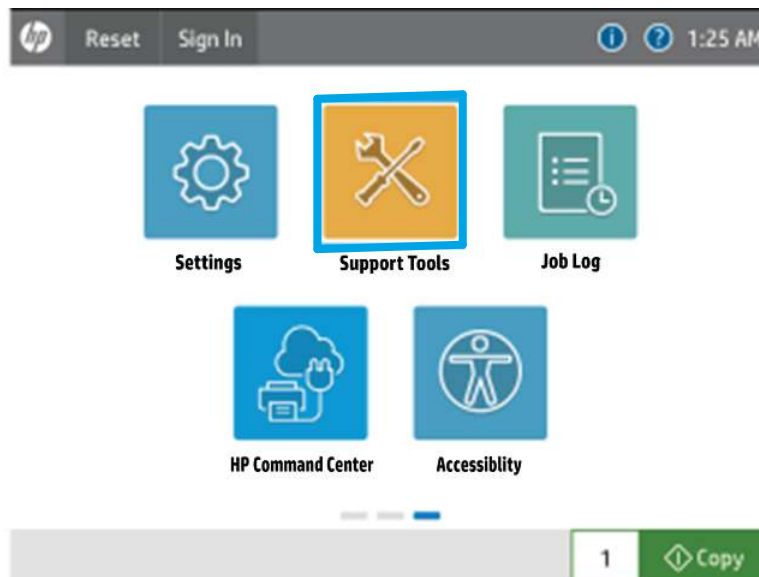


- b. Select **Troubleshooting**.

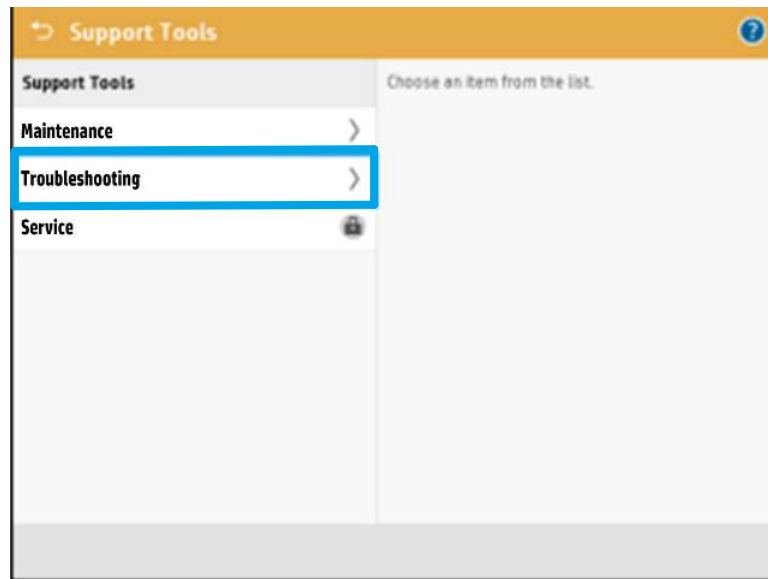


- c. Select **Diagnostic Tests**.

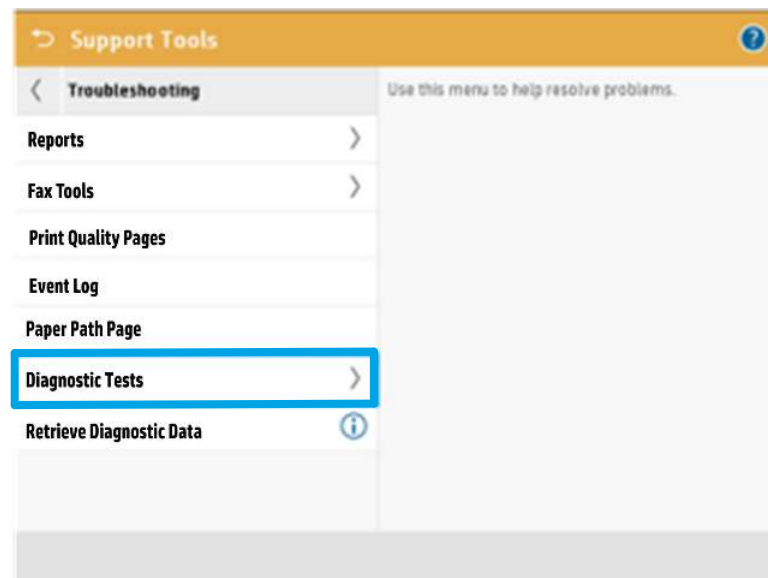


- d. Select **Continue**.

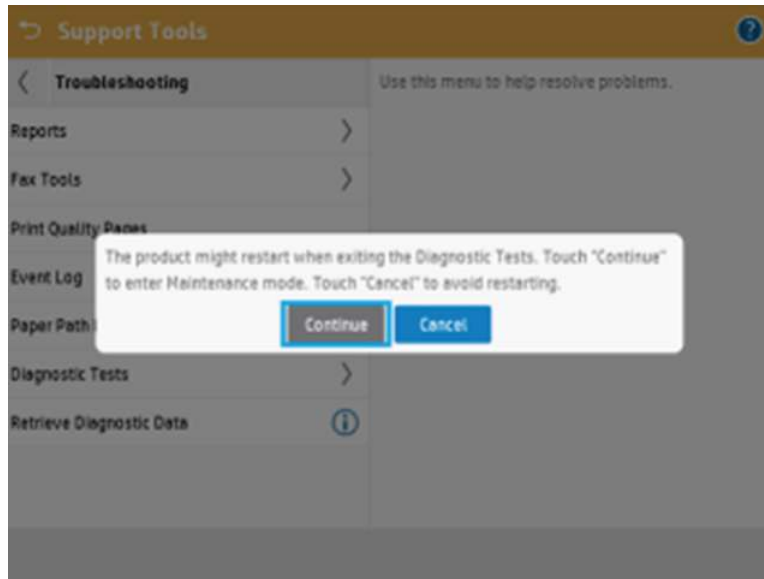

- e. Select **Manual Sensor Test**.

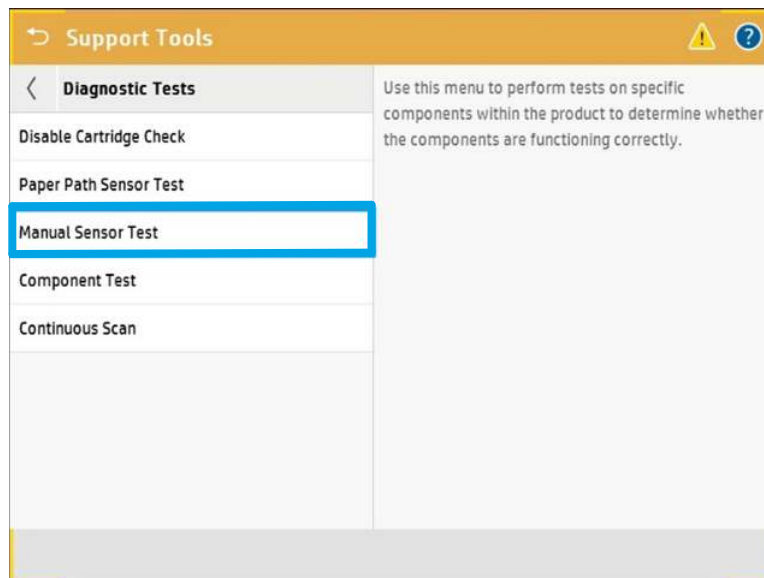

- f. Select **ADF Paper Path Deskew**.

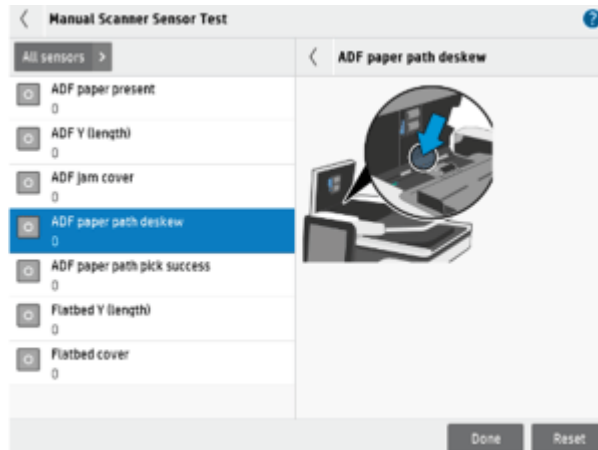

- g. Select **ADF Paper Path Pick Success**.

(Only in FLOW-MODELS)



NOTE: Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advancing.



- h. Close the ADF cover and ensure that is secure and closed correctly.

13. Open and close the ADF cover to trigger the ADF Paper Path Pick Success sensor.



NOTE: Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advanced.

14. If the ADF Paper Path Pick Success test fails to advance the count, replace the document feeder.

For instructions: See the Repair Service Manual for this product.

Part number

- Flow models part number: B5L47-67907
- Non-Flow models part number: B5L47-67906



NOTE: Note: Should a grinding noise be reported or heard in conjunction with the pick/feed of paper through the ADF, replace the document feeder (ADF) unit.


Document Feeder whole unit (ADF) part number:

- Flow models part number: B5L47-67909
- Non-Flow models part number: B5L47-67908

31.13.02

Document feeder job error, feed jam.

The paper passed the pick-success sensor, and then jammed in the document feeder paper path.

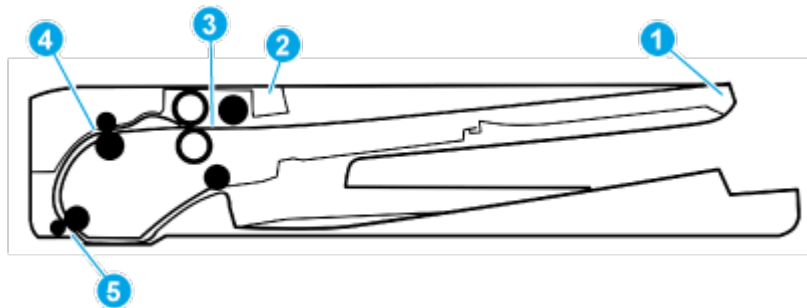


Between sensor location 4 and 5.

Recommended action for customer


Follow these troubleshooting steps in the order presented.


For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

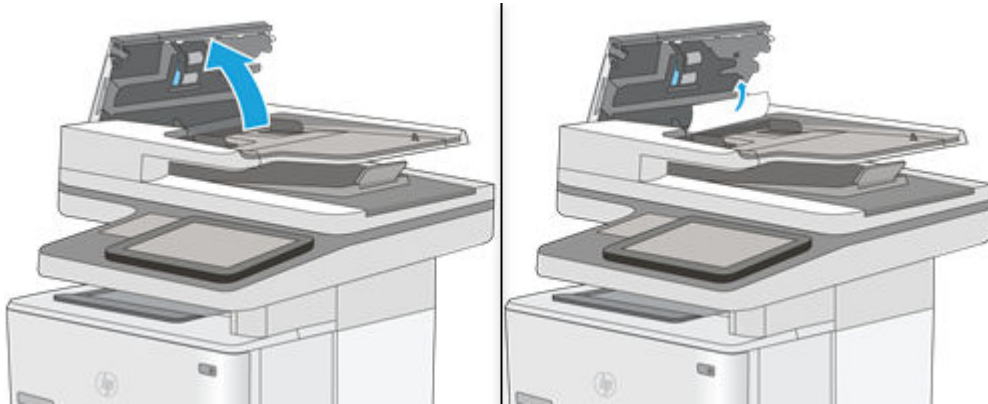

2. Lift the document-feeder input tray and remove any jammed paper.

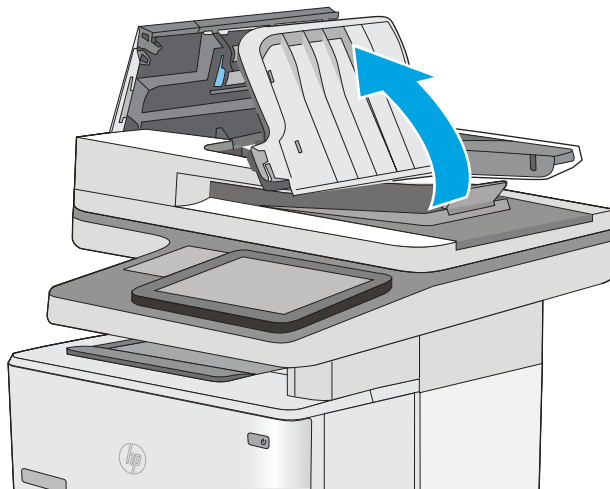

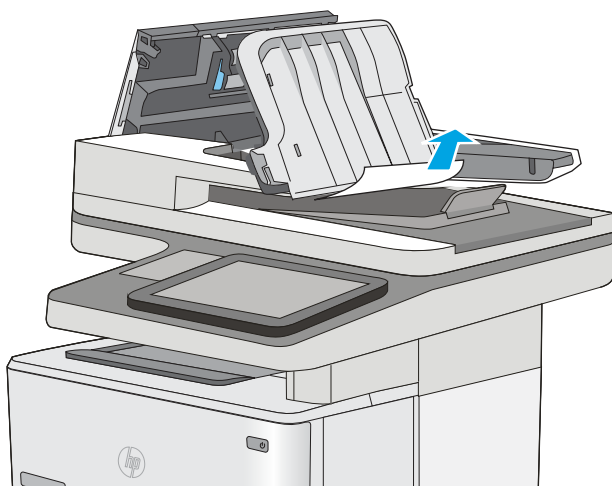

3. Lower the document-feeder input tray and then close the document feeder cover.

 **NOTE:** Verify that the latch on the top of the document-feeder cover is completely closed.


4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF): [Click here - c06601744](#)

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.

Figure 6-64 Set the ADF guides

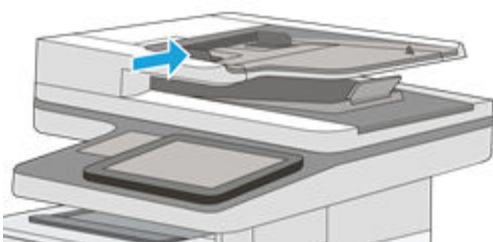


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.


 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

6. Check the Document Feeder Kit consumable status.


- a. Navigate to and select **Supplies** on the control panel.

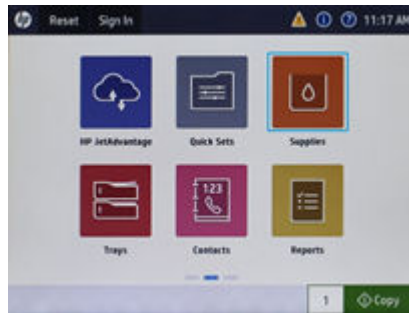

- b. Select **Document Feeder Kit**.

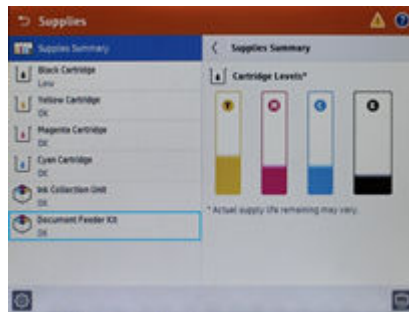

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

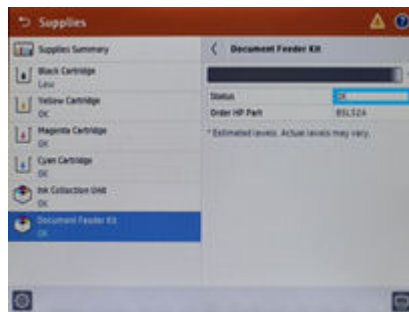


- d. Recommend that the customer replace the Document Feeder Kit if the status is **Low** or **Very Low**.

Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm

water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

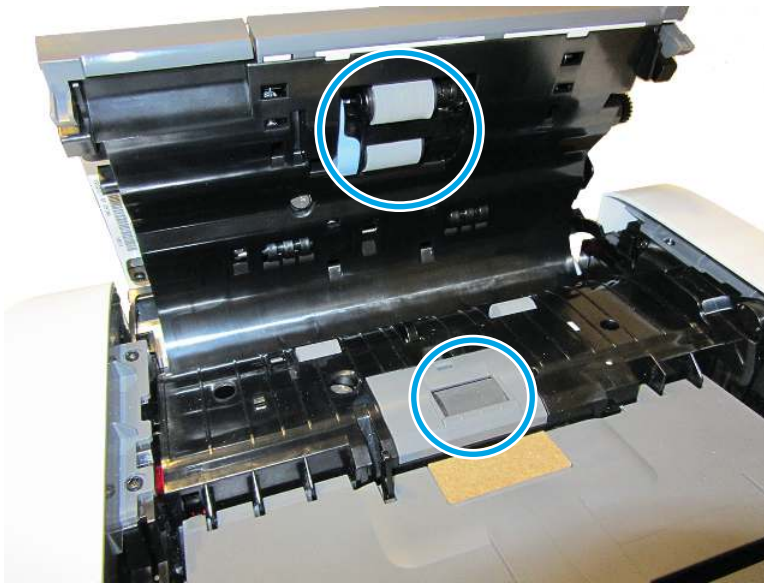

NOTE: Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: W5U23A/HP 200 ADF Roller Replacement Kit

To order parts, go to <https://store.hp.com>


9. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agent


Follow these troubleshooting steps in the order presented.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)


1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

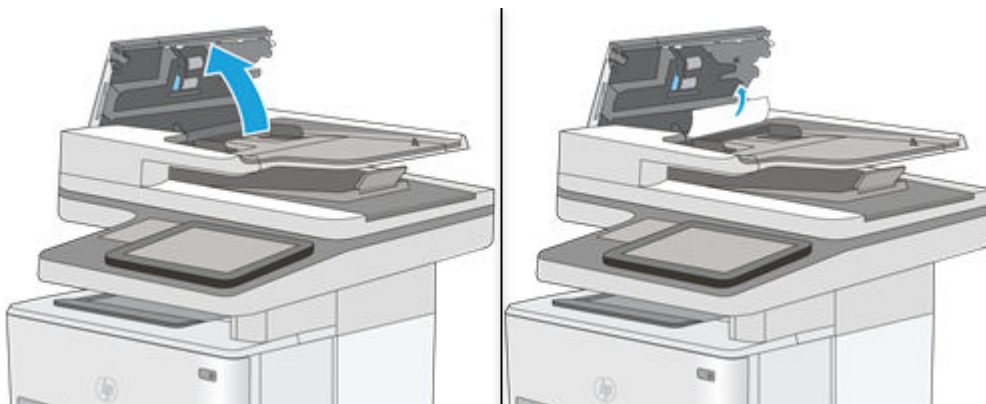

2. Lift the document-feeder input tray and remove any jammed paper.
 - a. Lift the document feeder input tray

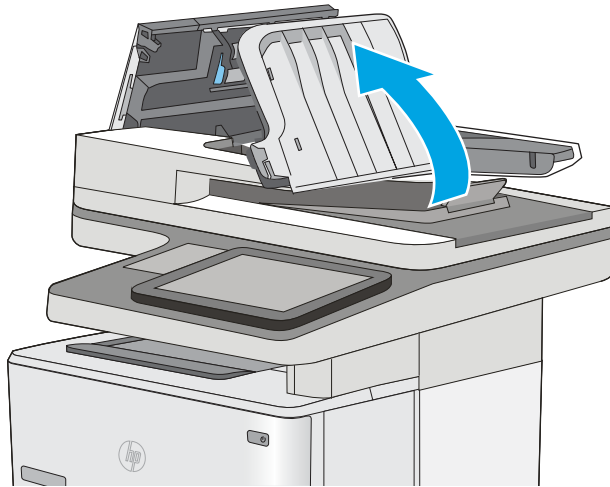

- b. Remove any paper found under the tray.

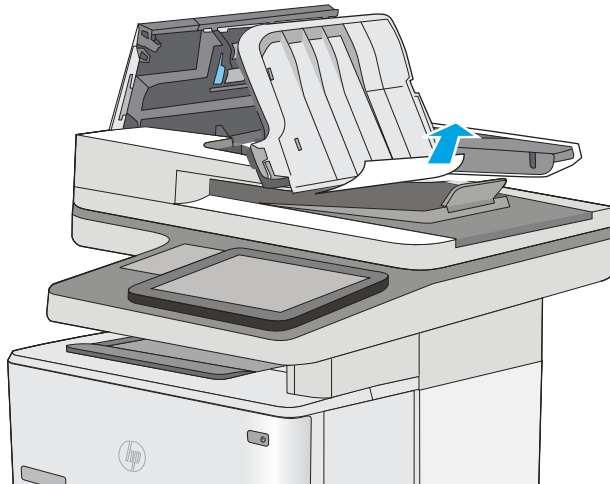


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

3. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path

- a. Open the ADF and remove any paper found.

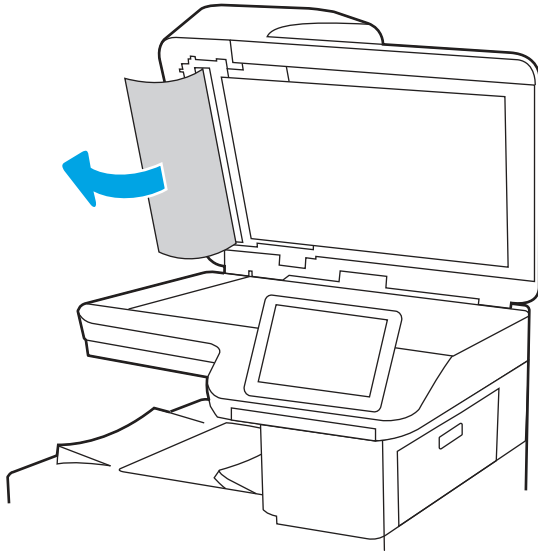

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

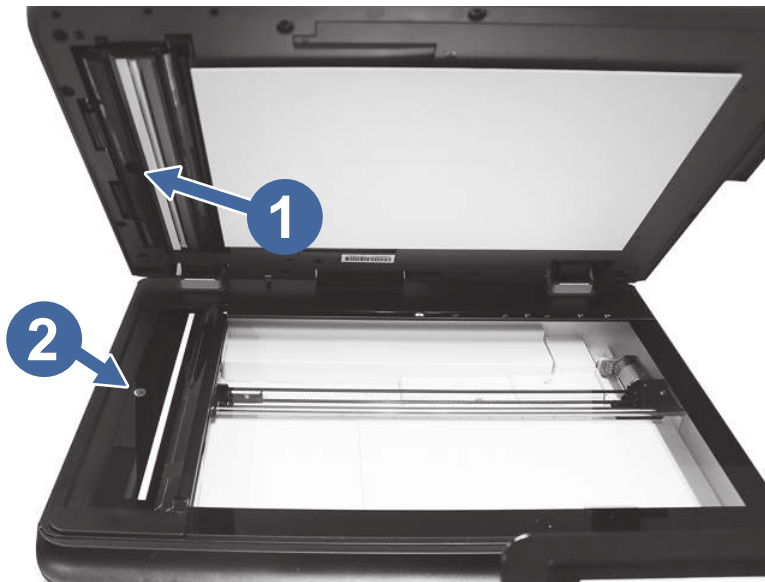

Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.


- c. Close the document feeder.
4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF): [Click here - c06601744](#)

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-65 Set the ADF guides

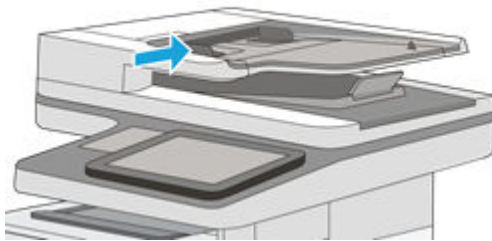


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

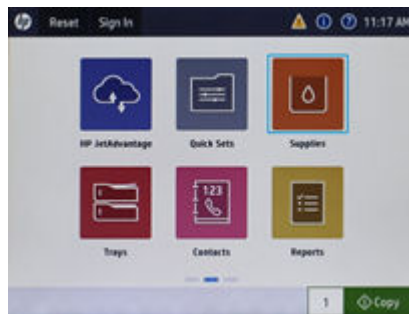

- b. Select **Document Feeder Kit**.

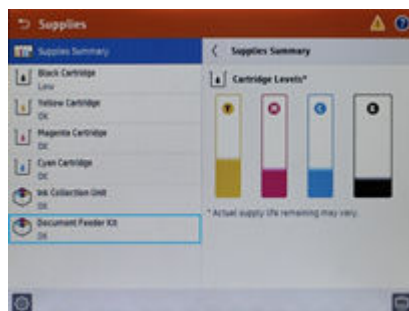

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

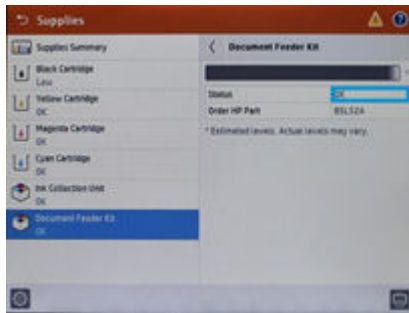


- d. If the status is **Low** or **Very Low**, recommend that the customer replace the Document Feeder Kit.

Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace the (ADF maintenance replacement roller kit) - W5U23-67901

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

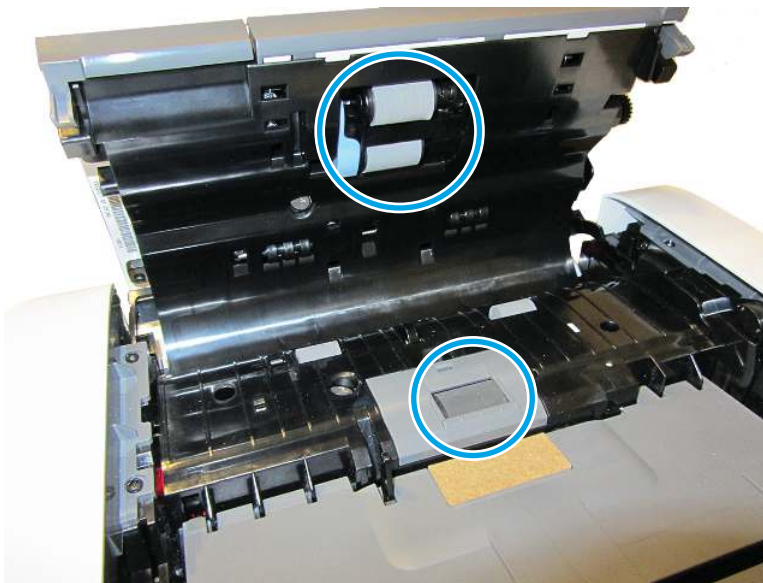

 **NOTE:** Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: W5U23-67901 ADF maintenance replacement roller kit

 **NOTE:** Note: Should a grinding noise be reported or heard in conjunction with the pick/feed of paper through the ADF, replace the document feeder (ADF) unit.

Document Feeder whole unit (ADF) part number:


- Flow models part number: B5L47-67909
- Non-Flow models part number: B5L47-67908

Recommended action for onsite technicians


Follow these troubleshooting steps in the order presented.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)


1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

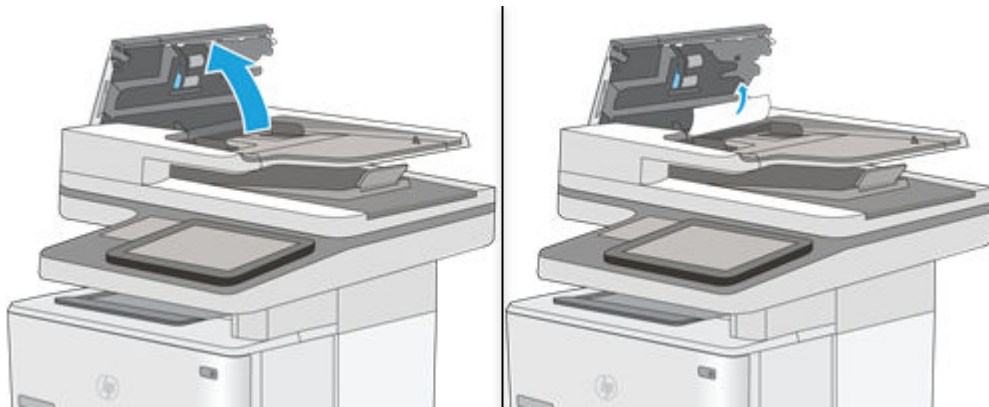

2. Lift the document-feeder input tray and remove any jammed paper.
 - a. Lift the document feeder input tray

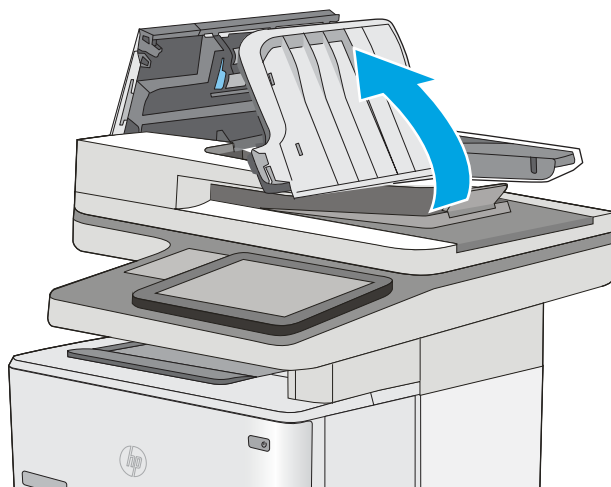

- b. Remove any paper found under the tray.

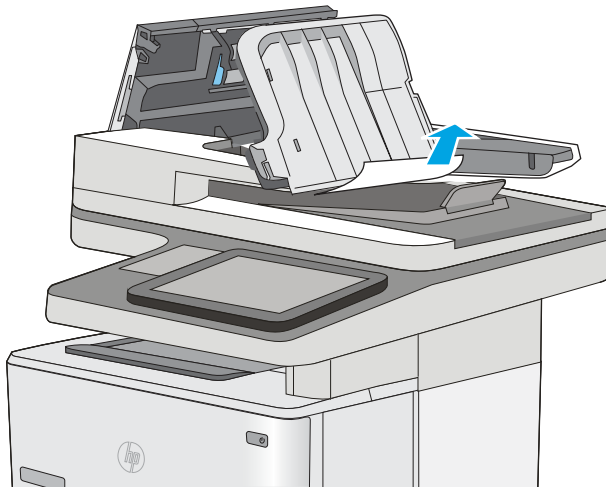


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

- 3. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path

- a. Open the ADF and remove any paper found.

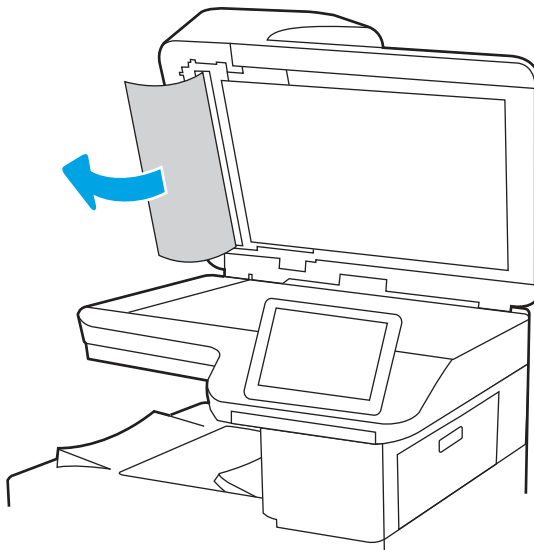

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

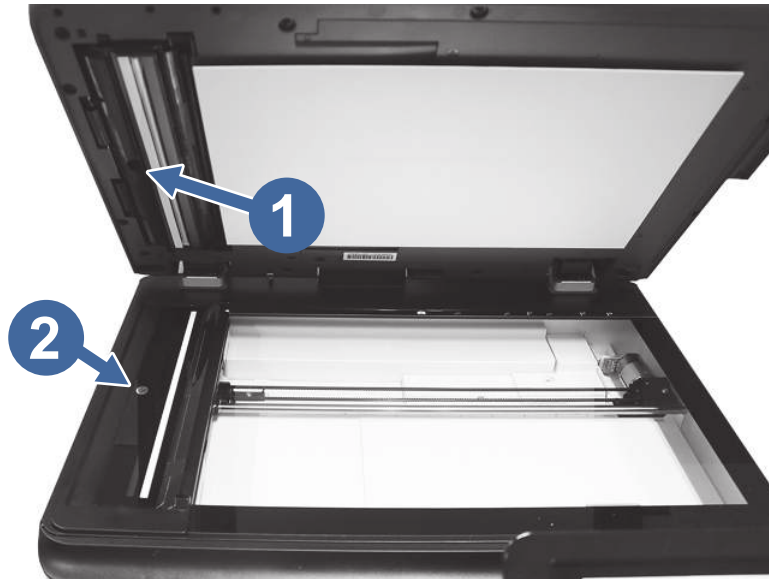

Callout 1: Check for paper blocking this area.


Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.
4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:
Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF): [Click here - c06601744](#)
 5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
Make sure that the paper stack is correctly aligned at the center of the input tray when paper is

loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-66 Set the ADF guides

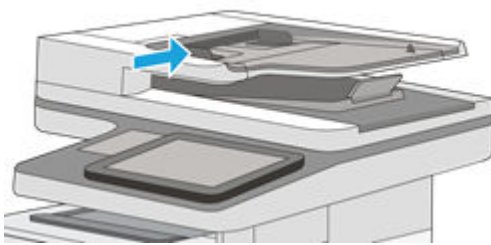


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

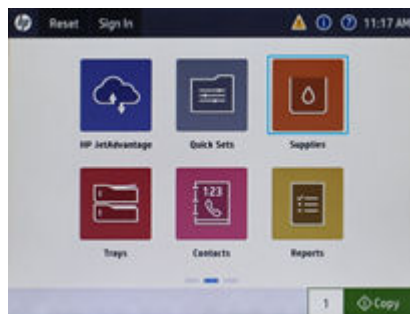

- b. Select **Document Feeder Kit**.

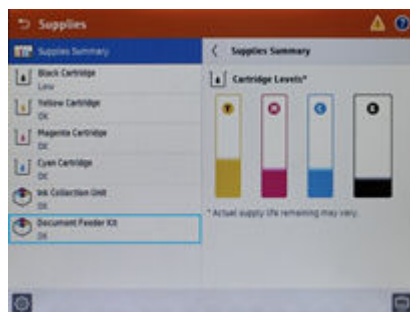

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

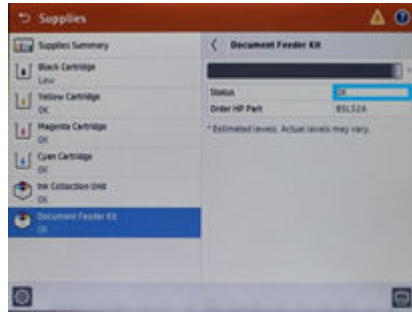


- d. If the status is **Low** or **Very Low**, recommend that the customer replace the Document Feeder Kit.

Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace the (ADF maintenance replacement roller kit) - W5U23-67901

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

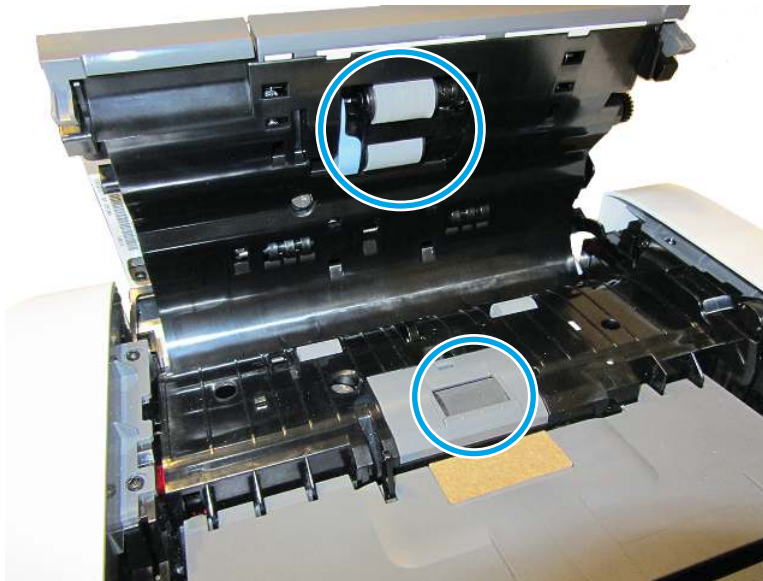


 **NOTE:** Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: W5U23-67901/(ADF maintenance replacement roller kit)


9. Inspect the ADF pick success sensor, cleaning both the REDI (paper pick success) sensor window and REDI (PAPER PICK SUCCESS) sensor reflector. If there is any dust or fiber remnants, clean by using a can of compressed air to blow out and clean.

Figure 6-67 ADF REDI sensor

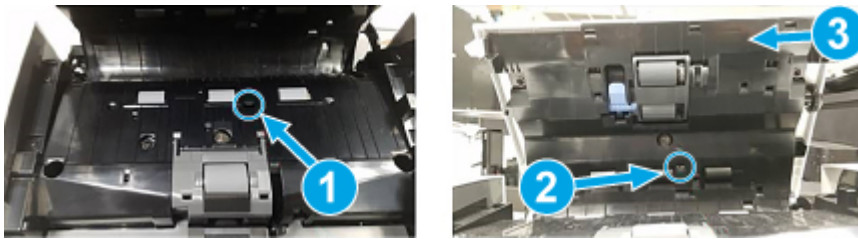

- 1 – REDI sensor window
2 – REDI sensor reflector
3 – ADF hatch

10. Check the REDI sensor reflector on flatbed. If there is any dust or fiber remnants, clean it by using a can of compressed air to blow out and clean. (related issue, ADF jam without paper inside)

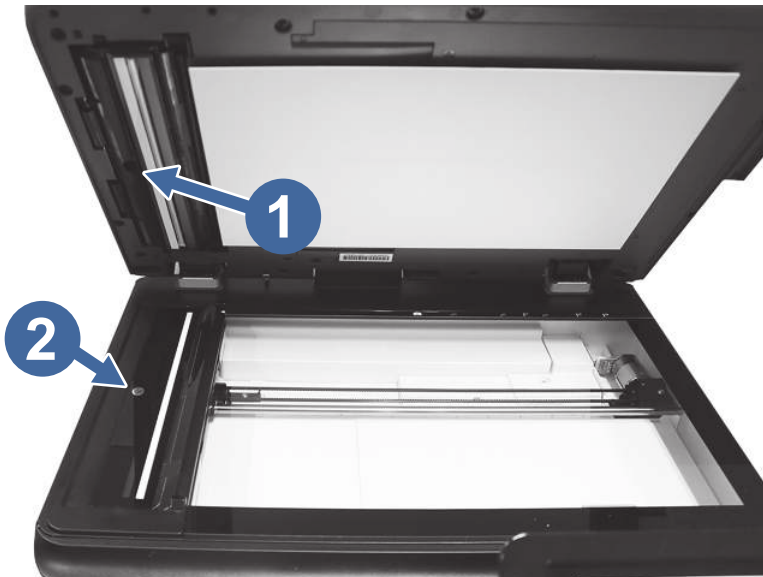


Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.


11. Verify that the connections between the automatic document feeder and the SCB are correctly seated.

Figure 6-68 SCB connections

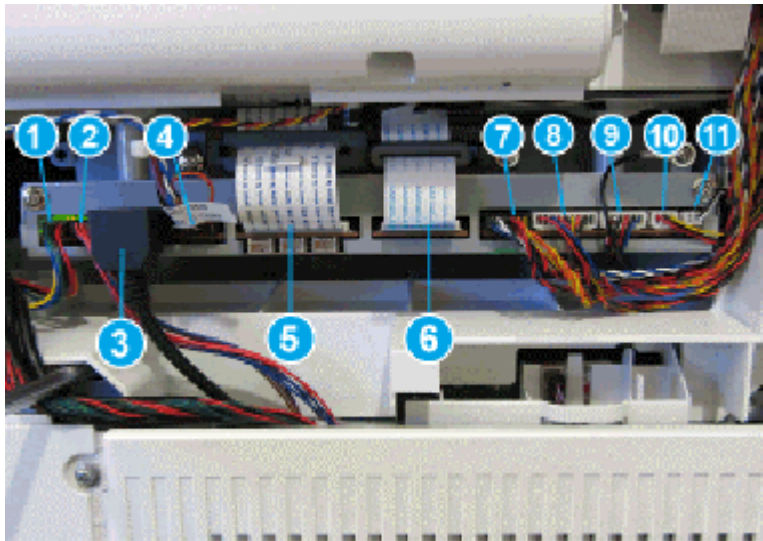


12. Using the Manual Scanner Sensor Test verify functionality of the ADF Paper Path Pick Success sensor.


- a. Navigate to and select **Support Tools**.

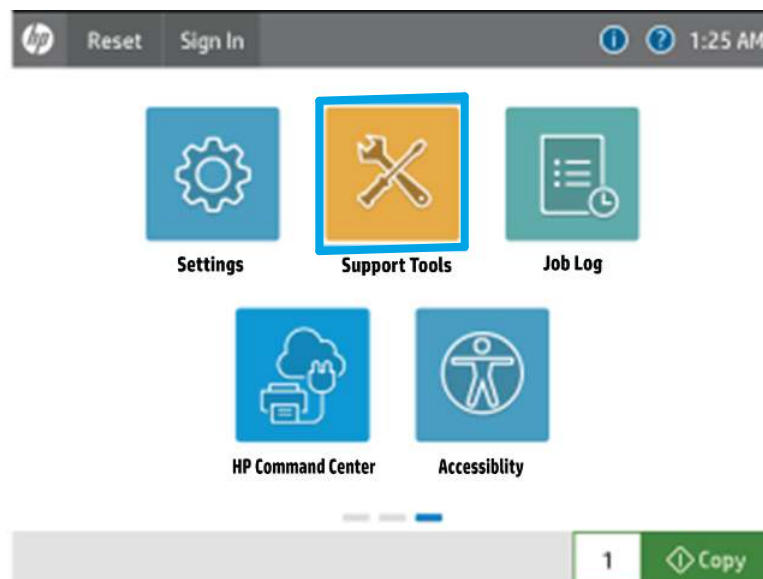


- b. Select **Troubleshooting**.

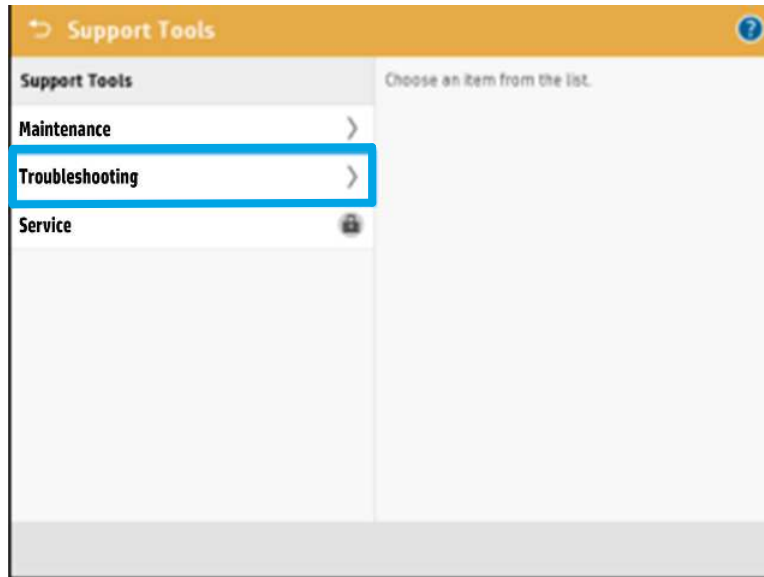


- c. Select **Diagnostic Tests**.

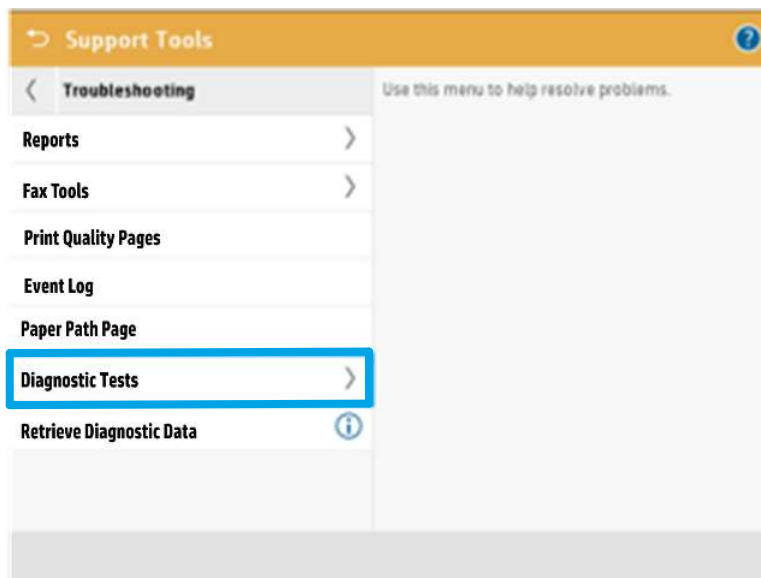


- d. Select **Continue**.

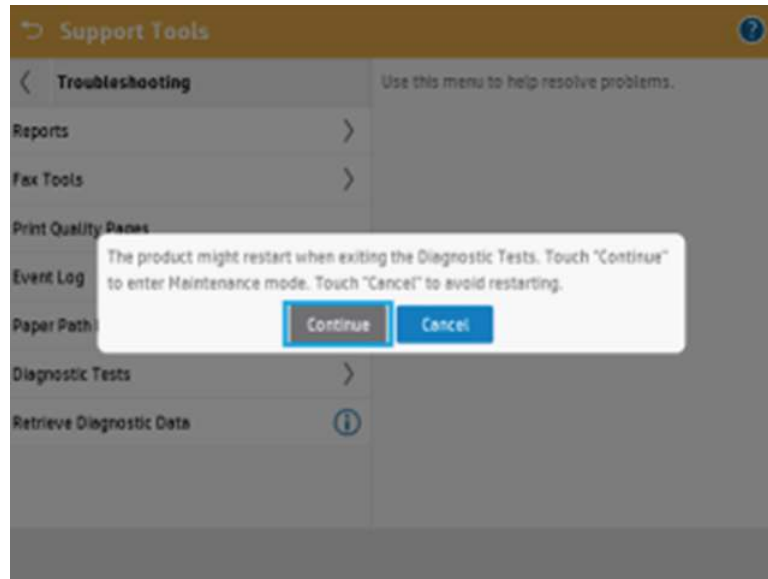

- e. Select **Manual Sensor Test**.

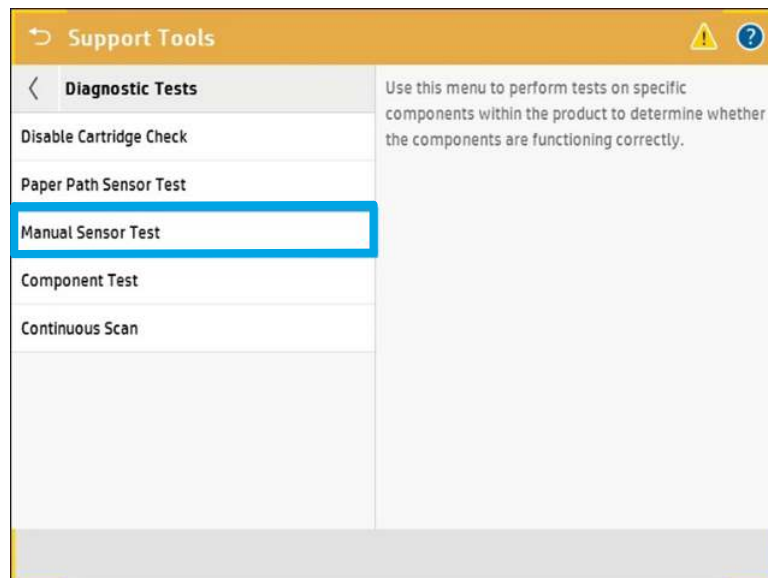

- f. Select **ADF Paper Path Deskew**.

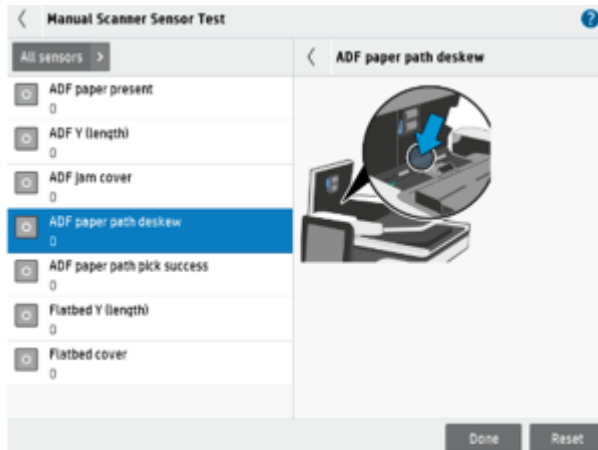


- g. Select **ADF Paper Path Pick Success**.

(Only in FLOW-MODELS)



NOTE: Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advancing.

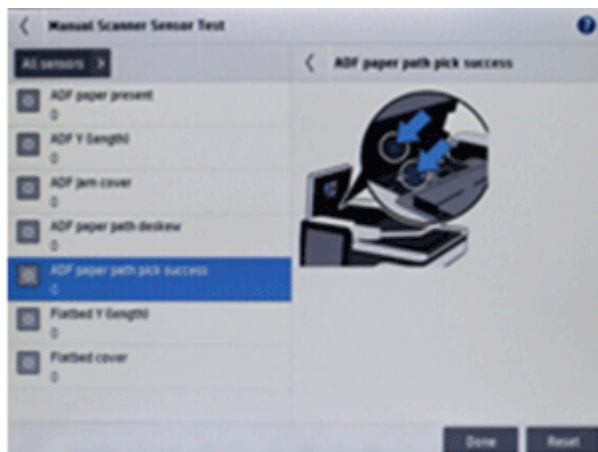

- h. Close the ADF cover and ensure that is secure and closed correctly.

13. Open and close the ADF cover to trigger the ADF Paper Path Pick Success sensor.



 **NOTE:** Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advanced.

14. If the ADF Paper Path Pick Success test fails to advance the count, replace the document feeder.

For instructions: See the Repair Service Manual for this product.

Part number

- Flow models part number: B5L47-67907
- Non-Flow models part number: B5L47-67906

 **NOTE:** Note: Should a grinding noise be reported or heard in conjunction with the pick/feed of paper through the ADF, replace the document feeder (ADF) unit.

Document Feeder whole unit (ADF) part number:

- Flow models part number: B5L47-67909
- Non-Flow models part number: B5L47-67908

31.13.13

The document feeder jam access door is open.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Verify that the jam access cover is closed.

2. Verify that the flag is not broken off. Open and close the jam cover and if the sensor status does not change then replace the document feeder.



3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians


Follow these troubleshooting steps in the order presented.

1. Verify that the jam access cover is closed.
2. Verify that the flag is not broken off. Open and close the jam cover and if the sensor status does not change then replace the document feeder.



3. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Scanner Tests

4. Actuate the pick-success sensor. If the sensor does not show functionality when tested, verify connector (9) ultra-sonic sensor.

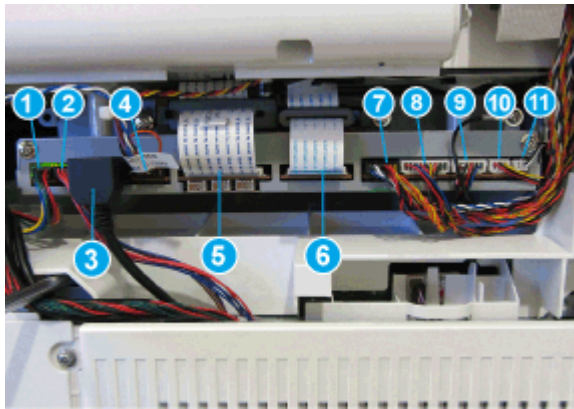

5. If sensor still fails, replace the document feeder.

For instructions: See the Repair Service Manual for this product.

Table 6-46 Part number:

Description	HP Part Number
Document feeder (M577c/z) kit	B5L47-67902
Document feeder (M577dn/f) kit	B5L47-67901

31.13.14

Document feeder job error: over current.


This is a feed jam in the document feeder, and the motor is not turning.

Recommended action for customer



Follow these troubleshooting steps in the order presented.

For further troubleshooting, please view this video: [Fixing 31.13.01/02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

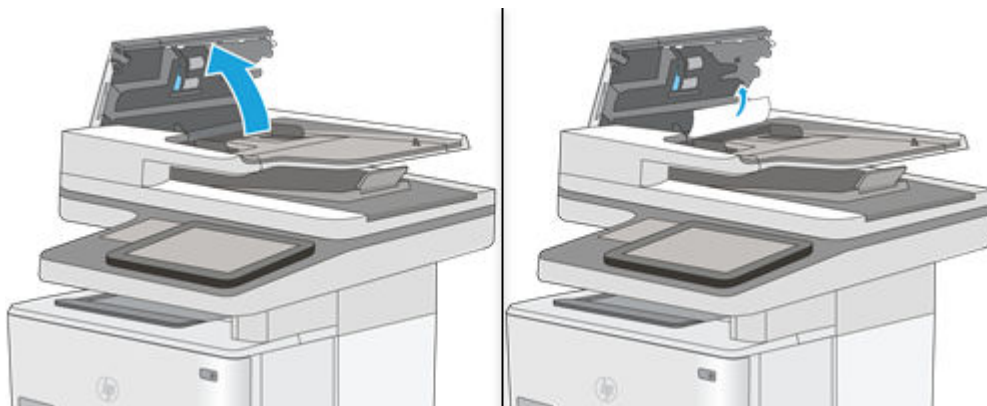

2. Lift the document-feeder input tray and remove any jammed paper.

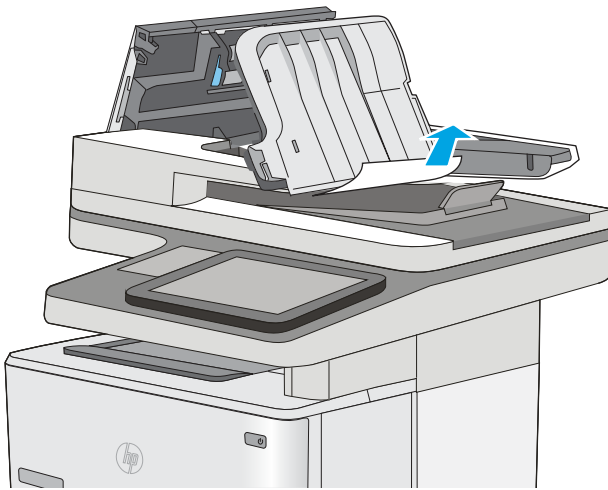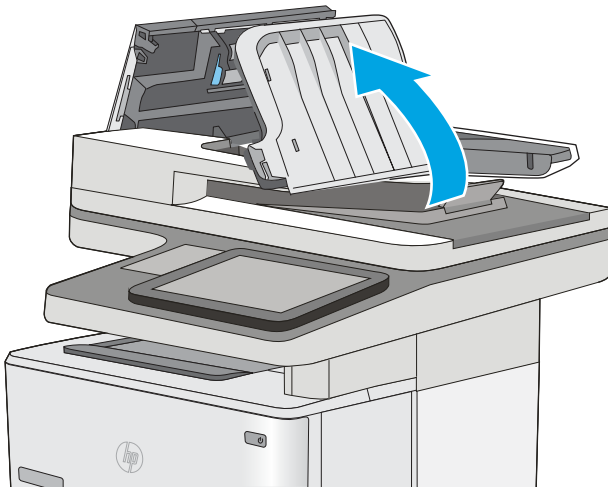

3. Lower the document-feeder input tray and then close the document feeder cover.



NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.


This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF): [Click here - c06601744](#)

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is

loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-69 Set the ADF guides

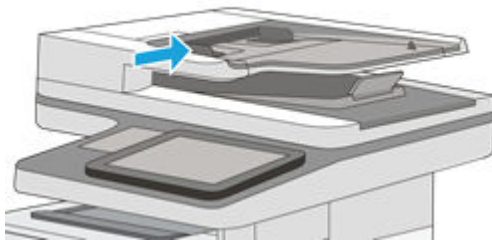


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

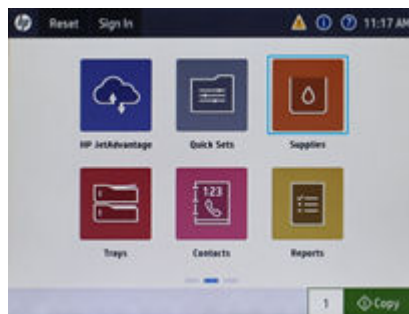

- b. Select **Document Feeder Kit**.

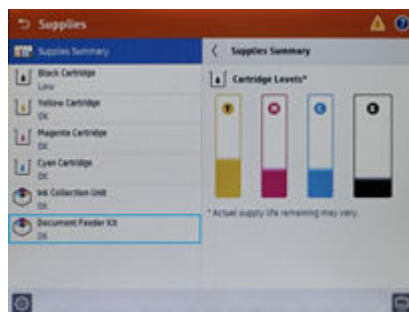

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

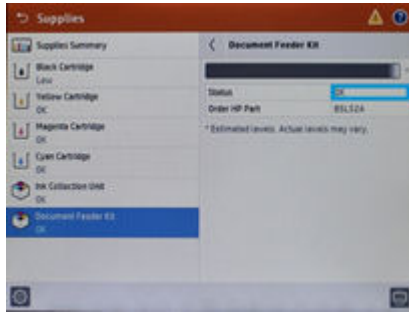


- d. Recommend that the customer replace the Document Feeder Kit if the status is **Low** or **Very Low**.

Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

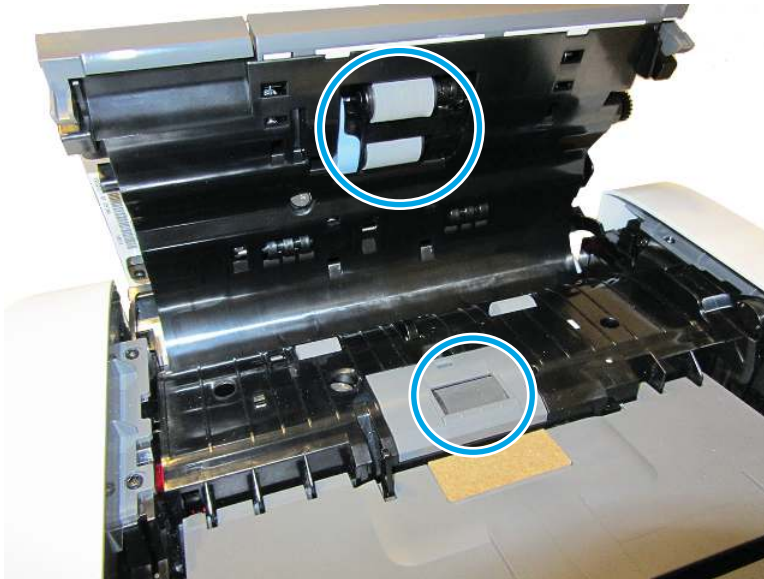

 **NOTE:** Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit


To order parts, go to <https://store.hp.com>

9. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Verify that the paper meets the HP printer specifications.
2. Ensure that the document feeder input tray is not overloaded.
3. Check the event log for other document feeder errors. If there are other errors listed, resolve those errors first.
4. Open and close the top cover to see if the pick motor turns without displaying the error. If there is no error, then the motor is good.
5. Verify that the motor cables are connected. (Connector 7 – document feeder Motors)

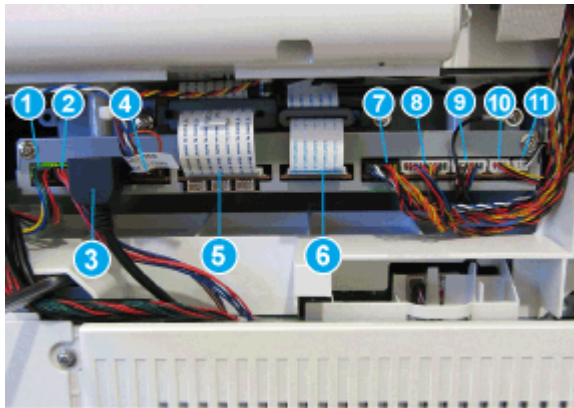

6. Re-seat the document feeder to the SCB connections.
7. If the error persists, replace the document feeder.

For instructions: See the Repair Service Manual for this product.

Table 6-47 Part number:

Description	HP Part Number
Document feeder (M577c/z) kit	B5L47-67902
Document feeder (M577dn/f) kit	B5L47-67901

32.WX.YX Error Messages

32.* errors

Errors in the 32.* family are related to either product start events or to backup and restore events.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. Retry the job.

32.08.A1, 32.08.A2, 32.08.A3

An event related to starting the printer.

32.08.A1 (event code)

Shutdown event. Boot after abnormal shutdown.

32.08.A2 (event code)

Boot from normal shutdown event.

32.08.A3 (event code)

Regular boot event.

Recommended action

There is no action needed for this message.

- No action necessary.

32.1C.05

The restore job ticket was submitted with invalid credentials.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Verify the credentials that were submitted.
2. Check the domain, user name, and password.

32.1C.06 (event code)

The backup job ticket was submitted with invalid credentials.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Verify the credentials that were submitted.
2. Check the domain, user name, and password.

32.1C.07 (event code)

Backup restore permissions error.

There was an error during the creation, read, or write of the restore file.

Recommended action

Follow these troubleshooting steps in the order presented.

- Retry the job.

32.1C.08 (event code)

Not enough disk space to perform backup/restore, or a network share issue.

There was an error during the creation, read, or write of the backup file.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Retry the job.
2. Remove stored jobs and retry.
3. If the error persists, try using a larger capacity storage device for the share location and check the network share settings.
4. Check the network share or try setting up a new shared network drive or folder.

32.1C.09 (event code)

Tried to restore a backup file that was not valid for this printer.

The data in the backup file specified in the restore job ticket is no longer valid due to a corruption of the data, or the data is no longer present.

Recommended action

Follow these troubleshooting steps in the order presented.

- Use a valid backup file.

32.1C.0A (event code)

Backup file is invalid.

The data in the backup file specified in the restore job ticket is no longer valid due to a corruption of the data, or the data is no longer present.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Use a valid backup file.
2. Reboot, and then observe the state of the printer.
3. If the error persists, perform a partition clean from the **Preboot** menu.

32.1C.0D (event code)

Backup/restore failed, auto-reboot failed, or the printer might be busy.

Recommended action

Follow these troubleshooting steps in the order presented.

- Reboot, and then retry the backup/restore.

32.1C.11 (event code)

Backup/restore time-out while communicating with the engine.

The backup operation was aborted because the printer is busy.

Recommended action

Follow these troubleshooting steps in the order presented.

- Wait until the printer is idle, and then try again.

32.1C.13, 32.1C.14

Not enough space exists to perform the backup.

The backup was aborted because the disk is at a critical level or full.

Scheduled backup failure.

Recommended action

Follow these troubleshooting steps in the order presented.

- Free up disk space, and then try again.

32.1C.15

The restore operation was aborted because the backup file was created by a previous version of firmware no longer supported by the feature.

Recommended action

Follow these troubleshooting steps in the order presented.

- Use the current backup file.

32.1C.2E

The restore operation was aborted because the printer is busy.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Wait until the printer is idle, and then retry.
2. Turn the printer off then on, and then retry.

32.1C.2F

Reset failure.

Recommended action

Follow these troubleshooting steps in the order presented.

- Turn the printer off, and then on. Retry the job.

32.1C.40

The backup operation completed successfully (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.41

The backup operation encountered an error (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.42

The backup operation completed, but with a warning message (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.43

A component in the backup file is not supported by the current version of firmware and will not be restored (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.44

A component in the backup file is not transferable to another printer and will not be restored (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.45

Some data was not included in the backup file (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.46

An expected component could not be found and was thus not backed up. Because components should be known on backups, this code is a warning (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.47

Some data was not restored from the backup file (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.48

The backup job ticket was submitted using an invalid network path.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Check that a shared folder was provided as part of the network path and not left blank.
2. Check that the server and the shared folder exists.
3. Check that you (or the applicable user) has permission to access the shared folder on the provided server.

32.1C.49

The backup job ticket was submitted with a bad encryption.



NOTE: This would only apply to a web services call to perform a backup with a blank PIN

Recommended action

Follow these troubleshooting steps in the order presented.

- Verify that the encryption personal identification number (PIN) meets the restrictions for the printer.

32.1C.4A

An error occurred when creating the temporary directories used to store the backup files in transition to and from the compressed (ZIP) file.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Retry the job.
2. If this does not resolve the issue, turn the printer off then on again and retry the job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

32.1C.56

Reset aborted. Backup/restore in progress (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.57

Reset aborted (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.58

Unknown reset error (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.60

The restore operation completed successfully (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.61

The restore operation encountered an error.

Recommended action

Follow these troubleshooting steps in the order presented.

- Review the printer's event log to see specific details about the failure.

32 . 1C . 62

The restore operation completed, but with a warning message.

Recommended action

Follow these troubleshooting steps in the order presented.

- Review the error log to see specific details about the failure.

32 . 1C . 68

The restore job ticket was submitted using an invalid network path.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Check that a shared folder was provided as part of the network path and not left blank.
2. Check that the server and the shared folder exist.
3. Check that you (or the applicable user) has permission to access the shared folder on the provided server.
4. Check that the path includes the compressed .ZIP file name as part of the path.

32 . 1C . 69

The restore job ticket was submitted with a bad encryption personal identification number (PIN).

Recommended action

Follow these troubleshooting steps in the order presented.

- Verify the encryption personal identification number (PIN) is the same PIN used to encrypt the backup file.

32 . 1C . 6A

An error occurred when creating the temporary directories used to store the restore files in transition to and from the compressed (ZIP) file.

Recommended action

Follow these troubleshooting steps in the order presented.

- Retry the job.

32 . 1C . 6D

An unusual error occurred when running the restore operation.

Recommended action

Follow these troubleshooting steps in the order presented.

- Retry the job.

33.WX.YZ Error Messages

33.* errors

Errors in the 33.* family are related to the printer's storage system or the formatter. The component might have been previously installed in another printer and is therefore locked to that other printer. Or, the component might be incorrect for this printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, investigate if the solid state drive (SSD) or hard disk drive (HDD) or formatter are the original ones. If recently swapped or replaced, turn the printer off, install the original SSD/HDD and/or formatter, and then turn the printer on.
3. If the issue persists, locate and notate the complete 33.WX.YZ error message as displayed on the control panel of the printer and contact your HP-authorized service or support provider, or contact customer support at <http://www.hp.com/go/contactHP>.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. If the issue persists, investigate if the solid state drive (SSD) or hard disk drive (HDD) or formatter are the original ones. If recently swapped or replaced, turn the printer off, install the original SSD or HDD and/or formatter, and then turn the printer on.
3. If the formatter/SSD or HDD were recently replaced and the original is unavailable verify the correct formatter/SSD or HDD are installed by referencing the part numbers.
4. If the issue persists, locate and notate the complete 33.WX.YZ error message as displayed on the control panel of the printer. Reference support content for the specific error and take the necessary action.
5. If the error cannot be cleared and you are unable to get the complete error code from the printer, perform a **Partial Clean** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

 **CAUTION:** A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

6. If the error persists, download and from the **Preboot** menu install the latest version of printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)

7. If the error persists, elevate the case using the Standard Support Process.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. If the issue persists, investigate if the solid state drive (SSD) or hard disk drive (HDD) or formatter are the original ones. If recently swapped or replaced, turn the printer off, install the original SSD or HDD and/or formatter, and then turn the printer on.
3. If the formatter/SSD or HDD were recently replaced and the original is unavailable verify the correct formatter/SSD or HDD are installed by referencing the part numbers.
4. If the issue persists, locate and notate the complete 33.WX.YZ error message as displayed on the control panel of the printer. Reference support content for the specific error and take the necessary action.
5. If the error cannot be cleared and you are unable to get the complete error code from the printer, perform a **Partial Clean** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

 **CAUTION:** A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

6. If the error persists, download and from the **Preboot** menu install the latest version of printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions.](#)

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)

7. If the error persists, elevate the case using the Standard Support Process.

33.01.xx

A save or restore process has occurred.

- **33.01.01** (event code)

A restore process has occurred.

- **33.01.02** (event code)

A save process has occurred.

- **33.01.03** (event code)

Save recover functionality OK after previously being disabled.

Recommended action

See recommended action.

- No action necessary.

33.02.01 Used board/disk installed

Used board or disk installed.

An encrypted board or disk with existing data previously locked to a different printer has replaced the original. If you continue, data is permanently lost.



IMPORTANT: Do not install used formatter boards in HP LaserJet, HP PageWide Enterprise or Managed printers. Only replace the formatter when specifically directed to do so during troubleshooting using the Control Panel Message Document (CPMD). If you see the 33.02.01 event code, it means a used board has been installed, and the settings may be incorrect.

For more information go to, or search for: [HP LaserJet Enterprise, HP LaserJet Managed, HP PageWide Enterprise, HP PageWide Managed - 33.02.01 error or printer name and/or product number changes after replacing the formatter](#) (c06360930).

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Install the latest version of printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, was the printer formatter recently replaced?
 - a. Investigate printer serial number service history to determine if formatter was recently replaced.
 - b. If formatter was recently replaced review the following document: HP LaserJet Enterprise, HP LaserJet Managed, HP PageWide Enterprise, HP PageWide Managed - 33.02.01 error or printer name and/or product number changes after replacing the formatter (c06360930)
3. If the formatter was not recently replaced, was the printer firmware recently updated?
 - a. Investigate if the printer firmware was recently updated.

- b. If the firmware has just been upgraded, go to **WISE** and search for the following topic: HP FutureSmart - '33.02.01 Used board/disk installed' error received after updating the firmware from HP FutureSmart 4.8.1 or 4.9 to a newer version

Or click on the following link: [HP FutureSmart - '33.02.01 Used board/disk installed' error received after updating the firmware from HP FutureSmart 4.8.1 or 4.9 to a newer version](#)

- 4. Install the latest version of printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

- 5. If the issue persists, elevate the case using your regional standard support process.

Recommended action for onsite technician

Follow these troubleshooting steps in the order presented.

- 1. Turn the printer off, and then on.
- 2. If the error persists, was the printer formatter and/or hard disk drive recently replaced?
 - a. Investigate printer serial number service history to determine if formatter was recently replaced.
 - b. If formatter was recently replaced review the following document: HP LaserJet Enterprise, HP LaserJet Managed, HP PageWide Enterprise, HP PageWide Managed - 33.02.01 error or printer name and/or product number changes after replacing the formatter (c06360930)
 - c. If the formatter or hard disk drive is available, reinstall the previous formatter or disk to recover the original device parameters.
 - d. If the formatter or hard disk drive is not available, elevate the case using your regional standard support process.
- 3. If the formatter was not recently replaced, was the printer firmware recently updated?
 - a. Investigate if the printer firmware was recently updated.
 - b. If the firmware has just been upgraded, go to **WISE** and search for the following topic: HP FutureSmart - '33.02.01 Used board/disk installed' error received after updating the firmware from HP FutureSmart 4.8.1 or 4.9 to a newer version

Or click on the following link: [HP FutureSmart - '33.02.01 Used board/disk installed' error received after updating the firmware from HP FutureSmart 4.8.1 or 4.9 to a newer version](#)

- 4. If the issue persists, elevate the case using your regional standard support process.

33.02.02

Save Recover Status Error

The save or recover is disabled, (one or both disabled) (**Event Log Only**)

Recommended action

There is no action needed for this message.

- No action necessary.

33.03.02

Data size mismatch. Unable to recover DCC NVRAM.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, replace the image control board (ICB) and return to HP for evaluation.

33.03.03 Incompatible formatter installed

This is an EFI BIOS event to prevent booting with the wrong formatter installed.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, perform a **Partial Clean** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

3. Install the latest version of printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

4. Turn the printer off, and then install the correct formatter in the printer.

Table 6-48 Part numbers

Description	HP Part Number
Formatter (M552 models only)	B5L23-67903
Formatter (M552 models only)(India and China)	B5L23-67904
Formatter (M553n, M553dn, M553dh)	B5L24-67909
Formatter (M553n, M553dn, M553dh)(India and China)	B5L24-67908
Formatter (M553x models only)	B5L26-67901
Formatter (M553x models only)(India and China)	B5L26-67902
Formatter (M577 models only)	B5L46-67909

Table 6-48 Part numbers (continued)

Description	HP Part Number
Formatter (M577 models only)(India and China)	B5L46-67911

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, perform a **Partial Clean** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: [HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#).*

- With the printer off, turn the printer on.
 - Press the HP logo that displays in the middle of the screen when you see the "1/8" under the logo.
 - Press the Down arrow button to highlight **Administrator**, and then press the OK button.
 - Press the Down arrow button to highlight **Partial Clean**, and then press the OK button.
 - Press the OK button again.
 - Press the Back button once to highlight **Continue**, and then press the OK button.
3. Install the latest version of printer firmware.
Go to [HP FutureSmart - Latest Firmware Versions](#).
For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).
 4. If the error persists, replace the formatter.



IMPORTANT: Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

Table 6-49 Part numbers

Description	HP Part Number
Formatter (M552 models only)	B5L23-67903
Formatter (M552 models only)(India and China)	B5L23-67904
Formatter (M553n, M553dn, M553dh)	B5L24-67909
Formatter (M553n, M553dn, M553dh)(India and China)	B5L24-67908
Formatter (M553x models only)	B5L26-67901
Formatter (M553x models only)(India and China)	B5L26-67902
Formatter (M577 models only)	B5L46-67909
Formatter (M577 models only)(India and China)	B5L46-67911

For instructions: See the Repair Service Manual for this product.

For instructions: See the Repair Service Manual for this product.

33.03.05 EFI Boot error

EFI BIOS event showing that a replacement formatter Recover attempt was unsuccessful.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. If the error persists, perform a **Partial Clean** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

- With the printer off, turn the printer on.
 - Press the HP logo that displays in the middle of the screen when you see the "1/8" under the logo.
 - Press the Down arrow button to highlight **Administrator**, and then press the OK button.
 - Press the Down arrow button to highlight **Partial Clean**, and then press the OK button.
 - Press the OK button again.
 - Press the Back button once to highlight **Continue**, and then press the OK button.
3. If the error persists, download and install the latest printer firmware available at [HP Customer Support - Software and Driver Downloads](https://support.hp.com/drivers) (<https://support.hp.com/drivers>).

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, replace the formatter.

Table 6-50 Part numbers

Description	HP Part Number
Formatter (M552 models only)	B5L23-67903
Formatter (M552 models only)(India and China)	B5L23-67904
Formatter (M553n, M553dn, M553dh)	B5L24-67909

Table 6-50 Part numbers (continued)

Description	HP Part Number
Formatter (M553n, M553dn, M553dh)(India and China)	B5L24-67908
Formatter (M553x models only)	B5L26-67901
Formatter (M553x models only)(India and China)	B5L26-67902
Formatter (M577 models only)	B5L46-67909
Formatter (M577 models only)(India and China)	B5L46-67911

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

This issue is caused by an unsuccessful formatter recovery after a formatter has been replaced.

1. Turn off the printer, and then turn on the printer.
2. If the error persists, perform a **Partial Clean** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

 **CAUTION:** A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

- a. Turn on the printer.
- b. Press the HP logo that displays in the middle of the screen when you see the "1/8" under the logo.
- c. Touch the down arrow button ▼ to highlight **Administrator**, and then press the **OK** button.
- d. Touch the down arrow button ▼ to highlight **Partial Clean**, and then press the **OK** button.
- e. Touch the **OK** button again.
- f. Touch the Home button  to highlight **Continue**, and then press the **OK** button.

The printer will automatically reboot and should return to a Ready state.

3. If the error persists, download and from the **Preboot** menu install the latest version of printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

4. If the issue persists, remove and reinstall the formatter board.
5. If the error persists, replace the formatter.

M806 part number: CZ244-67901

M806 (China/India) part number: CZ244-67902

M830 part number: CF367-67915

M830 (China/India) part number: CF367-67916

For instructions:

See the Repair Service Manual for this product.

6. If the error persists, elevate the case using the Standard Support Process.

33.03.06

The memory PCA was not detected on startup.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on again.
2. If the error persists, turn the printer off, disconnect the power cord, and remove the formatter cover. Press firmly on the memory PCA cable connection to the formatter.
3. If the error persists, replace the memory PCA assembly.

Part number: RM2-7138-000CN

33.04.01 Missing TPM

A Trusted Platform Module is missing from a printer that previously had a TPM installed.

TPM accessory (optional): This system is using a TPM module installed as an accessory to protect data and it is not present. The original TPM must be returned or you can select the [Stop Using](#) option in the preboot TPM sub-menu. All data will be cryptographically erased and a reload of firmware from USB might be required.

TPM Standard (Standard on product): This system is using a TPM module installed at the factory to protect data and it is not present. Verify that the TPM is seated firmly on the formatter, in case of shifting during shipment. If the TPM has been removed for a formatter replacement, put the original TPM on the board. If the original TPM cannot be reinstalled or has become damaged, **DO NOT** replace any parts. Replace the printer.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Reinstall the missing TPM module into the printer.



NOTE: If the TPM accessory was installed, you can also go to the [Administration](#) menu and under TPM, select the [Stop Using](#) option if you no longer want to use the TPM accessory.

3. Restart the printer.

33.04.02 Missing TPM

The wrong TPM is installed on a printer that previously had a different TPM installed.

TPM Optional device: This system is using a TPM module to protect data and it is not present. The original TPM module must be returned or you may select the **Stop Using** option in the preboot TPM sub-menu.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Reinstall the original TPM module into the printer.
3. Restart the printer.
4. Go to the [Administration](#) menu and under TPM and select the [Enable and Use](#) option.



NOTE: To no longer use the TPM device, go to the [Administration](#) menu and under TPM and select the [Stop Using](#) option.

33.04.03 Unknown TPM

A used TPM has been installed on a printer that has not previously had a TPM installed.

TPM Optional device: This system is using a TPM module to protect data and it is not present. The TPM module currently installed is used to protect data in another device. The original TPM module must be returned or you can start using this TPM module by selecting the [Enable and Use](#) option in the preboot TPM sub-menu. You can also stop using a TPM altogether.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off and remove the TPM module. The printer will not be protected.
2. If choosing to protect the printer with the used TPM, refer to the "Install a new or re-enable an existing TPM after disabling a previous TPM" section of the <http://h10032.www1.hp.com/ctg/Manual/c04499622> (c04499622).

33.04.05

TPM (Trusted Platform Module) Security Error

This system contains a TPM module that is not supported on the device or belongs to another device.

TPM is unique for each device.

For units that shipped with a TPM on board standard (most newer models): If the original TPM installed in the factory is unavailable or damaged, DO NOT replace any parts. Follow the recommended action.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order they are listed.

The technician will need to re-establish the trusted platform module state in the printer.



NOTE: Never replace the TPM on a unit that shipped with one. The TPM that can be ordered is only available for adding a level of security on a device that never had a TPM paired from the factory. A new TPM cannot be installed for security reasons.

1. Do **not** replace the formatter or HDD. It will not solve this issue.
2. Perform a Format Disk procedure, select **Continue** in the Pre-boot menu, and then reboot the device.
 - If the unit boots to a 33 . 04 . 05 error, reseal the eMMC or HDD.
 - If the unit continues to boot to a 33 . 04 . 05 error, continue to the next step.
3. Perform a Format Disk procedure again, and then reboot the device.
 - If the unit boots to a 99 . 09 . 67 error, reboot the device, and then update the firmware. This should resolve the issue.
 - If the unit continues to boot to a 33 . 04 . 05 error, continue to the next steps.
4. Remove the TPM and eMMC or HDD, open **Startup Options**, and then perform a Cold Reset.



WARNING! When removing the TPM, take extreme care as the connector on the TPM board can become dislodged and break. If this happens, a printer replacement will be required.

5. Reinstall the eMMC or HDD, open the Pre-boot menu, select **Manage Disk**, select **Boot Device**, and then select **Erase Unlock**.
 - If unit boots to a 99 . 09 . 67 error, reboot the device, and then update the firmware. This should resolve the issue.
 - If the unit continues to boot to a 33 . 04 . 05 error, continue to the next step.
6. Reseat the TPM and eMMC or HDD, perform a Format Disk, open Diagnostics, and then run diagnostics for all components.
 - If the Diagnostics fail, elevate the case to ATS and include all details.
 - If Diagnostics passes, continue to the next steps.
7. Remove the TPM and eMMC or HDD, open **Startup Options**, and then perform a Cold Reset.
8. Reinstall the eMMC or HDD, open the Pre-boot menu, select **Manage Disk**, select **Boot Device**, select **Erase Unlock**, and then reboot the device.
 - If the unit boots to a 99.09.67 error, reboot and then update the firmware. This should resolve the issue.
 - If the unit continues to boot to a 33 . 04 . 05 error, continue to the next step.

9. Include the following information in the CDAX case notes, and then elevate the case to ATS. No additional feedback is needed.



NOTE: Ensure that all original printer parts are installed on the unit at the time of elevation.

- Printer serial number.
- Collect the Diagnostic log file (.jdp file).
- Information when the 33.04.05 error displayed on the printer control panel.
- Parts replaced prior to the error displaying on the printer control panel.


33.04.15 TPM Authentication"

33.04.15 TPM Authentication" error caused due to the formatter manufacturing part roll.

Issue

An error message "**Error: 33.04.15 TPM Authentication**" displays on the printer control panel when the formatter with the part number "B5L46-60008" is installed on an HP LaserJet Managed MFP E57540.

Figure 6-70 Error message on control panel "33.04.15 TPM Authentication"

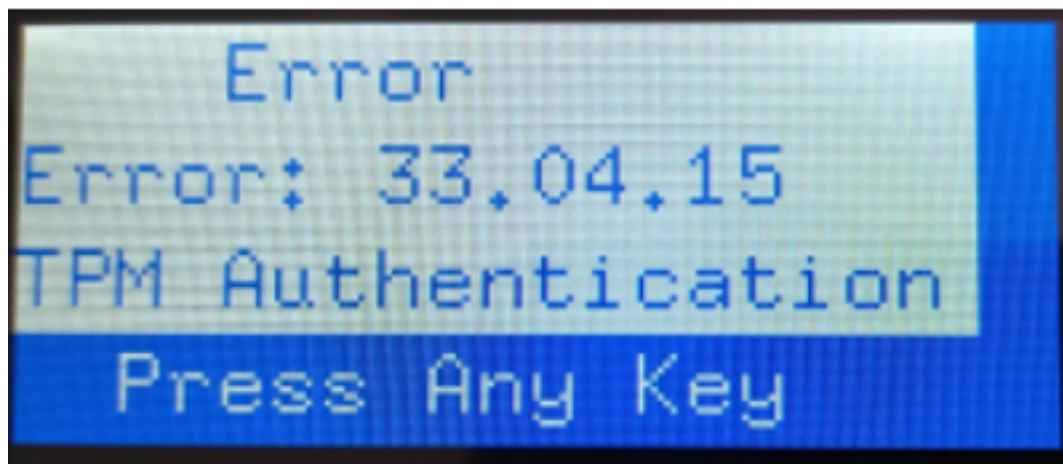

Applicable printer

This issue applies to the HP Color LaserJet Managed MFP E57540 printer series.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove the install Trusted Platform Module (TPM).
3. Turn the printer on.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Parts Predict Qualification

This issue occurs for Managed MFP E57540 manufactured from January 2023 and the label on the formatter manufacturing part number is "B5L46-60008".

Root cause


Due to supply issues, the manufacturing part number for the formatter was rolled from "B5L46-60001" to "B5L46-60008". The formatter part number change was implemented for MFP E57540.

This change implied that the formatter manufacturing part number "B5L46-60008" for MFP M578 was installed for MFP E57540. As this formatter was incompatible with a Trusted Platform Module (TPM) accessory, it caused an error message to display on the control panel when installed on a MFP E57540 with a TPM accessory.



NOTE: If a service to replace the formatter on MFP M577 or E57540 is required and the customer has the TPM accessory, this issue will occur if the replacement formatter has the manufacturing number "B5L46-60008" on the label.

Figure 6-71 Formatter B5L46-60008 with the TPM accessory

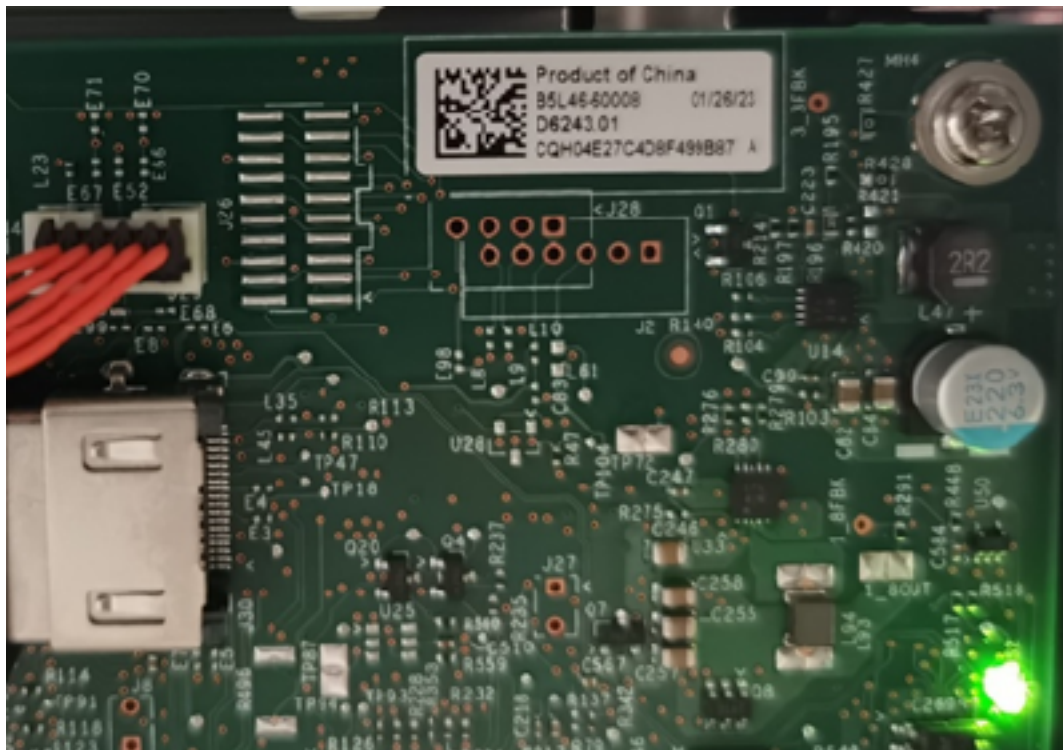

1. Remove the TPM Module.
 - a. Use the power button to turn off the printer and disconnect the power cable.
 - b. Remove the formatter cover, and then remove the hard disk drive (HDD).

- c. Locate the TPM accessory on the formatter, and then pull it straight off of the formatter to remove it.
- d. Check if the manufacturing part number on the label of the formatter is “B5L46-60008”.



NOTE: Take an image or picture of the manufacturing part number label on the formatter. You will need this information to replace the formatter.

2. Install the formatter without the TPM accessory.
3. Turn the printer on and check if the error message displays on the control panel.
4. Install a new formatter with the TPM accessory
 - a. Ensure that the old formatter manufacturing part number label is “B5L46-60008”.
 - b. Order a new formatter with part number B5L46-67909.



IMPORTANT: Make sure that the manufacturing part number label on the new formatter is B5L46-60001.


- c. Remove the formatter with the manufacturing part number label “B5L46-60008”.
- d. Install the new formatter with the TPM accessory.

Table 6-51 Part information

Part number	Description
B5L46-67909	Formatter PC board assembly


- e. Align the connector on the TPM (callout 1) with the connector on the formatter (callout 2), and then push the TPM onto the formatter to install it.

Figure 6-72 Install the TPM

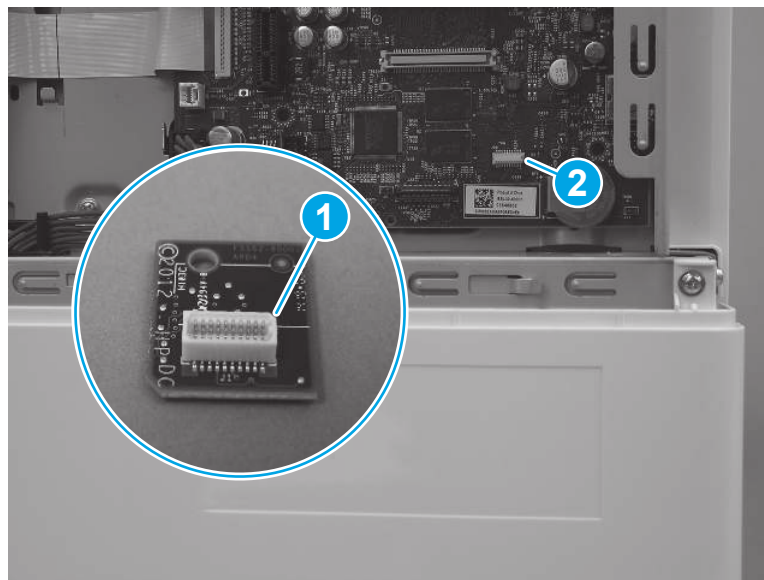

- f. Ensure that the TPM is fully seated in the connector.

Figure 6-73 Verify that the TPM is fully seated

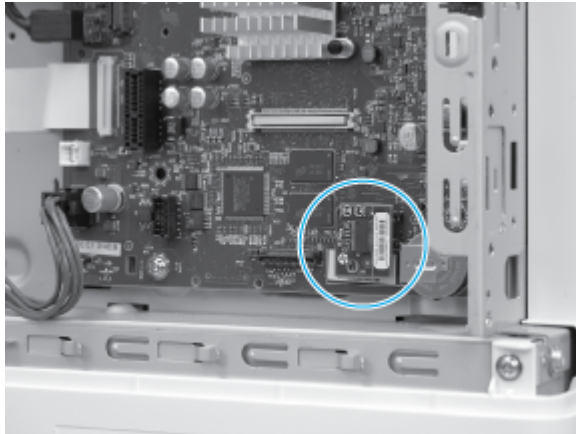

- g. Install the HDD and the formatter cover.
5. Connect the power cord, and then use the power button to turn on the printer.
6. Make sure that the printer initializes to a "Ready" state.

33.05.0z SureStart errors

A SureStart error has occurred.

The printer detected and recovered from a corrupted version of BIOS.

- **33.05.01** Boot code corrupt (event code)
- **33.05.02** Boot code corrupt (event code)
- **33.05.03** Boot code corrupt (event code)

The newly downloaded firmware failed to cryptographically validate the BIOS code.

- **33.05.04** Security alert
- **33.05.04** Upgrade corrupt (event code)
- **33.05.05** Security alert
- **33.05.05** Boot code corrupt (event code)
- **33.05.06** Security alert
- **33.05.06** Upgrade corrupt (event code)
- **33.05.07** Security alert
- **33.05.07** Upgrade corrupt (event code)
- **33.05.08** Invalid boot attempt (event code)
- **33.05.09** Downgrade attempted (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

1. For 33.05.01, 33.05.02, and 33.05.03: No action is necessary.
2. For all other errors: Download a firmware bundle to the printer from the [Preboot](#) menu.
Go to: [HP FutureSmart - Latest Firmware Versions](#)
3. If newly downloaded firmware will not resolve the issue, order an eMMC.
eMMC part number: 5851-6436
4. After replacing the new eMMC, reload the firmware from the [Preboot](#) menu.



NOTE: For more information on SureStart, go to: [HP SureStart Whitelisting and Intrusion Detection Troubleshooting Manual](#) (Doc ID: c04863614).

33.05.1x Whitelisting errors

An error occurred with a firmware file digital signature or an error with the certificate used to validate the firmware file certificate.

- **33.05.10** Security alert
- **33.05.10** Firmware verification Error: XX (Event code)
- **33.05.11** Security alert
- **33.05.11** Firmware verification Error: XX (Event code)
- **33.05.12** Security alert
- **33.05.12** Firmware verification Error: XX (Event code)

Recommended action

Follow these troubleshooting steps in the order presented.

1. Perform a [Format Disk](#) procedure.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) *Or click here: [HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#).*
2. If the device does not reboot to [Ready](#), download a firmware bundle to the device from the Preboot menu.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)



NOTE: Performing a Format Disk procedure is required before downloading a firmware bundle.

For more information on SureStart, go to: (Doc ID: c04863614). [HP SureStart Whitelisting and Intrusion Detection Troubleshooting Manual](#)

33.05.2x Intrusion detection errors

The intrusion detection system has encountered an error.

The intrusion detection memory process determined an unauthorized change in system memory.

- **33.05.21** Security alert
- **33.05.21** Potential intrusion (Event code)

The intrusion detection memory process heartbeat was not detected.

- **33.05.22** Security alert
- **33.05.22** Cannot scan for potential intrusions (Event code)

The intrusion detection memory process did not initialize.

- **33.05.23** Security alert
- **33.05.23** Intrusion detection not initialized (Event code)
- **33.05.24** Intrusion detection initialization error (Event code)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.



NOTE: Selecting [Continue](#) from the Preboot menu will not resolve the error. The printer must be turned off, and then on to clear the error allowing the printer to reboot to a [Ready](#) state.

Information on the Intrusion Detection error.

For more information on SureStart, go to: [HP SureStart - Whitelisting and Intrusion Detection Troubleshooting Manual](#) (Doc ID: c04863614).

33.05.5z Intrusion detection errors

The intrusion detection system has encountered an error.

The intrusion detection memory process determined an unauthorized change in system memory.

- **33.05.51** Security alert
- **33.05.51** Potential intrusion (Event code)

The intrusion detection memory process heartbeat was not detected.

- **33.05.52** Security alert
- **33.05.52** Cannot scan for potential intrusions (Event code)

The intrusion detection memory process did not initialize.

- **33.05.53** Security alert
- **33.05.53** Intrusion detection not initialized (Event code)
- **33.05.54** Intrusion detection initialization error (Event code)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.



NOTE: Selecting [Continue](#) from the Preboot menu will not resolve the error. The printer must be turned off, and then on to clear the error allowing the printer to reboot to a [Ready](#) state.

Information on the Intrusion Detection error.

For more information on SureStart, go to: [HP SureStart - Whitelisting and Intrusion Detection Troubleshooting Manual](#) (Doc ID: c04863614).

33.06.01

The firmware is not able to detect the correct memory chip on the formatter.

This issue occurs because the wrong formatter was installed in the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Remove the formatter that was installed and reinstall the original or order the correct formatter for the printer.
3. Reinstall all the parts including HDD/eMMC, TPM and any additional accessories.
4. Reload firmware from a USB stick using the pre-boot menu if necessary.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

40.WX.YZ Error Messages

40.* errors

Errors in the 40.* family are related to input/output accessories, such as USB storage devices, Jetdirect cards, or EIO cards or on-board network functions.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Touch the **OK** button to clear the error.
2. Remove and then reinstall the accessory.

40 . 00 . 01 USB I/O buffer overflow To continue, touch “OK”

The USB buffer has overflowed.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to print the transferred data (some data might be lost).
2. Check the host configuration.

40 . 00 . 02 Embedded I/O buffer overflow To continue, touch “OK”

The product has experienced a JetDirect buffer overflow.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to print the transferred data (some data might be lost).
2. Check the host configuration.

40 . 00 . 03 EIO [x] buffer overflow To continue, touch “OK”

Too much data was sent to the EIO card in the specified slot (x). An incorrect communications protocol might be in use.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to print the transferred data (some data might be lost).

40 . 00 . 04 EIO [x] bad transmission To continue, touch “OK”

The connection between the product and the USB device has been broken.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to clear the error message and continue printing.
2. Remove, and then reinstall the USB device.

40 . 00 . 05 Embedded I/O bad transmission To continue, touch OK

The USB device has been removed.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to clear the error message (data will be lost).
2. Install the USB device.

40 . 08 . 0x USB storage accessory removed

The USB storage accessory has been removed.

x = 0 or 1; information code.

Secure file erase is enabled.

Recommended action

See recommended action.

- No action necessary.

40 . 0x . 05 USB storage accessory removed

The USB storage accessory was removed.

x = 1, 2, 3, 5, or 6; information code.

Recommended action

See recommended action.

- No action necessary.

40 . 80 . 04 Failed to read NVRAM

Cannot read contract-requested value from NVRAM

Either the value was not populated or NVRAM was unreadable

Recommended action

Follow these troubleshooting steps in the order presented.

- Turn printer off, and then on.

41.WX.YZ Error Messages

41.* errors

Errors in the 41.* family are related to printing problems, such as a mismatch between the paper that is in the printer and the paper the printer is configured to use.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Verify the tray is loaded with the correct paper type, and that the guides are adjusted correctly.
2. Verify the paper type and size settings on the control panel match the paper in the tray.
3. Verify the paper type and size settings in the print driver match the paper in the tray.
4. Use the Tray/Bin manual sensor test to verify the media switch in the cassette is working correctly.
5. Turn the printer off and then on.
6. If the issue persists, replace the DC controller.

41 . 01 . YZ

Event log error message: 41.01.YZ.

An unknown misprint error occurred on the printer.

Y = Type, Z = Tray

- Y = 0: Photo Paper (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light Paper 1, 2, or 3 mode
- Y = 4: Heavy Paper 1
- Y = 5: Heavy Paper 2

- Y = 6: Heavy Paper 3
- Y = 7: Glossy Paper 1
- Y = 8: Glossy Paper 2
- Y = 9: Glossy Paper 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode
- Z = 0: From unknown tray
- Z = 1: From Tray 1
- Z = 2: From Tray 2
- Z = 3: From Tray 3
- Z = 4: From Tray 4
- Z = 5: From Tray 5
- Z = 6: From Tray 6
- Z = 7: From Tray 7
- Z = 8: From Tray 8
- Z = 9: From Tray 9
- Z = D: From duplex

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. If the error is not cleared, turn the printer off, and then on.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. If the error is not cleared, turn the printer off, and then on.


3. If the error persists, replace the laser/scanner assembly.

Part number: RM2-6545-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. If the error is not cleared, turn the printer off, and then on.
3. If the error is still present, power OFF printer, reseal connectors for both Laser Scanners (J126 and J127) on the DC Controller (Fig. 4-33), power ON printer and check for error.

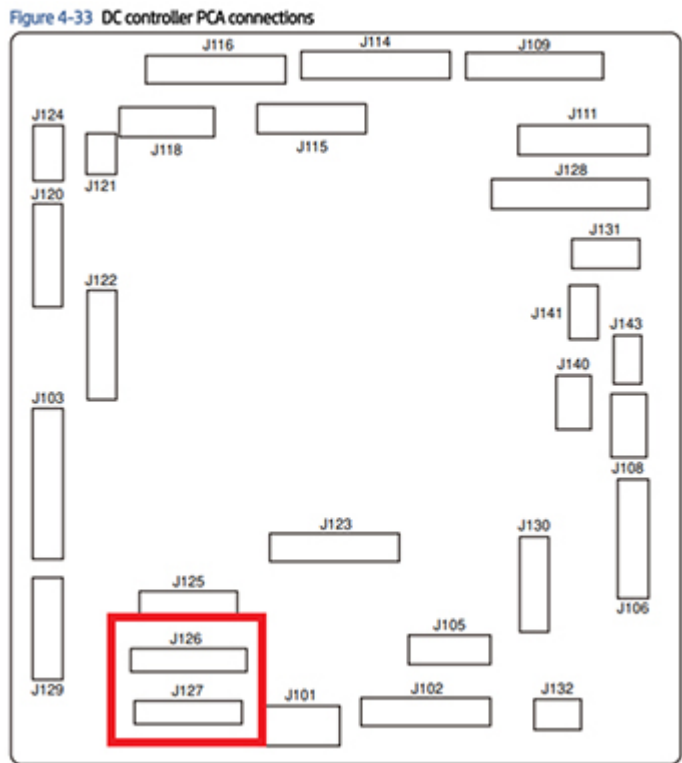

4. Turn the printer on, if the error persists, replace the laser/scanner assembly.

Part number: RM2-6545-000CN

For instructions: See the Repair Service Manual for this product.

5. If the error persists, replace the DC controller.

Table 6-52 Part number:

Description	HP Part Number
DC controller PCA assembly (M552, M553)	RM3-7450-000CN
DC controller PCA assembly (M577)	RM3-7451-000CN

For instructions: See the Repair Service Manual for this product.

6. If the error continues after replacing the DC Controller, elevate the case per your Region's escalation process.

41.02.00 Error

A beam detected misprint error occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. To clear the error message, touch **OK**.
2. If the error persists, turn the printer off, and then on.
3. If the error returns, check the wire harness from the laser/scanner to the DC controller.
4. Check the following connectors on DC controller J126 and J127.
5. If the error persists, replace the laser/scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: RM2-6545-000CN

41.03.FZ Unknown Misprint Error

This is a general misprint error. Either the paper is loaded off-center with the guides in the tray, or a paper width sensor failure occurred from an unknown tray.

The error will be one of the following:

- 41.03.F0
- 41.03.F1
- 41.03.F2
- 41.03.F3
- 41.03.F4
- 41.03.F5
- 41.03.FD

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Remove the paper and reload the tray. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
2. If the error persists, print a Configuration Page and note the paper size for the tray in question.
 - If the size is not reported correctly, run the tray size sensor test in the **Diagnostic** menu.
 - If the tray size sensors test as **GOOD**, replace the paper tray.
 - If the tray size sensors test as **BAD**, check the cable connections between the tray size sensor and the DC Controller.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Remove the paper and reload the tray. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
2. Try the print job again. Watch the paper tray feed mechanism to see if it is functioning correctly. If the linkage is broken, replace the paper tray.

Table 6-53 Part number:

Description	HP Part Number
Paper input tray 2 cassette	RM2-0007-020CN
550-sheet feeder tray cassette	RM2-5150-020CN

3. If the error persists, print a Configuration Page and note the paper size for the tray in question.
 - If the size is not reported correctly, run the tray size sensor test in the **Diagnostic** menu.
 - If the tray size sensors test as **GOOD**, replace the paper tray.
 - If the tray size sensors test as **BAD**, check the cable connections between the tray size sensor and the DC Controller.
4. If the cable connections are plugged in correctly and the cables are not damaged, replace the correct component that contains the tray size sensing switches.

41.03.yz Unexpected size in tray <X>

The printer detected a different paper size than expected.

Y = Type, Z = Tray

- Y = 0 Size mismatch. Detected paper is longer or shorter than expected.
- Y = A Size mismatch. Detected paper too long.
- Y = B Size mismatch. Detected paper too short.
- Y = C Size mismatch. Inter-page gap error.

- Y = D Size mismatch. Detected paper narrower than expected.
- Y = E Size mismatch. Detected paper wider than expected.
- Z = D Source is the duplexer.
- Z = E Source is the envelope feeder.
- Z = 1 Source is Tray 1.
- Z = 2 Source is Tray 2.
- Z = 3 Source is Tray 3.
- Z = 4 Source is Tray 4.
- Z = 5 Source is Tray 5.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Print a configuration page to verify the size and type the trays are set to.
3. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
4. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
5. If the paper is jammed, ensure it is completely removed. If paper has been ripped during removal and paper is stuck in the feed roller, spin the rollers down, which feeds the jammed paper up for easier removal.

Figure 6-74 Feed rollers



6. Verify that the toner cartridge and the transfer roller are seated correctly.

7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Print a configuration page to verify the size and type the trays are set to.
3. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
4. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
5. If the paper is jammed, ensure it is completely removed. If paper has been ripped during removal and paper is stuck in the feed roller, spin the rollers down, which feeds the jammed paper up for easier removal.

Figure 6-75 Feed rollers



6. Verify that the toner cartridge and the transfer roller are seated correctly.
7. Use the Tray/Bin manual sensor test to verify that the cassette paper switch is functioning correctly.
8. Check paper path sensors SR6 and SR9 for correct operation and that they do not stick at all. Replace any damaged sensor or assembly.
9. Check paper width sensors SR13 and SR14 for correct operation and that they do not stick at all. Replace any damaged sensor or assembly.
10. Reconnect the connectors for the paper sensor, the intermediate-transfer belt, and the DC controller PCA.



NOTE:

- SR6 Top Sensor connects to DCC on J118.
- SR9 fuser delivery sensor connects to fuser PCA on J2603 then to interconnect J50 then to DCC on J116.
- SR13 and SR14 paper width sensors connect to DCC on J118.

11. Test the registration assembly motor and clutch. If they do not function correctly, replace the registration assembly.

Table 6-54 Part number:

Description	HP Part Number
Registration assembly (M552dn, M553dn, M553x, M577)	RM2-0018-000CN
Registration assembly (M553n)	RM2-0093-000CN

12. If the error persists, replace the tray lifter assembly.

41.04.yz Printer Error

An unknown misprint error occurred on the printer.

Y = Type, Z = Tray

- Y = 0: Photo Paper (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light Paper 1, 2, or 3 mode
- Y = 4: Heavy Paper 1
- Y = 5: Heavy Paper 2
- Y = 6: Heavy Paper 3
- Y = 7: Glossy Paper 1
- Y = 8: Glossy Paper 2
- Y = 9: Glossy Paper 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode
- Z = D: Source is the duplexer.
- Z = 0: Source is the envelope feeder.

- Z = 1: Source is Tray 1.
- Z = 2: Source is Tray 2.
- Z = 3: Source is Tray 3.
- Z = 4: Source is Tray 4.
- Z = 5: Source is Tray 5.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. If the error does not clear, turn the printer off, and then on.
3. If the issue persists, swap out or re-seat each toner cartridge to test the toner cartridges.
4. Verify the toner cartridges are an original HP supply before replacing any other parts.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. If the error does not clear, turn the printer off, and then on.
3. Swap out or re-seat each toner cartridge to test the toner cartridges.
4. Verify the toner cartridges are an original HP supply before replacing any other parts.
5. If the error persists, replace the laser/scanner.

Part number: RM2-6545-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. If the issue persists, swap out or re-seat each toner cartridge to test the toner cartridges.
3. If the issue persists, verify the toner cartridges are an original HP supply before replacing any other parts.
4. If there is a non-HP supply in-use, replace with a genuine HP supply.
5. If genuine HP supplies are installed perform a Disable Cartridge Check to determine if there is a faulty cartridge.

Disable cartridge



IMPORTANT: The procedures in this section are for printers with FutureSmart 4 (FS4) or later firmware installed. For printers with FS3 firmware installed, go to the HP WISE web site and search

for HP Color LaserJet Enterprise M552, M553 - Control-panel menus (c04574398) or HP Color LaserJet Enterprise MFP M577 - Control panel menus (c04796059) for more information.

Use this diagnostic test to print internal pages or send an external job to the printer when the toner cartridge is removed or exchanged. Supply errors are ignored while the printer is in this mode.

When the printer is in this mode, access the troubleshooting menus and print internal pages (the print quality pages will be the most useful). This test can be used to isolate problems, such as noise, and to isolate print-quality problems that are related to the toner cartridge.



NOTE: Do not remove or exchange the toner cartridge until after beginning the disable cartridge check diagnostic.


Use these steps to perform the Disable cartridge check from a non-touchscreen control panel.

- From the Home screen on the printer control panel, use the arrow keys to navigate to **Support Tools**, and then press the **OK** button.
- Use the arrow buttons to scroll to **Troubleshooting**, and then press the **OK** button.
- Use the arrow buttons to scroll to **Diagnostic Tests**, and then press the **OK** button.
- Select **Continue** to enter **Maintenance Mode**.
- Use the arrow buttons to scroll to **Disable Cartridge Check**, and then press the **OK** button.

Disable cartridge check from a touchscreen control panel

- From the Home screen on the printer control panel, scroll to and touch the **Support Tools** button.
 - Open the following menus: **Troubleshooting > Diagnostic Tests > Disable Cartridge Check**.
6. Once the printer is in "Disable Cartridge Check" mode, remove all of the Toner Cartridges.
 7. Introduce one cartridge at a time, until the error occurs
 8. If the error occurs on a specific cartridge, install that Toner Cartridge in a different slot, or install a different Toner Cartridge in the suspect slot.
 9. If the error follows the Toner Cartridge, replace that specific cartridge.
 10. If the error follows a specific Toner Cartridge slot, then skip to step x.
 11. If Toner Cartridges and slots have been ruled out, continue with Step 10.

12. If the error is still present, power OFF printer, reseal connectors for both Laser Scanners (J126 and J127) and the HVPS (J109, J125, and J131) on the DC Controller (Fig. 4-33), power ON printer and check for error.

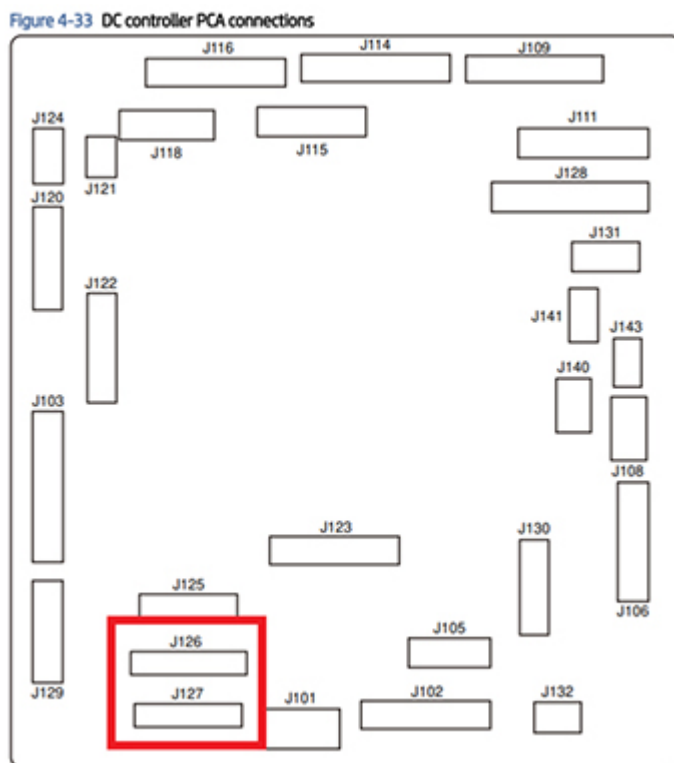

13. Turn the printer on, if the error persists, replace the laser/scanner assembly.

Part number: RM2-6545-000CN

For instructions: See the Repair Service Manual for this product.

14. If the error persists, replace the DC controller.

Table 6-55 Part number:

Description	HP Part Number
DC controller PCA assembly (M552, M553)	RM3-7450-000CN
DC controller PCA assembly (M577)	RM3-7451-000CN

For instructions: See the Repair Service Manual for this product.

15. If the error continues after replacing the DC Controller, elevate the case per your Region's escalation process.

41 . 05 . yz Unexpected type in tray <X>

The printer can detect the type of paper in the paper path, and it adjusts the print mode accordingly.

The printer uses two types of paper sensors:

- **Reflection:** Detects the glossiness of the paper.

- **Transmission:** Detects the thickness of the paper.

Tray X is loaded with a paper type (transparencies, envelopes, etc.) that is different than what the tray is configured to use.

Y = Expected type, Z = Detected type

- Y = 0: Photo Paper (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light Paper 1, 2, or 3 mode
- Y = 4: Heavy Paper 1
- Y = 5: Heavy Paper 2
- Y = 6: Heavy Paper 3
- Y = 7: Glossy Paper 1
- Y = 8: Glossy Paper 2
- Y = 9: Glossy Paper 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode
- Z = 0: Photo Paper (1, 2, or 3)
- Z = 1: Auto Sense (Normal)
- Z = 2: Normal (typed not from Auto Sense)
- Z = 3: Light Paper 1, 2, or 3 mode
- Z = 4: Heavy Paper 1
- Z = 5: Heavy Paper 2
- Z = 6: Heavy Paper 3
- Z = 7: Glossy Paper 1
- Z = 8: Glossy Paper 2
- Z = 9: Glossy Paper 3
- Z = A: Glossy film

- Z = B: OHT
- Z = C: Label
- Z = D: Envelope 1, 2, or 3 mode
- Z = E: Rough
- Z = F: Other mode

Recommended action

Follow these troubleshooting steps in the order presented.

1. Load the tray with the size and type of paper indicated, or use another tray if available.
2. If this message displays and the tray is loaded with the correct paper type, check the print driver settings to ensure they match the tray type settings on the printer.
3. Check all application and printer settings to ensure that the **Type** setting is correctly.

41 . 07 . 12 Press Exit to Continue

Tray 2 input source delay causes a paper transportation error.

The printer experiences pickup issues in tray 2 due to the broken gear teeth on the pick gear.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. Ensure tray 2 is loaded with the correct paper size and the sliding paper guides are adjusted correctly.
3. Verify the tray 2 pick-up, feed, and separation rollers are not dirty, worn, or damaged and installed correctly.

Clean or replace the rollers as needed.

- Use compressed air or a clean, lint-free cloth moistened with warm water to clean the rollers.
- To replace the rollers, use the table below to order the correct part number.

Table 6-56 Part number for Tray 2 roller assembly

Description	Part number
Tray 2 roller assembly	RM2-6577-000CN
(Includes tray 2 paper pickup and separation roller assemblies)	

For instructions, go to *Removal and replacement: Tray 2-X paper pickup roller and separation roller assemblies*.

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. Ensure tray 2 is loaded with the correct paper size and that the sliding paper guides are adjusted correctly.
3. Verify tray 2 pick-up, feed, and separation rollers are not dirty.

Use compressed air or a clean, lint-free cloth moistened with warm water to clean the rollers.


4. Ensure the tray 2 pick-up, feed, and separation rollers are not worn, or damaged.
5. Check if the tray 2 separation pad is installed correctly or if the springs are missing.
 - a. Pull tray 2 out. Lift the front of the tray, and then pull it out of the printer to remove it.
 - b. Locate the separation pad.
 - c. Push down on the separation pad, and then release it to check if the springs are missing.

If the separation pad does not spring back up, the springs might be missing.



NOTE: The separation pad assembly is mounted to a spring and should move up and down freely when installed correctly

Figure 6-76 Location of springs in the separation pad assembly for Tray 2

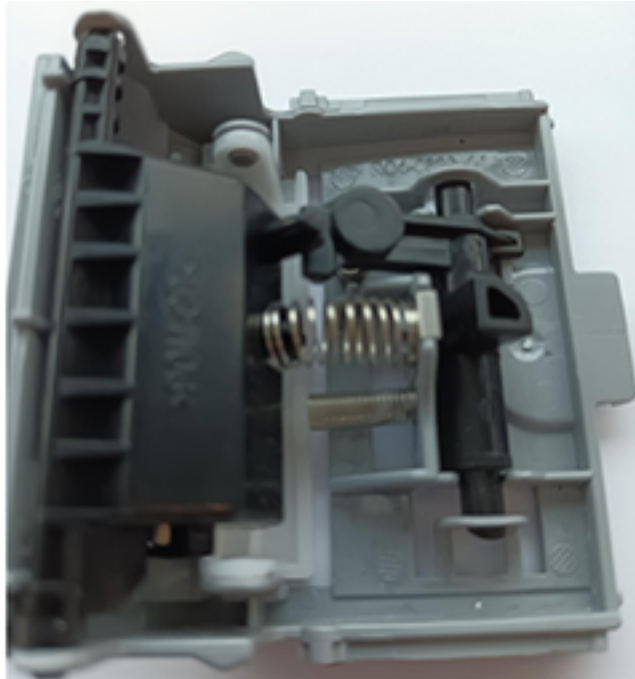

- d. Replace the tray 2 roller assembly.

Table 6-57 Part number for Tray 2 roller assembly


Description	Part number
Tray 2 roller assembly (Includes tray 2 paper pickup and separation roller assemblies)	RM2-6577-000CN

For instructions: See the Repair Service Manual for this product..

- 6. Verify the tray 2 pick-up, feed, and separation rollers are installed correctly.
- 7. Check the transport area for any damage or debris.
- 8. Turn off the printer and disconnect the power cable.
- 9. Remove tray 2.

10. Check if the gear teeth is damaged or broken on the pick gear in the Tray 2 pick-up assembly.

Figure 6-77 Broken gear teeth on pick up gear

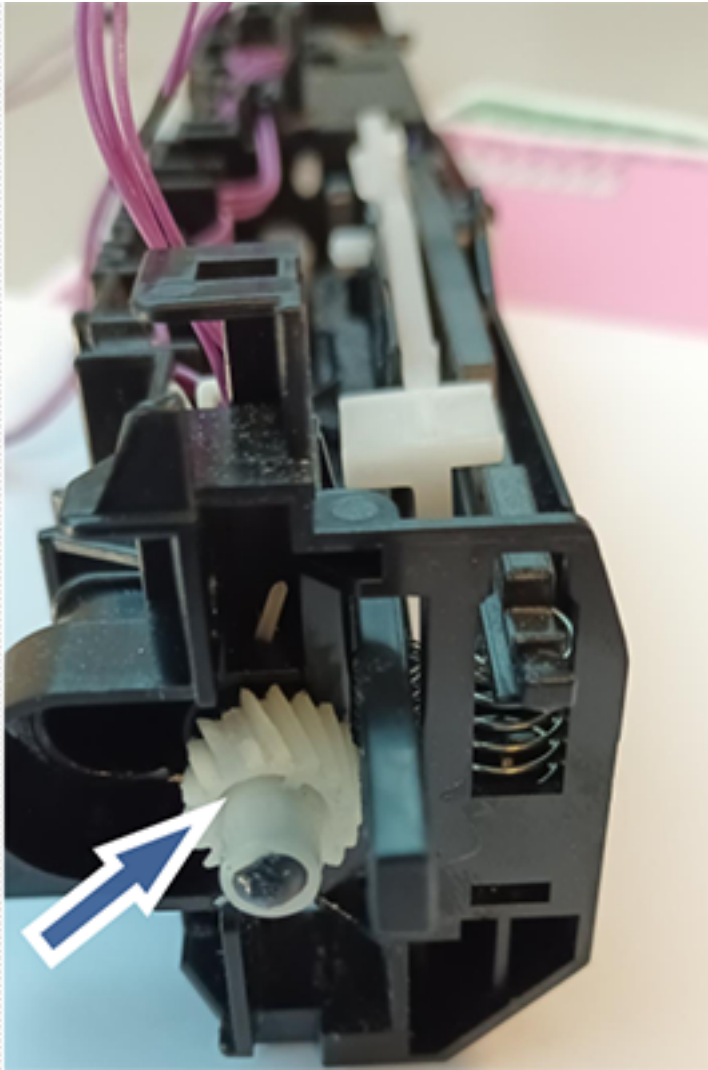

11. Order the correct part number for the service technician to replace the part.

Table 6-58 Part number for Tray 2 pick-up assembly

Description	Part number
Paper pick-up assembly	RM2-6556-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.


1. Use the power button to turn off the printer, and then to turn on the printer.
2. Ensure tray 2 is loaded with the correct paper size and the sliding paper guides are adjusted correctly.

3. Verify tray 2 pick-up, feed, and separation rollers are not dirty.
- Use compressed air or a clean, lint-free cloth moistened with warm water to clean the rollers.
4. Ensure the tray 2 pick-up, feed, and separation rollers are not worn, or damaged.
5. Check if the tray 2 separation pad is installed correctly or if the springs are missing.
- a. Pull tray 2 out. Lift the front of the tray, and then pull it out of the printer to remove it.
 - b. Locate the separation pad.
 - c. Push down on the separation pad, and then release it to check if the springs are missing.
- If the separation pad does not spring back up, the springs might be missing.



NOTE: The separation pad assembly is mounted to a spring that should move when pushed down. When installed correctly, the separation pad should move up and down on the spring.

Figure 6-78 Location of springs in the separation pad assembly for Tray 2

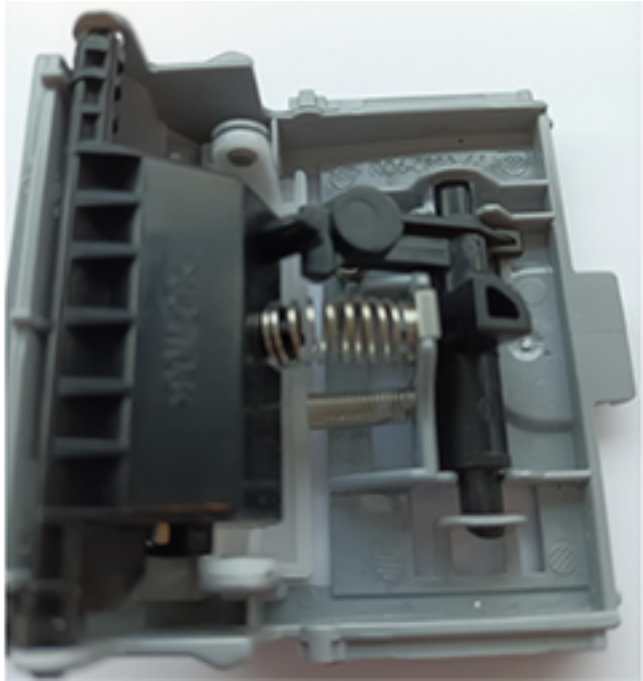

- d. Replace the tray 2 roller assembly.

Table 6-59 Part number for Tray 2 roller assembly


Description	Part number
Tray 2 roller assembly	RM2-6577-000CN
(Includes tray 2 paper pickup and separation roller assemblies)	

For instructions: See the Repair Service Manual for this product..

6. Verify the tray 2 pick-up, feed, and separation rollers are installed correctly.

7. Check the transport area for any damage or debris.
8. Turn off the printer and disconnect the power cable.
9. Check if the gear teeth is broken on the pick gear in the Tray 2 pick-up assembly.

Figure 6-79 Broken gear teeth on pick up gear

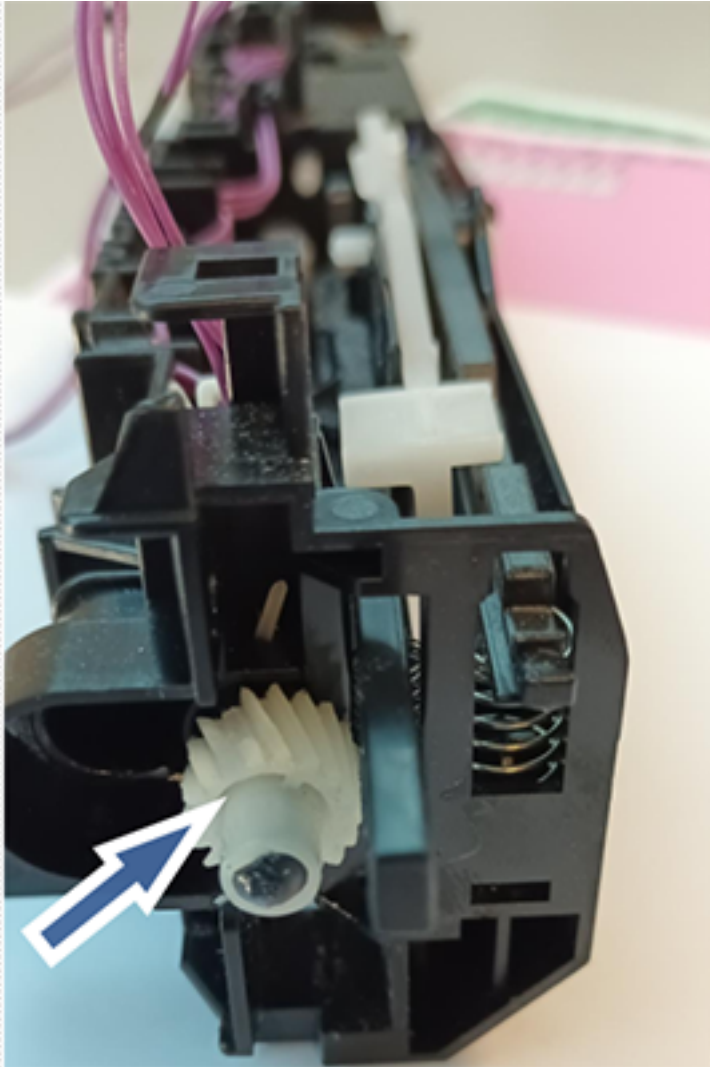

10. If the gear teeth is damaged on the pick gear, remove and replace the Tray 2 pick-up assembly to resolve the issue.

Table 6-60 Part number for Tray 2 pick up assembly

Description	Part number
Paper pick-up assembly	RM2-6556-000CN

For instructions: See the Repair Service Manual for this product.

41 . wx . yz Error To continue, touch "OK"

A printer error has occurred.

WX = error type

Y = fuser mode

Z = input tray

- WX = 02: Beam detect misprint
- WX = 09: Sub thermistor abnormally high
- WX = 10: Pickup failure.
- WX = 11: Illegal Duplex.
- WX = 18: Scan line inclination adjustment
- WX = 20: Image drum HV
- Y = 0: Photo Paper (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light Paper 1, 2, or 3 mode
- Y = 4: Heavy Paper 1
- Y = 5: Heavy Paper 2
- Y = 6: Heavy Paper 3
- Y = 7: Glossy Paper 1
- Y = 8: Glossy Paper 2
- Y = 9: Glossy Paper 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode
- Z = 0 Envelope feeder
- Z = 1 Tray 1
- Z = 2 Tray 2
- Z = 3 Tray 3
- Z = 4 Tray 4
- Z = 5 Tray 5

- Z = 6 Tray 6
- Z = D Duplexer

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. To clear the message, touch the **OK** button.
2. If the message displays again, turn the printer off, and then on.
3. If the error persists, swap out or re-seat each toner cartridge to test the toner cartridges.
4. Check the toner cartridges before replacing any other parts.
Verify it is an original HP supply. If not, replace cartridge with a Genuine HP supply to test.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. To clear the message, touch the **OK** button.
2. If the message displays again, turn the printer off, and then on.
3. If the error persists, swap out or re-seat each toner cartridge to test the toner cartridges.
4. Check the toner cartridges before replacing any other parts.
Verify it is an original HP supply. If not, replace cartridge with a Genuine HP supply to test.
5. If the error persists, replace the laser/scanner assembly.
Laser Scanner Part number: RM2-6545-010CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. To clear the message, touch the **OK** button.
2. If the message displays again, turn the printer off, and then on.
3. If the error persists, swap out or re-seat each toner cartridge to test the toner cartridges.
4. Check the toner cartridges before replacing any other parts.
Verify it is an original HP supply. If not, replace cartridge with a Genuine HP supply to test.
5. If genuine HP supplies are installed perform a Disable Cartridge Check to determine if there is a faulty cartridge.

Disable cartridge



IMPORTANT: The procedures in this section are for printers with FutureSmart 4 (FS4) or later firmware installed. For printers with FS3 firmware installed, go to the HP WISE web site and search

for HP Color LaserJet Enterprise M552, M553 - Control-panel menus (c04574398) or HP Color LaserJet Enterprise MFP M577 - Control panel menus (c04796059) for more information.

Use this diagnostic test to print internal pages or send an external job to the printer when the toner cartridge is removed or exchanged. Supply errors are ignored while the printer is in this mode.

When the printer is in this mode, access the troubleshooting menus and print internal pages (the print quality pages will be the most useful). This test can be used to isolate problems, such as noise, and to isolate print-quality problems that are related to the toner cartridge.



NOTE: Do not remove or exchange the toner cartridge until after beginning the disable cartridge check diagnostic.


Use these steps to perform the Disable cartridge check from a non-touchscreen control panel.

- From the Home screen on the printer control panel, use the arrow keys to navigate to **Support Tools**, and then press the **OK** button.
- Use the arrow buttons to scroll to **Troubleshooting**, and then press the **OK** button.
- Use the arrow buttons to scroll to **Diagnostic Tests**, and then press the **OK** button.
- Select **Continue** to enter **Maintenance Mode**.
- Use the arrow buttons to scroll to **Disable Cartridge Check**, and then press the **OK** button.

Disable cartridge check from a touchscreen control panel

- From the Home screen on the printer control panel, scroll to and touch the **Support Tools** button.
 - Open the following menus: **Troubleshooting > Diagnostic Tests > Disable Cartridge Check**.
6. Once the printer is in "Disable Cartridge Check" mode, remove all of the Toner Cartridges.
 7. Introduce one cartridge at a time, until the error occurs
 8. If the error occurs on a specific cartridge, install that Toner Cartridge in a different slot, or install a different Toner Cartridge in the suspect slot.
 9. If the error follows the Toner Cartridge, replace that specific cartridge.
 10. If the error follows a specific Toner Cartridge slot, then skip to step x.
 11. If Toner Cartridges and slots have been ruled out, continue with Step 10.

12. If the error is still present, power OFF printer, reseal connectors for both Laser Scanners (J126 and J127) and the HVPS (J109, J125, and J131) on the DC Controller (Fig. 4-33), power ON printer and check for error.

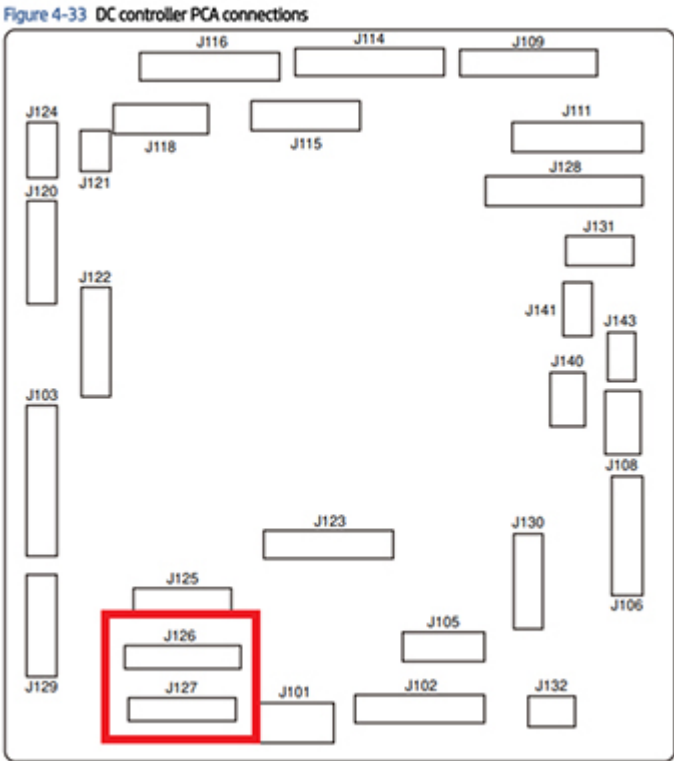

13. Turn the printer on, if the error persists, replace the laser/scanner assembly.
Part number: RM2-6545-000CN
For instructions: See the Repair Service Manual for this product.
14. If the error persists, replace the DC controller.

Table 6-61 Part number:

Description	HP Part Number
DC controller PCA assembly (M552, M553)	RM3-7450-000CN
DC controller PCA assembly (M577)	RM3-7451-000CN

For instructions: See the Repair Service Manual for this product.

15. If the error continues after replacing the DC Controller, elevate the case per your Region's escalation process.

42.WX.YZ Error Messages

42.* errors

Errors in the 42.* family indicate an internal system failure has occurred.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on. Retry the job.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on. Retry the job.
2. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

44.WX.YZ Error Messages

44.* errors

Errors in the 44.* family are related to the digital send functionality: fax, email, send to SharePoint, or save to folder.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. In many cases, the error will automatically clear, and you can try the job again.
2. Verify the digital send feature has been correctly configured at the control panel and with the HP Embedded Web Server (EWS).



NOTE: To access the EWS, open a Web browser, and in the address line, enter the printer IP address.

3. Turn the printer off, and then on. Retry the job.
4. For fax errors, verify the fax card is correctly installed on the formatter.
5. For SharePoint or save-to-folder errors, verify the permissions are set correctly for access to the SharePoint or network folder.
6. For email errors, verify connectivity to the network, and verify the SMTP gateway is configured correctly. Also verify if there is a size limit on email attachments.

7. If the error persists, reset the printer to factory settings, and then upgrade the firmware to the latest version.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

44 . 01 . xx Error Event log message

A digital send error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. No action necessary. This error message should automatically clear.
2. Try to send the job again.
3. If the error does not clear or it returns:
 - a. Use optimal resolution and image quality settings.
 - b. Wait until all the digital send jobs have been processed.
 - c. Turn the printer off, and then on. Retry the job.
 - d. Verify if there is an attachment limit on the email.
 - e. Verify network connectivity, SMTP gateways, access to folder share.

44 . 03 . xx Error Event log message

A digital send error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

- Try to send the job again.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Use optimal resolution and image quality settings.
2. Wait until all the digital send jobs have been processed.
3. Turn the printer off, and then on and retry the job.
4. Verify if there is an attachment limit on the email.
5. Verify network connectivity, SMTP gateways, access to folder share.

44 . 10 . xx Error Event log message (*Multifunction product only*)

A send to email error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the digital send configuration.

For more information, Go to: [Or click here: HP LaserJet Enterprise MFP - Set up Scan to Email.](#)

44 . 34 . xx Error Event log message

A fax error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the fax settings to make sure they are set to the proper settings for the environment.
3. If the issue persists, for additional fax troubleshooting information go to [HP LaserJet Enterprise MFP, HP PageWide Enterprise MFP - Checklist for solving fax problems.](#)

44 . 34 . 03 Fax Modem Failure

Digital Send error. Fax result modem fail.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Verify the fax card is correctly installed on the formatter. Ensure that the fax card is aligned with slot on the formatter chassis and is firmly seated against the formatter board.
3. Turn the printer on.
4. If the issue persists, replace the fax kit.

Part number: B5L53-67901

44 . 34 . E5 Fax Modem Failure

A fax error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Verify the fax card is correctly installed on the formatter. Ensure that the fax card is aligned with slot on the formatter chassis and is firmly seated against the formatter board.
3. If the issue persists, download and reinstall the firmware.
4. If the issue persists, perform a Partial Clean:
 - a. Turn the printer off, and then on.
 - b. The HP logo displays on the printer control panel. When a "1/8" with an underscore displays below the HP logo, touch the logo to open the [Pre-boot](#) menu.
 - c. Use the arrow buttons on the touchscreen to navigate the pre-boot menu.
 - d. Use the down arrow to highlight [Partial Clean](#), and then touch the [OK](#) button.
 - e. Touch the [OK](#) button again.
 - f. Touch the Back button to highlight [Continue](#), and then touch the [OK](#) button.

The printer will continue to boot to **Ready**.

5. If the issue persists, replace the fax kit.

Part number: B5L53-67901

44 . 90 . xx, 44 . 91 . xx, 44 . 92 . xx Error Event log message

A fax error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the fax settings to make sure they are set to the proper settings for the environment.
3. If the issue persists, for additional fax troubleshooting information go to [HP LaserJet Enterprise MFP, HP PageWide Enterprise MFP - Checklist for solving fax problems](#).

44 . A0 . yz Error Event log message

MFP specific error dealing with the digital send abilities for security (Login/LDAP/SSL)

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on. Try to login or send the job again.

2. Ensure all digital sending devices are operational and configured correctly. One or more control panel icons for digital send features may be "grayed out" and marked with an exclamation point "!"
3. The user should contact the systems administrator. The system administrator needs to check the Domain Controller certificate and ensure a valid SSL exists in the location on the LDAP server pointed to by the SSL extension in the certificate.

46.WX.YZ Error Messages

46.* error messages

Errors in the 46.* family occur when the printer is trying to perform an action that it is not able to complete.

- No network connectivity
- A problem with the file being printed, with the software application sending the job, or with the print driver

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Verify the printer is connected to the network, look at the network port connection on the back of the printer, and verify that the amber activity light flashes indicating network traffic, and the green link-status light is continuously lit indicating a network link. If the problem continues, try a different network cable or port on the hub and check network configuration settings such as the printer's IP address.
3. Send a different file from the same software application to see if the error is specific to the original file. Try sending a job from a different software application to see if the error is specific to the application. Verify the computer has the correct print driver installed.
4. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Verify the printer is connected to the network. If it is not, use a different network cable, and check the configuration settings.

3. Send a different file from the same software application to see if the error is specific to the original file. Try sending a job from a different software application to see if the error is specific to the application. Verify the computer has the correct print driver installed.
4. Upgrade the printer firmware.
5. If the error persists, go to WISE and search for the following document that contains links to flowcharts that you can use to troubleshoot the issue:

HP FutureSmart - 49 Error Troubleshooting (Persistent and Intermittent) (Document ID: c03122817)

Or, click the following link: [HP FutureSmart - 49 Error Troubleshooting \(Persistent and Intermittent\)](#)

47.WX.YZ Error Messages

47.* errors

Errors in the 47.* family indicate an internal error has occurred.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.00.xx

Back channel internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.

2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.01.xx

Image transformer internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.02.xx

Job parser internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.03.xx

Print job internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.04.xx

Print spooler 9100 internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the **Format Disk** item in the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.05.xx

Print spooler framework internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.06.xx

Print application internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.FC.yz Printer Calibration Failed To continue, touch "OK"

The device is unable to access or implement one of the image patterns files.

y = Calibration type, z = Event

- 47.FC.00 (event code) Color plane registration (CPR) Image not found at system initialization
- 47.FC.01 (event code) CPR Store Image failure
- 47.FC.02 (event code) CPR Image not found
- 47.FC.03 (event code) CPR Print engine execution failure
- 47.FC.10 (event code) Consecutive Dmax Dhalf Image not found at system initialization
- 47.FC.11 (event code) Consecutive Dmax Dhalf Store image failure
- 47.FC.12 (event code) Consecutive Dmax Dhalf Image not found
- 47.FC.13 (event code) Consecutive Dmax Dhalf Print engine execution failure
- 47.FC.20 (event code) Error Diffusion Image not found at system initialization
- 47.FC.21 (event code) Error Diffusion Store image failure
- 47.FC.22 (event code) Error Diffusion Image not found
- 47.FC.23 Error Diffusion Print engine execution failure
- 47.FC.30 0 (event code) Drum Speed Adjustment Image not found at system initialization
- 47.FC.31 (event code) Drum Speed Adjustment Store image failure

- 47.FC.32 (event code) Drum Speed Adjustment Image not found
- 47.FC.33 (event code) Drum Speed Adjustment Print engine execution failure
- 47.FC.40 (event code) Pulse Width Modulation Image not found at system initialization
- 47.FC.41 (event code) Pulse Width Modulation Store image failure
- 47.FC.42 (event code) Pulse Width Modulation Image not found
- 47.FC.43 (event code) Pulse Width Modulation Print engine execution failure

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the product off, and then on again.
2. If the error persists, reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the product off, and then on again.
2. If the error persists over multiple power cycles, then do the following.
 - In the [Support Tools](#) > [Troubleshooting](#) > [Diagnostics](#) menu, run the hard disk tests to validate the health of the device. Fix any issue found with the mass storage device.
3. If the error persists, reload the firmware.
4. If the error persists, perform a **Format Disk** procedure using the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

48.WX.YZ Error Messages

48.* errors

Errors in the 48.* family indicate an internal error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. In most cases, no action is necessary.
2. If the error persists, upgrade the printer firmware.
3. If the error persists, continue troubleshooting with the flowcharts for either Intermittent or Persistent 48 error troubleshooting (whichever is appropriate) in document c03122817. Search for the following document on **WISE**: HP LaserJet FutureSmart Devices - 49 Error Troubleshooting (Persistent and Intermittent).

Or click the following link: [HP LaserJet FutureSmart Devices - 49 Error Troubleshooting \(Persistent and Intermittent\)](#)



NOTE: 48.wx.yz errors are similar to 49.wx.yz errors and use the same troubleshooting steps and procedures.

49.WX.YZ Error Messages

49 . xx . yy Error To continue turn off then on

A firmware error occurred.

Possible causes:

- Corrupted print jobs
- Software application issues
- Non-product specific print drivers
- Poor quality USB or network cables
- Bad network connections or incorrect configurations
- Invalid firmware operations
- Unsupported accessories

A 49 error might happen at any time for multiple reasons. Although some types of 49 errors can be caused by hardware failures, it is more common for 49 errors to be caused by printing a specific document or performing some task on the printer.

49 errors most often occur when a printer is asked to perform an action that the printer firmware is not capable of and might not have been designed to comply with, such as:

- Printing files with unsupported programming commands
- A unique combination of user environment and user interactions with the printer
- Interfacing with a third-party solution that was not designed to work with the printer
- Specific timing, network traffic, or concurrent processing of jobs

Recommended action for customers

Follow these troubleshooting steps in the order presented.



NOTE: LaserJet formatter PCAs are rarely the root cause of 49 service errors. Please do not replace the formatter unless troubleshooting has identified the formatter as the root cause.

1. Turn the printer off, and then on.
2. If the error persists, check the following:
 - The error might be caused by a network connectivity problem, such as a bad USB or network interface cable, a bad USB port, or an invalid network configuration setting.
 - The error might be caused by the print job, due to an invalid print driver, a problem with the software application, or a problem with the file being printed.
 - Upgrading the printer firmware might help resolve the error.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: LaserJet formatter PCAs are rarely the root cause of 49 service errors. Please do not replace the formatter unless troubleshooting has identified the formatter as the root cause.

1. Turn the printer off, and then on.
2. If the error persists, check the following:
 - The error might be caused by a network connectivity problem, such as a bad interface cable, a bad USB port, or an invalid network configuration setting.
 - The error might be caused by the print job, due to an invalid print driver, a problem with the software application, or a problem with the file being printed.
 - Upgrading the printer firmware might help resolve the error.
3. If the error persists, continue troubleshooting with the flowcharts for either Intermittent or Persistent 49 error troubleshooting (whichever is appropriate) in document c03122817. Search for the following document on **WISE**: HP LaserJet FutureSmart Devices - 49 Error Troubleshooting (Persistent and Intermittent).



NOTE: 48 errors are similar to 49 errors.

Or click the following link: [HP LaserJet FutureSmart Devices - 49 Error Troubleshooting \(Persistent and Intermittent\)](#)

49.38.07

Generic error.

This issue is caused by a formatter replacement that has not had the correct parameters set at the factory. This issue is tied to the factory installed Trusted Platform Module (TPM).



NOTE: For additional information, go to WISE and search for this document: HP LaserJet Enterprise, HP LaserJet Managed - 49.38.07 error after replacing the formatter (Emerging Issue) (c06621339).

Or click on the following link: [HP LaserJet Enterprise, HP LaserJet Managed - 49.38.07 error after replacing the formatter \(Emerging Issue\)](#)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Ask the technician where the formatter came from and note the answer in the case notes.
2. Turn the printer off, and then on.
3. Confirm that the unit still boots to the same 49.38.07 error.
4. Elevate the case to ATS



NOTE: Never replace the TPM on a unit that shipped with one. The TPM that can be ordered is only available for adding a level of security on a device that never had a TPM paired from the factory. A new TPM cannot be installed for security reasons.

50.WX.YZ Error Messages

50.* errors

Errors in the 50.* family indicate a problem with the fuser.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and remove the fuser. Check the fuser for damage or obstructions. Reinstall or replace the fuser as needed.

 **CAUTION:** The fuser might be hot.

2. Check the connectors between the fuser and the DC controller and from the fuser to the printer.
3. Replace the fuser. If it has already been replaced, replace the fuser power supply.

50.1X.YZ

Low fuser temperature failure

X = Fuser Modes

0 = Photo Paper 1, 2, 3

1 = Normal–Auto Sense

2 = Normal

3 = Light 1

4 = Heavy 1

5 = Heavy 2

6 = Heavy 3

7 = Glossy 1

8 = Glossy 2

9 = Glossy 3

A = Glossy Film

B = Transparency

C = Label

D = Envelope 1

E = Rough

Y = Current printer sleep state

Z = Next sleep state

0 = Printing

1 = Standby level 1 (no temperature control)

2 = Standby level 2 (high temperature control)

3 = Standby level 3 (middle temperature control)

4 = Standby level 2 (low temperature control)

5 = Middle sleep

6 = Deep sleep

F = Power off

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterruptible power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Remove and reinstall the fuser. ensure that the fuser is seated correctly.
2. Ensure that there is no residual paper in the fuser.
3. Check the connector (J50) between the fuser and the printer. If it is damaged on the fuser, replace the fuser. If it is damaged in the printer, elevate the case using the Standard Support Process.
4. Reconnect the connector (J2603) on the fuser control PCA and connector (J116) on the DC controller PCA

5. If the error persists, replace the fuser.

Table 6-62 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.



NOTE: After replacing the fuser kit, reset the fuser page counter by selecting the [New Fuser Kit](#) in the [Reset Supplies](#) menu.

6. If the error still remains, replace the fuser power supply assembly.

Part number: RM2-7125-000CN

50.2X.YZ

Fuser warm-up error

X = Fuser Modes

0 = Photo Paper 1, 2, 3

1 = Normal–Auto Sense

2 = Normal

3 = Light 1

4 = Heavy 1

5 = Heavy 2

6 = Heavy 3

7 = Glossy 1

8 = Glossy 2

9 = Glossy 3

A = Glossy Film

B = Transparency

C = Label

D = Envelope 1

E = Rough

Y = Current printer sleep state

Z = Next sleep state

- 0 = Printing
- 1 = Standby level 1 (no temperature control)
- 2 = Standby level 2 (high temperature control)
- 3 = Standby level 3 (middle temperature control)
- 4 = Standby level 2 (low temperature control)
- 5 = Middle sleep
- 6 = Deep sleep
- F = Power off

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.
2. Ensure that there is no residual paper in the fuser.
3. Check the printer power source. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
4. Check connector (J50) between the fuser and the printer. If it is damaged on the fuser, replace the fuser. If it is damaged in the printer, elevate the case using the Standard Support Process.
5. Reconnect the connector (J128) on the DC controller PCA, connector (J600) on the low-voltage power supply assembly and connectors (J6002 and J6003) on the fuser power supply assembly

6. If the error persists, replace the fuser.

Table 6-63 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.



NOTE: After replacing the fuser kit, reset the fuser page counter by selecting the [New Fuser Kit](#) in the [Reset Supplies](#) menu.

7. If the error still remains, replace the fuser power supply assembly.

Part number: RM2-7125-000CN

8. Replace the low-voltage power assembly.

For instructions: See the Repair Service Manual for this product.

Part number:

Table 6-64 LVPS part numbers

Description	HP Part Number
RM3-7157-000CN	Low-voltage power supply (LVPS) 110V
RM3-7158-000CN	Low-voltage power supply (LVPS) 220V

50.3X.YZ

High fuser temperature

X = Fuser Modes

0 = Photo Paper 1, 2, 3

1 = Normal–Auto Sense

2 = Normal

3 = Light 1

4 = Heavy 1

5 = Heavy 2

6 = Heavy 3

7 = Glossy 1

8 = Glossy 2

9 = Glossy 3

A = Glossy Film

B = Transparency

C = Label

D = Envelope 1

E = Rough

Y = Current printer sleep state

Z = Next sleep state

0 = Printing

1 = Standby level 1 (no temperature control)

2 = Standby level 2 (high temperature control)

3 = Standby level 3 (middle temperature control)

4 = Standby level 2 (low temperature control)

5 = Middle sleep

6 = Deep sleep

F = Power off

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.
2. Ensure that there is no residual paper in the fuser.

3. Check the paper type setting in the printer control panel menus and in the print driver. Ensure that the settings match and are correct for the type of paper being used.
4. Check the connector (J50) between the fuser and printer. If it is damaged on the fuser, replace the fuser. If it is damaged in the printer, elevate the case using the Standard Support Process.
5. If the error persists, replace the fuser.

Table 6-65 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.

 **NOTE:** After replacing the fuser kit, reset the fuser page counter by selecting the [New Fuser Kit](#) in the [Reset Supplies](#) menu.

6. If the error still remains, replace the fuser power supply assembly.

Part number: RM2-7125-000CN

50.4X.YZ

Drive circuit fault

X = Fuser Modes

0 = Photo Paper 1, 2, 3

1 = Normal–Auto Sense

2 = Normal

3 = Light 1

4 = Heavy 1

5 = Heavy 2

6 = Heavy 3

7 = Glossy 1

8 = Glossy 2

9 = Glossy 3

A = Glossy Film

B = Transparency

C = Label

D = Envelope 1

E = Rough

Y = Current printer sleep state

Z = Next sleep state

0 = Printing

1 = Standby level 1 (no temperature control)

2 = Standby level 2 (high temperature control)

3 = Standby level 3 (middle temperature control)

4 = Standby level 2 (low temperature control)

5 = Middle sleep

6 = Deep sleep

F = Power off

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.
2. Check the printer power source. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.



NOTE: If the printer does not meet the power requirement of 43 to 67Hz frequency, the fuser temperature control does not work correctly and this will cause the error.

3. Reconnect the connector (J128) on the DC controller PCA.
4. Replace the fuser power supply assembly.

Part number: RM2-7125-000CN

50 . 6X . YZ

Open fuser circuit (heating element failure)

X = Fuser Modes

0 = Photo Paper 1, 2, 3

1 = Normal–Auto Sense

2 = Normal

3 = Light 1

4 = Heavy 1

5 = Heavy 2

6 = Heavy 3

7 = Glossy 1

8 = Glossy 2

9 = Glossy 3

A = Glossy Film

B = Transparency

C = Label

D = Envelope 1

E = Rough

Y = Current printer sleep state

Z = Next sleep state

0 = Printing

1 = Standby level 1 (no temperature control)

2 = Standby level 2 (high temperature control)

3 = Standby level 3 (middle temperature control)

4 = Standby level 2 (low temperature control)

5 = Middle sleep

6 = Deep sleep

F = Power off

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

2. Check connector (J50) between the fuser and the printer. If it is damaged on the fuser, replace the fuser. If it is damaged in the printer, elevate the case using the Standard Support Process.
3. If the error persists, replace the fuser.

Table 6-66 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.



NOTE: After replacing the fuser kit, reset the fuser page counter by selecting the [New Fuser Kit](#) in the [Reset Supplies](#) menu.

4. If the error still remains, replace the fuser power supply assembly.

Part number: RM2-7125-000CN

50.7X.YZ

Fuser pressure-release mechanism failure

X = Fuser Modes

0 = Photo Paper 1, 2, 3

1 = Normal–Auto Sense

2 = Normal

3 = Light 1

4 = Heavy 1

5 = Heavy 2

6 = Heavy 3

7 = Glossy 1

8 = Glossy 2

9 = Glossy 3

A = Glossy Film

B = Transparency

C = Label

D = Envelope 1

E = Rough

Y = Current printer sleep state

Z = Next sleep state

0 = Printing

1 = Standby level 1 (no temperature control)

2 = Standby level 2 (high temperature control)

3 = Standby level 3 (middle temperature control)

4 = Standby level 2 (low temperature control)

5 = Middle sleep

6 = Deep sleep

F = Power off

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.
2. Check the gear for releasing the pressure of the fuser. If the gear is damaged, replace the fuser.

Table 6-67 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.



NOTE: After replacing the fuser kit, reset the fuser page counter by selecting the [New Fuser Kit](#) in the [Reset Supplies](#) menu.

3. Check the gear for releasing pressure of the fuser in the printer. If it is damaged on the fuser, replace the fuser. If it is damaged in the printer, elevate the case using the Standard Support Process.
4. Run the sensor test in the sensor monitor mode to verify that the fuser pressure release sensor is functioning correctly. If the sensors does not function correctly, replace the fuser pressure release sensor.

5. Run the fuser depressurization drive test in the actuator drive mode to verify that the fuser depressurization is functioning correctly. If it is functioning correctly, replace the fuser motor.

Part number: RM2-0077-000CN

6. Reconnect the connector (J79) of the fuser pressure release sensor and the connector (J115) on the DC controller PCA.
7. Replace the fuser.

50.8X.YZ

Low fuser temperature 2

X = Fuser Modes

0 = Photo Paper 1, 2, 3

1 = Normal–Auto Sense

2 = Normal

3 = Light 1

4 = Heavy 1

5 = Heavy 2

6 = Heavy 3

7 = Glossy 1

8 = Glossy 2

9 = Glossy 3

A = Glossy Film

B = Transparency

C = Label

D = Envelope 1

E = Rough

Y = Current printer sleep state

Z = Next sleep state

0 = Printing

1 = Standby level 1 (no temperature control)

2 = Standby level 2 (high temperature control)

3 = Standby level 3 (middle temperature control)

4 = Standby level 2 (low temperature control)

5 = Middle sleep

6 = Deep sleep

F = Power off

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.
2. Ensure that there is no residual paper in the fuser.
3. Check connector (J50) between the fuser and the printer. If it is damaged on the fuser, replace the fuser. If it is damaged in the printer, elevate the case using the Standard Support Process.
4. Reconnect connector (J2603) on the fuser control PCA and connector (J116) on the DC controller PCA.
5. If the error persists, replace the fuser.

Table 6-68 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.



NOTE: After replacing the fuser kit, reset the fuser page counter by selecting the [New Fuser Kit](#) in the [Reset Supplies](#) menu.

6. If the error still remains, replace the fuser PCA assembly.

7. If the error still remains, replace the fuser power supply assembly.

Part number: RM2-7125-000CN

50 . 9X . YZ

High fuser temperature 2

X = Fuser Modes

0 = Photo Paper 1, 2, 3

1 = Normal–Auto Sense

2 = Normal

3 = Light 1

4 = Heavy 1

5 = Heavy 2

6 = Heavy 3

7 = Glossy 1

8 = Glossy 2

9 = Glossy 3

A = Glossy Film

B = Transparency

C = Label

D = Envelope 1

E = Rough

Y = Current printer sleep state

Z = Next sleep state

0 = Printing

1 = Standby level 1 (no temperature control)

2 = Standby level 2 (high temperature control)

3 = Standby level 3 (middle temperature control)

4 = Standby level 2 (low temperature control)

5 = Middle sleep

6 = Deep sleep

F = Power off

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterruptured power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.
2. Ensure that there is no residual paper in the fuser.
3. Check the paper type setting in the printer control panel menus and in the print driver. Ensure that the settings match and are correct for the type of paper being used.
4. Check the connector (J50) between the fuser and printer. If it is damaged on the fuser, replace the fuser. If it is damaged in the printer, elevate the case using the Standard Support Process.
5. If the error persists, replace the fuser.

Table 6-69 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.



NOTE: After replacing the fuser kit, reset the fuser page counter by selecting the [New Fuser Kit](#) in the [Reset Supplies](#) menu.

6. If the error still remains, replace the fuser PCA assembly.

50 .AX .YZ

Low fuser temperature 3

X = Fuser Modes

0 = Photo Paper 1, 2, 3

1 = Normal–Auto Sense

2 = Normal

3 = Light 1

4 = Heavy 1

5 = Heavy 2

6 = Heavy 3

7 = Glossy 1

8 = Glossy 2

9 = Glossy 3

A = Glossy Film

B = Transparency

C = Label

D = Envelope 1

E = Rough

Y = Current printer sleep state**Z = Next sleep state**

0 = Printing

1 = Standby level 1 (no temperature control)

2 = Standby level 2 (high temperature control)

3 = Standby level 3 (middle temperature control)

4 = Standby level 2 (low temperature control)

5 = Middle sleep

6 = Deep sleep

F = Power off

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.
2. Ensure that there is no residual paper in the fuser.
3. Check connector (J50) between the fuser and the printer. If it is damaged on the fuser, replace the fuser. If it is damaged in the printer, elevate the case using the Standard Support Process.
4. Reconnect connector (J2603) on the fuser control PCA and connector (J116) on the DC controller PCA.
5. If the error persists, replace the fuser.

Table 6-70 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.



NOTE: After replacing the fuser kit, reset the fuser page counter by selecting the [New Fuser Kit](#) in the [Reset Supplies](#) menu.

6. If the error still remains, replace the fuser PCA assembly.
7. If the error still remains, replace the fuser power supply assembly.

Part number: RM2-7125-000CN

50 . BX . YZ

High fuser temperature 3

X = Fuser Modes

0 = Photo Paper 1, 2, 3

1 = Normal–Auto Sense

2 = Normal

3 = Light 1

4 = Heavy 1

5 = Heavy 2

6 = Heavy 3

7 = Glossy 1

8 = Glossy 2

9 = Glossy 3

A = Glossy Film

B = Transparency

C = Label

D = Envelope 1

E = Rough

Y = Current printer sleep state

Z = Next sleep state

0 = Printing

1 = Standby level 1 (no temperature control)

2 = Standby level 2 (high temperature control)

3 = Standby level 3 (middle temperature control)

4 = Standby level 2 (low temperature control)

5 = Middle sleep

6 = Deep sleep

F = Power off

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.
2. Ensure that there is no residual paper in the fuser.
3. Check the paper type setting in the printer control panel menus and in the print driver. Ensure that the settings match and are correct for the type of paper being used.
4. Check connector (J50) between the fuser and printer. If it is damaged on the fuser, replace the fuser. If it is damaged in the printer, elevate the case using the Standard Support Process.
5. If the error persists, replace the fuser.

Table 6-71 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: See the Repair Service Manual for this product.



NOTE: After replacing the fuser kit, reset the fuser page counter by selecting the [New Fuser Kit](#) in the [Reset Supplies](#) menu.

6. If the error still remains, replace the fuser PCA assembly.

51.WX.YZ Error Messages

51.* errors

Errors in the 51.* family are related to the laser scanner.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Ensure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Check all connections on the laser/scanner and from the laser/scanner to the DC controller, and reseal them if necessary.
3. If the error persists, replace the laser scanner.

51.00.YZ

An error with the laser/scanner assembly has occurred in the printer.

- **51.00.10** Beam detect error
- **51.00.19** Laser malfunction

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open and close the right and front doors to see if the printer returns to a [Ready](#).
2. Turn the printer off, and then on.
3. Reconnect connector (J126) on the laser driver PCA and connector (J127) on the DC controller PCA.
4. Remove the left cover, reconnect the FFC on the laser scanner, closest to the left cover.
5. If the error persists, reconnect connector (J201) on the laser driver PCA and connector (J202) on the laser scanner, by removing the LVPS, HVPS-D, Formatter, and DCC pan.

6. If the error persists, replace the laser/scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: RM2-6545-000CN

52.WX.YZ Error Messages

52.* errors

Errors in the 52.* family are related to the laser scanner.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Ensure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Check all connections on the laser/scanner and from the laser/scanner to the DC controller, and reseal them if necessary.
3. If the error persists, replace the laser scanner.

52.00.00/52.00.20 Scanner Startup/Rotation error

A printer laser/scanner error occurred.

- **52.00.00** laser/scanner startup error.
- **52.00.20** laser/scanner rotation error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open and close the right and front doors to see if the printer returns to a [Ready](#).
2. Turn the printer off, and then on.
3. Reconnect connector (J126) on the laser driver PCA and connector (J127) on the DC controller PCA.
4. Remove the left cover, reconnect the FFC on the laser scanner, closest to the left cover.
5. If the error persists, reconnect connector (J201) on the laser driver PCA and connector (J202) on the laser scanner, by removing the LVPS, HVPS-D, Formatter, and DCC pan.
6. If the error persists, replace the laser/scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: RM2-6545-000CN

53.WX.YZ Error Messages

53.B0.0z

Tray "Z" feed roller nearing end of life.

Prepare to replace tray pick rollers



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B0.01:** Tray 1 feed roller nearing end of life.
- **53.B0.02:** Tray 2 feed roller nearing end of life.
- **53.B0.03:** Tray 3 feed roller nearing end of life.
- **53.B0.04:** Tray 4 feed roller nearing end of life.
- **53.B0.05:** Tray 5 feed roller nearing end of life.
- **53.B0.06:** Tray 6 feed roller nearing end of life.

Recommended action

Follow these troubleshooting steps in the order presented.

- The paper tray rollers will need to be replaced soon. Be prepared to replace the tray rollers for the specified tray.



NOTE: Check the event log for the following messages to determine which tray rollers need to be changed.

- **53.B0.01:** Tray 1 feed roller nearing end of life.
- **53.B0.02:** Tray 2 feed roller nearing end of life.

- **53.B0.03:** Tray 3 feed roller nearing end of life.
- **53.B0.04:** Tray 4 feed roller nearing end of life.
- **53.B0.05:** Tray 5 feed roller nearing end of life.
- **53.B0.06:** Tray 6 feed roller nearing end of life.

53.B1.0z

Tray "Z" feed roller at end of life.



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B1.01:** Tray 1 feed roller at end of life.
- **53.B1.02:** Tray 2 feed roller at end of life.
- **53.B1.03:** Tray 3 feed roller at end of life.
- **53.B1.04:** Tray 4 feed roller at end of life.
- **53.B1.05:** Tray 5 feed roller at end of life.
- **53.B1.06:** Tray 6 feed roller at end of life.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

- Replace the feed and separation rollers for the specified tray.

53.B2.0z

Tray "Z" feed roller brand new.



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B2.01:** Tray 1 feed roller brand new.
- **53.B2.02:** Tray 2 feed roller brand new.
- **53.B2.03:** Tray 3 feed roller brand new.
- **53.B2.04:** Tray 4 feed roller brand new.
- **53.B2.05:** Tray 5 feed roller brand new.

- **53.B2.06:** Tray 6 feed roller brand new.

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.B3.0z

Tray "Z" pick roller brand new (engine detected).

The engine detected that new tray feed rollers have been installed.



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B3.01:** Tray 1 feed roller brand new (engine detected).
- **53.B3.02:** Tray 2 feed roller brand new (engine detected).
- **53.B3.03:** Tray 3 feed roller brand new (engine detected).
- **53.B3.04:** Tray 4 feed roller brand new (engine detected).
- **53.B3.05:** Tray 5 feed roller brand new (engine detected).
- **53.B3.06:** Tray 6 feed roller brand new (engine detected).

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.C1.0z Tray "Z" size mismatch.

The specified tray contains a size that does not match the configured size.

Complete screen message:

The specified tray contains a size that does not match the configured size.

The tray is configured to support the only size indicated

Confirm guides are in correct position.

This issue occurs when the managed print provider has locked the paper tray to either letter or A4 and the tray has a different size paper loaded.



NOTE: This can occur if the tray was swapped out or the physical trays locks in the tray were removed and the guides changed.

- **53.C1.02:** Tray 2 size mismatch.
- **53.C1.03:** Tray 3 size mismatch.
- **53.C1.04:** Tray 4 size mismatch.

- **53.C1.05:** Tray 5 size mismatch.
- **53.C1.06:** Tray 6 size mismatch.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Ensure that the paper size in the tray matches the tray size in the [Trays](#) menu.
2. Contact your managed print provider if you need to change the paper size from the one selected.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Ask the customer to check the media size loaded in the tray to see if it matches the size listed in the [Trays](#) menu or on the Configuration Page.
2. Instruct the customer to contact the managed print provider if the paper size needs to be changed from the one selected.

54.WX.YZ Error Messages

54.* errors

Errors in the 54.* family are related to the image-formation system.

- For HP LaserJet printers, they can indicate a problem with the toner cartridges or the transfer unit (color printers only), or they can indicate a problem with a sensor, such as with the laser/scanner.
- For HP PageWide printers, they can indicate a problem with the calibration process.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Make sure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Check the supplies status page using the [Supplies](#) menu on the control panel to verify that toner cartridges, toner collection unit (TCU), or the transfer belt kit are not past their useful life. Replace the supplies and maintenance parts as necessary.

To print a Supplies Status Page:

- a. From the Home screen on the printer control panel, select [Administration](#).
- b. Open the following menus:
 - i. [Reports](#)
 - ii. [Configuration/Status Pages](#)

- c. Scroll to and select [Supplies Status Page](#).
- d. Select [Print](#) to print the page.

To order parts, go to <https://www.hp.com/buy/parts>.

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Check the supplies status page to verify that the toner cartridges, TCU, or the transfer belt kit are not past their useful life. Replace the supplies and maintenance parts as necessary.
3. For color printers, inspect the transfer belt for damage. Replace the transfer belt if necessary or instruct the customer to replace it.
4. For color printers, if the error persists, replace the registration assembly.
5. Check the connections between the laser/scanner and the DC controller, and from the laser/scanner to the printer. Reseat them if necessary. If the error persists, replace the laser scanner.

54.00.01 / 54.00.03 (event log only)

Environment sensor abnormality warning

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Reconnect connector (J800) of the environment sensor and connector (J122) on the DC controller PCA.
3. Replace the environment sensor.

Part number: RM2-7154-000CN

54.00.06 or 54.00.14 or 54.00.19 (event log only)

Registration density sensor failure

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.


1. Open and close the right door, or turn the printer off, and then on to perform the color plane registration.
2. Clean any toner dust and debris from the front and rear density sensors and the surrounding areas using compressed air and/or a soft brush.



NOTE: To clean the density sensors open right and front doors and remove both the fuser and ITB.

Close the front door to expose the density sensors for cleaning as shown in the following image.

Figure 6-80 Front and rear density sensors

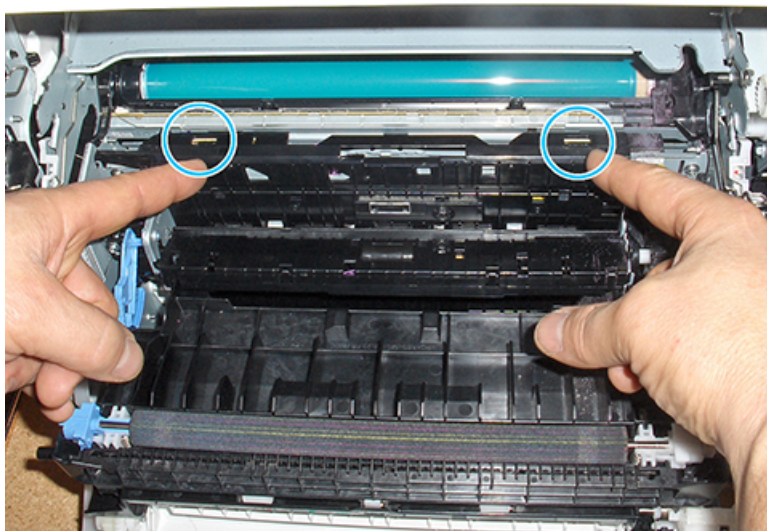

3. Reconnect the connector (J120) on the DC controller PCA.
4. If the error persists, replace the registration density sensor assembly.

Table 6-72 Part number:

Description	HP Part Number
Density detect sensor assembly	RM2-7160-000CN

54 . 01 . 05 (event log only)

Paper sensor is out of calibration range

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Clean the paper sensor assembly with a lint-free cloth. Turn the power off, and then on.
2. Reconnect connector (J3) of the paper sensor assembly and connector (J124) on the DC controller PCA.
3. Replace the registration assembly.

Table 6-73 Part number:

Description	HP Part Number
Registration assembly (M552dn, M553dn, M553x, M577)	RM2-0018-000CN
Registration assembly (M553n)	RM2-0093-000CN

54.06.21 (event log only)

Primary laser/scanner beam detect abnormality

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Check connectors (J126 and J127) on the DC controller PCA.
3. If the error persists, replace the laser/scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: RM2-6545-000CN

54.14.00 (event log only)

CPR sensor abnormality warning

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.
2. Check the supplies status page to ensure that the toner cartridges are not past their useful life.

 **NOTE:** Check the event log for the 10.0X.70 codes for the cartridge (10.01, 02, 03, 04.70). If this error is listed, the customer must replace the specified supply.

After an HP supply has reached the very low threshold, the HP premium protection warranty ends and the customer is responsible for replacing the part(s).

3. Check the ITB for damage and replace the ITB as needed.

For instructions: *Removal and replacement: ITB*


Part number: RM2-6576-000CN

4. Clean any toner dust and debris from the front and rear density sensors (RD sensors) and the surrounding areas using compressed air and/or a soft brush.

 **NOTE:** To clean the density sensors open right and front doors and remove both the fuser and ITB.

Close the front door to expose the density sensors for cleaning as shown in the following image.

Figure 6-81 Front and rear density sensors

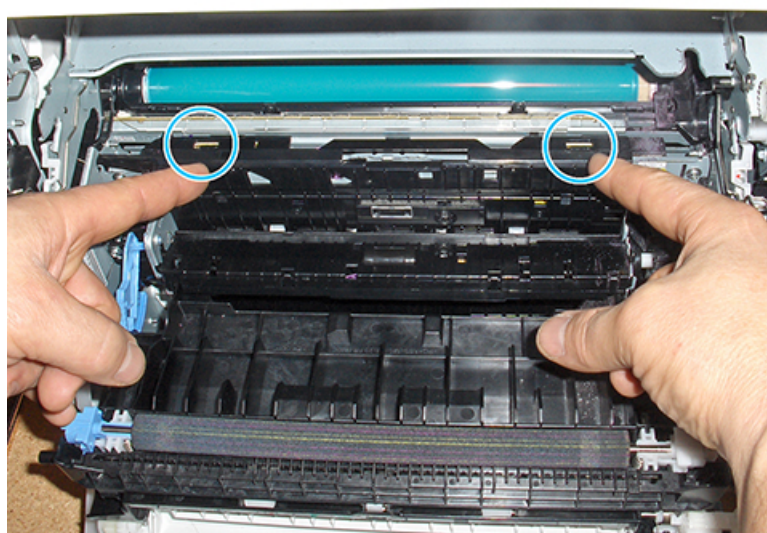

5. If the error persists, replace the ITB.

54.0B.YZ (event log only)

Density sensor out of range or density uniformity adjustment abnormality.

- 54.0B.00, 54.0B.10 – Black
- 54.0B.01, 54.0B.11 – Cyan
- 54.0B.02, 54.0B.12 – Magenta
- 54.0B.03, 54.0B.13 – Yellow

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.
2. Check the supplies status page to ensure that the toner cartridges are not past their useful life.



NOTE: Check the event log for the 10.0X.70 codes for the cartridge (10.01, 02, 03, 04.70). If this error is listed, the customer must replace the specified supply.

After an HP supply has reached the very low threshold, the HP premium protection warranty ends and the customer is responsible for replacing the part(s).

3. Check the ITB for damage and replace the ITB as needed.

For instructions: *Removal and replacement: ITB*

Part number: RM2-6576-000CN


4. Clean any toner dust and debris from the front and rear density sensors (RD sensors) and the surrounding areas using compressed air and/or a soft brush.



NOTE: To clean the density sensors open right and front doors and remove both the fuser and ITB.

Close the front door to expose the density sensors for cleaning as shown in the following image.

Figure 6-82 Front and rear density sensors

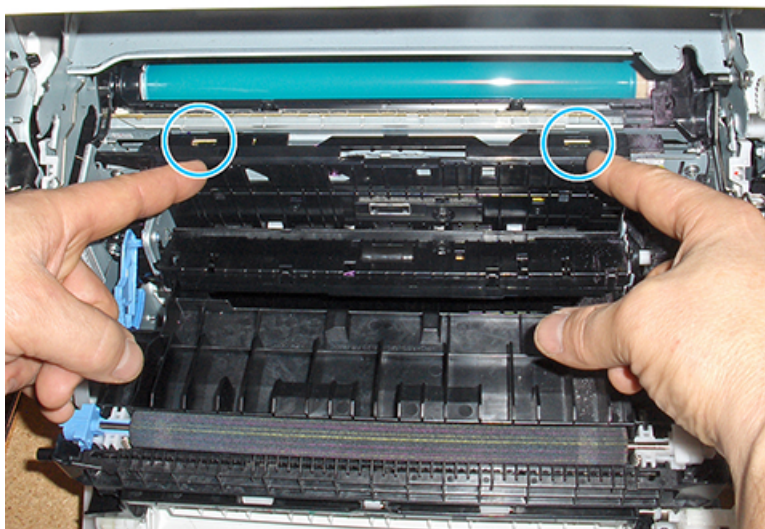

5. Replace the failing toner cartridge.
6. If the error persists, replace the registration sensor assembly.

Table 6-74 Part number:

Description	HP Part Number
Density detect sensor assembly	RM2-7160-000CN

54.0C.0Z or 54.0D.0Z (event log only)

DHalf warning.

During the printer calibration, the half tone of the color indicated failed to measure normally.

- **54.0C.00, 54.0D.00** – Black
- **54.0C.01, 54.0D.01** – Cyan
- **54.0C.02, 54.0D.02** – Magenta
- **54.0C.03, 54.0D.03** – Yellow

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.

2. Check the supplies status page to ensure that the toner cartridges are not past their useful life.

 **NOTE:** Check the event log for the 10.0X.70 codes for the cartridge (10.01, 02, 03, 04.70). If this error is listed, the customer must replace the specified supply.

After an HP supply has reached the very low threshold, the HP premium protection warranty ends and the customer is responsible for replacing the part(s).

3. Check the ITB for damage and replace the ITB as needed.

For instructions: *Removal and replacement: ITB*


Part number: RM2-6576-000CN

4. Clean any toner dust and debris from the front and rear density sensors (RD sensors) and the surrounding areas using compressed air and/or a soft brush.

 **NOTE:** To clean the density sensors open right and front doors and remove both the fuser and ITB.

Close the front door to expose the density sensors for cleaning as shown in the following image.

Figure 6-83 Front and rear density sensors

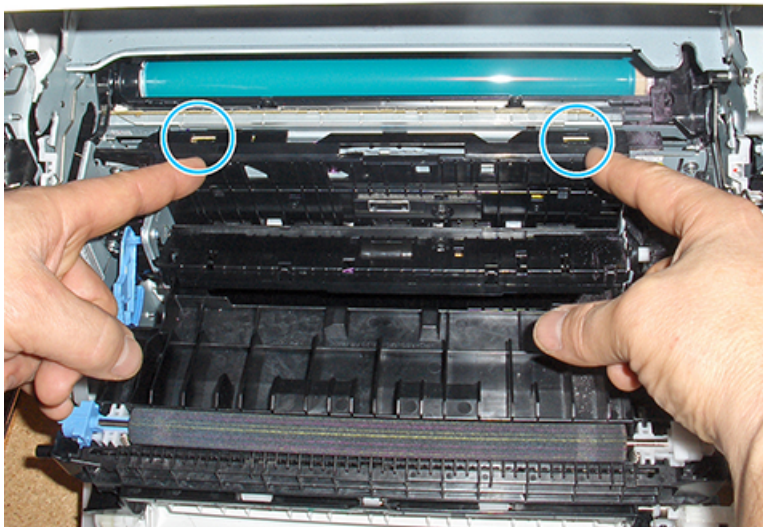

5. Replace the failing toner cartridge.
6. If the error persists, replace the registration sensor assembly.

Table 6-75 Part number:

Description	HP Part Number
Density detect sensor assembly	RM2-7160-000CN

54.0E.YZ (event log only)

These are informational only messages for engine calibration events.

Recommended action

There is no action needed for this message.

- No action necessary.

54.0F.YZ (event log only)

CPR sensor out of range

Mis-registration measurement abnormality error.

- **54.0F.00** – Black
- **54.0F.01** – Cyan
- **54.0F.02** – Magenta
- **54.0F.03** – Yellow

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.
2. Check the supplies status page to ensure that the toner cartridges are not past their useful life.

 **NOTE:** Check the event log for the 10.0X.70 codes for the cartridge (10.01, 02, 03, 04.70). If this error is listed, the customer must replace the specified supply.

After an HP supply has reached the very low threshold, the HP premium protection warranty ends and the customer is responsible for replacing the part(s).

3. Check the ITB for damage and replace the ITB as needed.

For instructions: *Removal and replacement: ITB*


Part number: RM2-6576-000CN

4. Clean any toner dust and debris from the front and rear density sensors and the surrounding areas using compressed air and/or a soft brush.

 **NOTE:** To clean the density sensors open right and front doors and remove both the fuser and ITB.

Close the front door to expose the density sensors for cleaning as shown in the following image.

Figure 6-84 Front and rear density sensors

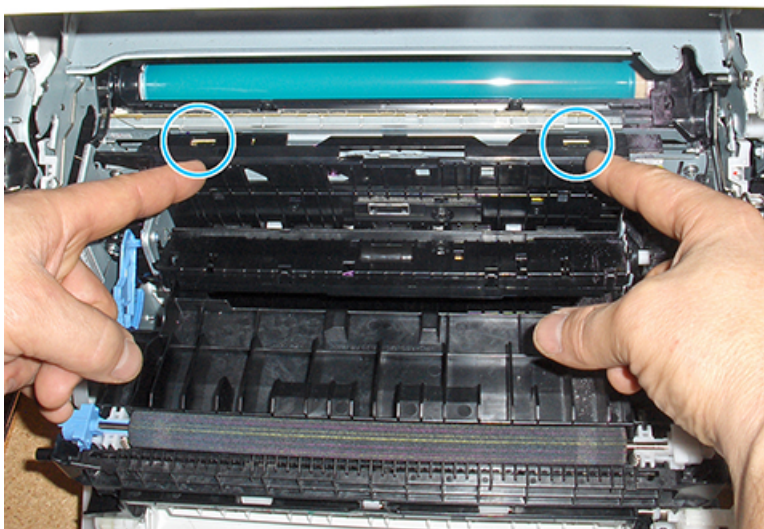

5. Replace the failing toner cartridge.
6. If the error persists, replace the registration sensor assembly.

Table 6-76 Part number:

Description	HP Part Number
Density detect sensor assembly	RM2-7160-000CN

54.0x.07 (event log only)

The printer experienced a drum home position sensor error.

- **54.05.07** Black Drum
- **54.06.07** Cyan Drum
- **54.07.07** Magenta Drum
- **54.08.07** Yellow Drum

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Reconnect connector (J114) on the DC controller PCA.

3. Replace the main drive assembly.

Part number: B5L25-67902

54 . 0X . 0B or 54 . 0X . 0C or 54 . 0X . 0D or 54 . 0X . 0E (event log only)

Density sensor out of range error or Dhalf calibration failure

- 54.00.0B, 54.00.0C 54.00.0D, 54.00.0E – Black
- 54.01.0B, 54.01.0C 54.01.0D, 54.01.0E – Cyan
- 54.02.0B, 54.02.0C 54.02.0D, 54.02.0E – Magenta
- 54.03.0B, 54.03.0C 54.03.0D, 54.03.0E – Yellow

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.
2. Check the supplies status page to ensure that the toner cartridges are not past their useful life.



NOTE: Check the event log for the 10.0X.70 codes for the cartridge (10.01, 02, 03, 04.70). If this error is listed, the customer must replace the specified supply.

After an HP supply has reached the very low threshold, the HP premium protection warranty ends and the customer is responsible for replacing the part(s).

3. Check the ITB for damage and replace the ITB as needed.

For instructions: *Removal and replacement: ITB*

Part number: RM2-6576-000CN


4. Clean any toner dust and debris from the front and rear density sensors (RD sensors) and the surrounding areas using compressed air and/or a soft brush.



NOTE: To clean the density sensors open right and front doors and remove both the fuser and ITB.

Close the front door to expose the density sensors for cleaning as shown in the following image.

Figure 6-85 Front and rear density sensors

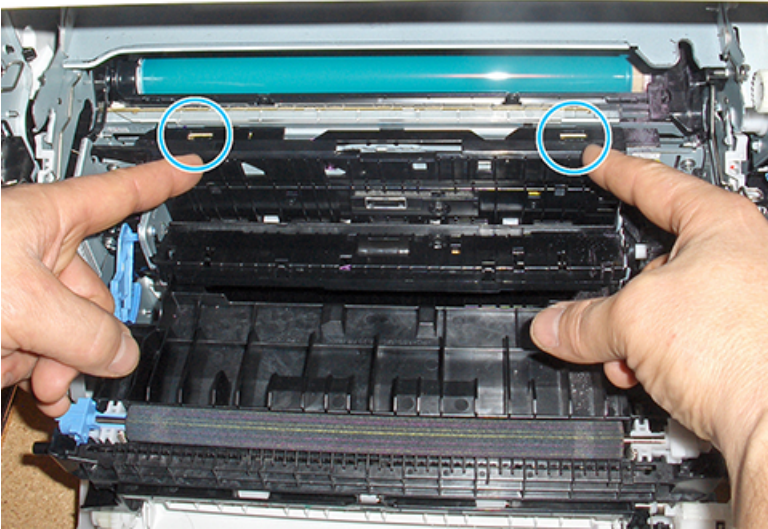

- 5. Replace the failing toner cartridge.
- 6. If the error persists, replace the registration sensor assembly.

Table 6-77 Part number:

Description	HP Part Number
Density detect sensor assembly	RM2-7160-000CN

55.WX.YZ, 56.WX.YZ Error Messages

55.* errors

Errors in the 55.* family often indicate a problem with the DC controller.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

- 1. Turn the printer off, and then on.
- 2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

- 1. Reset the printer:
 - a. Turn the printer off using the power switch, and then wait at least 30 seconds.

2. Make sure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, replace the DC controller.

55.00.01, 55.00.03 or 55.00.04 DC Controller Error

The communication link between the formatter and DC controller was lost.

- **55.00.01** DC controller memory error.
- **55.00.03** DC controller no engine response.
- **55.00.04** DC controller communications time out

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, wait at least 30 seconds, and then turn on.
2. If you are using a surge protector:
 - a. Turn the printer power off.
 - b. Remove the surge protector.
 - c. Plug the printer directly into the wall socket and turn the printer power on.
3. If the error persists, try a different power cord if one is available.
4. If the error persists, try a different wall outlet.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. To verify that the product engine is functioning, print an engine test page.
 - Use a small, pointed object to depress the test-page switch located on the rear of the product
 - The test page can use only Tray 2 as the paper source, so make sure that paper is loaded in Tray 2.
 - The test page should have a series of horizontal lines.

Figure 6-86 Engine test button



3. If the engine page does NOT print successfully, replace the DC controller

Table 6-78 Part number:


Description	HP Part Number
DC controller PCA assembly (M552, M553)	RM3-7450-000CN
DC controller PCA assembly (M577)	RM3-7451-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. To verify that the product engine is functioning, print an engine test page.
 - Use a small, pointed object to depress the test-page switch located on the rear of the product
 - The test page can use only Tray 2 as the paper source, so make sure that paper is loaded in Tray 2.
 - The test page should have a series of horizontal lines.


Figure 6-87 Engine test button

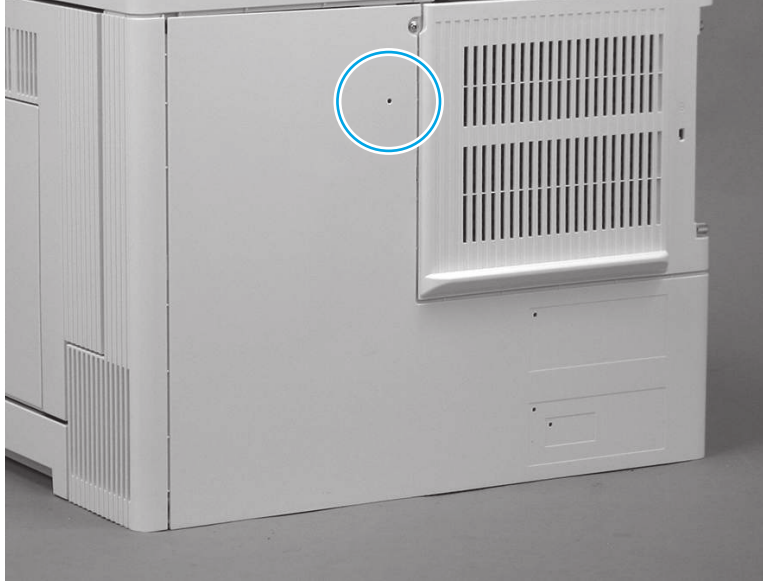

 **NOTE:** If the engine page prints successfully, this typically indicates that the basic functionality of the Hardware is working.

3. If the error persists, disconnect and reconnect all the cables on the DC Controller.

Figure 6-88 DC controller PCA connections

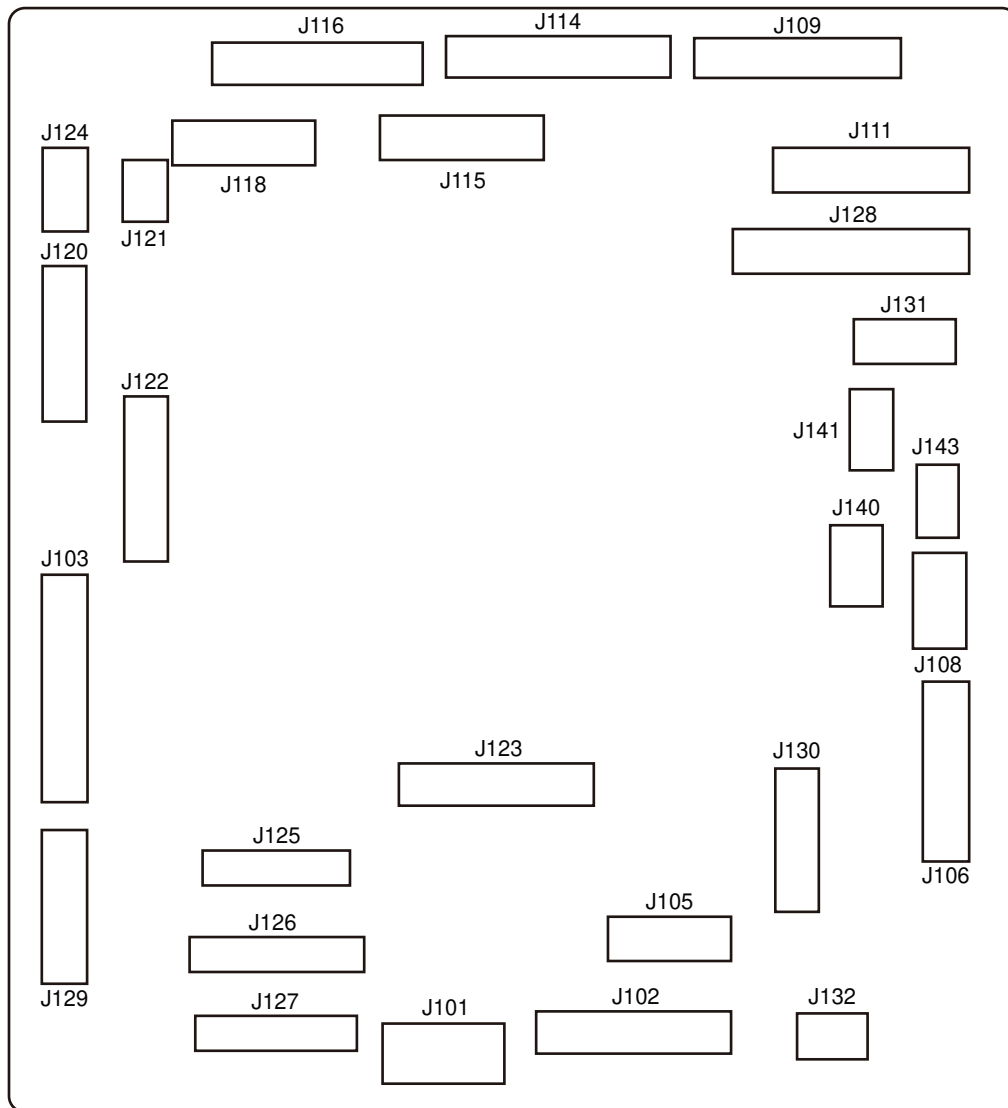

4. If the error persists after replacing the fan, replace the DC Controller.

Table 6-79 Part number:

Description	HP Part Number
DC controller PCA assembly (M552, M553, E55040):	RM3-7450-000CN
DC controller PCA assembly (M577, E57540)	RM3-7451-000CN
DC controller (M554, M555):	RM3-8465-000CN
DC controller (M578):	RM3-8468-000CN

For instructions: See the Repair Service Manual for this product.

5. If the engine test DOES print out, and the error persists, elevate the case per your Region's Elevation Process.

55 . 00 . 05 Engine Firmware RFU Error

The firmware upgrade failed.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, wait at least 30 seconds, and then turn on.
2. If you are using a surge protector:
 - a. Turn the printer power off.
 - b. Remove the surge protector.
 - c. Plug the printer directly into the wall socket and turn the printer power on.
3. If the error persists, try a different power cord if one is available.
4. If the error persists, try a different wall outlet.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Reset the printer.
 - a. Turn off the power by using the power switch, and then wait at least 30 seconds.
 - b. Turn on the power and wait for the product to initialize.
2. If you are using a surge protector:
 - a. Turn the printer power off.
 - b. Remove the surge protector.
 - c. Plug the printer directly into the wall socket and turn the printer power on.
3. If the error persists, try a different power cord if one is available.
4. If the error persists, try a different wall outlet.
5. Verify that all connectors on the DC controller are seated correctly.
6. For M552, M553, and MFP M577 ONLY: A interim version of firmware (ver.: 3.8.6) has been released that will address this issue. Send **NO PARTS**. Follow your normal elevation path to 2LS to get the interim FW to the customer.

55 . 01 . 06, 55 . 02 . 06 DC controller error To continue turn off then on

NVRAM memory warning

- **55.00.00** - Internal communication error

- **55.00.01** - DC controller memory error
- **55.01.06** - DC controller NVRAM abnormal read/write
- **55.02.06** - DC controller NVRAM not accessible

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Reset the printer.
 - a. Turn off the power by using the power switch, and then wait at least 30 seconds.
 - b. Turn on the power and wait for the product to initialize.
2. If you are using a surge protector:
 - a. Turn the printer power off.
 - b. Remove the surge protector.
 - c. Plug the printer directly into the wall socket and turn the printer power on.
3. If the error persists, try a different power cord if one is available.
4. If the error persists, try a different wall outlet.
5. Verify that all connectors on the DC controller are seated correctly.
6. For M552, M553, and MFP M577 ONLY: A interim version of firmware (ver.: 3.8.6) has been released that will address this issue. Send **NO PARTS**. Follow your normal elevation path to 2LS to get the interim FW to the customer.
7. **ONLY if directed after elevating the issue.**
8. Replace the DC controller.

For instructions: See the Repair Service Manual for this product.

Table 6-80 Part number:

Description	HP Part Number
DC controller PCA assembly (M552, M553)	RM3-7450-000CN
DC controller PCA assembly (M577)	RM3-7451-000CN


9. If the engine test DOES print out, and the error persists, elevate the case per your Region's Elevation Process.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. To verify that the product engine is functioning, print an engine test page.
 - Use a small, pointed object to depress the test-page switch located on the rear of the product
 - The test page can use only Tray 2 as the paper source, so make sure that paper is loaded in Tray 2.
 - The test page should have a series of horizontal lines.


Figure 6-89 Engine test button

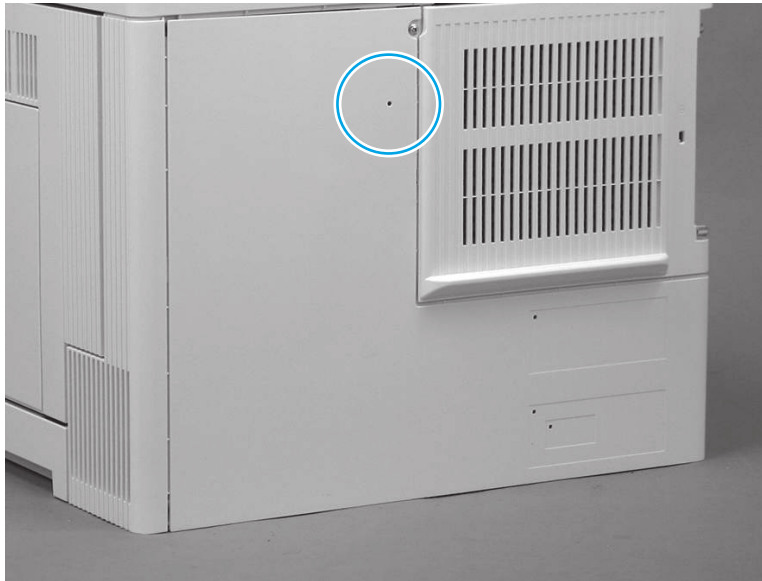

 **NOTE:** If the engine page prints successfully, this typically indicates that the basic functionality of the Hardware is working.

3. If the error persists, disconnect and reconnect all the cables on the DC Controller.

Figure 6-90 DC controller PCA connections

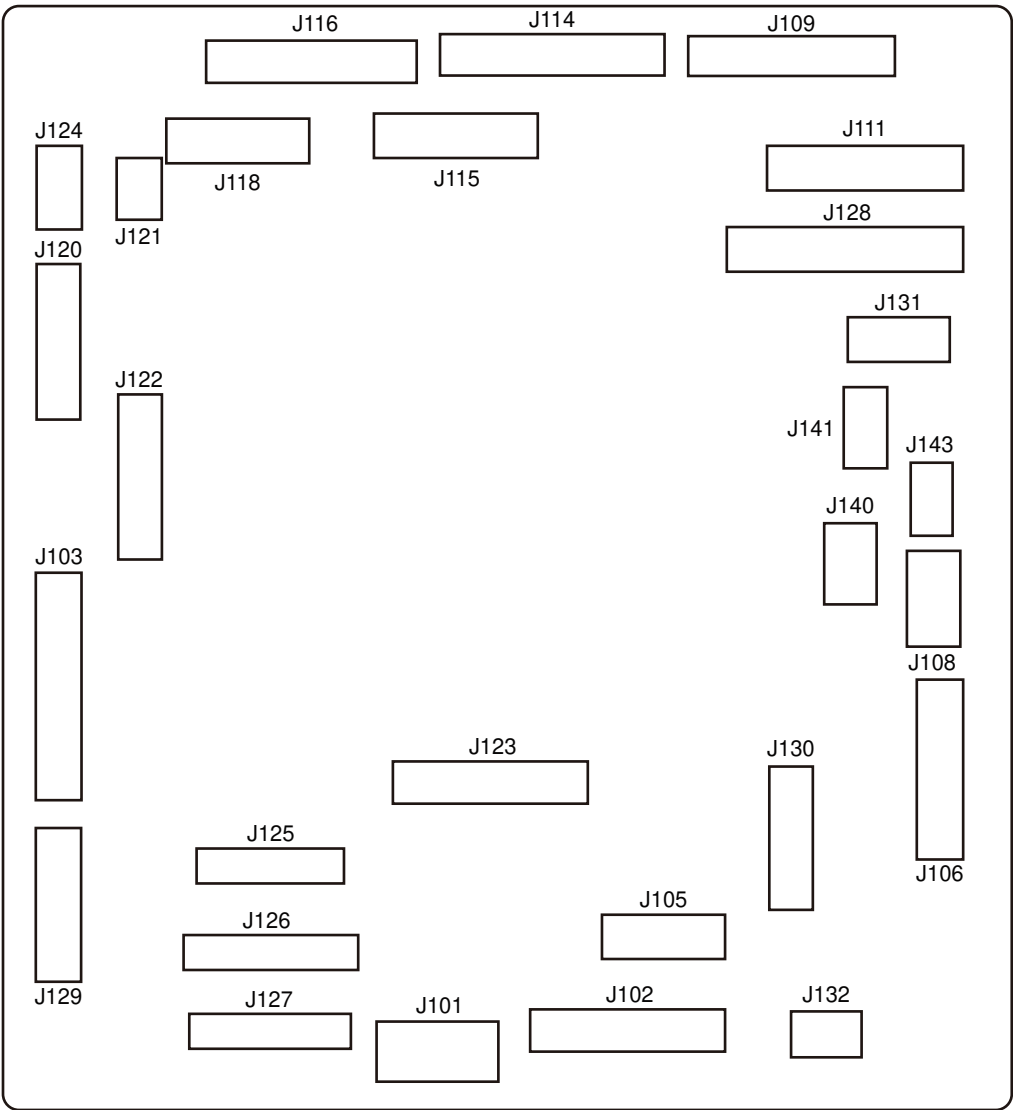

4. If the error persists after reseating all the connectors, replace the DC Controller.

Table 6-81 Part number:

Description	HP Part Number
DC controller PCA assembly (M552, M553)	RM3-7450-000CN
DC controller PCA assembly (M577)	RM3-7451-000CN

For instructions: See the Repair Service Manual for this product.

5. If the engine test DOES print out, and the error persists, elevate the case per your Region's Elevation Process.

56.* errors

Errors in the 56.* family indicate a communication problem with an optional paper tray or other external accessory.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. If any third-party hardware is installed, remove it and try printing again.
3. If an optional paper tray is installed, remove it. Check the connectors on the tray for damage. If the connector is damaged, replace the tray.
4. Reinstall the tray, and make sure it is correctly seated.

56.00.YZ

The printer experienced a communication error with the optional paper trays.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, then on.
2. If the error persists, re-seat the optional paper trays (1 x 500-sheet feeder and/or 3 x 500-sheet feeder).
3. Check the input connectors for damage. If a connector is damaged, replace the connector.

56.00.01 Illegal Input Printer Error

The printer experienced an illegal input.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, then on.
2. Remove any third-party hardware and test again.

57.WX.YZ Error Messages

57.* errors

Errors in the 57.* family indicate a problem with a fan.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.
2. Press the Power button again to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Use the printer troubleshooting manual to identify the locations of each fan. Turn the printer off and then on, and listen for noise coming from the area of each fan. Replace any fan that is not making noise.
2. Update the firmware to the latest version. If the latest version firmware is already installed, reinstall it now.

For more information, see:

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. Remove enough parts to access the DC controller or the power supply PCA. Check the connections from each fan to the DC controller or power supply PCA. Reseat them if necessary.
4. With the DC controller or power supply PCA exposed, turn the printer on. Immediately measure the voltage between the connectors for each fan and the DC controller. If the voltage changes from 0V to approximately 24V during the power-on cycle, replace the affected fan. If the voltage remains at 0V, replace the DC controller.

57.00.01 Delivery Fan (FM3) failure

Exhaust fan (FM3) failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer power off, and then wait for ten (10) seconds.
2. Turn the printer power on.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, an then wait 10 seconds.

2. Turn the printer on. Verify that the issue stills persists.
3. If the error persists, replace the exhaust fan FM3.


Part number, FM3: RK2-2728-000CN

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, then on.
2. Check the exhaust fan (FM3).
 - Disconnect and reconnect the connector (J2505) on the high-voltage power supply
 - Disconnect and reconnect connector (J109) on the DC controller PCA.

Figure 6-91 DC controller PCA connections

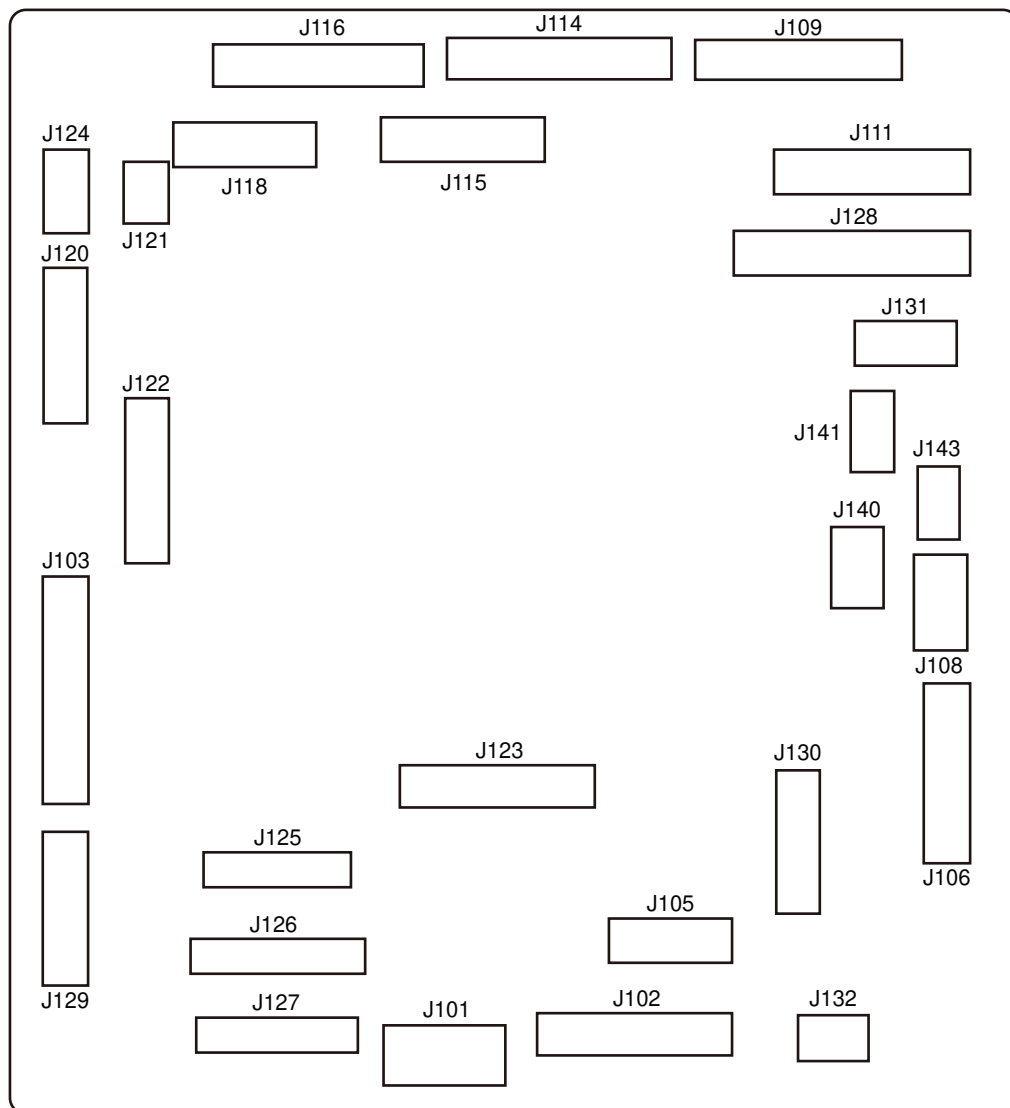

3. If the error persists, replace the exhaust fan (FM3).



NOTE: Technicians can measure the voltage between the connectors (J109-8 and J109-9) on the DC controller PCA immediately after the printer is turned on. If the voltage changes from 0V to approximately 24V, replace the exhaust fan. If the voltage is not present, check the voltages for other fans and replace the DC controller as needed.

4. If the error persists, replace the dc controller.

Table 6-82 Part number:

Description	HP Part Number
DC controller PCA assembly (M552, M553)	RM3-7450-000CN
DC controller PCA assembly (M577)	RM3-7451-000CN

For instructions: See the Repair Service Manual for this product.

57.00.02 Cartridge fan (FM2) failure

Cartridge fan (FM2) error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer power off, and then wait for ten (10) seconds.
2. Turn the printer power on.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer power off, and then wait for ten (10) seconds.
2. Turn the printer power on, and then check if the issue stills persists.
3. If the error persists, replace the cartridge fan, FM2.


Cartridge Fan (FM2) part number: RK2-6124-000CN.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer power off, and then on.
2. Check the cartridge fan, FM2.
 - Disconnect and reconnect the connectors (J6003 and J606) on the fuser power supply assembly.
 - Disconnect and reconnect connector (J128) on the DC controller PCA.

Figure 6-92 DC controller PCA connections

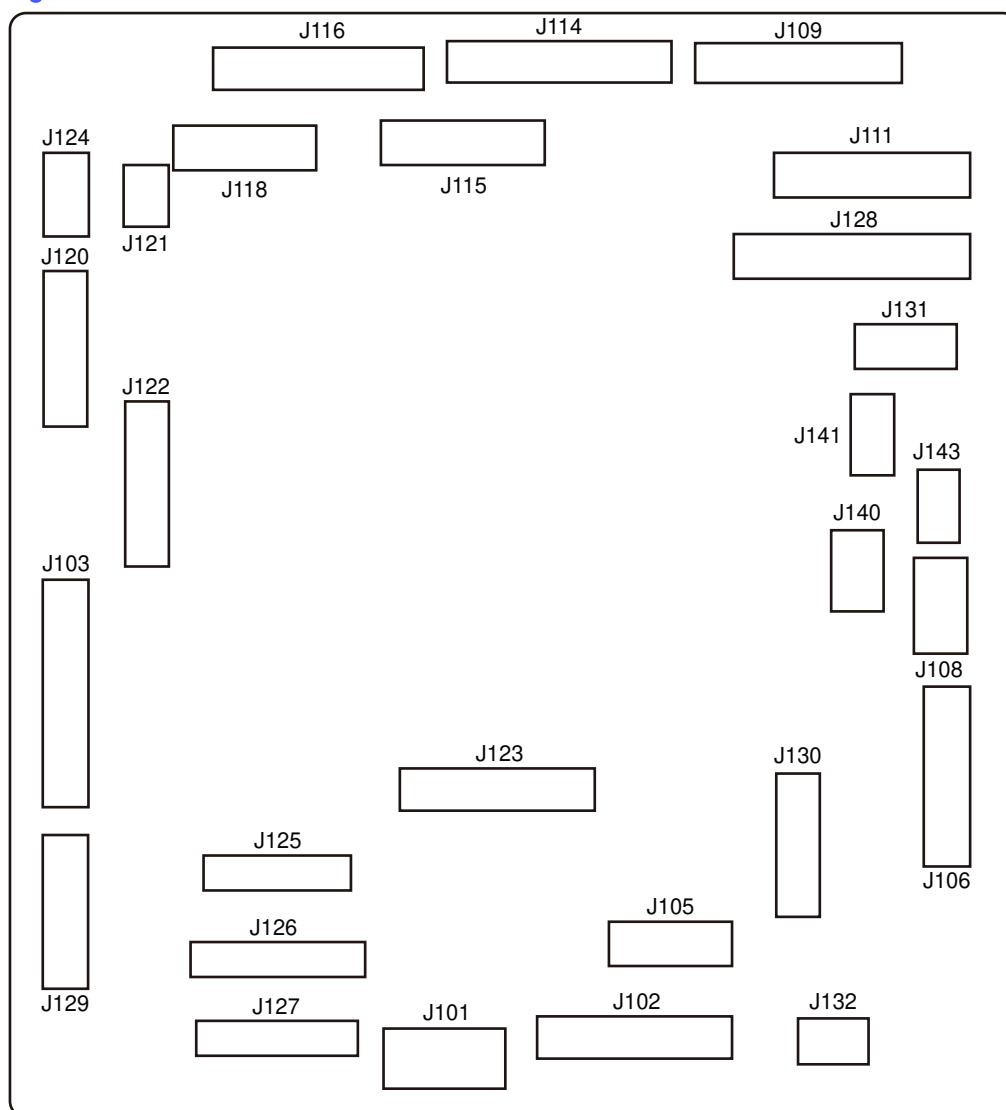

3. If the error persists replace the cartridge fan FM2.

Cartridge Fan (FM2) part number: RK2-6124-000CN.



NOTE: Technicians can measure the voltage between the connectors (J128-3 and J128-4) on the DC controller PCA immediately after the printer is turned on. If the voltage changes from 0V to approximately 24V, replace the cartridge fan FM2. If the voltage is not present, check the voltages for other fans and replace the Fuser Power Supply assembly.

4. If the error persists after replacing the fan, replace the Fuser Power Supply assembly.

Table 6-83 Part number for Fuser Power Supply assembly (110V and 220V)

Description	Part number
110V Fuser Power Supply PCB Assembly	RM3-7159-000CN
220V Fuser Power Supply PCB Assembly	RM3-7160-000CN

For instructions: , see the Repair Service Manual for this product.

57 . 00 . 03 Power supply fan (FM1) failure

Power supply fan (FM1) failure

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer power off, and then wait for ten (10) seconds.
2. Turn the printer power on.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer power off, and then wait ten (10) seconds.
2. Turn the printer power on, and then check if the issue stills persists.
3. If the issue persists, replace the power supply fan, FM1.


Fan (FM1) part number: RK2-2416-010CN.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer power off, and then on.
2. Check the power supply fan, FM1.
 - Disconnect and reconnect the connectors (J602 and J603) on the low-voltage power supply assembly.
 - Disconnect and reconnect connector (J105) on the DC controller PCA.

Figure 6-93 DC controller PCA connections

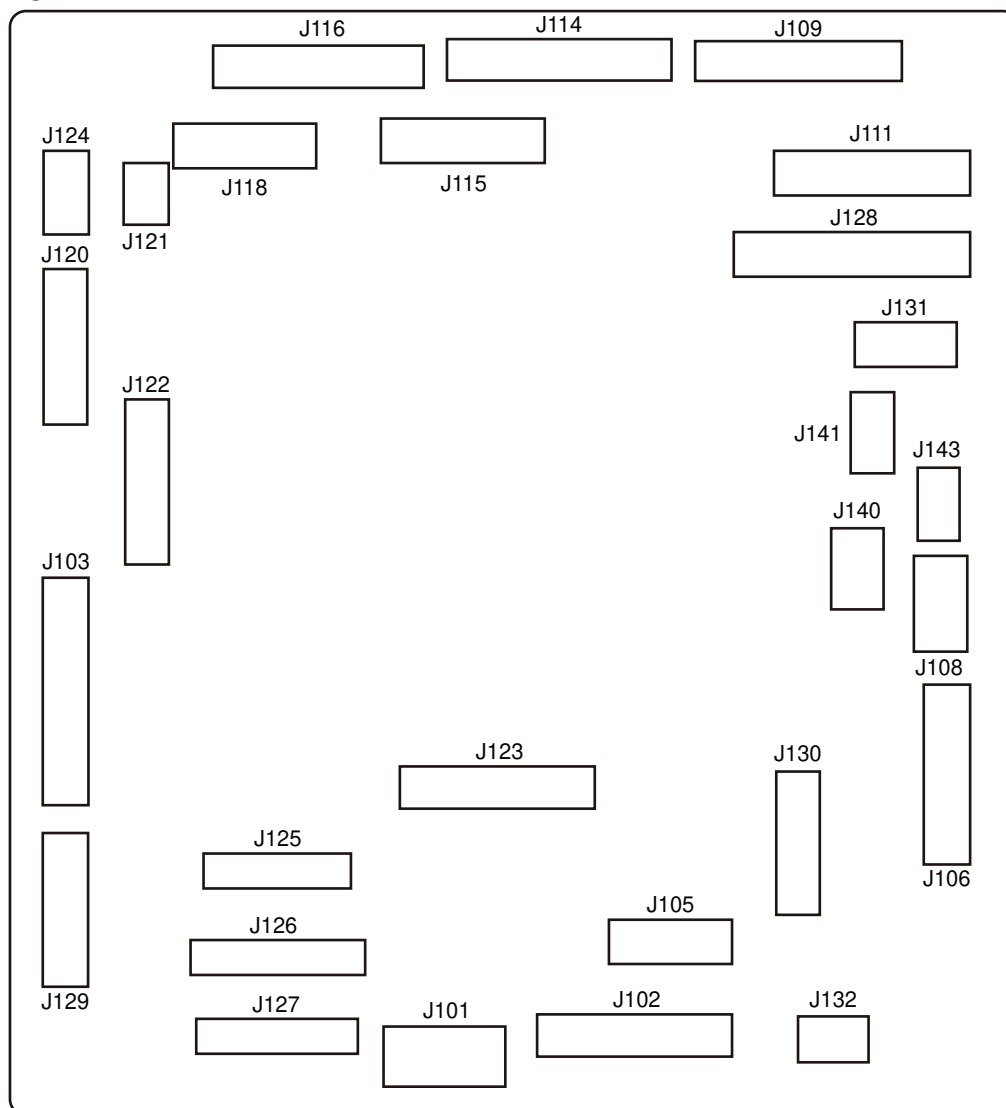

3. If the error persists, replace the power supply fan FM1.

Fan (FM1) part number: RK2-2416-010CN.



NOTE: Technicians can measure the voltage between the connectors (J105-8 and J105-9) on the DC controller PCA immediately after the printer is turned on. If the voltage changes from 0V to approximately 24V, replace the power supply fan, FM1. If the voltage is not present, check the voltages for other fans and replace the Low Voltage Power Supply.

4. If the error persists after replacing the fan, replace the Low Voltage Power Supply (LVPS).

Table 6-84 Part number for Low voltage power supply PCB assembly (110V and 220V)

Description	Part Number
Low-voltage 110V power supply	RM3-7157-000CN
Low-voltage 220V power supply	RM3-7158-000CN

For instructions: , see the Repair Service Manual for this product.

Guidelines to check and resolve printer fan issues

Review the following information to troubleshoot printer fan issues.

Table 6-85 Troubleshoot printer fan issues

Printer fans/Part numbers	Troubleshoot
FM1 (Power supply fan) Cooling area: LVPS Type: Intake RK2-2416-010CN	Check connectors: Check LVPS connectors (J603 and J602), then check the DC Controller (J105). Replace part after verifying connectors: Replace the fan and if the issue persists, replace LVPS.
FM2 (Cartridge fan) Cooling area: Toner cartridges Type: Intake RK2-6124-000CN	Check connectors: Check Fuser Power Supply PCA connectors (J6006 and J6003), then check DC Controller connector (J128). Replace part after verifying connectors: Replace the fan and if the issue persists, replace Fuser Power Supply.
FM3 (Delivery fan) Cooling area: Output tray and fuser area Type: Exhaust RK2-2728-000CN	Check connectors: Check HVPS-T connector (J2505) and DC Controller (J109). Replace part after verifying connectors: Replace the fan and if the issue persists, replace LVPS
FM4 (Fuser fan) Cooling area: Fuser Type: Exhaust RK2-2418-000CN	Check connectors: Reconnect the connector (J54) of the fuser fan, intermediate connector (J1801), connector (J2506) on the high-voltage power supply -T PCA and connector (J109) on the DC controller PCA. Replace part after verifying connectors: Replace the fan and if the issue persists, replace the DC controller.

57.00.04 Fuser Fan (FM4) failure

Fuser fan (FM4) failure

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer power off, and then wait for ten (10) seconds.
2. Turn the printer power on.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, an then wait 10 seconds.
2. Turn the printer on. Verify that the issue stills persists.

3. If the error persists, replace the fuser fan FM4.


Part number, fuser fan FM4: RK2-2418-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, then on.
2. Check the fuser fan (FM4).
 - Disconnect and reconnect the connector (J54) of the fuser fan, intermediate connector (J1801).
 - Disconnect and reconnect the intermediate connector (J1801).
 - Disconnect and reconnect the intermediate connector (J2506) on the high-voltage power supply -T PCA
 - Disconnect and reconnect the intermediate connector (J109) on the DC controller PCA.

Figure 6-94 DC controller PCA connections

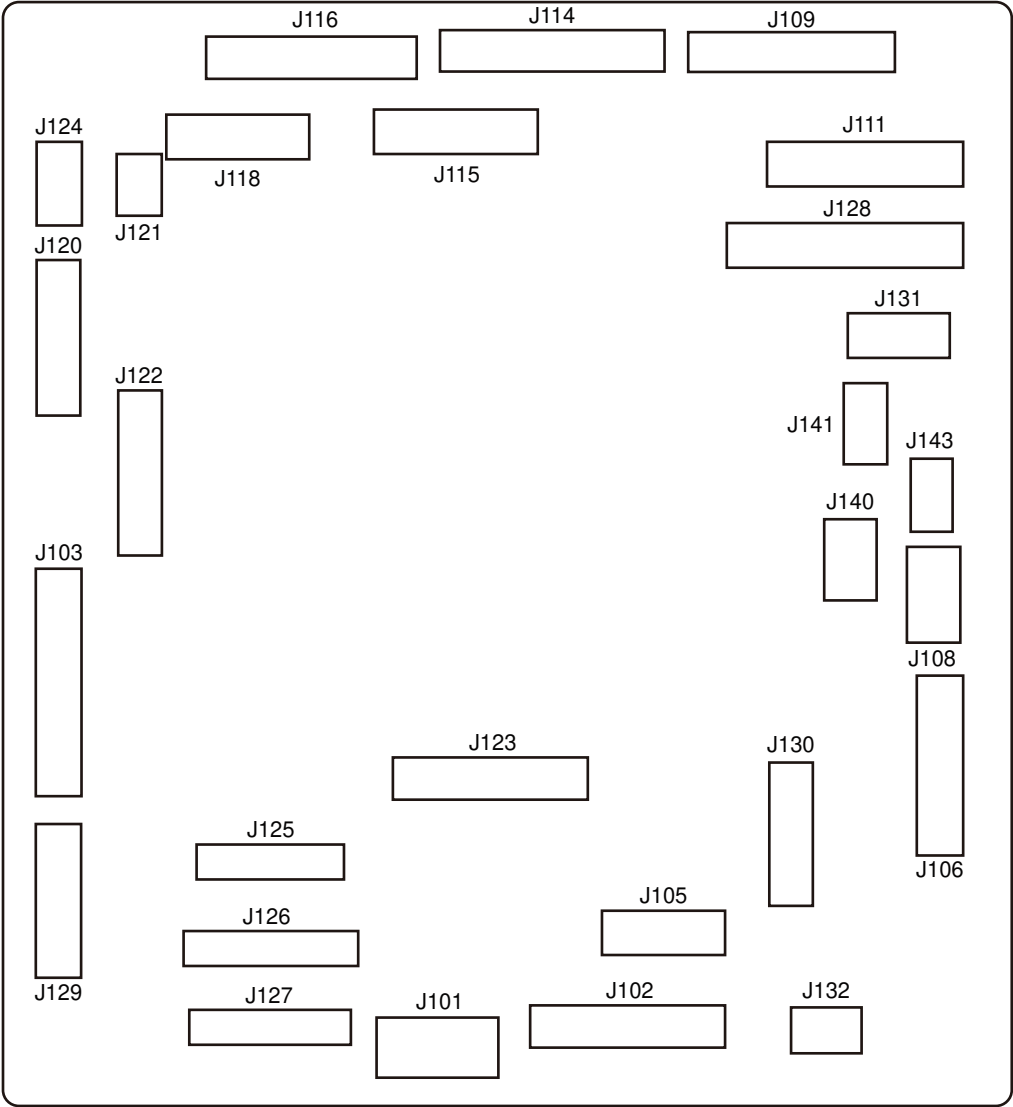

 **NOTE:** Technicians can measure the voltage between the connectors (J109-2 and J109-3) on the DC controller PCA immediately after the printer is turned on. If the voltage changes from 0V to approximately 24V, replace the fuser fan FM4. If the voltage is not present, check the voltages for other fans and replace the DC Controller as needed.

- 3. If the error persists, replace the fuser fan FM4.
Part number, fuser fan FM4: RK2-2418-000CN
- 4. If the error persists after replacing the fan, replace the DC Controller.

Table 6-86 Part number:

Description	HP Part Number
DC controller PCA assembly (M552, M553)	RM3-7450-000CN
DC controller PCA assembly (M577)	RM3-7451-000CN

For instructions: See the Repair Service Manual for this product.

58.WX.YZ Error Messages

58.* errors

Errors in the 58.* family indicate an electrical problem inside the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Make sure the printer is connected to a dedicated power outlet and not to a surge protector or other type of extension cord.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Make sure the printer is connected to a dedicated power outlet and not to a surge protector or other type of extension cord.
3. Check all connections on the DC Controller and the power supply. Trace the connections from the DC Controller and power supply to the sensors and other components and reseal them if necessary.

58.00.02 Error

Environmental sensor failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If this part has been removed or replace, check the connector (J800) of the environment sensor and connector (J122) on the DC controller PCA.

3. If the error persists, replace the environmental sensor.

Part number: RM2-7154-000CN

58.00.03 Error

DC controller failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, replace the DC controller PCA.

Table 6-87 Part number:

Description	HP Part Number
DC controller PCA assembly (M552, M553, E55040):	RM3-7450-000CN
DC controller PCA assembly (M577, E57540)	RM3-7451-000CN
DC controller (M554, M555):	RM3-8465-000CN
DC controller (M578):	RM3-8468-000CN


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the issue persists, disconnect and reconnect all the cables on the DC controller.

Figure 6-95 DC controller PCA connections

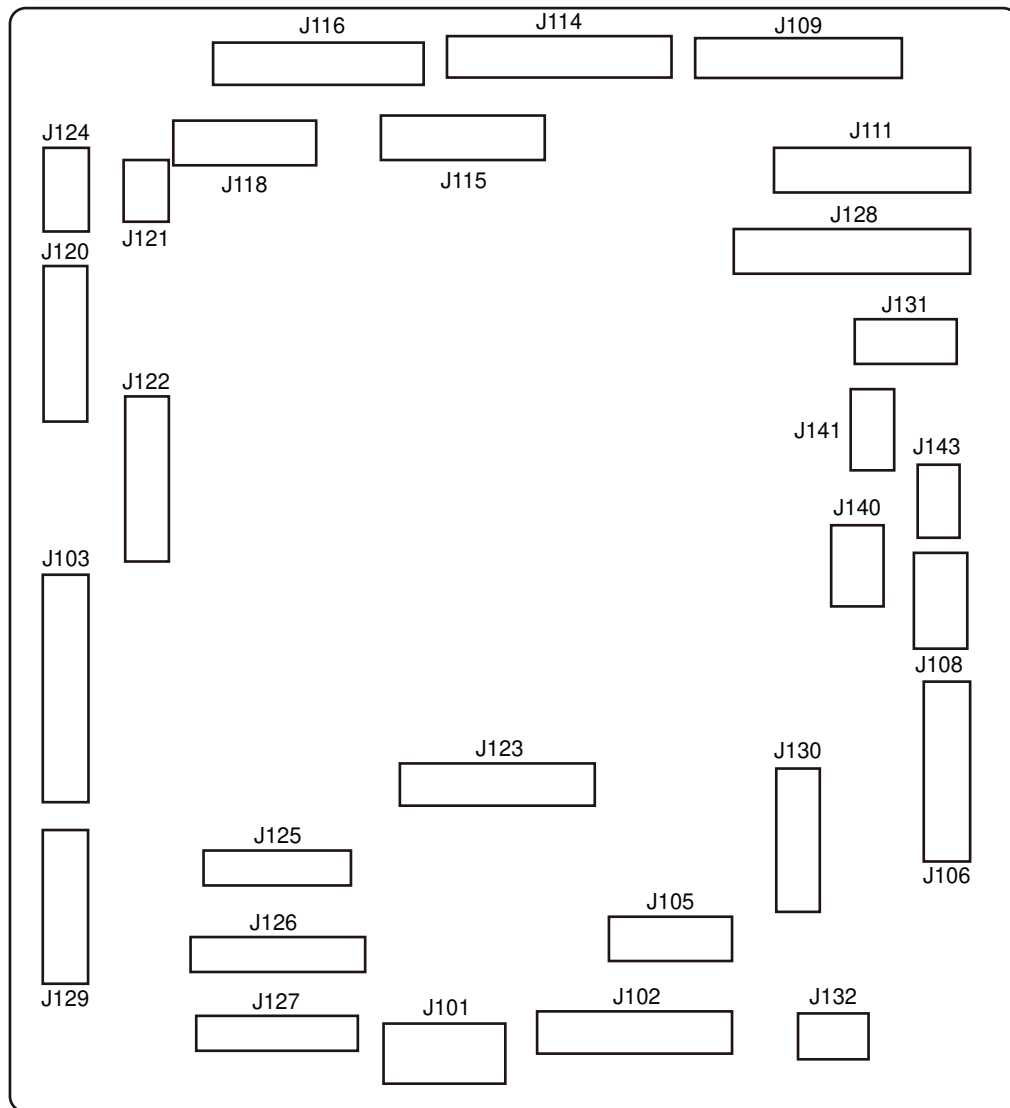

3. If the error persists, replace the DC controller PCA.

Table 6-88 Part number:

Description	HP Part Number
DC controller PCA assembly (M552, M553, E55040):	RM3-7450-000CN
DC controller PCA assembly (M577, E57540)	RM3-7451-000CN
DC controller (M554, M555):	RM3-8465-000CN
DC controller (M578):	RM3-8468-000CN

For instructions: See the Repair Service Manual for this product.

58.00.04 Error

Low-voltage power supply unit malfunction.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues.

Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. Ensure the printer is plug into a dedicated power outlet.
3. Reconnect the connector (J102) on the DC controller PCA.
4. If the error persists, replace the low-voltage power supply (LVPS).

For instructions: See the Repair Service Manual for this product.

Table 6-89 LVPS part numbers

Description	HP Part Number
RM3-7157-000CN	Low-voltage power supply (LVPS) 110V
RM3-7158-000CN	Low-voltage power supply (LVPS) 220V

58.01.04 Error

24V power supply error during operation.

During a regular printing operation the 24V power supply experienced an error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues.

Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. Ensure the printer is plug into a dedicated power outlet.
3. If the error persists, replace the low-voltage power supply (LVPS).

For instructions: See the Repair Service Manual for this product.

Table 6-90 LVPS part numbers

Description	HP Part Number
RM3-7157-000CN	Low-voltage power supply (LVPS) 110V
RM3-7158-000CN	Low-voltage power supply (LVPS) 220V

58.02.04 Error

24V power supply error during printer power on or wake up.

During the printer power on, or when waking from a sleep mode, the printer experienced an error with the 24V power supply.



NOTE: Check the voltage of the unit on the regulatory sticker. This event is directly related to a 220V printer being plugged into a 110V outlet. Ensure that the voltage of the outlet matches the voltage of the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues.

Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. Ensure the printer is plugged into a dedicated power outlet.
3. If the error persists, replace the low-voltage power supply (LVPS).

For instructions: See the Repair Service Manual for this product.

Table 6-91 LVPS part numbers

Description	HP Part Number
RM3-7157-000CN	Low-voltage power supply (LVPS) 110V
RM3-7158-000CN	Low-voltage power supply (LVPS) 220V

59.WWX.YZ Error Messages

59.* errors

Errors in the 59.* family indicate a problem with one of the motors or with the lifter drive assembly for one of the trays.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Check all connections on the main control board of the printer, (DC controller, Engine control board ECB) each motor, and to the paper feeder drive PCA (for an optional paper feeder). Reseat them if necessary.

59.00.00 Motor error

Paper Path motor malfunction M5 pickup motor.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, then back on.


2. If the error persists, replace the Paper pick-up drive assembly - Geared assembly includes motor (M5)

Paper pick-up drive assembly Part number: RM2-0008-000CN

Recommended action for on-site technicians


Follow these troubleshooting steps in the order presented.

1. Turn the printer off, then back on.
2. Run the Tray 2 pickup motor test. Go to **Support Tools > Troubleshooting > Diagnostic Tests > Component Test** Select **Tray 2 pickup motor** then select **Start**.

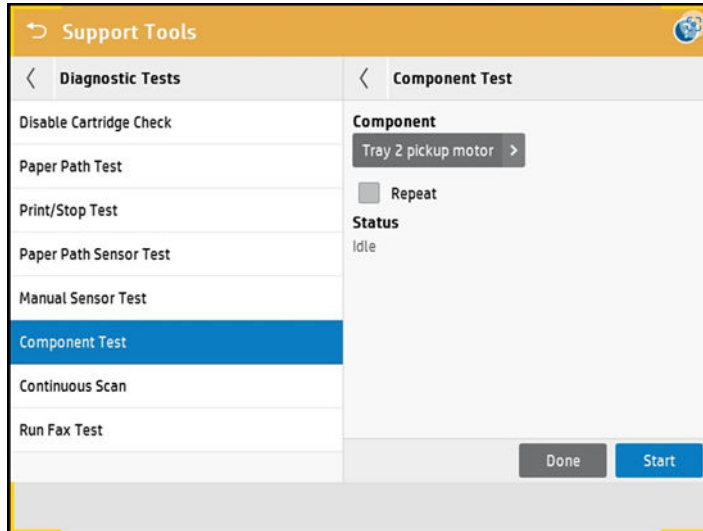

3. If the test fails, disconnect, and reconnect (J105) on the DC Controller and (J602 and J604) on the Low Voltage Power Supply.

Figure 6-96 DC controller PCA connections

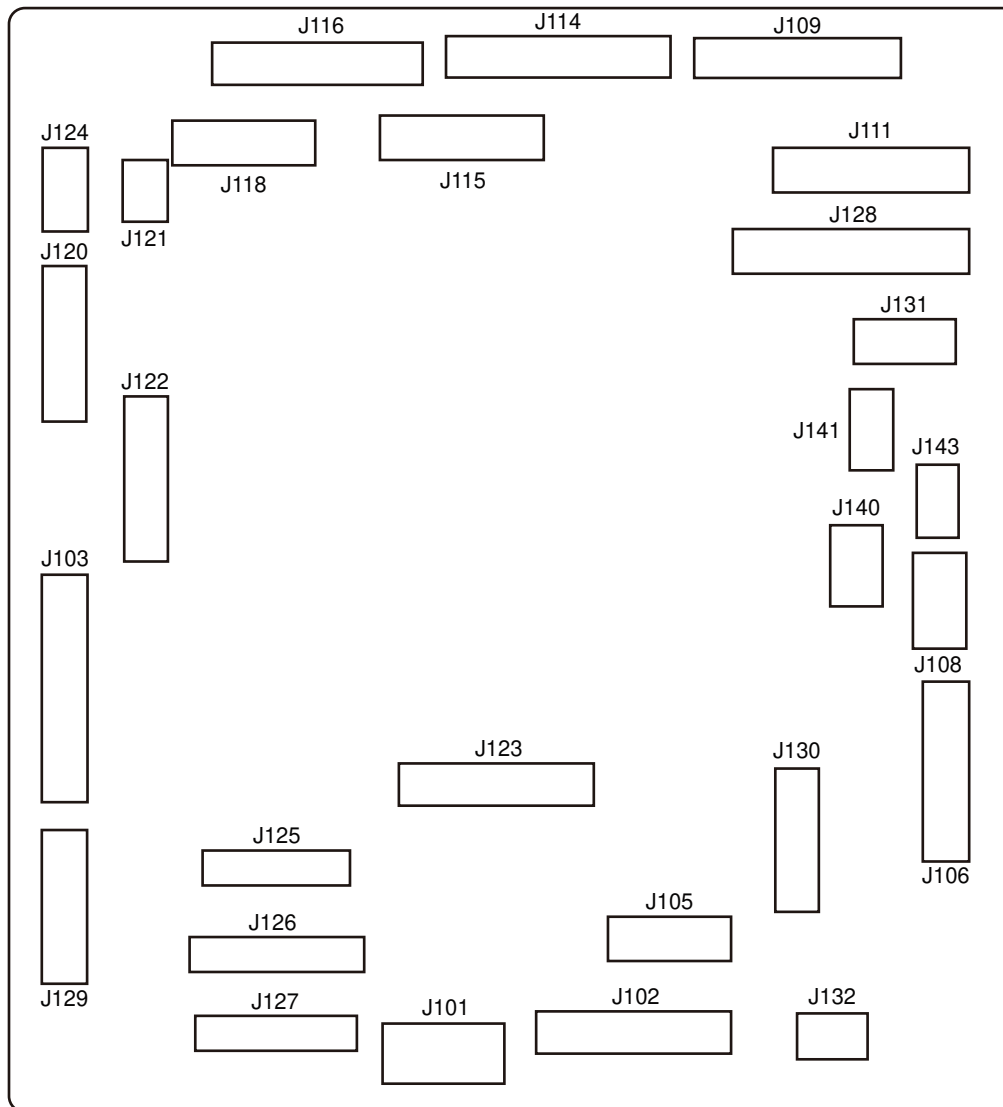

4. If the error persists, replace the paper pick-up drive assembly.
Part number: RM2-0008-000CN
5. If the error persists after the assembly has been replaced, replace the DC controller.

Table 6-92 Part number:

Description	HP Part Number
DC controller PCA assembly (M552, M553, E55040):	RM3-7450-000CN
DC controller PCA assembly (M577, E57540)	RM3-7451-000CN
DC controller (M554, M555):	RM3-8465-000CN
DC controller (M578):	RM3-8468-000CN

For instructions: See the Repair Service Manual for this product.

Refer the table below for the DC controller part numbers.

59.00.04 Duplex Motor error

Duplex motor M8 malfunction.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. See the following document to learn more about this error: [HP LaserJet Enterprise, HP PageWide Enterprise - 59.0X.YZ Errors](#)
2. Turn the printer off, disconnect the power cable from the printer and wait 1-minute before reconnecting power and turning the printer on.
3. Open the right door and inspect paper path for jams or obstructions and remove them as needed.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, then back on.
2. Turn the printer off, disconnect the power cable from the printer and wait 1-minute before reconnecting power and turning the printer on.
3. Open the right door and inspect paper path for jams or obstructions and remove them as needed.
4. If the error persists, replace the duplexing drive assembly.

Duplexing drive assembly, part number: RM2-0006-000CN

 **IMPORTANT:** Notes should be added for on-site technician to check the connectors on the DC controller for the specific motor before replacing any parts. This is especially important if any previous parts have been replaced.

Recommended action for on-site technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, disconnect the power cable from the printer and wait 1-minute before reconnecting power and turning the printer on.
2. Open the right door and inspect paper path for jams or obstructions and remove them as needed.
3. Run the duplex motor M8 drive test in the actuator drive mode to verify that the duplexing drive assembly is functioning properly. **Support Tools > Troubleshooting > Diagnostics > Component Tests > Duplex motor.**
4. If the test fails, remove, and reseal the connections between the duplexing drive assembly and the DC controller. Duplexing drive assembly connects to the HVPS-T first in connector J2503 (purple 4

wire cable) and HVPS-T connects to the DC controller in connector J109 (Flat Flexible cable). See the following pictures for reference.

Figure 6-97 HVPS-T connections, make sure all of them are removed and resealed



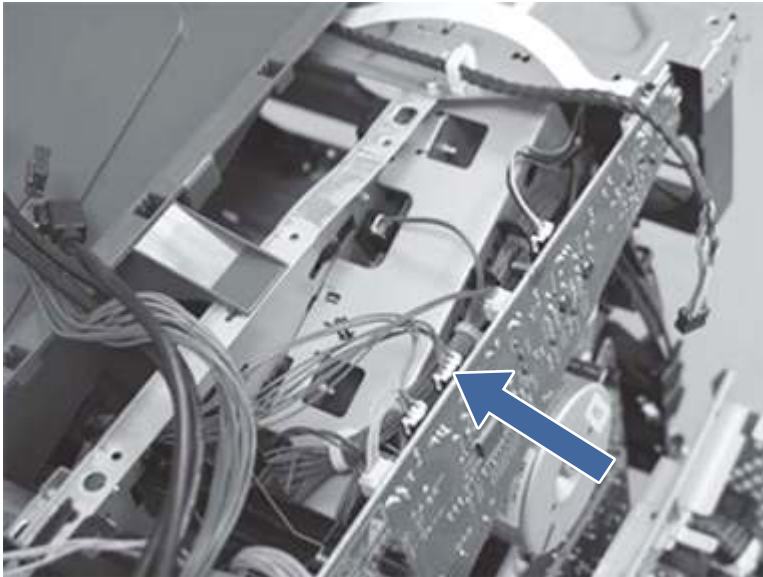


Figure 6-98 DC Controller connections (top right FFC is J109)

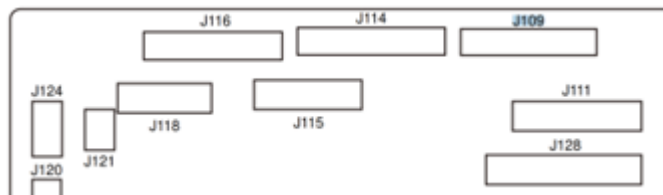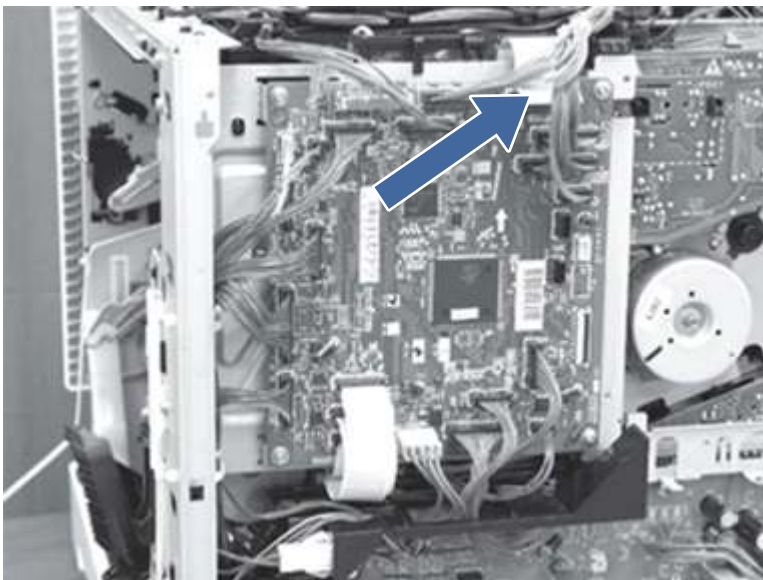

5. Retest the motor. If the test fails, replace the duplexing drive assembly.

Duplexing drive assembly, part number: RM2-0006-000CN

See the Repair Service Manual for this product.

6. If the error persists after the motor has been replaced, replace the DC controller.

Use the table below for the DC controller part number for your printer.

Table 6-93 Part number for DC controller

Description	HP Part Number
DC controller PCA assembly ((M552, M553, E55040)	RM3-7450-000CN
DC controller PCA assembly (M577, E57540)	RM3-7451-000CN
DC controller PCA assembly (M554, M555)	RM3-8465-000CN
DC controller PCA assembly (M578)	RM3-8468-000CN

For instructions: See the Repair Service Manual for this product.

59.00.30 or 59.00.40: Fuser error

Fuser motor (M4) start up error or fuser motor (M4) rotational error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. See the following document to learn more about this error: [HP LaserJet Enterprise, HP PageWide Enterprise - 59.OX.YZ Errors](#)
2. Turn the printer off, disconnect the power cable from the printer and wait 1-minute before reconnecting power and turning the printer on.
3. Open the right door and inspect paper path for jams or obstructions and remove them as needed.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, then back on.
2. Turn the printer off. Open the right door and remove the fuser.

 **CAUTION:** The fuser might be hot. Ensure to wait for the fuser to cool before removing it.

3. Rotate the fuser gear to ensure it moves freely. If it does not move freely, replace the fuser.


Table 6-94 Part Numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

4. If the fuser gear moves freely, run the fuser motor component test.
 - a. From the Home screen on the printer control panel, select [Support Tools](#).

- b. Open the following menus:
 - i. Troubleshooting
 - ii. Diagnostic Tests
 - iii. Component Test
- c. Select **Fuser motor**, and then select **Start**.

Figure 6-99 Fuser motor test

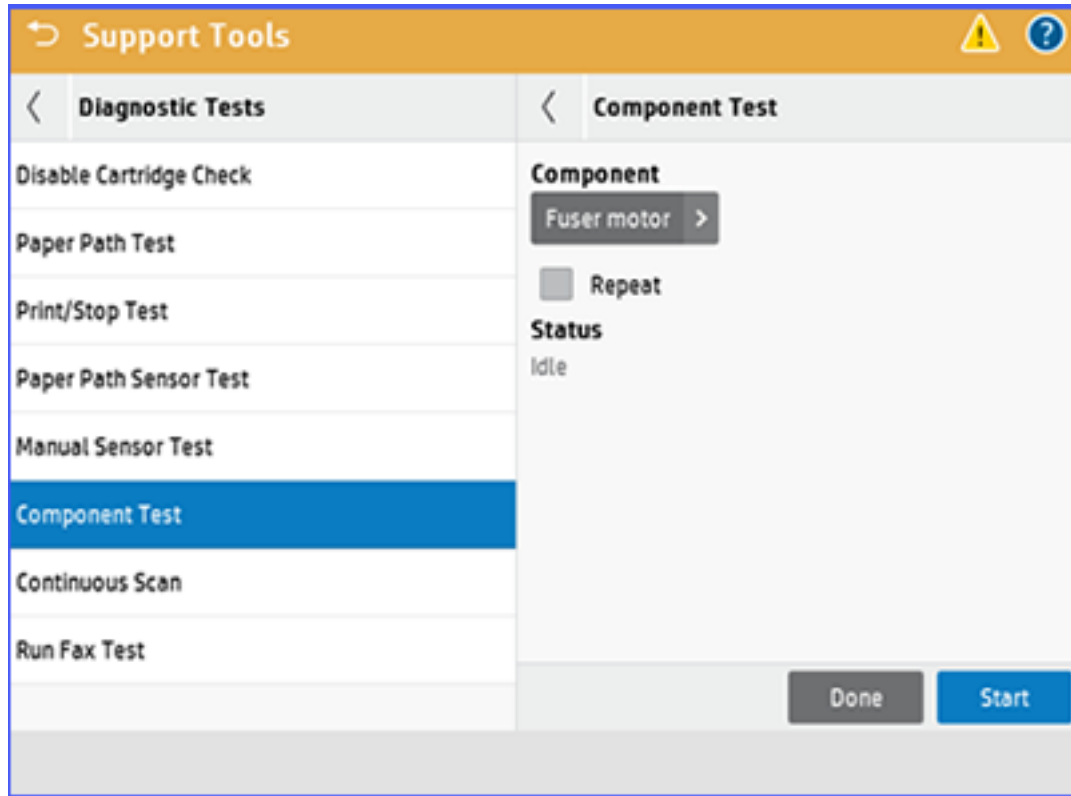

5. If the test fails, replace the fuser motor assembly (M4).
Fuser motor assembly (M4), part number: RM2-0077-000CN

Recommended action for on-site technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, then back on.
2. Turn the printer off. Open the right door and remove the fuser.

⚠ CAUTION: The fuser might be hot. Ensure to wait for the fuser to cool before removing it.
3. Rotate the fuser gear to ensure it moves freely. If it does not move freely, replace the fuser.

⚠ CAUTION: The fuser might be hot.

Table 6-95 Fuser kit


Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

For instructions: *Removal and replacement: Fuser*

See the Repair Service Manual for this product.


4. If the fuser gear moves freely, run the fuser motor component test.
 - a. From the Home screen on the printer control panel, select [Support Tools](#).
 - b. Open the following menus:
 - i. [Troubleshooting](#)
 - ii. [Diagnostic Tests](#)
 - iii. [Component Test](#)
 - c. Select [Fuser motor](#), and then select [Start](#).

Figure 6-100 Fuser motor test

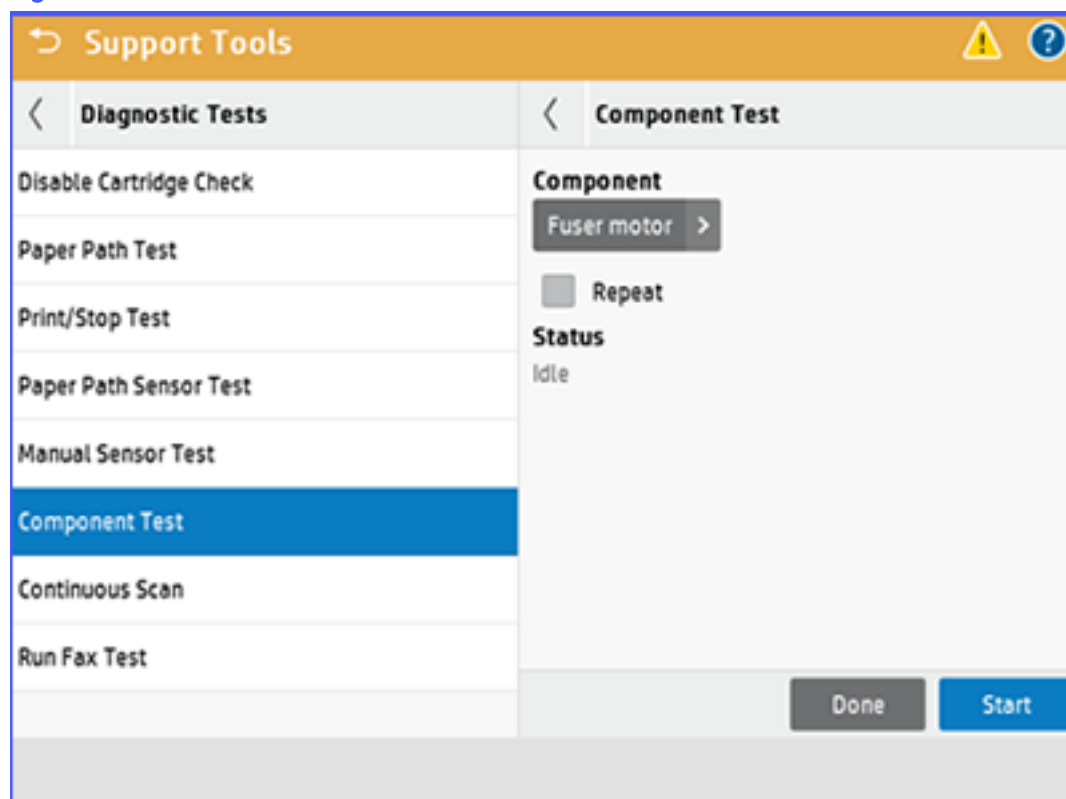

5. If the test fails, disconnect, and reconnect (J114) on the DC Controller and the fuser motor connection (J44).

Figure 6-101 DC controller PCA connections

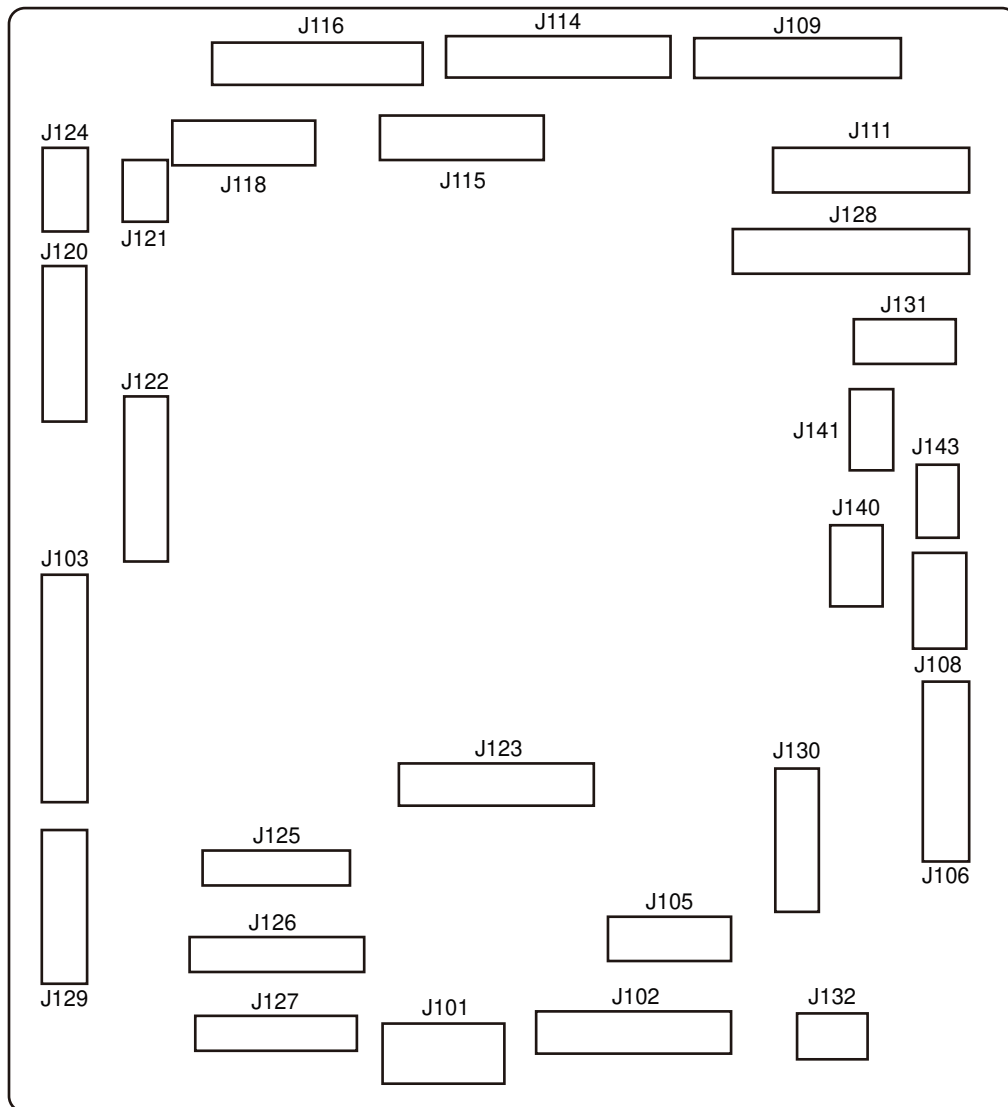

IMPORTANT: Before replacing any parts, check the connectors on the DC controller and LVPS for the specified motor. This is especially important if any previous parts have been replaced.

Reconnect the connector (J44) of the fuser motor and connector (J114) on the DC controller PCA.

Part number: RM2-0077-000CN

6. Repeat the fuser motor component test (Step 4) to test functionality of the M4 motor.
7. If the issue persists, replace the fuser motor assembly (M4).

Fuser motor assembly (M4), part number: RM2-0077-000CN

See the Repair Service Manual for this product.

8. When replacing the fuser motor, if damaged gears are seen on the fuser drive assembly, replace the fuser drive assembly.

Part number:

Table 6-96 Fuser drive assembly

Description	HP Part Number
Fuser drive assembly (M552dn, M553dn, M553x, M577)	RM2-0009-000CN
Fuser drive assembly (M553n)	RM2-0091-000CN

See the Repair Service Manual for this product.

9. If the error persists after the motor has been replaced, replace the DC controller.

Use the table below when replacing the DC controller part number for your printer.

Table 6-97 Part number for DC controller

Description	HP Part Number
DC controller PCA assembly ((M552, M553, E55040)	RM3-7450-000CN
DC controller PCA assembly (M577, E57540)	RM3-7451-000CN
DC controller PCA assembly (M554, M555)	RM3-8465-000CN
DC controller PCA assembly (M578)	RM3-8468-000CN

For instructions: See the Repair Service Manual for this product.

59 . 00 . B0 Replace Toner Collection Unit

The toner collection unit (TCU) is full.

Recommended action

Follow these troubleshooting steps in the order presented.

- Check the toner collection unit. If the unit is full, replace it.

Part number: B5L37-67901



NOTE: Toner can clog the ITB if the toner collection unit is full.

59 . 00 . C0

Developer disengagement motor (M6) error

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Go to the following document to learn more: [HP LaserJet Enterprise, HP PageWide Enterprise - 59.0X.YZ Errors](#).

2. Turn the printer off, disconnect the power cable from the printer and wait 1-minute before reconnecting power and turning the printer on.
3. Remove each Toner Cartridge. Reinstall Cartridges, one at a time, closing the cover each time. If the error occurs only after a specific Toner Cartridge is installed, replace cartridge.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, disconnect the power cable from the printer and wait 1-minute before reconnecting power and turning the printer on.
2. Remove each Toner Cartridge. Reinstall Cartridges, one at a time, closing the cover each time. If the error occurs only after a specific Toner Cartridge is installed, replace cartridge.
3. If the error persists with all Toner Cartridges removed, dispatch the duplexing drive assembly.



IMPORTANT: Notes should be added for on-site technician to check the connectors on the DC controller (J132) for the specific motor (J46) before replacing any parts. This is especially important if any previous parts have been replaced.

Developing disengagement motor (M6), part number: RK2-6027-000CN

Recommended action for on-site technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, disconnect the power cable from the printer and wait 1-minute before reconnecting power and turning the printer on.
2. Remove each Toner Cartridge. Reinstall Cartridges, one at a time, closing the cover each time. If the error occurs only after a specific Toner Cartridge is installed, replace cartridge.
3. If the error persists with all Toner Cartridges removed, Run the fuser pressure release motor (developer disengagement) test in the actuator drive mode to verify that the developer alienation drive is functioning correctly. **Troubleshooting > Diagnostic Tests > Component Test > Fuser Pressure Release Motor (M6)**
4. If the error still occurs and/or the test still fails, replace the developer disengagement motor M6.




IMPORTANT: Before replacing any parts, check the connectors on the DC controller and LVPS for the specified motor. This is especially important if any previous parts have been replaced. Reconnect the connector (J46) of developer disengagement motor M6 and connector (J132) on the DC controller PCA (Bottom right corner).

Part number: RK2-6027-000CN

See the Repair Service Manual for this product.

Figure 6-102 DC controller PCA connections

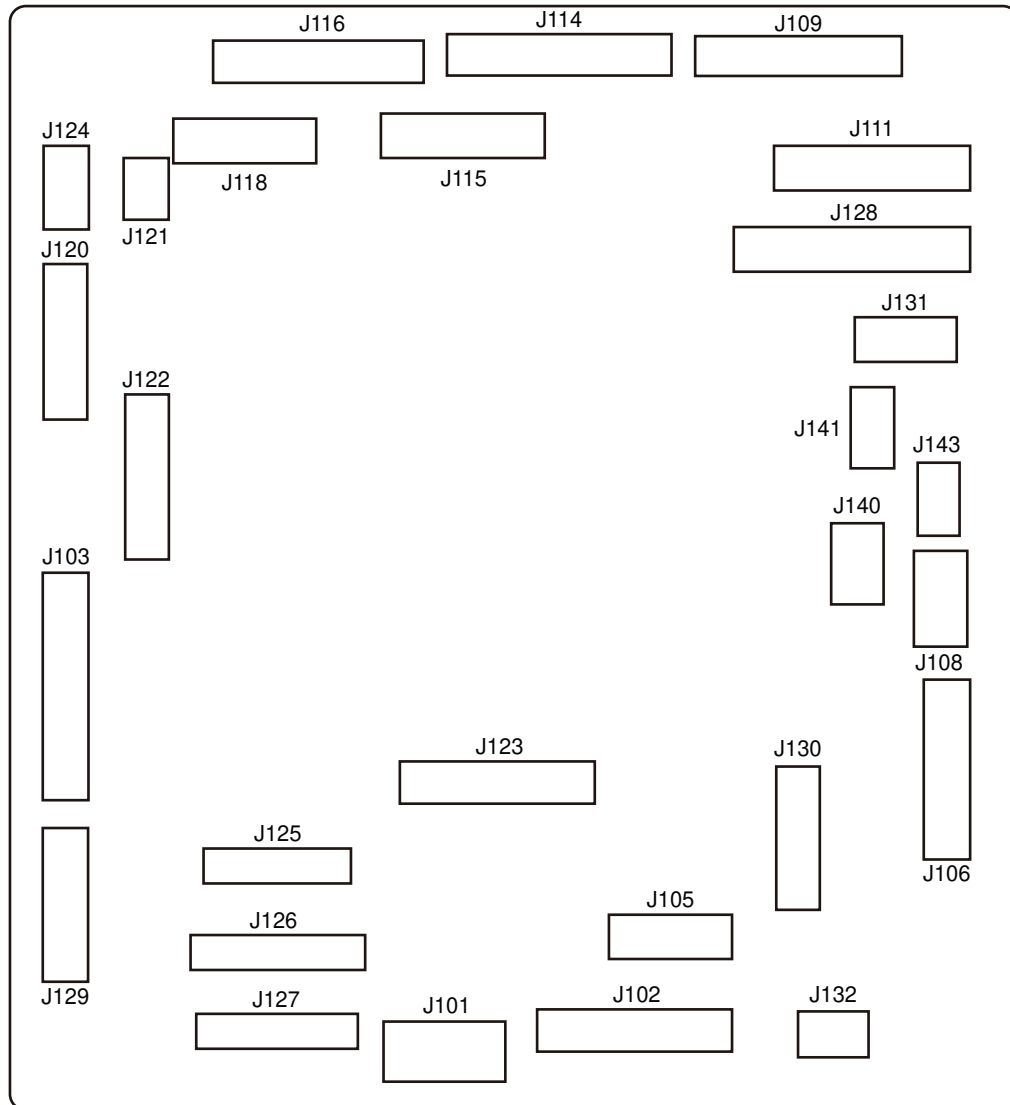

Check connection J132 in bottom left corner.

59.00.F0

T1 alienation mechanism failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

- See the following document to learn more about this error: [HP LaserJet Enterprise, HP PageWide Enterprise - 59.OX.YZ Errors](#).

Recommended action for call agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, then back on.
2. Ensure that the ITB is correctly installed.

3. If this issue occurs out to the box, **STOP**. Replace the unit.
4. If the error occurs 30 days after install, use the manual sensor test to verify that the T1 roller alienation sensor (SR5) is correctly functioning. If the test fails, replace the T1 roller estrangement detect PCA assembly.



NOTE: SR5 is attached to the estrangement detect PCB assembly.

Add notes for on-site technician to check if the PCA assembly is properly installed. You can also check this with on-site technicians and knowledgeable customers.

Part number: RM2-7157-000CN

5. Use the component tests T1 roller engagement and disengagement drive test to verify that the T1 roller disengagement mechanism is correctly functioning. If the test fails, remove the ITB and manually actuate the alienation mechanism. If it fails, replace the ITB. If the ITB is working correctly, replace the fuser drive assembly.

For instructions: *Removal and replacement: ITB*

Part number, ITB: RM2-6576-000CN

Part number:

Table 6-98 Part numbers

Description	HP Part Number
Fuser drive assembly (M552dn, M553dn, M553x, M577)	RM2-0009-000CN
Fuser drive assembly (M553n)	RM2-0091-000CN

Recommended action for on-site technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, then back on.
2. Ensure that the ITB is correctly installed.
3. If this issue occurs out to the box, **STOP**. Replace the unit.
4. Use the manual sensor test to verify that the T1 roller alienation sensor (SR5) is correctly functioning. If the test fails, replace the T1 roller estrangement detect PCA assembly.

Part number: RM2-7157-000CN



NOTE: SR5 is attached to the estrangement detect PCB assembly.

Check to see if the PCA assembly is properly installed, see step 6.

5. Use the component tests T1 roller engagement and disengagement drive test to verify that the T1 roller disengagement mechanism is correctly functioning. If the test fails, remove the ITB and manually actuate the alienation mechanism. If it fails, replace the ITB. If the ITB is working correctly, replace the fuser drive assembly.

For instructions: *Removal and replacement: ITB*

Part number, ITB: RM2-6576-000CN

Table 6-99 Part numbers

Description	HP Part Number
Fuser drive assembly (M552dn, M553dn, M553x, M577)	RM2-0009-000CN
Fuser drive assembly (M553n)	RM2-0091-000CN


 **IMPORTANT:** **DO NOT** replace ITB for a 59.00.F0 on this product unless you physically see damage to the ITB.

6. Reconnect the connector (J15) of the T1 roller alienation sensor, connectors (J2504 and J2502) on the high-voltage power supply -T PCA and connector (J131) on the DC controller PCA.

 **IMPORTANT:** Before replacing any parts, check the connectors on the DC controller PCA and other PCAs for the specified motor or assembly. This is especially important if any previous parts have been replaced.


7. Use the following steps and images for reference. Check the PCA sensor and the black plastic housing that detects the ITB to ensure they are installed correctly.
 - a. Locate the sensor for the ITB on the right side of the printer (remove the fuser and it is directly behind it on the right side).

Figure 6-103 ITB Detect PCA housing

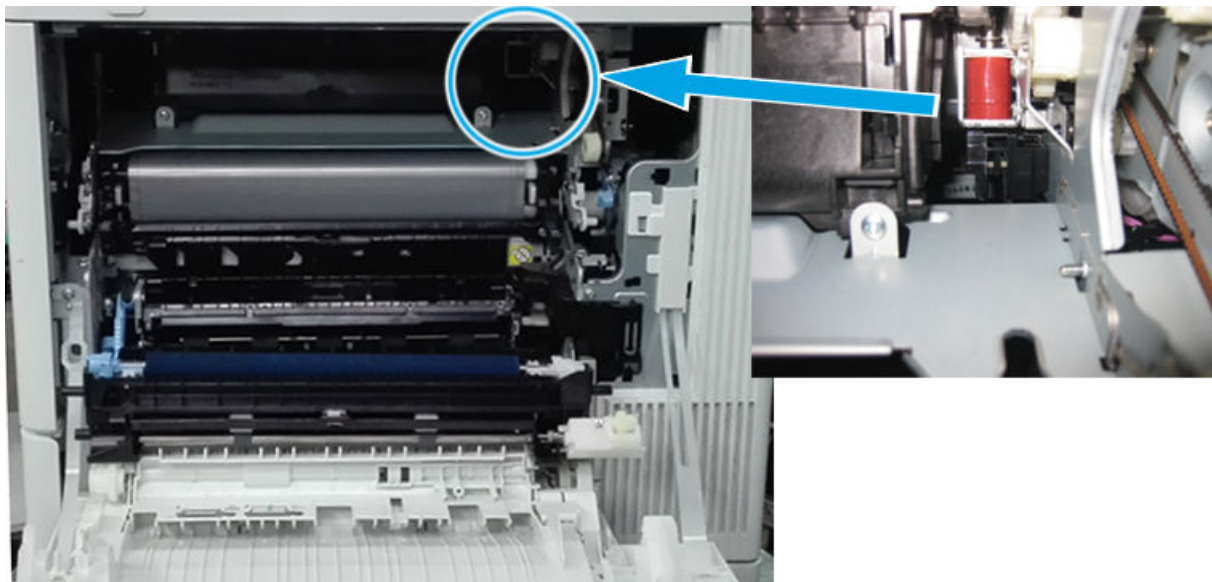

- b. Close up image of the right showing the small PCA that the sensor is mounted to. This PCA must be parallel with the bottom of the solenoid. If it is skewed or tilted in any angle and not parallel, this part needs to be removed and the PCA re-seated in the plastic housing correctly.

Figure 6-104 PCA housing correctly mounted

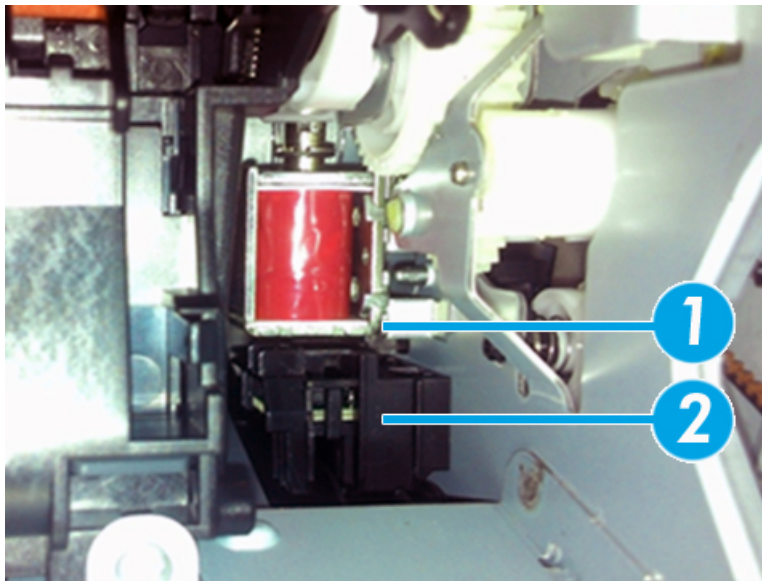


Callout 1 Solenoid base

Callout 2 PCA with sensor

The PCA must be parallel with the solenoid base as shown in the image

Figure 6-105 Close up of PCA not mounted incorrectly

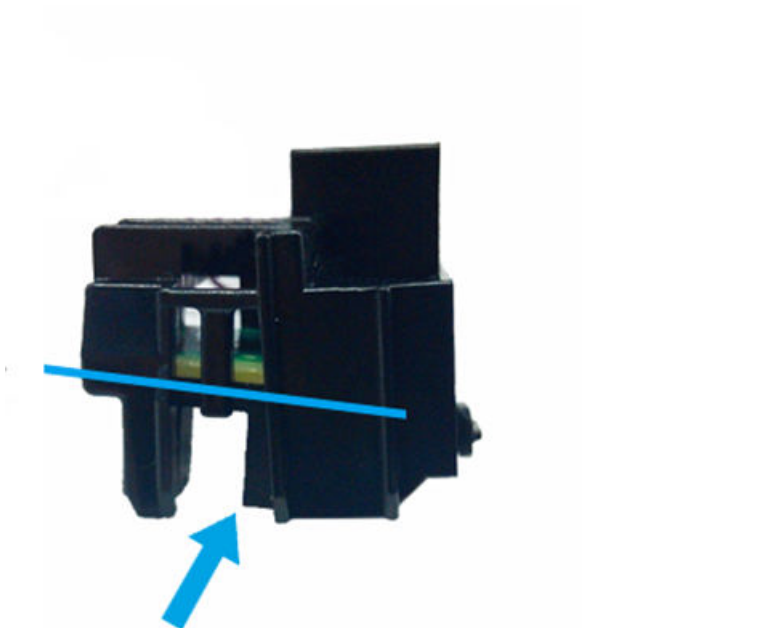

If the PCA is tilted, re-engage the retaining clips of T1 alienation sensor board.

- c. Open the front door and remove the black and cyan toner cartridges.
- d. Open the right door and remove the fuser and the ITB unit.

- e. From either the inside area where the cartridges were removed or from the right slide, press the sensor board up by finger to engage the retaining tabs on the board.

Figure 6-106 Push up on sensor board


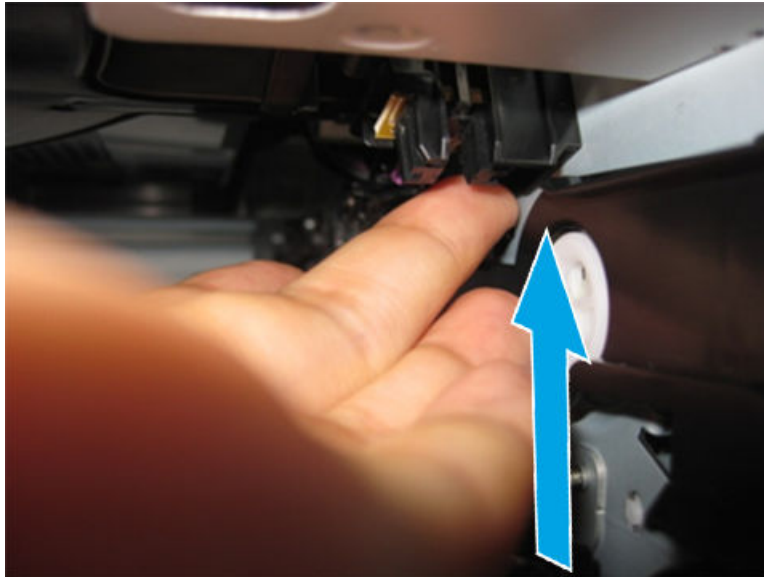


Figure 6-107 Close up view of sensor board

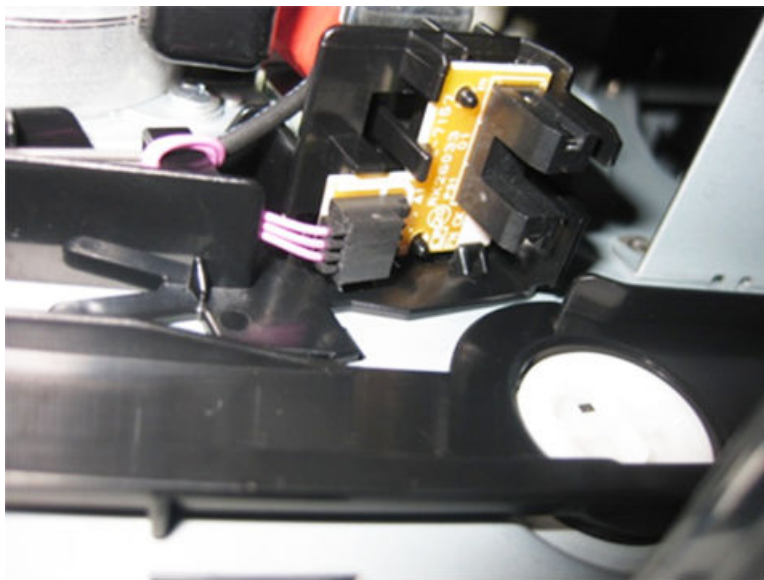

- f. Check that the holder is now seated correctly.
 - g. Install the fuser unit, ITB unit and the toner cartridges. Close the front and right doors.
8. If the previous procedures and all areas check out good and do not resolve the issue, replace the fuser drive assembly.

59.05.50 or 59.05.60

The printer experienced a black drum motor (M3) error.

- **59.05.50** Black drum motor startup abnormality.

- **59.05.60** Black drum motor rotation abnormality.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

- See the following document to learn more about this error: [HP LaserJet Enterprise, HP PageWide Enterprise - 59.OX.YZ Errors](#)

Recommended action for call agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove the black toner cartridge and turn the printer on.
3. Use the [Disable Cartridge](#) check and run the drum motor component test with the toner cartridge removed.
 - If the test passes, replace the black cartridge.
 - If the test fails, replace the drum motor M3.

Part number: RM2-0078-000CN



IMPORTANT: Notes should be added for on-site technician to check the connectors on the DC controller for the specific motor before replacing any parts. This is especially important if any previous parts have been replaced.

Recommended action for on-site technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove the black toner cartridge and turn the printer on.
3. Use the [Disable Cartridge](#) check and run the drum motor component test with the toner cartridge removed.
 - If the test passes, replace the black cartridge. If the printer has been serviced, check the connector at the drum motor assembly and the DC controller.
 - If the test fails, replace the drum motor.

Part number: RM2-0078-000CN



IMPORTANT: Reconnect the connector (J43) of the drum motor 3 and connector (J130) on the DC controller PCA.

59.06.50 or 59.06.60 – 59.07.50 or 59.07.60

The printer experienced a cyan/magenta drum motor (M2) error.

- **59.05.50** Cyan/magenta drum motor startup abnormality.
- **59.05.60** Cyan/magenta drum motor rotation abnormality.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

- See the following document to learn more about this error: [HP LaserJet Enterprise, HP PageWide Enterprise - 59.OX.YZ Errors](#).

Recommended action for call agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove the cyan and magenta toner cartridges and turn the printer on.
3. Use the [Disable Cartridge](#) check and run the drum motor component test with the toner cartridges removed.
 - If the test passes, check each toner cartridge to see if its drum can be rotated by the drive gear.
Replace the defected toner cartridge.
 - If the test fails, replace the drum motor M2.
Part number: RM2-0078-000CN

 **IMPORTANT:** Notes should be added for on-site technician to check the connectors on the DC controller for the specific motor before replacing any parts. This is especially important if any previous parts have been replaced.

Recommended action for on-site technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove the cyan and magenta toner cartridges and turn the printer on.
3. Use the [Disable Cartridge](#) check and run the drum motor component test with the toner cartridges removed.
 - If the test passes, check each toner cartridge to see if its drum can be rotated by the drive gear. check the connector at the drum motor assembly and the DC controller.
Replace the defected toner cartridge.
 - If the test fails, replace the drum motor.
Part number: RM2-0078-000CN

 **IMPORTANT:** Reconnect the connector (J42) of the drum motor 2 and connector (J111) on the DC controller PCA.

59.08.50 or 59.08.60

The printer experienced a yellow drum motor (M1) error.

- **59.05.50** Yellow drum motor startup abnormality.

- **59.05.60** Yellow drum motor rotation abnormality.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

- See the following document to learn more about this error: [HP LaserJet Enterprise, HP PageWide Enterprise - 59.OX.YZ Errors](#).

Recommended action for call agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove the yellow toner cartridge and turn the printer on.
3. Use the [Disable Cartridge](#) check and run the drum motor component test with the toner cartridge removed.
 - If the test passes, replace the yellow toner cartridge.
 - If the test fails, replace the drum motor M1.

Part number: RM2-0078-000CN



IMPORTANT: Notes should be added for on-site technician to check the connectors on the DC controller for the specific motor before replacing any parts. This is especially important if any previous parts have been replaced.

Recommended action for on-site technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove the yellow toner cartridge and turn the printer on.
3. Use the [Disable Cartridge](#) check and run the drum motor component test with the toner cartridge removed.
 - If the test passes, replace the yellow toner cartridge.
 - If the test fails, replace the drum motor M1.

Part number: RM2-0078-000CN



IMPORTANT: Reconnect the connector (J41) of the drum motor 1 and connector (J111) on the DC controller PCA.

60.00.0Y, 62.00.0Y Error Messages

60.* errors

Errors in the 60.* family are related to one of the optional trays.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.



NOTE: You can determine the tray number from the last digit in the error number. For example:

- 60.00.02 or 60.01.02 = Tray 2
- 60.00.03 or 60.01.03 = Tray 3

1. Open the failing tray and remove all paper from the tray.
2. Close the tray to check if the error persists.
3. Reload the paper and test the printer.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Use the [Tray/Bin Manual Sensor](#) test to verify that the sensors for each tray are functioning correctly.
2. Check all connectors on the paper feeder PCA.
3. Replace the optional paper feeder.

62 . 00 . 00 No system To continue turn off then on

The printer experienced an internal system failure.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, then on.
2. If the error persists, reload the firmware. If the error still persists, perform a firmware upgrade.
3. If the firmware upgrade does not resolve the problem, replace the hard disk (HDD).



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-100 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41616-011

Table 6-100 HDD part numbers (continued)

Description	Part number
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

70.WX.YZ Error Messages

70.* errors

Messages in the 70.* family indicate a problem with the DC controller or Formatter (ECB) depending on your printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Replace the DC controller or the Formatter as needed.

70 . 00 . 00 Error To continue turn off then on

DC controller failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, replace the DC controller.



IMPORTANT: Notes should be added for on-site technician to check all the connectors on the DC controller before replacing any parts. This is especially important if any previous parts have been replaced.

Table 6-101 Part number:

Description	HP Part Number
DC controller PCA assembly (M552, M553, E55040):	RM3-7450-000CN
DC controller PCA assembly (M577, E57540)	RM3-7451-000CN
DC controller (M554, M555):	RM3-8465-000CN
DC controller (M578):	RM3-8468-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, disconnect and reconnect all the cables on the DC controller.
3. If the error persists, replace the DC controller.

Table 6-102 Part number:

Description	HP Part Number
DC controller PCA assembly (M552, M553, E55040):	RM3-7450-000CN
DC controller PCA assembly (M577, E57540)	RM3-7451-000CN
DC controller (M554, M555):	RM3-8465-000CN
DC controller (M578):	RM3-8468-000CN

For instructions: See the Repair Service Manual for this product.

80.WX.YZ, 81.WX.YZ, 82.WX.YZ Error Messages

80.* errors

Errors in the 80.* family indicate a problem with an external I/O device, such as a Jetdirect card, an EIO card, or an external hard disk.

- **80.00.00 error:** Managed device lost connection to service provider. The product is under a service contract and has lost network connectivity for license validation.
- **80.01.01 error:** HP Accessibility Assistant connection error. Managed device is unable to establish a connection with the HP Accessibility Assistant.
- **80.01.02 error:** Managed Device Unknown HP Accessibility Assistant error.
- **80.01.03 error:** HP Accessibility Assistant connection lost. The product lost communication with the HP Accessibility Assistant.

- **80.01.04 error:** HP Accessibility Assistant disconnected. The HP Accessibility Assistant was disconnected from the product.
- **80.01.05 error:** HP Accessibility Assistant detected. Restart required. The HP Accessibility Assistant was connected to the product after turn on. The HP Accessibility Assistant is not a plug-and-play device.

Recommended action for customers

Customer actions for 80.* errors.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. Reload the printer firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call center agents

Call center agent actions for 80.* errors.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. If the error persists, perform a [Partial Clean](#) procedure using the [Preboot](#) menu.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: [HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#)*.

- a. Turn the printer on.
 - b. Press the HP logo that displays in the middle of the screen when you see the [1/8](#) under the logo.
 - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Partial Clean](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Press the back button once to highlight [Continue](#), and then press the [OK](#) button.
 - g. The printer automatically initializes and then returns to a Ready state.
4. If the error persists, perform a [Format Disk](#) procedure using the [Preboot](#) menu, and then upgrade the firmware to the latest version.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state

drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

- a. Turn the printer on.
 - b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
 - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Format Disk](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Wait for the printer to automatically initialize. The message **99.09.67** appears on the control panel.
 - g. Reload the firmware using a USB flash drive. See [99.09.67 error](#) for more information.
5. If the error persists, dispatch an onsite technician (no replacement parts required).

Recommended action for call center agents

Call center agent actions for 80.* errors.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. If the error persists, perform a [Partial Clean](#) procedure using the [Preboot](#) menu.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

- a. Turn the printer on.
 - b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
 - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Partial Clean](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Press the back button once to highlight [Continue](#), and then press the [OK](#) button.
 - g. The printer automatically initializes and then returns to a Ready state.
4. If the error persists, perform a [Format Disk](#) procedure using the [Preboot](#) menu, and then upgrade the firmware to the latest version.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

- a. Turn the printer on.

- b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
- c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
- d. Press the down arrow button to highlight [Format Disk](#), and then press the [OK](#) button.
- e. Press the [OK](#) button again.
- f. Wait for the printer to automatically initialize. The message **99.09.67** appears on the control panel.
- g. Reload the firmware using a USB flash drive. See [99.09.67 error](#) for more information.

82.* errors

Errors in the 82.* family indicate a problem with an external I/O device, such as a Jetdirect card, an EIO card, or an external hard disk.

- **82.00.00 error:** Memory Error.
- **82.73.45 error:** Memory Error. Disk successfully cleaned. Event log only.
- **82.73.46 error:** Memory Error. A hard disk or compact flash disk cleaning failed. Usually caused by a failure of the disk hardware. Event log only.
- **82.73.47 error:** Memory Error. Some of sanitized disk did not correctly verify. Event log only.

Recommended action for customers

Customer actions for 80.* errors.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. Reload the printer firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call center agents

Call center agent actions for 80.* errors.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. If the error persists, perform a [Partial Clean](#) procedure using the [Preboot](#) menu.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: [HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#)*.

- a. Turn the printer on.
 - b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
 - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Partial Clean](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Press the back button once to highlight [Continue](#), and then press the [OK](#) button.
 - g. The printer automatically initializes and then returns to a Ready state.
4. If the error persists, perform a [Format Disk](#) procedure using the [Preboot](#) menu, and then upgrade the firmware to the latest version.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: [HP LaserJet Enterprise](#), [HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#).*

- a. Turn the printer on.
 - b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
 - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Format Disk](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Wait for the printer to automatically initialize. The message **99.09.67** appears on the control panel.
 - g. Reload the firmware using a USB flash drive. See [99.09.67 error](#) for more information.
5. If the error persists, dispatch an onsite technician (no replacement parts required).

[Recommended action for call center agents](#)

Call center agent actions for 80.* errors.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. If the error persists, perform a [Partial Clean](#) procedure using the [Preboot](#) menu.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: [HP LaserJet Enterprise](#), [HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#).*

- a. Turn the printer on.
- b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.

- c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Partial Clean](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Press the back button once to highlight [Continue](#), and then press the [OK](#) button.
 - g. The printer automatically initializes and then returns to a Ready state.
4. If the error persists, perform a [Format Disk](#) procedure using the [Preboot](#) menu, and then upgrade the firmware to the latest version.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: [HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#).*

- a. Turn the printer on.
- b. Press the HP logo that displays in the middle of the screen when you see the [1/8](#) under the logo.
- c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
- d. Press the down arrow button to highlight [Format Disk](#), and then press the [OK](#) button.
- e. Press the [OK](#) button again.
- f. Wait for the printer to automatically initialize. The message **99.09.67** appears on the control panel.
- g. Reload the firmware using a USB flash drive. See [99.09.67 error](#) for more information.

80 . 0x . yz Embedded Jetdirect Error

An Embedded HP JetDirect print server critical error has occurred.

- 80 . 01 . 80 (event log) No heartbeat
- 80 . 01 . 81 (event log) Reclaim time-out
- 80 . 01 . 82 (event log) Invalid data length
- 80 . 01 . 8B (event log) Invalid max outstanding packet header field
- 80 . 01 . 8C (event log) Invalid channel mapping response
- 80 . 03 . 01 (event log) No PGP buffers
- 80 . 03 . 02 (event log) Channel table full
- 80 . 03 . 03 (event log) Producer index not reset
- 80 . 03 . 04 (event log) Consumer index not reset
- 80 . 03 . 05 (event log) Queue position size too small
- 80 . 03 . 06 (event log) Transport overflow

- 80 . 03 . 07 (event log) No overflow packets
- 80 . 03 . 08 (event log) Invalid identify response
- 80 . 03 . 09 (event log) Invalid channel map return status
- 80 . 03 . 10 (event log) Invalid reclaim return status
- 80 . 03 . 12 (event log) Datagram invalid buffer
- 80 . 03 . 13 (event log) Max stream channels
- 80 . 03 . 14 (event log) Max datagram channels
- 80 . 03 . 15 (event log) Card reset failed
- 80 . 03 . 16 (event log) Self-test failure
- 80 . 03 . 17 (event log) Unknown PGP packet
- 80 . 03 . 18 (event log) Duplicate I/O channel

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove the RJ45 network cable.
3. Turn the printer on.
4. Reconnect the RJ45 network cable. If the error is present only with RJ45 cable connected, try another cable or check the network settings.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Remove the RJ45 cable.
3. Turn the printer off, and then on.
4. Reconnect the RJ45 cable. If the error is present only with RJ45 cable connected, have the customer try another cable or check the network settings.
5. If the error persists, replace the formatter.

Table 6-103 Part numbers

Description	HP Part Number
Formatter (M552 models only)	B5L23-67903
Formatter (M552 models only)(India and China)	B5L23-67904

Table 6-103 Part numbers (continued)

Description	HP Part Number
Formatter (M553n, M553dn, M553dh)	B5L24-67909
Formatter (M553n, M553dn, M553dh)(India and China)	B5L24-67908
Formatter (M553x models only)	B5L26-67901
Formatter (M553x models only)(India and China)	B5L26-67902
Formatter (M577, E57540 models only)	B5L46-67909
Formatter (M577 models only)(India and China)	B5L46-67911

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove the RJ45 network cable.
3. Turn the printer on.
4. Reconnect the RJ45 cable. If the error is present only with RJ45 cable connected, have the customer try another cable or check the network settings.
5. If the error persists, replace the formatter.

Table 6-104 Part numbers

Description	HP Part Number
Formatter (M552 models only)	B5L23-67903
Formatter (M552 models only)(India and China)	B5L23-67904
Formatter (M553n, M553dn, M553dh)	B5L24-67909
Formatter (M553n, M553dn, M553dh)(India and China)	B5L24-67908
Formatter (M553x models only)	B5L26-67901
Formatter (M553x models only)(India and China)	B5L26-67902
Formatter (M577, E57540 models only)	B5L46-67909
Formatter (M577 models only)(India and China)	B5L46-67911

For instructions: See the Repair Service Manual for this product.

For instructions: See the Repair Service Manual for this product.

81 . wx . yz EIO Error To continue turn off then on

An external I/O card has failed on the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.

2. Remove the RJ45 network cable.
3. Turn the printer on.
4. Reconnect the RJ45 network cable. If the error is present only with RJ45 cable connected, try another cable or check the network settings.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove the RJ45 network cable.
3. Turn the printer on.
4. Reconnect the RJ45 network cable.

If the error is present only with RJ45 cable connected, have the customer try another cable or check the network settings.

5. If the error persists without the network cable connected, replace the formatter.

Table 6-105 Part numbers

Description	HP Part Number
Formatter (M552 models only)	B5L23-67903
Formatter (M552 models only)(India and China)	B5L23-67904
Formatter (M553n, M553dn, M553dh)	B5L24-67909
Formatter (M553n, M553dn, M553dh)(India and China)	B5L24-67908
Formatter (M553x models only)	B5L26-67901
Formatter (M553x models only)(India and China)	B5L26-67902
Formatter (M577, E57540 models only)	B5L46-67909
Formatter (M577 models only)(India and China)	B5L46-67911

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove the RJ45 network cable.
3. Turn the printer on.
4. Reconnect the RJ45 cable.

If the error is present only with RJ45 cable connected, have the customer try another cable or check the network settings.

5. If the error persists without the network cable, replace the formatter.

Table 6-106 Part numbers

Description	HP Part Number
Formatter (M552 models only)	B5L23-67903
Formatter (M552 models only)(India and China)	B5L23-67904
Formatter (M553n, M553dn, M553dh)	B5L24-67909
Formatter (M553n, M553dn, M553dh)(India and China)	B5L24-67908
Formatter (M553x models only)	B5L26-67901
Formatter (M553x models only)(India and China)	B5L26-67902
Formatter (M577, E57540 models only)	B5L46-67909
Formatter (M577 models only)(India and China)	B5L46-67911

For instructions: See the Repair Service Manual for this product.

For instructions: See the Repair Service Manual for this product.

81.09.00 Error

Internal Jetdirect Inside Networking event.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technician

Follow these troubleshooting steps in the order presented.

1. Verify that the issue occurs with the latest version of firmware.
 - a. Obtain the latest public firmware version for the device from hp.com.
 - b. Update the device firmware.
 - c. The device will reboot during the firmware update process.
 - d. If available (from HP Advance Technical Support), obtain the latest interim version of firmware to perform the same update test.
 - e. If the issue persists, continue with the next troubleshooting step.
2. Verify that the issue occurs when the device has the latest firmware and is not connected to the network.
 - a. Disconnect the network cable from the network I/O port on the device.
 - b. Turn the printer off, and then on.

- c. If the error persists, continue with the next troubleshooting step.
3. Verify that the issue occurs when disconnected from the network and with default configuration.
 - a. Run a partial clean.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*
 - b. If the error persists, continue with the next troubleshooting step.
4. **Call center agents:** Dispatch an onsite technician to re-establish the trusted platform module state in the printer.

 **IMPORTANT:** Never replace the TPM on a unit that shipped with one. The TPM that can be ordered is only available for adding a level of security on a device that never had a TPM paired from the factory. A new TPM cannot be installed for security reasons.

82.73.46, 82.73.47

A hard disk or compact flash disk cleaning failed.

This error is usually caused by a failure of the disk hardware.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the product off, and then on.
2. Reload the printer firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Use the [Format Disk](#) item in the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

3. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

90.WX.YZ error messages

90.* errors

Errors in the 90.* family are related to the control panel.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, dispatch an onsite technician.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off by holding down the power button for at least 10 seconds.
2. Check the connectors on the control panel. Reseat them if necessary.
3. If the HDMI cable between the formatter and the control panel is found to be damaged, Replace the HDMI cable.

Part number: RK2-6064-000CN
4. Turn the printer on. If the status LED on the formatter is yellow instead of green, the control panel might be defective. Replace the control panel.

90.15.00

The video interface has been detected.

Communication with the control panel has been detected.

This message is a normal part of booting up and establishing communication with the control panel.

Recommended action

There is no action needed for this message.

- No action necessary.

90.15.01

The video interface has **NOT** been detected.

Communication with the control panel has not been established in the expected time frame. The control panel likely will not display correctly.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Turn the printer off by holding down the power button for at least 10 seconds.
3. Ensure that the control panel connectors on control panel are correctly seated.
4. If the HDMI cable between the formatter and the control panel is found to be damaged, Replace the HDMI cable.

Part Number: RK2-6064-000CN

5. Turn the printer on. If formatter status LED is yellow, the control panel may be defective.
6. Replace the control panel.

For instructions: *Removal and replacement: Control Panel (M577)*, *Removal and replacement: Control Panel (M553)*

Table 6-107 Part number:

Description	HP Part Number
Control panel assembly (M553x)	B5L24-67903
Control panel assembly (M552dn, M553n, M553dn)	RM2-7180-000CN

98.0X.0Y Error Messages

98.* errors

Errors in the 98.* family are related to data corruption in the firmware.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Download and install the most current version of the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Use the [Format Disk](#) item in the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

4. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

98.00.01 or 98.01.00 Corrupt data in firmware volume

Data corruption has occurred in the firmware volume.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Use the [Format Disk](#) item in the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

3. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

98 . 00 . 02 Corrupt data in the solutions volume

Data corruption has occurred in the solutions volume.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Use the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

3. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

98 . 00 . 03 Corrupt data in the configuration volume

Data corruption has occurred in the configuration volume.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Download the firmware again, and then attempt the upgrade again.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Use the [Format Disk](#) item in the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

4. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

98.00.04 Corrupt data in the job data volume

Data corruption has occurred in the job data volume.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Make sure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Rerun the file erase function.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

99.WX.YZ Error Messages

99.* errors

Errors in the 99.* family are related to the firmware upgrade process.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Make sure the connection to the network is good, and then try the firmware upgrade again.
2. If the error persists, try using the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Make sure the connection to the network is good, and then try the upgrade again.
2. Try using the USB upgrade method.
3. If the error persists, run the [Format Disk](#) process from the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: [HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#)*.

4. If the issue persists, replace the hard disk drive (HDD).



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-108 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41616-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

99 . 00 . 01 Upgrade not performed file is corrupt

A remote firmware upgrade (RFU) was not performed.

This is a CRC error in the firmware image (bad image).

Recommended action

Follow these troubleshooting steps in the order presented.

- Download the firmware upgrade file, and then attempt the upgrade again.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99 . 00 . 02 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading the header number and size. It indicates a problem with the network environment, not the product.

Recommended action

Follow these troubleshooting steps in the order presented.

The most common cause is an issue with the network environment.

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



NOTE: If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99 . 00 . 03 Upgrade not performed error writing to disk

A remote firmware upgrade (RFU) was not performed.

This is a disk error. It might indicate a problem or a hard disk failure. It might be necessary to check the connection to the hard disk or replace the hard disk.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the RFU file, and then attempt the upgrade again.
2. If the error persists, run the [Clean Disk](#) process from the **Preboot** menu. You will need to download the firmware from the [Preboot](#) menu.
3. If the issue persists, replace the hard disk drive (HDD).



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-109 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41616-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

99 . 00 . 04 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading the header.

The most common cause is an issue with the network environment.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



NOTE: If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99 . 00 . 05 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading image data.

The most common cause is an issue with the network environment.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



NOTE: If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99 . 00 . 06 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

The issue is an unexpected read error when reading the header number and size.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the RFU file, and then attempt the upgrade again.

2. If the issue persists, replace the hard disk drive (HDD).



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-110 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41616-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

99 . 00 . 07 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

The issue is an unexpected read error when reading the rest of the header.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the RFU file, and then attempt the upgrade again.
2. If the issue persists, replace the hard disk drive (HDD).



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-111 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41616-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

99 . 00 . 08 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

The issue is an unexpected read error when reading image data.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the RFU file, and then attempt the upgrade again.

2. If the issue persists, replace the hard disk drive (HDD).



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-112 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41616-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

99 . 00 . 09 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled.

Recommended action

Follow these troubleshooting steps in the order presented.

- Resend the remote firmware upgrade (RFU).

99 . 00 . 10 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled when reading the header number and size.

Recommended action

Follow these troubleshooting steps in the order presented.

- Resend the remote firmware upgrade (RFU).

99 . 00 . 11 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled when reading the rest of the header, after reading the header number and size.

Recommended action

Follow these troubleshooting steps in the order presented.

- Resend the remote firmware upgrade (RFU).

99 . 00 . 12 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The header number is 1, but the header size does not match version 1 size.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the remote firmware upgrade (RFU) file again.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Resend the RFU.

99 . 00 . 13 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The header number is 2, but the header size does not match version 2 size.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the remote firmware upgrade (RFU) file again.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Resend the RFU.

99 . 00 . 14 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The file is invalid.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the remote firmware upgrade (RFU) file again.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Resend the RFU.

99 . 00 . 2x

There is a compatibility issue with the firmware.

The specific message varies depending on the cause, but the solution for each message is the same.

- 99 . 00 . 20 (event log)

The bundle is not for this product.

- 99 . 00 . 21 (event log)

The bundle is not signed with the correct signature, or the signature is invalid.

- 99.00.22 (event log)

The bundle header version is not supported by this firmware.

- 99.00.23 (event log)

The package header version is not supported by this firmware.

- 99.00.24 (event log)

The format of the bundle is invalid.

- 99.00.25 (event log)

The format of the package is invalid.

- 99.00.26 (event log)

A CRC32 check did not pass.

- 99.00.27 (event log)

An I/O error occurred while downloading the bundle.

Recommended action

Follow these troubleshooting steps in the order presented.

1. **99.00.27 only:** Turn the product off, and then on.
2. Download the correct firmware file, and then resend the firmware upgrade.
For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#) For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).
3. If the error persists, try installing the upgrade by another method (USB or Embedded Web Server).
For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99.01.xx

A firmware install error has occurred.

The specific message varies depending on the cause, but the solution for each message is the same.

- 99.01.00
- 99.01.10
- 99.01.20
- 99.01.21

Recommended action

Follow these troubleshooting steps in the order presented.

- Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
Firmware update steps,

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)

99.02.01

Firmware installation was successful.

Recommended action

See recommended action.

- No action necessary.

99.02.09

Firmware upgrade cancelled by user.

Recommended action

See recommended action.

- No action necessary.

99.02.32 Downgrade error

This occurs when attempting to downgrade the firmware on a printer running HP FutureSmart version 3.7 or newer in a 'Ready' state to a version older than HP FutureSmart Version 4.

A 99.02.32 Downgrade error displays on the control panel, the downgrade fails, and a 33.05.09 event log error is received.

This can occur when using the Device Maintenance menu from the control panel, the Embedded Web Server (EWS), or Web Jetadmin.

This is due to a new security feature that requires someone to be present at the printer in order to perform a firmware downgrade and prevents HP SureStart printers from being downgraded remotely.

For more information about this feature, go to *HP LaserJet Enterprise, HP PageWide Enterprise-Embedded Security features*.

Recommended action

Follow these troubleshooting steps in the order presented.

HP recommends using the latest firmware available but if a downgrade is absolutely necessary, then use the Preboot menu with a USB flash drive to avoid any errors.



NOTE: If you downgrade the printer firmware, all solutions, stored jobs, and current settings will be lost. The machine will be reset back to factory settings.

- Upgrade the printer using the USB upgrade method.

For instructions, go to Update the firmware using a USB flash drive or the Embedded Web Server (EWS), and then follow the steps in the Method three: USB flash drive - Preboot menu section.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)



NOTE: Using this method (Preboot menu with a USB flash drive) will preserve the HP SureStart feature and prevent downgrading to a non-HP SureStart firmware version and removing the HP SureStart feature.

99 . 07 . ȳZ Firmware install error (MFP - fax only)

Firmware install error

- **99.07.00** Unexpected fax modem FW installer error. Firmware installation failed. The finisher installer encountered an error during installation.
- **99.07.10** An error occurred accessing the repository during the fax modem FW install. Firmware installation failed. The fax modem installer encountered an error in the repository.
- **99.07.21** The fax modem could not be reset. Firmware installation failed. The fax modem installer failed to download flash to the modem.
- **99.07.20** The fax modem FW installer could not connect to the fax modem. Firmware installation failed. The fax modem installer encountered an error while detecting or initializing modem.
- **99.07.22** Firmware installation failed. The fax modem installer failed to download firmware to the modem.
- **99.07.23** Fax modem reset failed.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Verify the fax card is correctly installed on the formatter. Ensure the fax card is aligned with slot on the formatter chassis and is firmly seated against the formatter board. Turn the printer on.
3. If the error persists, download and reinstall the firmware.
4. If the error persists, perform a Partial Clean:
 - a. Turn the printer if, and then on.
 - b. Touch the [HP logo](#) that displays in the middle of the screen when you see the “1/8” under the logo. The Preboot menu will open.
 - c. Touch the down arrow button to highlight [Administrator](#), and then touch the OK button.
 - d. Use the down arrow button to highlight [Partial Clean](#), and then touch the OK button.
 - e. Touch the [OK](#) button again.
 - f. Touch the Back button to highlight Continue, and then touch the [OK](#) button.
 - g. The printer will continue to boot to [Ready](#).
5. If the error persists, replace the fax kit.

Part number: B5L53-67901

99 . 09 . 60 Unsupported disk

The hard disk currently installed is not recognized or supported by the product.

This is a [Preboot](#) menu error.

Recommended action

Follow these troubleshooting steps in the order presented.

- Install the correct hard disk for this printer.



NOTE: Do NOT replace the formatter board, it will not resolve the issue.

Table 6-113 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41616-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

99 . 09 . 61 Unsupported disk

The hard disk drive installed is not support in this printer.

The hard disk drive (HDD) is not encrypted and the printer is configured for an encrypted HDD.

Recommended action

Follow these troubleshooting steps in the order presented.



NOTE: Do NOT replace the formatter board, it will not resolve this error.

- Access the [Preboot](#) menu, and then select [Lock Disk](#) to lock the disk.
 - a. Access the [Preboot](#) menu
 - b. Turn the product on.
 - c. Touch the HP logo that displays in the center of the touchscreen until the [Preboot](#) menu item opens.
 - d. Use the arrow buttons on the touchscreen to navigate the [Preboot](#) menu.
 - e. Touch the [OK](#) button to select a menu item.

99 . 09 . 62 Unknown disk

This error indicates that there is an encryption mismatch between the HDD and the formatter.

This typically happens because an HDD was swapped into a device from another device.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.



NOTE: Do NOT replace the formatter board, it will not resolve this error.

1. Use the [Preboot](#) menu to unlock the disk.
 - a. Access the [Preboot](#) menu
 - b. Turn the product on.
 - c. Touch the HP logo that displays in the center of the touchscreen until the [Preboot](#) menu item opens.
 - d. Use the arrow buttons on the touchscreen to navigate the [Preboot](#) menu.
 - e. Touch the [OK](#) button to select a menu item.
2. If a disk is to be reused in a different product, execute the [Erase and Unlock](#) procedure from the [Preboot](#) menu, and then reload the firmware.
 - From the [Preboot](#) menu, open the following menus:
 - [Administration](#) (select 3)
 - [Manage Disks](#) (select 6)
 - [Boot Device](#) (select 6)
 - [Erase / Unlock](#) (select 2)
3. If the issue persists, replace the HDD/SSD as needed.



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-114 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41616-011
Solid state drive (SSD)	0950-5111
Federal Information Processing Standards Drive, FIPS	6HN31-67001
See NOTE above.	See NOTE above.

99 . 09 . 63 Incorrect disk

This error indicates that the expected encrypted HDD is not present.

This is expected behavior when installing a new HDD in a device where the previous HDD was encrypted.

Recommended action

Follow these troubleshooting steps in the order presented.

- Follow the procedure to load firmware on a new hard disk drive, and then lock the disk to this printer.



NOTE: Do NOT replace the formatter board, it will not resolve the issue.

For instructions on accessing the Preboot menu, go to **WISE** and search for the following document: HP LaserJet Enterprise M604, M605, M606 and HP Color LaserJet Enterprise M552, M553 - Pre-boot menu options.

Or click on the following link: [HP LaserJet Enterprise M604, M605, M606 and HP Color LaserJet Enterprise M552, M553 - Pre-boot menu options.](#)

99 . 09 . 64 Disk malfunction

A fatal hard disk failure has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Determine if the hard disk drive needs to be replaced.
2. Ask if the customer is using eMMC as a temporary mass storage solution is an option (eMMC must be present).
3. Instruct the customer to enable eMMC from the preboot menus.
4. Turn the printer off.
5. Inform the customer that the broken hard disk drive must be removed to continue.
6. Turn the printer on. The boot sequence is expected to stop at 99.39.67 eMMC Not Bootable error.
7. Provide instructions to download firmware (This will automatically download to eMMC).
8. During the download to eMMC, the firmware will clear the data migration bit.
9. If the issue persists, replace the hard disk drive (HDD).



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-115 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41616-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

99 . 09 . 65 Disk data error

Disk data corruption has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.



NOTE: Do NOT replace the formatter board, it will not resolve this error.

- Use the [Format Disk](#) procedure from the [Preboot](#) menu, and then resend the remote firmware upgrade (RFU).

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: [HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#).*

99 . 09 . 66 No boot device.

A hard disk drive or eMMC is not installed in the printer.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Determine the customer's intended boot device (hard disk drive or eMMC).
2. Install a compatible hard disk drive or eMMC.
3. If a compatible hard disk drive or eMMC is installed, re-seat the hard disk drive or eMMC to make sure that it is connected correctly. Additionally reseat all cables on the formatter, except the Flat Flexible cable (FFC).
4. If the issue persists, replace the hard disk drive (HDD).



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-116 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41616-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

99 . 09 . 67 Disk is not bootable please download firmware

This is an error indicating that there is no firmware installed on the disk.

This is usually the result of installing a new disk or performing a [Clean Disk](#) operation from the [Preboot](#) menu.



NOTE: When installing a new hard drive or eMMC, the disk should be formatted through the Preboot menu, BEFORE loading firmware.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Press any button to continue to the main [Preboot](#) menu.
2. Press the Help button to see the help text for the error.
3. Select the [Administration](#) menu.



NOTE: If there is a password assigned to the administrator, a prompt to enter the printer displays. Enter the password to proceed.

4. Select the [Format disk](#) option, select [OK](#).
5. Select the [Download](#) item, and then download the latest firmware. The user can now download a new firmware bundle to the printer.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

6. If the download fails to the hard disk drive, complete the following:
 - a. Determine if the hard disk drive needs to be replaced.
 - b. Ask if the customer is using eMMC as a temporary mass storage solution is an option (eMMC must be present).
 - c. Instruct the customer to enable eMMC from the [Preboot](#) menus.
 - d. Turn the printer off.
 - e. Inform the customer that the broken hard disk drive must be removed to continue.
 - f. Turn the printer on. The boot sequence is expected to stop at 99.39.67 eMMC Not Bootable.
 - g. Provide instructions to download firmware (This will automatically download to eMMC).
 - h. During the download to eMMC, the firmware will clear the data migration bit.
 - i. If the issue persists, replace the hard disk drive (HDD).



NOTE: Do NOT replace the formatter board, it will not resolve the issue.



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-117 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41616-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

99 . 39 . 64 eMMC Nonfunctional

The eMMC is not functioning.

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the eMMC.

Part number: B5L32-60002

 **NOTE:** The device is unusable until a new eMMC is installed.

 **NOTE:** Do NOT replace the formatter board, it will not resolve the issue.

99 . 39 . 67 eMMC Not Bootable

Data on the eMMC cannot be secured or encrypted.

When the hard disk drive is installed all data on the eMMC is automatically migrated to the hard disk drive and erased from the eMMC. As long as the hard disk drive is installed the eMMC is non-functional.

The customer passed the data migration and put the eMMC back in.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download firmware to the eMMC.
2. If the download fails to eMMC, replace the eMMC.

Part number: B5L32-60002

 **NOTE:** Do NOT replace the formatter board, it will not resolve the issue.

 **NOTE:** The device is unusable until a new eMMC is installed.

7 Alphabetical control panel messages

Use the following alphabetical message to see further information on the message.

Alphabetical messages

Authentication required

A user name and password are required.

Recommended action

Follow these troubleshooting steps in the order presented.

- Type the user name and password, or contact the network administrator.

Calibration reset pending

A calibration reset occurs when all jobs are processed.

Recommended action

Follow these troubleshooting steps in the order presented.

- To begin the reset sooner, cancel all jobs by pressing the [Stop](#) button.

Cartridge low <color>

The toner cartridge is low.

Recommended action

Follow these troubleshooting steps in the order presented.

- If this message appears with a new toner cartridge, perform the following:
 - a. Remove, and then reinstall the toner cartridge indicated.
 - b. Ensure that a genuine HP supply is being used.
 - c. If the error persists, replace the toner cartridge.

Cartridge Memory Abnormal <color>

The toner cartridge memory tag is reading an abnormal value.

Recommended action

Follow these troubleshooting steps in the order presented.

- If this message appears with a new toner cartridge, perform the following:
 - a. Remove, and then reinstall the toner cartridge.

- b. Ensure that a genuine HP supply is being used.
- c. Reconnect connector (J103) on the DC controller PCA.
- d. If the error persists, replace the toner cartridge.

Cartridge out <color>

The toner level, or the life expectancy or the toner cartridge is running out.

Recommended action

Follow these troubleshooting steps in the order presented.

- If this message appears with a new toner cartridge, perform the following:
 - a. Remove, and then reinstall the toner cartridge indicated.
 - b. Ensure that a genuine HP supply is being used.
 - c. If the error persists, replace the toner cartridge.

Cleaning disk <X> complete Do not power off

A storage device is being sanitized or cleaned.

Recommended action

Follow these troubleshooting steps in the order presented.

- Do not turn off the printer. The printer's functions are unavailable. The printer will automatically restart when finished.

Clearing activity log

This message is displayed while the activity log is being cleared. The printer exits the menus when the log has been cleared.

Recommended action

See recommended action.

- No action necessary.

Close front door

The front door is open.

This message appears even though the top front door is closed.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Close the front door.
2. Check the projection part on the front door. If it is damaged, replace the front door assembly.
3. Use the front door switch (SW1) test in the manual sensor test to verify that the switch is correctly functioning. If the switch fails the test, replace the switch.

4. Reconnect the connector (J101) on the DC controller PCA.
5. If the problem persists, replace the front door switch (SW1).

Part number: RM2-7206-000CN

Close lower right door

The optional paper feeder right door is open.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Close the door.
2. Run the switch test (SW20) in the sensor monitor mode to verify that the paper feeder right door switch is functioning correctly. If it is not, replace the lifter drive assembly. The SW20 switch is located on the drive assembly.

Part number: RM2-5149-000CN


See **callout 1** in the following image for switch location.

3. Check the sensor flag on the lower-right door assembly. If it is damaged, replace the right door assembly.

Part number: RM2-5146-000CN

See **callout 2** in the following image for flag location.

Figure 7-1 500 Sheet paper tray door

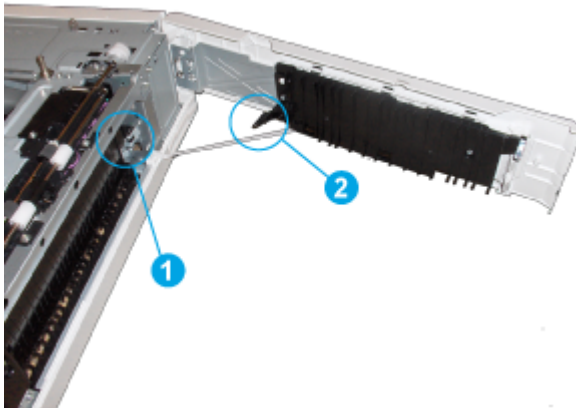

4. Check connector J2022 on the paper feeder right door switch and connector J1902 on the paper feeder controller PCA.

Replace the paper feeder PCA.

Part number: RM2-7139-000CN

Close upper right door

The upper right door is open.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Close the upper right door.
2. Check the flag part for the switch on the right door assembly. If it is damaged, replace the front door assembly.

Part number: RM2-0019-000CN
3. Use the upper right door switch (SW3) test in the manual sensor test to verify that the switch is correctly functioning. If the switch fails the test, replace the switch.
4. Reconnect the connector (J26) of the right door switch and connector (J115) on the DC controller PCA.
5. If the issue persists, elevate the case using the Standard Support Process.

Communication lost message appears on the control panel in five different languages

A communication lost message appears on the control panel in five different languages.

The control panel has lost communication with the formatter.

The communication path from the control panel to the formatter includes the control panel, USB cable, image control board (ICB), and the formatter.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove and re-seat the formatter.
 - a. Turn the printer off.
 - b. Disconnect the LAN/USB cable and power cable.
 - c. Manually loosen the thumbscrews to release the formatter from the engine.
 - d. Slide the formatter out of the printer by pulling from the thumbscrews gently.
 - e. Reseat formatter board and put back all cables.
 - f. Turn the printer back on.
3. If the message reappears in 20 - 30 seconds, check the following items:
 - a. Check the heartbeat LED on the formatter (is it flashing?).
 - b. If the heartbeat LED is not flashing, replace the formatter.

Table 7-1 Formatter part numbers

Description	HP Part Number
Formatter (M552 models only)	B5L23-67903

Table 7-1 Formatter part numbers (continued)

Description	HP Part Number
Formatter (M552 models only)(India and China)	B5L23-67904
Formatter (M553n, M553dn, M553dh)	B5L24-67909
Formatter (M553n, M553dn, M553dh)(India and China)	B5L24-67908
Formatter (M553x models only)	B5L26-67901
Formatter (M553x models only)(India and China)	B5L26-67902
Formatter (M577 models only)	B5L46-67909
Formatter (M577 models only)(India and China)	B5L46-67911

For instructions: See the Repair Service Manual for this product.

- c.** If the formatter heartbeat LED is flashing, then the communication lost message could also be caused by one of the following:
 - Bad USB connection at the ICB.
 - Bad control panel.
 - Bad ICB.
 - 4.** If the error persists after replacing the formatter, or the formatter is good, the control panel USB cable might not be seated correctly at the ICB connection on top of the engine.

Gateways failed

There is an incorrect gateways configuration.

Recommended action

Follow these troubleshooting steps in the order presented.

- Use the **EIO <X> Jetdirect** menu to configure the default gateway.

Incompatible <Supply>

The indicated supply is not compatible with this printer.

- **10.00.35** Black toner cartridge (event code)
- **10.01.35** Cyan toner cartridge (event code)
- **10.02.35** Magenta toner cartridge (event code)
- **10.03.35** Yellow toner cartridge (event code)
- **10.23.35** Fuser kit (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the supply with one that is designed for this printer.

Incompatible supplies

Toner cartridges or other supply items are installed that were not designed for this printer. The printer cannot print with these supplies installed.

Event codes are supply specific.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to identify the incompatible supplies.
2. Replace the supplies with those that are designed for this printer.

Install fuser unit

10.23.15 Fuser Kit (event code)

The fuser has been removed or installed incorrectly.

Recommended action

Follow these troubleshooting steps in the order presented.

 **WARNING!** The fuser can be hot while the printer is in use. Turn the printer off, and then wait for the fuser to cool before handling it.

1. Remove the fuser then reinstall it.
2. If message remains, replace the fuser.

For instructions: *Removal and replacement: Fuser*

Table 7-2 Part numbers

Description	HP Part Number
Fuser kit (110V)	B5L35-67902
Fuser kit (220V)	B5L36-67902

Internal disk not functional

82.0X.YZ (event code)

The internal hard disk drive is not functioning correctly.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then remove and reinstall the hard disk drive.
2. Turn on the printer.
3. If the issue persists, replace the internal hard disk drive (HDD).

 **NOTE:** Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government

printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 7-3 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41616-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

Load Tray <X>: [Type], [Size] To use another tray, press “OK”

This message displays when the indicated tray is selected, but is not loaded, and other paper trays are available for use.

It also displays when the tray is configured for a different paper type or size than the print job requested.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Load the correct paper in the tray.
2. If prompted, confirm the size and type of paper loaded.
3. Otherwise, press the **OK** button to select another tray.
4. If the error persists, use the cassette paper present sensor test in the Tray/Bin manual sensor test to verify that the sensor is functioning correctly.
5. Ensure that the sensor flag on the paper presence sensor is not damaged and moves freely.
6. Reconnect the corresponding connector.
 - Printer cassette: connectors (J22) on the cassette paper feed sensor and the connector (J121) on the DC controller PCA.
 - 1 X 500-sheet paper feeder cassette: interconnect (J2042 and J2042) on the paper feeder cassette paper feed sensor and the connector (J1904) on the paper feeder controller PCA.

Moving solenoid and motor

The solenoid and a motor are moving as part of a component test.

Recommended action

There is no action needed for this message.

- No action necessary.

Moving solenoid To exit press

The solenoid is moving as part of a component test.

Recommended action

There is no action needed for this message.

- No action necessary.

No USB drive or files found

The formatter was not able to detect the USB thumb drive.


If you experience the “No USB drive or files found” attempting to upgrade printer firmware via the walk up easy-access USB port perform the following.

Recommended action for customers

Follow these steps to try to resolve this error.

If you experience the “No USB drive or files found” attempting to upgrade printer firmware via the walk up easy-access USB port perform the following.

1. After the firmware file has been downloaded from hp.com uncompress the file and copy the xxxxxx.bdl file to the root of a portable USB flash memory storage device (thumb drive), insert the USB flash memory storage device into the easy-access USB port, and attempt to flash the firmware.
2. If the issue persists, verify the USB flash drive is formatted as FAT32. If unsure, format the flash drive as FAT32 and/or try a different flash drive and repeat step 1.
3. If the issue persists, the USB flash drive can be inserted directly into a USB port on the printer's formatter and the firmware flashed.
 - a. Locate the printer's formatter interface located at the rear left side of printer.
 - b. If necessary, rotate the printer for easier access to the formatter ports.
 - c. Locate the USB connection port (callout 2).

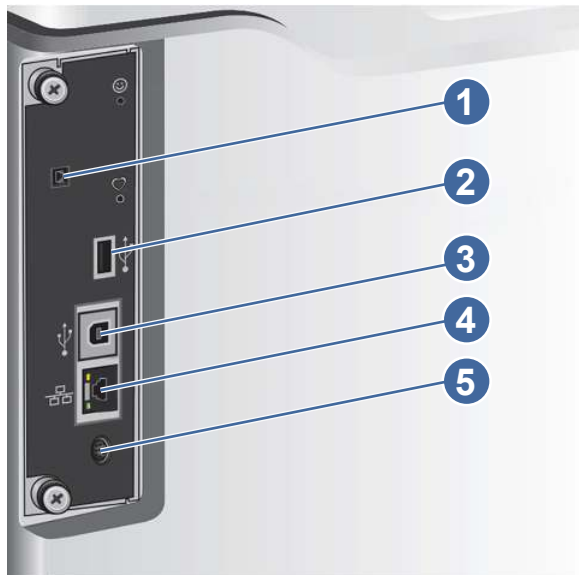

- d. Insert the USB flash drive (callout 2).

- e. Attempt to flash the printer's firmware.
 - f. After the firmware update remove the USB flash drive.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.


Recommended action for call-center agents

Follow these steps to try to resolve this error.

If you experience the "No USB drive or files found" attempting to upgrade printer firmware via the walk up easy-access USB port perform the following

1. After the firmware file has been downloaded from hp.com uncompress the file and copy the xxxxxx.bdl file to the root of a portable USB flash memory storage device (thumb drive), insert the USB flash memory storage device into the easy-access USB port, and attempt to flash the firmware.
2. If the issue persists, verify the USB flash drive is formatted as Fat32. If unsure, format the flash drive as Fat32 and/or try a different flash drive and repeat step 1.
3. If the issue persists, investigate if the printer's formatter has recently been replaced or swapped from another printer. If possible, install the original formatter.
4. If the issue persists the USB flash drive can be inserted directly into the USB port on the printer's formatter and the firmware flashed.
 - a. Locate the printer's formatter interface located at the rear left side of printer.
 - b. If necessary, rotate the printer for easier access to the formatter ports.
 - c. Locate the USB connection port (callout 3).

Figure 7-2 External plug and port locations

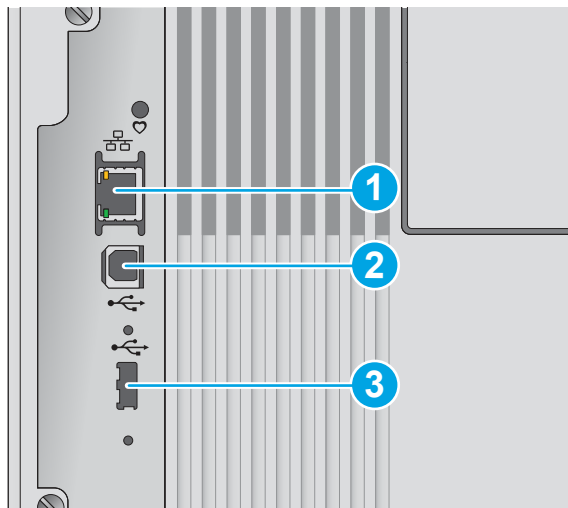

Item	Description
1	Local area network (LAN) Ethernet (RJ-45) network port
2	Hi-Speed USB 2.0 printing port

Item	Description
3	USB port for connecting external USB devices (this port might be covered) NOTE: For Walkup USB printing, use the USB port near the control panel.

- d. Insert the USB flash drive.
 - e. Attempt to flash the printer's firmware.
 - f. After the firmware update remove the USB flash drive.
5. If the firmware upgrade was successful via the formatter USB port reiterate to the customer that there are two ports available for firmware updates, the walkup USB port, and the USB port on the formatter.
 6. If the issue persists with walkup USB port and the customer expresses concern/dissatisfaction, dispatch a service technician to perform the following: disconnect and reconnect J20 (Easy-access USB) on the formatter.


Recommended action for onsite technicians

Follow these steps to try to resolve this error.

1. After the firmware file has been downloaded from hp.com uncompress the file and copy the xxxxxx.bdl file to the root of a portable USB flash memory storage device (thumb drive), insert the USB flash memory storage device into the easy-access USB port, and attempt to flash the firmware.
2. If the issue persists, verify the USB flash drive is formatted as Fat32. If unsure, format the flash drive as Fat32 and/or try a different flash drive and repeat step 1.
3. If the issue persists, investigate if the printer's formatter has recently been replaced or swapped from another printer. If possible, install the original formatter.
4. If the issue persists the USB flash drive can be inserted directly into the USB port on the printer's formatter and the firmware flashed.
 - a. Locate the printer's formatter interface located at the rear left side of printer.
 - b. If necessary, rotate the printer for easier access to the formatter ports.

- c. Locate the USB connection port (callout 3).

Figure 7-3 External plug and port locations

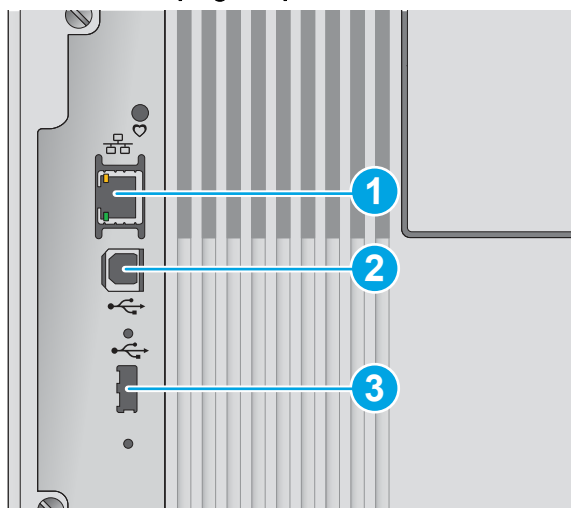

Item	Description
1	Local area network (LAN) Ethernet (RJ-45) network port
2	Hi-Speed USB 2.0 printing port
3	USB port for connecting external USB devices (this port might be covered) NOTE: For Walkup USB printing, use the USB port near the control panel.

- d. Insert the USB flash drive.
 - e. Attempt to flash the printer's firmware.
 - f. After the firmware update remove the USB flash drive.
5. If the firmware upgrade was successful via the formatter USB port reiterate to the customer that there are two ports available for firmware updates, the walk-up USB port, and the USB port on the formatter.
 6. If the firmware update was successful from the formatter USB port, attempt to flash the firmware from the walk up easy-access USB port. If the issue persists from the walk up easy-access USB port, disconnect and reconnect J20 (Easy-access USB) on the formatter.

Locate J20 in upper right hand side of the formatter PCA.

Figure 7-4 Formatter PCA connections (M552/M553/M554/M555/E55040)


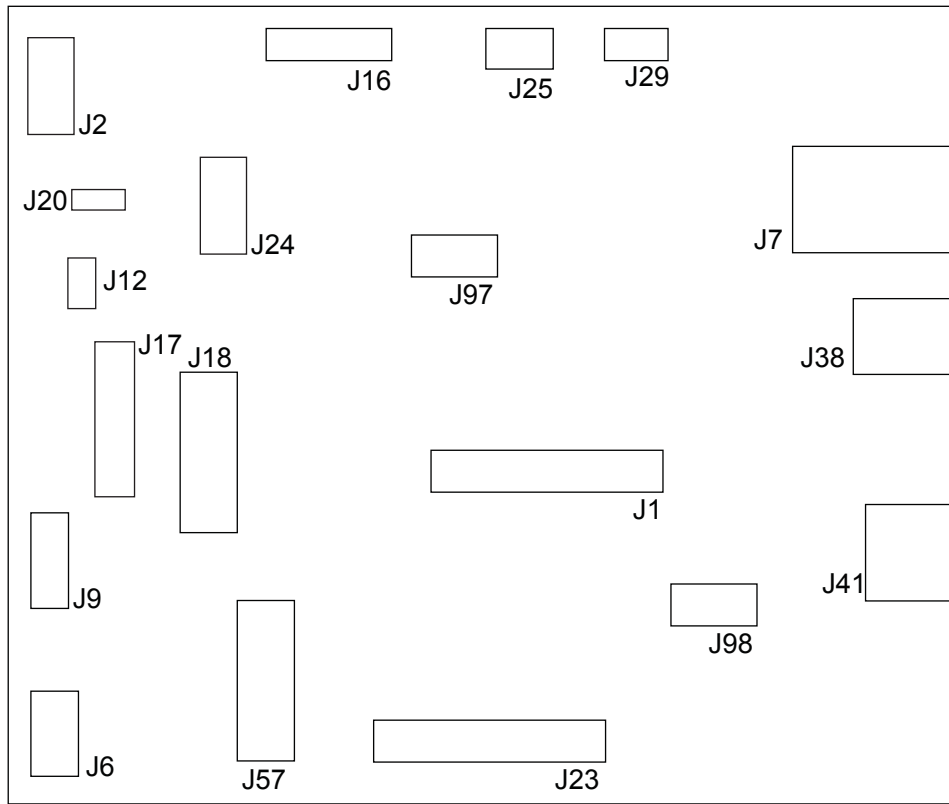


Figure 7-5 Formatter PCA connections (M577/M578/E57540)

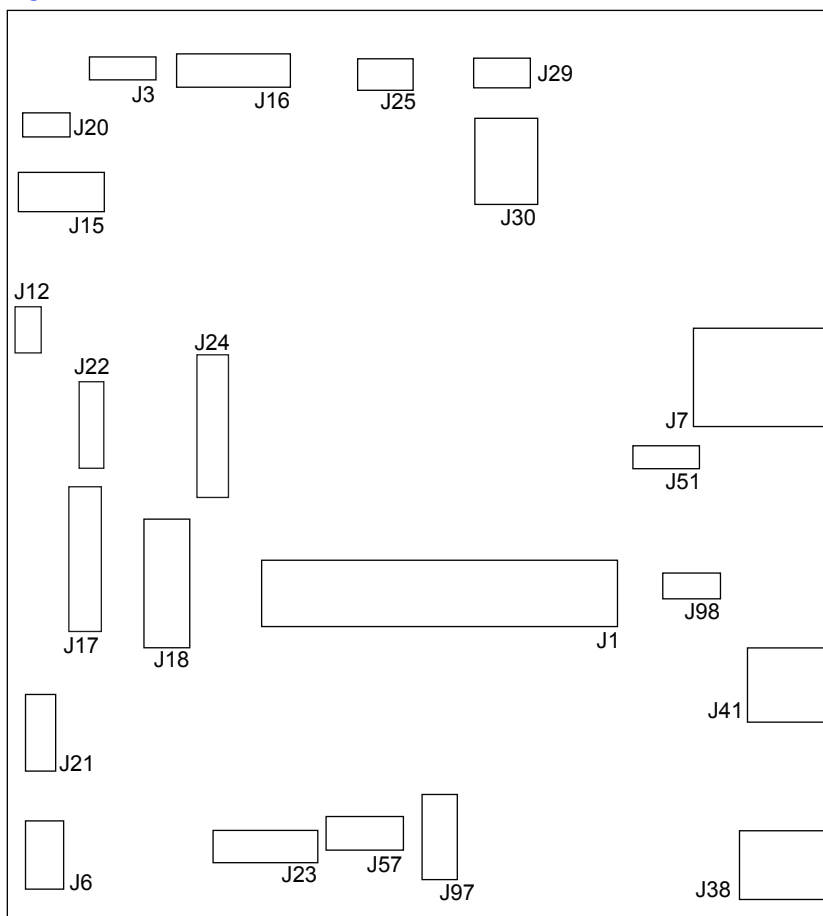

7. If the error persists from the walk up easy-access USB port and with USB flash drive directly connected to the formatter USB port, replace the formatter.

Table 7-4 Part numbers

Description	HP Part Number
Formatter (M552 models only)	B5L23-67903
Formatter (M552 models only)(India and China)	B5L23-67904
Formatter (M553n, M553dn, M553dh)	B5L24-67909
Formatter (M553n, M553dn, M553dh)(India and China)	B5L24-67908
Formatter (M553x models only)	B5L26-67901
Formatter (M553x models only)(India and China)	B5L26-67902
Formatter (M577 models only)	B5L46-67909
Formatter (M577 models only)(India and China)	B5L46-67911

For instructions: See the Repair Service Manual for this product.

For instructions: See the Repair Service Manual for this product.

8. If the error persists, elevate using the standard support process.

Output Bin Full

The output bin is full and paper must be removed before printing can continue.

Recommended action

Follow these troubleshooting steps in the order presented.

- If this message appears even though the output bin is not full perform the following:
 - a. Ensure that the output bin sensor flag is not damaged and can move freely. If the flag is damaged, replace the flag.
 - b. Use the output bin full sensor (PS10) test in the manual sensor test to test the sensor. If the sensor does not respond, replace the delivery assembly.

Table 7-5 Part numbers

Description	HP Part Number
Duplex Printer	RM2-0016-000CN
Simplex Printer	RM2-0092-000CN

Printing Demo Page

The demo page is being generated. The printer will return to the [Ready](#) when the page is complete.

Recommended action

There is no action needed for this message.

- No action necessary.

Remove toner cartridge

The printer is testing the print-cartridge motor.

Recommended action

Follow these troubleshooting steps in the order presented.

- To perform the test, remove the toner cartridge from the printer. To cancel, press the [Stop](#) button.

Replace <Supply>

This alert displays only if the printer is configured to stop when a supply reaches the very low threshold. The printer indicates when a supply level is at its estimated end of life. The actual life remaining might be different than estimated.

The supply does not need to be replaced now unless the print quality is no longer acceptable.

HP recommends that the customer have a replacement supply available to install when print quality is no longer acceptable.

The printer can be configured to stop when the supply level is very low. The supply might still be able to produce acceptable print quality.

- **10.00.70** Black toner cartridge (event code)

- **10.01.70** Cyan toner cartridge (event code)
- **10.02.70** Magenta toner cartridge (event code)
- **10.03.70** Yellow toner cartridge (event code)
- **10.23.70** Fuser Kit (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the specified supply. Or, configure the printer to continue printing using the [Manage Supplies](#) menu on the printer control panel.

Replace Supplies

This alert displays only if the printer is configured to stop when a supply reaches the very low threshold. The printer indicates when a supply level is at its estimated end of life. The actual life remaining might be different than estimated.

The supply does not need to be replaced now unless the print quality is no longer acceptable.

HP recommends that the customer have a replacement supply available to install when print quality is no longer acceptable.

The printer can be configured to stop when the supply level is very low. The supply might still be able to produce acceptable print quality.

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the specified supply. Or, configure the printer to continue printing using the [Manage Supplies](#) menu on the printer control panel.

Re-send external accessory firmware

An external accessory requires a firmware upgrade. Printing can continue, but jams might occur if the job uses the external accessory.

Recommended action

Follow these troubleshooting steps in the order presented.

- Perform a firmware upgrade.

RFU Load Error Send full RFU on <X> Port

The printer displays this message before the firmware is loaded at initialization when an error has occurred during a firmware upgrade.

Recommended action

Follow these troubleshooting steps in the order presented.

- Re-send the firmware upgrade.

Sanitizing disk <X> complete Do Not power off

The hard disk is being cleaned.

Recommended action

Follow these troubleshooting steps in the order presented.

- Contact the network administrator.

Too many jobs in queue

This message displays when the user selects a USB file to print, and 100 files are already in the print queue.

Recommended action

Follow these troubleshooting steps in the order presented.

- To select another file, touch the **OK** button.

Tray <X> [type] [size]

The paper in the specified tray is detected as the specified size and type.

The custom switch was not changed.

Recommended action

Follow these troubleshooting steps in the order presented.

- If the paper is a custom size or type, change the custom-size switch on the tray as necessary.

Tray <X> lifting

The printer is in the process of lifting paper in the indicated tray.

- X = 2: Tray 2
- X = 3: Tray 3
- X = 4: Tray 4
- X = 5: Tray 5

Recommended action

Follow these troubleshooting steps in the order presented.

- No action necessary.

Tray <X> open

The specified tray is open or not closed completely.

- X = 2: Tray 2
- X = 3: Tray 3
- X = 4: Tray 4

- X = 5: Tray 5

Recommended action

Follow these troubleshooting steps in the order presented.

1. Close the tray.
2. If this message displays after the lifter drive assembly was removed or replaced, ensure that the connector of the assembly is connected correctly and fully seated.
3. If the error persists, use the paper size switches (SW102, SW2, SW3) test in the Tray/Bin manual sensor test to test the switches. If they do not respond, replace associated the lifter drive assembly.
4. If the switches do not respond, replace the associated lifter drive assembly.

Table 7-6 Part numbers

Description	HP Part Number
Tray 2	RM2-0010-000CN
External 550 sheet feeder	RM2-5149-000CN

Tray <X> overfilled

The tray is filled above the stack-height mark.

- X = 2: Tray 2
- X = 3: Tray 3
- X = 4: Tray 4
- X = 5: Tray 5

The overfilled condition is sensed by the stack surface sensor when the tray is first closed. If the stack surface sensor does not move down (because the tray is too full), the overfilled message will be displayed and the tray will not be available for printing.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Open the tray and remove paper until the tray filled indicators can be seen.
2. Close the tray.
3. If the issue persists after removing paper from the tray, replace paper pickup assembly.

Part number: RM2-5154-000CN



NOTE: Before replacing the paper pickup assembly perform the following steps.

- a. Perform a tray bin sensor test for the paper stack sensor of the tray in question.

(Example) Perform a manual sensor test for SR12 tray 2 paper surface sensor.

This test requires the activation of the tray closed lever which releases the sensor arms for the paper surface sensors.

- b. Verify that all connections from the DC controller to the paper pickup assembly and lifting drive assembly are fully seated and connected. A loose or missing connection can cause this error.
- c. If this message appears after lifter drive assembly was removed or replaced, ensure that the connector on the assembly is correctly connected and fully seated.
- d. If the error persists, replace the paper pickup assembly.
 - Tray 2 – RM2-0008-000CN
 - External 550 sheet feeder – RM2-5154-000CN

Tray <X> empty: [Type], [Size]

The specified tray is empty and the current job does not need this tray to print.

- X = 1: Tray 1
- X = 2: Tray 2
- X = 3: Tray 3
- X = 4: Tray 4
- X = 5: Tray 5

Recommended action

Follow these troubleshooting steps in the order presented.

- Refill the tray at a convenient time.



NOTE: This could be a false message. If the tray is loaded without removing the shipping lock, the printer does not sense that the paper is loaded. Remove the shipping lock, and then load the tray.

Unsupported drive installed To continue, touch “OK”

A non-supported hard disk drive has been installed. The drive is unusable by this printer.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove the hard disk drive.
3. Turn the printer on.

Unsupported supply in use OR Unsupported supply installed To continue, touch “OK”

The printer has one or more HP genuine supplies, designed for a different printer, in use.

Recommended action

Follow these troubleshooting steps in the order presented.

- Install the correct supplies for this printer.

Used supply installed To continue, touch “OK”

The toner cartridges or supplies has been previously used.

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the used supply or touch OK to continue to use the supply installed



NOTE: If it is believed the customer purchased a genuine HP supply, go to www.hp.com/go/anticounterfeit.

Verifying, Please Wait

This message displays when the printer is retrieving a print job from device memory, but it can cause the printer control panel to lock up.

The user opens the **Retrieve from Device Memory** menu to print a job. After selecting the desired print jobs, **Verifying, Please Wait** displays on the control panel. The status bar will move for a moment, and then lock up. Typically, if the user waits a few minutes, the error will clear and the job will print.

In rare cases, the message will lock up permanently and force the user to power cycle the printer.

The event log might show the following errors as a result of power cycling the printer during lockup:

- 48.05.05
- 98.03.11

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the firmware is the latest revision.

Index

Symbols/Numerics

76.00.24 5

A

Alphabetical control panel
messages 370

B

backup error
32.WX.YZ error 4
reset error 4
restore error 4

C

connector error
65.WX.YZ error 5

D

DC controller communication error
55.WX.YZ error 4
DC controller firmware error
70.WX.YZ error 5
digital sending error (firmware)
44.WX.YZ error 4
document feeder error
31.WX.YZ error 4
duplexer error
69.WX.YZ error 5

E

Embedded Jetdirect error
80.WX.YZ error 5
engine error (LaserJet)
46.WX.YZ error 4
63.WX.YZ error 5
engine error (PageWide)
61.WX.YZ error 4
event log error (firmware)
42.WX.YZ error 4

F

fan error
58.WX.YZ error 4
firmware communication error
49.WX.YZ error 4

firmware install error
99.WX.YZ error 5
hard disk error 5
remote firmware upgrade
error 5

fuser error
41.WX.YZ error 4
laser scanner error 4
paper path error 4
fuser error (LaserJet)
50.WX.YZ error 4

H

hard disk partition error
98.WX.YZ error 5

I

input accessory error
67.WX.YZ error 5
input/output error
40.WX.YZ error 4
internal diagnostics error
90.WX.YZ error 5
video display error 5

J

jam error (LaserJet)
13.WX.YZ error 3
jam error (PageWide)
13.WX.YZ error 4
job accounting error (firmware)
48.WX.YZ error 4
job management error
(firmware) 4
job pipeline error (firmware) 4
job parser error (firmware)
47.WX.YZ error 4
printer calibration error 4

L

laser scanner error (LaserJet)
51.WX.YZ error 4
52.WX.YZ error 4
last update 1

M

memory error
82.WX.YZ error 5
EMMC error 5
hard disk error 5
motor error (LaserJet)
59.WX.YZ error 4

N

Near Field Communication error
81.WX.YZ error 5
Bluetooth error 5
external I/O card error 5
internal EIO error 5
wireless error 5
Numerical control panel
messages 18

O

output accessory error
66.WX.YZ error 5
OXPd/Web kit error
45.WX.YZ error 4

P

page error
21.WX.YZ error 4
paper handling error (LaserJet)
56.WX.YZ error 4
print bar error (PageWide)
62.WX.YZ error 5
printer memory error
20.WX.YZ error 4

R

real-time clock error
11.WX.YZ error 3

S

scanner error
30.WX.YZ error 4
security error
33.WX.YZ error 4
sensor error
54.WX.YZ error 4
58.WX.YZ error 4

supplies error (LaserJet)
10.WX.YZ error 3
supplies error (PageWide)
17.WX.YZ error 4
system error (LaserJet)
62.WX.YZ error 5

T

tray motor error (LaserJet)
60.WX.YZ error 4