





HP Color LaserJet Enterprise M652, M653

HP Color LaserJet Managed E65050, E65060, E65150, E65160

HP Color LaserJet Enterprise MFP M681, M682

HP Color LaserJet Managed MFP E67550, E67560, E67650, E67660

Control Panel Message Document (CPMD)

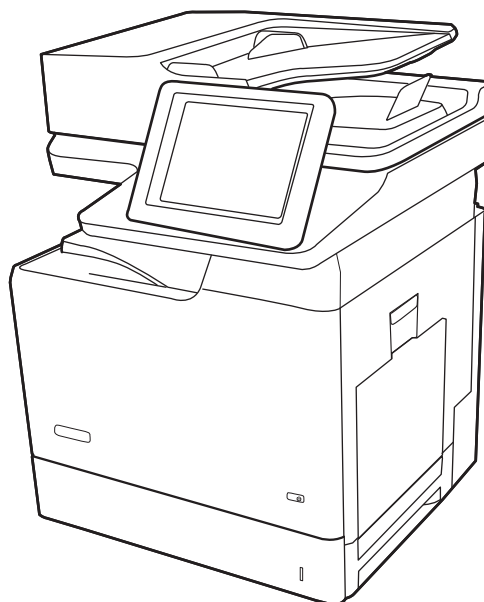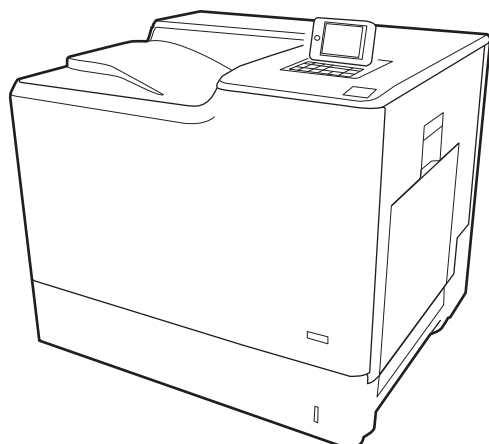

www.hp.com/support/colorlj652

www.hp.com/support/colorlj653

www.hp.com/support/ljE65050

www.hp.com/support/ljE65060

www.hp.com/support/colorljE65150

www.hp.com/support/colorljE65160

www.hp.com/support/colorljM681MFP

www.hp.com/support/colorljM682MFP

www.hp.com/support/ljE67550MFP

www.hp.com/support/ljE67560MFP

www.hp.com/support/colorljE67650MFP

www.hp.com/support/colorljE67660MFP



HP Color LaserJet Enterprise M652,
M653, MFP M681, M682, Managed
E65050-E65060, E65150, E65160, MFP
E67550, E67560, E67550, E67560, E67650,
E67660 - Control Panel Message
Document (CPMD)

SUMMARY

This document provides error-code troubleshooting information

Legal information

Copyright and License

© Copyright 2023 HP Development Company, L.P.

Reproduction, adaptation, or translation without prior written permission is prohibited, except as allowed under the copyright laws.

The information contained herein is subject to change without notice.

The only warranties for HP products and services are set forth in the express warranty statements accompanying such products and services. Nothing herein should be construed as constituting an additional warranty. HP shall not be liable for technical or editorial errors or omissions contained herein.

Edition 1.15, 7/2023

Trademark Credits

Adobe®, Adobe Photoshop®, Acrobat®, and PostScript® are trademarks of Adobe Systems Incorporated.

Apple and the Apple logo are trademarks of Apple Inc., registered in the U.S. and other countries.

macOS is a trademark of Apple Inc., registered in the U.S. and other countries.

AirPrint is a trademark of Apple Inc., registered in the U.S. and other countries.

Google™ is a trademark of Google Inc.

Microsoft®, Windows®, and Windows Server® are U.S. registered trademarks of Microsoft Corporation.

UNIX® is a registered trademark of The Open Group.

Table of contents

1 Document last updated.....	1
2 About this document.....	2
3 Control-panel message types.....	3
Error-code and control-panel-message troubleshooting overview.....	3
Error codes (types and structure).....	3
4 How to search for printer documentation.....	6
WISE - How to access and use.....	6
Accessing WISE.....	6
Using WISE to search for error codes.....	10
Using WISE to access repair and replace videos for FRUs.....	12
5 Printer service information.....	17
6 Numerical control panel messages.....	18
10.WX.YZ error messages.....	18
10.wx.yz error messages.....	18
10.0X.00 Supply memory error.....	19
10.0X.10 Supply memory error.....	20
10.0X.15 Install <supply>.....	21
10.0X.25 Wrong cartridge in <color> slot.....	22
10.0X.35 Incompatible <supply>.....	22
10.00.59.....	23
10.00.60, 10.01.60, 10.02.60, or 10.03.60, <Supply> low.....	23
10.00.69, 10.01.69, 10.02.69, or 10.03.69 <Supply> very low.....	24
10.0X.70 Printing past very low.....	24
10.0X.91 <supply> error.....	25
10.0X.92 <Cartridge> error.....	26
10.22.15 Install transfer unit.....	27
10.22.60 Transfer Kit low 10.22.69 Transfer Kit very low.....	28
10.22.70 Transfer Kit Printing past very low.....	29
10.23.15 Install Fuser kit.....	29
10.23.60 Fuser Kit low.....	30
10.23.70 Replace Fuser Kit.....	30
10.31.60 Toner collection unit almost full.....	31
10.31.70 Replace Toner Collection Unit.....	31
10.39.60 Document feeder kit low.....	31
10.39.70 Document feeder kit very low.....	32
10.99.31 Non-HP supply in use.....	32
10.99.34 Used supply in use.....	33
10.99.40 Genuine HP supplies installed.....	33
10.99.41 Unsupported Supply in use.....	33

11.WX.YZ error messages	33
11.* errors	33
11.00.01 or 11.00.02 Internal clock error	34
13.WX.YZ error messages	38
13.* errors	38
13.00.EE	45
13.00.FF	45
13.A3.DX	45
13.A4.DX	50
13.A5.D5	54
13.AX.FF	58
13.AA.EE Right Door Open	61
13.AB.EE Right Door Open	62
13.B2.Az Jam in Right door	62
13.B2.D1 Jam in Right Door	64
13.B2.D2 Jam in Right Door	71
13.B2.D4 Jam in Lower Right Door	75
13.B2.Dz Jam in Right Door	80
13.B2.FF Jam in Right door	82
13.B4.FF Jam in Right Door	82
13.B9.AZ Fuser jam	83
13.B9.Cz	85
13.B9.Dz	87
13.B9.FF	89
13.BA.EE Front Door Open	90
13.BB.EE Right Door Open	91
13.D3.Dz	92
13.D3.FF	94
13.E1.Dz	95
13.E1.FF	96
13.FF.FF	97
13.80.D1 Paper jam in stapler/stacker	97
13.83.FO	98
20.WX.YZ and 21.WX.YZ error messages	99
20.* errors	99
21.* errors	100
20.00.00 Insufficient memory <device>	100
21.00.00 Page Too ComplexEvent log error message 21.00.00	100
30.WX.YZ error messages	100
30.* errors	100
30.01.01	101
30.01.08 Home position error	109
30.01.14 Scan system EEPROM error	113
30.01.41 Scanner error	116
30.01.43 SCB memory failure	121
30.01.44	123
30.01.46 Scanner Error	129
30.01.54	131

30.01.57	132
30.03.14	132
30.03.20	132
30.03.22 Scanner failure	133
30.03.23 Scanner failure	134
30.03.30 Scanner Failure	135
30.03.45 Scanner Error To continue turn off then on	137
30.04.01 Flatbed Sensor Cable Not Detected	138
30.04.02 Flatbed FFC Cable Not Detected	141
30.04.03 ADF FFC Cable Disconnected	143
30.04.04 ADF Motor Cable Disconnected	145
30.04.05 ADF sensor Cable Disconnected	148
.....	150
31.WX.YZ error messages	151
31.* errors	151
31.01.47 Document feeder not detected	152
31.03.14	154
31.03.20 Backside scanner not detected	154
31.03.22 Scanner calibration failure	157
31.03.30 Document feeder pick motor error	166
31.03.31 Document feeder motor stall	168
31.03.33 Backside scanner calibration area dirty	170
31.13.00 Document feeder multi-pick error	173
31.13.01	192
31.13.02	211
31.13.13	230
31.13.14	231
32.WX.YX error messages	233
32.* errors	233
32.08.A1, 32.08.A2, 32.08.A3	233
32.1C.05	234
32.1C.06 (event code).....	234
32.1C.07 (event code)	234
32.1C.08 (event code).....	234
32.1C.09 (event code).....	234
32.1C.0A (event code)	235
32.1C.0D (event code).....	235
32.1C.11 (event code)	235
32.1C.13, 32.1C.14	235
32.1C.15	235
32.1C.2E	235
32.1C.2F	236
32.1C.40	236
32.1C.41	236
32.1C.42	236
32.1C.43	236
32.1C.44	237
32.1C.45	237

32.1C.46	237
32.1C.47	237
32.1C.48	237
32.1C.49	238
32.1C.4A	238
32.1C.56	238
32.1C.57	238
32.1C.58	238
32.1C.60	239
32.1C.61	239
32.1C.62	239
32.1C.68	239
32.1C.69	239
32.1C.6A	239
32.1C.6D	240
33.WX.YZ error messages	240
33.* errors	240
33.01.xx	240
33.02.01 Used board/disk installed	240
33.02.02	241
33.03.02	241
33.03.03 Incompatible formatter installed.	241
33.03.05 EFI Boot error	244
33.03.06	245
33.04.01 Missing TPM	246
33.04.02 Missing TPM	246
33.04.03 Unknown TPM	246
33.04.05	247
33.05.0z SureStart errors	247
33.05.1x Whitelisting errors	248
33.05.2x Intrusion detection errors	248
33.05.5z Intrusion detection errors	249
33.06.01	250
40.WX.YZ error messages	251
40.* errors	251
40.00.01 USB I/O buffer overflow To continue, touch “OK”	251
40.00.02 Embedded I/O buffer overflow To continue, touch “OK”	251
40.00.03 EIO [x] buffer overflow To continue, touch “OK”	251
40.00.04 EIO [x] bad transmission To continue, touch “OK”	252
40.00.05 Embedded I/O bad transmission To continue, touch OK	252
40.08.0x USB storage accessory removed	252
40.0x.05 USB storage accessory removed	252
40.80.04 Failed to read NVRAM	252
41.WX.YZ error messages	253
41.01.YZ	253
41.02.00 Error	256
41.03.FZ Unknown Misprint Error	257
41.03.YZ Unexpected size in tray <X>	259

41.04.YZ Printer Error	260
41.05.YZ Unexpected type in tray <X>	263
41.07.72 Printer Error	264
41.WX.YZ Error To continue, touch "OK"	265
42.WX.YZ error messages	270
42.* errors	270
44.WX.YZ error messages	270
44.* errors	270
44.01.xx Error Event log message	271
44.03.xx Error Event log message	271
44.10.xx Error Event log message (Multifunction product only.)	271
44.34.xx Error Event log message	272
44.34.03 Fax Modem Failure	272
44.34.E5 Fax Modem Failure	272
44.90.xx, 44.91.xx, 44.92.xx Error Event log message	273
44.A0.YZ Error Event log message	273
46.WX.YZ error messages	273
46.* error messages	273
46.21.52	274
47.WX.YZ error messages	275
47.* errors	275
47.00.xx	275
47.01.xx	276
47.02.xx	276
47.03.xx	277
47.04.xx	277
47.05.xx	278
47.06.xx	278
47.FC.yz Printer Calibration Failed To continue, touch "OK"	279
48.WX.YZ error messages	280
48.* errors	280
49.WX.YZ error messages	281
49.XX.YY Error To continue turn off then on	281
49.21.52	282
49.38.07	282
50.WX.YZ error messages	283
50.* errors	283
50.1X.YZ	283
50.2X.YZ	284
50.3X.YZ	285
50.4X.YZ	286
50.6X.YZ	287
50.7X.YZ	288
50.8X.YZ	289
50.9X.YZ	290
50.AX.YZ	291
50.BX.YZ	292

51.WX.YZ, 52.WX.YZ error messages.....	293
51.* errors.....	293
52.* errors.....	293
51.00.YZ	294
52.00.00/52.00.20 Scanner Startup/Rotation error	294
53.wx.yz error messages.....	295
53.A0.y0	295
53.A0.y1	295
53.A1.y0 Enter error message	296
53.A1.y1.....	297
53.A2.y0	298
53.A2.y1	298
53.B0.0z.....	299
53.B1.0z	299
53.B2.0z	300
53.B3.0z	300
53.C1.0z Tray "Z" size mismatch.	301
54.WX.YZ error messages.....	302
54.* errors.....	302
54.00.01 / 54.00.03 (event log only)	302
54.00.06 or 54.00.14 or 54.00.19 (event log only)	303
54.01.05 (event log only)	304
54.06.21 (event log only)	304
54.14.00 (event log only)	305
54.0B.YZ (event log only)	306
54.0C.0Z or 54.0D.0Z (event log only)	308
54.0E.YZ (event log only)	310
54.0F.YZ (event log only)	310
54.0X.07 (event log only)	312
54.0X.0B or 54.0X.0C or 54.0X.0D or 54.0X.0E (event log only)	313
55.WX.YZ, 56.WX.YZ error messages.....	314
55.* errors.....	314
55.00.01, 55.00.03 or 55.00.04 DC Controller Error	315
55.00.05 Engine Firmware RFU Error	318
55.01.06, 55.02.06 DC controller error To continue turn off then on	319
55.01.07 Fuser NVRAM memory warning	322
56.* errors.....	324
56.00.YZ	324
56.00.01 Illegal Input Printer Error	325
57.WX.YZ error messages.....	325
57.WX.YZ error messages.....	325
58.WX.YZ error messages.....	329
58.* errors.....	329
58.00.02 Error	330
58.00.03 Error	330
58.00.04 Error	333
58.01.04 Error	334

58.02.04 Error	335
59.WX.YZ error messages	336
59.* errors.....	336
59.00.00 Motor error	336
59.00.04 Duplex Motor error	339
59.00.30 or 59.00.40: Fuser error	343
59.00.B0 Replace Toner Collection Unit	346
59.00.C0	347
59.00.F0	351
59.05.50 or 59.05.60	353
59.06.50 or 59.06.60 – 59.07.50 or 59.07.60	354
59.08.50 or 59.08.60	356
59.A3.03	357
59.A3.04	364
59.A3.05	367
60.00.0Y, 61.00.00, 62.00.00 error messages.....	370
60.* errors.....	370
60.01.0z Lift motor error	370
60.10.0z Paper Pickup Mechanism error	372
62.* errors.....	374
62.00.00 No system To continue turn off then on	375
65.WX.YZ error messages	376
65.* errors.....	376
66.WX.YZ error messages	376
66.* errors.....	376
66.00.77 Output accessory failure	376
66.00.0A Output accessory failure	377
66.80.01 and 66.80.02 device failure	377
66.80.03, 66.80.19, 66.80.20 or 66.80.35 device failure	378
66.80.17 device failure	378
66.80.21, 66.80.22, 66.80.23, and 66.80.33 device failure	379
70.WX.YZ error messages.....	380
70.* errors.....	380
70.00.00 Error To continue turn off then on	380
80.WX.YZ, 81.WX.YZ, 82.WX.YZ error messages	381
80.* errors.....	381
80.0X.YZ Embedded Jetdirect Error	384
81.WX.YZ EIO Error To continue turn off then on	386
81.09.00 Error	388
82.* errors.....	389
82.73.46, 82.73.47	390
90.WX.YZ error messages	390
90.* errors.....	390
90.15.00	391
90.15.01	391
98.0X.0Y error messages	392

98.* errors.....	392
98.00.01 or 98.01.00 Corrupt data in firmware volume	392
98.00.02 Corrupt data in the solutions volume	393
98.00.03 Corrupt data in the configuration volume	393
98.00.04 Corrupt data in the job data volume	394
99.WXYZ error messages.....	394
99.* errors.....	394
99.00.01 Upgrade not performed file is corrupt	395
99.00.02 Upgrade not performed timeout during receive	395
99.00.03 Upgrade not performed error writing to disk	396
99.00.04 Upgrade not performed timeout during receive	396
99.00.05 Upgrade not performed timeout during receive	397
99.00.06 Upgrade not performed error reading upgrade	397
99.00.07 Upgrade not performed error reading upgrade	398
99.00.08 Upgrade not performed error reading upgrade	398
99.00.09 Upgrade canceled by user	399
99.00.10 Upgrade canceled by user	399
99.00.11 Upgrade canceled by user	399
99.00.12 Upgrade not performed the file is invalid	399
99.00.13 Upgrade not performed the file is invalid	400
99.00.14 Upgrade not performed the file is invalid	400
99.00.2x	400
99.01.xx	401
99.02.01	401
99.02.09	402
99.07.YZ Firmware install error (MFP - fax only)	402
99.07.22 Firmware install error	403
99.09.60 Unsupported disk	405
99.09.61 Unsupported disk	405
99.09.62 Unknown disk	406
99.09.63 Incorrect disk	406
99.09.64 Disk Nonfunctional	407
99.09.65 Disk data error	407
99.09.66 No boot device.	408
99.09.67 Disk is not bootable please download firmware	409
99.39.64 eMMC Nonfunctional	410
99.39.67 eMMC Not Bootable	410

7 Alphabetical control panel messages..... 412

Alphabetical error messages.....	412
Accept bad signature	412
Authentication required	412
Bad optional tray connection	412
Binname full	413
Calibration reset pending	414
Canceling..<jobname>	414
Cartridge low	414
Cartridge Memory Abnormal	414
Cartridge out	414

Checking engine	415
Checking paper path	415
Chosen personality not available To continue touch "OK"	415
Cleaning disk <X> complete Do not power off	415
Cleaning	415
Clearing activity log	416
Clearing event log	416
Clearing paper path	416
Close right door	416
Close front door	417
Communication lost	417
Cooling device	423
Data received To print last page press "OK"	423
Data received To print last page press "OK"	423
Event log is empty	423
Expected drive missing	424
External device initializing	424
Fuser Kit low	424
Fuser Kit very low To continue, touch "OK"	424
Gateways failed	425
Genuine HP supply installed	425
HP Secure hard drive disabled	425
Incompatible <Supply>	425
Incompatible supplies	425
Initializing... ..	425
Install fuser unit	426
Install supplies	426
Internal disk device failure To clear touch "OK"	426
Internal disk device failure To clear touch "OK"	427
Internal disk file operation failed	427
Internal disk file system is full	427
Internal disk not found	427
Internal disk not functional	427
Internal disk not initialized	428
Internal disk spinning up	428
Load Tray <X>: [Type], [Size] To use another tray, press "OK"	428
Loading program <XX> Do not power off	429
Manually feed output stack Then touch "OK" to print second side	430
Manually feed: <Type><Size>	430
Moving solenoid To exit press Stop	430
Moving solenoid and motor	430
No job to cancel	430
No USB drive or files found.....	431
NON HP Supply Installed	437
Output Bin Full	438
Paused... ..	438
Performing Paper Path Test	438
Please Wait... ..	438
Printing Configuration... ..	439

Printing Demo Page	439
Printing engine test... ..	439
Printing Event Log... ..	439
Printing File Directory... ..	439
Printing Font List... ..	439
Printing Help Page... ..	440
Printing Menu Map... ..	440
Printing stopped... ..	440
Printing Supplies Status Page... ..	440
Printing Usage Page... ..	440
Processing... ..	441
Processing... copy <x> of <y>	441
Processing duplex job Do not grab paper until job completes	441
Processing job from tray <x>... Do not grab paper until job completes	441
RAM disk device failure To clear press "OK"	441
RAM disk file operation failed To clear press "OK"	441
RAM disk file system is full To clear press "OK"	442
RAM disk not initialized	442
RAM disk is write protected To clear press "OK"	442
Ready	442
Ready <IP Address>	442
Receiving Upgrade	442
Remove USB accessory	442
Replace <Supply>	443
Replace Supplies	443
Resend external accessory firmware	443
Resend Upgrade	444
Restore Factory Settings	444
RFU Load Error Send full RFU on <X> Port	444
ROM disk device failed To clear press "OK"	444
ROM disk file operation failed To clear press "OK"	444
ROM disk file system is full To clear press "OK"	444
ROM disk is write protected To clear press "OK"	445
ROM disk not initialized To clear press "OK"	445
Rotating Motor	445
Sanitizing disk <X> complete Do Not power off	445
Size mismatch in Tray <X>	445
Sleep mode on	447
Supplies low	447
Supply memory warning	447
The unit has corrupt data	447
Too many jobs in queue	448
Tray <X> empty: [Type], [Size]	448
Tray <X> lifting	449
Tray <X> open	449
Tray <X> overfilled	450
Type mismatch Tray <x>	452
Unsupported drive installed To continue, touch "OK"	452
Unsupported supply in use OR Unsupported supply installed To continue, touch "OK"	452

Unsupported tray configuration	453
Unsupported USB accessory detected Remove USB accessory	453
USB device is not responding. Please remove it.....	453
USB accessory not functional	453
USB hubs are not fully supported Some operations may not work properly	454
USB is write protected To clear press "OK"	454
USB needs too much power Remove USB and then turn off and on	454
USB not initialized	454
USB storage accessory removed Clearing any associated data	455
USB storage device failure To clear press "OK"	455
USB storage file operation failed To clear press "OK"	455
USB storage file system is full To clear press "OK"	455
Used supply installed To continue, touch "OK" OR Used supply in use	455
Verifying, Please Wait	455
Waiting for tray <x> to lift	456

Index.....	457
------------	-----

1 Document last updated

The following is the last time this document was updated:

Last update: June 7, 2024

2 About this document

This document provides error-code troubleshooting information.



IMPORTANT: Procedures and part numbers change. For current information, use the browser-based format.

Verify PDF is the most current before use. PDF part numbers must be verified with web-based error code information or parts look-up before parts are ordered.

Choose the format that best meets your needs.

Table 2-1 Content format types

Format	Document title example	Recommended use
Web-based	Go to: Product Detail page > Error Code Look-up	Quick access to individual web-based error code troubleshooting TIP: Save Product Detail page URL location in favorites
Web-Base	Go To: WISE default Search page > Enter [Product] and error code	- Access to individual web-based error code troubleshooting - Web-based: Most up-to-date information available
PDF	[Product] - Control Panel Message Document (CPMD) PDF	- Use when support portals are NOT accessible at time of service - Use when a printable document is needed NOTE: Always refer to the printer service manual for removal and replacement procedures NOTE: For current information, use the Web-based format.

3 Control-panel message types

The control-panel messages and event code entries indicate the current printer status or situations that might require action.



NOTE: Event log errors do not appear on the control-panel display. Open the event log to view or print the event log errors.

A control-panel message displays temporarily and might require you (or the applicable user) to acknowledge the message by touching the **OK** button to resume printing or by touching the **Stop** button to cancel the job.

With certain messages, the job might not finish printing, or the print quality might be affected. If the message is related to printing and the auto-continue feature is on, the printer will attempt to resume printing after the message has appeared for 10 seconds without acknowledgement.

For some messages, restarting the printer might fix the problem. If a critical error persists, the printer might require service.

Error-code and control-panel-message troubleshooting overview

This section provides information on error codes and searching for information.

Error codes (types and structure)

Error codes and control-panel messages display on the printer control panel to indicate the current printer status or situations that might require action. Error codes are numerical, or alphanumerical, and have a set structure with six characters (example: 13.WX.YZ).

- The first two characters are numeric and represent the system component that is causing the error. For example, in error code 10 . 22 . 15, **10** = **Supplies** for HP LaserJets.
- The remaining four characters (W, X, Y, and Z values) further define the error.

HP LaserJet and HP PageWide Enterprise error codes are documented in the control panel message document (CPMD) for each printer.

The CPMD is a comprehensive list of error codes, diagnostic and troubleshooting steps to clear or resolve the error, and other helpful information such as service mode pins and part numbers.

The CPMD is continually updated and republished with the latest information for the following error codes.

Table 3-1 ERROR CODES: The first two characters

Error code	System Component	System Error Description
10.WX.YZ	Supplies (LaserJet)	Supply error or supply memory error.
11.WX.YZ	Real-time clock	Internal error with the clock on the formatter.
13.WX.YZ	Jam (LaserJet)	Paper jam or open door jam error.

Table 3-1 ERROR CODES: The first two characters (continued)

Error code	System Component	System Error Description
15.WX.YZ	Jam (PageWide)	Paper jam or open door jam error.
17.WX.YZ	Supplies (PageWide)	Supply error or supply memory error.
20.WX.YZ	Printer memory	Insufficient memory or buffering error.
21.WX.YZ	Page	Page complexity causing a decompression error when trying to process job.
30.WX.YZ	Scanner	Flatbed scanner error occurring inside the unit.
31.WX.YZ	Document feeder	Document feeder, scanner, or jam error.
32.WX.YZ	Backup, restore, or reset	Backup, restore, or reset notification or error.
33.WX.YZ	Security	Backup, Disk, EFI BIOS, Firmware integrity (SureStart), or Trusted Platform Module (TPM) notification or error.
40.WX.YZ	Input/Output (I/O)	Partition manager, secure erase, or USB accessory error.
41.WX.YZ	Fuser, Laser scanner, or Paper path	Miscellaneous error including general and misprint or mismatch errors typically involving (but not limited to) the fuser, the laser scanner, or the paper path.
42.WX.YZ	Firmware	Firmware failure involving the Event Log, Shell, System Manager, or other component.
44.WX.YZ	Firmware	Firmware failure involving a digital sending component.
45.WX.YZ	OXPd/Web Kit (PageWide)	Informational notifications involving the OXPd Web Kit (communications log).
46.WX.YZ	Engine (LaserJet)	Engine communication error.
47.WX.YZ	Firmware	Job parser or printer calibration error.
48.WX.YZ	Firmware	PJA job accounting, job management, or job pipeline error.
49.WX.YZ	Firmware	Firmware communication error.
50.WX.YZ	Fuser (LaserJet)	Fuser error.
51.WX.YZ	Laser scanner (LaserJet)	Laser scanner beam error.
52.WX.YZ	Laser scanner (LaserJet)	Laser scanner startup error.
54.WX.YZ	Sensor	Sensor error (not jam related).
55.WX.YZ	DC controller (LaserJet)	DC controller communication error.
56.WX.YZ	Paper handling (LaserJet)	Paper input/output or accessory error.
57.WX.YZ	Fan	Fan error.
58.WX.YZ	Sensor	Engine sensor failure.
59.WX.YZ	Motor (LaserJet)	Motor error.
60.WX.YZ	Tray motor error (LaserJet)	Tray lifting or pick up error.
61.WX.YZ	Engine (PageWide)	Print engine error with the 8-bit data package.

Table 3-1 ERROR CODES: The first two characters (continued)

Error code	System Component	System Error Description
62.WX.YZ	System (LaserJet)	LaserJet internal system error.
	Print bar (PageWide)	PageWide print system error.
63.WX.YZ	Engine (LaserJet)	General engine error (electrical, communication, etc.).
65.WX.YZ	Connector	Output accessory connection error.
66.WX.YZ	Output accessory	Output accessory error.
67.WX.YZ	Input accessory	Input accessory connection error
69.WX.YZ	Duplexer	Duplexer error.
70.WX.YZ	DC controller (LaserJet)	DC controller firmware error.
76.WX.YZ	DC controller (LaserJet)	Power supply fluctuations causes formatter and DC controller communication issue and results them not to be in synchronization.
80.WX.YZ	Managed device	Embedded Jetdirect error.
81.WX.YZ	Near Field Communication (NFC)	Wireless, Bluetooth or internal EIO error.
82.WX.YZ	Memory (hard disk, EMMC, etc.)	Disk hardware error.
90.WX.YZ	Internal diagnostics	Internal test of systems (i.e. disk, CPB, display) or interconnection error.
98.WX.YZ	Hard disk	Hard disk partition error.
99.WX.YZ	Firmware installer	Remote Firmware Upgrade (RFU), firmware install (engine or accessory), or disk error.

4 How to search for printer documentation

The CPMD, error codes, and other support documentation for each printer is available on the HP portals.

For HP internal access to WISE, go to [WISE](#).

For HP channel partners access WISE, see [Accessing WISE for HP channel partners \(HP Partner Portal\) on page 6](#) or [Accessing WISE for HP channel partners \(CSDP\)](#).

WISE is available to call agents, service technicians, and HP internal users. The level of detail available depends on your access credentials. To learn how to find support content in WISE, [watch the video here](#).

WISE - How to access and use

Learn how to access and use Web-based Interactive Search Engines (WISE) to locate available support information. WISE is a repository of technical support documentation including service manuals, user guides, videos, and general support information.

Accessing WISE

Learn how to access Web-based Interactive Search Engines (WISE) if you are an HP channel partner or an internal HP user.

Accessing WISE for HP channel partners (HP Partner Portal)


Learn how to access WISE by accessing the HP Partner Portal if you are an HP Channel Partner.

 **NOTE:** If this is your first visit to the HP Partner Portal, you will be asked to create an account. Follow the setup directions using your HP Partner credentials.

 [View a video of how to access WISE for HP channel partners](#)


1. Sign-in to the HP Partner Portal (click <https://partner.hp.com> to access the sign-in page).

Figure 4-1 HP Partner Portal sign-in page

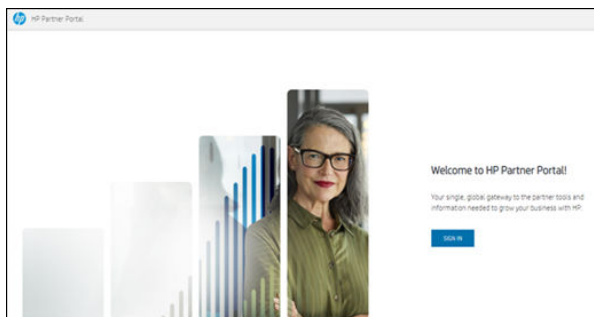


2. On the HP Partner Portal home page, click the **Services & Support** item.

Figure 4-2 HP Partner Portal home page

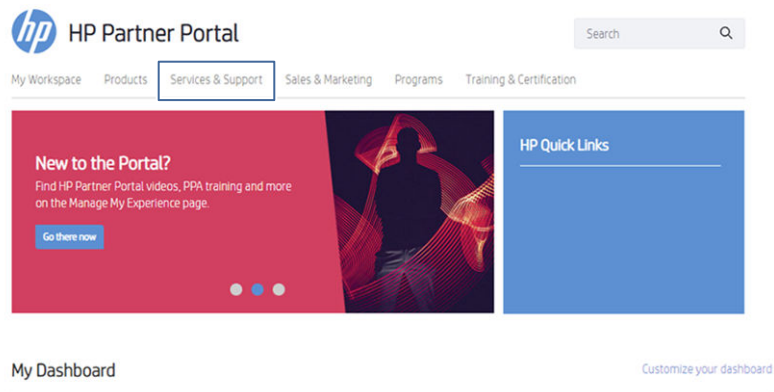


3. Select the **Technical Support (WISE)** item.

Figure 4-3 HP Partner Portal Service & Support page

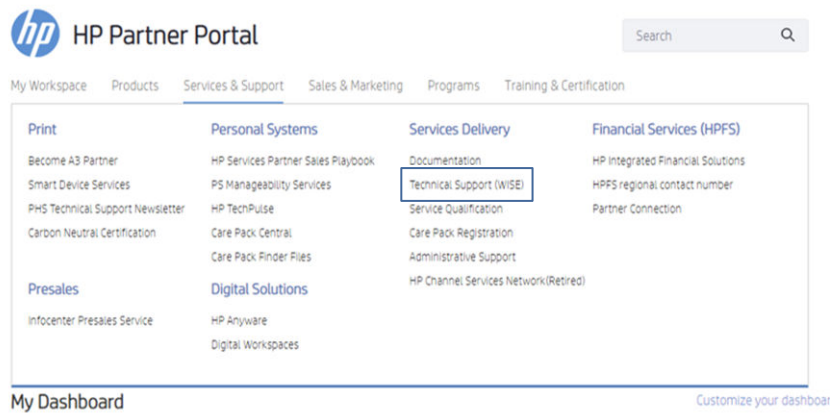


4. Select the **Technical Documentation** item.

Figure 4-4 HP Partner Portal Technical Support (WISE)page

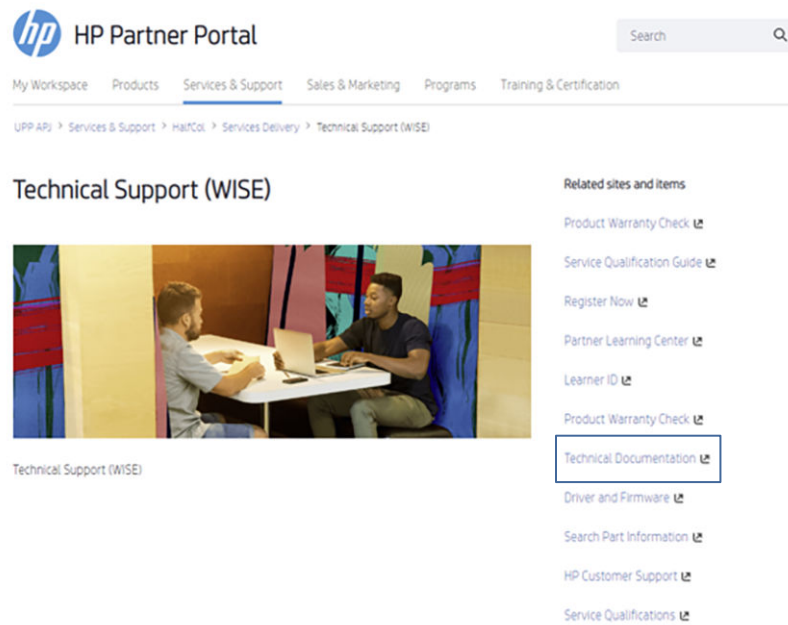

5. Use the WISE portal to search for printer information.

Figure 4-5 WISE portal home page

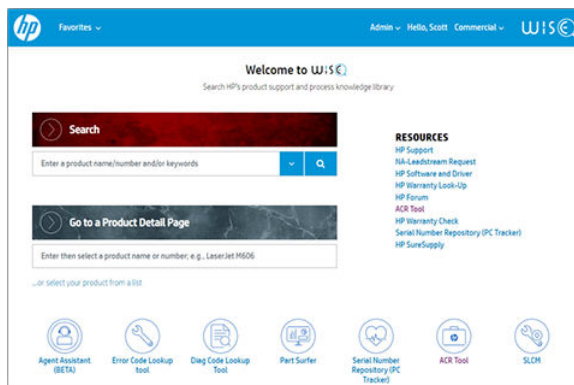

Accessing WISE for internal HP users

Learn how to access WISE if you are an internal HP user.

1. Open one of the Web-based Interactive Search Engines (WISE) URLs listed below.

Americas (AMS)

- [WISE - English](#)
- [WISE - Spanish](#)
- [WISE - Portuguese](#)
- [WISE - French](#)

Asia Pacific / Japan (APJ)


- [WISE - English](#)
- [WISE - Japanese](#)
- [WISE - Korean](#)
- [WISE - Chinese \(simplified\)](#)
- [WISE - Chinese \(traditional\)](#)
- [WISE - Thai](#)

Europe / Middle East / Africa (EMEA)


- [WISE - English](#)

2. Select **Commercial** from the drop-down menu.

Figure 4-6 Choose an experience

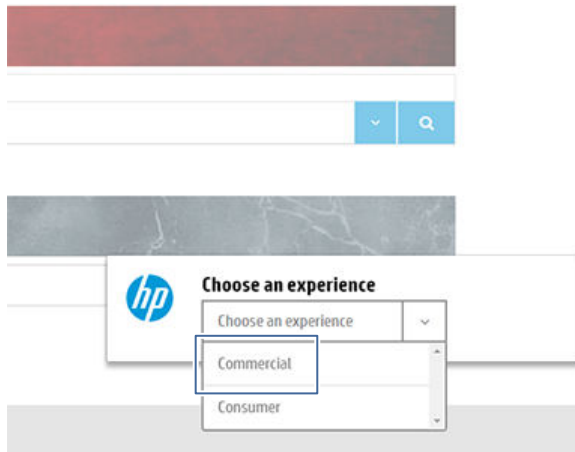

3. The WISE home page appears.

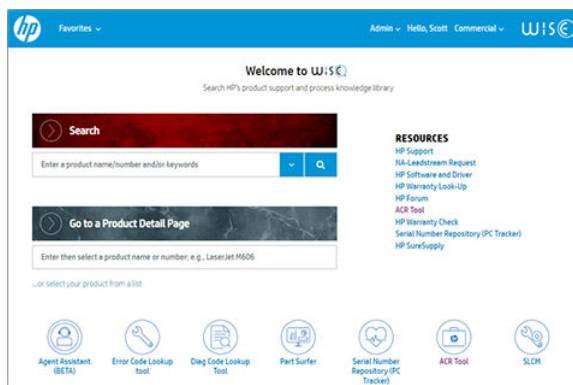

Play the video:



[View a video of how access WISE \(internal HP users\)](#)

Using WISE to search for error codes

Learn how to use WISE to look up error codes.



NOTE: The model used in the instructional videos is an example. The same steps apply to all printer models.

You will need the printer type (e.g. HP LaserJet), model number (e.g. M607), and bundle option (e.g. dn, dh, z).

Search for error codes using the lookup widget

Learn how to search for a specific error code using the WISE Error Code Lookup widget.

1. Enter a printer model number (for example, M606) in the **Go to a Product Detail page** dialog box.



TIP: To find a Product Detail Page (PDP) from a list of products by product type, select the **...or select your product from a list** item just below the dialog box.

The screenshot shows the WISE search interface. At the top is a red 'Search' bar with a magnifying glass icon. Below it is a text input field with the placeholder 'Enter a product name/number and/or keywords' and a blue search button. Below the search bar is a dark blue 'Go to a Product Detail Page' dialog box. Inside the dialog box is a text input field with the placeholder 'Enter then select a product name or number; e.g., LaserJet M606'. Below the input field is a link that says '...or select your product from a list'.

2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.



NOTE: Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

The screenshot shows the 'Go to a Product Detail Page' dialog box with a drop-down list. The input field contains 'M606'. The drop-down list is open, showing several options. The first option, 'HP LaserJet Enterprise M606 series', is circled in blue. Below it are several other options: 'E6B73AR', 'E6B72A', 'E6B73V', 'E6B73A', and 'E6B72V'.

3. Type the error code (for example, 13.E1.D3) in the **Error Code Lookup** field, and then select the search icon.

Error Code Lookup

Enter a specific error code in the field below, e.g. 13.b7 d7

1 2

Other Content

- Advisories (0)
- Bulletins (21)
- Guides, Manuals, etc. (76)
- Notices (1)
- Product Change Not... (0)
- Software-Drivers-F...
- Top Issues (7)
- Videos (127)

4. The error code troubleshooting content displays in the **All Search Results** area.

All Search Results

13.E1.D3 Fuser Area Jam
Last Modified Date: "2022/03/11"
ish_1686515-1408419-16
Public

Click on the article to see the full content.

Recommended action for customers

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size...

13.* errors
Last Modified Date: "2022/11/30"
ish_1690706-842345-16
Public

Click on the article to see the full content.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open....

HP LaserJet Enterprise M607, M608, M608nk, M609, M610, M611, M612, HP LaserJet Managed E60055-E60075, E60155-E60175 printers - Control Panel Messages Document (CPMD)
Last Modified Date: "2022/11/22"
pdf_3366820_en-US-6
For HP And Channel Partner Internal Use

Play the video:



[View a video of how to search for error codes using the Product Detail Page \(PDP\) or the Error Code Lookup tool.](#)

Search for error codes from the WISE home page

Learn how to search for a specific error code from the WISE home page.

1. On the WISE home page, enter a printer model number (for example, M606) in the **Search** dialog box.

Search

Enter a product name/number and/or keywords

Go to a Product Detail Page


Enter then select a product name or number; e.g., LaserJet M606

...or select your product from a list


2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.




NOTE: Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

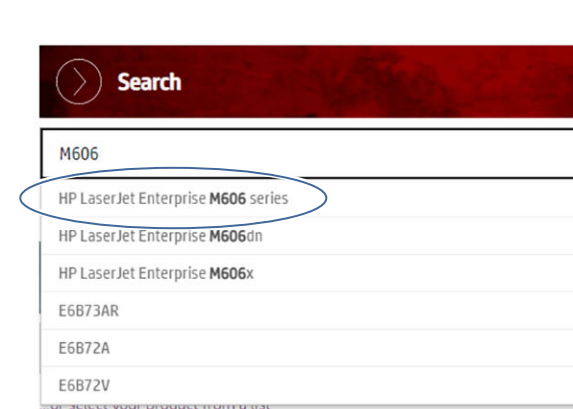

3. Type the error code (for example, 13.E1.D3) in the **Search** keyword field, and then select the search icon.

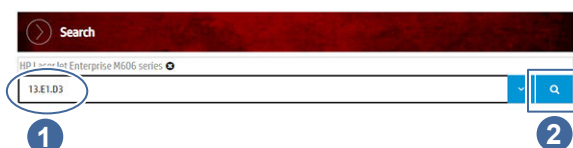

4. The error code troubleshooting content displays in the **All Search Results** area.

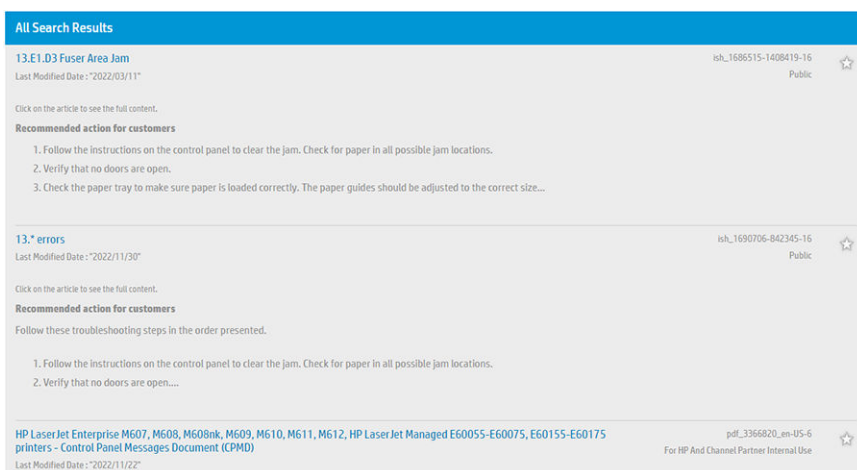

Using WISE to access repair and replace videos for FRUs

Learn how to use WISE to access repair and replace videos for FRUs.



NOTE: The model used in the instructional videos is an example. The same steps apply to all printer models.


You will need the printer type (e.g. HP LaserJet), model number (e.g. M607), and bundle option (e.g. dn, dh, z).

Search for videos using the Product Detail Page (PDP)

Learn how to search WISE for product specific information. Quickly review the steps and then play the video.


1. Enter a printer model number (for example, M606) in the **Go to a Product Detail page** dialog box.

 **TIP:** To find a Product Detail Page (PDP) from a list of products by product type, select the **...or select your product from a list** item just below the dialog box.

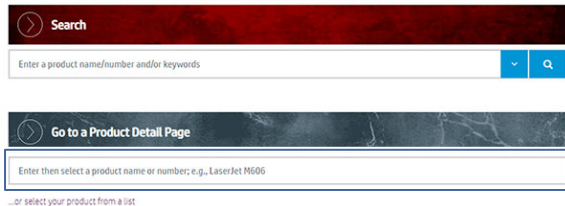


2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.

 **NOTE:** Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

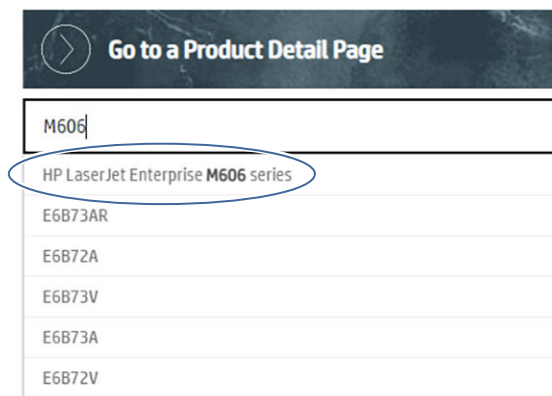


3. Select the link to **Videos** in the **Other Content** menu at the bottom-right of the screen.

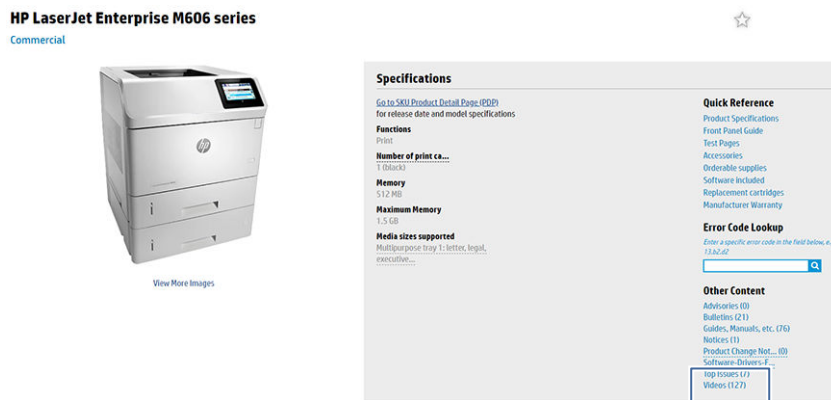

4. Select the desired video from the list of videos.



TIP: Select the **Add Or Remove Hardware & Customer Self Repair** filter under **Troubleshooting** to limit the search results to repair and replace videos.

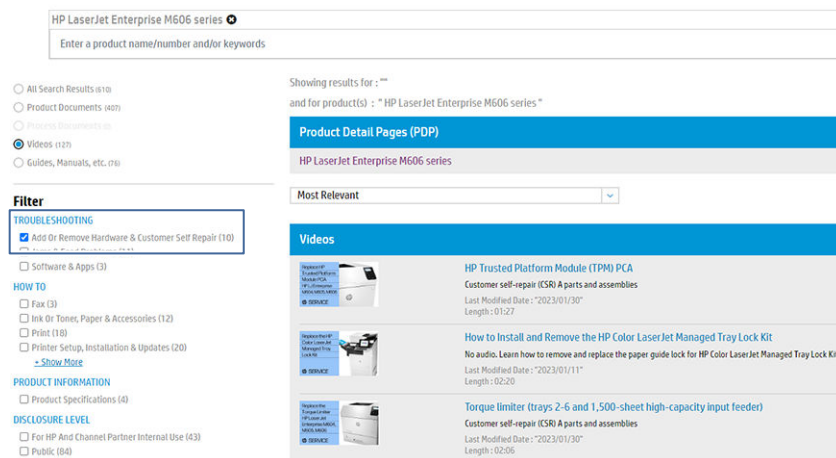

Play the video:




[View a video of how to search for the printer's Product Detail Page \(PDP\)](#)

Search for videos using the WISE search function


Learn how to search WISE using the model number. Quickly review the steps and then play the video.

1. On the WISE home page, enter a printer model number (for example, M606) in the **Search** dialog box.

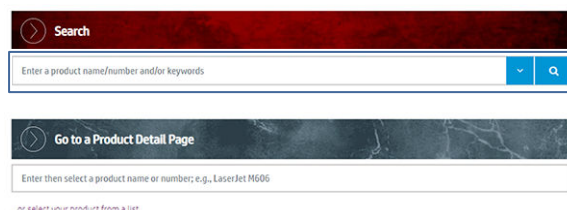


2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.


 **NOTE:** Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

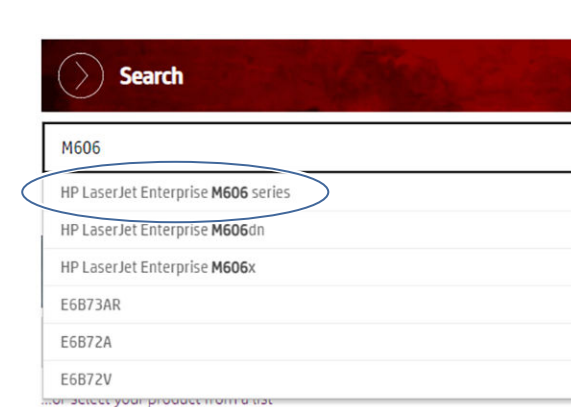

3. Select the search icon.

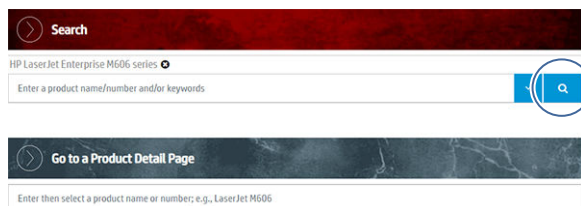

4. To refine the search results, select the radio button labeled **Videos** in the upper-right portion of the screen.

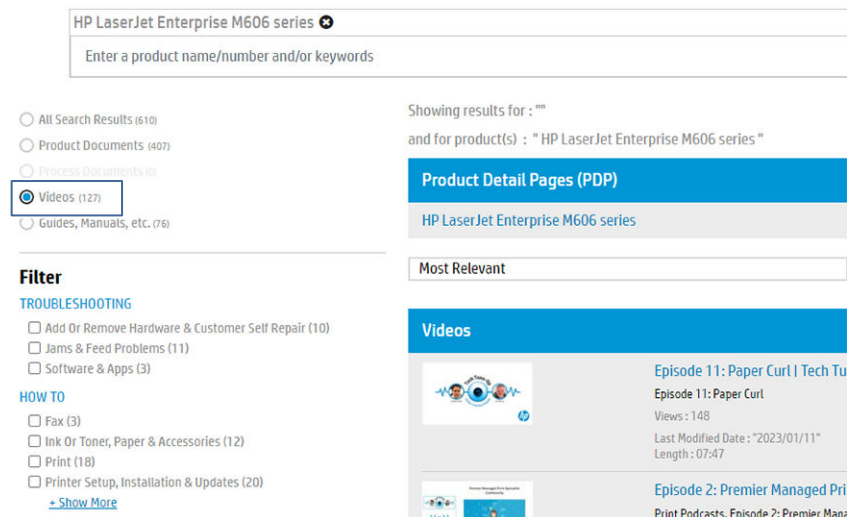

 **TIP:** To refine video search results, type a part name in the keyword search bar, and then select the search icon. For example, entering the word **fuser** to the keyword search bar returns videos related to repair and replacement of the fuser.

HP LaserJet Enterprise M606 series

Fuser

All Search Results (34)

Product Documents (28)

Process Documents (8)

Videos (2)

Guides, Manuals, etc. (4)

Filter

TROUBLESHOOTING

Add Or Remove Hardware & Customer Self Repair (1)

Jams & Feed Problems (1)

DISCLOSURE LEVEL

Public (2)

Showing results for : "fuser"

and for product(s) : "HP LaserJet Enterprise M606 series"

Product Detail Pages (PDP)

HP LaserJet Enterprise M606 series

Most Relevant

Videos

Fuser jams

HP LaserJet

HP Fuser Kit

Enterprise M606

Series L6060

HOW TO

Clear paper jams in the fuser area

Clear paper jams

Last Modified Date : "2022/08/03"

Length : 01:51

Replace the Fuser

HP LaserJet Enterprise M606

Series M606

HOW TO

No audio. Customer self-repair (CSR) A parts and assemblies.

Last Modified Date : "2022/08/03"

Length : 01:54

Play the video:



[View a video of how to perform a model number search](#)

5 Printer service information

Last update: June 7, 2024

Service mode PIN numbers:

- M652/M653/E65050/E65060/E65150/E65160: 05065217
- M681/M682/E67550/E67560/E67659/E67660: 05068117



NOTE: When possible, always update the printer firmware to the latest available version at [HP.com](https://www.hp.com) as part of the troubleshooting performed for any of the following errors.

After the firmware updates, re-enable autosend through the control panel

6 Numerical control panel messages

Use the following numerical error message troubleshooting to resolve your issue.

10.WX.YZ error messages

10.wx.yz error messages

Errors in the 10.* family are related to toner cartridges and other supply items that require regular replacement as part of routine printer maintenance.

Order replacement supplies and install them as necessary. To order parts, go to <https://www.hp.com/buy/parts>.

Use the following list to identify the supply item affected:



NOTE: Not all printers have all of these supplies.

- 10.00.XX = Black toner cartridge
- 10.01.XX = Cyan toner cartridge
- 10.02.XX = Magenta toner cartridge
- 10.03.XX = Yellow toner cartridge
- 10.10.XX = Transfer roller
- 10.22.XX = Transfer Belt
- 10.23.XX = Fuser kit
- 10.31.XX = Toner collection unit
- 10.39.XX = Document feeder kit
- 10.99.XX = One or more supply items have been installed

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

To order parts, go to <https://www.hp.com/buy/parts>.

1. For toner cartridges:
 - a. Remove and reinstall the cartridge.

4. Close the front door.
5. If the message displays again, turn the printer off, then on again.
6. If the error persists, replace the toner cartridge.

HP 655A Black laser toner cartridge part number: CF450A

HP 655A Cyan laser toner cartridge part number: CF451A

HP 655A Magenta laser toner cartridge part number: CF452A

HP 655A Yellow laser toner cartridge part number: CF453A

HP 656X High capacity Black laser toner cartridge part number: CF460A

HP 656X High capacity Cyan laser toner cartridge part number: CF461A

HP 656X High capacity Magenta laser toner cartridge part number: CF456A

HP 656X High capacity Yellow laser toner cartridge part number: CF463A

HP 657X High capacity replacement Black laser toner cartridge part number: CF470A

HP 657X High capacity replacement Cyan laser toner cartridge part number: CF471A

HP 657X High capacity replacement Magenta laser toner cartridge part number: CF476A

HP 657X High capacity replacement Yellow laser toner cartridge part number: CF473A

10.0x.10 Supply memory error

The printer is unable to read the toner cartridge data. The toner cartridge is present but defective.

When this error occurs, a question mark appears on the gas gauge of the supply or supplies with the error.

If multiple supplies have this error, a 10.0X.10 error for the first supply detected with the error displays. After the error corresponding to the first supply is resolved, another 10.0X.00 error displays for the next supply. This continues for all supplies memory errors.

- **10.00.10** Black toner cartridge
- **10.01.10** Cyan toner cartridge
- **10.02.10** Magenta toner cartridge
- **10.03.10** Yellow toner cartridge

Recommended action

1. Open the front door and remove the toner cartridge.
2. Check the electronic chip on the cartridge if it is visible. If the chip is damaged, replace the toner cartridge.
3. Reinstall the toner cartridge.
4. Close the front door. If the message reappears, turn the printer off, and then on.
5. If the error persists, replace the toner cartridge.

HP 655A Black laser toner cartridge part number: CF450A

HP 655A Cyan laser toner cartridge part number: CF451A
HP 655A Magenta laser toner cartridge part number: CF452A
HP 655A Yellow laser toner cartridge part number: CF453A
HP 656X High capacity Black laser toner cartridge part number: CF460A
HP 656X High capacity Cyan laser toner cartridge part number: CF461A
HP 656X High capacity Magenta laser toner cartridge part number: CF456A
HP 656X High capacity Yellow laser toner cartridge part number: CF463A
HP 657X High capacity replacement Black laser toner cartridge part number: CF470A
HP 657X High capacity replacement Cyan laser toner cartridge part number: CF471A
HP 657X High capacity replacement Magenta laser toner cartridge part number: CF476A
HP 657X High capacity replacement Yellow laser toner cartridge part number: CF473A

10.0x.15 Install <supply>

A supply is either not installed or not correctly installed in the printer.

The 10.XX.15 is an event log only message, it will not show on the control panel. The only message to display will be **Install <Supply>**.

- **10.00.15** Black toner cartridge (event code)
- **10.01.15** Cyan toner cartridge (event code)
- **10.02.15** Magenta toner cartridge (event code)
- **10.03.15** Yellow toner cartridge event code

Recommended action

- Replace or reinstall the toner cartridge correctly to continue printing.

HP 655A Black laser toner cartridge part number: CF450A
HP 655A Cyan laser toner cartridge part number: CF451A
HP 655A Magenta laser toner cartridge part number: CF452A
HP 655A Yellow laser toner cartridge part number: CF453A
HP 656X High capacity Black laser toner cartridge part number: CF460A
HP 656X High capacity Cyan laser toner cartridge part number: CF461A
HP 656X High capacity Magenta laser toner cartridge part number: CF456A
HP 656X High capacity Yellow laser toner cartridge part number: CF463A
HP 657X High capacity replacement Black laser toner cartridge part number: CF470A
HP 657X High capacity replacement Cyan laser toner cartridge part number: CF471A
HP 657X High capacity replacement Magenta laser toner cartridge part number: CF476A
HP 657X High capacity replacement Yellow laser toner cartridge part number: CF473A

10 . 0x . 25 Wrong cartridge in <color> slot

The printer displays this message when a toner cartridge is installed in the wrong slot.

The 10.XX.25 is an event log only message, it will not show on the control panel. The only message to display will be **Wrong cartridge in <color> slot**.

The indicated cartridge is installed in the wrong position:

- **10.00.25** Black toner cartridge (event code)
- **10.01.25** Cyan toner cartridge (event code)
- **10.02.25** Magenta toner cartridge (event code)
- **10.03.25** Yellow toner cartridge (event code)

Recommended action

- Reinstall the toner cartridges in the correct slots.

From left to right, the toner cartridges should be installed in this order:

- Yellow
- Magenta
- Cyan
- Black

10 . 0x . 35 Incompatible <supply>

The printer displays this message when the indicated supply is not compatible with this printer.

The 10.XX.35 is an event log only message, it will not show on the control panel. The only message to display will be **Incompatible <supply>**.

- **10.00.35** Black toner cartridge (event code)
- **10.01.35** Cyan toner cartridge (event code)
- **10.02.35** Magenta toner cartridge (event code)
- **10.03.35** Yellow toner cartridge (event code)

Recommended action

- Install a cartridge that is designed for this printer.

HP 655A Black laser toner cartridge part number: CF450A

HP 655A Cyan laser toner cartridge part number: CF451A

HP 655A Magenta laser toner cartridge part number: CF452A

HP 655A Yellow laser toner cartridge part number: CF453A

HP 656X High capacity Black laser toner cartridge part number: CF460A

HP 656X High capacity Cyan laser toner cartridge part number: CF461A

HP 656X High capacity Magenta laser toner cartridge part number: CF456A
HP 656X High capacity Yellow laser toner cartridge part number: CF463A
HP 657X High capacity replacement Black laser toner cartridge part number: CF470A
HP 657X High capacity replacement Cyan laser toner cartridge part number: CF471A
HP 657X High capacity replacement Magenta laser toner cartridge part number: CF476A
HP 657X High capacity replacement Yellow laser toner cartridge part number: CF473A

10.00.59

Black cartridge has been replaced with non-new cartridge

This is an **Event Log Only** message.

Recommended action

There is no action needed for this message.

- No action necessary.

10.00.60, 10.01.60, 10.02.60, or 10.03.60, <Supply> low

The printer indicates when a supply level is low. Actual toner cartridge life might vary. You do not need to replace the toner cartridge at this time unless print quality is no longer acceptable.

The 10.0X.60 is an event log only message, it will not show on the control panel. The only message to display will be **<Supply> low**.

- **10.00.60** Black toner cartridge (event code)
- **10.01.60** Cyan toner cartridge (event code)
- **10.02.60** Magenta toner cartridge (event code)
- **10.03.60** Yellow toner cartridge (event code)

Recommended action

- If the print quality is no longer acceptable, replace the toner cartridge.



NOTE: HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

HP 655A Black laser toner cartridge part number: CF450A
HP 655A Cyan laser toner cartridge part number: CF451A
HP 655A Magenta laser toner cartridge part number: CF452A
HP 655A Yellow laser toner cartridge part number: CF453A
HP 656X High capacity Black laser toner cartridge part number: CF460A
HP 656X High capacity Cyan laser toner cartridge part number: CF461A
HP 656X High capacity Magenta laser toner cartridge part number: CF456A
HP 656X High capacity Yellow laser toner cartridge part number: CF463A
HP 657X High capacity replacement Black laser toner cartridge part number: CF470A

HP 657X High capacity replacement Cyan laser toner cartridge part number: CF471A

HP 657X High capacity replacement Magenta laser toner cartridge part number: CF476A

HP 657X High capacity replacement Yellow laser toner cartridge part number: CF473A

10.00.69, 10.01.69, 10.02.69, or 10.03.69 <Supply> very low

The printer indicates when a supply level is very low. Actual toner cartridge life might vary. You do not need to replace the toner cartridge at this time unless the print quality is no longer acceptable.

The 10.0x.69 is an event log only message, it will not show on the control panel. The only message to display will be <Supply> very low.

- **10.00.69** Black toner cartridge very low (event code)
- **10.01.69** Cyan toner cartridge very low (event code)
- **10.02.69** Magenta toner cartridge very low (event code)
- **10.03.69** Yellow toner cartridge very low (event code)

Recommended action

- If the print quality is no longer acceptable, replace the toner cartridge.

 **NOTE:** HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

HP 655A Black laser toner cartridge part number: CF450A

HP 655A Cyan laser toner cartridge part number: CF451A

HP 655A Magenta laser toner cartridge part number: CF452A

HP 655A Yellow laser toner cartridge part number: CF453A

HP 656X High capacity Black laser toner cartridge part number: CF460A

HP 656X High capacity Cyan laser toner cartridge part number: CF461A

HP 656X High capacity Magenta laser toner cartridge part number: CF456A

HP 656X High capacity Yellow laser toner cartridge part number: CF463A

HP 657X High capacity replacement Black laser toner cartridge part number: CF470A

HP 657X High capacity replacement Cyan laser toner cartridge part number: CF471A

HP 657X High capacity replacement Magenta laser toner cartridge part number: CF476A

HP 657X High capacity replacement Yellow laser toner cartridge part number: CF473A

10.0x.70 Printing past very low

The printer indicates when one of the supplies is very low. The actual remaining supply life might vary. You do not need to replace the toner cartridge at this time unless the print quality is no longer acceptable.

The 10.XX.70 is an event log only message, it will not show on the control panel. The only message to display will be a warning message <Supply> very low.

- **10.00.70** Black toner cartridge (event code)

- **10.01.70** Cyan toner cartridge (event code)
- **10.02.70** Magenta toner cartridge (event code)
- **10.03.70** Yellow toner cartridge (event code)

Recommended action

- If the print quality is no longer acceptable, order a new toner cartridge.



NOTE: HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

HP 655A Black laser toner cartridge part number: CF450A

HP 655A Cyan laser toner cartridge part number: CF451A

HP 655A Magenta laser toner cartridge part number: CF452A

HP 655A Yellow laser toner cartridge part number: CF453A

HP 656X High capacity Black laser toner cartridge part number: CF460A

HP 656X High capacity Cyan laser toner cartridge part number: CF461A

HP 656X High capacity Magenta laser toner cartridge part number: CF456A

HP 656X High capacity Yellow laser toner cartridge part number: CF463A

HP 657X High capacity replacement Black laser toner cartridge part number: CF470A

HP 657X High capacity replacement Cyan laser toner cartridge part number: CF471A

HP 657X High capacity replacement Magenta laser toner cartridge part number: CF476A

HP 657X High capacity replacement Yellow laser toner cartridge part number: CF473A

10.0x.91 <supply> error

Toner cartridge motor stall.

- **10.00.91** Black toner cartridge
- **10.01.91** Cyan toner cartridge
- **10.02.91** Magenta toner cartridge
- **10.03.91** Yellow toner cartridge

Recommended action for customers

1. Open the front door and remove the failing toner cartridge.
2. Close the front door without the toner cartridge installed. Let the printer display the message [Install toner cartridge](#).
3. Reinstall the toner cartridge.
4. If the error persists, turn the printer off, and then on.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Open the front door and remove the failing toner cartridge.
2. Close the front door without the toner cartridge installed. Let the printer come to [Install toner cartridge](#).
3. Reinstall the toner cartridge.
4. If the error persists, perform the image-drum motors component test under the [Troubleshooting > Menu > Diagnostic test > Component test](#).
5. If one of the motors fails the test, replace the motor.

Part number: RM2-1956-000CN

For instructions:

- Drum motor 1: *Removal and replacement: Drum motor 1* See the Repair Service Manual for this product.
 - Drum motor 2: *Removal and replacement: Drum motor 2* See the Repair Service Manual for this product.
 - Drum motor 3: *Removal and replacement: Drum motor 3* See the Repair Service Manual for this product.
6. If the motors tests good, replace the toner cartridge.
HP 655A Black laser toner cartridge part number: CF450A
HP 655A Cyan laser toner cartridge part number: CF451A
HP 655A Magenta laser toner cartridge part number: CF452A
HP 655A Yellow laser toner cartridge part number: CF453A
HP 656X High capacity Black laser toner cartridge part number: CF460A
HP 656X High capacity Cyan laser toner cartridge part number: CF461A
HP 656X High capacity Magenta laser toner cartridge part number: CF456A
HP 656X High capacity Yellow laser toner cartridge part number: CF463A
HP 657X High capacity replacement Black laser toner cartridge part number: CF470A
HP 657X High capacity replacement Cyan laser toner cartridge part number: CF471A
HP 657X High capacity replacement Magenta laser toner cartridge part number: CF476A
HP 657X High capacity replacement Yellow laser toner cartridge part number: CF473A

10.0x.92 <Cartridge> error

Toner cartridges are not engaged.

- **10.00.92** Black toner cartridge
- **10.01.92** Cyan toner cartridge

- **10.02.92** Magenta toner cartridge
- **10.03.92** Yellow toner cartridge

Recommended action

1. Open the front door, and then remove and reinstall the toner cartridge.
2. Check the toner cartridge for any damage or defects.
3. Replace the toner cartridge.

HP 655A Black laser toner cartridge part number: CF450A

HP 655A Cyan laser toner cartridge part number: CF451A

HP 655A Magenta laser toner cartridge part number: CF452A

HP 655A Yellow laser toner cartridge part number: CF453A

HP 656X High capacity Black laser toner cartridge part number: CF460A

HP 656X High capacity Cyan laser toner cartridge part number: CF461A

HP 656X High capacity Magenta laser toner cartridge part number: CF456A

HP 656X High capacity Yellow laser toner cartridge part number: CF463A

HP 657X High capacity replacement Black laser toner cartridge part number: CF470A

HP 657X High capacity replacement Cyan laser toner cartridge part number: CF471A

HP 657X High capacity replacement Magenta laser toner cartridge part number: CF476A

HP 657X High capacity replacement Yellow laser toner cartridge part number: CF473A

10 . 22 . 15 Install transfer unit

The transfer unit or Intermediate Transfer Belt (ITB) has been removed or is installed incorrectly.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Install the intermediate transfer belt (ITB). If it is already installed, remove the ITB and then reinstall it.

Use the following table to order or replace the correct part number for your printer.

Table 6-1 ITB part number

Description	Part number
Image transfer belt (<i>Includes tray 2 transfer roller, paper pick-up roller, tray 2 separation roller, retard roller, and transfer roller guide.</i>)	P1B93-67901

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Intermediate transfer belt*

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Install the ITB. If it is already installed, remove the ITB and then reinstall it.

Use the following table to order or replace the ITB for the printer.

Table 6-2 ITB part number

Customer type	Part number	Description
Managed Print Services (MPS)	P1B93-69001	Intermediate Transfer Belt PM Kit
All others (non-MPS)	P1B93-67901	Image transfer belt - Includes tray 2 transfer roller, paper pick-up roller, tray 2 separation roller, retard roller, and transfer roller guide.

For instructions: *Removal and replacement: Intermediate transfer belt*

2. If the printer could not find the ITB contact alienation home position, check the ITB alienation sensor SR5.
3. Open the Component Test menu and use the ITB Contact/Alienation test to verify that the ITB alienation mechanism is functioning correctly.
4. If the mechanism does not function correctly, check and reconnect the connector J15 of the T1 roller alienation sensor, connectors J357, J350, and J351 on the high-voltage power supply -T PCA, and connector J118 on the DC controller PCA.
5. If the error persists, replace the fuser drive assembly.

Part number: RM2-1934-000CN

For instructions: *Removal and replacement: Fuser drive assembly* See the Repair Service Manual for this product.



NOTE: Replacing the fuser drive assembly involves removing the main drive assembly. Only perform this step after contacting HP support.

10 . 22 . 60 Transfer Kit low 10 . 22 . 69 Transfer Kit very low

The printer indicates when a supply level is low or very low.

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the intermediate transfer belt (ITB) kit when print quality becomes unacceptable.

Use the following table to order or replace the ITB for the printer.

Table 6-3 ITB part number

Customer type	Part number	Description
Managed Print Services (MPS)	P1B93-69001	Intermediate Transfer Belt PM Kit
All others (non-MPS)	P1B93-67901	Image transfer belt - Includes tray 2 transfer roller, paper pick-up roller, tray 2 separation roller, retard roller, and transfer roller guide.

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Intermediate transfer belt* See the Repair Service Manual for this product.

10 . 22 . 70 Transfer Kit Printing past very low

The printer indicates when a supply level is very low.

The 10.WX.70 is an event log only message, it will not show on the control panel. The only message to display will be a warning message **<Supply> very low**.

Recommended action

Follow these troubleshooting steps in the order presented.



NOTE: HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

- If the print quality is no longer acceptable, HP recommends ordering and installing the intermediate transfer belt kit.

Use the following table to order or replace the ITB for the printer.

Table 6-4 ITB part number

Customer type	Part number	Description
Managed Print Services (MPS)	P1B93-69001	Intermediate Transfer Belt PM Kit
All others (non-MPS)	P1B93-67901	Image transfer belt - Includes tray 2 transfer roller, paper pick-up roller, tray 2 separation roller, retard roller, and transfer roller guide.

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Intermediate transfer belt*

10 . 23 . 15 Install Fuser kit

The fuser is either not installed, or not correctly installed in the printer.

Recommended action

1. Remove, and then reinstall the fuser. Ensure that the fuser is fully seated.

 **CAUTION:** The fuser might be hot.

2. If the error persists, replace the fuser.

Fuser Kit 110v part number: RM2-1928-000CN

Fuser Kit 220v part number: RM2-1929-000CN

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Fuser*

10.23.60 Fuser Kit low

The printer indicates when a supply level is low.

Recommended action

- Replace the fuser kit.

Fuser Kit 110v part number: RM2-1928-000CN

Fuser Kit 220v part number: RM2-1929-000CN

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Fuser*

 **NOTE:** After replacing the fuser kit, reset the fuser page counter by selecting the **New Fuser Kit** in the **Reset Supplies** menu.

10.23.70 Replace Fuser Kit

The 10.WX.70 is an event log only message, it will not show on the control panel. The only message to display will be a warning message **<Supply> very low**.

The printer indicates when the fuser kit is at its estimated end of life. The actual life remaining might be different than the estimation.

The fuser kit does not need to be replaced now unless the print quality is no longer acceptable.

110V Part number: RM2-1928-000CN

220V Part number: RM2-1929-000CN

To order parts, go to <https://www.hp.com/buy/parts>.

Recommended action

 **NOTE:** HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

1. If the print quality is no longer acceptable, order a replacement fuser kit.

Fuser Kit 110v part number: RM2-1928-000CN

Fuser Kit 220v part number: RM2-1929-000CN

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Fuser*

 **CAUTION:** The fuser might be hot.

2. Open the right door.
3. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.
4. Install the replacement fuser.

Fuser Kit 110v part number: RM2-1928-000CN

Fuser Kit 220v part number: RM2-1929-000CN

For instructions: *Removal and replacement: Fuser*

5. Close the right door.

10 . 31 . 60 Toner collection unit almost full

The toner collection unit is almost full.

Recommended action

- Replace the toner collection unit.

Part number: RM2-6613-000CN

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Toner collection unit* See the Repair Service Manual for this product.

10 . 31 . 70 Replace Toner Collection Unit

The 10.WX.70 is an event log only message, it will not show on the control panel. The only message to display will be a warning message **<Supply> very low**.

The printer indicates when the toner collection unit is at its estimated end of life.

Recommended action

- Replace the toner collection unit.

 **NOTE:** Printing past the **Replace Toner Collection Unit** message is not a recommended option because of the risk of overfilling the toner collection unit, which could result in the need to service the printer.

Part number: RM2-6613-000CN

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Toner collection unit* See the Repair Service Manual for this product.

10 . 39 . 60 Document feeder kit low

The printer indicates when a supply level is low.

Recommended action for customers

- Replace the document feeder kit.

Part number: J8J95A

To order parts, go to <https://store.hp.com>

Recommended action for call-center agents and onsite technicians

- Replace the document feeder kit.

Part number: 5851-7202

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Document feeder rollers* See the Repair Service Manual for this product.

10 . 39 . 70 Document feeder kit very low

The 10.WX.70 is an event log only message, it will not show on the control panel. The only message to display will be a warning message **<Supply> very low**.

The printer indicates when the document feeder maintenance kit is very low. The actual remaining document feeder maintenance kit life might vary.

Recommended action for customers

- Replace the document feeder kit.

Part number: J8J95A

To order parts, go to <https://store.hp.com>

Recommended action for call-center agents and onsite technicians

- Order a replacement document feeder maintenance kit.

Part number: 5851-7202

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Document feeder rollers* See the Repair Service Manual for this product.



NOTE: After replacing the document feeder maintenance kit, reset the maintenance kit page counter by selecting **New Document Feeder Kit** in the **Manage Supplies** sub-menu.

10 . 99 . 31 Non-HP supply in use.

The printer displays this message when a used supply a remanufactured or refilled genuine HP or non-HP supply has been installed.

The 10.99.31 is an event log only message, it will not show on the control panel. The only message to display will be **Used supply in use** message.

Recommended action

- The toner cartridge has been previously used. Touch the **OK** button to continue.

 **NOTE:** Removing a cartridge from one printer and then installing it in a different printer for testing functionality will cause this (event code).

 **NOTE:** If you believe a genuine HP supply is being used, go to www.hp.com/go/anticounterfeit.

10 . 99 . 34 Used supply in use.

The printer displays this message when a used supply a remanufactured or refilled genuine HP or non-HP supply has been installed.

The 10.99.34 is an event log only message, it will not show on the control panel. The only message to display will be **Used supply in use**.

Recommended action

- The toner cartridge has been previously used. Touch the **OK** button to continue.

 **NOTE:** Removing a cartridge from one printer and then installing it in a different printer for testing functionality will cause this (event code).

 **NOTE:** If you believe a genuine HP supply is being used, go to www.hp.com/go/anticounterfeit.

10 . 99 . 40 Genuine HP supplies installed

The printer displays this message when a new cartridge has been installed and all cartridges are Genuine HP.

Recommended action

- Touch the **OK** button to continue.

10 . 99 . 41 Unsupported Supply in use

The indicated toner cartridge is for a different printer.

Recommended action

- Remove the indicated toner cartridge, and then install the correct cartridge for this printer.

11.WX.YZ error messages

11.* errors

Errors in the 11.* family are related to the printer real-time clock.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Set the time and date on the printer control panel.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

11.00.01 or 11.00.02 Internal clock error

The printer real time clock has experienced an error.

01=dead clock

02=dead real time clock

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. Set the time and date on the control panel.



NOTE: The control panel display menu options for the steps below might vary depending on the printer model and firmware version installed.


- a. From the Home screen on the product control panel, select [Settings](#).
- b. Select [General](#), and then select [Date/Time Settings](#).
- c. Open the [Date/Time Format](#) menu, configure the date and time format, and then save the settings.
- d. Open the [Date/Time](#) menu and configure the date and time zone settings for the printer location.



NOTE: If you are in an area that uses daylight savings time, select the [Adjust for Daylight Savings](#) check box.

- e. Select **Done** to save the settings.

Figure 6-1 Date/Time Settings

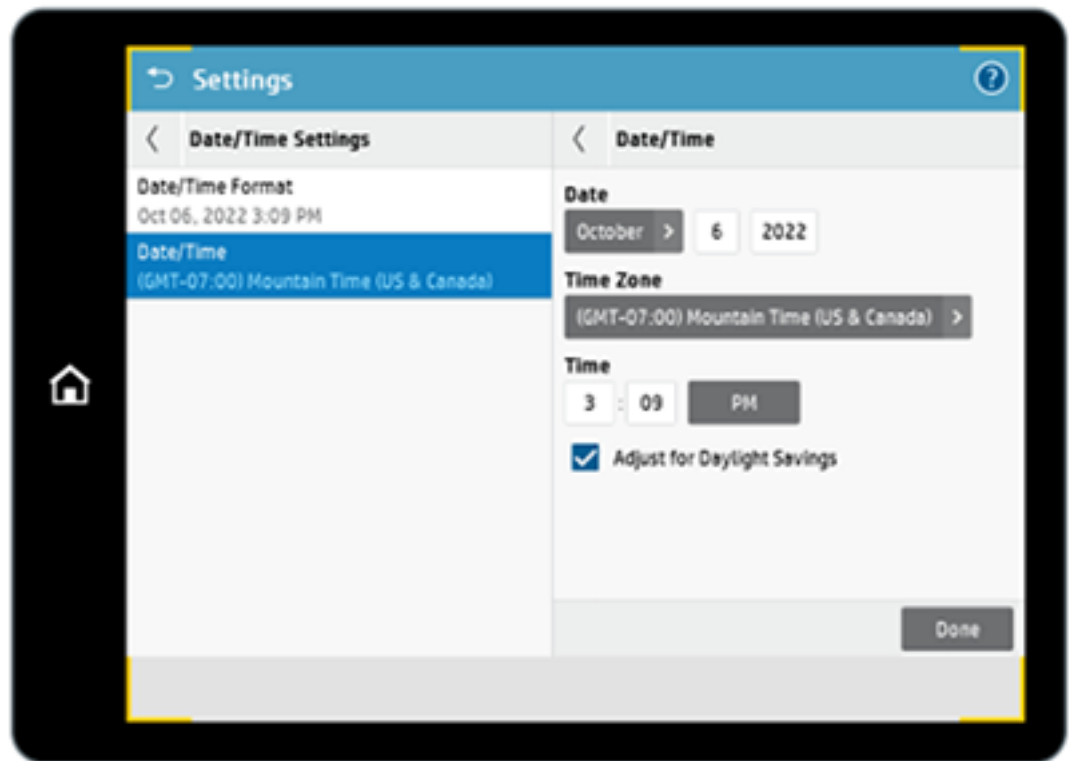

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. Set the time and date on the control panel.


 **NOTE:** The control panel display menu options for the steps below might vary depending on the printer model and firmware version installed.

- a. From the Home screen on the product control panel, select **Settings**.
- b. Select **General**, and then select **Date/Time Settings**.
- c. Open the **Date/Time Format** menu, configure the date and time format, and then save the settings.
- d. Open the **Date/Time** menu and configure the date and time zone settings for the printer location.

 **NOTE:** If you are in an area that uses daylight savings time, select the **Adjust for Daylight Savings** check box.

- e. Select **Done** to save the settings.

Figure 6-2 Date/Time Settings

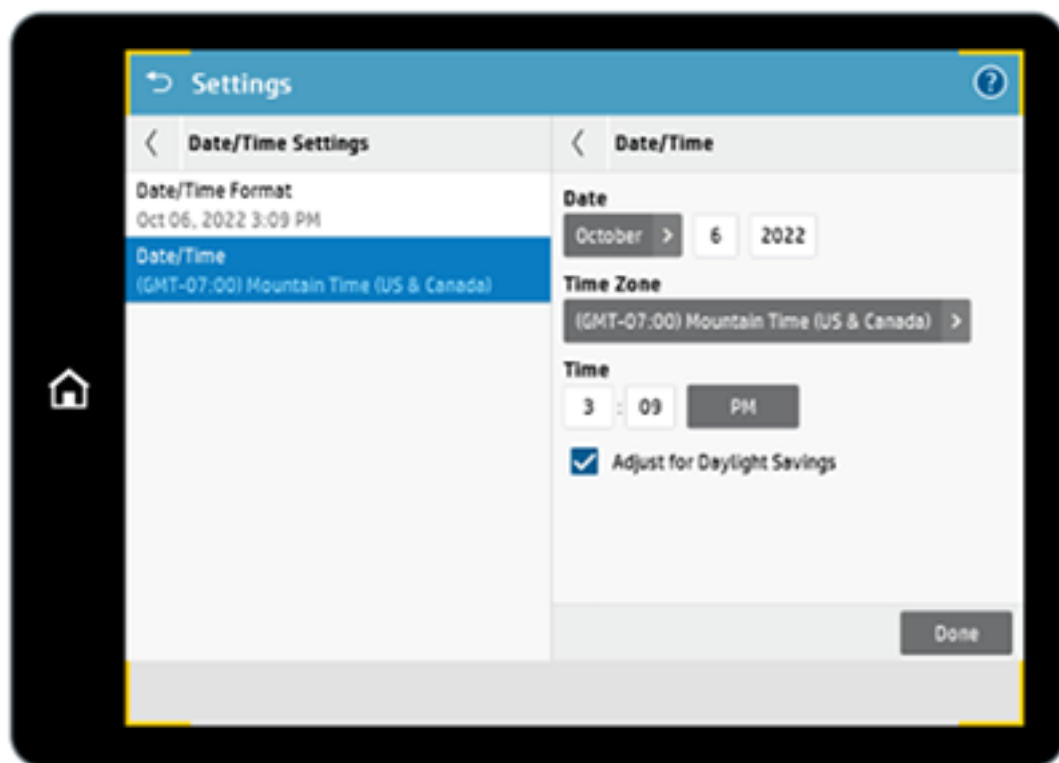

3. If the error persists, replace the formatter.

Use the table below to order the correct part number for the printer.

Table 6-5 Formatter part numbers

Description/Product models	Part number
Formatter (main logic) PC board assembly	J7Z98-60001
For products: M652/M653	
Formatter (main logic) PC board assembly (India/China)	J7Z98-67904
For products: M652/M653	
Formatter (main logic) PC board assembly	J8A10-60001
For products: M681/M682	
Formatter (main logic) PC board assembly (India/China)	J8A10-67902
For products: M681/M682	

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. Set the time and date on the control panel.


 **NOTE:** The control panel display menu options for the steps below might vary depending on the printer model and firmware version installed.

- a. From the Home screen on the product control panel, select **Settings**.
- b. Select **General**, and then select **Date/Time Settings**.
- c. Open the **Date/Time Format** menu, configure the date and time format, and then save the settings.
- d. Open the **Date/Time** menu and configure the date and time zone settings for the printer location.

 **NOTE:** If you are in an area that uses daylight savings time, select the **Adjust for Daylight Savings** check box.

- e. Select **Done** to save the settings.

Figure 6-3 Date/Time Settings

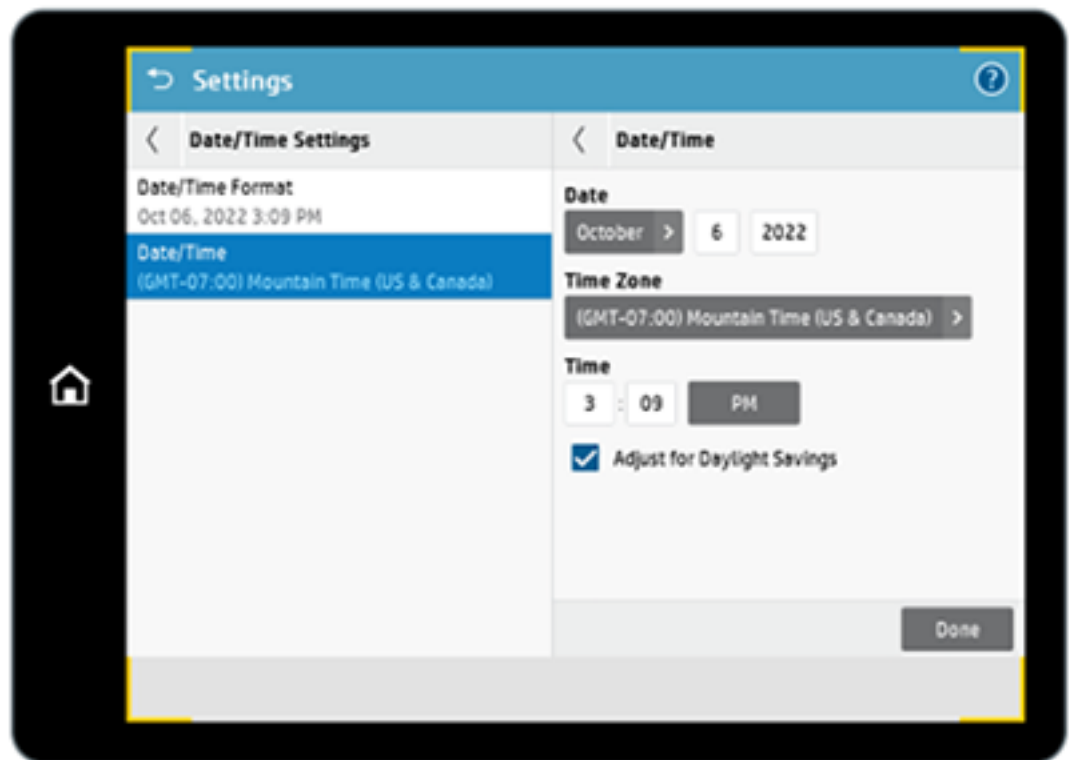

3. If the error persists, replace the formatter.

Use the table below to order the correct part number for the printer.

Table 6-6 Formatter part numbers

Description/Product models	Part number
Formatter (main logic) PC board assembly	J7Z98-60001
For products: M652/M653	
Formatter (main logic) PC board assembly (India/China)	J7Z98-67904
For products: M652/M653	
Formatter (main logic) PC board assembly	J8A10-60001
For products: M681/M682	
Formatter (main logic) PC board assembly (India/China)	J8A10-67902
For products: M681/M682	

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

13.WX.YZ error messages

13.* errors

Errors in the 13.* family are related to jams.

More than 1000 unique error codes are possible. Use the following information to understand the jam code. Not all codes apply to all printers.

Message format: 13.WX.YZ

- W represents the jam location.
- X represents the sensor or door that triggered the jam.
- Y represents the jam condition (delay, stay, wrap, etc.)
- Z represents the paper source, fuser mode, or destination

Table 6-7 Potential values for W and X

W	Jam location	X	Sensor or door
A	Input area	0	Envelope feeder
A	Input area	1	Tray 1 feed (unless Tray 1 feed is the registration sensor)
A	Input area	2	Tray 2 feed (unless Tray 2 feed is the registration sensor)
A	Input area	3	Tray 3 feed
A	Input area	4	Tray 4 feed
A	Input area	5	Tray 5 feed
A	Input area	6	Tray 6 feed

Table 6-7 Potential values for W and X (continued)

W	Jam location	X	Sensor or door
A	Input area	7	Optional tray exit sensor
A	Input area	A	Door 1
A	Input area	B	Door 2
A	Input area	C	Door 3
A	Input area	D	Door 4
A	Input area	E	Door 5
A	Input area	F	Multiple sensors or doors
B	Image area	0	Media sensor for forbidden transparencies
B	Image area	2	Registration/top of page
B	Image area	3	Top of page
B	Image area	4	Loop
B	Image area	5	Fuser input
B	Image area	9	Fuser output
B	Image area	A	Door 1
B	Image area	B	Door 2
B	Image area	F	Multiple sensors or doors
C	Switchback area (between the fuser and the output bin)	1	Intermediate switchback sensor
C	Switchback area (between the fuser and the output bin)	2	Switchback media stay sensor
C	Switchback area (between the fuser and the output bin)	3	Paper delivery sensor
D	Duplex area	1	Duplex switchback
D	Duplex area	2	Duplex delivery
D	Duplex area	3	Duplex refeed
D	Duplex area	A	Door 1 (if different than the imaging area)
D	Duplex area	B	Door 2 (if different than the imaging area)
D	Duplex area	F	Multiple sensors or doors
E	Output or intermediate paper transport unit (IPTU) area	1	Output bin full sensor
E	Output or intermediate paper transport unit (IPTU) area	2	IPTU feed sensor 1
E	Output or intermediate paper transport unit (IPTU) area	3	IPTU sensor 2
E	Output or intermediate paper transport unit (IPTU) area	4	IPTU sensor 3
E	Output or intermediate paper transport unit (IPTU) area	5	IPTU bin full sensor 4

Table 6-7 Potential values for W and X (continued)

W	Jam location	X	Sensor or door
E	Output or intermediate paper transport unit (IPTU) area	6	Output sensor
E	Output or intermediate paper transport unit (IPTU) area	A	Door 1
E	Output or intermediate paper transport unit (IPTU) area	F	Multiple sensors or doors
F	Multiple subsystems (occurs when paper is stuck in several areas)	F	Multiple sensors or doors
1	Jetlink input device	4	Tray 4 feed sensor
1	Jetlink Input device	5	Tray 5 feed sensor
1	Jetlink Input device	6	Tray 6 feed sensor
1	Jetlink Input device	7	Tray 7 feed sensor
1	Jetlink Input device	8	Tray 8 feed sensor
1	Jetlink Input device	9	Tray 9 feed sensor
1	Jetlink Input device	A	Door 1
1	Jetlink Input device	B	Door 2
1	Jetlink Input device	F	Multiple sensors or doors
2	Buffer pass unit	0	Buffer pass inlet sensor
2	Buffer pass unit	9	Buffer pass exit sensor
2	Buffer pass unit	A	Door 1
3	Page insert unit	0	Page insertion inlet sensor
3	Page insert unit	1	Page insertion tray 1 feed sensor
3	Page insert unit	2	Page insertion tray 2 feed sensor
3	Page insert unit	3	Page insertion tray 3 feed sensor
3	Page insert unit	4	Page insertion tray 4 feed sensor
3	Page insert unit	7	Output path feed sensor
3	Page insert unit	9	Page insertion exit sensor
3	Page insert unit	A	Door 1
4	Punch unit	0	Puncher inlet sensor
4	Punch unit	1	Puncher jam sensor
4	Punch unit	9	Puncher exit sensor
4	Punch unit	A	Door 1
5	Folding unit	0	Folder inlet sensor
5	Folding unit	1	Folder sensor
5	Folding unit	9	Folder exit sensor
5	Folding unit	A	Door 1

Table 6-7 Potential values for W and X (continued)

W	Jam location	X	Sensor or door
6	Stacker unit	0	Stacker inlet sensor
6	Stacker unit	4	Stacker outlet sensor
6	Stacker unit	7	Stacker switchback entrance sensor
6	Stacker unit	8	Stacker switchback registration sensor
6	Stacker unit	9	Stacker switchback lower sensor
7	Multi-bin mailbox (MBM) unit	0	MBM inlet sensor
7	Multi-bin mailbox (MBM) unit	1	MBM middle sensor
7	Multi-bin mailbox (MBM) unit	9	Stapler sensor
7	Multi-bin mailbox (MBM) unit	A	Door 1
7	Multi-bin mailbox (MBM) unit	B	Door 2
7	Multi-bin mailbox (MBM) unit	C	Door 3
7	Multi-bin mailbox (MBM) unit	F	Multiple sensors or doors
8	Stapler/stacker (SS) unit	0	SS inlet sensor
8	Stapler/stacker (SS) unit	1	SS Bin Z
8	Stapler/stacker (SS) unit	3	SS unit middle sensor
8	Stapler/stacker (SS) unit	4	SS unit outlet sensor 1
8	Stapler/stacker (SS) unit	5	SS unit outlet sensor 2
8	Stapler/stacker (SS) unit	9	Stapler sensor
8	Stapler/stacker (SS) unit	A	Door 1
8	Stapler/stacker (SS) unit	B	Door 2
9	Booklet maker unit	0	Booklet maker input sensor
9	Booklet maker unit	2	Booklet maker feed sensor 2
9	Booklet maker unit	2	Booklet maker feed sensor 3
9	Booklet maker unit	4	Booklet maker delivery sensor
9	Booklet maker unit	5	Booklet maker vertical paper path sensor
9	Booklet maker unit	6	Booklet unit front staple sensor
9	Booklet maker unit	7	Booklet unit rear staple sensor
9	Booklet maker unit	8	Booklet unit outlet sensor
9	Booklet maker unit	A	Door 1
9	Booklet maker unit	B	Door 2
9	Booklet maker unit	C	Door 3
9	Booklet maker unit	F	Multiple sensors or doors
0	Unknown	0	Unknown

Table 6-8 Potential values for Y (jam condition)

Y	Jam condition
0	Unknown
1	Unexpected sheet (duplex)
2	Staple jam
3	Jam caused by an open door (duplex)
4	Stay jam (the page never left the tray - duplex)
A	Stay jam (the page never left the tray - simplex)
B	Multifeed
C	Wrap
D	Delay (the page did not reach the sensor within the expected time - simplex)
E	Door open
F	Residual (paper is detected in the paper path when it should not be there)

The information represented by the value for Z depends on where the paper is in the paper path.

Table 6-9 Potential values for Z (source, fuser mode, or destination)

Paper location	Z	Source, fuser mode, or destination
When paper has not reached the fuser, Z represents the paper source.	1	Tray 1
Z represents the paper source.	2	Tray 2
Z represents the paper source.	3	Tray 3
Z represents the paper source.	4	Tray 4
Z represents the paper source.	5	Tray 5
Z represents the paper source.	6	Tray 6
Z represents the paper source.	D	Duplexer
Z represents the paper source.	E	Envelope feeder
When paper has reached the fuser, is in the duplex path, or in the output path, Z represents the fuser mode. Jams can occur when there is a mismatch between the actual paper and the fuser mode setting.	0	Photo 1, 2, or 3 Designated 2 or 3
Z represents the fuser mode.	1	Normal (automatically sensed rather than based on the paper type set at the control panel)
Z represents the fuser mode.	2	Normal (based on the paper type set at the control panel)
Z represents the fuser mode.	3	Light 1, 2, or 3
Z represents the fuser mode.	4	Heavy 1
Z represents the fuser mode.	5	Heavy 2

Table 6-9 Potential values for Z (source, fuser mode, or destination) (continued)

Paper location	Z	Source, fuser mode, or destination
Z represents the fuser mode.	6	Heavy 3
Z represents the fuser mode.	7	Glossy 1
Z represents the fuser mode.	8	Glossy 2
Z represents the fuser mode.	9	Glossy 3
Z represents the fuser mode.	A	Glossy Film
Z represents the fuser mode.	B	Transparency
Z represents the fuser mode.	C	Label
Z represents the fuser mode.	D	Envelope 1, 2, or 3
Z represents the fuser mode.	E	Rough
When paper has entered the output bin, Z represents the output bin, numbered from top to bottom.	0	Unknown bin
Z represents the output bin	1	Bin 1
Z represents the output bin	2	Bin 2
Z represents the output bin	3	Bin 3
Z represents the output bin	4	Bin 4
Z represents the output bin	5	Bin 5
Z represents the output bin	6	Bin 6
Z represents the output bin	7	Bin 7
Z represents the output bin	8	Bin 8
Z represents the output bin	9	Bin 9
All paper locations	E	Door open jam
All paper locations	F	Residual jam
All paper locations	0	Forbidden OHT jam (when Y=2)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size, and the tray should not be filled above the maximum fill marks or tabs.
4. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
5. Use a damp, lint-free cloth to clean the rollers in the appropriate tray. Replace rollers that are worn.

6. Open all doors and covers and ensure the paper path is completely clear of paper or obstructions.
7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

To prevent future paper jams in the printer, follow these recommendations:

- Use only paper that meets HP specifications for this printer.

For more information, refer to the printer User Guide or search for the "HP LaserJet Printers - Print Media Guide" (c06117757) [Or click here: HP LaserJet Print Media Guide](#).
- Make sure the printing environment is within recommended specifications.
- Do not use paper that is wrinkled, folded, or damaged.
- Do not overload the tray with paper.
- Make sure that the paper guides in the tray are adjusted correctly for the size of paper.
- Make sure that the tray is fully inserted in the printer.
- If printing on heavy, embossed, or perforated paper, use the manual feed feature and feed sheets one at a time.
- Open the [Trays](#) menu on the printer control panel. Verify that the tray is configured correctly for the paper type and size.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size, and the tray should not be filled above the maximum fill marks or tabs.
4. Verify that the paper meets specifications for this printer.
5. Use a damp, lint-free cloth to clean the rollers in the appropriate tray. Replace rollers that are worn.
6. If the issue persists, open the [Administration > Troubleshooting > Diagnostic Tests > Component Test](#) menu, and perform the appropriate pickup/feed motor drive test. Replace the pickup assembly if the test fails.
7. Verify the sensors are functioning correctly. If the sensors fail the test, first verify that all connections on the DC controller are correctly seated. If possible, replace the sensor or assembly it is associated with.
8. If the sensors pass the test, look for blockage or damaged parts and replace any damaged parts.
9. If the error persists, elevate the case using the Standard Support Process.

13.00.EE

Unknown door open.

Recommended action

- Ensure that all of the doors and covers are closed.

13.00.FF

Residual jam.

This error has no specific sensor designated. It could be any sensor in the paper feed path and the required jam access point has not been accessed.

Recommended action for customers

1. Check the printer for a jam.
2. Look for and clear any paper present or obstructions in the paper path.
View event log to determine if other jam errors are occurring and troubleshoot those errors.

Recommended action for call-center agents and onsite technicians

1. Check the printer for a jam.
2. Look for and clear any paper present or obstructions in the paper path.
View event log to determine if other jam errors are occurring and troubleshoot those errors.
3. Use the manual sensor test to isolate a faulty door switch or sensor.
4. Replace parts as determined by sensor tests, obstructions or broken parts.

13.A3.DX

Paper delay jam in Tray X.

Paper did not reach the Tray 3 feed sensor in the designated amount of time when printing from Tray X.

- **13.A3.D3** Paper did not reach the Tray 3 feed sensor in the designated amount of time when printing from Tray 3.
- **13.A3.D4** Paper did not reach the Tray 3 feed sensor in the designated amount of time when printing from Tray 4.
- **13.A3.D5** Paper did not reach the Tray 3 feed sensor in the designated amount of time when printing from Tray 5.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the upper and lower right door.

- c. Look for and clear any paper present or obstructions in the paper path.
 - d. Close the upper and lower right door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
 3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-4 Paper tray guides


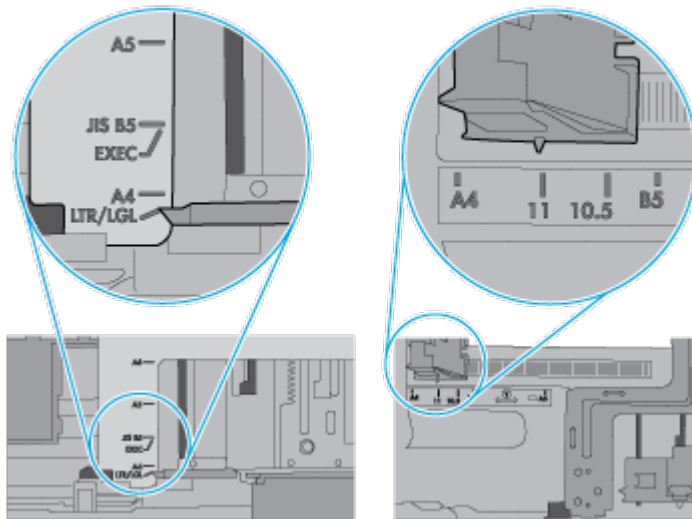


Figure 6-5 Paper height guides

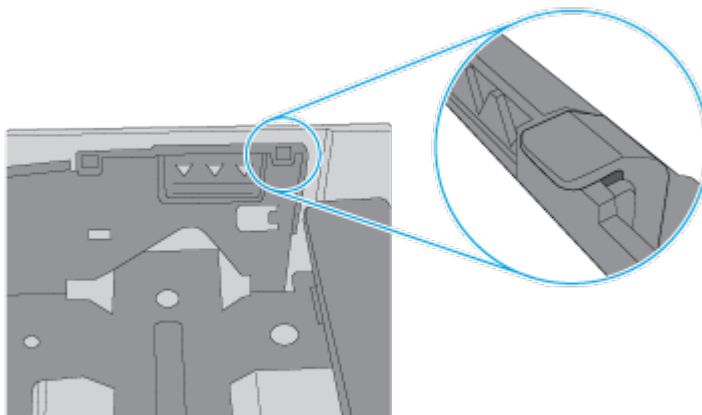

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the upper and lower right door.

- c. Look for and clear any paper present or obstructions in the paper path.
 - d. Close the upper and lower right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
 3. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-6 Paper tray guides


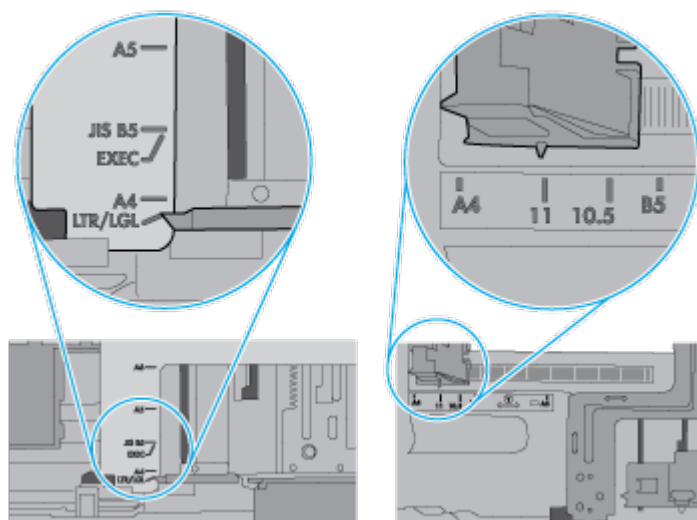


Figure 6-7 Paper height guides

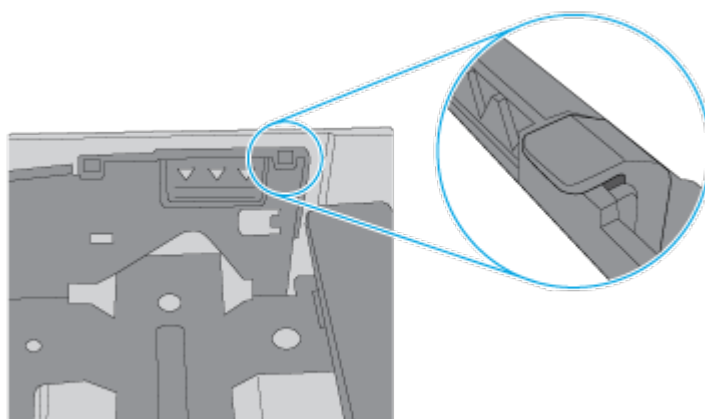

4. Ensure that the tray pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.

Paper tray	Roller kit part number	Replacement instructions
550-sheet paper feeder	J7Z98-67902	<i>Removal and replacement: Tray 2-3 pickup and separation rollers</i>

Paper tray	Roller kit part number	Replacement instructions
1x550-sheet paper feeder with stand	J7Z98-67902	<i>Removal and replacement: Tray 3-5 paper feeder pickup and separation roller kit</i>
3x550-sheet paper feeder with stand	J7Z98-67902	<i>Removal and replacement: Tray 3-5 paper feeder with stand pickup and separation roller kit</i>
2500-sheet HCI	J7Z98-67902	<i>Removal and replacement: Tray 3-5 paper feeder with stand pickup and separation roller kit</i>

6. Check the tray 3 pickup assembly.

- a. Check the connectors at the sensor J12 and J204, feed motor J13, and on the paper feeder controller PCA J5020, J5017 and J5004 for tray 3.
- b. Open the following menus:
 - [Support Tools](#)
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
- c. Using the [Manual Sensor Tests](#), test sensor “Tray 3 feed sensor”. If the sensor test fails, replace the tray 3 pickup assembly.

Paper tray	Pickup assembly part number	Replacement instructions
550-sheet paper feeder	RM2-5154-000CN	<i>Removal and replacement: Paper pickup assembly (550-sheet paper feeder) See the Repair Service Manual for this product.</i>
1x550-sheet paper feeder with stand	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (1x550 feeder with stand) See the Repair Service Manual for this product.</i>
3x550-sheet paper feeder with stand	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (3x550 feeder with stand) See the Repair Service Manual for this product.</i>
2500-sheet HCI	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (2500-sheet HCI) See the Repair Service Manual for this product.</i>

- d. If the sensor test passes, use the [Component Tests](#) and run the tray 3 clutch drive test and listen for the clutch activation. If the test fails, replace the lifter drive assembly.

Paper tray	Lifter drive assembly part number	Replacement instructions
550-sheet paper feeder	RM2-6933-000CN	<i>Removal and replacement: Lifter drive assembly (550-sheet paper feeder) See the Repair Service Manual for this product.</i>

Paper tray	Lifter drive assembly part number	Replacement instructions
1x550-sheet paper feeder with stand	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (1x550 feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

- e. If the clutch drive test passes, use the [Component Tests](#) and run the tray 3 feed motor test. If the test fails, replace the following component (depending on the tray configuration):

- Optional 1x550-sheet feeder: Replace the drive assembly
- 1x550-sheet paper feeder with stand: Replace the feed motor
- 3x550-sheet paper feeder with stand: Replace the feed motor
- 2500-sheet HCI: Replace the feed motor

Paper tray	Replacement part number	Replacement instructions
550-sheet paper feeder	Drive assembly: RM2-6934-000CN	<i>Removal and replacement: Drive assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	Feed motor: RK2-7831-000CN	<i>Removal and replacement: Feed motor (1x550 feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	Feed motor: RK2-7831-000CN	<i>Removal and replacement: Feed motors (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	Feed motor: RK2-7831-000CN	<i>Removal and replacement: Feed motor (2500-sheet paper feeder with stand)</i> See the Repair Service Manual for this product.

- f. If the test passes and the error still persists, replace the tray 3 pickup assembly

Paper tray	Pickup assembly part number	Replacement instructions
550-sheet paper feeder	RM2-5154-000CN	<i>Removal and replacement: Paper pickup assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (1x550 feeder with stand)</i> See the Repair Service Manual for this product.

Paper tray	Pickup assembly part number	Replacement instructions
3x550-sheet paper feeder with stand	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

7. If the issue persists, replace the paper pickup assembly for tray 3.

Paper tray	Pickup assembly part number	Replacement instructions
550-sheet paper feeder	RM2-5154-000CN	<i>Removal and replacement: Paper pickup assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (1x550 feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

13.A4.DX

Paper delay jam in Tray X.

Paper did not reach the Tray 4 feed sensor in the designated amount of time when printing from Tray X.

- **13.A4.D4** Paper did not reach the Tray 3 feed sensor in the designated amount of time when printing from Tray 4.
- **13.A4.D5** Paper did not reach the Tray 3 feed sensor in the designated amount of time when printing from Tray 5.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the upper and lower right door.
 - c. Look for and clear any paper present or obstructions in the paper path.
 - d. Close the upper and lower right door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.

3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-8 Paper tray guides


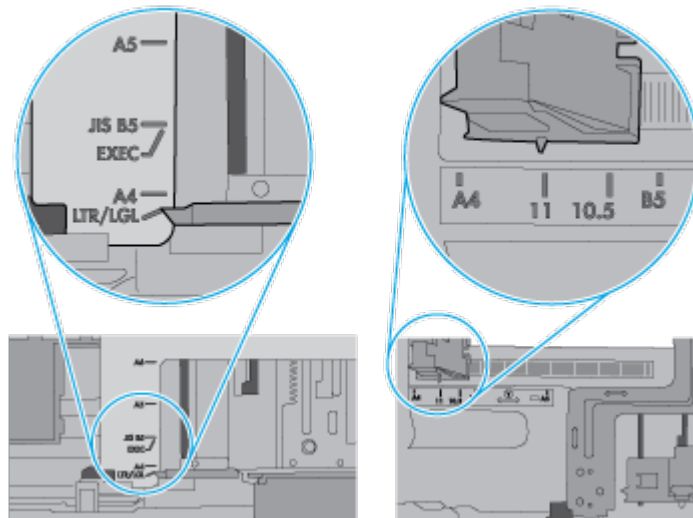


Figure 6-9 Paper height guides

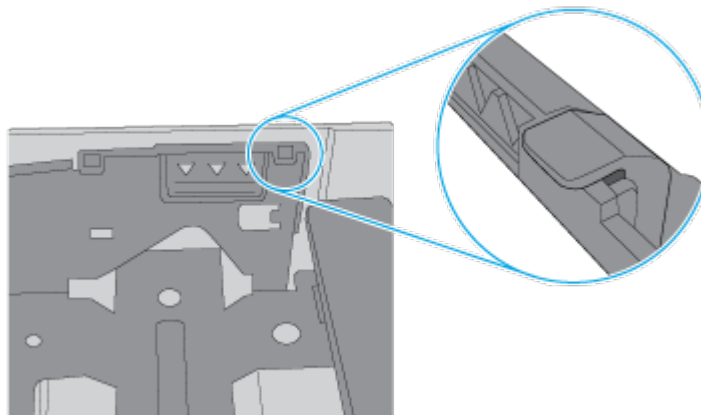

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the upper and lower right door.
 - c. Look for and clear any paper present or obstructions in the paper path.
 - d. Close the upper and lower right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.

3. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-10 Paper tray guides


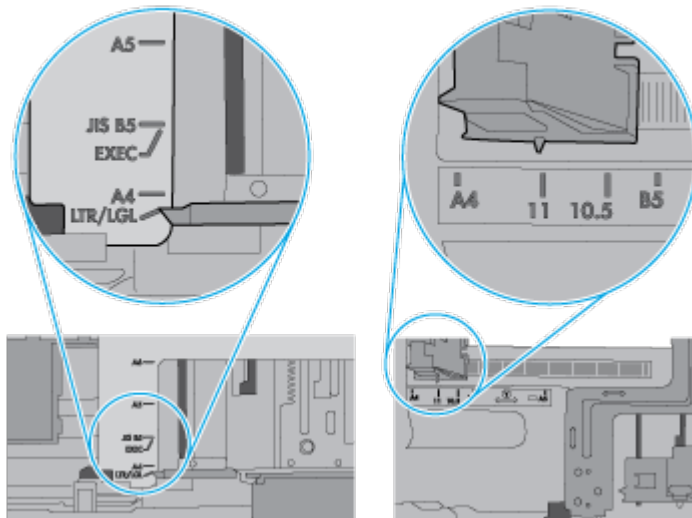


Figure 6-11 Paper height guides

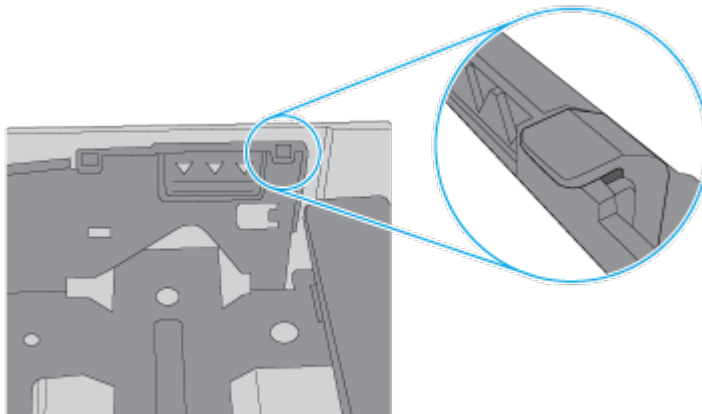

4. Ensure that the tray pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.

Part number: J7Z98-67902

For instructions: *Removal and replacement: Tray 3-5 pickup and separation roller kit*

6. Check the tray 4 pickup assembly.
 - a. Check the connectors at the sensor J12 and J205, feed motor J34, and on the paper feeder controller PCA J5009, J5021. and J5026 for tray 4.
 - b. Open the following menus:
 - [Support Tools](#)

- Troubleshooting
- Diagnostic Tests

- c. Using the [Manual Sensor Tests](#), test sensor “Tray 4 feed sensor”. If the sensor test fails, replace the tray 4 pickup assembly.

Paper tray	Pickup assembly part number	Replacement instructions
550-sheet paper feeder	RM2-5154-000CN	<i>Removal and replacement: Paper pickup assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

- d. If the sensor test passes, use the [Component Tests](#) and run the tray 4 clutch drive test and listen for the clutch activation. If the test fails, replace the lifter drive assembly.

Paper tray	Lifter drive assembly part number	Replacement instructions
550-sheet paper feeder	RM2-6933-000CN	<i>Removal and replacement: Lifter drive assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

- e. If the clutch drive test passes, use the [Component Tests](#) and run the tray 4 feed motor test. If the test fails, replace the following component (depending on the tray configuration):

- Optional 1x550-sheet feeder: Replace the drive assembly
- 3x550-sheet paper feeder with stand: Replace the feed motor
- 2500-sheet HCI: Replace the feed motor

Paper tray	Replacement part number	Replacement instructions
550-sheet paper feeder	Drive assembly: RM2-6934-000CN	<i>Removal and replacement: Drive assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.

Paper tray	Replacement part number	Replacement instructions
3x550-sheet paper feeder with stand	Feed motor: RK2-7831-000CN	<i>Removal and replacement: Feed motors (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	Feed motor: RK2-7831-000CN	<i>Removal and replacement: Feed motor (2500-sheet paper feeder with stand)</i> See the Repair Service Manual for this product.

- f. If the test passes and the error still persists, replace the tray 4 pickup assembly

Paper tray	Pickup assembly part number	Replacement instructions
550-sheet paper feeder	RM2-5154-000CN	<i>Removal and replacement: Paper pickup assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

7. If the issue persists and the pickup assembly has not been replaced, replace the paper pickup assembly for tray 4.

Paper tray	Pickup assembly part number	Replacement instructions
550-sheet paper feeder	RM2-5154-000CN	<i>Removal and replacement: Paper pickup assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

13.A5.D5

Paper delay jam in Tray 5.

Paper did not reach the Tray 5 Feed sensor in the designated amount of time when printing from Tray 5.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.

- b. Open the upper and lower right door.
 - c. Look for and clear any paper present or obstructions in the paper path.
 - d. Close the upper and lower right door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-12 Paper tray guides


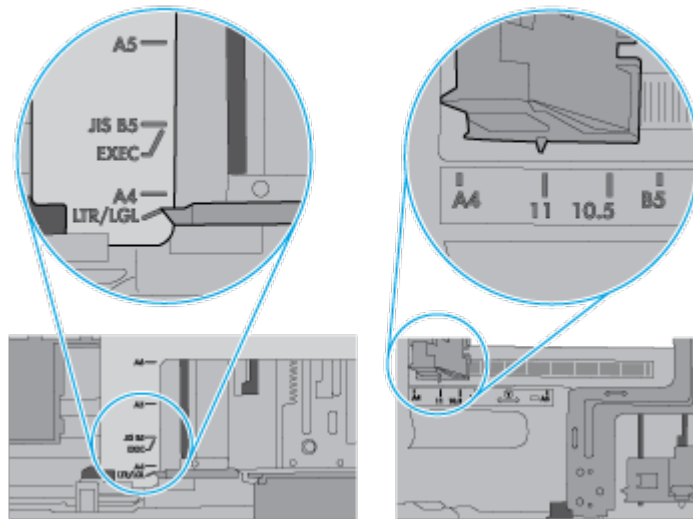


Figure 6-13 Paper height guides

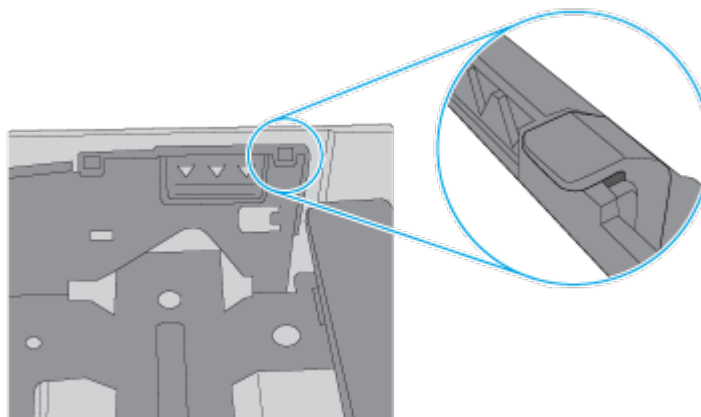

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.

- b. Open the upper and lower right door.
 - c. Look for and clear any paper present or obstructions in the paper path.
 - d. Close the upper and lower right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-14 Paper tray guides


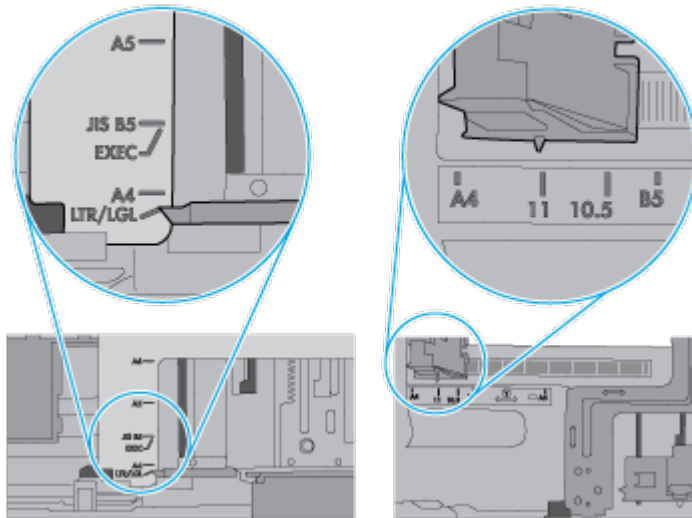


Figure 6-15 Paper height guides

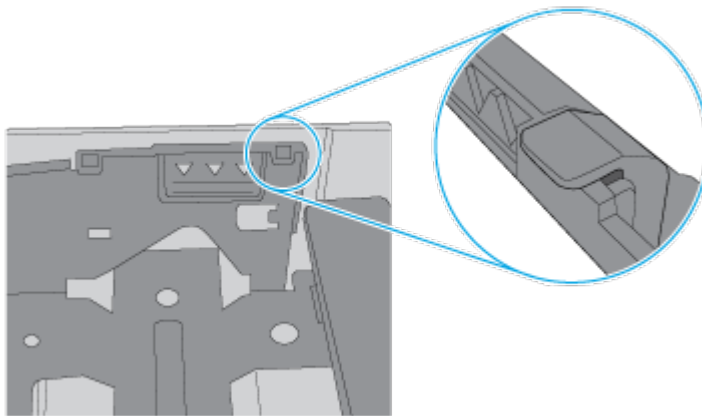

4. Ensure that the tray pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.

Part number: J7Z98-67902

For instructions: *Removal and replacement: Tray 3-5 pickup and separation roller kit*

6. Check the tray 5 pickup assembly.

- a. Check the connectors at the sensor J12 and J206, feed motor J22, and on the paper feeder controller PCA J5001, J5023. and J5031 for tray 5.
- b. Open the following menus:
 - [Support Tools](#)
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
- c. Using the [Manual Sensor Tests](#), test sensor “Tray 5 feed sensor”. If the sensor test fails, replace the tray 5 pickup assembly.

Paper tray	Pickup assembly part number	Replacement instructions
550-sheet paper feeder	RM2-5154-000CN	<i>Removal and replacement: Paper pickup assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

- d. If the sensor test passes, use the [Component Tests](#) and run the tray 5 clutch drive test and listen for the clutch activation. If the test fails, replace the lifter drive assembly.

Paper tray	Lifter drive assembly part number	Replacement instructions
550-sheet paper feeder	RM2-6933-000CN	<i>Removal and replacement: Lifter drive assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

- e. If the clutch drive test passes, use the [Component Tests](#) and run the tray 5 feed motor test. If the test fails, replace the following component (depending on the tray configuration):
 - Optional 1x550-sheet feeder: Replace the drive assembly
 - 3x550-sheet paper feeder with stand: Replace the feed motor
 - 2500-sheet HCI: Replace the feed motor

Paper tray	Replacement part number	Replacement instructions
550-sheet paper feeder	Drive assembly: RM2-6934-000CN	<i>Removal and replacement: Drive assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	Feed motor: RK2-7831-000CN	<i>Removal and replacement: Feed motors (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	Feed motor: RK2-7831-000CN	<i>Removal and replacement: Feed motor (2500-sheet paper feeder with stand)</i> See the Repair Service Manual for this product.

- f. If the test passes and the error still persists, replace the tray 5 pickup assembly

Paper tray	Pickup assembly part number	Replacement instructions
550-sheet paper feeder	RM2-5154-000CN	<i>Removal and replacement: Paper pickup assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

13.AX.FF

Residual paper jam in Tray X.

This jam occurs when residual paper is detected at the Tray X feed sensor.

- **13.A3.FF** Residual Paper Jam in Tray 3.
- **13.A4.FF** Residual Paper Jam in Tray 4.
- **13.A5.FF** Residual Paper Jam in Tray 5.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the upper and lower right door.
 - c. Look for and clear any paper present or obstructions in the paper path.
 - d. Close the upper and lower right door to allow the printer to attempt to clear the jam message.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Open Tray X and remove any jammed paper, and then close the tray.
2. Open and close the upper right door to allow the printer to attempt to clear the jam.
3. Ensure that the Tray X pickup, feed, and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup, feed, and separation rollers as needed.

Paper tray	Roller kit part number	Replacement instructions
550-sheet paper feeder	J7Z98-67902	<i>Removal and replacement: Tray 2-3 pickup and separation rollers</i>
1x550-sheet paper feeder with stand	J7Z98-67902	<i>Removal and replacement: Tray 3-5 paper feeder pickup and separation roller kit</i>
3x550-sheet paper feeder with stand	J7Z98-67902	<i>Removal and replacement: Tray 3-5 paper feeder with stand pickup and separation roller kit</i>
2500-sheet HCI	J7Z98-67902	<i>Removal and replacement: Tray 3-5 paper feeder with stand pickup and separation roller kit</i>

5. Check the tray X pickup assembly.
 - a. Check the connectors at the failing sensor, feed motor, and on the paper feeder controller PCA for the failing tray.
 - b. Open the following menus:
 - [Support Tools](#)
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - c. Using the [Manual Sensor Tests](#), test sensor “Tray X feed sensor”. If the sensor test fails, replace the tray X pickup assembly.

Paper tray	Pickup assembly part number	Replacement instructions
550-sheet paper feeder	RM2-5154-000CN	<i>Removal and replacement: Paper pickup assembly (550-sheet paper feeder) See the Repair Service Manual for this product.</i>
1x550-sheet paper feeder with stand	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (1x550 feeder with stand) See the Repair Service Manual for this product.</i>
3x550-sheet paper feeder with stand	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (3x550 feeder with stand) See the Repair Service Manual for this product.</i>

Paper tray	Pickup assembly part number	Replacement instructions
2500-sheet HCI	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

- d. If the sensor test passes, use the [Component Tests](#) and run the tray X clutch drive test and listen for the clutch activation. If the test fails, replace the lifter drive assembly.

Paper tray	Lifter drive assembly part number	Replacement instructions
550-sheet paper feeder	RM2-6933-000CN	<i>Removal and replacement: Lifter drive assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (1x550 feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

- e. If the clutch drive test passes, use the [Component Tests](#) and run the tray X feed motor test. If the test fails, replace the following component (depending on the tray configuration):

- Optional 1x550-sheet feeder: Replace the drive assembly
- 1x550-sheet paper feeder with stand: Replace the feed motor
- 3x550-sheet paper feeder with stand: Replace the feed motor
- 2500-sheet HCI: Replace the feed motor

Paper tray	Replacement part number	Replacement instructions
550-sheet paper feeder	Drive assembly: RM2-6934-000CN	<i>Removal and replacement: Drive assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	Feed motor: RK2-7831-000CN	<i>Removal and replacement: Feed motor (1x550 feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	Feed motor: RK2-7831-000CN	<i>Removal and replacement: Feed motors (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	Feed motor: RK2-7831-000CN	<i>Removal and replacement: Feed motor (2500-sheet paper feeder with stand)</i> See the Repair Service Manual for this product.

- f. If the test passes and the error still persists, replace the tray X pickup assembly

Paper tray	Pickup assembly part number	Replacement instructions
550-sheet paper feeder	RM2-5154-000CN	<i>Removal and replacement: Paper pickup assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (1x550 feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

6. If the issue persists, elevate the case using the Standard Support Process.

13 . AA . EE Right Door Open

The lower right on the paper deck was door open during printing.

Recommended action for customers

- Close the lower right door to allow the printer to attempt to clear the jam.

Recommended action for call-center agents and onsite technicians

1. Close the front door to allow the printer to attempt to clear the jam.
2. Disconnect and reconnect the connector on the paper deck door switch and the connector on the PD controller PCA.
3. Replace the paper feeder right door assembly.

Paper feeder	Part number	Replacement instructions
550-sheet paper feeder	RM2-6937-000CN	<i>Removal and replacement: Right door, 1x550-sheet paper feeder</i> See the Repair Service Manual for this product.
1x550-sheet feeder with stand	RM2-1226-000CN	<i>Removal and replacement: Right door, 1x550-sheet paper feeder with stand</i> See the Repair Service Manual for this product.
3x550-sheet feeder with stand	RM2-1230-000CN	<i>Removal and replacement: Right door, 3x550-sheet paper feeder with stand</i> See the Repair Service Manual for this product.

Paper feeder	Part number	Replacement instructions
2500-sheet HCI feeder	RM2-1230-000CN	<i>Removal and replacement: Right door, 2500-sheet paper feeder with stand</i> See the Repair Service Manual for this product.

13 . AB . EE Right Door Open

The lower right second 1x550 sheet feeder was door open during printing.

Recommended action for customers

- Close the lower right door to allow the printer to attempt to clear the jam.

Recommended action for call-center agents and onsite technicians

1. Close the front door to allow the printer to attempt to clear the jam.
2. Disconnect and reconnect the connector J560 on the paper feeder door switch and connector J5504 on the PF controller PCA.
3. Replace the paper feeder right door assembly.

Part number: RM2-6937-000CN

For instructions: *Removal and replacement: Right door, 1x550-sheet paper feeder* See the Repair Service Manual for this product.

13 . B2 . Az Jam in Right door

Paper stay jam in the upper right door at the image area.

Paper present at SR11 after a specified time limit has passed.

● 13.B2.A1

This jam occurs when the registration sensor (SR11) detects paper present longer than the expected time based on the paper size when printing from Tray 1.

● 13.B2.A2

This jam occurs when the registration sensor (SR11) detects paper present longer than the expected time based on the paper size when printing from Tray 2.

● 13.B2.A3

This jam occurs when the registration sensor (SR11) detects paper present longer than the expected time based on the paper size when printing from Tray 3.

● 13.B2.A4

This jam occurs when the registration sensor (SR11) detects paper present longer than the expected time based on the paper size when printing from Tray 4.

● 13.B2.A5

This jam occurs when the registration sensor (SR11) detects paper present longer than the expected time based on the paper size when printing from Tray 5.

- **13.B2.AD**

This jam occurs when the registration sensor (SR11) detects paper present longer than the expected time based on the paper size when printing from the Duplexer.

If using adhesive or self-sealing media, go to **WISE** and search for the following document: A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper (ish_3199741-3199797-16). A *"13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper.*

Recommended action for customers

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. Test the top of page sensor (SR11) to ensure that it moves freely.
4. Check the ITB and ensure that the part is seated correctly. Ensure that the part is not damaged. Replace the ITB as needed.

Use the following table to order or replace the ITB for the printer.

Table 6-10 ITB part number

Customer type	Part number	Description
Managed Print Services (MPS)	P1B93-69001	Intermediate Transfer Belt PM Kit
All others (non-MPS)	P1B93-67901	Image transfer belt - Includes tray 2 transfer roller, paper pick-up roller, tray 2 separation roller, retard roller, and transfer roller guide.

For instructions: *Removal and replacement: Intermediate transfer belt*

5. Check the T2 roller at the transfer area, ensure that the part is seated correctly. If the part is damaged, replace the T2 roller.

Transfer roller kit part number: RM2-6561-000CN

For instructions: *Removal and replacement: Secondary transfer roller*

6. Check the registration sensor.
 - a. Open the following menus:
 - [Support Tools](#)
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - b. Test the registration sensor (SR11) using the Tray/Bin manual sensor test to verify that the sensor is functioning correctly.
 - c. If the test fails, disconnect and reconnect the connections to the registration assembly and the connector J133 on the DC controller.
 - d. If the sensor still does not function, replace the registration assembly.

Part number: RM2-1957-000CN

For instructions: *Removal and replacement: Registration assembly* See the Repair Service Manual for this product.

7. Check the paper width sensors.
 - a. Test the paper width sensors SR12 and SR13.
 - b. If the test fails, disconnect and reconnect the connections to the registration assembly and the connector J133 on the DC controller.
 - c. If the sensor still does not function, replace the registration assembly.

Registration unit part number: RM2-1957-000CN

For instructions: *Removal and replacement: Registration assembly* See the Repair Service Manual for this product.

8. If the issue persists, elevate the case using the Standard Support Process.

13 . B2 . D1 Jam in Right Door

Paper delay jam in the top cover at the image area.

Paper did not reach SR11 in specified time when printing from Tray 1.


If using adhesive or self-sealing media, go to **WISE** and search for the following document: A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper (ish_3199741-3199797-16). A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper.

Recommended action for customers

1. Clear the paper jam.

- a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. For Tray 1, ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.


Figure 6-16 Tray 1 paper height and width guides

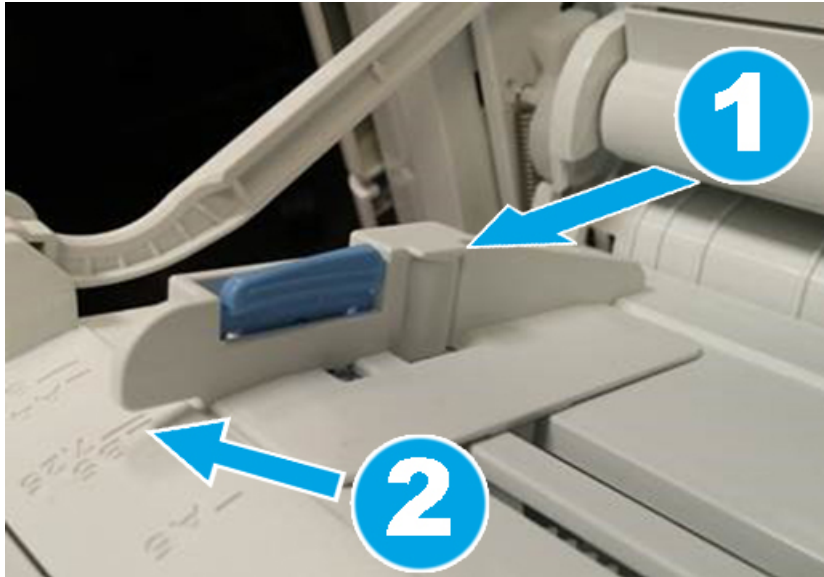

Callout 1 – Height guide

Callout 2 – Page size

Figure 6-17 Tray 1 paper height guides

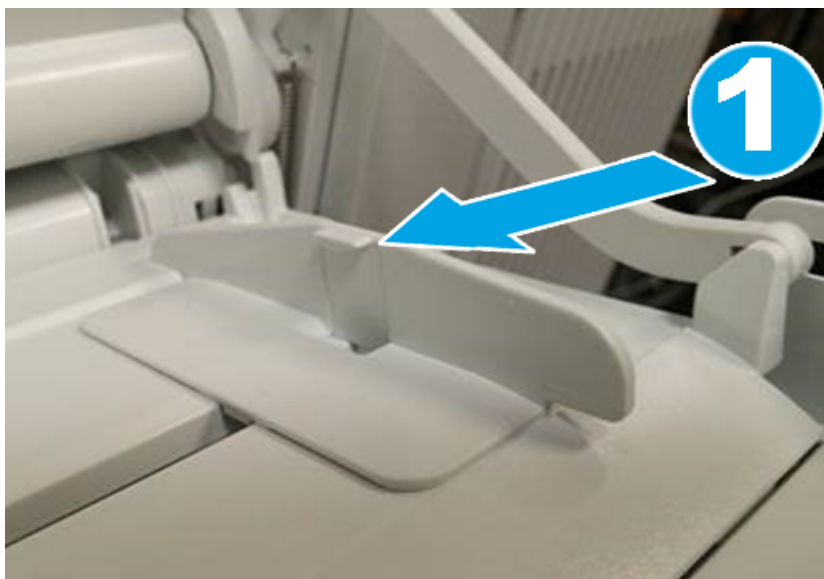

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. For Tray 1, ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-18 Tray 1 paper height and width guides

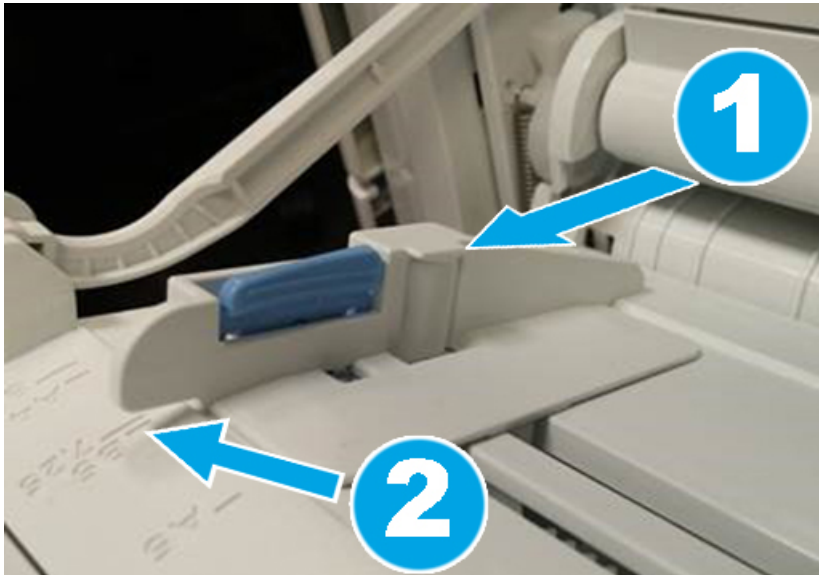


Figure 6-19 Tray 1 paper height guides



Callout 1 – Height guide

Callout 2 – Page size

4. Ensure that the Tray 1 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.


MP tray roller kit part number: 9460-B012 (includes the pickup roller and the separation roller)

For instructions:

- Pickup roller: *Removal and replacement: Tray 1 pickup roller*
 - Separation roller: *Removal and replacement: Tray 1 separation roller*
6. Test the top of page sensor (SR11) to ensure that it moves freely.
 7. Reseat the tray 2-x diverter assembly.
 - a. Open the right door.


- b. Remove the spring on the right side of the outer diverter plate.

Figure 6-20 Remove spring

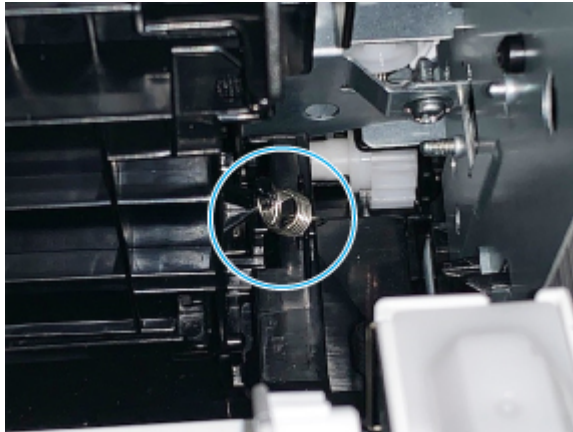

- c. Remove both the outer and inner diverter plates, by pulling straight up.

Figure 6-21 Remove plates

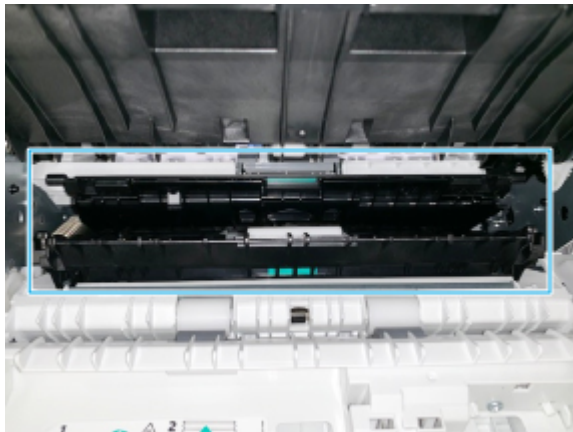

- d. When both the diverter plates are removed, check the location points on the right and left hand sides for proper re-installation.

Figure 6-22 Right side location



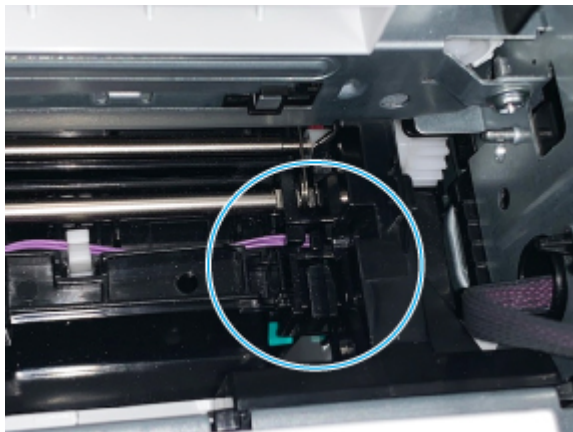


Figure 6-23 Left side location

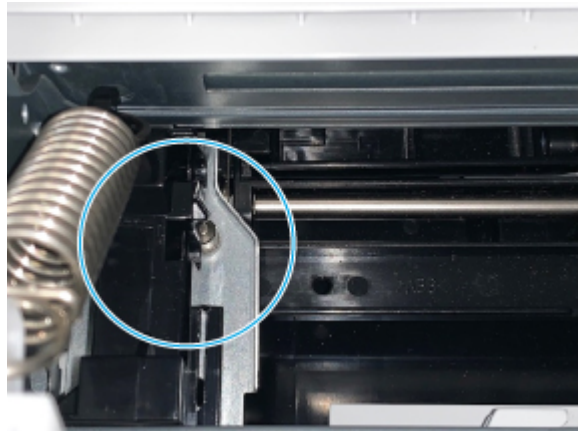

- e. Reinstall the rear diverter plate.

Figure 6-24 Reinstall rear plate

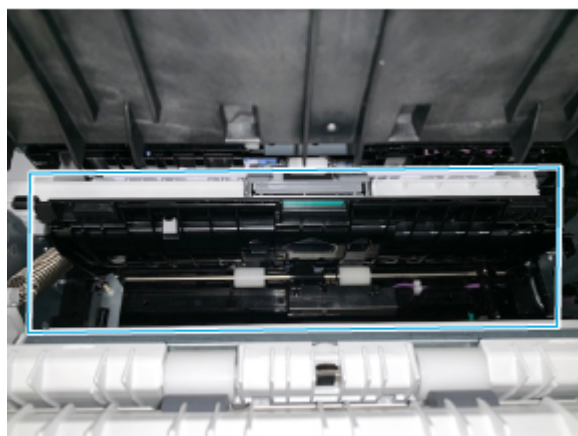

- f. Reinstall the front diverter plate.

Figure 6-25 Reinstall front plate



- g. Reinstall the spring.

8. Check the ITB and T2 roller at the transfer area. Ensure that the parts are seated correctly and no parts are damaged. Replace the ITB or T2 roller as needed.
 - Use the following table to order or replace the ITB for the printer.

Table 6-11 ITB part number

Customer type	Part number	Description
Managed Print Services (MPS)	P1B93-69001	Intermediate Transfer Belt PM Kit
All others (non-MPS)	P1B93-67901	Image transfer belt - Includes tray 2 transfer roller, paper pick-up roller, tray 2 separation roller, retard roller, and transfer roller guide.

For instructions: *Removal and replacement: Intermediate transfer belt*

- Transfer roller kit part number: RM2-6561-000CN

For instructions: *Removal and replacement: Secondary transfer roller*

9. Test the registration assembly sensors using the manual sensor test.
 - a. Open the following menus:
 - [Support Tools](#)
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - Manual Sensor Test
 - b. Test the registration sensor (SR11)
 - c. Test the paper width sensors SR12 and SR13.
 - d. If any of the sensors fail, check the connections to the registration assembly and the connector J133 on the DC controller.
 - e. If the error persists, replace the registration unit.

Registration unit part number: RM2-1957-000CN

For instructions: *Removal and replacement: Registration assembly* See the Repair Service Manual for this product.
10. If the sensors functioning correctly, test the tray 1 pickup motor.
 - a. Use the [Component Test](#) and test the tray 1 pickup motor and solenoid. If the either test fails, check J70 on the pickup assembly and connector J122 on the DC controller PCA.
 - b. If the error persists, replace the tray 1 paper pick up assembly.

Part number: RM2-6556-000CN

For instructions: *Removal and replacement: Pickup assembly* See the Repair Service Manual for this product.
11. If the motor test passes, test the tray 1 pickup solenoid.

- a. Use the [Component Test](#) and test the tray 1 pickup solenoid. If the solenoid test fails, check J95 on the right door assembly and connector J124 on the DC controller PCA.
- b. If the error persists, replace the right door assembly.

Part number: RM2-6622-000CN

For instructions: *Removal and replacement: Right door* See the Repair Service Manual for this product.

12. If the issue persists, elevate the case using the Standard Support Process.

13 . B2 . D2 Jam in Right Door

Paper delay jam at the image area.

Paper did not reach SR11 in specified time when printing from Tray 2.

If using adhesive or self-sealing media, go to **WISE** and search for the following document: A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper (ish_3199741-3199797-16). *A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper.*

Recommended action for customers

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.

3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab (line below 3 triangles). See following images.

Figure 6-26 Tray 2 paper guides

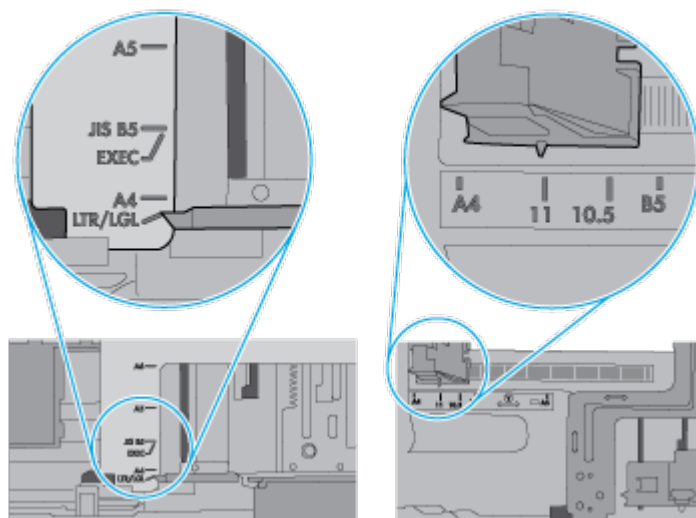


Figure 6-27 Tray height mark



4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.

3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab (line below 3 triangles). See the following images.

Figure 6-28 Tray 2 paper guides

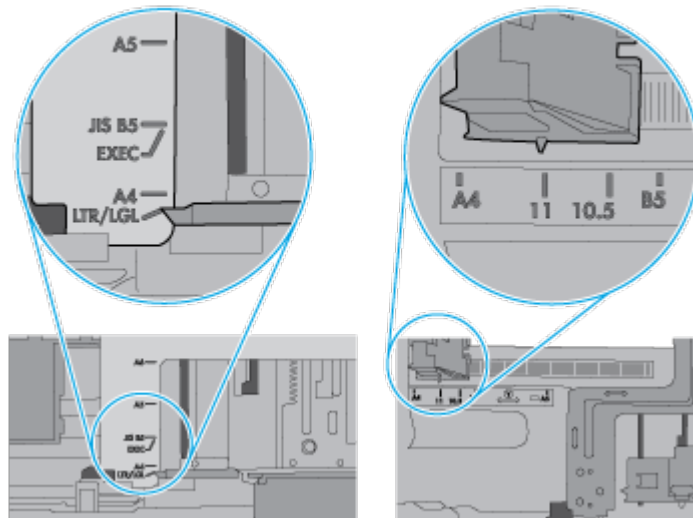


Figure 6-29 Tray height mark



4. Ensure that the tray 2 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.
Part number: J7Z98-67902
For instructions: *Removal and replacement: Trays 2 and 3 roller kit*
6. Test the top of page sensor (SR11) to ensure that it moves freely.
7. Check the ITB and T2 roller at the transfer area. Ensure that the parts are seated correctly and no parts are damaged. Replace the ITB or T2 roller as needed.
 - Use the following table to order or replace the ITB for the printer.

Table 6-12 ITB part number

Customer type	Part number	Description
Managed Print Services (MPS)	P1B93-69001	Intermediate Transfer Belt PM Kit
All others (non-MPS)	P1B93-67901	Image transfer belt - Includes tray 2 transfer roller, paper pick-up roller, tray 2 separation roller, retard roller, and transfer roller guide.

For instructions: *Removal and replacement: Intermediate transfer belt*

- Transfer roller kit part number: RM2-6561-000CN

For instructions: *Removal and replacement: Secondary transfer roller*

8. Open the following menus:

- [Support Tools](#)
- [Troubleshooting](#)
- [Diagnostic Tests](#)

9. Test the registration assembly sensors using the manual sensor test.

a. Open the following menus:

- [Support Tools](#)
- [Troubleshooting](#)
- [Diagnostic Tests](#)
- [Manual Sensor Test](#)

b. Test the registration sensor (SR11)

c. Test the paper width sensors SR12 and SR13.

d. If any of the sensors fail, check the connections to the registration assembly and the connector J133 on the DC controller.

e. If the error persists, replace the registration unit.

Registration unit part number: RM2-1957-000CN

For instructions: *Removal and replacement: Registration assembly* See the Repair Service Manual for this product.

10. If the sensors functioning correctly, check the tray 2 motor.

a. Use the [Component Test](#) and test the tray 2 pickup motor.

Part number: RM2-6556-000CN

For instructions: *Removal and replacement: Pickup assembly* See the Repair Service Manual for this product.

- b. If the test fails, disconnect and reconnect J70 on the pickup assembly and connector J122 on the DC controller PCA.
 - c. Retest the motor. If the motor test continues to fail, replace the tray 2 pickup drive assembly.
Part number: RM2-6556-000CN
For instructions: *Removal and replacement: Pickup assembly* See the Repair Service Manual for this product.
- 11. If motor is functioning correctly, check the tray 2 pickup clutch.
 - a. Use the [Component Test](#) and test the tray 2 pickup clutch.
Part number: RM2-6556-000CN
For instructions: *Removal and replacement: Pickup assembly* See the Repair Service Manual for this product.
 - b. If the test fails, disconnect and reconnect J76 on the right door assembly and connector J124 on the DC controller PCA.
 - c. Retest the motor. If the motor test continues to fail, replace the tray 2 lifter drive assembly.
Part number: RM2-6669-000CN
For instructions: *Removal and replacement: Lifter drive assembly* See the Repair Service Manual for this product.
- 12. If the previous tests pass, run a few pages to check where the leading edge of the paper stops. If the test shows any defective parts, replace the appropriate assembly.

Table 6-13 ITB part number

Customer type	Part number	Description
Managed Print Services (MPS)	P1B93-69001	Intermediate Transfer Belt PM Kit
All others (non-MPS)	P1B93-67901	Image transfer belt - Includes tray 2 transfer roller, paper pick-up roller, tray 2 separation roller, retard roller, and transfer roller guide.

For instructions: *Removal and replacement: Intermediate transfer belt* See the Repair Service Manual for this product.

- 13. If the issue persists, elevate the case using the Standard Support Process.

13 . B2 . D4 Jam in Lower Right Door

Paper delay jam at SR11 when printing from tray 4.

Paper did not reach the registration sensor (SR11) in the designated amount of time when printing from Tray 4.

This error occurs from Tray 4 of the 2,550-sheet paper-feeder.

If using adhesive or self-sealing media, go to **WISE** and search for the following document: A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing

on self-adhesive paper (ish_3199741-3199797-16). A *"13.BY.XY paper jam"* or *"41.03.XY Size Mismatch"* message displays on the printer control panel when printing on self-adhesive paper.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the lower right door on the High Capacity Input (HCI).
 - b. Look for and clear any paper present or obstructions in the paper path.


Figure 6-30 Lower right door jam



- c. Open and close the upper right door to allow the printer to attempt to clear the jam message.

2. Open Tray 4, and check if the paper is skewed.

Figure 6-31 Skewed paper

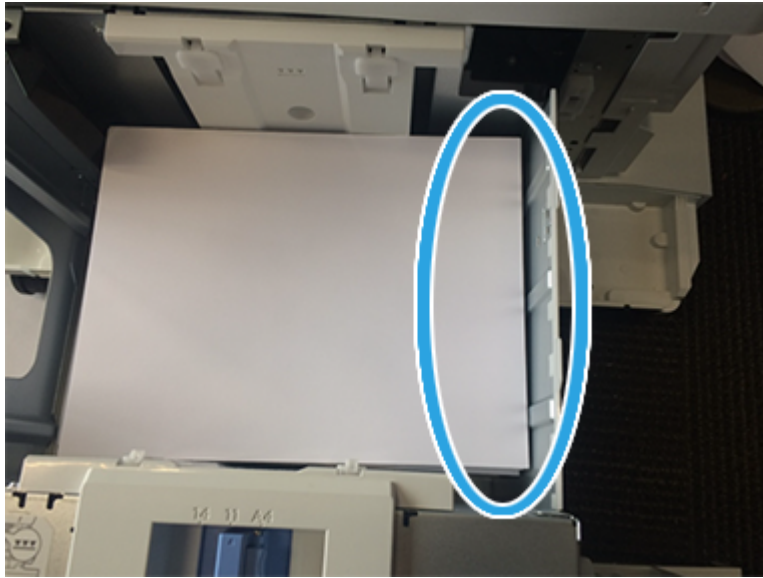

3. Ensure that the type and quality of the paper being used meets the HP specifications for the printer.
4. Complete the following tasks for Tray 4:
 - a. Unload all the paper from the tray.
 - b. Adjust the paper-size guides of the tray to the correct position for the paper being installed into the tray.
 - c. Reload the paper into tray 4.
 - d. Ensure that the paper is stacked correctly.
5. Ensure that the tray is not overfilled, and then close Tray 4.
6. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open the lower right door on the High Capacity Input (HCI).

- b. Look for and clear any paper present or obstructions in the paper path.

Figure 6-32 Lower right door jam



- c. Open and close the upper right door to allow the printer to attempt to clear the jam message.
2. Open Tray 4, and check if the paper is skewed.

Figure 6-33 Skewed paper



3. Ensure that the type and quality of the paper being used meets the HP specifications for the printer.

4. Complete the following tasks for Tray 4:
 - a. Unload all the paper from the tray.
 - b. Adjust the paper-size guides of the tray to the correct position for the paper being installed into the tray.
 - c. Reload the paper into tray 4.
 - d. Ensure that the paper is stacked correctly.
5. Ensure that the tray is not overfilled, and then close Tray 4.
6. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
7. Test the top of page sensor (SR11) to ensure that it moves freely.
8. Check the ITB and T2 roller at the transfer area. Ensure that the parts are seated correctly and no parts are damaged. Replace the ITB or T2 roller as needed.
 - Use the following table to order or replace the ITB for the printer.

Table 6-14 ITB part number

Customer type	Part number	Description
Managed Print Services (MPS)	P1B93-69001	Intermediate Transfer Belt PM Kit
All others (non-MPS)	P1B93-67901	Image transfer belt - Includes tray 2 transfer roller, paper pick-up roller, tray 2 separation roller, retard roller, and transfer roller guide.

For instructions: *Removal and replacement: Intermediate transfer belt*

- Transfer roller kit part number: RM2-6561-000CN

For instructions: *Removal and replacement: Secondary transfer roller*

9. Open the following menus:
 - [Support Tools](#)
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
10. Test the registration assembly sensors using the manual sensor test.
 - a. Open the following menus:
 - [Support Tools](#)
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
 - b. Test the registration sensor (SR11)

- c. Test the paper width sensors SR12 and SR13.
- d. If any of the sensors fail, check the connections to the registration assembly and the connector J133 on the DC controller.
- e. If the error persists, replace the registration unit.

Registration unit part number: RM2-1957-000CN

For instructions: *Removal and replacement: Registration assembly* See the Repair Service Manual for this product.

11. If the issue persists, elevate the case using the Standard Support Process.

13.B2.Dz Jam in Right Door

Paper delay jam in the top cover at the image area.

Paper did not reach SR11 in specified time.

- **13.B2.D3**

Paper did not reach the registration sensor (SR11) in the designated amount of time when printing from Tray 3.

- **13.B2.D4**

Paper did not reach the registration sensor (SR11) in the designated amount of time when printing from Tray 4.

- **13.B2.D5**

Paper did not reach the registration sensor (SR11) in the designated amount of time when printing from Tray 5.

- **13.B2.DD**

Paper did not reach the registration sensor (SR11) in the designated amount of time when being re-fed from the duplexer.

If using adhesive or self-sealing media, go to **WISE** and search for the following document: A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper (ish_3199741-3199797-16). A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. Test the top of page sensor (SR11) to ensure that it moves freely.
4. Check the ITB and T2 roller at the transfer area. Ensure that the parts are seated correctly and no parts are damaged. Replace the ITB or T2 roller as needed.
 - Use the following table to order or replace the ITB for the printer.

Table 6-15 ITB part number

Customer type	Part number	Description
Managed Print Services (MPS)	P1B93-69001	Intermediate Transfer Belt PM Kit
All others (non-MPS)	P1B93-67901	Image transfer belt - Includes tray 2 transfer roller, paper pick-up roller, tray 2 separation roller, retard roller, and transfer roller guide.

For instructions: *Removal and replacement: Intermediate transfer belt*

- Transfer roller kit part number: RM2-6561-000CN

For instructions: *Removal and replacement: Secondary transfer roller*

5. Open the following menus:
 - [Support Tools](#)
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
6. Test the registration assembly sensors using the manual sensor test.
 - a. Open the following menus:
 - [Support Tools](#)
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - Manual Sensor Test
 - b. Test the registration sensor (SR11)
 - c. Test the paper width sensors SR12 and SR13.

- d. If any of the sensors fail, check the connections to the registration assembly and the connector J133 on the DC controller.
- e. If the error persists, replace the registration unit.

Registration unit part number: RM2-1957-000CN

For instructions: *Removal and replacement: Registration assembly* See the Repair Service Manual for this product.

7. If the issue persists, elevate the case using the Standard Support Process.

13 . B2 . FF Jam in Right door

Paper residual jam in top cover at image area.

Paper present at SR11, SR12 or SR13 at power on or after clearing a jam.

If using adhesive or self-sealing media, go to **WISE** and search for the following document: A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper (ish_3199741-3199797-16). A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Test the top of page sensor (SR11) and the paper width sensors (SR12, SR13). If any of these sensors fail, replace the registration assembly.

Part number: RM2-1957-000CN

For instructions: *Removal and replacement: Registration assembly* See the Repair Service Manual for this product.

13 . B4 . FF Jam in Right Door

Paper residual jam at image area.

Paper present at fuser loop sensor SR8615 at power on or after clearing a jam.

If using adhesive or self-sealing media, go to **WISE** and search for the following document: A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper (ish_3199741-3199797-16). *A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper.*

Recommended action for customers

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Remove the fuser and check for paper and the correct movement of the sensors SR8615.

 **CAUTION:** The fuser might be hot.

3. Test the fuser loop sensor SR8615.
4. If either sensor fails the test replace the fuser.

Fuser Kit 110v part number: RM2-1928-000CN

Fuser Kit 220v part number: RM2-1929-000CN

For instructions: *Removal and replacement: Fuser*

13.B9.AZ Fuser jam

Fuser delivery stay jam; paper stay jam in the fuser area; paper present at SR8611/8613 after specified time limit.

For additional troubleshooting information, go to **WISE** and search for the following document: HP LaserJet Enterprise MFP, HP LaserJet Managed MFP - 13.B9.A1 or 13.80.A1 Jam (Emerging Issue) (c05868398).

Or click on this link: [HP LaserJet Enterprise MFP, HP LaserJet Managed MFP - 13.B9.A1 or 13.80.A1 Jam \(Emerging Issue\)](#)

If using adhesive or self-sealing media, go to **WISE** and search for the following document: A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing

on self-adhesive paper (ish_3199741-3199797-16). A *"13.BY.XY paper jam" or "41.03.XY Size Mismatch"* message displays on the printer control panel when printing on self-adhesive paper.

This jam code can be caused by:

- An accordion paper jam at the fuser exit.
- Something blocking the paper before reaching the output rollers.
- The output bin rollers are not turning. Because there is very little distance from the fuser exit to the output bin, paper stopped at the rollers can cause a fuser jam.
- A sticky fuser exit flag. If the flag is stuck or even delayed momentarily in the activated position it can cause this jam.

- **13.B9.A1** Multi-feed jam is detected when printing from Tray 1.
- **13.B9.A2** Multi-feed jam is detected when printing from Tray 2.
- **13.B9.A3** Multi-feed jam is detected when printing from Tray 3.
- **13.B9.A4** Multi-feed jam is detected when printing from Tray 4.
- **13.B9.A5** Multi-feed jam is detected when printing from Tray 5.
- **13.B9.AD** Multi-feed jam is detected when printing from the Duplexer.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.



IMPORTANT: If this error occurs on printers that have a stapler/stacker attached and the output is going only to the stapler/stacker bin, go to **WISE** and search for the following document to troubleshoot: HP LaserJet Enterprise MFP, HP LaserJet Managed MFP - 13.B9.A1 or 13.80.A1 Jam (Emerging Issue) (c05868398).

Or click on this link: [HP LaserJet Enterprise MFP, HP LaserJet Managed MFP - 13.B9.A1 or 13.80.A1 Jam \(Emerging Issue\)](#)

If the jam occurs when the output is going to the top output of the stapler/stacker, or on printers that do not have a stapler/stacker attached, troubleshoot using the following steps:

1. Clear the paper jam.

- a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
 3. Check the fuser delivery sensor for correct functionality and movement.

 **CAUTION:** The fuser might be hot.

4. Verify there is no debris from a previous jam stuck in the fuser, or the rollers leading into and out of the fuser.
5. Confirm that the output bin rollers are turning.
6. Remove the ITB and inspect the ITB and T2 roller for any damage and debris. If damaged, replace the ITB or the T2 roller.
 - Use the following table to order or replace the ITB for the printer.

Table 6-16 ITB part number

Customer type	Part number	Description
Managed Print Services (MPS)	P1B93-69001	Intermediate Transfer Belt PM Kit
All others (non-MPS)	P1B93-67901	Image transfer belt - Includes tray 2 transfer roller, paper pick-up roller, tray 2 separation roller, retard roller, and transfer roller guide.

For instructions: *Removal and replacement: Intermediate transfer belt* See the Service Manual for this printer.

- Transfer roller kit part number: RM2-6561-000CN

For instructions: *Removal and replacement: Secondary transfer roller* See the Service Manual for this printer.

7. Replace the fuser.

Fuser Kit 110v part number: RM2-1928-000CN

Fuser Kit 220v part number: RM2-1929-000CN

For instructions: *Removal and replacement: Fuser* See the Service Manual for this printer.

13.B9.Cz

Fuser wrap jam.

This jam occurs when the paper disappears from the fuser output sensor before a designated amount of time after the paper reached the fuser output sensor (SR8611/8613).

It is determined that the paper is being wrapped around the fuser roller.

Z = Fuser mode

- **13.B9.C1** Fuser wrap jam when **Auto Sense (Normal)**.
- **13.B9.C2** Fuser wrap jam when **Normal**.
- **13.B9.C3** Fuser wrap jam when **Light 1** or **Light 2**.
- **13.B9.C4** Fuser wrap jam when **Heavy 1**.
- **13.B9.C5** Fuser wrap jam when **Heavy 2**.
- **13.B9.C6** Fuser wrap jam when **Heavy Paper 3**.
- **13.B9.C7** Fuser wrap jam when **Glossy Paper 1**.
- **13.B9.C8** Fuser wrap jam when **Glossy Paper 2**.
- **13.B9.C9** Fuser wrap jam when **Glossy Paper 3**.
- **13.B9.CB** Fuser wrap jam when **Transparency**.
- **13.B9.CC** Fuser wrap jam when **Label**.
- **13.B9.CD** Fuser wrap jam when **Envelope 1** or **Envelope 2**.

If using adhesive or self-sealing media, go to **WISE** and search for the following document: A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper (ish_3199741-3199797-16). A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Remove the fuser, and remove any paper wrapped around the fuser roller.



CAUTION: The fuser might be hot! Allow the fuser to cool before handling.

 - c. Look for and clear any paper present or obstructions in the paper path.
 - d. Reinstall the fuser.
 - e. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Print a cleaning page to ensure that all of the toner is removed from the fuser roller.
3. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the upper right door.

- b. Remove the fuser, and remove any paper wrapped around the fuser roller.

 **CAUTION:** The fuser might be hot.

- c. Look for and clear any paper present or obstructions in the paper path.
 - d. Reinstall the fuser.
 - e. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Print a cleaning page to ensure that all of the toner is removed from the fuser roller.
 3. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
 4. If the error persists, replace the fuser.

Fuser Kit 110v part number: RM2-1928-000CN

Fuser Kit 220v part number: RM2-1929-000CN

For instructions: *Removal and replacement: Fuser*

13.B9.Dz

Fuser delivery delay jam.

Paper did not reach the fuser sensor SR8611/8613 within the specified time.

- **13.B9.D1** Fuser delivery delay jam when printing from Tray 1.
- **13.B9.D2** Fuser delivery delay jam when printing from Tray 2.
- **13.B9.D3** Fuser delivery delay jam when printing from Tray 3.
- **13.B9.D4** Fuser delivery delay jam when printing from Tray 4.
- **13.B9.D5** Fuser delivery delay jam when printing from Tray 5.
- **13.B9.DD** Fuser delivery delay jam when printing with the Duplexer.

The following are possible causes and areas that should be investigated.

- The paper jam is found wrapped around the fuser roller. In this case it is a sign of a worn out fuser.
- The paper jam is found in the transfer area. This could be caused by transfer area damage.
- A fuser drive or delivery issue.

If using adhesive or self-sealing media, go to **WISE** and search for the following document: A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper (ish_3199741-3199797-16). A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.

- c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Determine where the jam is located and remove the jam.
 - a. Open the upper right door and check for paper present in the paper path.
 - b. Remove the fuser and check for paper or obstructions.

 **CAUTION:** The fuser might be hot.

2. If the paper stopped before the fuser, complete these troubleshooting steps:
 - a. Thoroughly check the duplex paper path and the ITB and transfer area for any issues with the rollers, jammed paper, or any obstructions that might be causing the jam.
 - b. Verify that the T2 transfer roller is seated correctly and not worn or deformed. Replace the T2 transfer roller as needed.

Part number: RM2-6561-000CN

For instructions: *Removal and replacement: Secondary transfer roller*

- c. Inspect the transfer feed assembly for debris or damage. Replace the right door sub assembly as needed.

Part number: RM2-6622-000CN

For instructions: *Removal and replacement: Right door* See the Repair Service Manual for this product.

- d. Remove the ITB and inspect it for any damage and debris. If damaged, replace the ITB.

Use the following table to order or replace the ITB for the printer.

Table 6-17 ITB part number

Customer type	Part number	Description
Managed Print Services (MPS)	P1B93-69001	Intermediate Transfer Belt PM Kit
All others (non-MPS)	P1B93-67901	Image transfer belt - Includes tray 2 transfer roller, paper pick-up roller, tray 2 separation roller, retard roller, and transfer roller guide.

For instructions: *Removal and replacement: Intermediate transfer belt*

3. If the paper stopped in or at the fuser, complete these troubleshooting steps:

- a. Remove the fuser and inspect the fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.

Fuser Kit 110v part number: RM2-1928-000CN

Fuser Kit 220v part number: RM2-1929-000CN

For instructions: *Removal and replacement: Fuser*

- b. Open the following menus:

- [Support Tools](#)
- [Troubleshooting](#)
- [Diagnostic Tests](#)

- c. Test the fuser delivery sensor (SR8611/8613) using the [Manual Sensor Test](#) to verify that the sensor is functioning correctly. If the test fails, replace the fuser.

Fuser Kit 110v part number: RM2-1928-000CN

Fuser Kit 220v part number: RM2-1929-000CN

For instructions: *Removal and replacement: Fuser*

- d. Run the fuser motor drive test using the [Component Test](#) to verify that the fuser drive and gears are functioning correctly. If they are not, replace the fuser motor assembly.

Part number: RM2-1955-000CN

For instructions: *Removal and replacement: Fuser motor* See the Repair Service Manual for this product.

13.B9.FF

Residual paper jam at the fuser output sensor.

Paper is present at SR8611/8613 at power on or after clearing a jam.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the upper right door.

- b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Verify the paper meets the HP printer specifications.
 3. Remove the fuser and inspect the fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.

 **CAUTION:** The fuser might be hot.

Fuser Kit 110v part number: RM2-1928-000CN

Fuser Kit 220v part number: RM2-1929-000CN

For instructions: *Removal and replacement: Fuser*

4. Open the following menus:
 - [Support Tools](#)
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
5. Test the fuser delivery sensor (SR8611/8613) using the [Manual Sensor Test](#) to verify that the sensor is functioning correctly. If the test fails, replace the fuser.

Fuser Kit 110v part number: RM2-1928-000CN

Fuser Kit 220v part number: RM2-1929-000CN

For instructions: *Removal and replacement: Fuser*

6. Run the fuser motor drive test using the [Component Test](#) to verify that the fuser drive and gears are functioning correctly. If they are not, replace the fuser motor assembly.

Part number: RM2-1955-000CN

For instructions: *Removal and replacement: Fuser motor* See the Repair Service Manual for this product.

7. If the issue persists, replace the fuser motor assembly and the fuser.

Fuser motor part number: RM2-1955-000CN

For instructions: *Removal and replacement: Fuser motor* See the Repair Service Manual for this product.

Fuser Kit 110v part number: RM2-1928-000CN

Fuser Kit 220v part number: RM2-1929-000CN

For instructions: *Removal and replacement: Fuser*

13 . BA . EE Front Door Open

The front was door open during printing.

Recommended action for customers

- Close the front door to allow the printer to attempt to clear the jam.

Recommended action for call-center agents and onsite technicians

1. Close the front door to allow the printer to attempt to clear the jam.
2. Check the projection part on the front door assembly that contacts the switch sensor. If the it is damaged, replace the front door assembly.

Part number: RM2-6658-000CN

For instructions: *Removal and replacement: Front door assembly* See the Repair Service Manual for this product.

3. Check the 24V interlock switch.
 - a. Open the following menus:
 - [Support Tools](#)
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - b. Run the switch test in the sensor monitor mode to verify that SW1 the 24V interlock switch is functioning correctly.
 - c. If the test fails, disconnect and reconnect the connector J21 of the 24V interlock switch and connector J108 on the DC controller PCA.
 - d. Retest the switch. If the test fails, replace the 24V interlock switch.

Part number: RM2-8449-000CN

- e. Run the switch test in the sensor monitor mode to verify that SW3 the 5V interlock switch is functioning correctly.
- f. If the test fails, disconnect and reconnect the connector J109 on the DC controller PCA
- g. Retest the switch. If the test fails, replace the 5V interlock switch.

Part number: RM2-1947-000CN

13 . BB . EE Right Door Open

The upper right was door open during printing.

Recommended action for customers

- Close the upper right door to allow the printer to attempt to clear the jam.

Recommended action for call-center agents and onsite technicians

1. Close the upper right door to allow the printer to attempt to clear the jam.

2. Check the projection part on the right door assembly that contacts the switch sensor. If the it is damaged, replace the right door assembly.

Part number: RM2-6622-000CN

For instructions: *Removal and replacement: Right door* See the Repair Service Manual for this product.

3. Disconnect and reconnect the connector J99 of the 24V interlock switch and connector J115 on the DC controller PCA.
4. Replace the SW6 interlock switch.

Part number: RK2-0535-000CN

For instructions: *Removal and replacement: Microswitch* See the Repair Service Manual for this product.

13.D3.Dz

Late to duplex re-feed jam.

- **13.D3.D1** The fuser is printing in fuser mode **Auto Sense** special case distinguished from "typed" Normal.
- **13.D3.D2** The fuser is printing in fuser mode **Normal**.
- **13.D3.D3** The fuser is printing in fuser mode **Light 1** or **Light 2**.
- **13.D3.D4** The fuser is printing in fuser mode **Heavy 1**.
- **13.D3.D5** The fuser is printing in fuser mode **Heavy 2**.
- **13.D3.D6** The fuser is printing in fuser mode **Heavy Paper 3**.
- **13.D3.D7** The fuser is printing in fuser mode **Glossy Paper 1**.
- **13.D3.D8** The fuser is printing in fuser mode **Glossy Paper 2**.
- **13.D3.D9** The fuser is printing in fuser mode **Glossy Paper 3**.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.

- a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Perform the continuous paper path test in simplex mode of at least 50 pages to ensure that issue is occurring while duplex printing only.
3. Test duplexing from multiple trays to see if issue is tray specific or not. If the jam occurs from only one specific tray, troubleshoot the tray for pick and feed issues.
 - a. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
 - b. Ensure the tray is set correctly. If Tray 1 is set to ANY size ANY type, set it to the size the customer is trying to print on.
 - c. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
 - d. Ensure that the tray pickup, feed, and separation rollers are installed correctly and show no damage or wear. Clean or replace the rollers as needed.
4. Check the duplex unit.
 - a. Open the following menus:
 - [Support Tools](#)
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - b. Using the [Component Tests](#) menu, run the duplex switchback motor test and the duplex switchback solenoid test.
 - c. If either of the tests fail, check the connections to the duplex assembly J64 and J65 and DC controller J153 are correctly seated.
 - d. If the error persists, replace the right door assembly.

 Part number: RM2-6622-000CN

 For instructions: *Removal and replacement: Right door* See the Repair Service Manual for this product.
5. Check the right door assembly and rollers for any damage or debris. Replace the right door assembly as needed.

 Part number: RM2-6622-000CN

 For instructions: *Removal and replacement: Right door* See the Repair Service Manual for this product.
6. Check the delivery roller and assembly for any damage or debris. Replace the delivery assembly as needed.

 Part number: RM2-6621-000CN

For instructions (M652, M653): *Removal and replacement: Delivery assembly (M652, M653)* See the Repair Service Manual for this product.

For instructions (M681, M682): *Removal and replacement: Delivery assembly (M681, M682)* See the Repair Service Manual for this product.

13.D3.FF

A power on jam has occurred at the duplex refeed sensor.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Check the duplex unit.
 - a. Open the following menus:
 - [Support Tools](#)
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - b. Using the [Component Tests](#), run the duplex switchback motor test and the duplex switchback solenoid test.
 - c. If either of the tests fail, check the connections to the duplex assembly J64 and J65 and DC controller J153 are correctly seated.
 - d. If the error persists, replace the right door assembly.

Part number: RM2-6622-000CN

For instructions: *Removal and replacement: Right door* See the Repair Service Manual for this product.

3. Check the right door assembly and rollers for any damage or debris. Replace the right door assembly as needed.

Part number: RM2-6622-000CN

For instructions: *Removal and replacement: Right door* See the Repair Service Manual for this product.

13.E1.Dz

Output delivery delay jam. Paper did not reach the output bin full sensor in time.

- **13.E1.D1** The fuser is printing in fuser mode **Auto Sense** special case distinguished from "typed" Normal.
- **13.E1.D2** The fuser is printing in fuser mode **Normal**.
- **13.E1.D3** The fuser is printing in fuser mode **Light 1** or **Light 2**.
- **13.E1.D4** The fuser is printing in fuser mode **Heavy 1**.
- **13.E1.D5** The fuser is printing in fuser mode **Heavy 2**.
- **13.E1.D6** The fuser is printing in fuser mode **Heavy Paper 3**.
- **13.E1.D7** The fuser is printing in fuser mode **Glossy Paper 1**.
- **13.E1.D8** The fuser is printing in fuser mode **Glossy Paper 2**.
- **13.E1.D9** The fuser is printing in fuser mode **Glossy Paper 3**.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Check the delivery roller and assembly for any damage or debris. Replace the delivery assembly as needed.

Part number: RM2-6621-000CN

For instructions (M652, M653): *Removal and replacement: Delivery assembly (M652, M653)* See the Repair Service Manual for this product.

For instructions (M681, M682): *Removal and replacement: Delivery assembly (M681, M682)* See the Repair Service Manual for this product.

3. Check the fuser for damage or wear. Replace the fuser as needed.

Fuser Kit 110v part number: RM2-1928-000CN

Fuser Kit 220v part number: RM2-1929-000CN

For instructions: *Removal and replacement: Fuser*

13.E1.FF

A power on jam has occurred at the output bin full sensor.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Check the delivery roller and assembly for any damage or debris. Replace the delivery assembly as needed.

Part number: RM2-6621-000CN

For instructions (M652, M653): *Removal and replacement: Delivery assembly (M652, M653)* See the Repair Service Manual for this product.

For instructions (M681, M682): *Removal and replacement: Delivery assembly (M681, M682)* See the Repair Service Manual for this product.

3. Check the fuser for damage or wear. Replace the fuser as needed.

Fuser Kit 110v part number: RM2-1928-000CN

Fuser Kit 220v part number: RM2-1929-000CN

For instructions: *Removal and replacement: Fuser*

13.FF.FF

A power on residual paper jam has occurred.

This error has no specific sensor designated. It could be any sensor in the paper feed path.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Look for paper present or obstructions in the paper path. View the event log to determine if other jam errors are occurring and troubleshoot those errors.
3. Use the [Manual Sensors Test](#) or [Tray/Bin Manual Sensors Test](#) to isolate a faulty door switch or sensor.
4. Replace parts as determined by sensor tests, damage, or obstructions.

13.80.D1 Paper jam in stapler/stacker

Late to Stapler/Stacker jam

Recommended action for customers

1. Check the printer for a jam in the stapler/stacker.
2. Look for and clear any paper present or obstructions in the paper path.
3. View event log to determine if other jam errors are occurring and troubleshoot those errors.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Check the printer for a jam.

2. Look for and clear any paper present or obstructions in the paper path.
3. View event log to determine if other jam errors are occurring and troubleshoot those errors.
4. Verify there is no debris from a previous jam stuck in the fuser, or the rollers leading into and out of the fuser.
5. Confirm that the output bin rollers are turning.
6. If the error persists, replace the stapler/stacker micro switch.

Micro switch (stapler/stacker) part number: WC4-5171-000CN

13.83.FO

Power on Jam/Stacker jam - middle sensor.

Recommended action for customers


1. Check the printer for a jam in the stapler/stacker.
2. Look for and clear any paper in the upper right cover of the stapler/stacker.
3. View the event log to determine if any other jam errors are occurring and troubleshoot those errors.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Check the printer for a paper jam.
2. Look for and clear any paper in the upper right cover of the stapler stacker.
3. View the event log to determine if any other jam errors are occurring and troubleshoot those errors.
4. Confirm that the output bin rollers are turning.

5. If this occurs after service of the upper paper feed assembly, check that the cover was reinstalled correctly and is not blocking sensor movement.

Figure 6-34 Sensor location

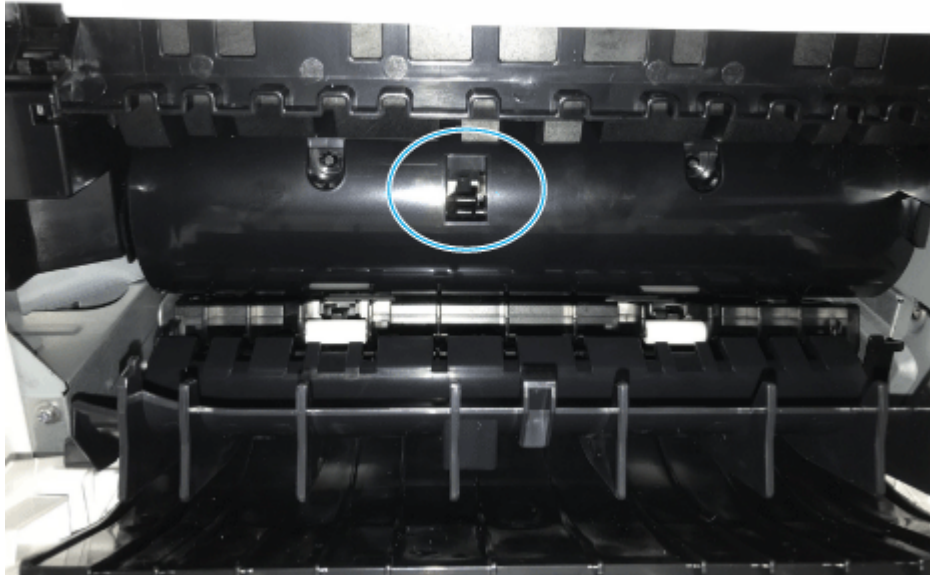

6. If the error persists, replace the stapler/stacker upper paper feed assembly.

Part number: RM2-6810-000CN

For instructions: *Removal and replacement: Stapler/Stacker upper paper feed assembly* See the Repair Service Manual for this product.

20.WX.YZ and 21.WX.YZ error messages

20.* errors

Errors in the 20.* family are related to the printer memory. The page might require more memory than the printer has available.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Touch the **OK** button to continue.
2. Reduce the page complexity.
3. Add product memory.

21.* errors

Errors in the 21.* family are related to the printer memory. The page might require more memory than the printer has available.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Touch the **OK** button to continue.
2. Reduce the page complexity.
3. Add product memory.

20 . 00 . 00 Insufficient memory <device>

Event log message 20.00.00.

The printer does not have enough memory to print the page.

The printer received more data than can fit in the available memory. Too many macros, soft fonts, or complex graphics might have been in the attempted transfer.

Recommended action

- Touch the **OK** button to print the transferred data. Some data might be lost. Reduce the page complexity or add printer memory.

21 . 00 . 00 Page Too ComplexEvent log error message 21.00.00.

The printer displays this message to indicate that the page decompression process was too slow for the printer.

Recommended action

- Touch the **OK** button to continue. There may be some data loss on the page that was being formatted when the error occurred.

30.WX.YZ error messages

30.* errors

Errors in the 30.* family are related to the flatbed scanner.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Calibrate the scanner. Open these menus: **Device Maintenance > Calibrate-Cleaning > Calibrate Scanner**.
2. Clean the scanner glass and glass strips.

3. Perform the tests for scanner diagnostics. Open these menus: [Administration > Troubleshooting > Diagnostic Tests > Scanner Tests](#).
4. Upgrade the firmware.
For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)
5. Check all connections on the scanner control board and from the scanner control board to the formatter and the DC controller or the engine control board. If all connections are good, replace the scanner control board.
6. Replace the formatter.
7. If the error persists, replace the scanner assembly.

30.01.01

The flatbed cover sensor was interrupted.

The scanner flatbed cover is open.

This message appears only in the event log and is not posted on the control panel.

The control panel will read **Flatbed Cover Open**.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer, and then press the power button to turn on the printer.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the printer and then turn on the printer.
2. Open the scanner lid.

3. Locate the black plastic sensor flag on the document feeder/scanner cover. This sensor is located on the left rear of the document feeder/flatbed glass.



4. If the black plastic sensor flag on the ADF is damaged or missing, replace the image scanner assembly.

Table 6-18 Image scanner kit part number


Description	Part number
Image scanner kit - Includes white backing and retention clips, keyboard cover, and rear cover	J8A10-67901

For instructions: *Removal and replacement: Image scanner assembly* See the Repair Service Manual for this product.

5. Perform the following tests to check the functionality of the flatbed cover sensor.
 - a. Press the ADF black plastic sensor flag down and allow it to spring back, and then press the sensor flag down again. Ensure that the control panel displays a warning message "Flatbed cover open" when the black sensor flag is in the up position. The warning message should not display when the sensor flag is pressed down.

If the test is functional, perform the next test to verify the actuation of the sensor flag.

Figure 6-35 "Flatbed cover open" warning message

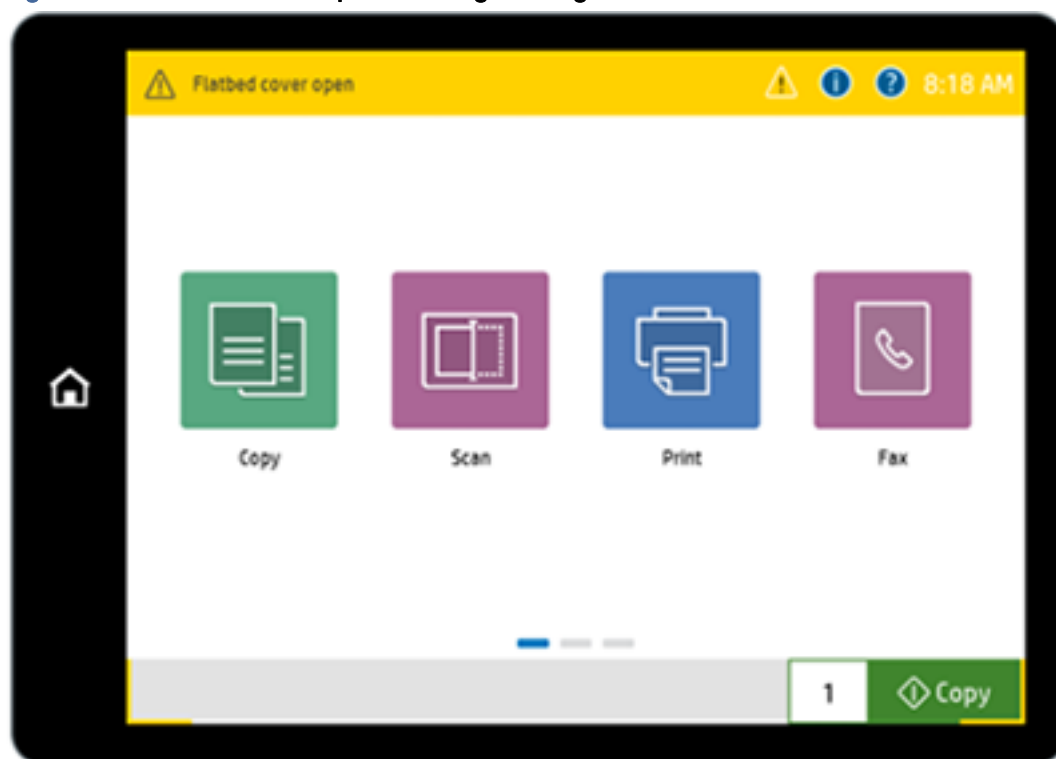

- b. Open and close the scanner lid to test the functionality of the sensor flag. Check the document feeder hinges and ensure the ADF cover is seated correctly.

 **NOTE:** If the actuation of the sensor flag works while depressing manually but not when opening and closing the scanner lid, inspect the ADF hinges to verify they are not broken, and that the ADF is seated correctly.

6. If a broken hinge is identified, replace the ADF hinge.

Table 6-19 ADF hinge part number

Description	Part number
ADF hinge	5851-7205

7. Access the [Manual Sensor Test](#) on the printer control panel to verify the functionality of the [Flatbed cover](#) sensor.


- a. From the Home screen on the control panel, scroll to and select [Support Tools](#).

 **NOTE:** The control panel menu options might vary depending on the printer model and firmware version installed.

- b. Open the following menus: **Troubleshooting > Diagnostic Tests > Manual Sensor Test**.

- c. Select **Flatbed cover**.

Figure 6-36 Flatbed cover option in Manual Sensor Test menu on the printer control panel

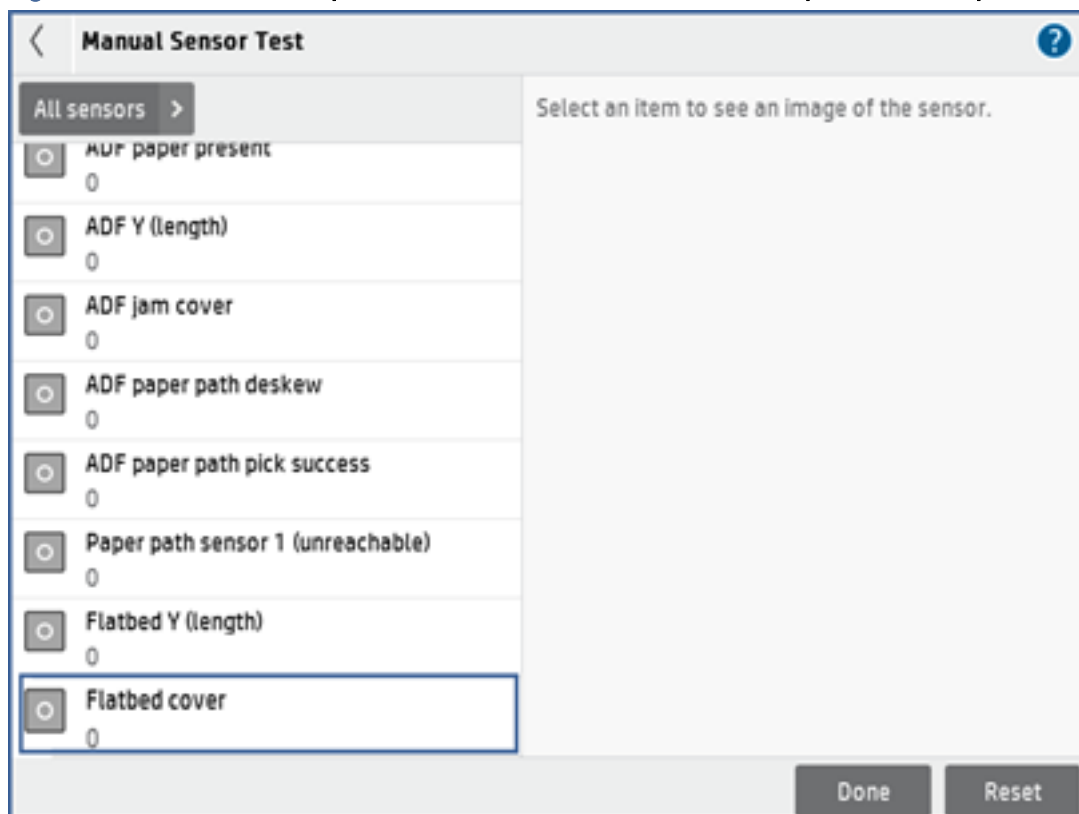

- d. Open and close the flatbed cover.



NOTE: The Flatbed cover sensor counter under the sensor name should increment by one (from "0" to "1", for example) each time the cover is opened or closed.

- e. Check the control panel display to verify the sensor is activated and incremented by one each time you open and close the flatbed cover.
8. If the flatbed cover sensor does not actuate and the counter is not incremented, replace the image scanner assembly.

Table 6-20 Image scanner kit part number

Description	Part number
Image scanner kit- Includes white backing and retention clips, keyboard cover, and rear cover	J8A10-67901

For instructions: *Removal and replacement: Image scanner assembly* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-37 Gate Closed



Figure 6-38 Proper Insertion

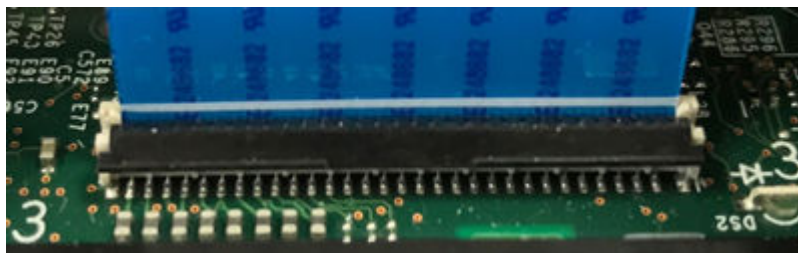


Figure 6-39 Improper Insertion



1. Turn off the printer, and then turn on the printer.
2. Open the scanner lid.

3. Locate the black plastic sensor flag on the document feeder/scanner cover. This sensor is located on the left rear of the document feeder/flatbed glass.



4. If the black plastic sensor flag on the ADF is damaged or missing, replace the image scanner assembly.

Table 6-21 Image scanner kit part number

Description	Part number
Image scanner kit - Includes white backing and retention clips, keyboard cover, and rear cover	J8A10-67901

For instructions: *Removal and replacement: Image scanner assembly* See the Repair Service Manual for this product.

5. Access the [Manual Sensor Test](#) on the printer control panel to verify the functionality of the flatbed cover sensor.

- a. From the Home screen on the control panel, scroll to and select [Support Tools](#).




NOTE: The control panel menu options might vary depending on the printer model and firmware version installed.

- b. Open the following menus: **Troubleshooting > Diagnostic Tests > Manual Sensor Test**.

- c. Select **Flatbed cover**.

Figure 6-40 Flatbed cover option in Manual Sensor Test menu on the printer control panel

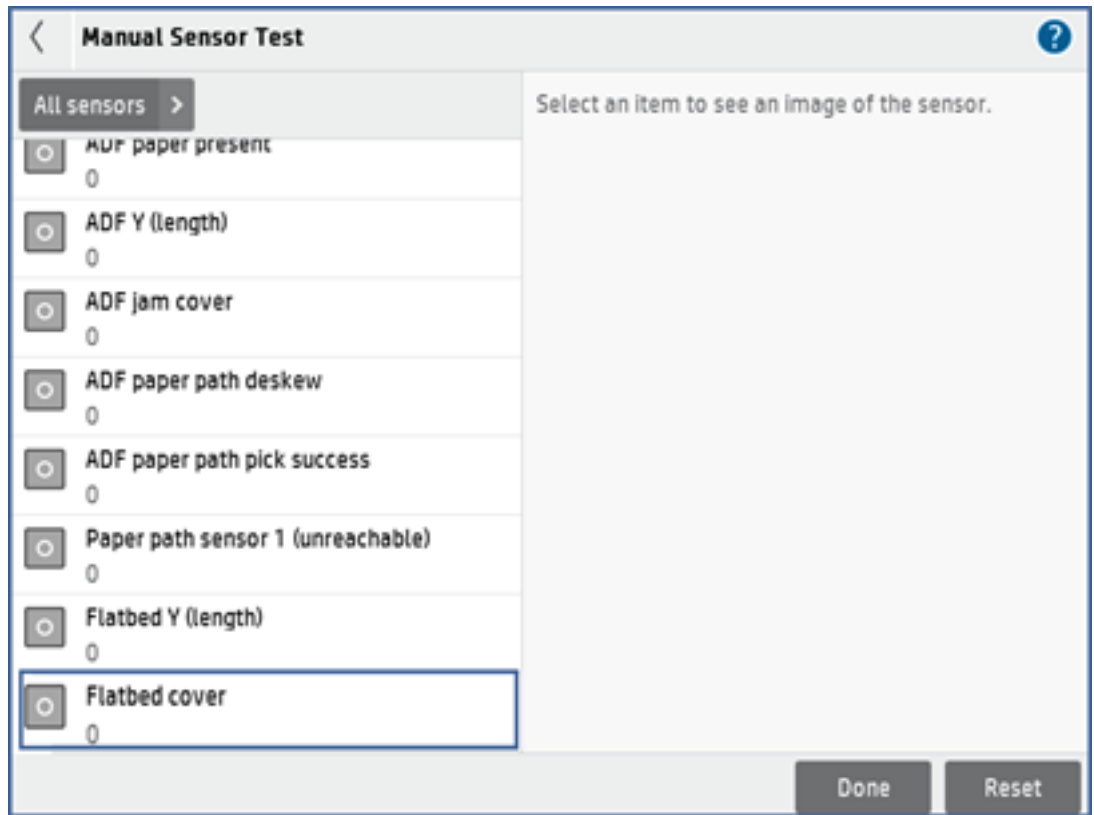

6. Perform the following test in the order presented to verify the functionality of the **Flatbed cover** sensor.

NOTE: The Flatbed cover sensor counter under the sensor name should increment by one (from "0" to "1", for example) for each actuation of the sensor flag or each time the document flatbed cover is opened or closed.

- a. Press the ADF black plastic sensor flag down and allow it to spring back. Repeat the steps and check if the Flatbed cover sensor counter increments by one for each actuation of the sensor flag.
- b. If the sensor fails to actuate the counter, replace the image scanner assembly.

Table 6-22 Image scanner kit part number

Description	Part number
Image scanner kit - Includes white backing and retention clips, keyboard cover, and rear cover	J8A10-67901

- c. If the sensor flag increases the counter, open and close the flatbed cover to actuate the sensor while performing the same test.
- d. If the flatbed cover sensor does not actuate and advance the counter, inspect the ADF hinges to verify that they are not broken, and to ensure that the flatbed cover is seated correctly.

- e. If a broken hinge is identified, replace the ADF hinge.

Table 6-23 ADF hinge part number

Description	Part number
ADF hinge	5851-7205

For instructions, see the Repair Service Manual for this product.

7. If the error persists, disconnect and reconnect all the cables on the scanner control board (SCB).

Figure 6-41 Scanner control board (SCB): Sensor connections

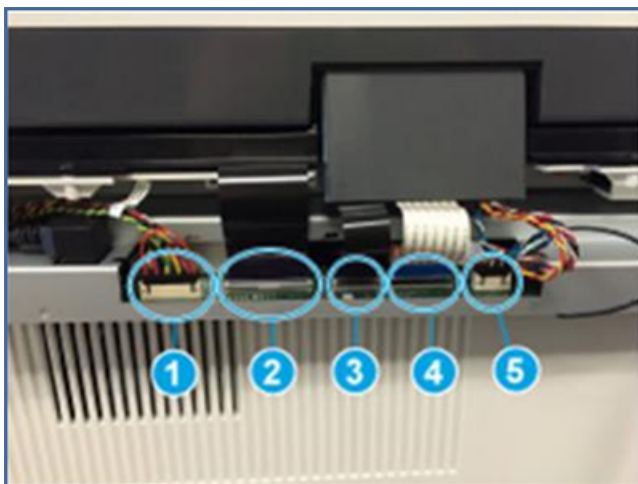


Table 6-24 SCB sensor callout descriptions

Callout	Description
1	Flatbed sensor/motor
2	Flatbed FFC
3	ADF sensor
4	ADF FFC
5	ADF Motor

8. If the error persists after the SCB cables are connected correctly, replace the scanner control board (SCB).

Table 6-25 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) - Flow series	5851-7347

For instructions: *Removal and replacement: Scanner control board* See the Repair Service Manual for this product.

30 . 01 . 08 Home position error

The scanner optic failed to return to the home position.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then turn on the printer.
2. Print a Configuration Page and check if the latest version of printer and scanner firmware are installed. If the firmware is not on the latest version, update the firmware.
3. Print a Configuration Page to check if the latest version of the printer and scanner firmware is installed. If the latest firmware version is not installed, update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists after the firmware update, perform a Continuous Scan diagnostic test using the printer control panel to test the functionality of the scan optics.
 - a. From the Home screen on the control panel, scroll to and touch [Support Tools](#).




NOTE: The control panel menu options might vary depending on the printer model and firmware version installed.

- b. Open the following menus: **Troubleshooting > Diagnostic Tests**.
- c. Select [Continuous Scan](#).

- d. Select **Start** to run the test.

Figure 6-42 Start the Continuous Scan test

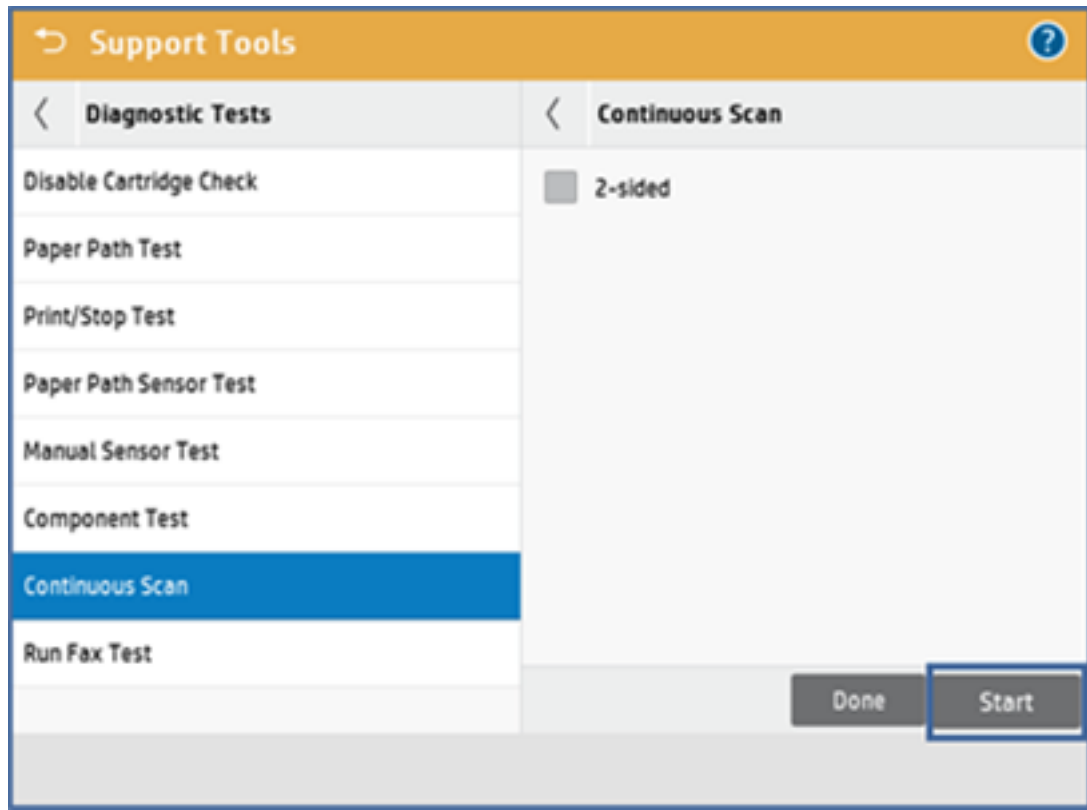

- e. Check if the scan head moves from the home position through the scan, and back to the home position.

 **NOTE:** The scan head should actuate, moving from the home position through a scan, and back to the home position. This process will repeat until interrupted.

5. If the scan head does not actuate or operate correctly, replace the image scanner assembly (ISA).

Table 6-26 Image scanner kit part number

Description	Part number
Image scanner kit - Includes white backing and retention clips, keyboard cover, and rear cover	J8A10-67901

For instructions: *Removal and replacement: Image scanner assembly* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

 **NOTE:** When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-43 Gate Closed

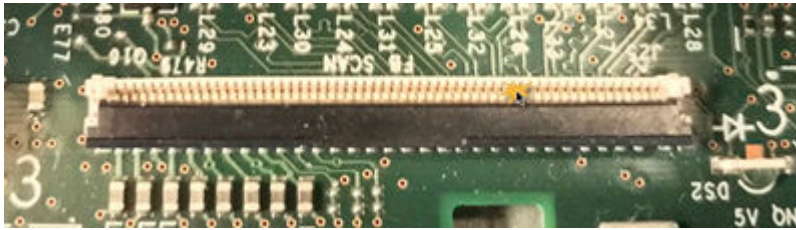


Figure 6-44 Proper Insertion

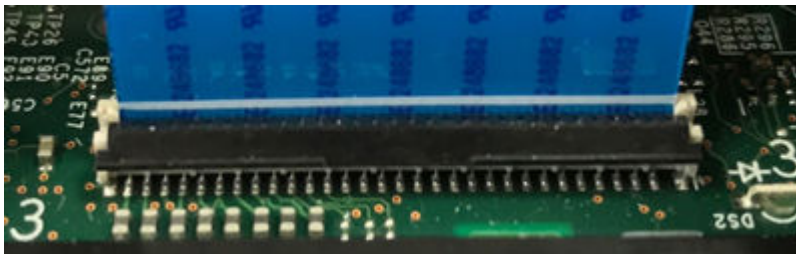


Figure 6-45 Improper Insertion




1. Turn off the printer, and then turn on the printer.
 2. Print a Configuration Page to check if the latest version of the printer and scanner firmware is installed. If the latest firmware version is not installed, update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).
 3. If the error persists after the firmware update, perform a Continuous Scan diagnostic test using the printer control panel to test the functionality of the scan optics.
 - a. From the Home screen on the control panel, scroll to and touch [Support Tools](#).
-
-  **NOTE:** The control panel menu options might vary depending on the printer model and firmware version installed.
-
- b. Open the following menus: **Troubleshooting > Diagnostic Tests**.
 - c. Select [Continuous Scan](#).

- d. Select **Start** to run the test.

Figure 6-46 Start the Continuous Scan test

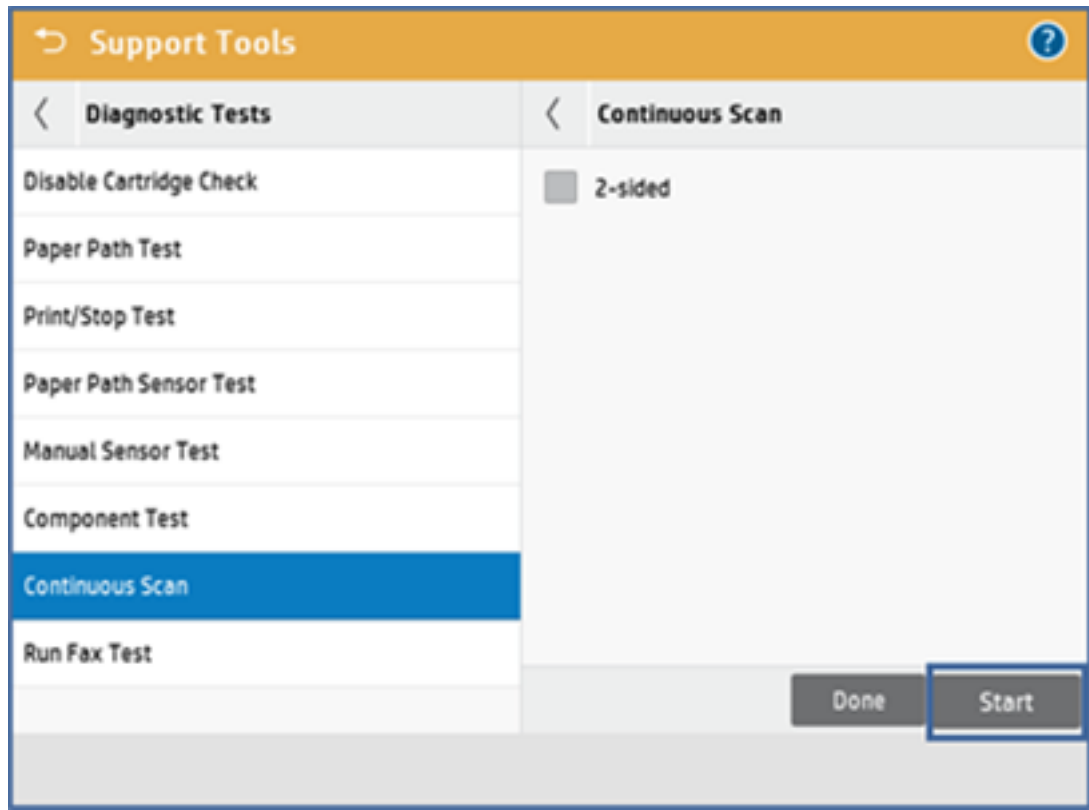

- e. Check if the scan head moves from the home position through the scan, and back to the home position.

 **NOTE:** The scan head should actuate, moving from the home position through a scan, and back to the home position. This process will repeat until interrupted.

4. If the scan head does not actuate or operate correctly, replace the image scanner assembly (ISA).

Table 6-27 Image scanner kit part number

Description	Part number
Image scanner kit - Includes white backing and retention clips, keyboard cover, and rear cover	J8A10-67901

For instructions: *Removal and replacement: Image scanner assembly* See the Repair Service Manual for this product.

5. If the error persists, disconnect and reconnect all the cables on the scanner control board (SCB).

 **NOTE:** Ensure that all the cables on the SCB are connected and seated correctly before replacing any parts.

Figure 6-47 Scanner control board (SCB): Sensor connections

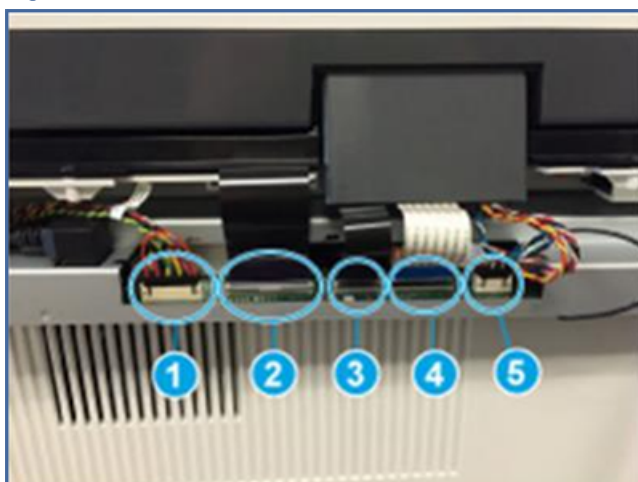


Table 6-28 SCB sensor callout descriptions

Callout	Description
1	Flatbed sensor/motor
2	Flatbed FFC
3	ADF sensor
4	ADF FFC
5	ADF Motor

6. If the issue persists, replace the scanner control board (SCB).

Table 6-29 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) - Flow series	5851-7347

For instructions: *Removal and replacement: Scanner control board* See the Repair Service Manual for this product.

30 . 01 . 14 Scan system EEPROM error

SCB EEPROM error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. If the issue persists, print a Configuration Page to check if the latest version of the printer and scanner firmware is installed. If the latest firmware version is not installed, update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the error persists after updating the latest firmware, replace the scanner control board (SCB).

Table 6-30 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) - Flow series	5851-7347

For instructions: *Removal and replacement: Scanner control board* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

 **NOTE:** When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-48 Gate Closed



Figure 6-49 Proper insertion


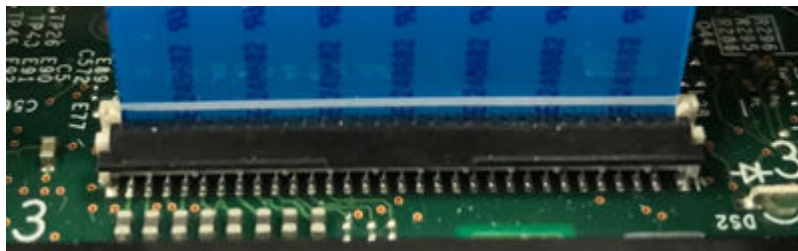


Figure 6-50 Improper insertion

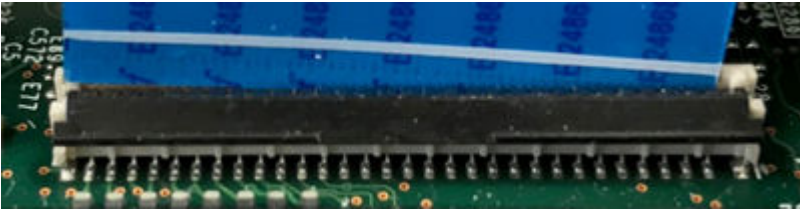

1. Turn off the printer, and then turn on the printer.
2. If the issue persists, print a Configuration Page to check if the latest version of the printer and scanner firmware is installed. If the latest firmware version is not installed, update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the error persists, disconnect and reconnect all the cables on the scanner control board (SCB).

 **NOTE:** Ensure that all the cables on the SCB are connected and seated correctly before replacing any parts.

Figure 6-51 Scanner control board (SCB): Sensor connections

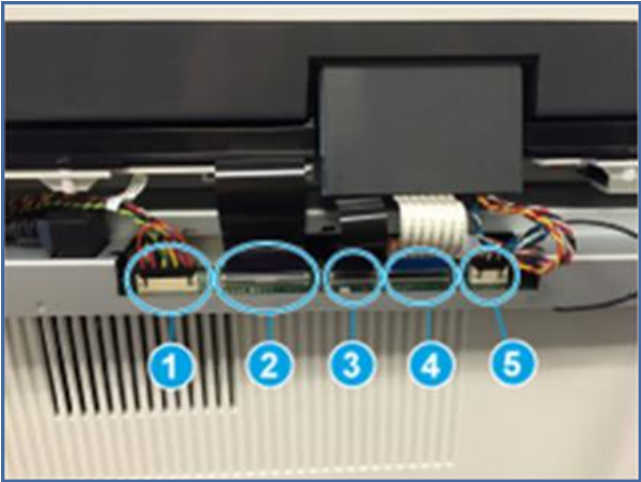


Table 6-31 SCB sensor callout descriptions

Callout	Description
1	Flatbed sensor/motor
2	Flatbed FFC
3	ADF sensor
4	ADF FFC
5	ADF Motor

4. If the issue persists, replace the scanner control board (SCB).

Table 6-32 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) - Flow series	5851-7347

For instructions: *Removal and replacement: Scanner control board* See the Repair Service Manual for this product.

30.01.41 Scanner error

The formatter lost connections with the SCB or communication was corrupted.



NOTE: Check the voltage of the unit on the regulatory sticker. This event is directly related to a 220V printer being plugged into a 110V outlet. Ensure that the voltage of the outlet matches the voltage of the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then disconnect the power cable from the printer.
2. Wait for one minute, and then reconnect the power cable.
3. Use the power button to turn on the printer.
4. If the error persists, upgrade the printer firmware to the latest version.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.



IMPORTANT: If this error occurs after the control panel has come out of Sleep mode or after opening and closing the ADF multiple times, go to [HP LaserJet Enterprise MFP M631-M633, HP LaserJet Managed MFP E62555-E62575 Non-Flow - Control panel is not responsive and/or a 30.01.41 error](#) (document c06103348) for additional troubleshooting steps.

1. Turn off the printer, and then disconnect the power cable from the printer.
2. Wait for one minute, reconnect the power cable, and then turn on the printer.
3. If the error persists, turn the printer off and then disconnect and reconnect all of the connections on the scan control board (SCB); the Flat flexible cables (FFC), HDMI cables, and standard cables.

4. If the issue persists, replace the Scanner control board (SCB).

Table 6-33 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) - Flow series	5851-7347

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-52 Gate Closed



Figure 6-53 Proper insertion

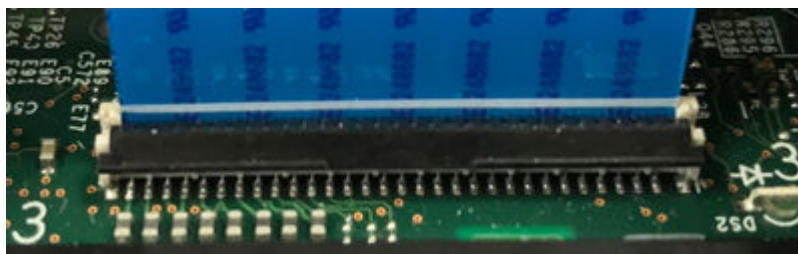


Figure 6-54 Improper insertion



IMPORTANT: If this error occurs after the control panel has come out of Sleep mode or after opening and closing the ADF multiple times, go to [HP LaserJet Enterprise MFP M631-M633, HP LaserJet Managed MFP E62555-E62575 Non-Flow - Control panel is not responsive and/or a 30.01.41 error](#) (document c06103348) for additional troubleshooting steps.

1. Turn off the printer, and then disconnect the power cable from the printer.
2. Wait for one minute, reconnect the power cable, and then turn on the printer.

3. If the error persists, turn the printer off and then disconnect and reconnect all of the connections on the scan control board (SCB); the Flat flexible cables (FFC), HDMI cables, and standard cables.

 **NOTE:** Ensure that all the cables on the SCB are connected and seated correctly before replacing any parts.

Figure 6-55 SCB cables and the HDMI cable



Table 6-34 SCB cables and the HDMI cable callout descriptions

Callout	Description
1	Power cable
2	HDMI (Formatter/SCB communication)
3	Flatbed sensor/motor
4	Flatbed FFC
5	ADF sensor/motor
6	ADF FFC
7	ADF Motor

Figure 6-56 HDMI cable



4. If the issue persists, replace the Scanner control board (SCB).

Table 6-35 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) - Flow series	5851-7347

For instructions: *Removal and replacement: Scanner control board* See the Repair Service Manual for this product.

5. Open the automatic document feeder (ADF) to view the flatbed or scanner glass, and then use the power button to turn on the printer.
6. Check if the flatbed scanner lamp illuminates (lights) and/or the scan head assembly moves, and then perform the appropriate task:
 - If the flatbed scanner lamp **does not light** and/or the scan head assembly does not move, replace the Integrated Scanner Assembly (ISA).

Table 6-36 Image scanner kit part number

Description	Part number
Image scanner kit - Includes white backing and retention clips, keyboard cover, and rear cover	J8A10-67901

For instructions: *Removal and replacement: Image scanner assembly* See the Repair Service Manual for this product.

- If the flatbed scanner lamp **does light** and/or the scan head assembly moves, replace the Automatic Document Feeder (ADF).

Table 6-37 Automatic Document Feeder (ADF) part numbers

Description	Part number
Document feeder kit Enterprise series (<i>Includes white backing and retention clips</i>)	5851-7203
Document feeder kit Workflow series (<i>Includes white backing and retention clips</i>)	5851-7204

For instructions: *Removal and replacement: Automatic document feeder* See the Repair Service Manual for this product.

7. If the issue persists, replace the scanner control board (SCB) to formatter power cable.

Table 6-38 SCB to formatter power cable part number

Description	Part number
Scanner control board (SCB) to formatter power cable	J8A10-60110

8. If the issue persists, replace the formatter.

Use the table below to order the correct part number for the printer.

Table 6-39 Formatter part numbers

Description/Product models	Part number
Formatter (main logic) PC board assembly	J8A10-60001
For products: M681/M682	
Formatter (main logic) PC board assembly (India/China)	J8A10-67902
For products: M681/M682	
Kit-Formatter	3GY31-67901
For products: E67650/E67660	

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

30 . 01 . 43 SCB memory failure

SCB memory error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, replace the Scanner control board (SCB).

Table 6-40 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) - Flow series	5851-7347

For instructions: *Removal and replacement: Scanner control board* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

 **NOTE:** When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-57 Gate Closed



Figure 6-58 Proper insertion

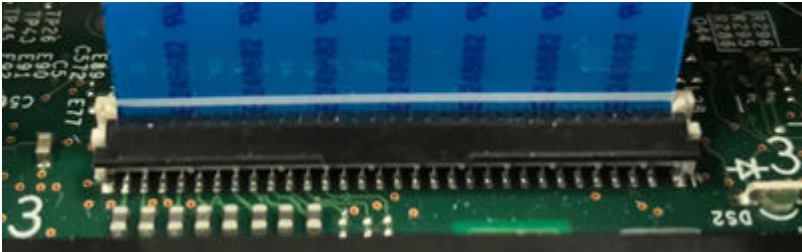


Figure 6-59 Improper insertion



1. Turn the printer off, and then on.
2. If the error persists, disconnect and reconnect all the cable connections on the scanner control board (SCB).

 **NOTE:** Ensure that all the cables on the SCB are connected and seated correctly before replacing any parts.

Figure 6-60 SCB cables and the HDMI cable



Table 6-41 SCB cables and the HDMI cable callout descriptions

Callout	Description
1	Power cable

Table 6-41 SCB cables and the HDMI cable callout descriptions (continued)

Callout	Description
2	HDMI (Formatter/SCB communication)
3	Flatbed sensor/motor
4	Flatbed FFC
5	ADF sensor/motor
6	ADF FFC
7	ADF Motor

3. If the error persists, replace the Scanner control board (SCB).

Table 6-42 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) - Flow series	5851-7347

For instructions: *Removal and replacement: Scanner control board* See the Repair Service Manual for this product.

4. If the error persists, replace the formatter.

Use the table below to order the correct part number for the printer.

Table 6-43 Formatter part numbers

Description/Product models	Part number
Formatter (main logic) PC board assembly	J7Z98-60001
For products: M652/M653	
Formatter (main logic) PC board assembly (India/China)	J7Z98-67904
For products: M652/M653	
Formatter (main logic) PC board assembly	J8A10-60001
For products: M681/M682	
Formatter (main logic) PC board assembly (India/China)	J8A10-67902
For products: M681/M682	

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

30.01.44

SCB communication error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then disconnect the power cable from the printer.
2. Wait for one minute, and then reconnect the power cable.
3. Use the power button to turn on the printer, and then check if the error persists.
4. If the error persists, update the printer firmware to the latest version.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

 **IMPORTANT:** If this error occurs after the control panel has come out of Sleep mode or after opening and closing the ADF multiple times, go to [HP LaserJet Enterprise MFP M631-M633, HP LaserJet Managed MFP E62555-E62575 Non-Flow - Control panel is not responsive and/or a 30.01.41 error](#) (document c06103348) for additional troubleshooting steps.

1. Use the power button to turn off the printer, and then disconnect the power cable from the printer.
2. Wait for one minute, reconnect the power cable, and then turn the printer power on.
3. If the error persists, update the printer to the latest firmware version.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, turn off the printer.
5. Open the automatic document feeder (ADF) to view the flatbed or scanner glass, and then use the power button to turn on the printer.
6. Check if the flatbed scanner lamp illuminates (lights) and/or the scan head assembly moves, and then perform the appropriate task:
 - If the flatbed scanner lamp **does not light** and/or the scan head assembly does not move, replace the Integrated Scanner Assembly (ISA).

Table 6-44 Image scanner kit part number

Description	Part number
Image scanner kit - Includes white backing and retention clips, keyboard cover, and rear cover	J8A10-67901

For instructions: *Removal and replacement: Image scanner assembly* See the Repair Service Manual for this product.

- If the flatbed scanner lamp **does light** and/or the scan head assembly moves, replace the Automatic Document Feeder (ADF).

Table 6-45 Automatic Document Feeder (ADF) part numbers

Description	Part number
Document feeder kit Enterprise series <i>(Includes white backing and retention clips)</i>	5851-7203
Document feeder kit Workflow series <i>(Includes white backing and retention clips)</i>	5851-7204

For instructions: *Removal and replacement: Automatic document feeder* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

 **NOTE:** When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-61 Gate Closed



Figure 6-62 Proper insertion

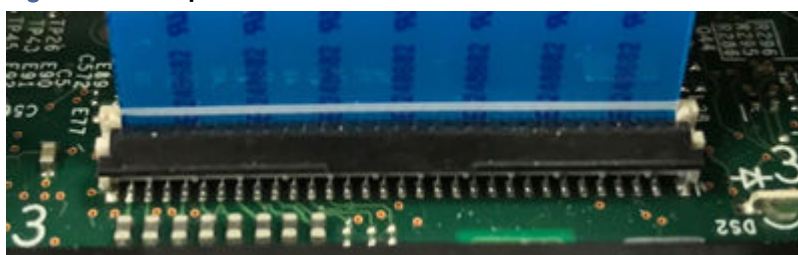


Figure 6-63 Improper insertion



 **IMPORTANT:** If this error occurs after the control panel has come out of Sleep mode or after opening and closing the ADF multiple times, go to [HP LaserJet Enterprise MFP M631-M633, HP LaserJet](#)

[Managed MFP E62555-E62575 Non-Flow - Control panel is not responsive and/or a 30.01.41 error](#) (document c06103348) for additional troubleshooting steps.

1. Turn off the printer, and then disconnect the power cable from the printer.
2. Wait for one minute, reconnect the power cable, and then turn on the printer.
3. If the error persists, upgrade the printer firmware to the latest version.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, disconnect and reconnect all the cables on the scanner control board (SCB).

 **NOTE:** Ensure that all the cables on the SCB are connected and seated correctly before replacing any parts.

Figure 6-64 SCB cables and the HDMI cable



Table 6-46 SCB cables and the HDMI cable callout descriptions

Callout	Description
1	Power cable
2	HDMI (Formatter/SCB communication)
3	Flatbed sensor/motor
4	Flatbed FFC
5	ADF sensor/motor
6	ADF FFC
7	ADF Motor

5. If the error persists, disconnect and reconnect the HDMI cable located on the formatter.

Figure 6-65 HDMI cable



6. If the error persists, turn off the printer.
7. Open the automatic document feeder (ADF) to view the flatbed or scanner glass, and then use the power button to turn on the printer.
8. Check if the flatbed scanner lamp illuminates (lights) and/or the scan head assembly moves, and then perform the appropriate task:
 - If the flatbed scanner lamp **does not light** and/or the scan head assembly does not move, replace the Integrated Scanner Assembly (ISA).

Table 6-47 Image scanner kit part number

Description	Part number
Image scanner kit - Includes white backing and retention clips, keyboard cover, and rear cover	J8A10-67901

For instructions: *Removal and replacement: Image scanner assembly* See the Repair Service Manual for this product.

- If the flatbed scanner lamp **does light** and/or the scan head assembly moves, replace the Automatic Document Feeder (ADF).

Table 6-48 Automatic Document Feeder (ADF) part numbers

Description	Part number
Document feeder kit Enterprise series (<i>Includes white backing and retention clips</i>)	5851-7203
Document feeder kit Workflow series (<i>Includes white backing and retention clips</i>)	5851-7204

For instructions: *Removal and replacement: Automatic document feeder* See the Repair Service Manual for this product.

9. If the issue persists, replace the Scanner control board (SCB).

Table 6-49 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) - Flow series	5851-7347

For instructions: *Removal and replacement: Scanner control board* See the Repair Service Manual for this product.

10. If the issue persists, replace the formatter.

Use the table below to order the correct part number for the printer.

Table 6-50 Formatter part numbers

Description/Product models	Part number
Formatter (main logic) PC board assembly	J8A10-60001
For products: M681/M682	
Formatter (main logic) PC board assembly (India/China)	J8A10-67902
For products: M681/M682	
Kit-Formatter	3GY31-67901
For products: E67650/E67660	

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

11. If the issue persists, replace the scanner control board (SCB) to formatter power cable.

Table 6-51 SCB to formatter power cable part number

Description	Part number
Scanner control board (SCB) to formatter power cable	J8A10-60110

30.01.46 Scanner Error

Scanner firmware error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer.
2. Use the power button to turn on the printer, and then check if the error persists.
3. If the error persists, update the printer firmware to the latest version.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, replace the Scanner control board (SCB).

Table 6-52 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) - Flow series	5851-7347

For instructions: *Removal and replacement: Scanner control board* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-66 Gate Closed



Figure 6-67 Proper insertion

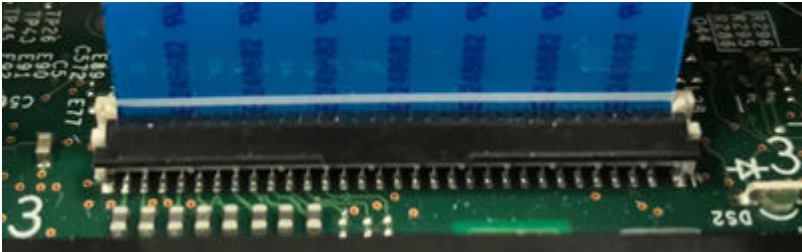


Figure 6-68 Improper insertion



- 1. Turn the printer off, and then on.
- 2. If the error persists, disconnect and reconnect all the cables on the scanner control board (SCB).

 **NOTE:** Ensure that all the cables on the SCB are connected and seated correctly before replacing any parts.

Figure 6-69 SCB cables and the HDMI cable

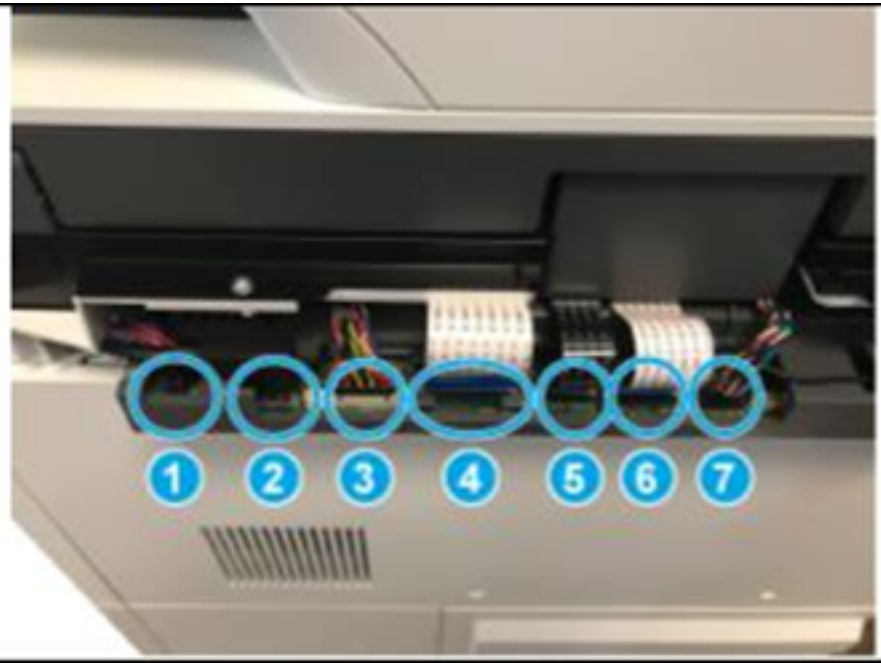


Table 6-53 SCB cables and the HDMI cable callout descriptions

Callout	Description
1	Power cable
2	HDMI (Formatter/SCB communication)

Table 6-53 SCB cables and the HDMI cable callout descriptions (continued)

Callout	Description
3	Flatbed sensor/motor
4	Flatbed FFC
5	ADF sensor/motor
6	ADF FFC
7	ADF Motor

3. If the issue persists, replace the Scanner control board (SCB).

Table 6-54 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) - Flow series	5851-7347

For instructions: *Removal and replacement: Scanner control board* See the Repair Service Manual for this product.

30.01.54

24V SCB power reached an over-current condition and the over-current is persistent after an automatic power cycle. (Event Log Message Only)

This issue typically appears after a 2-sided scan from the ADF, and the control panel might become unresponsive.

For additional troubleshooting steps, go to **WISE** and search for the following document: HP LaserJet Enterprise MFP M631-M633, HP LaserJet Managed MFP E62555-E62575 Non-Flow - Control panel is not responsive and/or a 30.01.41 error (Emerging Issue) (document c06103348).

Or click on the following link: [HP LaserJet Enterprise MFP M631-M633, HP LaserJet Managed MFP E62555-E62575 Non-Flow - Control panel is not responsive and/or a 30.01.41 error \(Emerging Issue\)](#)

Recommended action for customers

1. Turn the printer off, and then on.
2. This error message should automatically clear.
3. If the error persists, download FutureSmart firmware 4.7 or later.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.

2. This error message should automatically clear.
3. If the error persists, download FutureSmart firmware 4.7 or later. DO NOT replace any hardware components.

30.01.57

Scanner error detected.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer, and then press the power button to turn on the printer.
2. If the error persists, upgrade the printer firmware.

To download the latest printer firmware version, go to [HP Customer Support - Software and Driver Downloads](#).

For instructions to update the printer firmware, go to *HP Enterprise, HP Managed - Update the printer firmware*.

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Upgrade the printer and scanner firmware.
2. If the error persists, replace the Scanner Control Board (SCB).

Part number: 5851-7764

30.03.14

A non-fatal error has occurred.

A scanner EEPROM (NVM) error has occurred.

Recommended action for all

- This is an informational message, and no action is required.

30.03.20

Front side scanner not detected.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

 **NOTE:** When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-70 Gate Closed



Figure 6-71 Proper insertion

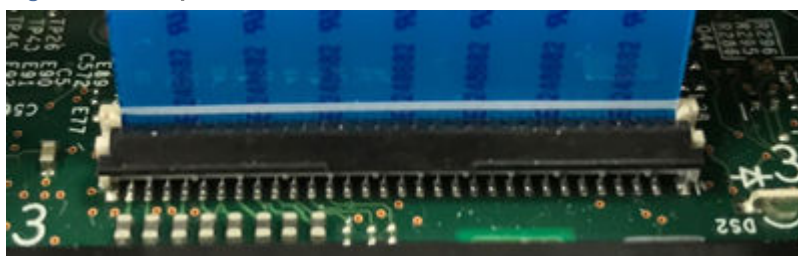


Figure 6-72 Improper insertion



1. Turn the printer off, and then on.
2. Verify that the FFCs between the scanner and the SCB are connected.
3. Replace the image scanner kit.

Part number: J8A10-67901

For instructions: *Removal and replacement: Image scanner assembly* See the Repair Service Manual for this product.

30 . 03 . 22 Scanner failure

Front side illumination calibration failure.

The scan module cannot see the illumination module, or marginal illumination.

The optical assembly may not be parked under the calibration strip.

Recommended action for customers

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Upgrade the firmware.
3. Check the event log for other scanner errors. If the errors are present, resolve those errors.
4. Reseat the image scanner FFC connection.
5. Under the troubleshooting menu, run a “Continuous Scan” single sided to verify that the flatbed scan assembly moves freely and the scanner bulb is illuminated.
6. Replace the image scanner kit.

Part number: J8A10-67901

For instructions: *Removal and replacement: Image scanner assembly* See the Repair Service Manual for this product.

30.03.23 Scanner failure

Calibration error.

Recommended action for customers

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Upgrade the firmware.
3. Check the event log for other scanner errors. If the errors are present, resolve those errors.
4. Reseat the image scanner FFC connection.
5. Under the troubleshooting menu, run a “Continuous Scan” single sided to verify that the flatbed scan assembly moves freely and the scanner bulb is illuminated.

6. Replace the image scanner kit.

Part number: J8A10-67901

For instructions: *Removal and replacement: Image scanner assembly* See the Repair Service Manual for this product.

 **NOTE:** If the error persists on a Flow model only, the failure might be in the second side scanner of the document feeder. Replace the document feeder.

Flow models part number: 5851-7204

For instructions: *Removal and replacement: Document feeder* See the Repair Service Manual for this product.

30 . 03 . 30 Scanner Failure

Flatbed motor shutdown.

The SCB cannot communicate with the flatbed scanner motor.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

 **NOTE:** When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-73 Gate Closed



Figure 6-74 Proper insertion


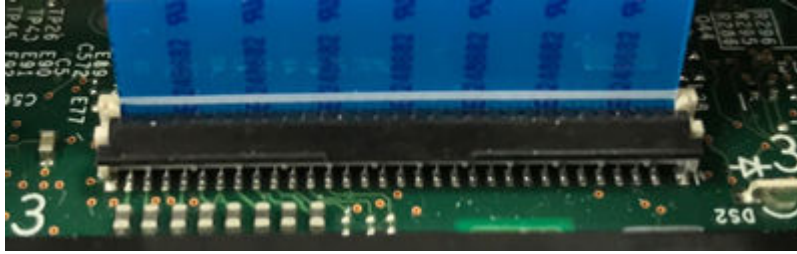


Figure 6-75 Improper insertion



1. Turn the printer off, and then on. As the printer turns on, open the document feeder, and verify that the scan head moves.
2. Verify that the drive belt is in the correct position.
3. Run diagnostics on the flatbed scanner to see if the scan bar moves. For this test, run the continuous scan from the Diagnostics test menu.
4. If the error persists, turn the printer off, and then check all cables on the scanner control board (SCB) for correct connection and seating.

Figure 6-76 SCB Connections

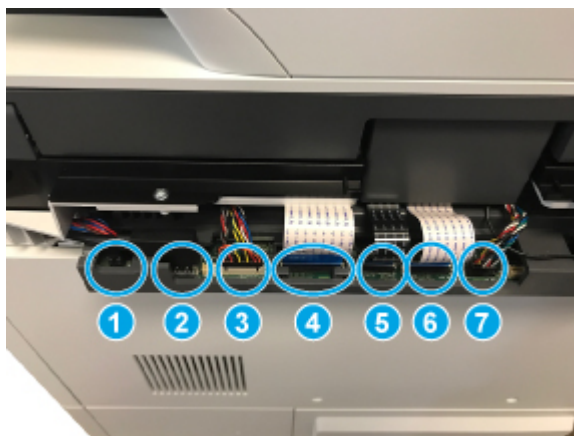

- 1 – Power cable
- 2 – HDMI (Formatter/SCB communication)
- 3 – Flatbed sensor/motor
- 4 – Flatbed FFC
- 5 – ADF sensor/motor
- 6 – ADF FFC
- 7 – ADF Motor

5. Replace the image scanner kit.

Table 6-55 Image scanner kit part number

Description	Part number
Image scanner kit - Includes white backing and retention clips, keyboard cover, and rear cover	J8A10-67901

For instructions: *Removal and replacement: Image scanner assembly* See the Repair Service Manual for this product.

30 . 03 . 45 Scanner Error To continue turn off then on

SCB firmware assertion failure. SCB firmware assertion controls the scan head motor.

Recommended action for customers

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

 **NOTE:** When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-77 Gate Closed



Figure 6-78 Proper insertion


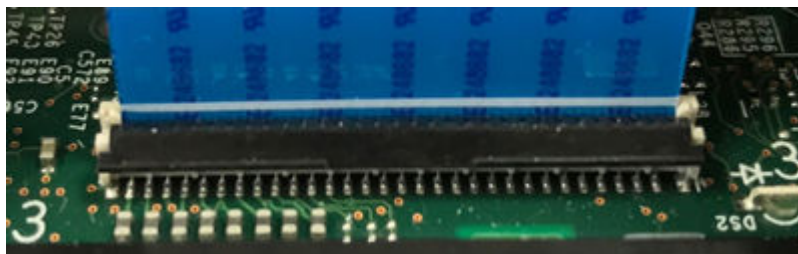


Figure 6-79 Improper insertion



1. Turn the printer off, and then on.
2. Upgrade the firmware.
3. Reseat all cables and FFC's in the SCB.

Figure 6-80 SCB Connections

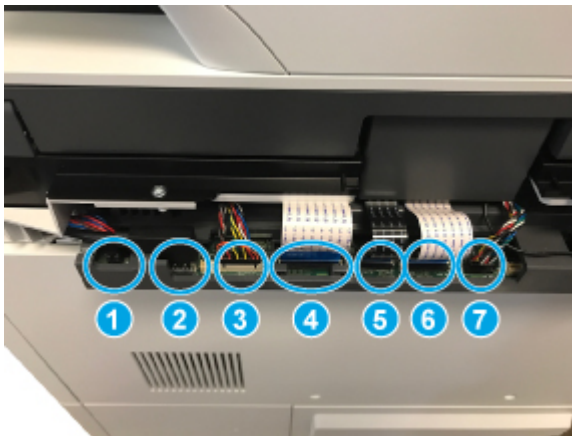

- 1 – Power cable
- 2 – HDMI (Formatter/SCB communication)
- 3 – Flatbed sensor/motor
- 4 – Flatbed FFC
- 5 – ADF sensor/motor
- 6 – ADF FFC
- 7 – ADF Motor

4. Check the event log for other scanner errors. If any errors are present, resolve those errors.
5. Replace the image scanner kit.

Part number: J8A10-67901

For instructions: *Removal and replacement: Image scanner assembly* See the Repair Service Manual for this product.

30 . 04 . 01 Flatbed Sensor Cable Not Detected

The flatbed sensor cable is not attached or did not sync with scanner controller board FW at power up. Cables are only accessible to a service technician.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, replace the scanner control board (SCB).

Table 6-56 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) - Flow series	5851-7347

For instructions: *Removal and replacement: Scanner control board* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-81 Gate Closed



Figure 6-82 Proper insertion

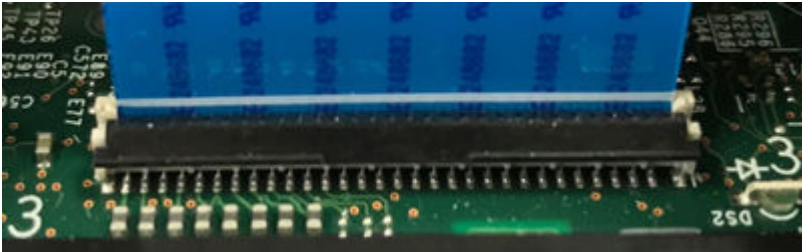


Figure 6-83 Improper insertion



1. Turn the printer off, and then on.
2. If the error persists, disconnect and reconnect all the cables on the scanner control board (SCB).

 **NOTE:** Ensure that all the cables on the SCB are connected and seated correctly before replacing any parts.

Figure 6-84 SCB cables and the HDMI cable

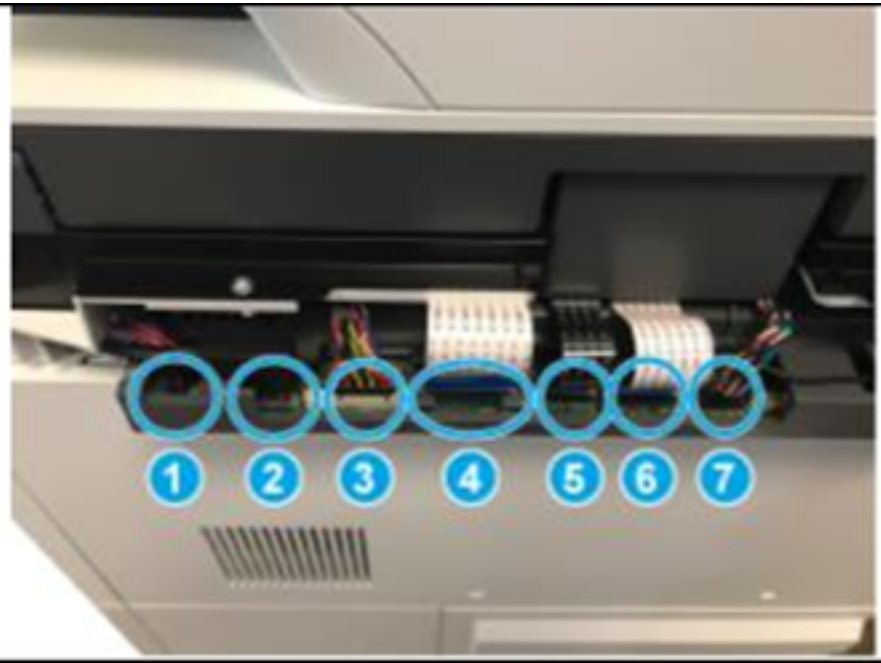


Table 6-57 SCB cables and the HDMI cable callout descriptions

Callout	Description
1	Power cable
2	HDMI (Formatter/SCB communication)

Table 6-57 SCB cables and the HDMI cable callout descriptions (continued)

Callout	Description
3	Flatbed sensor/motor
4	Flatbed FFC
5	ADF sensor/motor
6	ADF FFC
7	ADF Motor

3. If the error persists, replace the image scanner assembly.

Table 6-58 Image scanner kit part number

Description	Part number
Image scanner kit - Includes white backing and retention clips, keyboard cover, and rear cover	J8A10-67901

For instructions: *Removal and replacement: Image scanner assembly* See the Repair Service Manual for this product.

4. If the issue persists, replace the Scanner control board (SCB).

Table 6-59 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) - Flow series	5851-7347

For instructions: *Removal and replacement: Scanner control board* See the Repair Service Manual for this product.

30 . 04 . 02 Flatbed FFC Cable Not Detected

The flatbed FFC cable is not attached or did not sync with scanner controller board FW at power up. Cables are only accessible to a service technician.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-agents and onsite technicians



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-85 Gate Closed

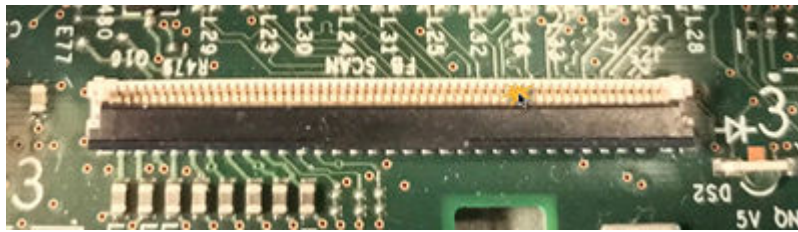


Figure 6-86 Proper insertion

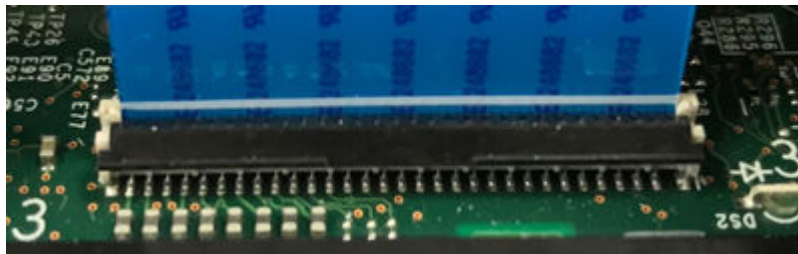


Figure 6-87 Improper insertion



1. Turn the printer off, and then on.
2. Verify that the FFCs between the scanner and the SCB are connected.

Figure 6-88 SCB Connections



- 1 – Power cable
- 2 – HDMI (Formatter/SCB communication)

- 3 – Flatbed sensor/motor
 - 4 – Flatbed FFC
 - 5 – ADF sensor/motor
 - 6 – ADF FFC
 - 7 – ADF Motor
3. If the issue persists, replace the image scan kit.

Part number: J8A10-67901

For instructions: *Removal and replacement: Image scanner assembly* See the Repair Service Manual for this product.

30 . 04 . 03 ADF FFC Cable Disconnected

The automatic ADF FFC cable is not attached or did not sync with scanner controller board FW at power up. Cables are only accessible to a service technician.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Dispatch a technician onsite to perform the following tasks:
 - a. Instruct the onsite service personnel to disconnect and reconnect the ADF FFC on the scanner control board (SCB) labeled "ADF SCAN".
 - b. Ensure that the ADF FFC cable is connected correctly. Reboot and test for functionality.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-89 Gate Closed

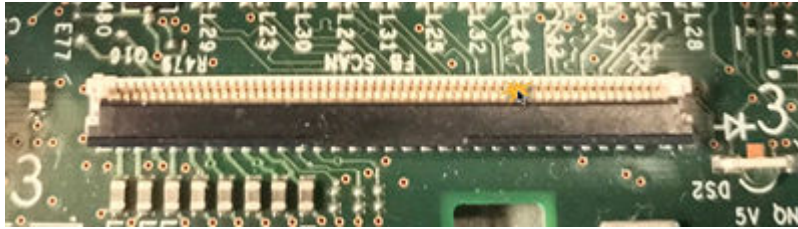


Figure 6-90 Proper insertion

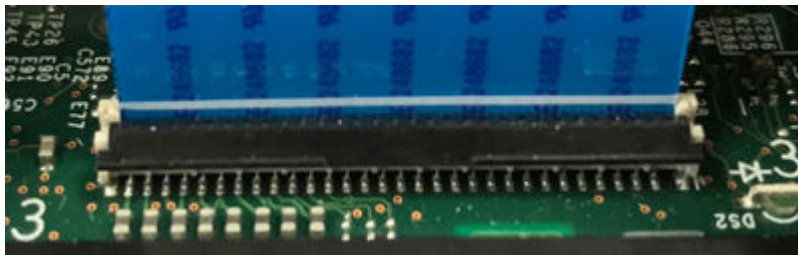


Figure 6-91 Improper insertion



1. Turn the printer off, and then on.
2. If the error persists, disconnect and reconnect the ADF FFC (Callout 4) on the scanner control board (SCB) labeled "ADF SCAN", and then test for functionality.

Figure 6-92 SCB cables



Table 6-60 SCB cables callout descriptions

Callout	Description
1	Power cable
2	HDMI (Formatter/SCB communication)
3	Flatbed sensor/motor
4	Flatbed FFC
5	ADF sensor/motor
6	ADF FFC
7	ADF Motor

3. If the error persists, replace the automatic document feeder (ADF).

Table 6-61 Document Feeder (ADF) part numbers

Description	Part number
Document feeder kit Enterprise series <i>(Includes white backing and retention clips)</i>	5851-7203
Document feeder kit Workflow series <i>(Includes white backing and retention clips)</i>	5851-7204

For instructions: *Removal and replacement: Document feeder* See the Repair Service Manual for this product.

4. If the error persists, replace the scanner control board (SCB).

Table 6-62 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) - Flow series	5851-7347

For instructions: *Removal and replacement: Scanner control board* See the Repair Service Manual for this product.

5. If the error persists, elevate the issue using the Standard Support Process.

30 . 04 . 04 ADF Motor Cable Disconnected

The automatic document motor cable is not attached or did not sync with scanner controller board FW at power up. Cables are only accessible to a service technician.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Dispatch a technician onsite to perform the following tasks:
 - a. Instruct the onsite service personnel to disconnect and reconnect the ADF Motor cable (TP102) on the scanner control board (SCB).
 - b. Ensure that the automatic document feeder motor cable is connected correctly. Reboot and test for functionality.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

 **NOTE:** When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-93 Gate Closed



Figure 6-94 Proper insertion

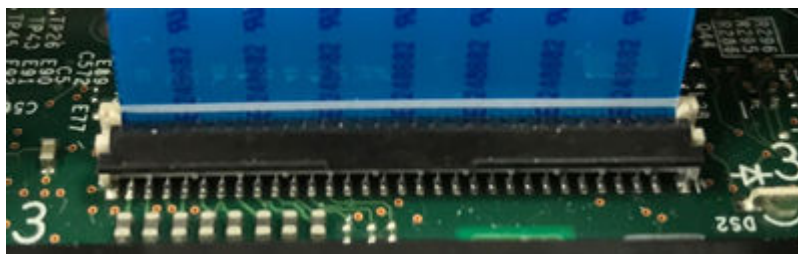


Figure 6-95 Improper insertion



1. Turn the printer off, and then on.

2. If the error persists, disconnect and reconnect the ADF motor cable (TP102, see Callout 5) on the scanner control board (SCB), and then test for functionality.

Figure 6-96 SCB cables

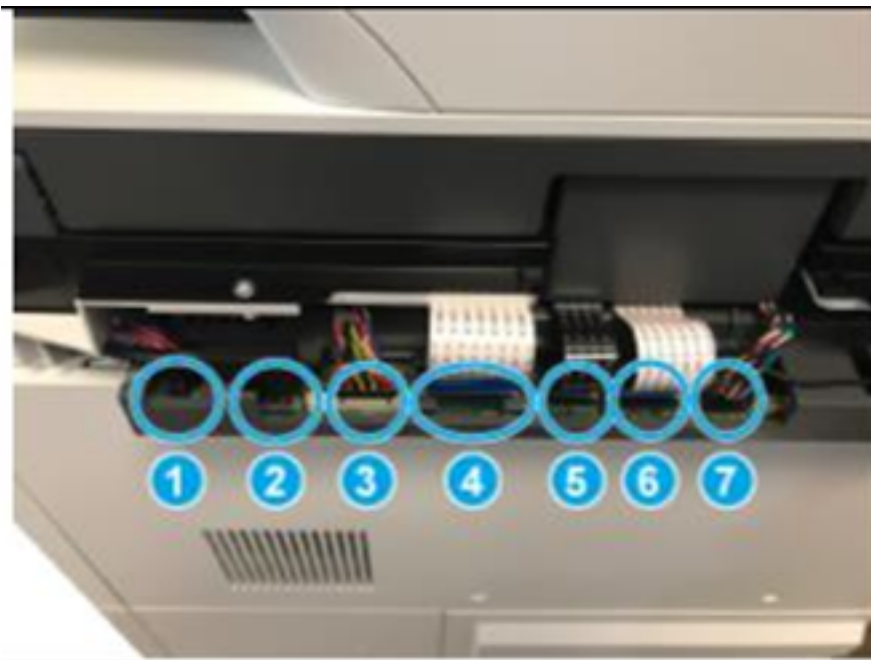


Table 6-63 SCB cables callout descriptions

Callout	Description
1	Power cable
2	HDMI (Formatter/SCB communication)
3	Flatbed sensor/motor
4	Flatbed FFC
5	ADF sensor/motor
6	ADF FFC
7	ADF Motor

3. If the error persists, replace the automatic document feeder (ADF).

Table 6-64 Document Feeder (ADF) part numbers

Description	Part number
Document feeder kit Enterprise series (Includes white backing and retention clips)	5851-7203
Document feeder kit Workflow series (Includes white backing and retention clips)	5851-7204

For instructions: *Removal and replacement: Document feeder* See the Repair Service Manual for this product.

4. If the error persists, replace the scanner control board (SCB).

Table 6-65 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) - Flow series	5851-7347

For instructions: *Removal and replacement: Scanner control board* See the Repair Service Manual for this product.

5. If the error persists, elevate the issue using the Standard Support Process.

30 . 04 . 05 ADF sensor Cable Disconnected

The ADF sensor cable is not attached or did not sync with scanner controller board FW at power up. Cables are only accessible to a service technician.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Dispatch a technician onsite to perform the following tasks:
 - a. Instruct the onsite service personnel to disconnect and reconnect the document feeder sensor cable (ADF SNS) on the scanner control board (SCB).
 - b. Ensure that the ADF sensor motor cable is connected correctly. Reboot and test for functionality.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-97 Gate Closed

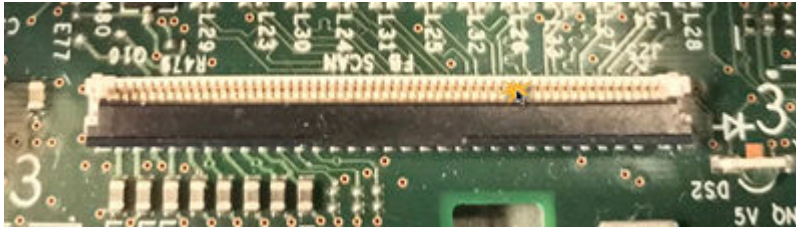


Figure 6-98 Proper Insertion

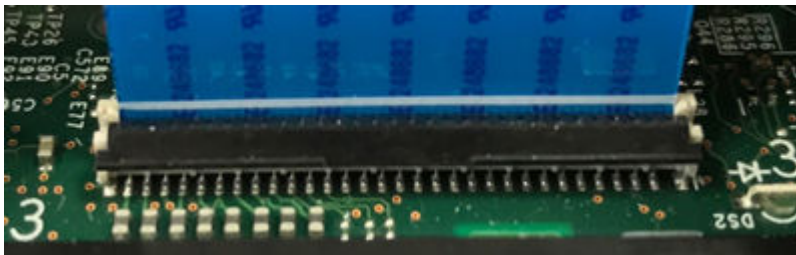


Figure 6-99 Improper Insertion



1. Turn the printer off, and then on.
2. If the error persists, disconnect and reconnect the document feeder sensor cable (ADF SNS, Callout 3) on the scanner control board (SCB), and then test for functionality.

Figure 6-100 SCB cables

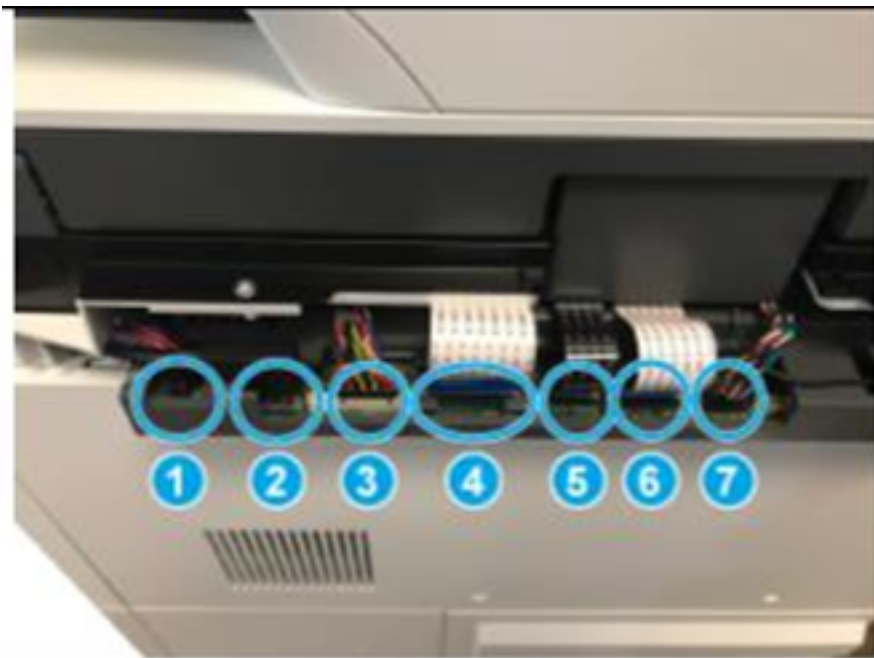


Table 6-66 SCB cables callout descriptions

Callout	Description
1	Power cable
2	HDMI (Formatter/SCB communication)
3	Flatbed sensor/motor
4	Flatbed FFC
5	ADF sensor/motor
6	ADF FFC
7	ADF Motor

3. If the error persists, replace the automatic document feeder (ADF).

Table 6-67 Document Feeder (ADF) part numbers

Description	Part number
Document feeder kit Enterprise series (<i>Includes white backing and retention clips</i>)	5851-7203
Document feeder kit Workflow series (<i>Includes white backing and retention clips</i>)	5851-7204

For instructions: *Removal and replacement: Document feeder* See the Repair Service Manual for this product.

4. If the error persists, replace the scanner control board (SCB).

Table 6-68 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) - Flow series	5851-7347

For instructions: *Removal and replacement: Scanner control board* See the Repair Service Manual for this product.

5. If the error persists, elevate the issue using the Standard Support Process.

1. Turn the printer off, and then on.
2. Turn the printer off, and then on. Retry the job.
3. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues.

Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

4. No action necessary.

5. No action necessary.
To exit, press the [Stop](#) button.
6. No action necessary. This error message should automatically clear.
7. Touch the [OK](#) button to clear the error.
8. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
9. If you believe a genuine HP supply is being used, go to www.hp.com/go/anticounterfeit.
- 10.
11. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.
12. Upgrade the firmware.
For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

31.WX.YZ error messages

31.* errors

Errors in the 31.* family are related to the document feeder.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Verify the document feeder top cover is completely closed when feeding pages through it.
2. Verify the document feeder input tray is not overloaded and that the guides are adjusted correctly.
3. Open the document feeder top cover and check the rollers. Clean or replace them if necessary.
4. Clean the scanner glass and all the calibration strips.
5. Calibrate the scanner. Open these menus: [Device Maintenance > Calibrate-Cleaning > Calibrate Scanner](#).
6. Clean the scanner glass and glass strips, and clean the white strips used for calibration.
7. Perform the tests for scanner diagnostics. Open these menus: [Administration > Troubleshooting > Diagnostic Tests > Scanner Tests](#). Look for tests related to the document feeder, such as the [Jam Cover Sensor](#) test.
8. Upgrade the firmware.
9. Check all connections from the document feeder to the scanner control board, and reseal them if necessary.
10. If the error persists, replace the document feeder assembly.

31.01.47 Document feeder not detected

the automatic document feeder was not detected, or the automatic document feeder might not be connected. The flatbed glass is still available for scanning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Verify that the connections between the automatic document feeder and the SCB are correctly seated.
3. If the error persists, replace the automatic document feeder (ADF).

Table 6-69 Document Feeder (ADF) part numbers

Description	Part number
Document feeder kit Enterprise series (Includes white backing and retention clips)	5851-7203
Document feeder kit Workflow series (Includes white backing and retention clips)	5851-7204

For instructions: *Removal and replacement: Document feeder* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

 **NOTE:** When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-101 Gate Closed



Figure 6-102 Proper insertion

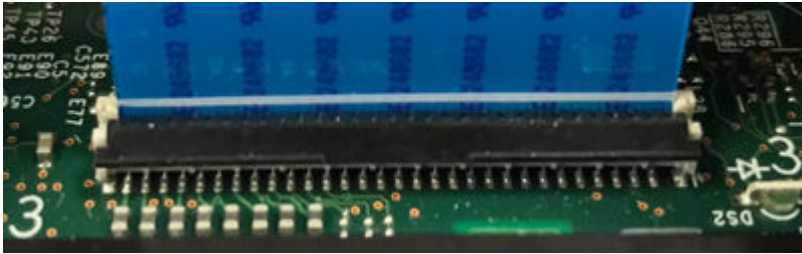


Figure 6-103 Improper insertion



1. Turn the printer off, and then on.
2. If the error persists, disconnect and reconnect the scanner control board (SCB) connections.

Figure 6-104 SCB connections



Table 6-70 SCB connections callout descriptions

Callout	Description
1	Power cable
2	HDMI (Formatter/SCB communication)
3	Flatbed sensor/motor
4	Flatbed FFC

Table 6-70 SCB connections callout descriptions (continued)

Callout	Description
5	ADF sensor/motor
6	ADF FFC
7	ADF Motor

3. If the error persists, replace the automatic document feeder (ADF) assembly.

Table 6-71 Document Feeder (ADF) part numbers

Description	Part number
Document feeder kit Enterprise series (<i>Includes white backing and retention clips</i>)	5851-7203
Document feeder kit Workflow series (<i>Includes white backing and retention clips</i>)	5851-7204

For instructions: *Removal and replacement: Document feeder* See the Repair Service Manual for this product.

4. If the error persists, replace the scanner control board (SCB).

Table 6-72 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) - Flow series	5851-7347

For instructions: *Removal and replacement: Scanner control board* See the Repair Service Manual for this product.

5. Use the power button to turn off the printer, and then turn on the printer. Check if the issue persists.
6. If the error persists, elevate the case as per your region's elevation process.

31.03.14

Backside scanner EEPROM (NVM) error.

A non-fatal error has occurred.

Recommended action

- No action necessary.

31.03.20 Backside scanner not detected

Backside scanner not detected.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Dispatch a technician onsite to perform the following tasks:
 - a. Instruct the onsite service personnel to disconnect and reconnect the ADF FFC on the scanner control board (SCB) labeled "ADF SCAN".
 - b. Ensure that the ADF FFC cable is connected correctly. Reboot and test for functionality.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-105 Gate Closed



Figure 6-106 Proper Insertion


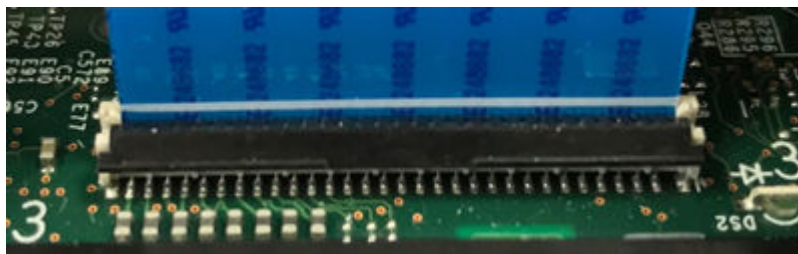


Figure 6-107 Improper insertion

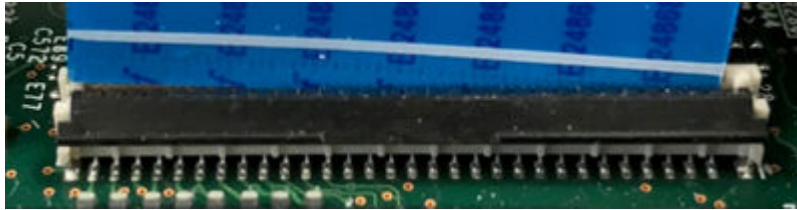

1. Turn the printer off, and then on.
2. If the error persists, disconnect and reconnect the ADF FFC (Callout 4) on the scanner control board (SCB) labeled "ADF SCAN", and then test for functionality.

Figure 6-108 SCB cables



Table 6-73 SCB cables callout descriptions

Callout	Description
1	Power cable
2	HDMI (Formatter/SCB communication)
3	Flatbed sensor/motor
4	Flatbed FFC
5	ADF sensor/motor
6	ADF FFC
7	ADF Motor

3. If the error persists, replace the automatic document feeder (ADF).

Table 6-74 Document Feeder (ADF) part numbers

Description	Part number
Document feeder kit Enterprise series (<i>Includes white backing and retention clips</i>)	5851-7203
Document feeder kit Workflow series (<i>Includes white backing and retention clips</i>)	5851-7204

For instructions: *Removal and replacement: Document feeder* See the Repair Service Manual for this product.

4. If the error persists, replace the scanner control board (SCB).

Table 6-75 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) - Flow series	5851-7347

For instructions: *Removal and replacement: Scanner control board* See the Repair Service Manual for this product.

5. If the error persists, elevate the issue using the Standard Support Process.

31 . 03 . 22 Scanner calibration failure

Backside illumination calibration failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. Attempt to copy or scan a duplex job.


3. If the issue persists, turn off the printer, and then open the scanner lid.

Figure 6-109 Open scanner lid



4. Locate the white calibration area (document feeder strip) on the bottom of the scanner lid.

Figure 6-110 White calibration area (Document feeder strip)

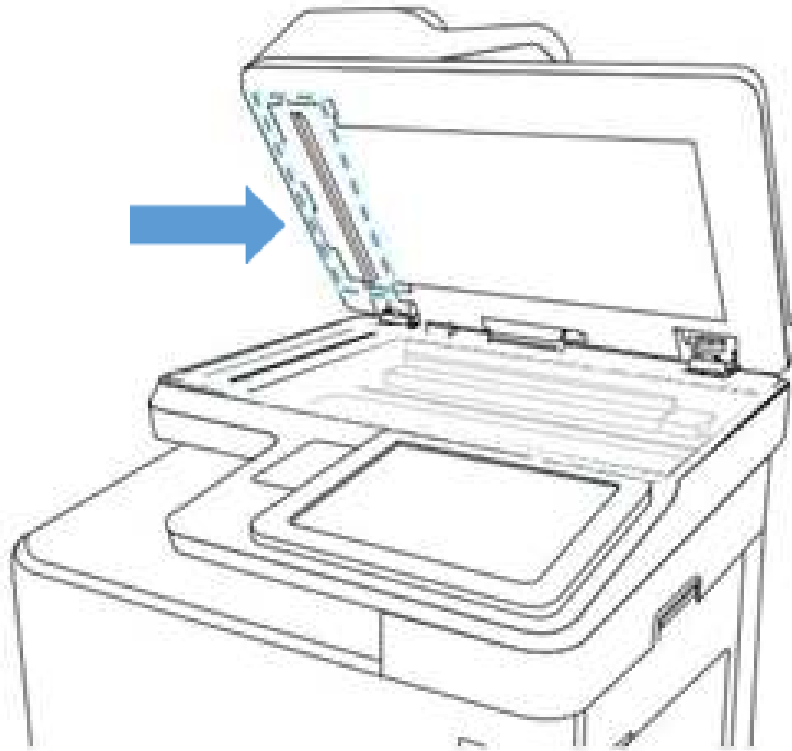

5. Clean the white calibration area using a soft cloth moistened with a nonabrasive glass cleaner.

CAUTION: Do not spray liquids directly on the glass or platen. They might seep and damage the printer. Do not use abrasives, acetone, benzene, ammonia, ethyl alcohol, or carbon tetrachloride on any part of the printer; these can damage the printer.

6. Use the power button to turn on the printer.
7. Attempt to copy or scan a duplex job from the document feeder.
8. If the issue persists, ensure the printer firmware version installed is 3.4 or newer.
9. Update the printer firmware to the latest version, if needed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

10. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Attempt to copy or scan a duplex job.

3. If the issue persists, turn off the printer, and then open the scanner lid.


Figure 6-111 Open scanner lid



4. Clean the white calibration area using a soft cloth moistened with nonabrasive glass cleaner.

⚠ CAUTION: Do not spray liquids directly on the glass or platen. They might seep and damage the printer. Do not use abrasives, acetone, benzene, ammonia, ethyl alcohol, or carbon tetrachloride on any part of the printer; these can damage the printer.

Figure 6-112 White calibration area (Document feeder strip)

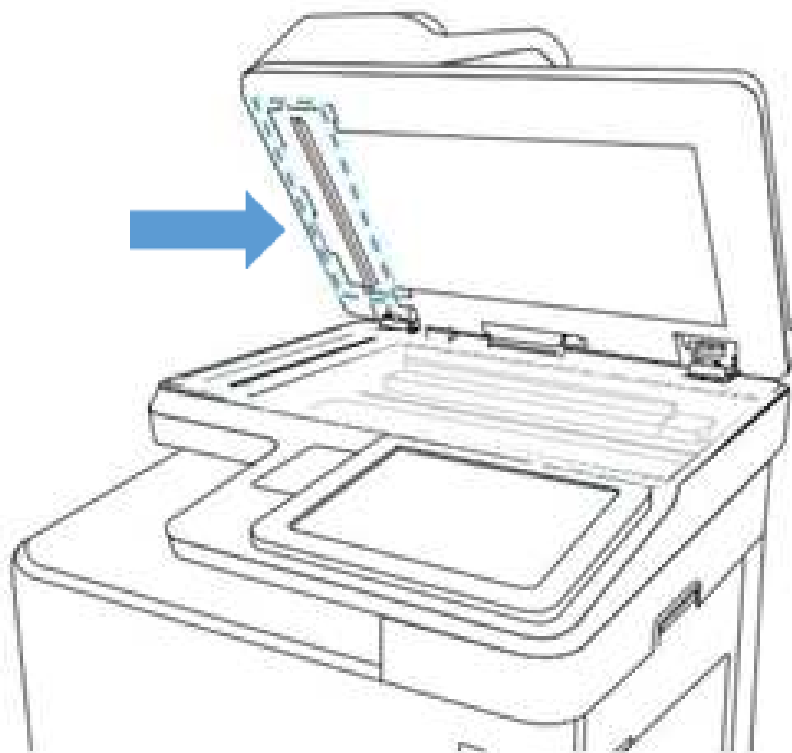

5. Turn on the printer, and attempt to copy or scan a duplex job from the document feeder.
6. Update the printer firmware to the latest version, if needed.
For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).
7. If the error persists, replace the automatic document feeder (ADF).

Table 6-76 Document Feeder (ADF) part numbers

Description	Part number
Document feeder kit Enterprise series (<i>Includes white backing and retention clips</i>)	5851-7203
Document feeder kit Workflow series (<i>Includes white backing and retention clips</i>)	5851-7204

For instructions: *Removal and replacement: Document feeder* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

 **NOTE:** When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-113 Gate Closed

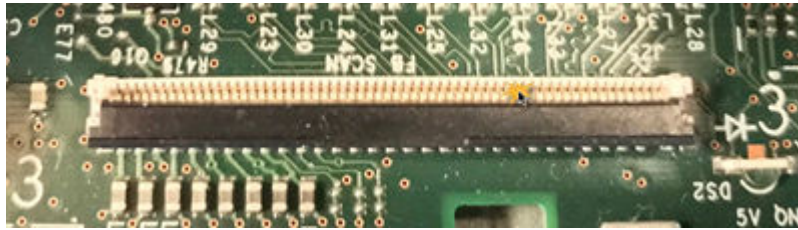


Figure 6-114 Proper Insertion

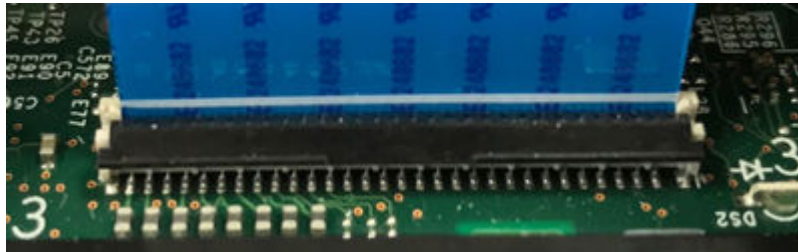


Figure 6-115 Improper Insertion



1. Turn the printer off, and then on.
2. Attempt to copy or scan a duplex job.

3. If the issue persists, turn off the printer, and then open the scanner lid.

Figure 6-116 Open scanner lid



4. Clean the white calibration area using a soft cloth moistened with nonabrasive glass cleaner.

⚠ CAUTION: Do not spray liquids directly on the glass or platen. They might seep and damage the printer. Do not use abrasives, acetone, benzene, ammonia, ethyl alcohol, or carbon tetrachloride on any part of the printer; these can damage the printer.

Figure 6-117 White calibration area (Document feeder strip)



5. Turn on the printer, and attempt to copy or scan a duplex job from the document feeder.
6. Update the printer firmware to the latest version, if needed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

7. Verify that the connections between the automatic document feeder and the SCB are seated correctly.

Figure 6-118 SCB cables

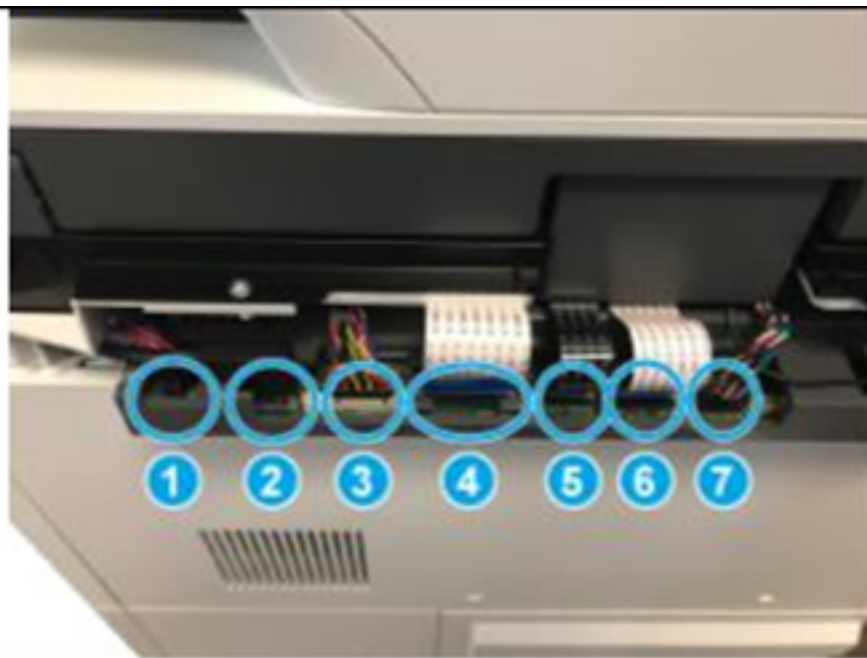


Table 6-77 SCB cables callout descriptions

Callout	Description
1	Power cable
2	HDMI (Formatter/SCB communication)
3	Flatbed sensor/motor
4	Flatbed FFC
5	ADF sensor/motor
6	ADF FFC
7	ADF Motor

8. If the error persists, replace the automatic document feeder (ADF).

Table 6-78 Document Feeder (ADF) part numbers

Description	Part number
Document feeder kit Enterprise series (Includes white backing and retention clips)	5851-7203
Document feeder kit Workflow series (Includes white backing and retention clips)	5851-7204

For instructions: *Removal and replacement: Document feeder* See the Repair Service Manual for this product.

9. If the error persists, replace the scanner control board (SCB).

Table 6-79 SCB part numbers for Enterprise and Flow models

Description	Part number
SCB Enterprise	5851-7764
Scanner control board (SCB) - Flow series	5851-7347

For instructions: *Removal and replacement: Scanner control board* See the Repair Service Manual for this product.

10. If the error persists, elevate the case as per your region's elevation process.

31 . 03 . 30 Document feeder pick motor error

The automatic document feeder pick motor is not turning.

Recommended action for customers

1. Open the top cover and remove any paper present. Close the top cover.
2. Turn the printer off, and then on.
3. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
4. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
5. Ensure that the automatic document feeder rollers are installed correctly and are not bound up. Replace the roller kit as needed.

Part number: 5851-7202

To order parts, go to <https://www.hp.com/buy/parts>.

6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

 **NOTE:** When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-119 Gate Closed



Figure 6-120 Proper insertion

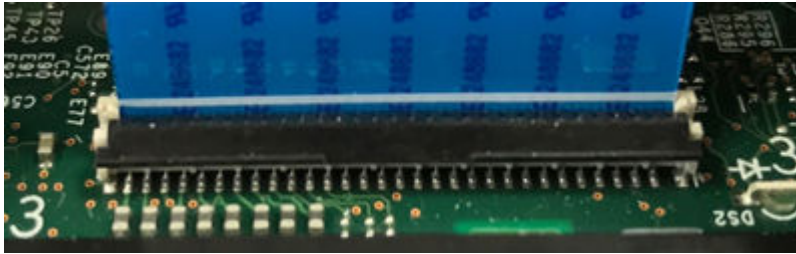


Figure 6-121 Improper insertion




1. Open the top cover and remove any paper present. Close the top cover.
2. Verify that the paper being used meets the HP specifications for the printer.
3. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
4. Check the event log for other document feeder errors. If other errors are present, resolve those errors first.
5. Open and close the top cover to see if the pick motor turns without displaying the error. If the motor turns, the motor is good.
6. Ensure that the automatic document feeder rollers are installed correctly and are not bound up. Replace the roller kit as needed.

Part number: 5851-7202

For instructions: *Removal and replacement: Document feeder rollers* See the Repair Service Manual for this product.

7. Verify that the connections between the automatic document feeder and the SCB are correctly seated.

Figure 6-122 SCB Connections

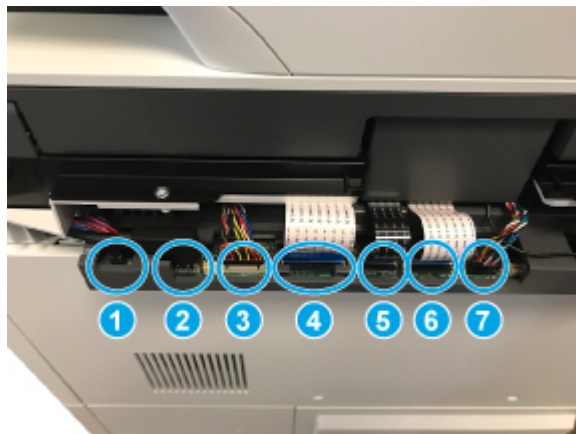

- 1 – Power cable
- 2 – HDMI (Formatter/SCB communication)
- 3 – Flatbed sensor/motor
- 4 – Flatbed FFC
- 5 – ADF sensor/motor
- 6 – ADF FFC
- 7 – ADF Motor
- 8. Replace the automatic document feeder.
 - Non-flow models part number: 5851-7203
 - Flow models part number: 5851-7204
 - For instructions: *Removal and replacement: Document feeder* See the Repair Service Manual for this product.
- 9. If the error persists, elevate the issue using the Standard Support Process.

31 . 03 . 31 Document feeder motor stall

The automatic document feeder feed motor is not turning.

Recommended action for customers

1. Open the top cover and remove any paper present. Close the top cover.
2. Turn the printer off, and then on.
3. Verify that the paper being used meets the HP specifications for the printer.
4. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-123 Gate Closed



Figure 6-124 Proper Insertion

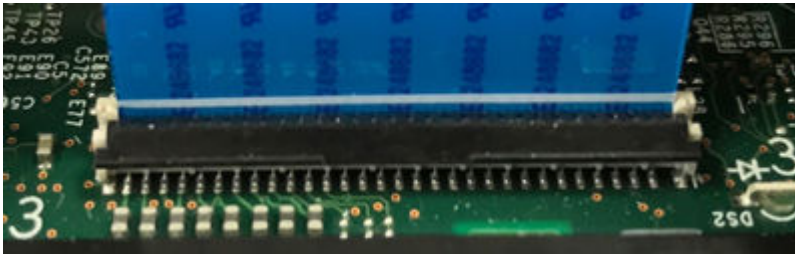



Figure 6-125 Improper Insertion



1. Open the top cover and remove any paper present. Close the top cover.
2. Verify that the paper being used meets the HP specifications for the printer.
3. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
4. Check the event log for other document feeder errors. If other errors are present, resolve those errors first.
5. Open and close the top cover to see if the pick motor turns without displaying the error. If the motor turns, the motor is good.

6. Verify that the connections between the automatic document feeder and the SCB are correctly seated.

Figure 6-126 SCB Connections

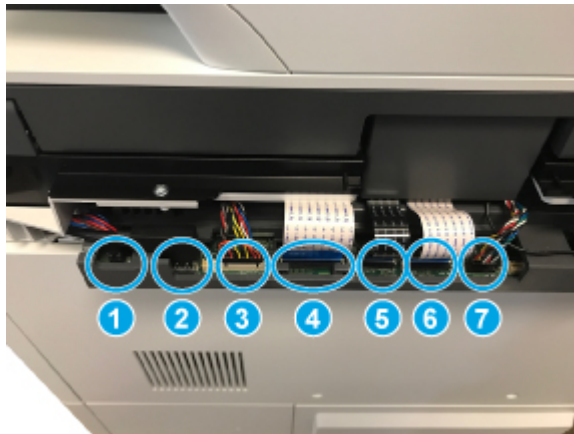

1 – Power cable

2 – HDMI (Formatter/SCB communication)

3 – Flatbed sensor/motor

4 – Flatbed FFC

5 – ADF sensor/motor

6 – ADF FFC

7 – ADF Motor

7. Replace the automatic document feeder.

Non-flow models part number: 5851-7203

Flow models part number: 5851-7204

For instructions: *Removal and replacement: Document feeder* See the Repair Service Manual for this product.

8. If the error persists, elevate the issue using the Standard Support Process.

31 . 03 . 33 Backside scanner calibration area dirty

The white area used for backside scanner calibration is dirty.

Recommended action for customers

1. Clean the white strip on platen glass and on the automatic document feeder (side 2 glass).



2. Turn the printer off, and then on.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-127 Gate Closed



Figure 6-128 Proper insertion

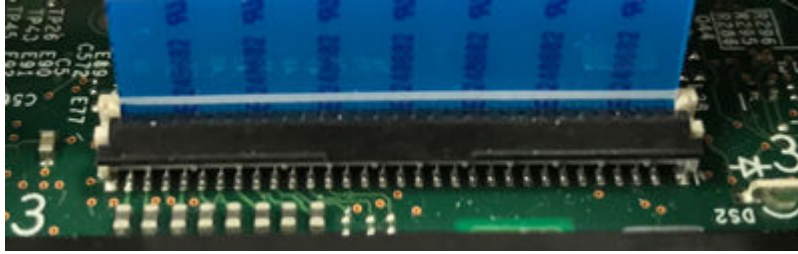



Figure 6-129 Improper insertion



1. Clean the white strip on platen glass and on the automatic document feeder (side 2 glass).



2. Verify that the connections between the automatic document feeder and the SCB are correctly seated.

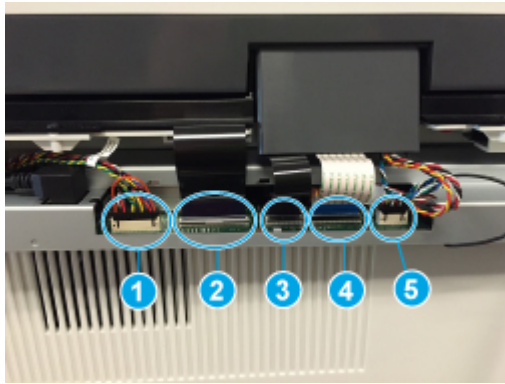

1 – Flatbed sensor/motor

2 – Flatbed FFC

3 – ADF sensor

4 – ADF FFC

5 – ADF motor

3. If the error remains replace the automatic document feeder assembly.

Non-flow models part number: 5851-7203

Flow models part number: 5851-7204

For instructions: *Removal and replacement: Document feeder* See the Repair Service Manual for this product.

4. If the error persists, elevate the issue using the Standard Support Process.

31 . 13 . 00 Document feeder multi-pick error

A multiple pick error was reported by the automatic document feeder assembly.

Issue might be described as the following:


- Picking multiple documents
- Picking more than one page
- Multiple sheets pulled from ADF
- Multiple pages picked

Recommended action for customers


1. Remove any paper in the paper path.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)


2. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

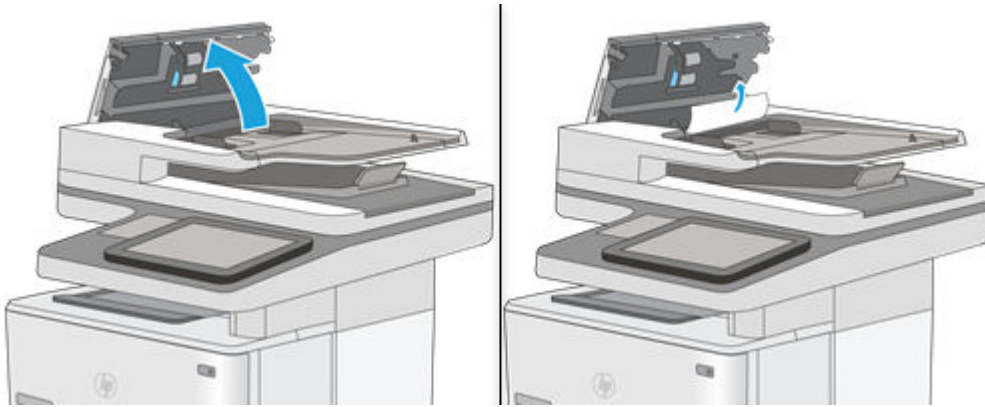

3. Lift the document-feeder input tray and remove any jammed paper.
 - a. Lift the document feeder input tray

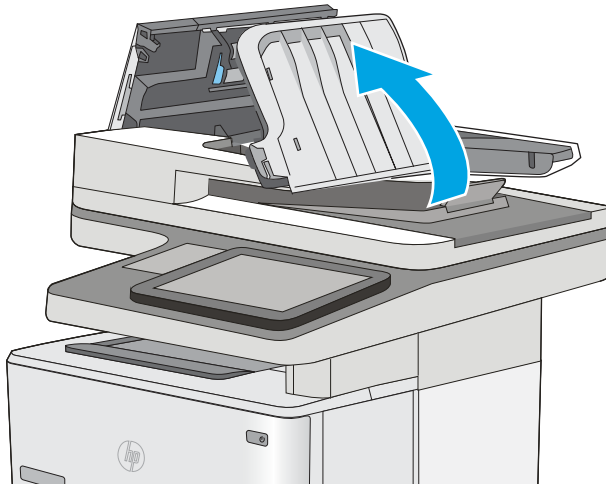

- b. Remove any paper found under the tray.

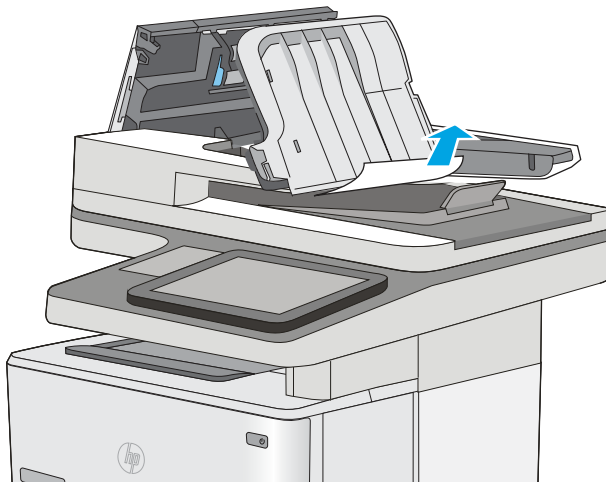


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

- 4. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path
 - a. Open the ADF and remove any paper found.

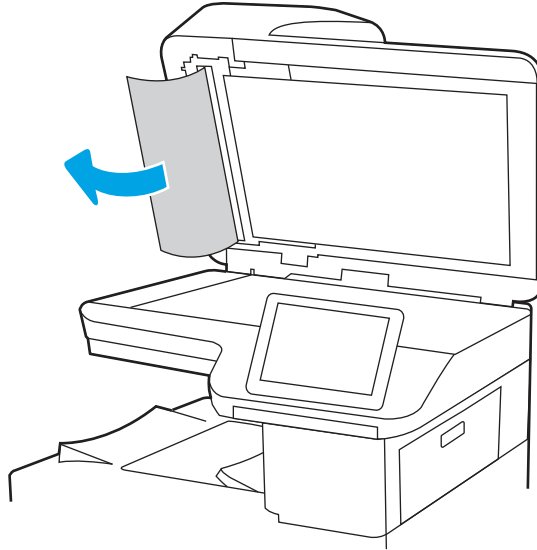

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

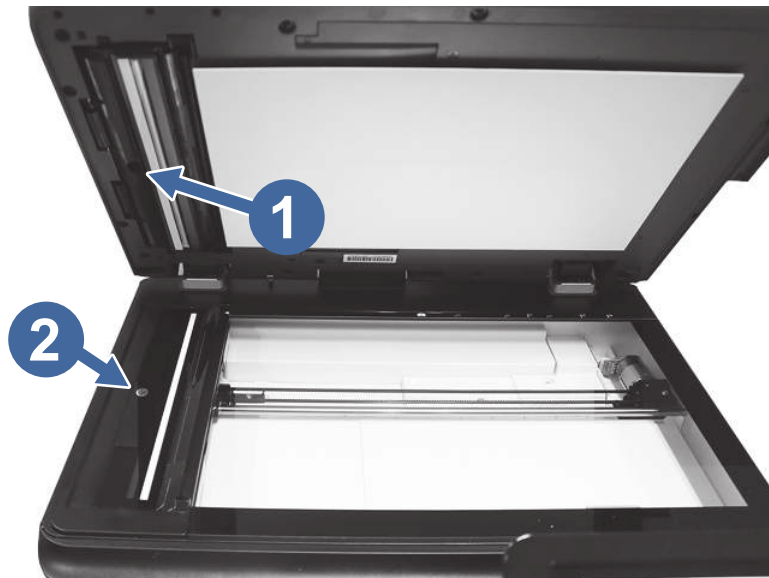

Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.


5. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF): [Click here - c06601744](#)

6. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-130 Set the ADF guides

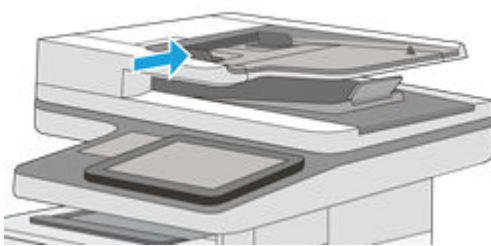


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


7. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

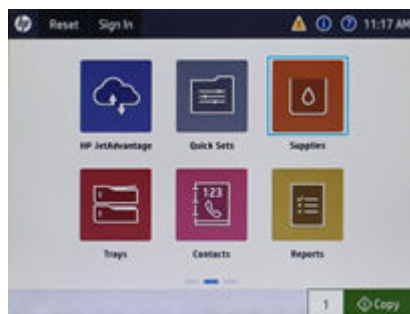

- b. Select **Document Feeder Kit**.

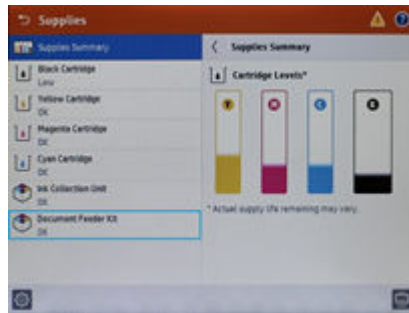


- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

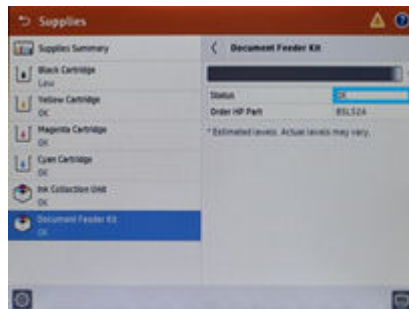

- d. If the status is **Low** or **Very Low** it is recommended that the customer replace the Document Feeder Kit.

Part number: [J8J95A](#)/HP 300 ADF Roller Replacement Kit

8. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

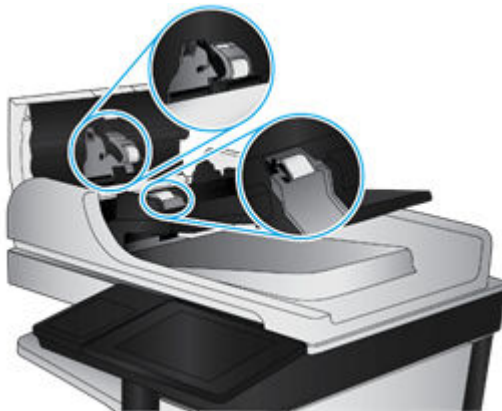

9. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.


Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Remove any paper in the paper path.


For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

2. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

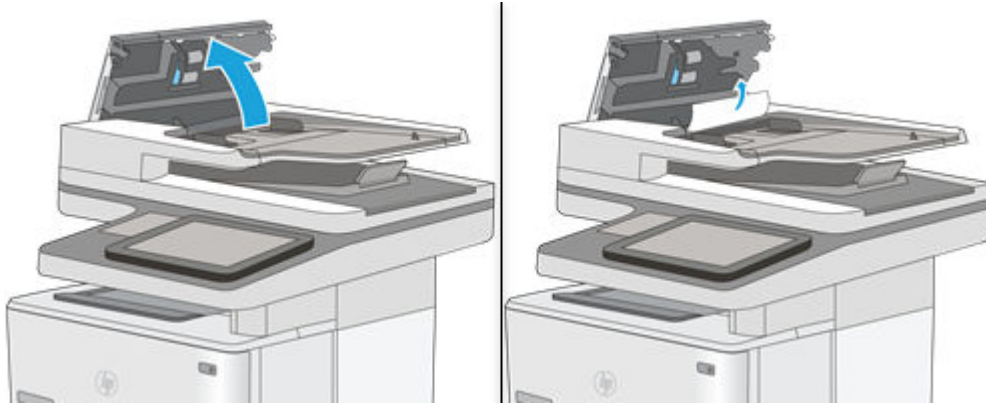


3. Lift the document-feeder input tray and remove any jammed paper.

- a. Lift the document feeder input tray

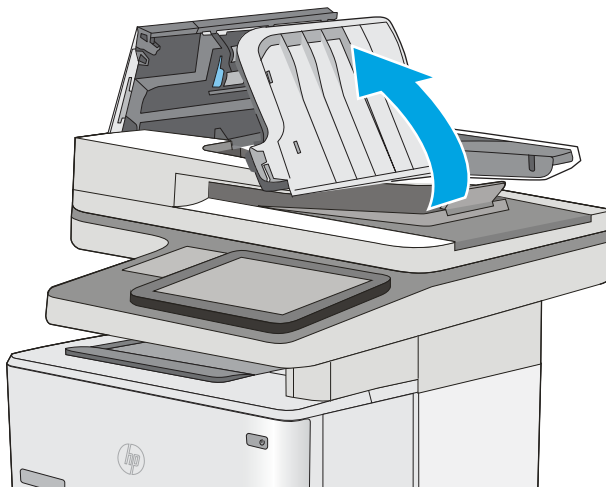

- b. Remove any paper found under the tray.

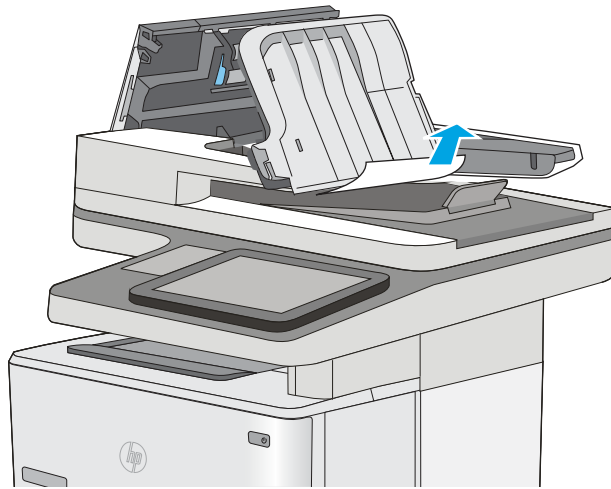


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

4. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path

- a. Open the ADF and remove any paper found.

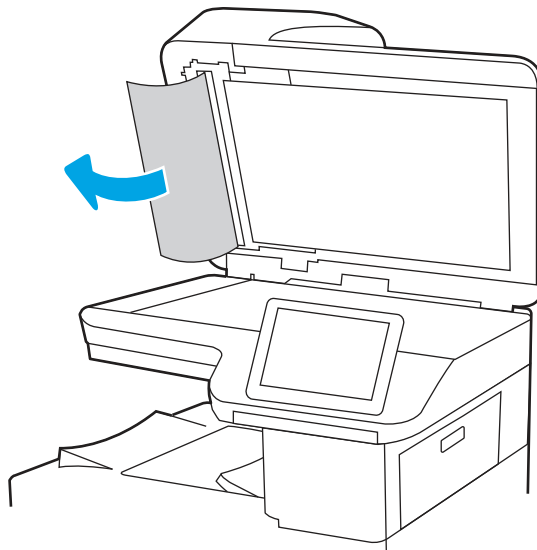

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

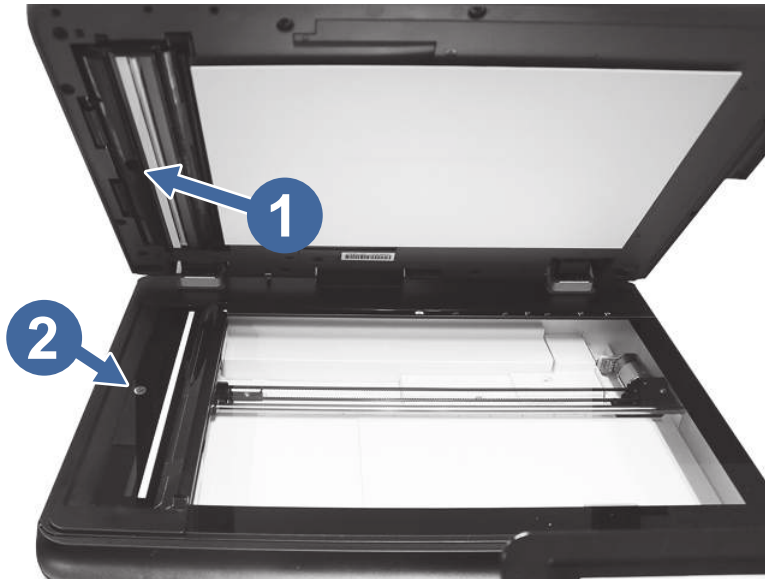


Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.
- 5. Ensure that the paper meets the document feeder (ADF) specifications for the printer.
This document outlines the supported weights and sizes of the ADF including best practices:
Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF): [Click here - c06601744](#)
 - 6. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
Make sure that the paper stack is correctly aligned at the center of the input tray when paper is

loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-131 Set the ADF guides

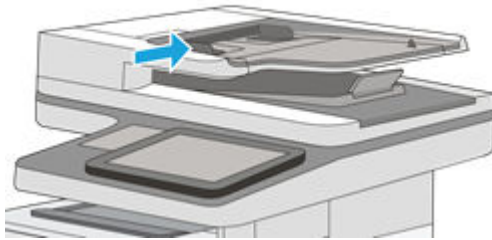


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


7. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

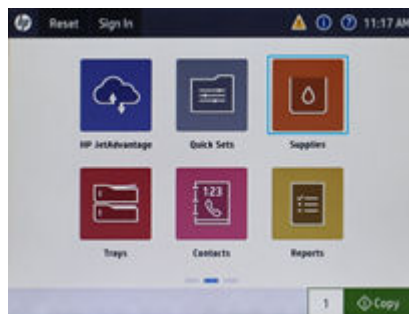

- b. Select **Document Feeder Kit**.

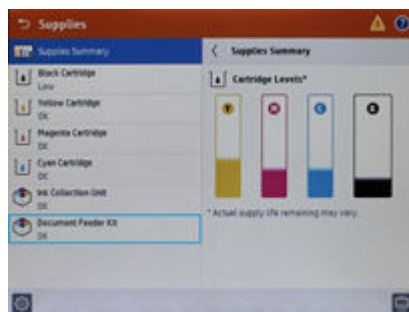

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

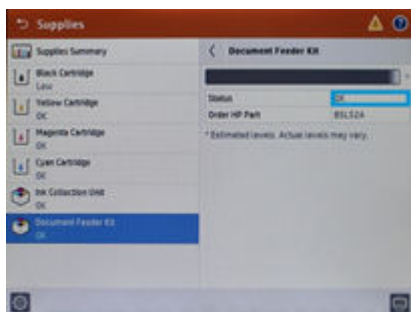

- d. If the status is **Low** or **Very Low** it is recommended that the customer replace the Document Feeder Kit.


Part number: [J8J95A](#)/HP 300 ADF Roller Replacement Kit .

To order parts, go to <https://store.hp.com>



NOTE: Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace 5851-7202 (Roller replacement kit - Replacement feed rollers for the document feeder)

8. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

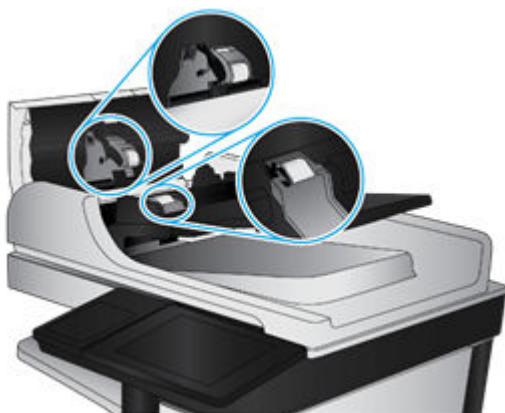

9. If the error persists, replace the Document Feeder Kit rollers and separation pad.

Table 6-80 Roller replacement kit part number

Part description	Part number
Roller replacement kit - Replacement feed rollers for the document feeder	5851-7202

10. If a grinding noise is heard or reported in conjunction with the pick or feed of paper through the ADF, replace the document feeder (ADF) unit.

Use the table below to order the correct part for your printer. The replacement part for the Document feeder kit (ADF) Enterprise and Workflow series includes white backing and retention clips.

Table 6-81 Document feeder kit for Enterprise and Workflow models part numbers

Part description	Part number
Document feeder kit - Enterprise series	5851-7203
Document feeder kit - Workflow series	5851-7204


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.


1. Remove any paper in the paper path.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

2. Open the automatic document feeder lid, pull all the sheets back into the input tray, and then resume the job.
3. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path
 - a. Open the ADF and remove any paper found.

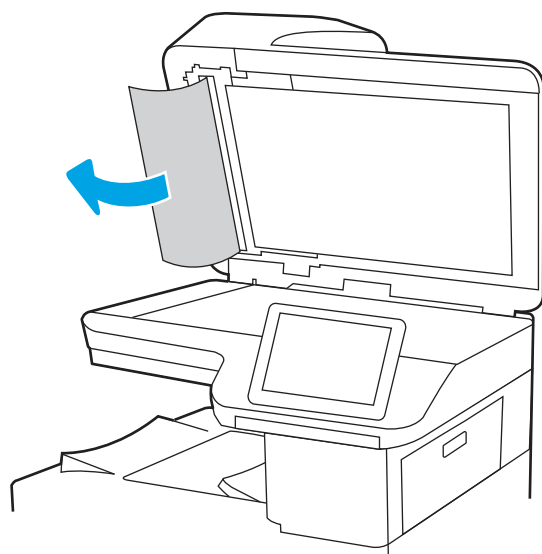

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

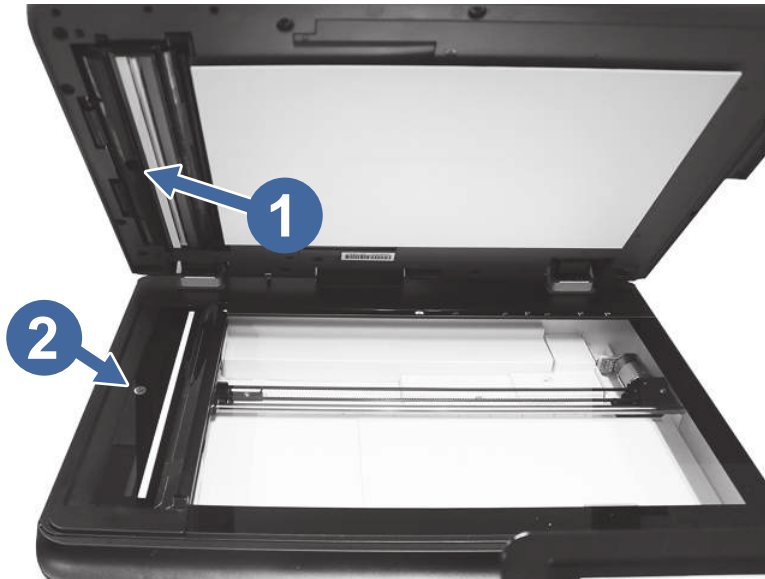


Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.
4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.
This document outlines the supported weights and sizes of the ADF including best practices:
Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF): [Click here - c06601744](#)
 5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
Make sure that the paper stack is correctly aligned at the center of the input tray when paper is

loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-132 Set the ADF guides

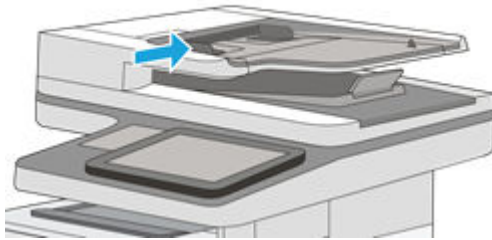


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

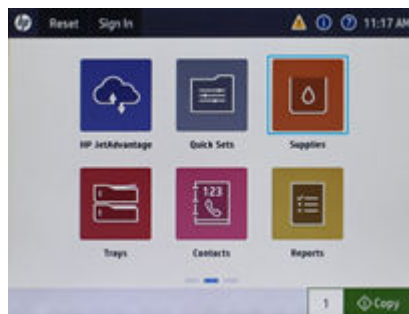

- b. Select **Document Feeder Kit**.

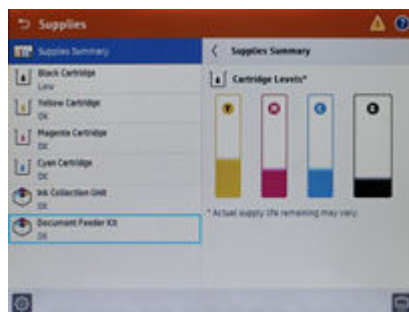

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

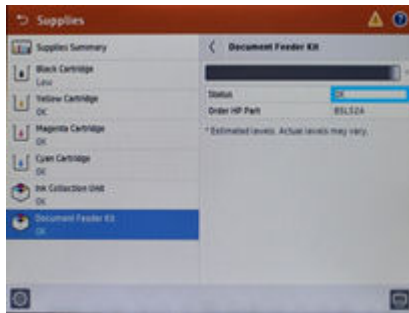


- d. If the status is **Low** or **Very Low** it is recommended that the customer replace the Document Feeder Kit.

Part number: [J8J95A](#)/HP 300 ADF Roller Replacement Kit .

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace 5851-7202 (Roller replacement kit - Replacement feed rollers for the document feeder)

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

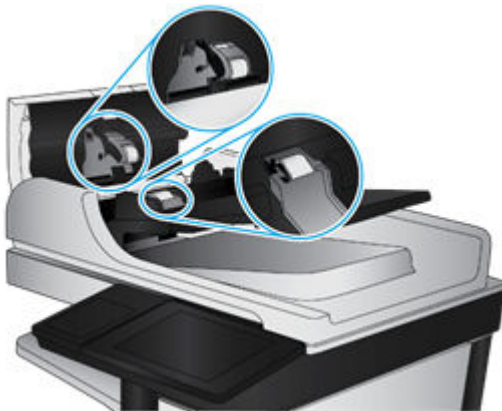

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Roller replacement kit - Replacement feed rollers for the document feeder: 5851-7202

For instructions: *Removal and replacement: Document feeder rollers* See the Repair Service Manual for this product.

9. Test the document feeder by running a multiple page copy job.
- Should a grinding noise be reported or heard in conjunction with the pick/feed of paper through the ADF, Replace the document feeder (ADF) unit.
 - If the pick/feed issue does not include grinding noise, continue with the recommended action for the specific 31.13.x event/or symptomatic behavior

10. Inspect the ADF pick success sensor, cleaning both the REDI (paper pick success) sensor window and REDI (PAPER PICK SUCCESS) sensor reflector. If there is any dust or fiber remnants, clean by using a can of compressed air to blow out and clean.


Figure 6-133 ADF REDI sensor



- 1 – REDI sensor window
- 2 – REDI sensor reflector
- 3 – ADF hatch

11. Verify that the connections between the automatic document feeder and the SCB are correctly seated.


Figure 6-134 SBC connections

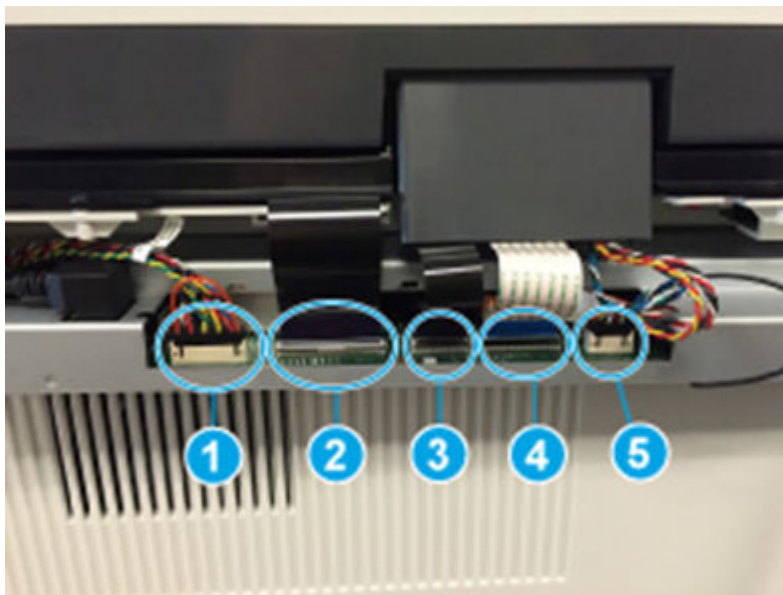


- 1 – Flatbed sensor/motor
- 2 – Flatbed FFC
- 3 – ADF sensor
- 4 – ADF FFC
- 5 – ADF Motor

 **NOTE:** The flat flexible cables (FFC's) on the Scanner Control Board (SCB) are zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are DRAMATICALLY different that the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 families.
Gate closed

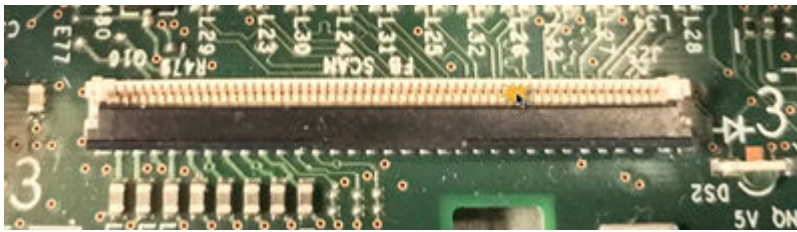


Proper insertion

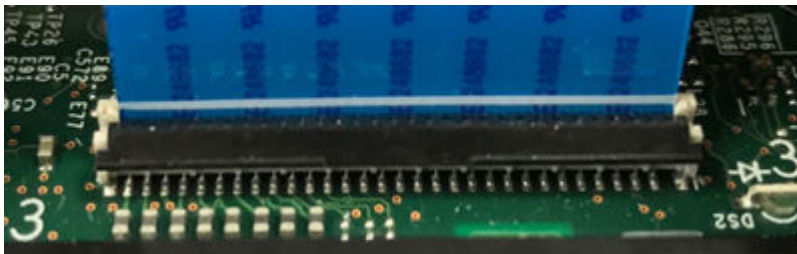


Improper insertion




12. Using the Manual Scanner Sensor Test verify functionality of the ADF Paper Path Pick Success sensor.
 - a. Navigate to and select **Support Tools**.

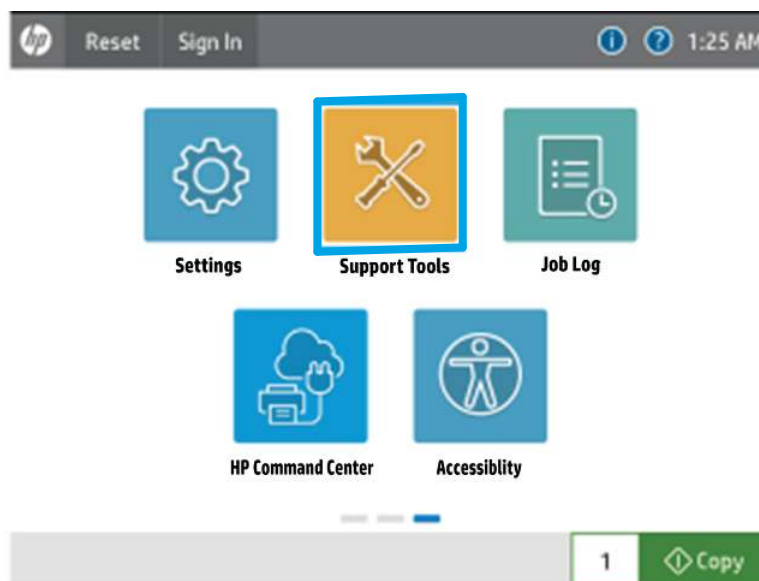


- b. Select **Troubleshooting**.

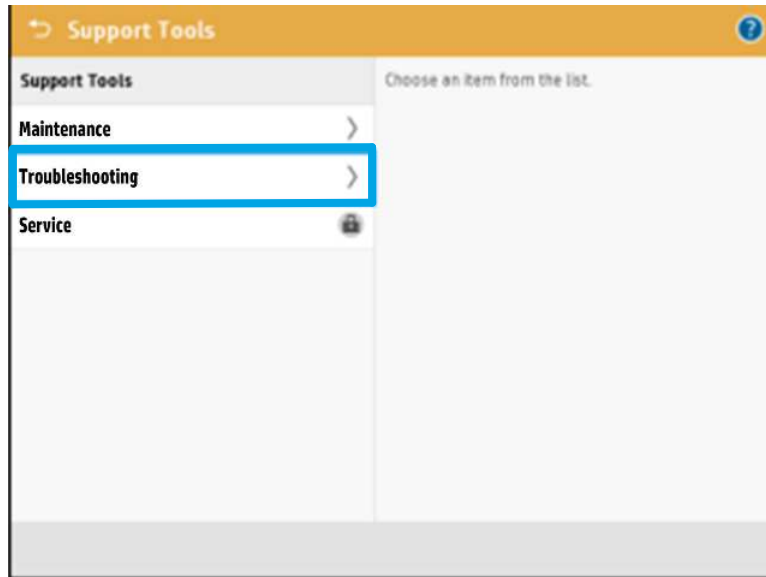


- c. Select **Diagnostic Tests**.

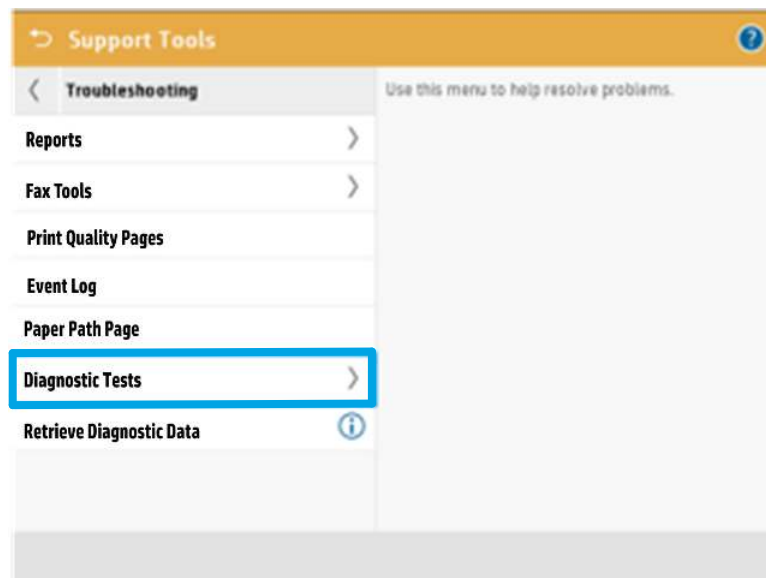


- d. Select **Continue**.

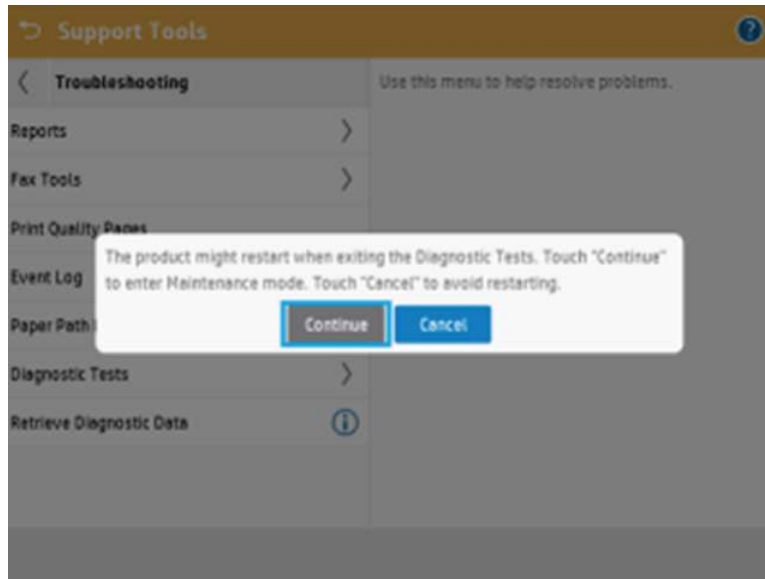

- e. Select **Manual Sensor Test**.

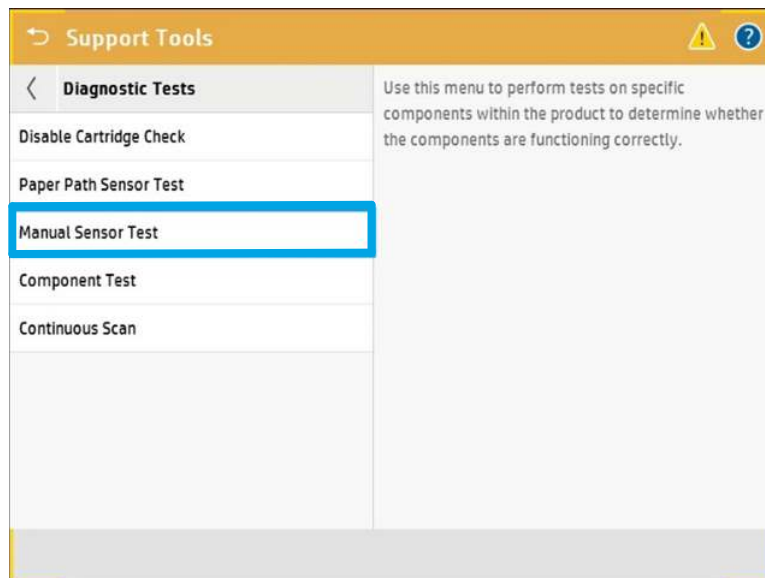

- f. Select **ADF Paper Path Deskew**.

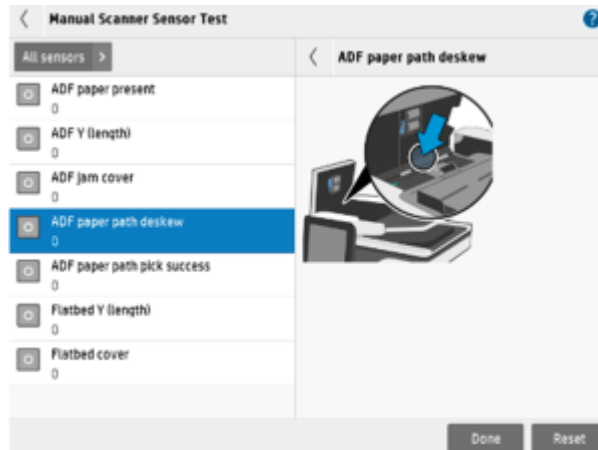

- g. Select **ADF Paper Path Pick Success**.

(Only in FLOW-MODELS)



NOTE: Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advancing.



- h. Close the ADF cover and ensure that is secure and closed correctly.

13. Open and close the ADF cover to trigger the ADF Paper Path Pick Success sensor.



 **NOTE:** Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advanced.

14. If the ADF Paper Path Pick Success test fails to advance the count, replace the document feeder.

 **NOTE:** If a grinding noise is heard or reported in conjunction with the pick or feed of paper through the ADF, replace the document feeder (ADF) unit.

Use the table below to order the correct part for your printer. The replacement part for the Document feeder kit (ADF) Enterprise and Workflow series includes white backing and retention clips.

Table 6-82 Document feeder kit for Enterprise (Non-flow models) and Workflow (Flow models) series part numbers

Part description	Part number
Document feeder kit - Enterprise series	5851-7203
Document feeder kit - Workflow series	5851-7204

For instructions: *Removal and replacement: Document feeder* See the Repair Service Manual for this product.

31.13.01

Document feeder job error, pick error.

Paper pick was initiated but the page did not make it to the pick success sensor.


- Paper not feeding from document feeder (ADF)
- Pick error ADF
- pick issue document feeder

Recommended action for customers

1. Remove any paper in the paper path.


For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

2. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

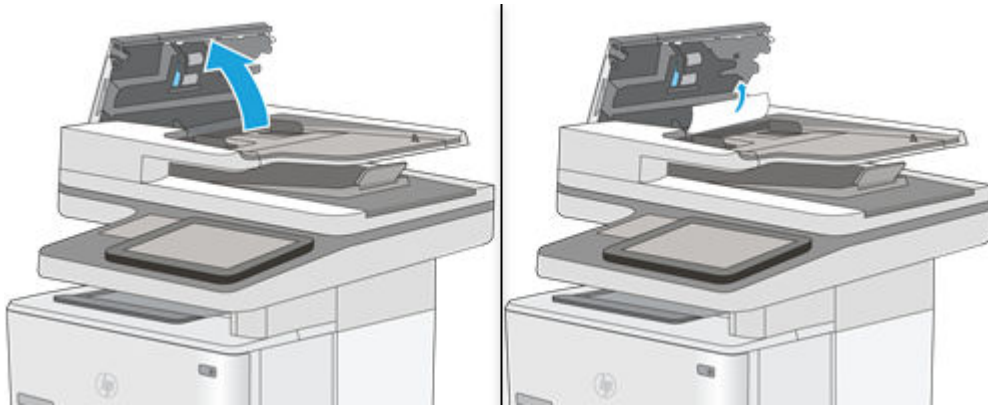


3. Lift the document-feeder input tray and remove any jammed paper.

- a. Lift the document feeder input tray

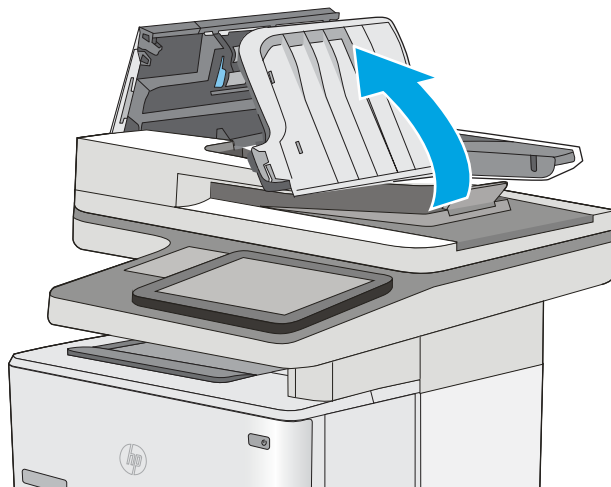

- b. Remove any paper found under the tray.

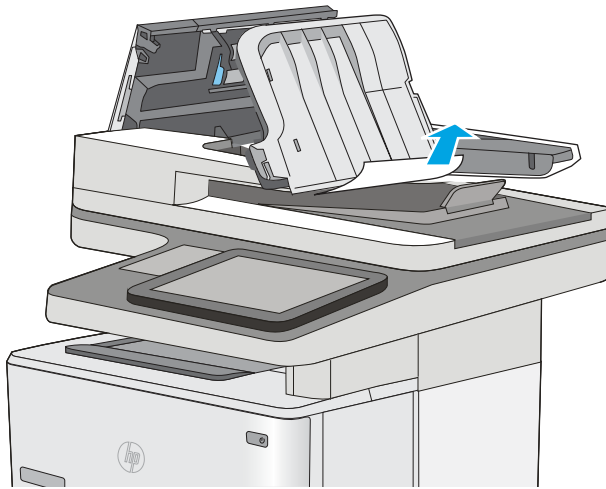


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

- 4. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path

- a. Open the ADF and remove any paper found.

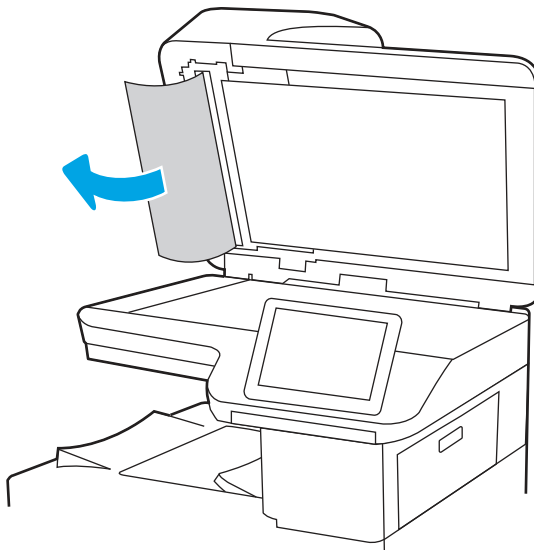

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

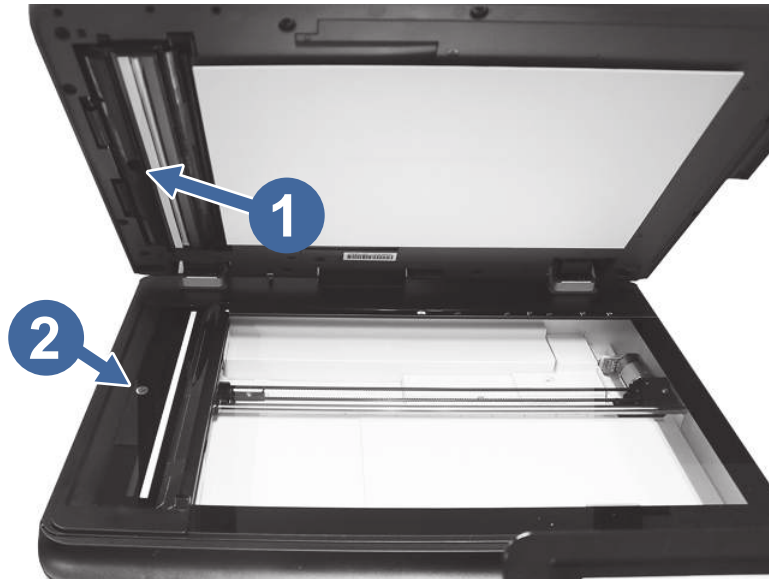


Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.
5. Ensure that the paper meets the document feeder (ADF) specifications for the printer.
This document outlines the supported weights and sizes of the ADF including best practices:
Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF): [Click here - c06601744](#)
 6. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
Make sure that the paper stack is correctly aligned at the center of the input tray when paper is

loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-135 Set the ADF guides

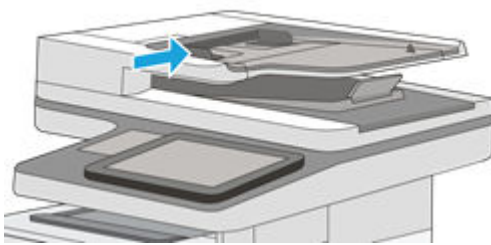


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


7. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

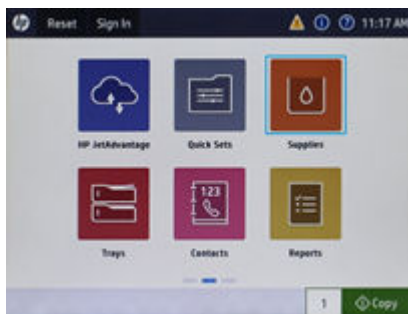

- b. Select **Document Feeder Kit**.

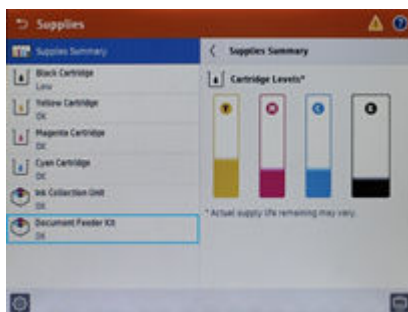


- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

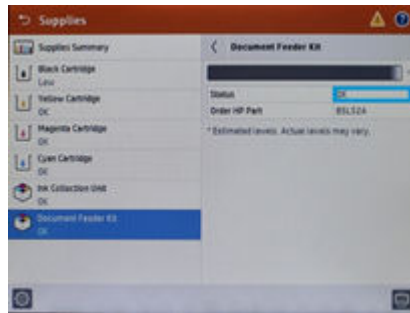

- d. If the status is **Low** or **Very Low** it is recommended that the customer replace the Document Feeder Kit.

Part number: **J8J95A**/HP 300 ADF Roller Replacement Kit

8. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

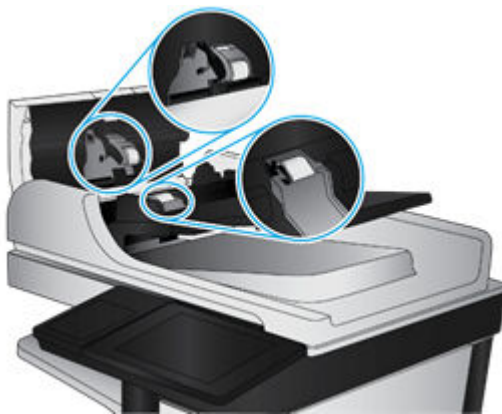

9. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.


Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.


1. Remove any paper in the paper path.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)


2. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

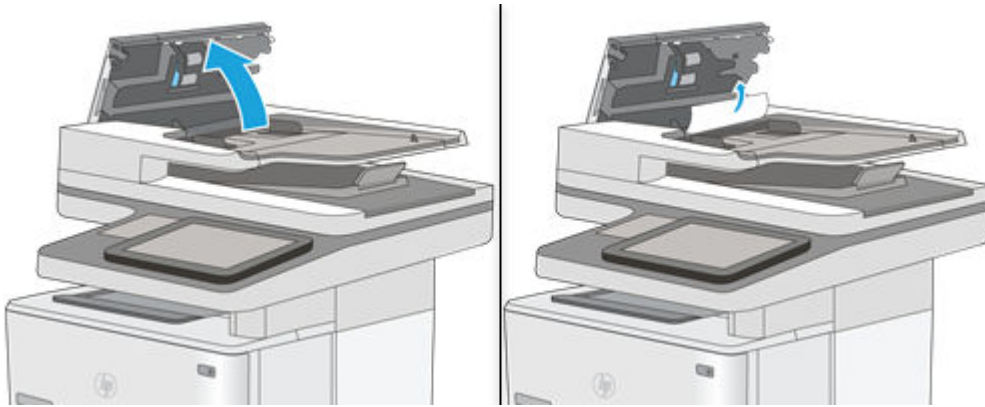

3. Lift the document-feeder input tray and remove any jammed paper.
 - a. Lift the document feeder input tray

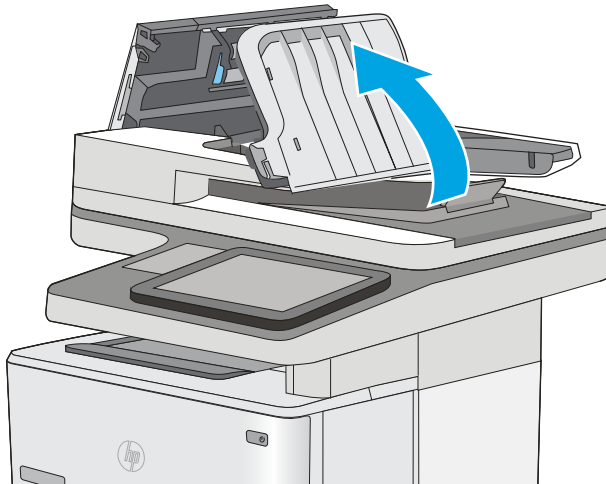

- b. Remove any paper found under the tray.

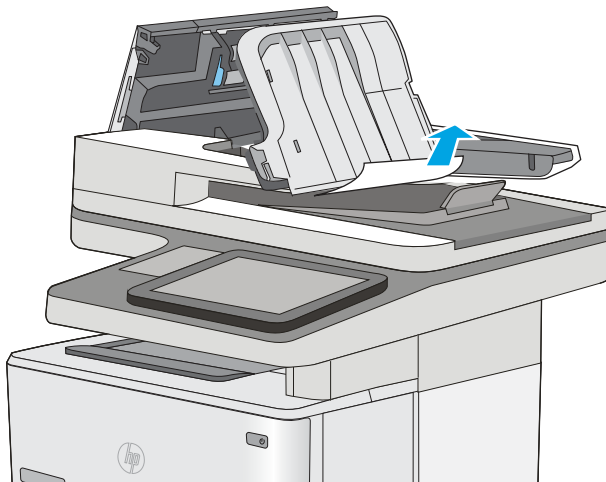


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

- 4. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path
 - a. Open the ADF and remove any paper found.

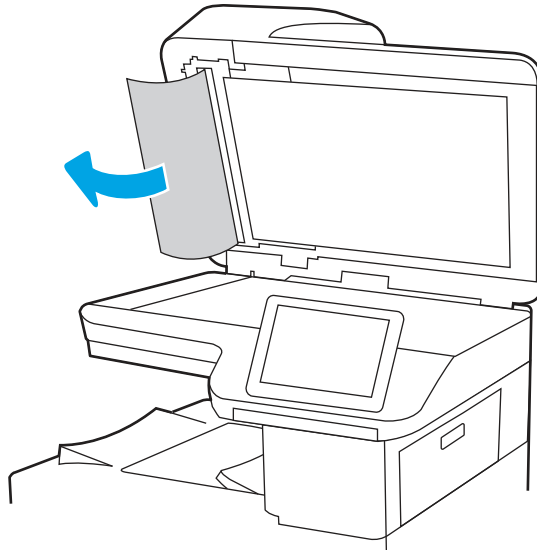

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

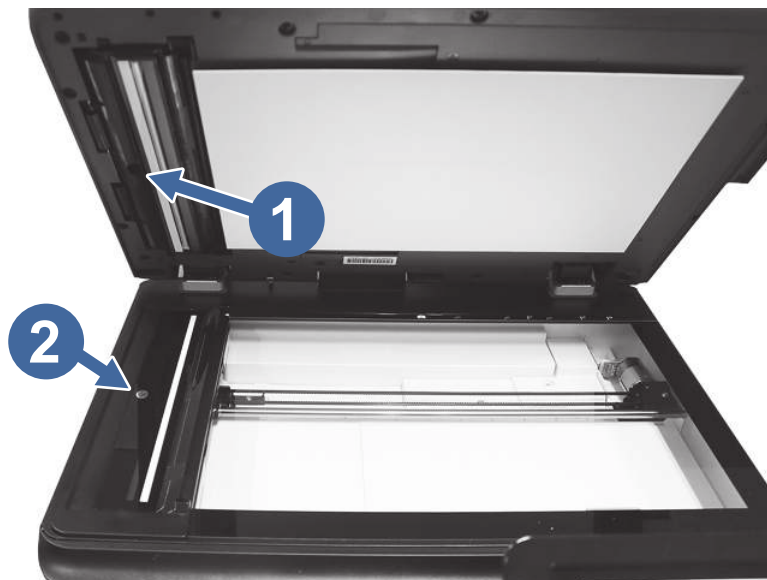

Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.


5. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF): [Click here - c06601744](#)

6. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-136 Set the ADF guides

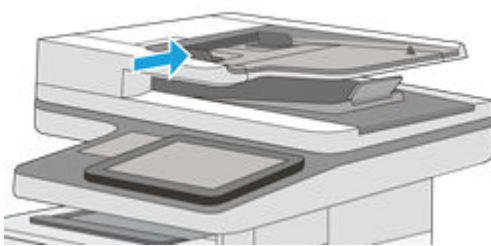


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


7. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

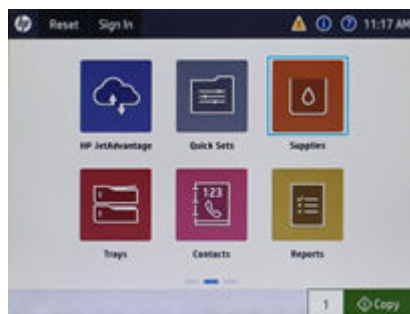

- b. Select **Document Feeder Kit**.

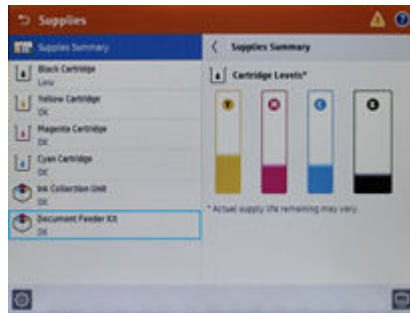

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

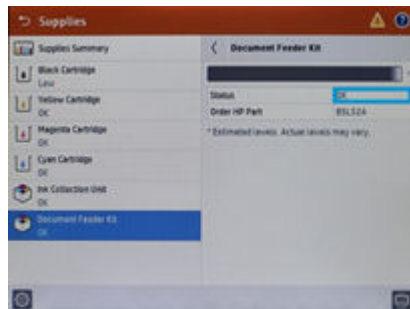


- d. If the status is **Low** or **Very Low** it is recommended that the customer replace the Document Feeder Kit.

Part number: **J8J95A**/HP 300 ADF Roller Replacement Kit .

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace 5851-7202 (Roller replacement kit - Replacement feed rollers for the document feeder)

8. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

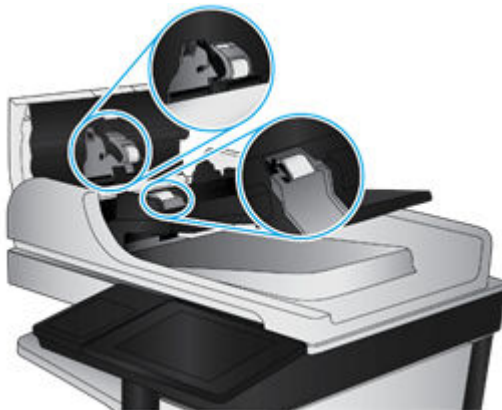

9. If the error persists, replace the Document Feeder Kit rollers and separation pad.

Table 6-83 Roller replacement kit part number

Part description	Part number
Roller replacement kit - Replacement feed rollers for the document feeder	5851-7202

10. If a grinding noise is heard or reported in conjunction with the pick or feed of paper through the ADF, replace the document feeder (ADF) unit.

Use the table below to order the correct part for your printer. The replacement part for the Document feeder kit (ADF) Enterprise and Workflow series includes white backing and retention clips.

Table 6-84 Document feeder kit for Enterprise and Workflow models part numbers

Part description	Part number
Document feeder kit - Enterprise series	5851-7203
Document feeder kit - Workflow series	5851-7204


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.


1. Remove any paper in the paper path.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

2. Open the automatic document feeder lid, pull all the sheets back into the input tray, and then resume the job.
3. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path
 - a. Open the ADF and remove any paper found.

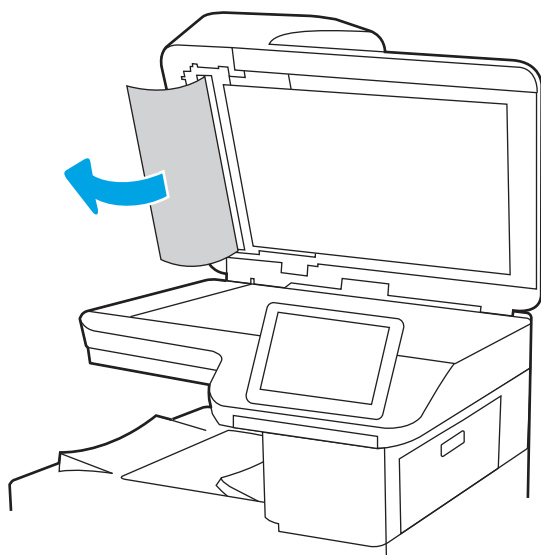

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

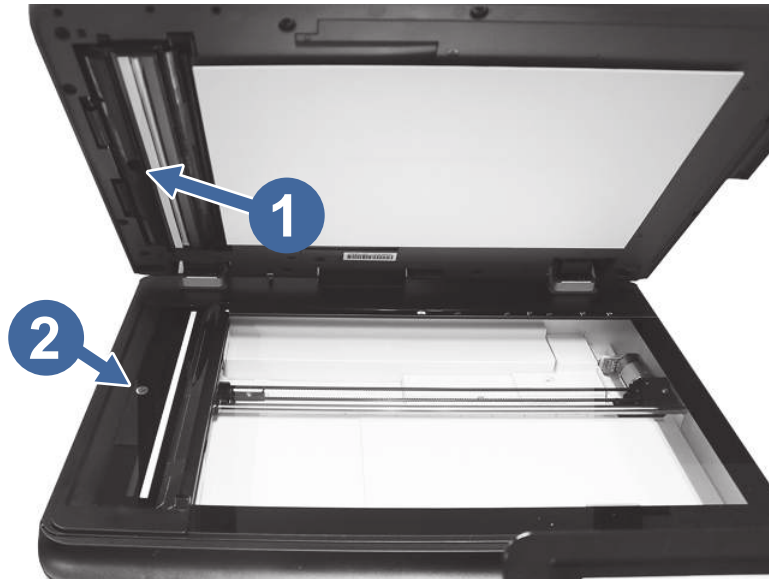

Callout 1: Check for paper blocking this area.


Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.
4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:
Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF): [Click here - c06601744](#)
 5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
Make sure that the paper stack is correctly aligned at the center of the input tray when paper is

loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-137 Set the ADF guides

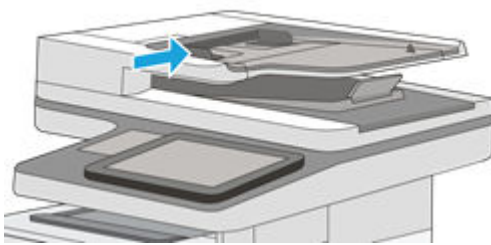


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

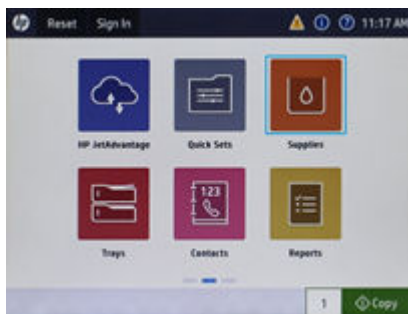

- b. Select **Document Feeder Kit**.

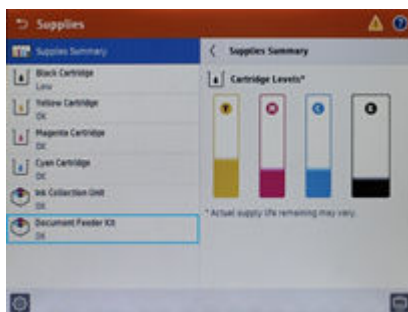

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

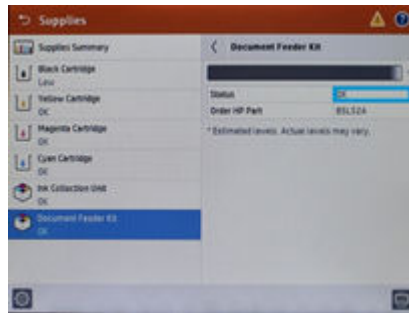

- d. If the status is **Low** or **Very Low** it is recommended that the customer replace the Document Feeder Kit.


Part number: **J8J95A**/HP 300 ADF Roller Replacement Kit .

To order parts, go to <https://store.hp.com>



NOTE: Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace 5851-7202 (Roller replacement kit - Replacement feed rollers for the document feeder)

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

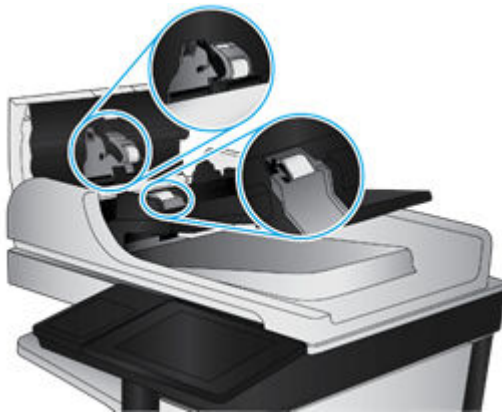

8. If necessary, replace the Document Feeder Kit rollers and separation pad.


Roller replacement kit - Replacement feed rollers for the document feeder: 5851-7202

For instructions: *Removal and replacement: Document feeder rollers* See the Repair Service Manual for this product.

9. Test the document feeder by running a multiple page copy job.
- Should a grinding noise be reported or heard in conjunction with the pick/feed of paper through the ADF, Replace the document feeder (ADF) unit.
 - If the pick/feed issue does not include grinding noise, continue with the recommended action for the specific 31.13.x event/or symptomatic behavior

10. Inspect the ADF pick success sensor, cleaning both the REDI (paper pick success) sensor window and REDI (PAPER PICK SUCCESS) sensor reflector. If there is any dust or fiber remnants, clean by using a can of compressed air to blow out and clean.


Figure 6-138 ADF REDI sensor

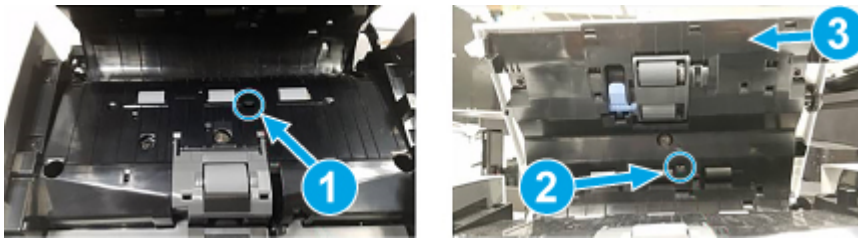

- 1 – REDI sensor window
- 2 – REDI sensor reflector
- 3 – ADF hatch

11. Verify that the connections between the automatic document feeder and the SCB are correctly seated.

Figure 6-139 SBC connections

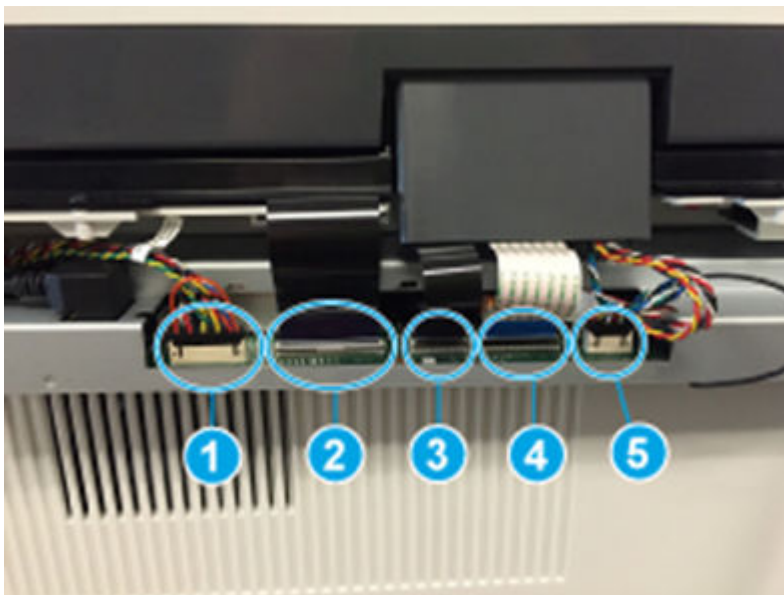


- 1 – Flatbed sensor/motor
- 2 – Flatbed FFC
- 3 – ADF sensor
- 4 – ADF FFC
- 5 – ADF Motor


 **NOTE:** The flat flexible cables (FFC's) on the Scanner Control Board (SCB) are zero Insertion Force (ZIF) connectors.

-


- b. Select **Troubleshooting**.

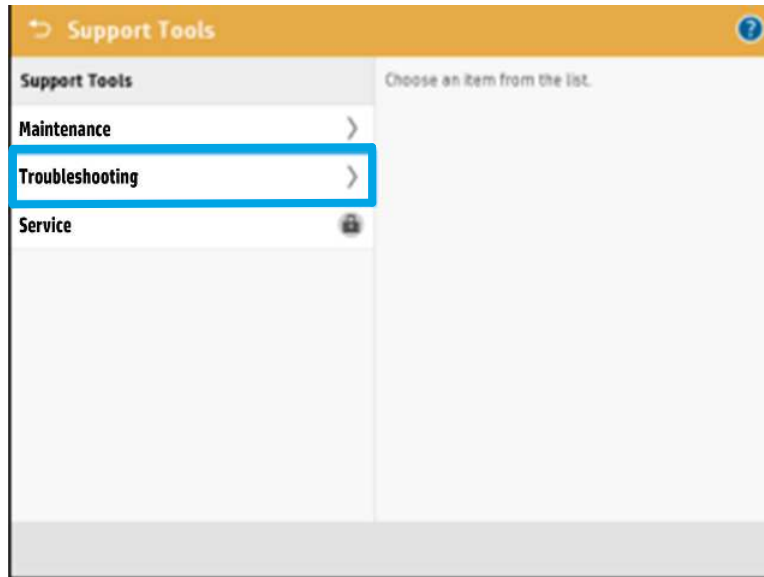


- c. Select **Diagnostic Tests**.

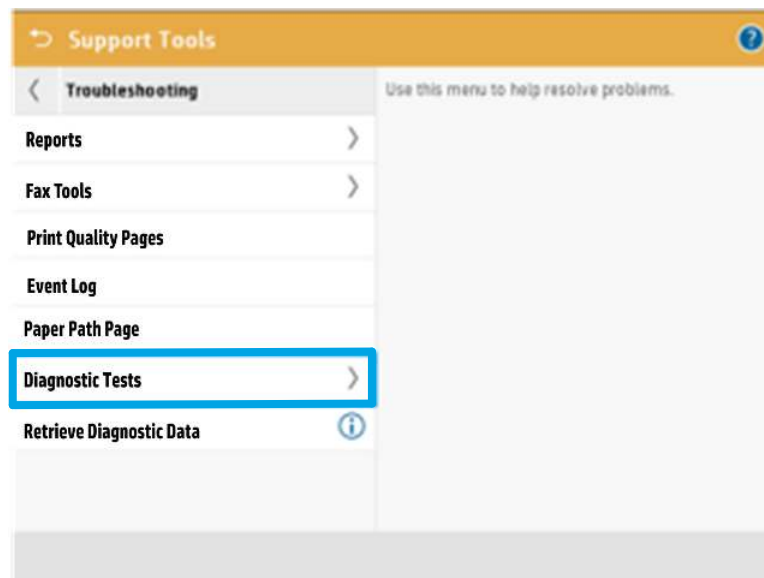


- d. Select **Continue**.

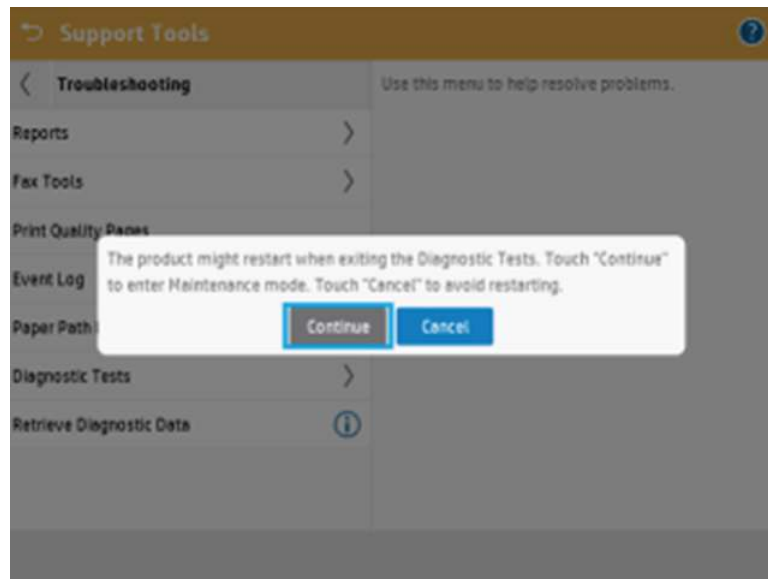

- e. Select **Manual Sensor Test**.

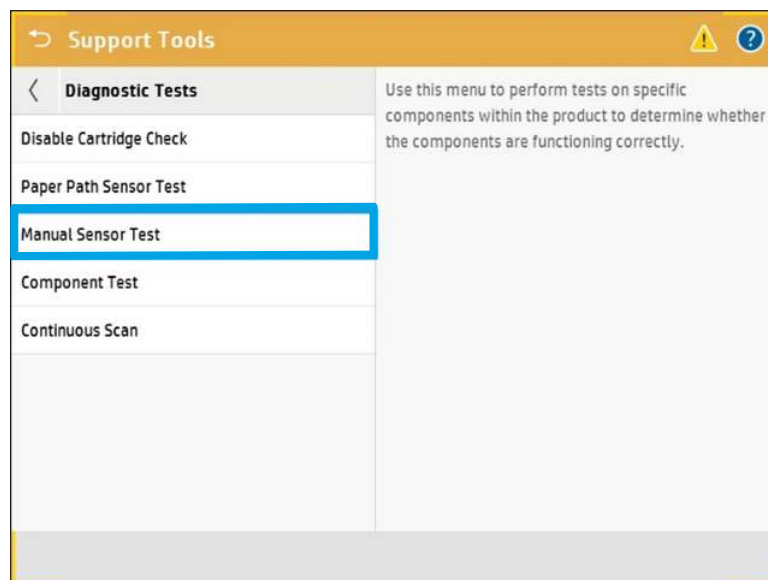

- f. Select **ADF Paper Path Deskew**.

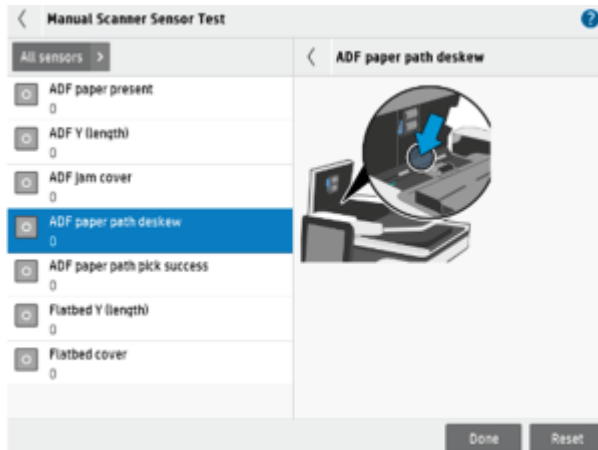


- g. Select **ADF Paper Path Pick Success**.

(Only in FLOW-MODELS)



NOTE: Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advancing.

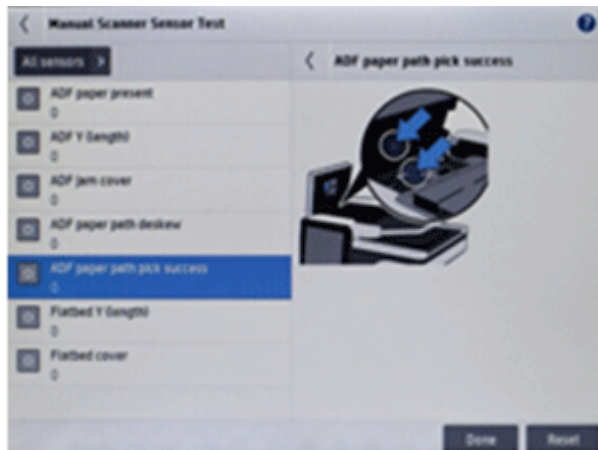

- h. Close the ADF cover and ensure that is secure and closed correctly.

13. Open and close the ADF cover to trigger the ADF Paper Path Pick Success sensor.



 **NOTE:** Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advanced.

14. If the ADF Paper Path Pick Success test fails to advance the count, replace the document feeder.

 **NOTE:** If a grinding noise is heard or reported in conjunction with the pick or feed of paper through the ADF, replace the document feeder (ADF) unit.

Use the table below to order the correct part for your printer. The replacement part for the Document feeder kit (ADF) Enterprise and Workflow series includes white backing and retention clips.

Table 6-85 Document feeder kit for Enterprise (Non-flow models) and Workflow (Flow models) series part numbers

Part description	Part number
Document feeder kit - Enterprise series	5851-7203
Document feeder kit - Workflow series	5851-7204

For instructions: *Removal and replacement: Document feeder* See the Repair Service Manual for this product.

31.13.02

Document feeder job error, feed jam.

The paper passed the pick-success sensor, and then jammed in the automatic document feeder paper path.

This issue might be describe as the following:


- Automatic document feeder jam
- ADF Jamming
- ADF paper jam
- Jams in document feeder

Recommended action for customers

1. Remove any paper in the paper path.


For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

2. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

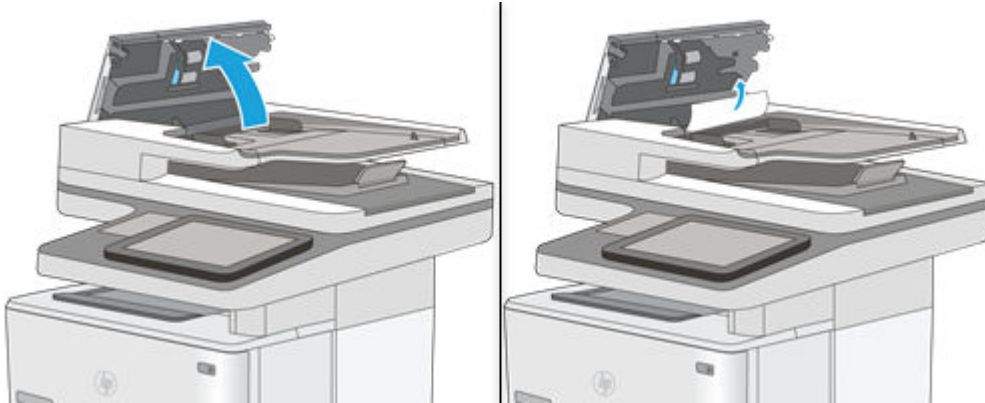


3. Lift the document-feeder input tray and remove any jammed paper.

- a. Lift the document feeder input tray

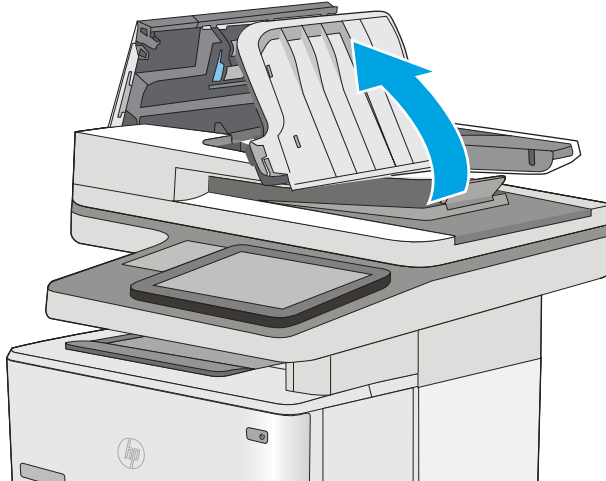

- b. Remove any paper found under the tray.

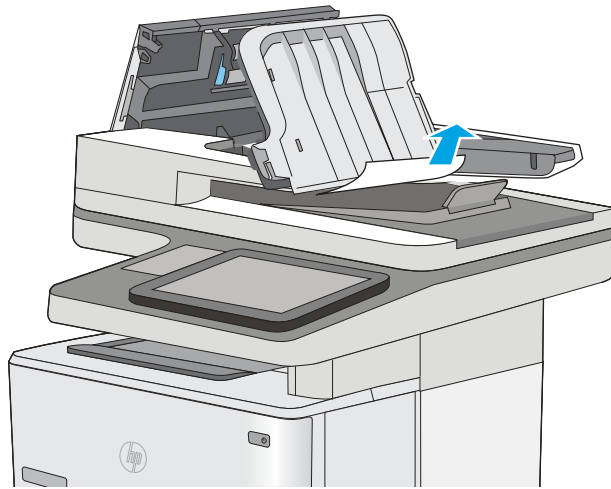


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

4. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path

- a. Open the ADF and remove any paper found.

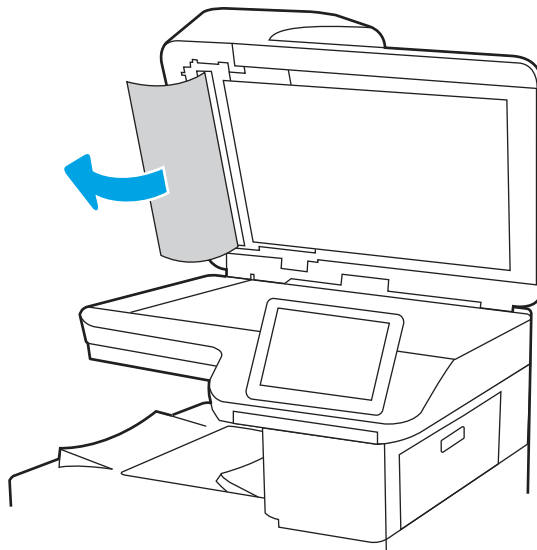

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

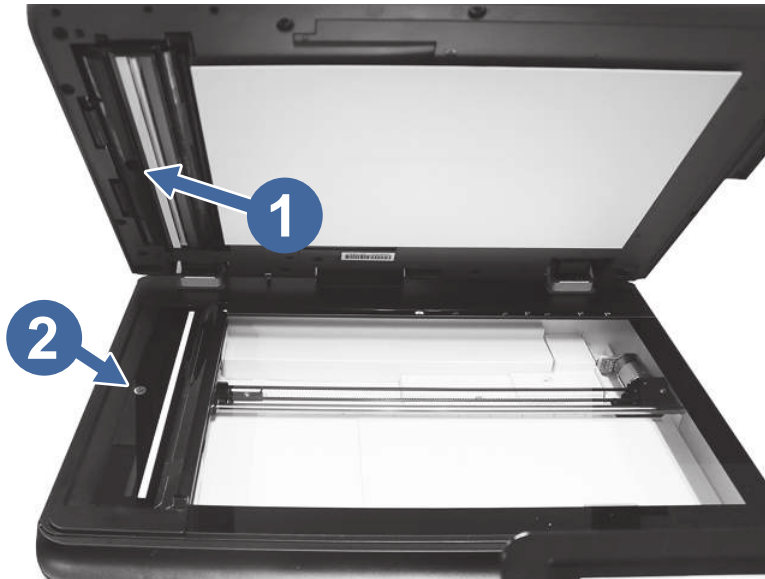


Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.
5. Ensure that the paper meets the document feeder (ADF) specifications for the printer.
This document outlines the supported weights and sizes of the ADF including best practices:
Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF): [Click here - c06601744](#)
 6. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
Make sure that the paper stack is correctly aligned at the center of the input tray when paper is

loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-140 Set the ADF guides

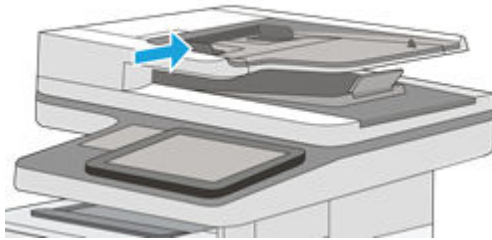


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


7. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

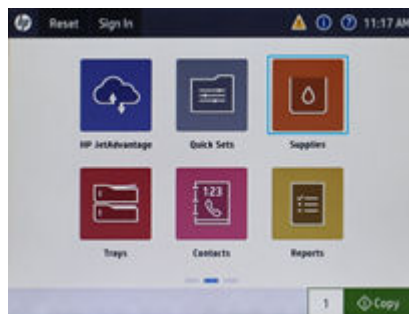

- b. Select **Document Feeder Kit**.

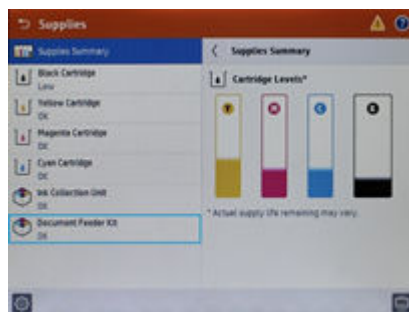


- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

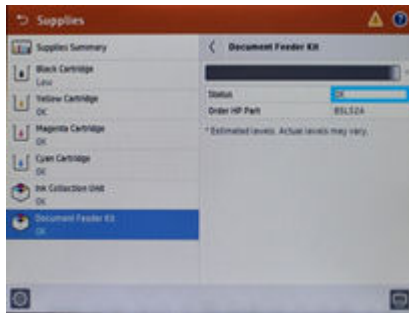

- d. If the status is **Low** or **Very Low** it is recommended that the customer replace the Document Feeder Kit.

Part number: [J8J95A](#)/HP 300 ADF Roller Replacement Kit

8. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

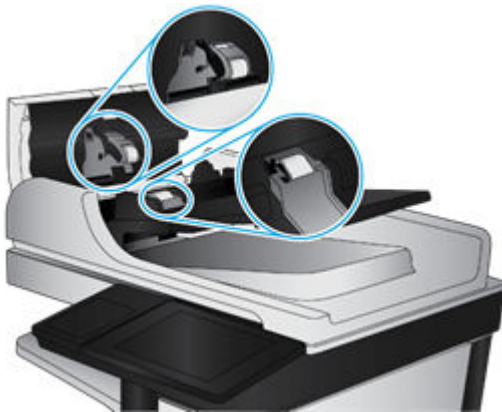

9. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.


Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.


1. Remove any paper in the paper path.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)


2. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

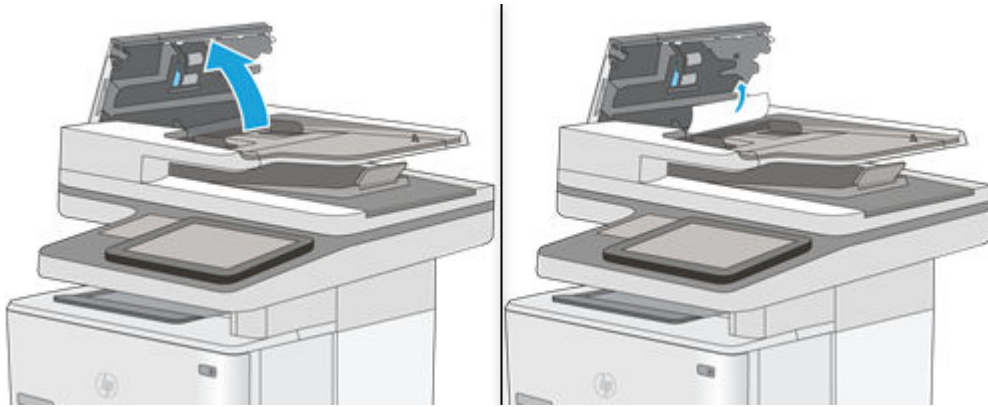

3. Lift the document-feeder input tray and remove any jammed paper.
 - a. Lift the document feeder input tray

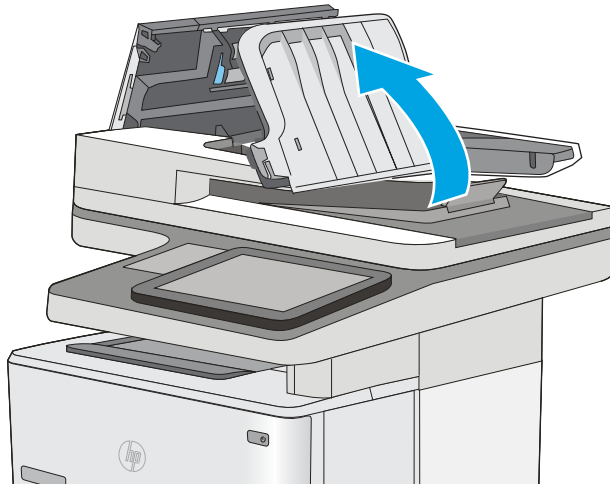

- b. Remove any paper found under the tray.

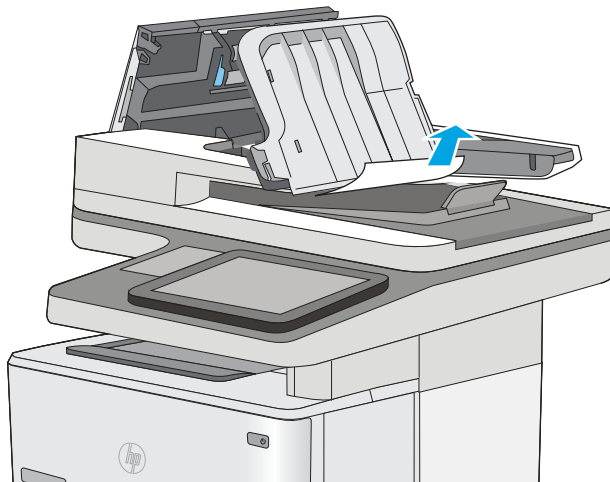


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

- 4. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path
 - a. Open the ADF and remove any paper found.

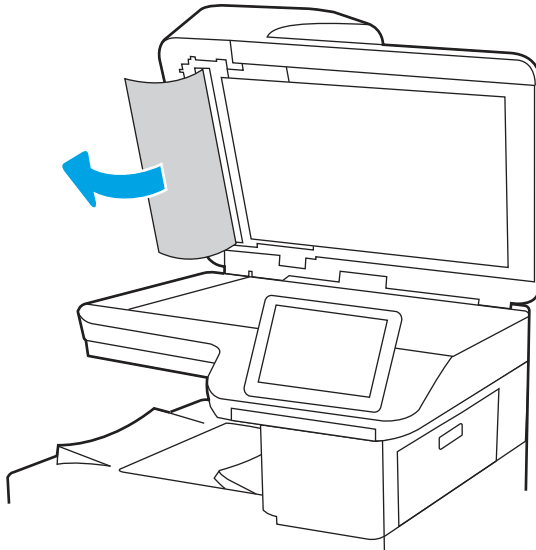

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

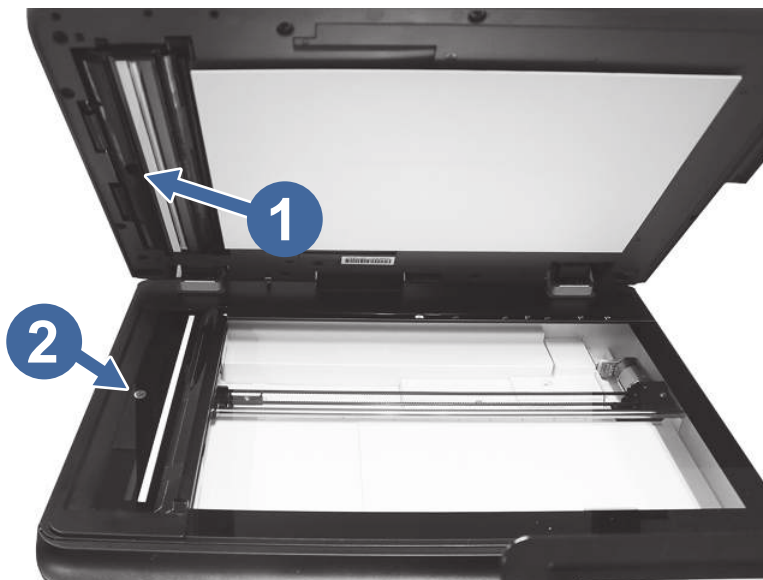

Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.


5. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF): [Click here - c06601744](#)

6. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-141 Set the ADF guides

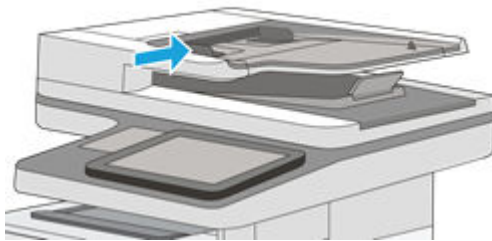


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


7. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

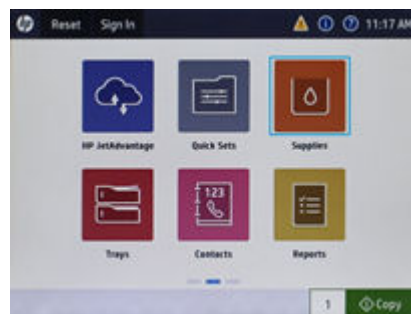

- b. Select **Document Feeder Kit**.

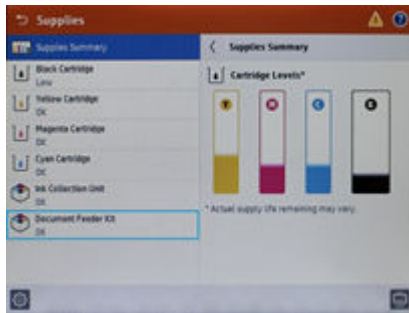

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

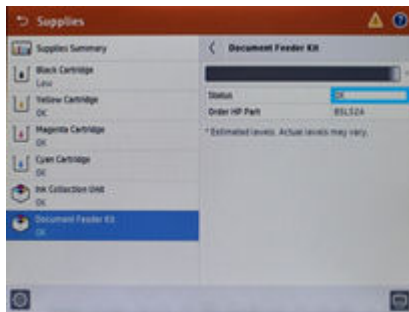


- d. If the status is **Low** or **Very Low** it is recommend that the customer replace the Document Feeder Kit.

Part number: [J8J95A](#)/HP 300 ADF Roller Replacement Kit .

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace 5851-7202 (Roller replacement kit - Replacement feed rollers for the document feeder)

8. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

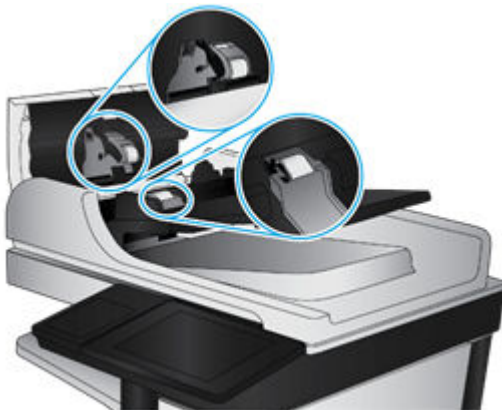

9. If the error persists, replace the Document Feeder Kit rollers and separation pad.

Table 6-86 Roller replacement kit part number

Part description	Part number
Roller replacement kit - Replacement feed rollers for the document feeder	5851-7202

10. If a grinding noise is heard or reported in conjunction with the pick or feed of paper through the ADF, replace the document feeder (ADF) unit.

Use the table below to order the correct part for your printer. The replacement part for the Document feeder kit (ADF) Enterprise and Workflow series includes white backing and retention clips.

Table 6-87 Document feeder kit for Enterprise and Workflow models part numbers

Part description	Part number
Document feeder kit - Enterprise series	5851-7203
Document feeder kit - Workflow series	5851-7204


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.


1. Remove any paper in the paper path.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

2. Open the automatic document feeder lid, pull all the sheets back into the input tray, and then resume the job.
3. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path
 - a. Open the ADF and remove any paper found.

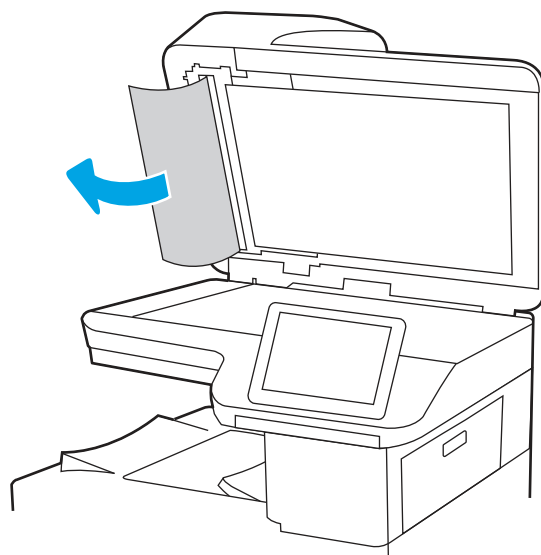

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

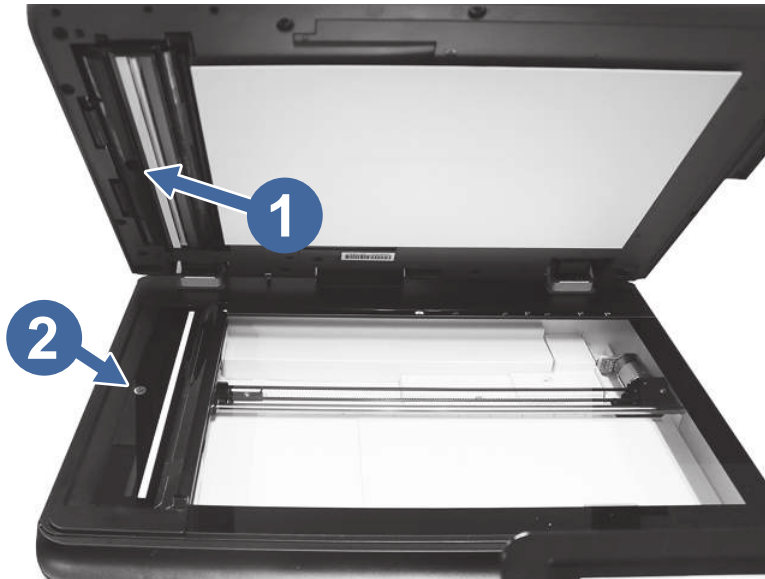


Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.
4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.
This document outlines the supported weights and sizes of the ADF including best practices:
Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF): [Click here - c06601744](#)
 5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
Make sure that the paper stack is correctly aligned at the center of the input tray when paper is

loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-142 Set the ADF guides

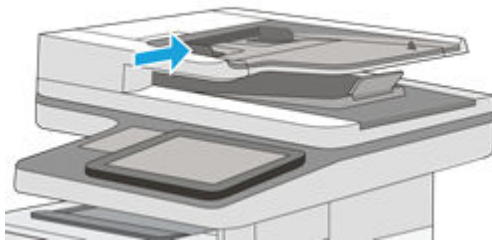


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

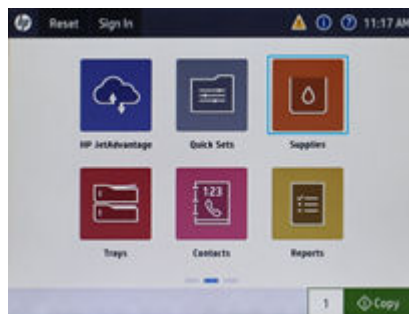

- b. Select **Document Feeder Kit**.

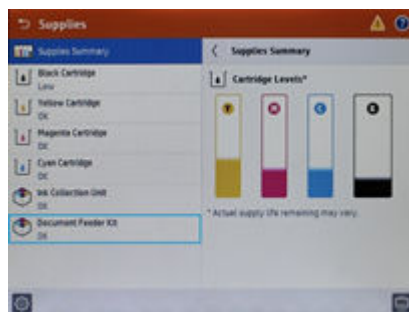

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

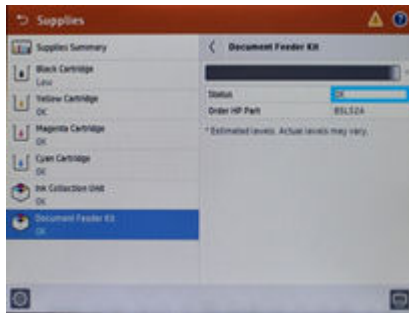


- d. If the status is **Low** or **Very Low** it is recommended that the customer replace the Document Feeder Kit.

Part number: [J8J95A](#)/HP 300 ADF Roller Replacement Kit .

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace 5851-7202 (Roller replacement kit - Replacement feed rollers for the document feeder)

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

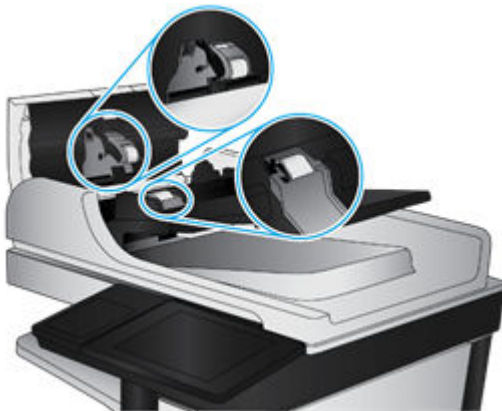

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Roller replacement kit - Replacement feed rollers for the document feeder: 5851-7202

For instructions: *Removal and replacement: Document feeder rollers* See the Repair Service Manual for this product.

9. Test the document feeder by running a multiple page copy job.
- Should a grinding noise be reported or heard in conjunction with the pick/feed of paper through the ADF, Replace the document feeder (ADF) unit.
 - If the pick/feed issue does not include grinding noise, continue with the recommended action for the specific 31.13.x event/or symptomatic behavior

10. Inspect the ADF pick success sensor, cleaning both the REDI (paper pick success) sensor window and REDI (PAPER PICK SUCCESS) sensor reflector. If there is any dust or fiber remnants, clean by using a can of compressed air to blow out and clean.


Figure 6-143 ADF REDI sensor



- 1 – REDI sensor window
- 2 – REDI sensor reflector
- 3 – ADF hatch

11. Verify that the connections between the automatic document feeder and the SCB are correctly seated.


Figure 6-144 SBC connections

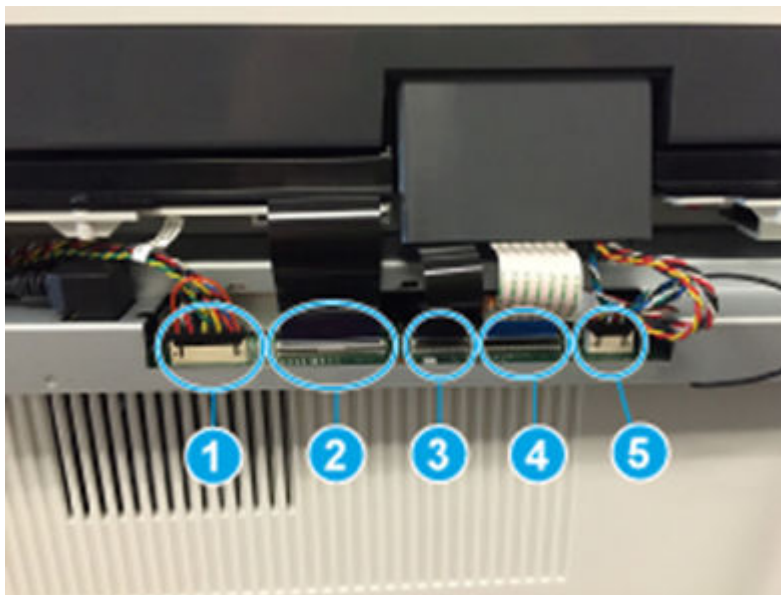


- 1 – Flatbed sensor/motor
- 2 – Flatbed FFC
- 3 – ADF sensor
- 4 – ADF FFC
- 5 – ADF Motor

 **NOTE:** The flat flexible cables (FFC's) on the Scanner Control Board (SCB) are zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are DRAMATICALLY different that the Light Insertion Force (LIF) connectors found on the LaserJet M527 and Color LaserJet M577 families.
Gate closed

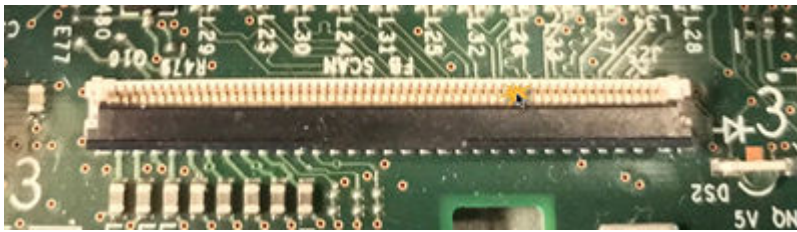


Proper insertion

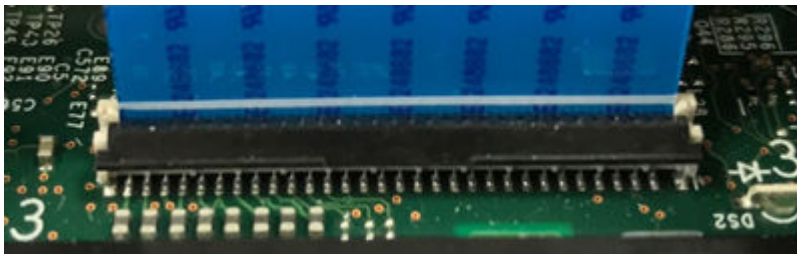


Improper insertion




12. Using the Manual Scanner Sensor Test verify functionality of the ADF Paper Path Pick Success sensor.
 - a. Navigate to and select **Support Tools**.

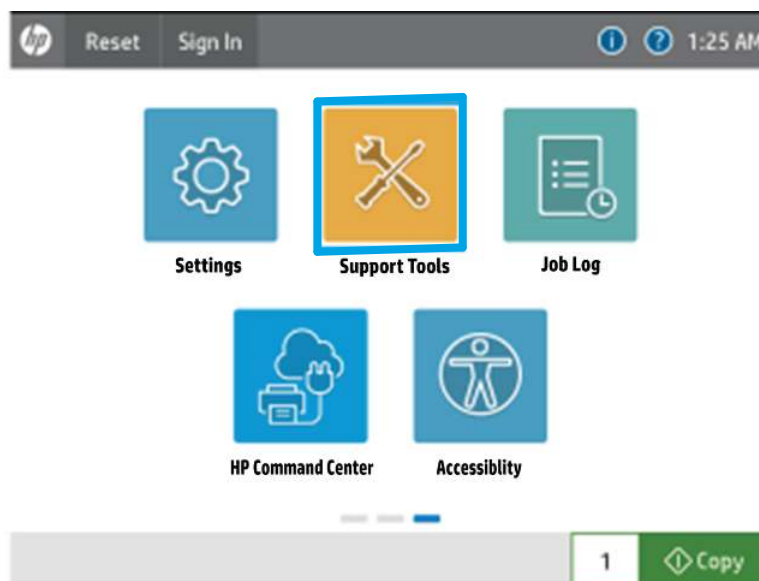


- b. Select **Troubleshooting**.

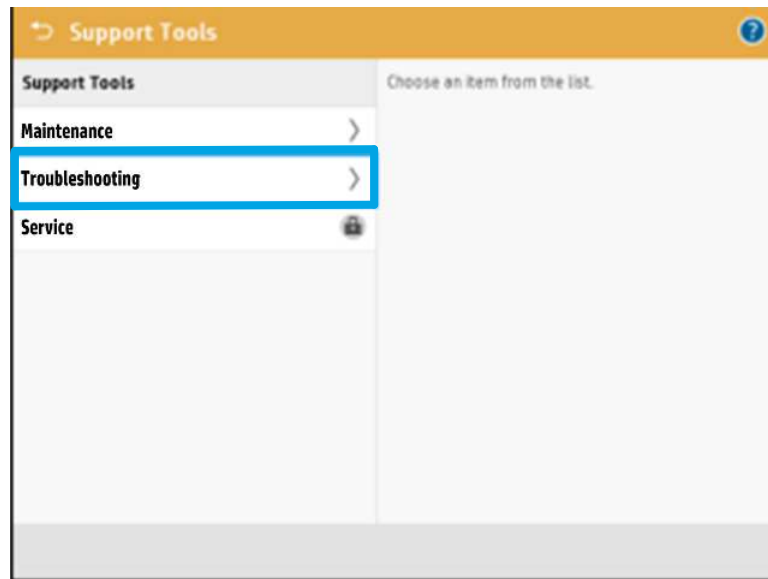


- c. Select **Diagnostic Tests**.

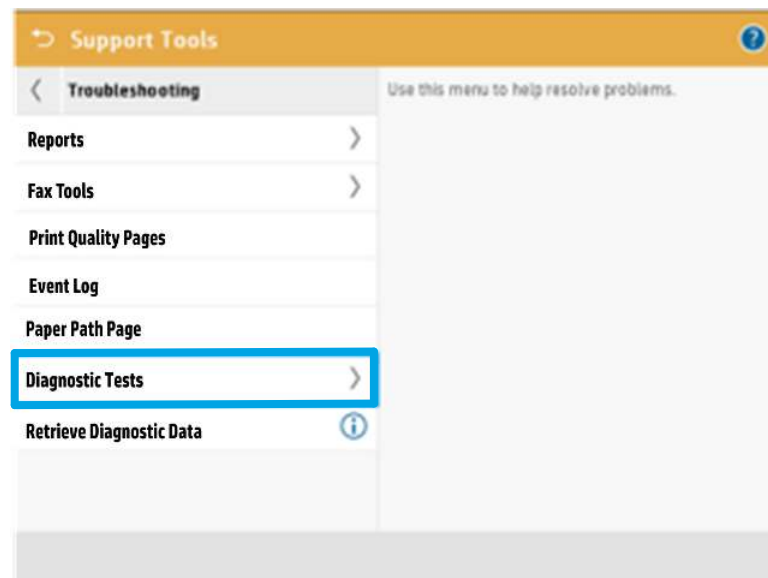

- d. Select **Continue**.

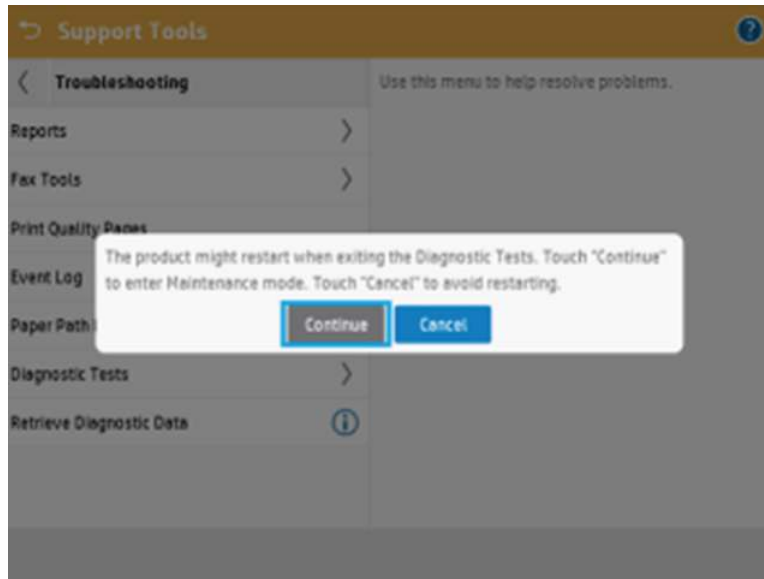

- e. Select **Manual Sensor Test**.

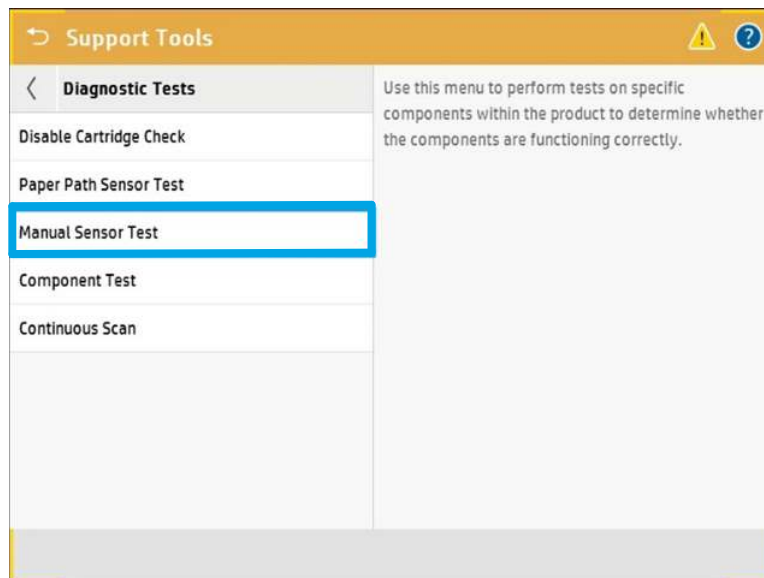

- f. Select **ADF Paper Path Deskew**.




- g. Select **ADF Paper Path Pick Success**.

(Only in FLOW-MODELS)



NOTE: Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advancing.

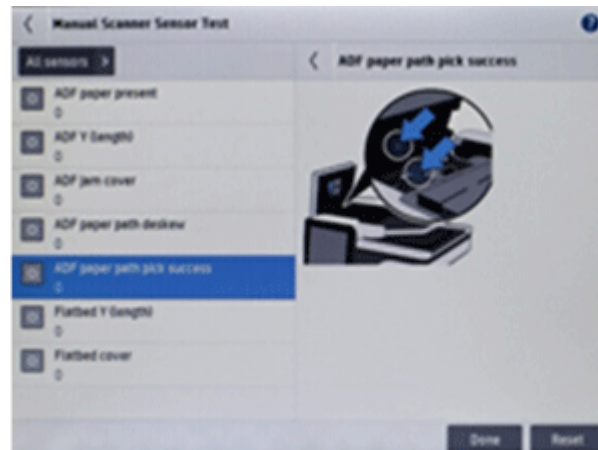

- h. Close the ADF cover and ensure that is secure and closed correctly.

13. Open and close the ADF cover to trigger the ADF Paper Path Pick Success sensor.



 **NOTE:** Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advanced.

14. If the ADF Paper Path Pick Success test fails to advance the count, replace the document feeder.

 **NOTE:** If a grinding noise is heard or reported in conjunction with the pick or feed of paper through the ADF, replace the document feeder (ADF) unit.

Use the table below to order the correct part for your printer. The replacement part for the Document feeder kit (ADF) Enterprise and Workflow series includes white backing and retention clips.

Table 6-88 Document feeder kit for Enterprise (Non-flow models) and Workflow (Flow models) series part numbers

Part description	Part number
Document feeder kit - Enterprise series	5851-7203
Document feeder kit - Workflow series	5851-7204

For instructions: *Removal and replacement: Document feeder* See the Repair Service Manual for this product.

31.13.13

The automatic document feeder jam access door is open.

Recommended action for customers

1. Open and close the automatic document feeder jam access cover ensuring that the cover latches correctly.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Open and close the automatic document feeder jam access cover ensuring that the cover latches correctly.

2. Verify that the flag is not broken off. Open and close the jam cover and if the sensor status does not change then replace the automatic document feeder.
3. If the error remains replace the automatic document feeder assembly.

Non-flow models part number: 5851-7203

Flow models part number: 5851-7204

For instructions: *Removal and replacement: Document feeder* See the Repair Service Manual for this product.

31.13.14

Document feeder job error: over current.

This is a feed jam in the automatic document feeder, and the motor is not turning.

Recommended action for customers

1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
4. Check and clean the feed rollers and separation pad. If needed, replace the pickup roller assembly and separation pad.

Part number: 5851-7202

To order parts, go to <https://www.hp.com/buy/parts>.

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians



NOTE: When disconnecting and reseating flat flexible cables (FFC's) on the Scanner Control Board (SCB), it is important to know that the connectors are Zero Insertion Force (ZIF) connectors.

ZIF connectors have gates that need to be opened and closed for proper removal/reinsertion. These connectors are significantly different than the Light Insertion Force (LIF) connectors found on some other LaserJet printer families.

Figure 6-145 Gate Closed



Figure 6-146 Proper insertion

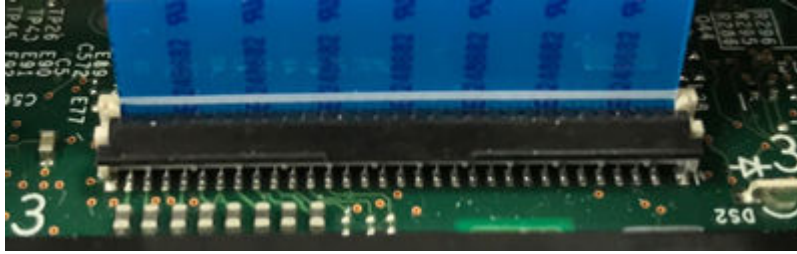


Figure 6-147 Improper insertion




1. Open the automatic document feeder lid, pull all the sheets back into the input tray, and then resume the job.
2. Verify that the paper being used meets the HP specifications for the printer.
3. Ensure that the input tray is not overloaded and the tray guides are set to the correct size.
4. Check the automatic document feeder page count for roller life. If they are past the life of the rollers have the customer purchase a new roller kit.
5. Check and clean the feed rollers and separation pad. If needed, replace the pickup roller assembly and separation pad.

Part number: 5851-7202

For instructions: *Removal and replacement: Document feeder rollers* See the Repair Service Manual for this product.

6. Verify that the connections between the automatic document feeder and the SCB are correctly seated.

Figure 6-148 SCB Connections

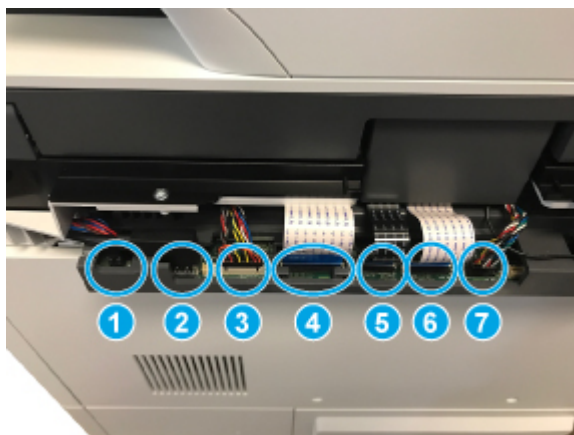

1 – Power cable

- 2 – HDMI (Formatter/SCB communication)
- 3 – Flatbed sensor/motor
- 4 – Flatbed FFC
- 5 – ADF sensor/motor
- 6 – ADF FFC
- 7 – ADF Motor
- 7. If the error remains replace the automatic document feeder assembly.

Non-flow models part number: 5851-7203

Flow models part number: 5851-7204

For instructions: *Removal and replacement: Document feeder* See the Repair Service Manual for this product.

32.WX.YX error messages

32.* errors

Errors in the 32.* family are related to either product start events or to backup and restore events.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. Retry the job.

32.08.A1, 32.08.A2, 32.08.A3

An event related to starting the printer.

32.08.A1 (event code)

Shutdown event. Boot after abnormal shutdown.

32.08.A2 (event code)

Boot from normal shutdown event.

32.08.A3 (event code)

Regular boot event.

Recommended action

There is no action needed for this message.

- No action necessary.

32.1C.05

The restore job ticket was submitted with invalid credentials.

Recommended action

1. Verify the credentials that were submitted.
2. Check the domain, user name, and password.

32.1C.06 (event code)

The backup job ticket was submitted with invalid credentials.

Recommended action

1. Verify the credentials that were submitted.
2. Check the domain, user name, and password.

32.1C.07 (event code)

Backup restore permissions error.

There was an error during the creation, read, or write of the restore file.

Recommended action

- Retry the job.

32.1C.08 (event code)

Not enough disk space to perform backup/restore, or a network share issue.

There was an error during the creation, read, or write of the backup file.

Recommended action

1. Retry the job.
2. Remove stored jobs and retry.
3. If the error persists, try using a larger capacity storage device for the share location and check the network share settings.
4. Check the network share or try setting up a new shared network drive or folder.

32.1C.09 (event code)

Tried to restore a backup file that was not valid for this printer.

The data in the backup file specified in the restore job ticket is no longer valid due to a corruption of the data, or the data is no longer present.

Recommended action

- Use a valid backup file.

32.1C.0A (event code)

Backup file is invalid.

The data in the backup file specified in the restore job ticket is no longer valid due to a corruption of the data, or the data is no longer present.

Recommended action

1. Use a valid backup file.
2. Reboot, and then observe the state of the printer.
3. If the error persists, perform a partition clean from the **Preboot** menu.

32.1C.0D (event code)

Backup/restore failed, auto-reboot failed, or the printer might be busy.

Recommended action

- Reboot, and then retry the backup/restore.

32.1C.11 (event code)

Backup/restore time-out while communicating with the engine.

The backup operation was aborted because the printer is busy.

Recommended action

- Wait until the printer is idle, and then try again.

32.1C.13, 32.1C.14

Not enough space exists to perform the backup.

The backup was aborted because the disk is at a critical level or full.

Scheduled backup failure.

Recommended action

- Free up disk space, and then try again.

32.1C.15

The restore operation was aborted because the backup file was created by a previous version of firmware no longer supported by the feature.

Recommended action

- Use the current backup file.

32.1C.2E

The restore operation was aborted because the printer is busy.

Recommended action

1. Wait until the printer is idle, and then retry.
2. Turn the printer off then on, and then retry.

32 . 1C . 2F

Reset failure.

Recommended action

- Turn the printer off, and then on. Retry the job.

32 . 1C . 40

The backup operation completed successfully (informational).

Recommended action

See recommended action.

- No action necessary.

32 . 1C . 41

The backup operation encountered an error (informational).

Recommended action

See recommended action.

- No action necessary.

32 . 1C . 42

The backup operation completed, but with a warning message (informational).

Recommended action

See recommended action.

- No action necessary.

32 . 1C . 43

A component in the backup file is not supported by the current version of firmware and will not be restored (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.44

A component in the backup file is not transferable to another printer and will not be restored (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.45

Some data was not included in the backup file (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.46

An expected component could not be found and was thus not backed up. Because components should be known on backups, this code is a warning (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.47

Some data was not restored from the backup file (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.48

The backup job ticket was submitted using an invalid network path.

Recommended action

1. Check that a shared folder was provided as part of the network path and not left blank.
2. Check that the server and the shared folder exists.
3. Check that you (or the applicable user) has permission to access the shared folder on the provided server.

32.1C.49

The backup job ticket was submitted with a bad encryption.



NOTE: This would only apply to a web services call to perform a backup with a blank PIN

Recommended action

- Verify that the encryption personal identification number (PIN) meets the restrictions for the printer.

32.1C.4A

An error occurred when creating the temporary directories used to store the backup files in transition to and from the compressed (ZIP) file.

Recommended action

1. Retry the job.
2. If this does not resolve the issue, turn the printer off then on again and retry the job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

32.1C.56

Reset aborted. Backup/restore in progress (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.57

Reset aborted (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.58

Unknown reset error (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.60

The restore operation completed successfully (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.61

The restore operation encountered an error.

Recommended action

- Review the printer's event log to see specific details about the failure.

32.1C.62

The restore operation completed, but with a warning message.

Recommended action

- Review the error log to see specific details about the failure.

32.1C.68

The restore job ticket was submitted using an invalid network path.

Recommended action

1. Check that a shared folder was provided as part of the network path and not left blank.
2. Check that the server and the shared folder exist.
3. Check that you (or the applicable user) has permission to access the shared folder on the provided server.
4. Check that the path includes the compressed .ZIP file name as part of the path.

32.1C.69

The restore job ticket was submitted with a bad encryption personal identification number (PIN).

Recommended action

- Verify the encryption personal identification number (PIN) is the same PIN used to encrypt the backup file.

32.1C.6A

An error occurred when creating the temporary directories used to store the restore files in transition to and from the compressed (ZIP) file.

Recommended action

- Retry the job.

32.1C.6D

An unusual error occurred when running the restore operation.

Recommended action

- Retry the job.

33.WX.YZ error messages

33.* errors

Errors in the 33.* family are related to the printer's storage system or the formatter. The component might have been previously installed in another printer and is therefore locked to that other printer. Or, the component might be incorrect for this printer.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem.

- Install the correct component for this printer.

33.01.xx

A save or restore process has occurred.

- **33.01.01** (event code)

A restore process has occurred.

- **33.01.02** (event code)

A save process has occurred.

- **33.01.03** (event code)

Save/recover functionality OK after previously being disabled.

Recommended action

See recommended action.

- No action necessary.

33.02.01 Used board/disk installed

Used board or disk installed.

An encrypted board or disk with existing data previously locked to a different printer has replaced the original. If you continue, data is permanently lost.

Recommended action

1. Determine if the printer firmware is up-to-date.
 - If the firmware has just been upgraded, go to **WISE** and search for the following document: HP FutureSmart - '33.02.01 Used board/disk installed' error received after updating the firmware from HP FutureSmart 4.8.1 or 4.9 to a newer version (c06488003).

Or click on the following link: [HP FutureSmart - '33.02.01 Used board/disk installed' error received after updating the firmware from HP FutureSmart 4.8.1 or 4.9 to a newer version](#)
 - If not, upgrade the printer firmware to the latest version.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
2. Press **OK** on the control panel or remotely by using the new Remote Control Panel feature in the Embedded Web Server. The printer will return to a ready state.
3. If the issue persists, reinstall the used board or disk into its original printer.
4. To save the data on the board or disk, turn the printer off. Replace the board or disk with another board or disk.
5. To delete the data on the board or disk and continue, touch the **OK** button.

33.02.02

Save Recover Status Error

The save or recover is disabled, (one or both disabled) (**Event Log Only**)

Recommended action

There is no action needed for this message.

- No action necessary.

33.03.02

Data size mismatch. Unable to recover DCC NVRAM.

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, replace the memory PCA (SODIMM) and return it to HP for evaluation.

33.03.03 Incompatible formatter installed.

This is an EFI BIOS event to prevent booting with the wrong formatter installed.

Recommended action for customers

1. Turn the printer off, and then install the correct formatter in the printer.



NOTE: If you believe this formatter is the correct part number and model for this printer, install the replacement formatter, and then return the formatter in question to HP for evaluation.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, ensure to use the **Backup/Restore** feature to save the printer settings, and then perform a **Partial Clean** procedure using the **Preboot** menu.

⚠ CAUTION: A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

- a. Turn the printer on.
- b. Press the HP logo that displays in the middle of the screen when you see the “1/8” under the logo.
- c. Use the down arrow ▼ to highlight **Administrator**, and then touch the **OK** button.
- d. Use the down arrow ▼ to highlight **Partial Clean**, and then touch the **OK** button.
- e. Press the **OK** button again.
- f. Press the Home button  to highlight **Continue**, and then press the **OK** button.

The printer will automatically reboot and should return to a Ready state.

For detailed instructions to perform a Partial Clean procedure, go to: [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#) (c03398779).

3. If the error persists, download the latest firmware version from [Software and Driver Downloads](#) to update the firmware.

For instructions, go to [Update the printer firmware](#).

4. If the error persists, replace the formatter.

Table 6-89 Formatter part numbers

Description/Product models	Part number
Formatter (main logic) PC board assembly	J7Z98-60001
For products: M652/M653	
Formatter (main logic) PC board assembly (India/China)	J7Z98-67904
For products: M652/M653	
Formatter (main logic) PC board assembly	J8A10-60001
For products: M681/M682	
Formatter (main logic) PC board assembly (India/China)	J8A10-67902
For products: M681/M682	

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, ensure to use the **Backup/Restore** feature to save the printer settings, and then perform a **Partial Clean** procedure using the **Preboot** menu.

 **CAUTION:** A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

- a. Turn the printer on.
- b. Press the HP logo that displays in the middle of the screen when you see the “1/8” under the logo.
- c. Use the down arrow ▼ to highlight **Administrator**, and then touch the **OK** button.
- d. Use the down arrow ▼ to highlight **Partial Clean**, and then touch the **OK** button.
- e. Press the **OK** button again.
- f. Press the Home button  to highlight **Continue**, and then press the **OK** button.

The printer will automatically reboot and should return to a Ready state.

For detailed instructions to perform a Partial Clean procedure, go to: [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#) (c03398779).

3. If the error persists, download the latest firmware version from [Software and Driver Downloads](#) to update the firmware.

For instructions, go to [Update the printer firmware](#).

4. If the error persists, replace the formatter.

 **IMPORTANT:** Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

Table 6-90 Formatter part numbers

Description/Product models	Part number
Formatter (main logic) PC board assembly	J8A10-60001
For products: M681/M682	
Formatter (main logic) PC board assembly (India/China)	J8A10-67902
For products: M681/M682	

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

33.03.05 EFI Boot error

EFI BIOS event showing that a replacement formatter Recover attempt was unsuccessful.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, download the latest firmware version from [Software and Driver Downloads](#) to update the firmware.

For instructions, go to [Update the printer firmware](#).

3. If the error persists, replace the formatter.

Table 6-91 Formatter part numbers

Description/Product models	Part number
Formatter (main logic) PC board assembly For products: M652/M653	J7Z98-60001
Formatter (main logic) PC board assembly (India/China) For products: M652/M653	J7Z98-67904
Formatter (main logic) PC board assembly For products: M681/M682	J8A10-60001
Formatter (main logic) PC board assembly (India/China) For products: M681/M682	J8A10-67902

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

This issue is caused by an unsuccessful formatter recovery after a formatter has been replaced.

1. Turn off the printer, and then turn on the printer.
2. If the error persists, perform a **Partial Clean** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives"

(ish_4502973-4502949-16) - Or click here: [HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.](#)

 **CAUTION:** A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

- a. Turn on the printer.
- b. Press the HP logo that displays in the middle of the screen when you see the “1/8” under the logo.
- c. Touch the down arrow button ▼ to highlight **Administrator**, and then press the **OK** button.
- d. Touch the down arrow button ▼ to highlight **Partial Clean**, and then press the **OK** button.
- e. Touch the **OK** button again.
- f. Touch the Home button  to highlight **Continue**, and then press the **OK** button.

The printer will automatically reboot and should return to a Ready state.

3. If the error persists, download and from the **Preboot** menu install the latest version of printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

4. If the issue persists, remove and reinstall the formatter board.
5. If the error persists, replace the formatter.

M806 part number: CZ244-67901

M806 (China/India) part number: CZ244-67902

M830 part number: CF367-67915

M830 (China/India) part number: CF367-67916

For instructions: *Removal and replacement: Formatter PCA*

See the Repair Service Manual for this product.

6. If the error persists, elevate the case using the Standard Support Process.

33.03.06

The memory PCA was not detected on startup.

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, turn the printer off, disconnect the power cord, and remove the formatter cover. Press firmly on the memory PCA cable connection to the formatter.
3. If the error persists, replace the memory PCA (SODIMM) assembly.

33.04.01 Missing TPM

A Trusted Platform Module is missing from a printer that previously had a TPM installed.

TPM accessory (optional): This system is using a TPM module installed as an accessory to protect data and it is not present. The original TPM must be returned or you can select the [Stop Using](#) option in the preboot TPM sub-menu. All data will be cryptographically erased and a reload of firmware from USB might be required.

TPM Standard (Standard on product): This system is using a TPM module installed at the factory to protect data and it is not present. Verify that the TPM is seated firmly on the formatter, in case of shifting during shipment. If the TPM has been removed for a formatter replacement, put the original TPM on the board. If the original TPM cannot be reinstalled or has become damaged, **DO NOT** replace any parts. Replace the printer.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Reinstall the missing TPM module into the printer.



NOTE: If the TPM accessory was installed, you can also go to the [Administration](#) menu and under TPM, select the [Stop Using](#) option if you no longer want to use the TPM accessory.

3. Restart the printer.

33.04.02 Missing TPM

The wrong TPM is installed on a printer that previously had a different TPM installed.

TPM Optional device: This system is using a TPM module to protect data and it is not present. The original TPM module must be returned or you may select the **Stop Using** option in the preboot TPM sub-menu.

Recommended action

1. Turn the printer off.
2. Reinstall the original TPM module into the printer.
3. Restart the printer.
4. Go to the [Administration](#) menu and under TPM and select the [Enable and Use](#) option.



NOTE: To no longer use the TPM device, go to the [Administration](#) menu and under TPM and select the [Stop Using](#) option.

33.04.03 Unknown TPM

A used TPM has been installed on a printer that has not previously had a TPM installed.

TPM Optional device: This system is using a TPM module to protect data and it is not present. The TPM module currently installed is used to protect data in another device. The original TPM module must be returned or you can start using this TPM module by selecting the [Enable and Use](#) option in the preboot TPM sub-menu. You can also stop using a TPM altogether.

Recommended action

1. Turn the printer off and remove the TPM module. The printer will not be protected.
2. If choosing to protect the printer with the used TPM, refer to the "Install a new or re-enable an existing TPM after disabling a previous TPM" section of the <http://h10032.www1.hp.com/ctg/Manual/c04499622> (c04499622).

33.04.05

TPM Security Error

This system contains a TPM module that is not supported on the device or belongs to another device.

TPM is unique for each device.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Disable the TPM in the preboot menu, customer will be able to operate the unit without security settings.
3. If the error persists, elevate the case using the Standard Support Process.

33.05.0z SureStart errors

A SureStart error has occurred.

The printer detected and recovered from a corrupted version of BIOS.

- **33.05.01** Boot code corrupt (event code)
- **33.05.02** Boot code corrupt (event code)
- **33.05.03** Boot code corrupt (event code)

The newly downloaded firmware failed to cryptographically validate the BIOS code.

- **33.05.04** Security alert
- **33.05.04** Upgrade corrupt (event code)
- **33.05.05** Security alert
- **33.05.05** Boot code corrupt (event code)
- **33.05.06** Security alert
- **33.05.06** Upgrade corrupt (event code)

- **33.05.07** Security alert
- **33.05.07** Upgrade corrupt (event code)
- **33.05.08** Invalid boot attempt (event code)
- **33.05.09** Downgrade attempted (event code)

Recommended action

1. For 33.05.01, 33.05.02, and 33.05.03: No action is necessary.
2. For all other errors: Download a firmware bundle to the printer from the [Preboot](#) menu.

Go to: [HP FutureSmart - Latest Firmware Versions](#)



NOTE: For more information on SureStart, go to: [HP SureStart Whitelisting and Intrusion Detection Troubleshooting Manual](#) (Doc ID: c04863614).

33.05.1x Whitelisting errors

An error occurred with a firmware file digital signature or an error with the certificate used to validate the firmware file certificate.

- **33.05.10** Security alert
- **33.05.10** Firmware verification Error: XX (Event code)
- **33.05.11** Security alert
- **33.05.11** Firmware verification Error: XX (Event code)
- **33.05.12** Security alert
- **33.05.12** Firmware verification Error: XX (Event code)

Recommended action

1. Perform a [Format Disk](#) procedure.
[HP Enterprise, HP Managed - Perform a Partial Clean or Format Disk to reset the printer](#)
2. If the device does not reboot to [Ready](#), download a firmware bundle to the device from the [Preboot](#) menu.

Go to: [HP FutureSmart - Latest Firmware Versions](#)



NOTE: Performing a Format Disk procedure is required before downloading a firmware bundle.

For more information on SureStart, go to [HP SureStart Whitelisting and Intrusion Detection Troubleshooting Manual](#). Doc ID c04863614.

33.05.2x Intrusion detection errors

The intrusion detection system has encountered an error.

The intrusion detection memory process determined an unauthorized change in system memory.

- **33.05.21** Security alert

- **33.05.21** Potential intrusion (Event code)

The intrusion detection memory process heartbeat was not detected.

- **33.05.22** Security alert
- **33.05.22** Cannot scan for potential intrusions (Event code)

The intrusion detection memory process did not initialize.

- **33.05.23** Security alert
- **33.05.23** Intrusion detection not initialized (Event code)
- **33.05.24** Intrusion detection initialization error (Event code)

Recommended action for customers

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.



NOTE: Selecting **Continue** from the Preboot menu will not resolve the error. The printer must be turned off, and then on to clear the error allowing the printer to reboot to a **Ready** state.



NOTE: With firmware version 3.7, when selecting **Continue** from the Preboot menu after encountering a **33.05.2z** or **33.05.5z** error, the following message displays:

"A disk or boot error has occurred. Clear Error. Press Any Key"

This message should be ignored.

Information on the Intrusion Detection error.

For more information on SureStart, go to: [HP SureStart Whitelisting and Intrusion Detection Troubleshooting Manual](#) (Doc ID: c04863614).

33.05.5z Intrusion detection errors

The intrusion detection system has encountered an error.

The intrusion detection memory process determined an unauthorized change in system memory.

- **33.05.51** Security alert
- **33.05.51** Potential intrusion (Event code)

The intrusion detection memory process heartbeat was not detected.

- **33.05.52** Security alert

- **33.05.52** Cannot scan for potential intrusions (Event code)

The intrusion detection memory process did not initialize.

- **33.05.53** Security alert
- **33.05.53** Intrusion detection not initialized (Event code)
- **33.05.54** Intrusion detection initialization error (Event code)

Recommended action for customers

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.



NOTE: Selecting **Continue** from the Preboot menu will not resolve the error. The printer must be turned off, and then on to clear the error allowing the printer to reboot to a **Ready** state.



NOTE: With firmware version 3.7, when selecting **Continue** from the Preboot menu after encountering a **33.05.2z** or **33.05.5z** error, the following message displays:

"A disk or boot error has occurred. Clear Error. Press Any Key"

This message should be ignored.

Information on the Intrusion Detection error.

For more information on SureStart, go to: [HP SureStart Whitelisting and Intrusion Detection Troubleshooting Manual](#) (Doc ID: c04863614).

33.06.01

The firmware is not able to detect the correct memory chip on the formatter.

This issue occurs because the wrong formatter was installed in the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Remove the formatter that was installed and reinstall the original or order the correct formatter for the printer.
3. Reinstall all the parts including HDD/eMMC, TPM and any additional accessories.
4. Reload firmware from a USB stick using the pre-boot menu if necessary.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

40.WX.YZ error messages

40.* errors

Errors in the 40.* family are related to input/output accessories, such as USB storage devices, Jetdirect cards, or EIO cards or on-board network functions.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Touch the **OK** button to clear the error.
2. Remove and then reinstall the accessory.

40 . 00 . 01 USB I/O buffer overflow To continue, touch “OK”

The USB buffer has overflowed.

Recommended action

1. Touch the **OK** button to print the transferred data (some data might be lost).
2. Check the host configuration.

40 . 00 . 02 Embedded I/O buffer overflow To continue, touch “OK”

The product has experienced a JetDirect buffer overflow.

Recommended action

1. Touch the **OK** button to print the transferred data (some data might be lost).
2. Check the host configuration.

40 . 00 . 03 EIO [x] buffer overflow To continue, touch “OK”

Too much data was sent to the EIO card in the specified slot (x). An incorrect communications protocol might be in use.

Recommended action

- Touch the **OK** button to print the transferred data (some data might be lost).

40 . 00 . 04 EIO [x] bad transmission To continue, touch “OK”

The connection between the product and the USB device has been broken.

Recommended action

1. Touch the **OK** button to clear the error message and continue printing.
2. Remove, and then reinstall the USB device.

40 . 00 . 05 Embedded I/O bad transmission To continue, touch OK

The USB device has been removed.

Recommended action

1. Touch the **OK** button to clear the error message (data will be lost).
2. Install the USB device.

40 . 08 . 0x USB storage accessory removed

The USB storage accessory has been removed.

x = 0 or 1; information code.

Secure file erase is enabled.

Recommended action

See recommended action.

- No action necessary.

40 . 0x . 05 USB storage accessory removed

The USB storage accessory was removed.

x = 1, 2, 3, 5, or 6; information code.

Recommended action

See recommended action.

- No action necessary.

40 . 80 . 04 Failed to read NVRAM

Cannot read contract-requested value from NVRAM

Either the value was not populated or NVRAM was unreadable

Recommended action

- Turn the printer off, and then on.

41.WX.YZ error messages

41.01.YZ

Event log error message: 41.01.YZ.

An unknown misprint error occurred on the printer.

Y = Type, Z = Tray

- Y = 0: Photo Paper (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light Paper 1, 2, or 3 mode
- Y = 4: Heavy Paper 1
- Y = 5: Heavy Paper 2
- Y = 6: Heavy Paper 3
- Y = 7: Glossy Paper 1
- Y = 8: Glossy Paper 2
- Y = 9: Glossy Paper 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode
- Z = 0: From unknown tray
- Z = 1: From Tray 1
- Z = 2: From Tray 2
- Z = 3: From Tray 3
- Z = 4: From Tray 4
- Z = 5: From Tray 5
- Z = 6: From Tray 6

- Z = 7: From Tray 7
- Z = 8: From Tray 8
- Z = 9: From Tray 9
- Z = D: From duplex

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to clear the error.
2. If the error is not cleared, turn the printer off, and then on.
3. If the error persists, re-seat the toner cartridge.



IMPORTANT: Ensure that the printer is using genuine HP supplies.

- a. Open the front door.
- b. Grasp the handle of the toner cartridge and pull it out to remove it.
- c. Check if genuine HP toner cartridges are installed.

A genuine HP toner cartridge has the word “HP” on it, or has the HP logo on it. For more information on identifying HP cartridges, go to <http://www.hp.com/go/learnaboutsupplies>.

- d. Align the toner cartridge with its slot, and then insert the toner cartridge into the printer.
 - e. Close the front door.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. If the error does not clear, turn off the printer, and then turn on the printer.
3. If the error persists, re-seat the toner cartridge. Ensure that the printer is using genuine HP supplies.
 - a. Open the front door.
 - b. Grasp the handle of the toner cartridge and pull it out to remove it.
 - c. Check if genuine HP toner cartridges are installed.
 - d. Align the toner cartridge with its slot, and then insert the toner cartridge into the printer.
 - e. Close the front door.

4. If the error persists, replace the laser scanner assembly.

Table 6-92 Laser scanner assembly part number

Part description	Part number
Laser scanner assembly	RM2-1237-000CN

For instructions: *Removal and replacement: Laser/scanner* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. Touch **OK** to use another tray.
3. If the error does not clear, turn off the printer, and then turn on the printer.
4. If the error persists, re-seat the toner cartridge. Ensure that the printer is using genuine HP supplies.
 - a. Open the front door.
 - b. Grasp the handle of the toner cartridge and pull it out to remove it.
 - c. Check if genuine HP toner cartridges are installed.
 - d. Align the toner cartridge with its slot, and then insert the toner cartridge into the printer.
 - e. Close the front door.
5. If the error persists, verify that the toner cartridges high-voltage contacts are clean and not damaged.
6. If the error persists, check the wire harness from the laser scanner assembly to the DC controller is seated correctly.
7. If the error persists, replace the laser scanner assembly.

Table 6-93 Laser scanner assembly part number

Part description	Part number
Laser scanner assembly	RM2-1237-000CN

For instructions: *Removal and replacement: Laser/scanner* See the Repair Service Manual for this product.

8. If the error persists, replace the DC controller.

Table 6-94 DC controller assembly part number

Part description	Part number
DC controller PC board assembly For products: M652/M653	RM3-7030-000CN
DC controller PC board assembly For products: M681/M682	RM3-7031-000CN

For instructions: *Removal and replacement: DC controller PCA* See the Repair Service Manual for this product.

41.02.00 Error

A beam detected misprint error occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to clear the error.
2. If the error is not cleared, turn the printer off, and then on.
3. If the error persists, re-seat the toner cartridge.



IMPORTANT: Ensure that the printer is using genuine HP supplies.

- a. Open the front door.
- b. Grasp the handle of the toner cartridge and pull it out to remove it.
- c. Check if genuine HP toner cartridges are installed.

A genuine HP toner cartridge has the word “HP” on it, or has the HP logo on it. For more information on identifying HP cartridges, go to <http://www.hp.com/go/learnaboutsupplies>.

- d. Align the toner cartridge with its slot, and then insert the toner cartridge into the printer.
 - e. Close the front door.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. To clear the error message, touch **OK**.
2. If the error persists, turn the printer off, and then on.
3. If the error returns, check the wire harness from the laser/scanner to the DC controller.
4. Check the following connectors on DC controller J110 and J123.

5. If the error persists, replace the laser/scanner assembly.

Part number: RM2-1237-000CN

For instructions: *Removal and replacement: Laser/scanner* See the Repair Service Manual for this product.

41 . 03 . FZ Unknown Misprint Error

This is a general misprint error. Either the paper is loaded off-center with the guides in the tray, or a paper width sensor failure occurred from an unknown tray.

The error will be one of the following:

- 41 . 03 . F0
- 41 . 03 . F1
- 41 . 03 . F2
- 41 . 03 . F3
- 41 . 03 . F4
- 41 . 03 . F5
- 41 . 03 . FD

Recommended action for customers

1. Remove the paper the tray.
2. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray.
3. Reload the paper in the tray and ensure that the tray is not over filled above the fill mark or over the tab on the tray.
4. Print a [Configuration Page](#) and note the paper size for the tray in question to ensure that it is reading what the paper guides were set to.

If it does not read the correct size paper try resetting the paper tray guides.

5. Print a test job to see if the issue persists.
6. If the error is not cleared, turn the printer off, and then on.
7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Remove the paper and the reload the tray. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

2. Try the print job again. Watch the paper tray feed mechanism to see if it is functioning correctly. If the linkage is broken, replace the paper tray.

Table 6-95 Part numbers

Tray	Part number
Cassette tray 2	RM2-6618-000CN
550 sheet paper feeder tray 3	RM2-6935-000CN
550 sheet feeder/stand, 3X550, and 2550 HCl tray 3	RM2-1219-000CN
3X550 tray 4 and 5	RM2-1231-000CN
2550 HCl tray 4	RM2-1220-000CN

3. If the error persists, print a Configuration Page and note the paper size for the tray in question.
4. If the size is not reported correctly, run the tray size sensor test in the **Diagnostic** menu. If the tray size sensors test as **GOOD**, replace the paper tray.

Table 6-96 Part numbers

Tray	Part number
Cassette tray 2	RM2-6618-000CN
550 sheet paper feeder tray 3	RM2-6935-000CN
550 sheet feeder/stand, 3X550, and 2550 HCl tray 3	RM2-1219-000CN
3X550 tray 4 and 5	RM2-1231-000CN
2550 HCl tray 4	RM2-1220-000CN

5. If the tray size sensors test as **BAD**, check the cable connections between the tray size sensor and the DC controller. If the cable connections are plugged in correctly and the cables are not damaged, replace the correct component that contains the tray size sensing switches.

Table 6-97 Part numbers

Tray	Size sensor part number	Replacement instructions
550 sheet paper feeder tray 3	RM2-5147-000CN	<i>Removal and replacement: Size detect switch, 550-sheet feeder</i> See the Repair Service Manual for this product.
550 sheet feeder with stand	RM2-0857-000CN	<i>Removal and replacement: Size sensor, 1x550 sheet feeder with stand</i> See the Repair Service Manual for this product.
3x550 with stand (all trays)	RM2-0857-000CN	<i>Removal and replacement: Size sensor, 3x550-sheet feeder with stand</i> See the Repair Service Manual for this product.
2500 HCl tray 3	RM2-0857-000CN	<i>Removal and replacement: Size sensor, 2500-sheet feeder tray 3</i> See the Repair Service Manual for this product.

Table 6-97 Part numbers (continued)

Tray	Size sensor part number	Replacement instructions
2500 HCI tray 4	RM2-0918-000CN	<i>Removal and replacement: Size sensor, 2500-sheet feeder tray 4</i> See the Repair Service Manual for this product.

41 . 03 . YZ Unexpected size in tray <X>

The printer detected a different paper size than expected.

If using adhesive or self-sealing media, please see the instructions in *A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper* (ish_3199741-3199797-16).

Y = Type, Z = Tray

- Y = 0 Size mismatch. Detected paper is longer or shorter than expected.
- Y = A Size mismatch. Detected paper too long.
- Y = B Size mismatch. Detected paper too short.
- Y = C Size mismatch. Inter-page gap error.
- Y = D Size mismatch. Detected paper narrower than expected.
- Y = E Size mismatch. Detected paper wider than expected.
- Z = D Source is the duplexer.
- Z = E Source is the envelope feeder.
- Z = 1 Source is Tray 1.
- Z = 2 Source is Tray 2.
- Z = 3 Source is Tray 3.
- Z = 4 Source is Tray 4.
- Z = 5 Source is Tray 5.

Recommended action for customers

1. Touch **OK** to use another tray.
2. Print a configuration page to verify the size and type the trays are set to.
3. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
4. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
5. If the error is not cleared, turn the printer off, and then on.

6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Touch **OK** to use another tray.
2. Print a configuration page to verify the size and type the trays are set to.
3. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
4. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
5. Use the manual sensor test to verify that the cassette paper switch is functioning correctly.
6. Check paper path sensors SR11 registration sensor and SR8611/8613 fuser delivery sensor for correct operation and that they do not stick at all.
7. Perform a paper path sensor test. This will toggle the paper sensors and check for proper movement, and that no sensors are binding. If a sensor is damaged replace the corresponding part.

Registration unit part number: RM2-1957-000CN

For instructions: *Removal and replacement: Registration assembly* See the Repair Service Manual for this product.

Fuser Kit 110v part number: RM2-1928-000CN

Fuser Kit 220v part number: RM2-1929-000CN

For instructions: *Removal and replacement: Fuser*

41.04.yz Printer Error

An unknown misprint error occurred on the printer.

Y = Type, Z = Tray

- Y = 0: Photo Paper (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light Paper 1, 2, or 3 mode
- Y = 4: Heavy Paper 1
- Y = 5: Heavy Paper 2
- Y = 6: Heavy Paper 3
- Y = 7: Glossy Paper 1
- Y = 8: Glossy Paper 2
- Y = 9: Glossy Paper 3

- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode
- Z = D: Source is the duplexer.
- Z = 0: Source is the envelope feeder.
- Z = 1: Source is Tray 1.
- Z = 2: Source is Tray 2.
- Z = 3: Source is Tray 3.
- Z = 4: Source is Tray 4.
- Z = 5: Source is Tray 5.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to clear the error.
2. Touch **OK** to use another tray.
3. If the error does not clear, turn the printer off, and then on.
4. If the error persists, re-seat each toner cartridge, and verify it is an original HP supply.
 - a. Open the front door.
 - b. Grasp the handle of the toner cartridge and pull it out to remove it.
 - c. Check if genuine HP toner cartridges are installed.
 - d. Align the toner cartridge with its slot, and then insert the toner cartridge into the printer.
 - e. Close the front door.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. If the error does not clear, turn off the printer, and then turn on the printer.
3. If the error persists, re-seat the toner cartridge. Ensure that the printer is using genuine HP supplies.

- a. Open the front door.
 - b. Grasp the handle of the toner cartridge and pull it out to remove it.
 - c. Check if genuine HP toner cartridges are installed.
 - d. Align the toner cartridge with its slot, and then insert the toner cartridge into the printer.
 - e. Close the front door.
4. If the error persists, replace the laser scanner assembly.

Table 6-98 Laser scanner assembly part number

Part description	Part number
Laser scanner assembly	RM2-1237-000CN

For instructions: *Removal and replacement: Laser/scanner* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. If the error does not clear, turn off the printer, and then turn on the printer.
3. If the error persists, re-seat the toner cartridge. Ensure that the printer is using genuine HP supplies.
 - a. Open the front door.
 - b. Grasp the handle of the toner cartridge and pull it out to remove it.
 - c. Check if genuine HP toner cartridges are installed.
 - d. Align the toner cartridge with its slot, and then insert the toner cartridge into the printer.
 - e. Close the front door.
4. If the error persists, verify that the toner cartridges high-voltage contacts are clean and not damaged.
5. If the error persists, check the wire harness from the laser scanner assembly to the DC controller is seated correctly.
6. If the error persists, replace the laser scanner assembly.

Table 6-99 Laser scanner assembly part number

Part description	Part number
Laser scanner assembly	RM2-1237-000CN

For instructions: *Removal and replacement: Laser/scanner* See the Repair Service Manual for this product.

7. If the error persists, replace the DC controller.

Table 6-100 DC controller assembly part number

Part description	Part number
DC controller PC board assembly	RM3-7030-000CN
For products: M652/M653	
DC controller PC board assembly	RM3-7031-000CN
For products: M681/M682	

For instructions: *Removal and replacement: DC controller PCA* See the Repair Service Manual for this product.

41 . 05 . yz Unexpected type in tray <X>

The printer can detect the type of paper in the paper path, and it adjusts the print mode accordingly.

The printer uses two types of paper sensors:

- **Reflection:** Detects the glossiness of the paper.
- **Transmission:** Detects the thickness of the paper.

Tray X is loaded with a paper type (transparencies, envelopes, etc.) that is different than what the tray is configured to use.

Y = Expected type, Z = Detected type

- Y = 0: Photo Paper (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light Paper 1, 2, or 3 mode
- Y = 4: Heavy Paper 1
- Y = 5: Heavy Paper 2
- Y = 6: Heavy Paper 3
- Y = 7: Glossy Paper 1
- Y = 8: Glossy Paper 2
- Y = 9: Glossy Paper 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode

- Y = E: Rough
- Y = F: Other mode
- Z = 0: Photo Paper (1, 2, or 3)
- Z = 1: Auto Sense (Normal)
- Z = 2: Normal (typed not from Auto Sense)
- Z = 3: Light Paper 1, 2, or 3 mode
- Z = 4: Heavy Paper 1
- Z = 5: Heavy Paper 2
- Z = 6: Heavy Paper 3
- Z = 7: Glossy Paper 1
- Z = 8: Glossy Paper 2
- Z = 9: Glossy Paper 3
- Z = A: Glossy film
- Z = B: OHT
- Z = C: Label
- Z = D: Envelope 1, 2, or 3 mode
- Z = E: Rough
- Z = F: Other mode

Recommended action

1. Load the tray with the size and type of paper indicated, or use another tray if available.
2. If this message displays and the tray is loaded with the correct paper type, check the print driver settings to ensure they match the tray type settings on the printer.
3. Check all application and printer settings to ensure that the **Type** setting is correct.

41 . 07 . 72 Printer Error

Optional input source delay. Heavy media 3 (whether typed or from Auto Sense). From Tray 2.

Recommended action

1. To clear the message, touch the [OK](#) button.
2. Open tray 2 and remove any jammed, or misfed media.
3. Check the type of paper being used for printing. Typically, this error will only happen with heavier media such as Heavy Glossy mode. Ensure media is within paper weight specifications.
4. Ensure the paper type is set to the correct setting in the [General Settings](#) (or [Settings](#)) > [Print Quality](#) > [Adjust Paper Types](#) menu.

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

41 . WX . YZ Error To continue, touch “OK”

A printer error has occurred.

WX = error type

Y = fuser mode

Z = input tray

- WX = 02: Beam detect misprint
- WX = 09: Sub thermistor abnormally high
- WX = 10: Pickup failure.
- WX = 11: Illegal Duplex.
- WX = 18: Scan line inclination adjustment
- WX = 20: Image drum HV
- Y = 0: Photo Paper (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light Paper 1, 2, or 3 mode
- Y = 4: Heavy Paper 1
- Y = 5: Heavy Paper 2
- Y = 6: Heavy Paper 3
- Y = 7: Glossy Paper 1
- Y = 8: Glossy Paper 2
- Y = 9: Glossy Paper 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode
- Z = 0 Envelope feeder
- Z = 1 Tray 1

- Z = 2 Tray 2
- Z = 3 Tray 3
- Z = 4 Tray 4
- Z = 5 Tray 5
- Z = 6 Tray 6
- Z = D Duplexer

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to clear the error.
2. If the message displays again, turn the printer off, and then on.
3. If the error persists, remove each toner cartridge from the printer, and verify it is an original HP supply.
 - a. Open the front door.
 - b. Grasp the handle of the toner cartridge and pull it out to remove it.
 - c. Check if genuine HP toner cartridges are installed.



NOTE: Replace any non-HP toner cartridge with a genuine HP toner cartridge.

- d. Align the toner cartridge with its slot, and then insert the toner cartridge into the printer.
 - e. Close the front door.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. If the message displays again, turn the printer off, and then on.
3. Remove each toner cartridge from the printer and verify it is an HP original supply.
4. Replace any toner cartridge with a genuine HP toner cartridge for testing purposes.
5. If the issue persists when genuine HP supplies are installed, select the **Disable Cartridge Check** option from the control panel.
 -
 - Follow these steps to disable the cartridge check from a touchscreen control panel:
 - a. From the Home screen on the printer control panel, scroll to select **Support Tools**.
 - b. Open the **Troubleshooting** menu, and then select the **Diagnostic Tests** menu.

- c. Select the [Disable Cartridge Check](#).
- Follow these steps to disable the cartridge check from a non-touchscreen control panel:
 - a. From the Home screen on the printer control panel, use the arrow keys to select [Support Tools](#), and then press the [OK](#) button.
 - b. Use the arrow buttons to scroll to the [Troubleshooting](#) menu, and then press the [OK](#) button.
 - c. Use the arrow buttons to scroll to the [Diagnostic Tests](#) menu, and then press the [OK](#) button.
 - d. Use the arrow buttons to scroll to the [Disable Cartridge Check](#) menu, and then press the [OK](#) button.
- 6. Perform a disable cartridge check from the control panel.
 - a. In the [Disable Cartridge Check](#) mode, remove all toner cartridges.
 - b. Install one cartridge at a time.
 - c. If an error occurs after a specific cartridge installation, insert the cartridge in a different slot. Check if the error persists when the cartridge is inserted in a different slot.
 - d. If the error persists, replace the toner cartridge.
- 7. If the error persists, replace the laser scanner assembly.

Table 6-101 Laser scanner assembly part number

Part description	Part number
Laser scanner assembly	RM2-1237-000CN

For instructions: *Removal and replacement: Laser/scanner* See the Repair Service Manual for this product.


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch [OK](#) to clear the error.
 2. If the message displays again, turn the printer off, and then on.
 3. Remove each toner cartridge from the printer and verify it is an HP original supply.
 4. Replace any toner cartridge with a genuine HP toner cartridge for testing purposes.
 5. If the issue persists when genuine HP supplies are installed, select the [Disable Cartridge Check](#) option from the control panel.
-
- Follow these steps to disable the cartridge check from a touchscreen control panel:
 - a. From the Home screen on the printer control panel, scroll to select [Support Tools](#).
 - b. Open the [Troubleshooting](#) menu, and then select the [Diagnostic Tests](#) menu.

- c. Select the [Disable Cartridge Check](#).
- Follow these steps to disable the cartridge check from a non-touchscreen control panel:
 - a. From the Home screen on the printer control panel, use the arrow keys to select [Support Tools](#), and then press the [OK](#) button.
 - b. Use the arrow buttons to scroll to the [Troubleshooting](#) menu, and then press the [OK](#) button.
 - c. Use the arrow buttons to scroll to the [Diagnostic Tests](#) menu, and then press the [OK](#) button.
 - d. Use the arrow buttons to scroll to the [Disable Cartridge Check](#) menu, and then press the [OK](#) button.
- 6. Perform a disable cartridge check from the control panel.
 - a. In the [Disable Cartridge Check](#) mode, remove all toner cartridges.
 - b. Install one cartridge at a time.
 - c. If an error occurs after a specific cartridge installation, insert the cartridge in a different slot. Check if the error persists when the cartridge is inserted in a different slot.
 - d. If the error persists, replace the toner cartridge.
- 7. If the error persists, reseal the laser scanner and HVPS connectors on the DC controller.
 - a. Use the power button to turn off the printer.
 - b. Disconnect and reconnect the following connectors on the DC controller PCA:
 - Laser scanner assembly connectors: J110
 - High-voltage power supply connectors: J112, J113, and J114
 - c. Turn on the printer.

Figure 6-149 Laser scanner (J110) and HVPS (J112, J113, and J114) connectors on the DC Controller

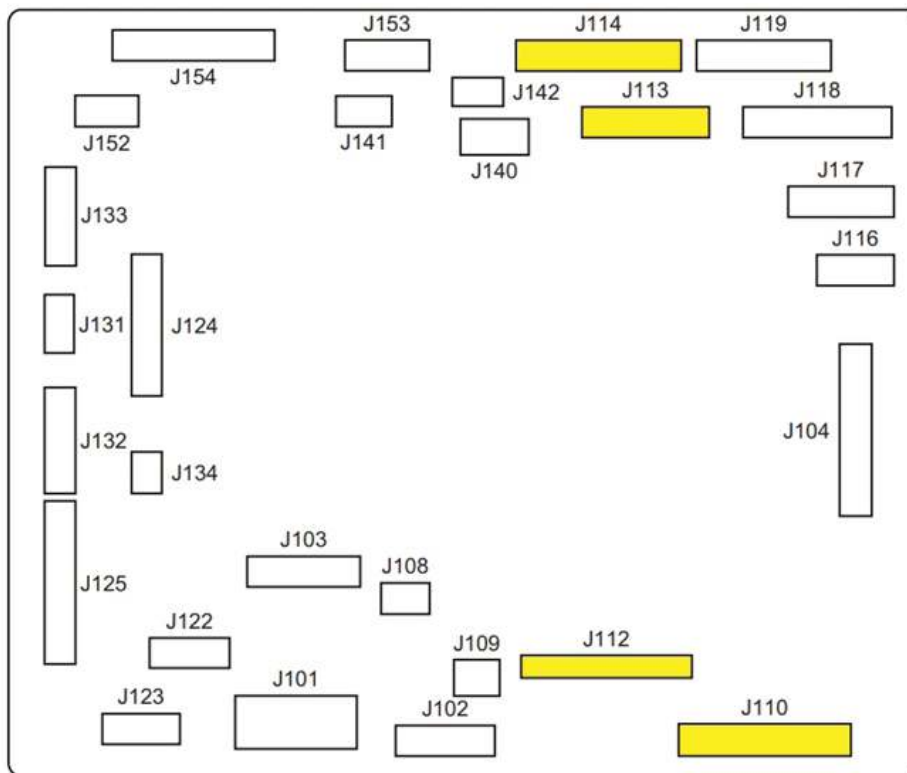

8. If the error persists, replace the laser scanner assembly.

Table 6-102 Laser scanner assembly part number

Part description	Part number
Laser scanner assembly	RM2-1237-000CN

For instructions: *Removal and replacement: Laser/scanner* See the Repair Service Manual for this product.

9. If the error persists, replace the DC controller.

Table 6-103 DC controller assembly part number

Part description	Part number
DC controller PC board assembly	RM3-7030-000CN
For products: M652/M653	
DC controller PC board assembly	RM3-7031-000CN
For products: M681/M682	

For instructions: *Removal and replacement: DC controller PCA* See the Repair Service Manual for this product.

10. If the error persists, elevate the case as per your region's escalation process.

42.WX.YZ error messages

42.* errors

Errors in the 42.* family indicate an internal system failure has occurred.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on. Retry the job.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on. Retry the job.
2. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

44.WX.YZ error messages

44.* errors

Errors in the 44.* family are related to the digital send functionality: fax, email, send to SharePoint, or save to folder.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. In many cases, the error will automatically clear, and you can try the job again.
2. Verify the digital send feature has been correctly configured at the control panel and with the HP Embedded Web Server (EWS).



NOTE: To access the EWS, open a Web browser, and in the address line, enter the printer IP address.

3. Turn the printer off, and then on. Retry the job.
4. For fax errors, verify the fax card is correctly installed on the formatter.
5. For SharePoint or save-to-folder errors, verify the permissions are set correctly for access to the SharePoint or network folder.

6. For email errors, verify connectivity to the network, and verify the SMTP gateway is configured correctly. Also verify if there is a size limit on email attachments.
7. If the error persists, reset the printer to factory settings, and then upgrade the firmware to the latest version.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

44 . 01 . xx Error Event log message

A digital send error has occurred.

Recommended action

1. No action necessary. This error message should automatically clear.
2. Try to send the job again.
3. If the error does not clear or it returns:
 - a. Use optimal resolution and image quality settings.
 - b. Wait until all the digital send jobs have been processed.
 - c. Turn the printer off, and then on. Retry the job.
 - d. Verify if there is an attachment limit on the email.
 - e. Verify network connectivity, SMTP gateways, access to folder share.

44 . 03 . xx Error Event log message

A digital send error has occurred.

Recommended action for customers

- Try to send the job again.

Recommended action

1. Use optimal resolution and image quality settings.
2. Wait until all the digital send jobs have been processed.
3. Turn the printer off, and then on and retry the job.
4. Verify if there is an attachment limit on the email.
5. Verify network connectivity, SMTP gateways, access to folder share.

44 . 10 . xx Error Event log message (*Multifunction product only*)

A send to email error has occurred.

Recommended action

1. Try to send the job again.

2. Check the digital send configuration.

For more information, Go to: [Or click here: HP LaserJet Enterprise MFP - Set up Scan to Email.](#)

44 . 34 . xx Error Event log message

A fax error has occurred.

Recommended action

1. Try to send the job again.
2. Check the fax settings to make sure they are set to the proper settings for the environment.
3. If the issue persists, for additional fax troubleshooting information go to [HP LaserJet Enterprise MFP, HP PageWide Enterprise MFP - Checklist for solving fax problems.](#)

44 . 34 . 03 Fax Modem Failure

Digital Send error. Fax result modem fail.

Recommended action

1. Turn the printer off.
2. Verify the fax card is correctly installed on the formatter. Ensure that the fax card is aligned with slot on the formatter chassis and is firmly seated against the formatter board.
3. Turn the printer on.
4. If the issue persists, replace the fax kit.

Part number: CC522-67929

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Fax Kit* See the Repair Service Manual for this product.

44 . 34 . E5 Fax Modem Failure

A fax error has occurred.

Recommended action

1. Turn the printer off.
2. Verify the fax card is correctly installed on the formatter. Ensure that the fax card is aligned with slot on the formatter chassis and is firmly seated against the formatter board.
3. If the issue persists, download and reinstall the firmware.
4. If the issue persists, perform a Partial Clean:
 - a. Turn the printer off, and then on.
 - b. The HP logo displays on the printer control panel. When a "1/8" with an underscore displays below the HP logo, touch the logo to open the [Pre-boot](#) menu.
 - c. Use the arrow buttons on the touchscreen to navigate the pre-boot menu.

- d. Use the down arrow to highlight **Partial Clean**, and then touch the **OK** button.
- e. Touch the **OK** button again.
- f. Touch the Back button to highlight **Continue**, and then touch the **OK** button.

The printer will continue to boot to **Ready**.

- 5. If the issue persists, replace the fax kit.

Service part number: CC522-67929

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Fax Kit* See the Repair Service Manual for this product.

44 . 90 . xx, 44 . 91 . xx, 44 . 92 . xx Error Event log message

A fax error has occurred.

Recommended action

- 1. Try to send the job again.
- 2. Check the fax settings to make sure they are set to the proper settings for the environment.
- 3. If the issue persists, for additional fax troubleshooting information go to [HP LaserJet Enterprise MFP, HP PageWide Enterprise MFP - Checklist for solving fax problems](#).

44 . A0 . yz Error Event log message

MFP specific error dealing with the digital send abilities for security (Login/LDAP/SSL)

Recommended action

- 1. Turn the printer off, and then on.
- 2. Try to login or send the job again.
- 3. Ensure all digital sending devices are operational and configured correctly. One or more control panel icons for digital send features may be "grayed out" and marked with an exclamation point: "!"
- 4. Contact the systems administrator.

The system administrator needs to check the Domain Controller certificate and ensure a valid SSL exists in the location on the LDAP server pointed to by the SSL extension in the certificate.

46.WX.YZ error messages

46.* error messages

Errors in the 46.* family occur when the printer is trying to perform an action that it is not able to complete.

- No network connectivity
- A problem with the file being printed, with the software application sending the job, or with the print driver

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Verify the printer is connected to the network, look at the network port connection on the back of the printer, and verify that the amber activity light flashes indicating network traffic, and the green link-status light is continuously lit indicating a network link. If the problem continues, try a different network cable or port on the hub and check network configuration settings such as the printer's IP address.
3. Send a different file from the same software application to see if the error is specific to the original file. Try sending a job from a different software application to see if the error is specific to the application. Verify the computer has the correct print driver installed.
4. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Verify the printer is connected to the network. If it is not, use a different network cable, and check the configuration settings.
3. Send a different file from the same software application to see if the error is specific to the original file. Try sending a job from a different software application to see if the error is specific to the application. Verify the computer has the correct print driver installed.
4. Upgrade the printer firmware.
5. If the error persists, use the troubleshooting flowcharts in this document: [HP LaserJet FutureSmart Devices - 49 error Troubleshooting \(Persistent and Intermittent\)](#)

46.21.52

Copy Processor board communication error. (Event Log Only)

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, reload the most current version of firmware. The fix is included in firmware version 4.5.6 or newer.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

47.WX.YZ error messages

47.* errors

Errors in the 47.* family indicate an internal error has occurred.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.00.xx

Back channel internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.

3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.01.xx

Image transformer internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the **Format Disk** item in the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.02.xx

Job parser internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.

3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.03.xx

Print job internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.04.xx

Print spooler 9100 internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.

3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.05.xx

Print spooler framework internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.06.xx

Print application internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.

3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47 . FC . yz Printer Calibration Failed To continue, touch "OK"

The device is unable to access or implement one of the image patterns files.

y = Calibration type, z = Event

- 47.FC.00 (event code) Color plane registration (CPR) Image not found at system initialization
- 47.FC.01 (event code) CPR Store Image failure
- 47.FC.02 (event code) CPR Image not found
- 47.FC.03 (event code) CPR Print engine execution failure
- 47.FC.10 (event code) Consecutive Dmax Dhalf Image not found at system initialization
- 47.FC.11 (event code) Consecutive Dmax Dhalf Store image failure
- 47.FC.12 (event code) Consecutive Dmax Dhalf Image not found
- 47.FC.13 (event code) Consecutive Dmax Dhalf Print engine execution failure
- 47.FC.20 (event code) Error Diffusion Image not found at system initialization
- 47.FC.21 (event code) Error Diffusion Store image failure
- 47.FC.22 (event code) Error Diffusion Image not found
- 47.FC.23 Error Diffusion Print engine execution failure
- 47.FC.30 0 (event code) Drum Speed Adjustment Image not found at system initialization
- 47.FC.31 (event code) Drum Speed Adjustment Store image failure
- 47.FC.32 (event code) Drum Speed Adjustment Image not found
- 47.FC.33 (event code) Drum Speed Adjustment Print engine execution failure
- 47.FC.40 (event code) Pulse Width Modulation Image not found at system initialization
- 47.FC.41 (event code) Pulse Width Modulation Store image failure
- 47.FC.42 (event code) Pulse Width Modulation Image not found
- 47.FC.43 (event code) Pulse Width Modulation Print engine execution failure

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the product off, and then on again.

2. If the error persists, reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the product off, and then on again.
2. If the error persists over multiple power cycles, then do the following.
 - In the [Support Tools/Troubleshooting/Diagnostics](#) menu, run the hard disk tests to validate the health of the device. Fix any issue found with the mass storage device.
3. If the error persists, reload the firmware.
4. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the procedure to perform a Format Disk procedure, go to: [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#) (c03398779).

48.WX.YZ error messages

48.* errors

Errors in the 48.* family indicate an internal error has occurred.

Recommended action for customers

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. In most cases, no action is necessary.
2. If the error persists, upgrade the printer firmware.
3. If the error persists, use the troubleshooting flowcharts in this document: [HP LaserJet FutureSmart Devices - 49 Error Troubleshooting \(Persistent and Intermittent\)](#)



NOTE: 48.wx.yz are similar to 49.wx.yz errors and use the same troubleshooting steps and procedures.

49.WX.YZ error messages

49 . xx . yy Error To continue turn off then on

A firmware error occurred.

Possible causes:

- Corrupted print jobs
- Software application issues
- Non-product specific print drivers
- Poor quality USB or network cables
- Bad network connections or incorrect configurations
- Invalid firmware operations
- Unsupported accessories

A 49 error might happen at any time for multiple reasons. Although some types of 49 errors can be caused by hardware failures, it is more common for 49 errors to be caused by printing a specific document or performing some task on the printer.

49 errors most often occur when a printer is asked to perform an action that the printer firmware is not capable of and might not have been designed to comply with, such as:

- Printing files with unsupported programming commands
- A unique combination of user environment and user interactions with the printer
- Interfacing with a third-party solution that was not designed to work with the printer
- Specific timing, network traffic, or concurrent processing of jobs

Recommended action for customers



NOTE: LaserJet formatter PCAs are rarely the root cause of 49 service errors. Please do not replace the formatter unless troubleshooting has identified the formatter as the root cause.

1. Turn the printer off, and then on.
2. If the error persists, check the following:
 - The error might be caused by a network connectivity problem, such as a bad USB or network interface cable, a bad USB port, or an invalid network configuration setting.
 - The error might be caused by the print job, due to an invalid print driver, a problem with the software application, or a problem with the file being printed.
 - Upgrading the printer firmware might help resolve the error.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians



NOTE: LaserJet formatter PCAs are rarely the root cause of 49 service errors. Please do not replace the formatter unless troubleshooting has identified the formatter as the root cause.

1. Turn the printer off, and then on.
2. If the error persists, check the following:
 - The error might be caused by a network connectivity problem, such as a bad interface cable, a bad USB port, or an invalid network configuration setting.
 - The error might be caused by the print job, due to an invalid print driver, a problem with the software application, or a problem with the file being printed.
 - Upgrading the printer firmware might help resolve the error.
3. If the error persists, continue troubleshooting with the flowcharts for either Intermittent or Persistent 49 error troubleshooting (whichever is appropriate) in document c03122817:

[HP LaserJet FutureSmart Devices - 49 Error Troubleshooting \(Persistent and Intermittent\)](#)

49.21.52

Jetlink unrecognized speed.

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, reload the most current version of firmware. The fix is included in firmware version 4.5.6 or newer.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

49.38.07

Generic error.

This issue is caused by a formatter replacement that has not had the correct parameters set at the factory. This issue is tied to the factory installed Trusted Platform Module (TPM).



NOTE: For additional information, go to WISE and search for this document: HP LaserJet Enterprise, HP LaserJet Managed - 49.38.07 error after replacing the formatter (Emerging Issue) (c06621339).

Or click on the following link: [HP LaserJet Enterprise, HP LaserJet Managed - 49.38.07 error after replacing the formatter \(Emerging Issue\)](#)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Ask the technician where the formatter came from and note the answer in the case notes.
2. Turn the printer off, and then on.
3. Confirm that the unit still boots to the same 49.38.07 error.
4. Elevate the case to ATS



NOTE: Never replace the TPM on a unit that shipped with one. The TPM that can be ordered is only available for adding a level of security on a device that never had a TPM paired from the factory. A new TPM cannot be installed for security reasons.

50.WX.YZ error messages

50.* errors

Errors in the 50.* family indicate a problem with the fuser.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and remove the fuser. Check the fuser for damage or obstructions. Reinstall or replace the fuser as needed.



CAUTION: The fuser might be hot.

2. Check the connectors between the fuser and the DC controller and from the fuser to the printer.
3. Replace the fuser. If it has already been replaced, replace the fuser power supply.

50.1X.YZ

Low fuser temperature failure

X = fuser mode, Y = previous printer sleep state, and Z = next printer sleep state.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Remove and reinstall the fuser. ensure that the fuser is seated correctly.



CAUTION: The fuser might be hot.

2. Ensure that there is no residual paper in the fuser.
3. Check the connector between the fuser and the fuser drive assembly. If the fuser connector is damaged, replace the fuser. If the printer side connector is damaged replace the fuser power connector assembly.

Fuser Kit 110v part number: RM2-1928-030CN

Fuser Kit 220v part number: RM2-1929-030CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

50.2X.YZ

Fuser warm-up error

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

2. Ensure that there is no residual paper in the fuser.
3. Check the printer power source. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
4. Check the connector between the fuser and the fuser drive assembly. If the fuser connector is damaged, replace the fuser. If the printer side connector is damaged replace the fuser power connector assembly.

Fuser Kit 110v part number: RM2-1928-030CN

Fuser Kit 220v part number: RM2-1929-030CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

5. Reconnect the connector (J154) on the DC controller PCA.
6. Replace the low-voltage power assembly.

110V part number: RM2-8421-000CN

220V part number: RM2-8422-000CN

For instructions: *Removal and replacement: Low-voltage power supply* See the Repair Service Manual for this product.

50.3X.YZ

High fuser temperature

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.

 **NOTE:** Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.
-
-  **CAUTION:** The fuser might be hot.
-
2. Ensure that there is no residual paper in the fuser.
 3. Check the paper type setting in the printer control panel menus and in the print driver. Ensure that the settings match and are correct for the type of paper being used.
 4. Check the connector between the fuser and the fuser drive assembly. If the fuser connector is damaged, replace the fuser. If the printer side connector is damaged replace the fuser power connector assembly.

Fuser Kit 110v part number: RM2-1928-030CN

Fuser Kit 220v part number: RM2-1929-030CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

5. Reconnect the connector (J154) on the DC controller PCA.
6. Replace the low-voltage power assembly.

110V part number: RM2-8421-000CN

220V part number: RM2-8422-000CN

For instructions: *Removal and replacement: Low-voltage power supply* See the Repair Service Manual for this product.

50.4X.YZ

Drive circuit fault

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

2. Check the printer power source. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.

 **NOTE:** If the printer does not meet the power requirement of 43 to 67Hz frequency, the fuser temperature control does not work correctly and this will cause the error.

3. Reconnect the connector (J208) on the low voltage power supply and (J103) on the DC controller PCA.
4. Replace the low voltage power supply assembly.

110V part number: RM2-8421-000CN

220V part number: RM2-8422-000CN

For instructions: *Removal and replacement: Low-voltage power supply* See the Repair Service Manual for this product.

50 . 6X . YZ

Open fuser circuit (heating element failure)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.

 **NOTE:** Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.

6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

2. Check the connector between the fuser and the fuser drive assembly. If the fuser connector is damaged, replace the fuser. If the printer side connector is damaged replace the fuser power connector assembly.

Fuser Kit 110v part number: RM2-1928-030CN

Fuser Kit 220v part number: RM2-1929-030CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

3. If the error persists, replace the fuser.

Fuser Kit 110v part number: RM2-1928-030CN

Fuser Kit 220v part number: RM2-1929-030CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

50.7X.YZ

Fuser pressure-release mechanism failure

Specific Errors:

- 50.71.14 Pressure Release Failure
- 50.7F.00 Pressure Release Failure



NOTE: Auto-navigation instructions on the control panel are incorrect.

Recommended action for customers

1. Turn the printer off and wait 30 seconds.
2. Remove and check for any jammed media or damage to the fuser.

 **CAUTION:** The fuser might be hot.

3. Reinsert the fuser and ensure its fully seated.
4. Turn the printer on.
5. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

1. Turn the printer off and wait 30 seconds.
2. Remove and check for any jammed media or damage to the fuser.

 **CAUTION:** The fuser might be hot.

3. Reinsert the fuser and ensure its fully seated.
4. Turn the printer on.
5. Replace the fuser.

Fuser Kit 110v part number: RM2-1928-030CN

Fuser Kit 220v part number: RM2-1929-030CN

Recommended action for onsite technicians

1. Turn the printer off and wait 30 seconds.
2. Remove and check for any jammed media or damage to the fuser.

 **CAUTION:** The fuser might be hot.

3. Check the connector between the fuser and the fuser drive assembly. If the fuser connector is damaged, replace the fuser. If the printer side connector is damaged replace the fuser power connector assembly.

Fuser Kit 110v part number: RM2-1928-030CN

Fuser Kit 220v part number: RM2-1929-030CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

4. Reinsert the fuser and ensure its fully seated.
5. Turn the printer on.
6. Run the fuser pressure release roller test in the diagnostic menu. If the test passes replace the fuser, if it fails replace the fuser drive assembly.

Fuser Kit 110v part number: RM2-1928-030CN

Fuser Kit 220v part number: RM2-1929-030CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

Part number: RM2-1934-000CN

For instructions: *Removal and replacement: Fuser drive assembly* See the Repair Service Manual for this product.

50.8X.YZ

Low fuser temperature 2

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.

 **NOTE:** Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.
2. Ensure that there is no residual paper in the fuser.
3. Check the connector between the fuser and the fuser drive assembly. If the fuser connector is damaged, replace the fuser. If the printer side connector is damaged replace the fuser power connector assembly.

Fuser Kit 110v part number: RM2-1928-030CN
Fuser Kit 220v part number: RM2-1929-030CN
For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.
4. If the error persists, replace the fuser.

Fuser Kit 110v part number: RM2-1928-030CN
Fuser Kit 220v part number: RM2-1929-030CN
For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

50 . 9X . YZ

High fuser temperature 2

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.

6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

2. Ensure that there is no residual paper in the fuser.
3. Check the paper type setting in the printer control panel menus and in the print driver. Ensure that the settings match and are correct for the type of paper being used.
4. Check the connector between the fuser and the fuser drive assembly. If the fuser connector is damaged, replace the fuser. If the printer side connector is damaged replace the fuser power connector assembly.

Fuser Kit 110v part number: RM2-1928-030CN

Fuser Kit 220v part number: RM2-1929-030CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

5. If the error persists, replace the fuser.

Fuser Kit 110v part number: RM2-1928-030CN

Fuser Kit 220v part number: RM2-1929-030CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

6. Replace the low-voltage power assembly.

110V part number: RM2-8421-000CN

220V part number: RM2-8422-000CN

For instructions: *Removal and replacement: Low-voltage power supply* See the Repair Service Manual for this product.

50 . AX . YZ

Low fuser temperature 3

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.

 **NOTE:** Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.

Check the size and type on the control panel Trays menu or use the EWS Trays menu

4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.
2. Ensure that there is no residual paper in the fuser.
3. Check the connector between the fuser and the fuser drive assembly. If the fuser connector is damaged, replace the fuser. If the printer side connector is damaged replace the fuser power connector assembly.

Fuser Kit 110v part number: RM2-1928-030CN

Fuser Kit 220v part number: RM2-1929-030CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

4. If the error persists, replace the fuser.

Fuser Kit 110v part number: RM2-1928-030CN

Fuser Kit 220v part number: RM2-1929-030CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

50 .BX .YZ

High fuser temperature 3

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

2. Ensure that there is no residual paper in the fuser.
3. Check the paper type setting in the printer control panel menus and in the print driver. Ensure that the settings match and are correct for the type of paper being used.
4. Check the connector between the fuser and the fuser drive assembly. If the fuser connector is damaged, replace the fuser. If the printer side connector is damaged replace the fuser power connector assembly.

Fuser Kit 110v part number: RM2-1928-030CN

Fuser Kit 220v part number: RM2-1929-030CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

5. If the error persists, replace the fuser.

Fuser Kit 110v part number: RM2-1928-030CN

Fuser Kit 220v part number: RM2-1929-030CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

6. Replace the low-voltage power assembly.

110V part number: RM2-8421-000CN

220V part number: RM2-8422-000CN

For instructions: *Removal and replacement: Low-voltage power supply* See the Repair Service Manual for this product.

51.WX.YZ, 52.WX.YZ error messages

51.* errors

Errors in the 51.* family are related to the laser/scanner.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Check all connections on the laser/scanner and from the laser/scanner to the DC controller, and reseal them if necessary.
2. If the error persists, replace the laser/scanner.

52.* errors

Errors in the 52.* family are related to the laser/scanner.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Check all connections on the laser/scanner and from the laser/scanner to the DC controller, and reseal them if necessary.
2. If the error persists, replace the laser/scanner.

51.00.YZ

An error with the laser/scanner assembly has occurred in the printer.

- **51.00.10** Beam detect error
- **51.00.19** Laser malfunction

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Open and close the right and front doors to see if the printer returns to a **Ready** state.
2. Turn the printer off, and then on.
3. Reconnect connector J77 on the laser driver PCA and connector J123 on the DC controller PCA.
4. If the error persists, replace the laser/scanner assembly.

Part number: RM2-1237-000CN

For instructions: *Removal and replacement: Laser/scanner* See the Repair Service Manual for this product.

52.00.00/52.00.20 Scanner Startup/Rotation error

A printer laser/scanner error occurred.

- **52.00.00** laser/scanner startup error.
- **52.00.20** laser/scanner rotation error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Open and close the right and front doors to see if the printer returns to a **Ready** state.
2. Turn the printer off, and then on.
3. Reconnect connector J77 on the laser driver PCA and connector J123 on the DC controller PCA.
4. If the error persists, replace the laser/scanner assembly.

Part number: RM2-1237-000CN

For instructions: *Removal and replacement: Laser/scanner* See the Repair Service Manual for this product.

53.wx.yz error messages

53.A0.y0

Tray "Y" side guide misalignment resolved.

The engine detected that the tray guide misalignment has been resolved.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A0.10:** Tray 1 Side guide misalignment resolved.
- **53.A0.20:** Tray 2 side guide misalignment resolved.
- **53.A0.30:** Tray 3 side guide misalignment resolved.
- **53.A0.40:** Tray 4 side guide misalignment resolved.
- **53.A0.50:** Tray 5 side guide misalignment resolved.
- **53.A0.60:** Tray 6 side guide misalignment resolved.

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.A0.y1

Tray "Y" Side guide misalignment proactive warning.

The engine detected a tray "Y" side guide misalignment.

This is a proactive warning intended to avoid a jam event.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A0.11:** Tray 1 side guide misalignment warning.

- **53.A0.21:** Tray 2 side guide misalignment warning.
- **53.A0.31:** Tray 3 side guide misalignment warning.
- **53.A0.41:** Tray 4 side guide misalignment warning.
- **53.A0.51:** Tray 5 side guide misalignment warning.
- **53.A0.61:** Tray 6 side guide misalignment warning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Ensure that the paper size in the tray matches the tray size in the [Trays](#) menu.
2. If the trays are **not** locked, ensure the tray guides are correctly aligned to the size of paper being installed.
3. If the trays are locked, contact your managed print provider if you need to change the paper size from the one selected.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Ask the customer to check the paper size loaded in the tray to see if it matches the size listed in the [Trays](#) menu or on the Configuration Page.
2. If the trays are **not** locked, educate the customer on the correct way to align the side guides when refilling paper in the tray.
3. Instruct the customer to contact the managed print provider if the paper size needs to be changed from the one selected.

53.A1.y0 Enter error message

Tray "Y" paper delivery direction misalignment resolved.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A1.10:** Tray 1 Side guide misalignment resolved.
- **53.A1.20:** Tray 2 side guide misalignment resolved.
- **53.A1.30:** Tray 3 side guide misalignment resolved.
- **53.A1.40:** Tray 4 side guide misalignment resolved.
- **53.A1.50:** Tray 5 side guide misalignment resolved.
- **53.A1.60:** Tray 6 side guide misalignment resolved.

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.A1.y1

Tray "Y" paper delivery direction misalignment warning.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A1.11:** Tray 1 paper delivery direction misalignment warning.
- **53.A1.21:** Tray 2 paper delivery direction misalignment warning.
- **53.A1.31:** Tray 3 paper delivery direction misalignment warning.
- **53.A1.41:** Tray 4 paper delivery direction misalignment warning.
- **53.A1.51:** Tray 5 paper delivery direction misalignment warning.
- **53.A1.61:** Tray 6 paper delivery direction misalignment warning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Ensure that the paper size in the tray matches the tray size in the [Trays](#) menu.
2. If the trays are **not** locked, ensure the tray guides are correctly aligned to the size of paper being installed.
3. If the trays are locked, contact your managed print provider if you need to change the paper size from the one selected.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Ensure that the paper tray guides are set to the correct paper size that is being loaded into the paper tray.



NOTE: Check the event log for the following messages to determine which tray guides need to be adjusted.

- **53.A1.11:** Tray 1 paper delivery direction misalignment warning.
 - **53.A1.21:** Tray 2 paper delivery direction misalignment warning.
 - **53.A1.31:** Tray 3 paper delivery direction misalignment warning.
 - **53.A1.41:** Tray 4 paper delivery direction misalignment warning.
 - **53.A1.51:** Tray 5 paper delivery direction misalignment warning.
 - **53.A1.61:** Tray 6 paper delivery direction misalignment warning.
2. Ensure that the rear paper guide is set to the correct paper length.
 3. Ask the customer to check the paper size loaded in the tray to see if it matches the size listed in the [Trays](#) menu or on the Configuration Page.

4. If the trays are **not** locked, educate the customer on the correct way to align the guides when refilling paper in the tray.
5. Inspect the quality and condition of the customer paper to identify conditions that may lead to paper skewing.
6. Inspect the condition of the feed and separation rollers of the listed tray, and ensure they are not worn, or damaged. Replace the rollers as needed.

53.A2.y0

Tray "Y" overload resolved.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A2.10:** Tray 1 overload resolved.
- **53.A2.20:** Tray 2 overload resolved.
- **53.A2.30:** Tray 3 overload resolved.
- **53.A2.40:** Tray 4 overload resolved.
- **53.A2.50:** Tray 5 overload resolved.
- **53.A2.60:** Tray 6 overload resolved.

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.A2.y1

Tray "Y" overload warning.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A2.11:** Tray 1 overload warning.
- **53.A2.21:** Tray 2 overload warning.
- **53.A2.31:** Tray 3 overload warning.
- **53.A2.41:** Tray 4 overload warning.
- **53.A2.51:** Tray 5 overload warning.
- **53.A2.61:** Tray 6 overload warning.

Recommended action

Follow these troubleshooting steps in the order presented.

- Remove paper from the specified tray until it is below the paper fill level mark.

53.B0.0z

Tray "Z" feed roller nearing end of life.

Prepare to replace tray pick rollers



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B0.01:** Tray 1 feed roller nearing end of life.
- **53.B0.02:** Tray 2 feed roller nearing end of life.
- **53.B0.03:** Tray 3 feed roller nearing end of life.
- **53.B0.04:** Tray 4 feed roller nearing end of life.
- **53.B0.05:** Tray 5 feed roller nearing end of life.
- **53.B0.06:** Tray 6 feed roller nearing end of life.

Recommended action

Follow these troubleshooting steps in the order presented.

- The paper tray rollers will need to be replaced soon. Be prepared to replace the tray rollers for the specified tray.



NOTE: Check the event log for the following messages to determine which tray rollers need to be changed.

- **53.B0.01:** Tray 1 feed roller nearing end of life.
- **53.B0.02:** Tray 2 feed roller nearing end of life.
- **53.B0.03:** Tray 3 feed roller nearing end of life.
- **53.B0.04:** Tray 4 feed roller nearing end of life.
- **53.B0.05:** Tray 5 feed roller nearing end of life.
- **53.B0.06:** Tray 6 feed roller nearing end of life.

53.B1.0z

Tray "Z" feed roller at end of life.



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B1.01:** Tray 1 feed roller at end of life.
- **53.B1.02:** Tray 2 feed roller at end of life.
- **53.B1.03:** Tray 3 feed roller at end of life.

- **53.B1.04:** Tray 4 feed roller at end of life.
- **53.B1.05:** Tray 5 feed roller at end of life.
- **53.B1.06:** Tray 6 feed roller at end of life.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

- Replace the feed and separation rollers for the specified tray.

53.B2.0z

Tray "Z" feed roller brand new.



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B2.01:** Tray 1 feed roller brand new.
- **53.B2.02:** Tray 2 feed roller brand new.
- **53.B2.03:** Tray 3 feed roller brand new.
- **53.B2.04:** Tray 4 feed roller brand new.
- **53.B2.05:** Tray 5 feed roller brand new.
- **53.B2.06:** Tray 6 feed roller brand new.

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.B3.0z

Tray "Z" pick roller brand new (engine detected).

The engine detected that new tray feed rollers have been installed.



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B3.01:** Tray 1 feed roller brand new (engine detected).
- **53.B3.02:** Tray 2 feed roller brand new (engine detected).

- **53.B3.03:** Tray 3 feed roller brand new (engine detected).
- **53.B3.04:** Tray 4 feed roller brand new (engine detected).
- **53.B3.05:** Tray 5 feed roller brand new (engine detected).
- **53.B3.06:** Tray 6 feed roller brand new (engine detected).

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.C1.0z Tray "Z" size mismatch.

The specified tray contains a size that does not match the configured size.

Complete screen message:

The specified tray contains a size that does not match the configured size.

The tray is configured to support the only size indicated

Confirm guides are in correct position.

This issue occurs when the managed print provider has locked the paper tray to either letter or A4 and the tray has a different size paper loaded.



NOTE: This can occur if the tray was swapped out or the physical trays locks in the tray were removed and the guides changed.

- **53.C1.02:** Tray 2 size mismatch.
- **53.C1.03:** Tray 3 size mismatch.
- **53.C1.04:** Tray 4 size mismatch.
- **53.C1.05:** Tray 5 size mismatch.
- **53.C1.06:** Tray 6 size mismatch.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Ensure that the paper size in the tray matches the tray size in the [Trays](#) menu.
2. Contact your managed print provider if you need to change the paper size from the one selected.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Ask the customer to check the media size loaded in the tray to see if it matches the size listed in the [Trays](#) menu or on the Configuration Page.
2. Instruct the customer to contact the managed print provider if the paper size needs to be changed from the one selected.

54.WX.YZ error messages

54.* errors

Errors in the 54.* family are related to the image-formation system.

- For HP LaserJet printers, they can indicate a problem with the toner cartridges or the transfer unit (color printers only), or they can indicate a problem with a sensor, such as with the laser/scanner.
- For HP PageWide printers, they can indicate a problem with the calibration process.

Recommended action for call-center agent and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off and then unplug the power cord. Wait for at least 30 seconds, then reconnect the power cord and turn the printer on.
2. Turn the printer off, and check all the connections on the formatter. Reseat them if necessary.

Recommended action for LaserJets

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Check the supplies status page to verify that toner cartridges or the transfer kit are not past their useful life. Replace supplies as necessary.
3. For color printers, inspect the transfer belt for damage, and replace it if necessary.
4. For color printers, if the error persists, replace the registration assembly.
5. Check the connections between the laser/scanner and the DC controller, and from the laser/scanner to the printer. Reseat them if necessary. If the error persists, replace the laser/scanner.

54.00.01 / 54.00.03 (event log only)

Environment sensor abnormality warning

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Ensure that the connectors of the paper sensor assembly and connectors on the DC controller PCA.

3. Replace the environment sensor.

Part number: RM2-8440-000CN

For instructions: *Removal and replacement: Environment sensor PCA* See the Repair Service Manual for this product.

54.00.06 or 54.00.14 or 54.00.19 (event log only)


Registration density sensor failure

Recommended action for customers

1. Turn the printer off, and then on.
2. Open and close the front door multiple times to clean the registration density sensors.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Open and close the front door multiple times to clean the registration density sensors.
2. Open and close the front door, or turn the printer off, and then on to perform the color plane registration.
3. If the error persists, manually clean the density sensors.
 - a. To clean the density sensors open the right and front doors and remove both the fuser and ITB.
 - b. Close the front door to expose the density sensors for cleaning as shown in the following image.

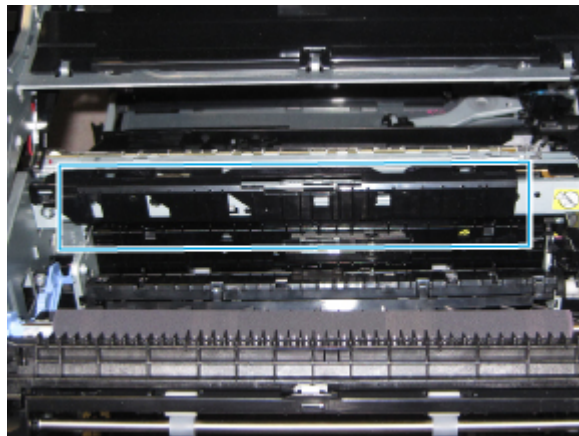

- c. Clean any toner dust and debris from the front and rear density sensors (RD sensors) and the surrounding areas using compressed air and/or a soft brush.
4. Ensure that the connectors of the paper sensor assembly and connectors on the DC controller PCA.

5. If the error persists, replace the density detect assembly.

Part number: RM2-7160-000CN

For instructions: *Removal and replacement: Registration density sensor* See the Repair Service Manual for this product.

54 . 01 . 05 (event log only)

Paper sensor is out of calibration range

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, open the right cover, then open the small jam access.
3. Clean the paper sensor assembly located under the access in the middle with a lint-free cloth. Turn the power off, and then on.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Clean the paper sensor assembly with a lint-free cloth. Turn the power off, and then on.
2. Ensure that the connectors of the paper sensor assembly and connectors on the DC controller PCA.
3. Replace the registration assembly.

Part number: RM2-1957-000CN

For instructions: *Removal and replacement: Registration assembly* See the Repair Service Manual for this product.

54 . 06 . 21 (event log only)

Primary laser/scanner beam detect abnormality

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Ensure that the connectors of the paper sensor assembly and connectors on the DC controller PCA.

3. If the error persists, replace the laser/scanner assembly.

Part number: RM2-1237-000CN

For instructions: *Removal and replacement: Laser/scanner* See the Repair Service Manual for this product.

54 . 14 . 00 (event log only)

CPR sensor abnormality warning

Recommended action for customers

1. Turn the printer off, and then on.
2. Open and close the front door multiple times to clean the registration density sensors.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.
2. Check the supplies status page to ensure that the toner cartridges are not past their useful life.



NOTE: Check the event log for the 10.0X.70 codes for the cartridge (10.01, 02, 03, 04.70). If this error is listed, the customer must replace the specified supply.

After an HP supply has reached the very low threshold, the HP premium protection warranty ends and the customer is responsible for replacing the part(s).

3. Open and close the front door multiple times to clean the registration density sensors.
4. Check the ITB for damage and replace the ITB as needed.

Use the following table to order or replace the ITB for the printer.


Table 6-104 ITB part number

Customer type	Part number	Description
Managed Print Services (MPS)	P1B93-69001	Intermediate Transfer Belt PM Kit
All others (non-MPS)	P1B93-67901	Image transfer belt - Includes tray 2 transfer roller, paper pick-up roller, tray 2 separation roller, retard roller, and transfer roller guide.

For instructions: *Removal and replacement: Intermediate transfer belt*

5. Manually clean the density sensors.
 - a. To clean the density sensors open the right and front doors and remove both the fuser and ITB.

- b. Close the front door to expose the density sensors for cleaning as shown in the following image.

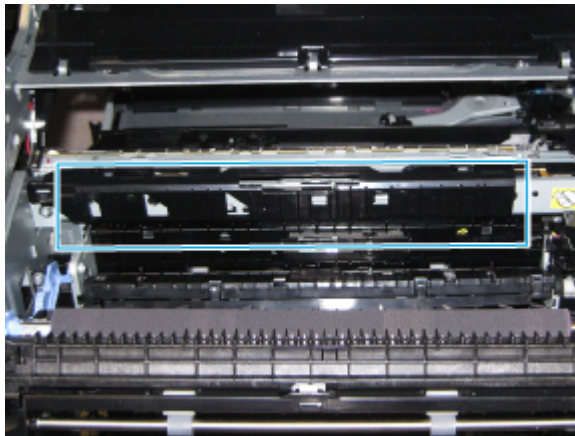

- c. Clean any toner dust and debris from the front and rear density sensors (RD sensors) and the surrounding areas using compressed air and/or a soft brush.
6. If the error persists, replace the density detect assembly.

Part number: RM2-7160-000CN

For instructions: *Removal and replacement: Registration density sensor* See the Repair Service Manual for this product.

54.0B.YZ (event log only)

Density sensor out of range or density uniformity adjustment abnormality.

- 54.0B.00, 54.0B.10 – Black
- 54.0B.01, 54.0B.11 – Cyan
- 54.0B.02, 54.0B.12 – Magenta
- 54.0B.03, 54.0B.13 – Yellow

Recommended action for customers

1. Turn the printer off, and then on.
2. Open and close the front door multiple times to clean the registration density sensors.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.

2. Check the supplies status page to ensure that the toner cartridges are not past their useful life.

 **NOTE:** Check the event log for the 10.0X.70 codes for the cartridge (10.01, 02, 03, 04.70). If this error is listed, the customer must replace the specified supply.

After an HP supply has reached the very low threshold, the HP premium protection warranty ends and the customer is responsible for replacing the part(s).

3. Open and close the front door multiple times to clean the registration density sensors.
4. Check the ITB for damage and replace the ITB as needed.


Use the following table to order or replace the correct part number for your printer.

Table 6-105 ITB part number

Customer type	Part number	Description
Managed Print Services (MPS)	P1B93-69001	Intermediate Transfer Belt PM Kit
All others (non-MPS)	P1B93-67901	Image transfer belt - Includes tray 2 transfer roller, paper pick-up roller, tray 2 separation roller, retard roller, and transfer roller guide.

For instructions: *Removal and replacement: Intermediate transfer belt*

5. Manually clean the density sensors.
 - a. To clean the density sensors open the right and front doors and remove both the fuser and ITB.
 - b. Close the front door to expose the density sensors for cleaning as shown in the following image.

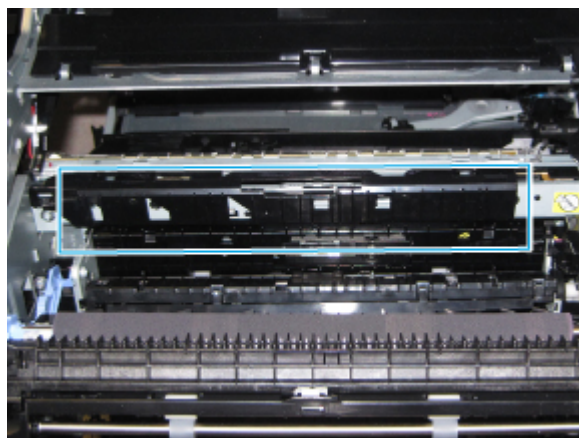

- c. Clean any toner dust and debris from the front and rear density sensors (RD sensors) and the surrounding areas using compressed air and/or a soft brush.
6. Replace the failing toner cartridge.

HP 655A Black laser toner cartridge part number: CF450A

HP 655A Cyan laser toner cartridge part number: CF451A

HP 655A Magenta laser toner cartridge part number: CF452A

HP 655A Yellow laser toner cartridge part number: CF453A

HP 656X High capacity Black laser toner cartridge part number: CF460A

HP 656X High capacity Cyan laser toner cartridge part number: CF461A

HP 656X High capacity Magenta laser toner cartridge part number: CF456A

HP 656X High capacity Yellow laser toner cartridge part number: CF463A

HP 657X High capacity replacement Black laser toner cartridge part number: CF470A

HP 657X High capacity replacement Cyan laser toner cartridge part number: CF471A

HP 657X High capacity replacement Magenta laser toner cartridge part number: CF476A

HP 657X High capacity replacement Yellow laser toner cartridge part number: CF473A

7. If the error persists, replace the density detect assembly.

Part number: RM2-7160-000CN

For instructions: *Removal and replacement: Registration density sensor* See the Repair Service Manual for this product.

54.0C.0Z or 54.0D.0Z (event log only)

DHalf warning.

During the printer calibration, the half tone of the color indicated failed to measure normally.

- **54.0C.00, 54.0D.00** – Black
- **54.0C.01, 54.0D.01** – Cyan
- **54.0C.02, 54.0D.02** – Magenta
- **54.0C.03, 54.0D.03** – Yellow

Recommended action for customers

1. Turn the printer off, and then on.
2. Open and close the front door multiple times to clean the registration density sensors.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.
2. Check the supplies status page to ensure that the toner cartridges are not past their useful life.



NOTE: Check the event log for the 10.0X.70 codes for the cartridge (10.01, 02, 03, 04.70). If this error is listed, the customer must replace the specified supply.

After an HP supply has reached the very low threshold, the HP premium protection warranty ends and the customer is responsible for replacing the part(s).

3. Open and close the front door multiple times to clean the registration density sensors.
4. Check the ITB for damage and replace the ITB as needed.


Use the following table to order or replace the correct part number for your printer.

Table 6-106 ITB part number

Customer type	Part number	Description
Managed Print Services (MPS)	P1B93-69001	Intermediate Transfer Belt PM Kit
All others (non-MPS)	P1B93-67901	Image transfer belt - Includes tray 2 transfer roller, paper pick-up roller, tray 2 separation roller, retard roller, and transfer roller guide.

For instructions: *Removal and replacement: Intermediate transfer belt*

5. Manually clean the density sensors.
 - a. To clean the density sensors open the right and front doors and remove both the fuser and ITB.
 - b. Close the front door to expose the density sensors for cleaning as shown in the following image.

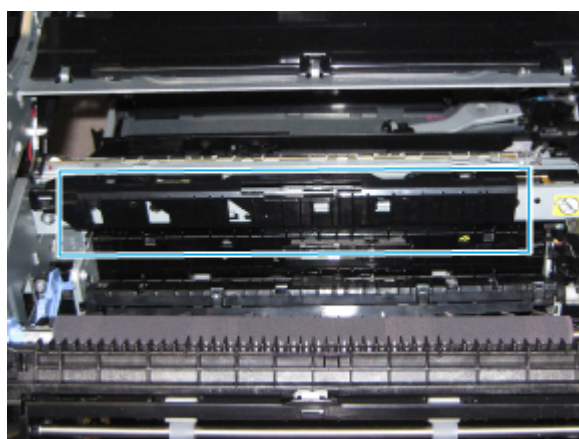

- c. Clean any toner dust and debris from the front and rear density sensors (RD sensors) and the surrounding areas using compressed air and/or a soft brush.
6. Replace the failing toner cartridge.

HP 655A Black laser toner cartridge part number: CF450A

HP 655A Cyan laser toner cartridge part number: CF451A

HP 655A Magenta laser toner cartridge part number: CF452A

HP 655A Yellow laser toner cartridge part number: CF453A

HP 656X High capacity Black laser toner cartridge part number: CF460A

HP 656X High capacity Cyan laser toner cartridge part number: CF461A

HP 656X High capacity Magenta laser toner cartridge part number: CF456A

HP 656X High capacity Yellow laser toner cartridge part number: CF463A

HP 657X High capacity replacement Black laser toner cartridge part number: CF470A

HP 657X High capacity replacement Cyan laser toner cartridge part number: CF471A

HP 657X High capacity replacement Magenta laser toner cartridge part number: CF476A

HP 657X High capacity replace Yellow laser toner cartridge part number: CF473A

7. If the error persists, replace the density detect assembly.

Part number: RM2-7160-000CN

For instructions: *Removal and replacement: Registration density sensor* See the Repair Service Manual for this product.

54 . 0E . YZ (event log only)

These are informational only messages for engine calibration events.

Recommended action for customers

- No action is necessary because the event is not an error and is not user-visible.

Recommended action for call-center agents and onsite technicians

- There is no action for the customer to take because the event is not an error and is not user-visible.

54 . 0F . YZ (event log only)

CPR sensor out of range

Misregistration measurement abnormality error.

- 54.0F.00 – Black
- 54.0F.01 – Cyan
- 54.0F.02 – Magenta
- 54.0F.03 – Yellow

Recommended action for customers

1. Turn the printer off, and then on.
2. Open and close the front door multiple times to clean the registration density sensors.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.
2. Check the supplies status page to ensure that the toner cartridges are not past their useful life.



NOTE: Check the event log for the 10.0X.70 codes for the cartridge (10.01, 02, 03, 04.70). If this error is listed, the customer must replace the specified supply.

After an HP supply has reached the very low threshold, the HP premium protection warranty ends and the customer is responsible for replacing the part(s).

3. Open and close the front door multiple times to clean the registration density sensors.
4. Check the ITB for damage and replace the ITB as needed.


Use the following table to order or replace the correct part number for your printer.

Table 6-107 ITB part number

Customer type	Part number	Description
Managed Print Services (MPS)	P1B93-69001	Intermediate Transfer Belt PM Kit
All others (non-MPS)	P1B93-67901	Image transfer belt - Includes tray 2 transfer roller, paper pick-up roller, tray 2 separation roller, retard roller, and transfer roller guide.

For instructions: *Removal and replacement: Intermediate transfer belt*

5. Manually clean the density sensors.
 - a. To clean the density sensors open the right and front doors and remove both the fuser and ITB.
 - b. Close the front door to expose the density sensors for cleaning as shown in the following image.

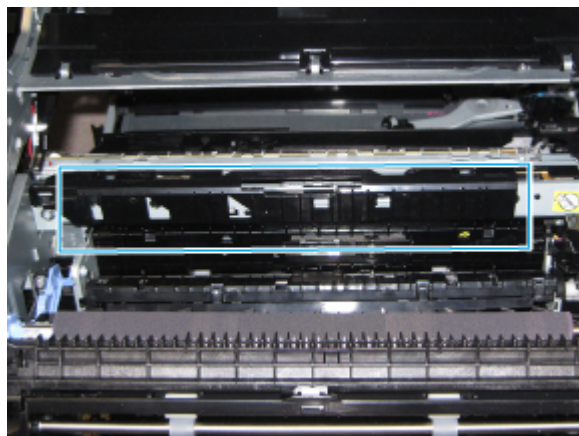

- c. Clean any toner dust and debris from the front and rear density sensors (RD sensors) and the surrounding areas using compressed air and/or a soft brush.
6. Replace the failing toner cartridge.

HP 655A Black laser toner cartridge part number: CF450A

HP 655A Cyan laser toner cartridge part number: CF451A

HP 655A Magenta laser toner cartridge part number: CF452A

HP 655A Yellow laser toner cartridge part number: CF453A

HP 656X High capacity Black laser toner cartridge part number: CF460A

HP 656X High capacity Cyan laser toner cartridge part number: CF461A

HP 656X High capacity Magenta laser toner cartridge part number: CF456A

HP 656X High capacity Yellow laser toner cartridge part number: CF463A

HP 657X High capacity replacement Black laser toner cartridge part number: CF470A

HP 657X High capacity replacement Cyan laser toner cartridge part number: CF471A

HP 657X High capacity replacement Magenta laser toner cartridge part number: CF476A

HP 657X High capacity replace Yellow laser toner cartridge part number: CF473A

7. If the error persists, replace the density detect assembly.

Part number: RM2-7160-000CN

For instructions: *Removal and replacement: Registration density sensor* See the Repair Service Manual for this product.

54.0x.07 (event log only)

The printer experienced a drum home position sensor error.

- **54.05.07** Black Drum
- **54.06.07** Cyan Drum
- **54.07.07** Magenta Drum
- **54.08.07** Yellow Drum

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Ensure that the connectors of the paper sensor assembly and connectors on the DC controller PCA.
3. Replace the main drive assembly.

Part number: RM2-1927-000CN

For instructions: *Removal and replacement: Main drive* See the Repair Service Manual for this product.

54 . 0X . 0B or 54 . 0X . 0C or 54 . 0X . 0D or 54 . 0X . 0E (event log only)

Density sensor out of range error or Dhalf calibration failure

- 54.00.0B, 54.00.0C 54.00.0D, 54.00.0E – Black
- 54.01.0B, 54.01.0C 54.01.0D, 54.01.0E – Cyan
- 54.02.0B, 54.02.0C 54.02.0D, 54.02.0E – Magenta
- 54.03.0B, 54.03.0C 54.03.0D, 54.03.0E – Yellow

Recommended action for customers

1. Turn the printer off, and then on.
2. Open and close the front door multiple times to clean the registration density sensors.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.
2. Check the supplies status page to ensure that the toner cartridges are not past their useful life.



NOTE: Check the event log for the 10.0X.70 codes for the cartridge (10.01, 02, 03, 04.70). If this error is listed, the customer must replace the specified supply.

After an HP supply has reached the very low threshold, the HP premium protection warranty ends and the customer is responsible for replacing the part(s).

3. Open and close the front door multiple times to clean the registration density sensors.
4. Check the ITB for damage and replace the ITB as needed.

Use the following table to order or replace the correct part number for your printer.


Table 6-108 ITB part number

Customer type	Part number	Description
Managed Print Services (MPS)	P1B93-69001	Intermediate Transfer Belt PM Kit
All others (non-MPS)	P1B93-67901	Image transfer belt - Includes tray 2 transfer roller, paper pick-up roller, tray 2 separation roller, retard roller, and transfer roller guide.

For instructions: *Removal and replacement: Intermediate transfer belt*

5. Manually clean the density sensors.
 - a. To clean the density sensors open the right and front doors and remove both the fuser and ITB.

- b. Close the front door to expose the density sensors for cleaning as shown in the following image.

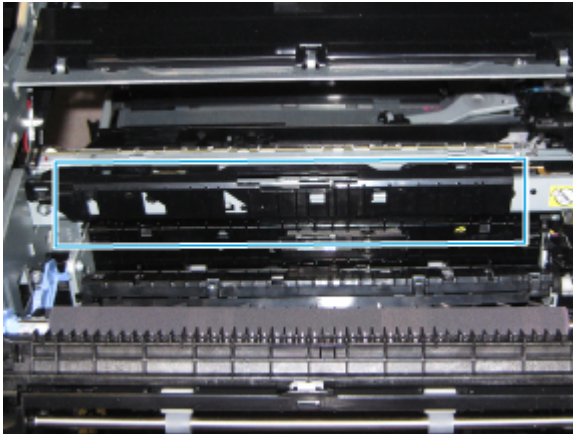

- c. Clean any toner dust and debris from the front and rear density sensors (RD sensors) and the surrounding areas using compressed air and/or a soft brush.
6. Replace the failing toner cartridge.
HP 655A Black laser toner cartridge part number: CF450A
HP 655A Cyan laser toner cartridge part number: CF451A
HP 655A Magenta laser toner cartridge part number: CF452A
HP 655A Yellow laser toner cartridge part number: CF453A
HP 656X High capacity Black laser toner cartridge part number: CF460A
HP 656X High capacity Cyan laser toner cartridge part number: CF461A
HP 656X High capacity Magenta laser toner cartridge part number: CF456A
HP 656X High capacity Yellow laser toner cartridge part number: CF463A
HP 657X High capacity replacement Black laser toner cartridge part number: CF470A
HP 657X High capacity replacement Cyan laser toner cartridge part number: CF471A
HP 657X High capacity replacement Magenta laser toner cartridge part number: CF476A
HP 657X High capacity replace Yellow laser toner cartridge part number: CF473A
 7. If the error persists, replace the density detect assembly.
Part number: RM2-7160-000CN
For instructions: *Removal and replacement: Registration density sensor* See the Repair Service Manual for this product.

55.WX.YZ, 56.WX.YZ error messages

55.* errors

Errors in the 55.* family often indicate a problem with the DC controller.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. If the error persists, replace the DC controller.

55 . 00 . 01, 55 . 00 . 03 or 55 . 00 . 04 DC Controller Error

The communication link between the formatter and DC controller was lost.

- **55.00.01** DC controller memory error.
- **55.00.03** DC controller no engine response.
- **55.00.04** DC controller communications time out

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.


Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, print an engine test to verify the printer engine is functioning.
 - a. Ensure paper is loaded in tray 2.

- b. Use a small, pointed object to depress the test-page switch located on the rear of the product.

Figure 6-150 Engine test button

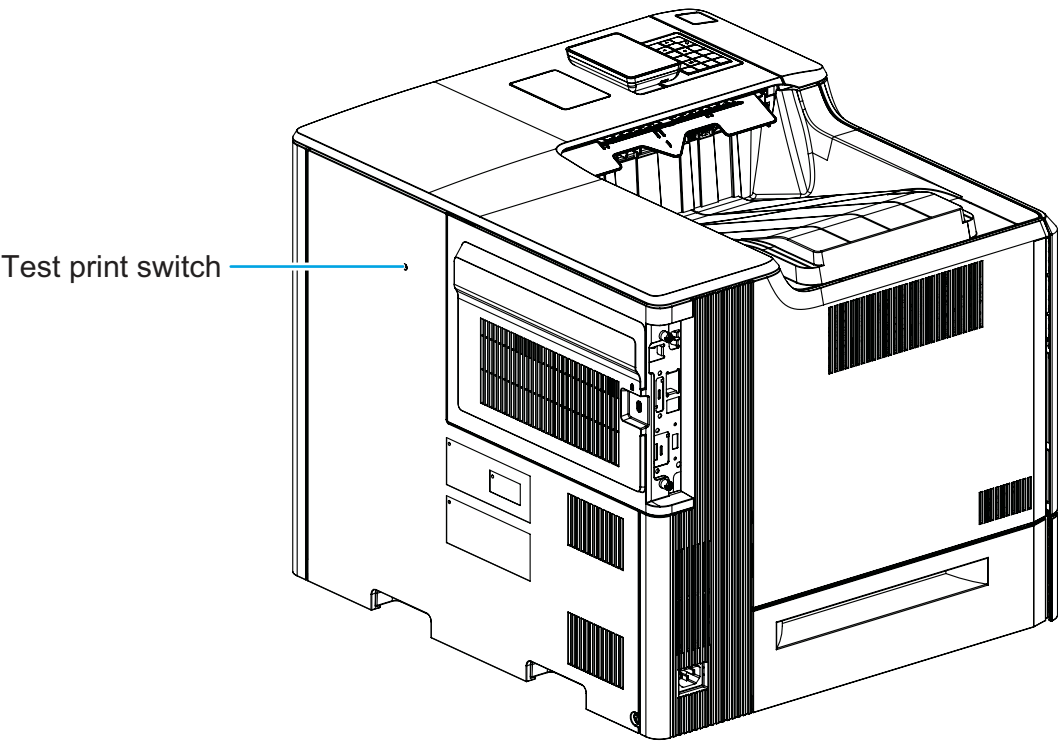

- c. Check if the test page prints successfully.



NOTE: A successful test page will have a series of horizontal lines.

- 3. If the engine page does NOT print successfully, replace the DC Controller.

Table 6-109 DC controller assembly part number

Part description	Part number
DC controller PC board assembly	RM3-7030-000CN
For products: M652/M653	
DC controller PC board assembly	RM3-7031-000CN
For products: M681/M682	

For instructions: *Removal and replacement: DC controller PCA* See the Repair Service Manual for this product.

- 4. If the engine test prints successfully and the issue persists, elevate the case as per your region's escalation process


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

- 1. Turn the printer off, and then on.

2. If the issue persists, print an engine test to verify the printer engine is functioning.
 - a. Ensure paper is loaded in tray 2.
 - b. Use a small, pointed object to depress the test-page switch located on the rear of the product.

Figure 6-151 Engine test button

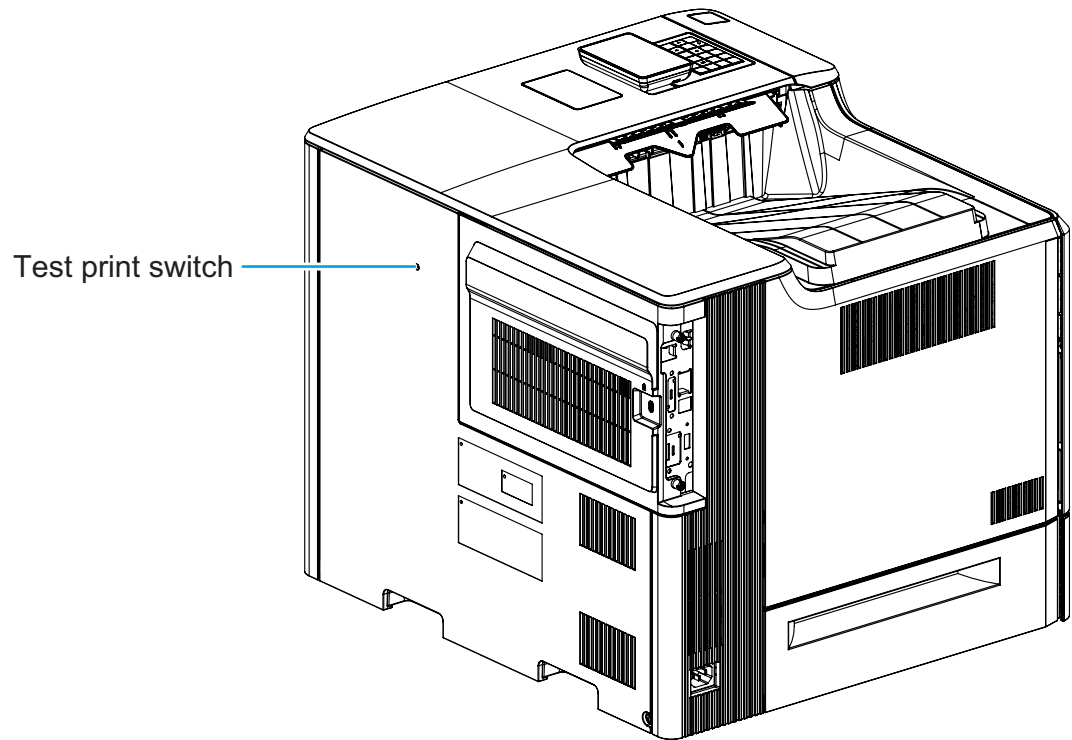


- c. Check if the test page prints successfully.



NOTE: A successful test page will have a series of horizontal lines.

3. If the issue persists, disconnect and reconnect all connections on the DC controller.

Figure 6-152 DC Controller PCA connectors

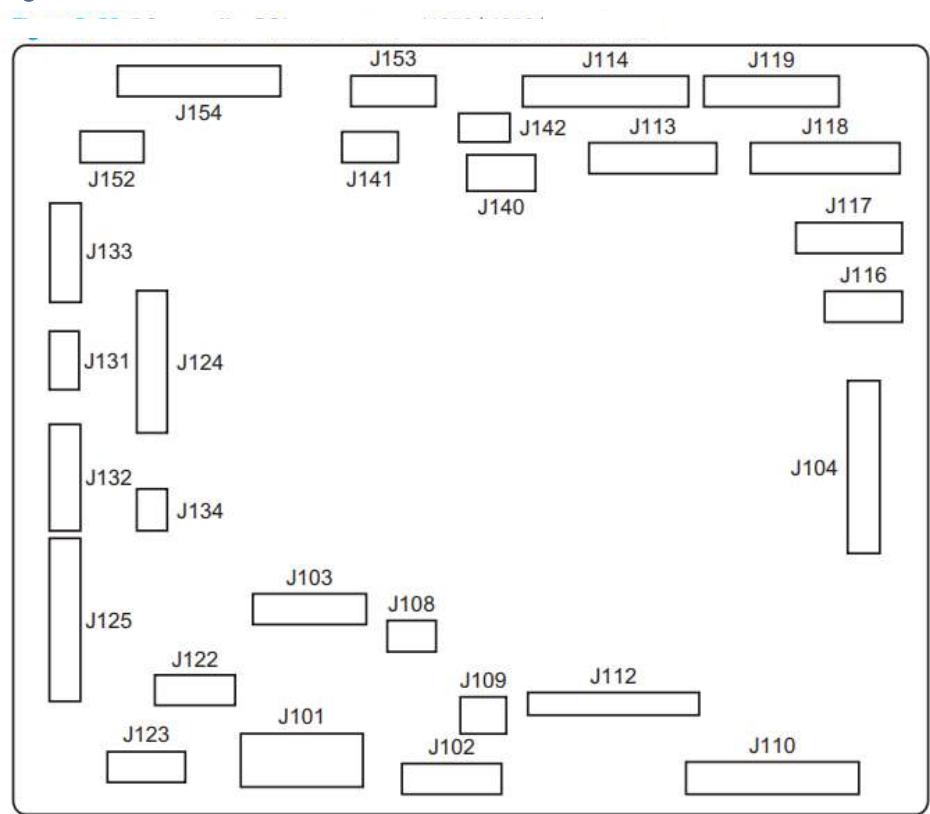

4. If the issue persists, replace the DC Controller.

Table 6-110 DC controller assembly part number

Part description	Part number
DC controller PC board assembly	RM3-7030-000CN
For products: M652/M653	
DC controller PC board assembly	RM3-7031-000CN
For products: M681/M682	

For instructions: *Removal and replacement: DC controller PCA* See the Repair Service Manual for this product.

5. If the engine test prints successfully and the issue persists, elevate the case as per your region's escalation process.

55 . 00 . 05 Engine Firmware RFU Error

The firmware upgrade failed.

Recommended action

1. Turn the printer off, and then on.

2. If issue remains re-send the upgrade.

55.01.06, 55.02.06 DC controller error To continue turn off then on

NVRAM memory warning

- 55.01.06 (event code)
NVRAM memory data error warning.
- 55.02.06 (event code)
NVRAM memory access error warning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.


Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, print an engine test to verify the printer engine is functioning.
 - a. Ensure paper is loaded in tray 2.

- b. Use a small, pointed object to depress the test-page switch located on the rear of the product.

Figure 6-153 Engine test button

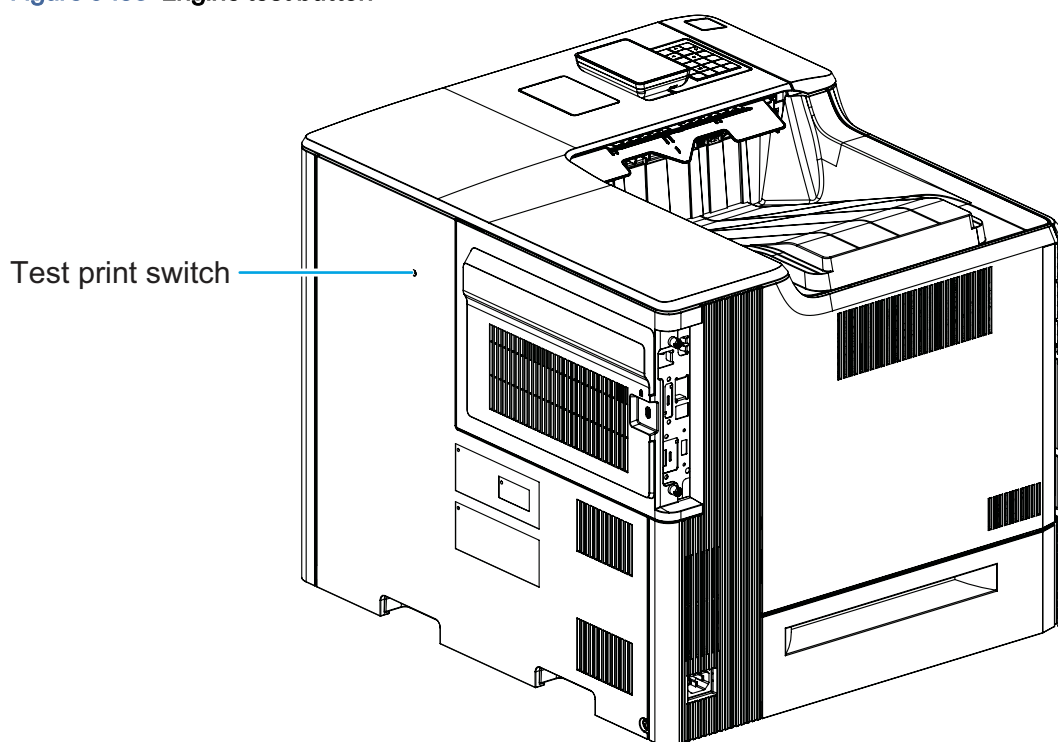

- c. Check if the test page prints successfully.



NOTE: A successful test page will have a series of horizontal lines.

3. If the engine page does NOT print successfully, replace the DC Controller.

Table 6-111 DC controller assembly part number

Part description	Part number
DC controller PC board assembly	RM3-7030-000CN
For products: M652/M653	
DC controller PC board assembly	RM3-7031-000CN
For products: M681/M682	

For instructions: *Removal and replacement: DC controller PCA* See the Repair Service Manual for this product.

4. If the engine test prints successfully and the issue persists, elevate the case as per your region's escalation process


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the issue persists, print an engine test to verify the printer engine is functioning.
 - a. Ensure paper is loaded in tray 2.
 - b. Use a small, pointed object to depress the test-page switch located on the rear of the product.

Figure 6-154 Engine test button

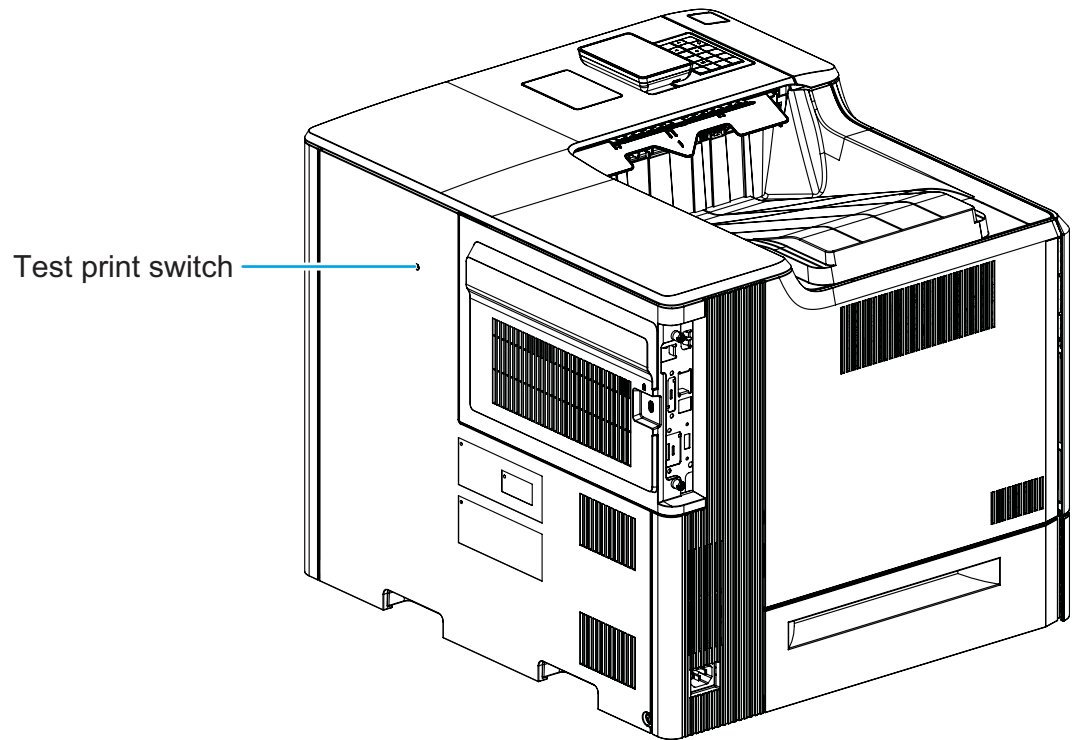


- c. Check if the test page prints successfully.



NOTE: A successful test page will have a series of horizontal lines.

3. If the issue persists, disconnect and reconnect all connections on the DC controller.

Figure 6-155 DC Controller PCA connectors

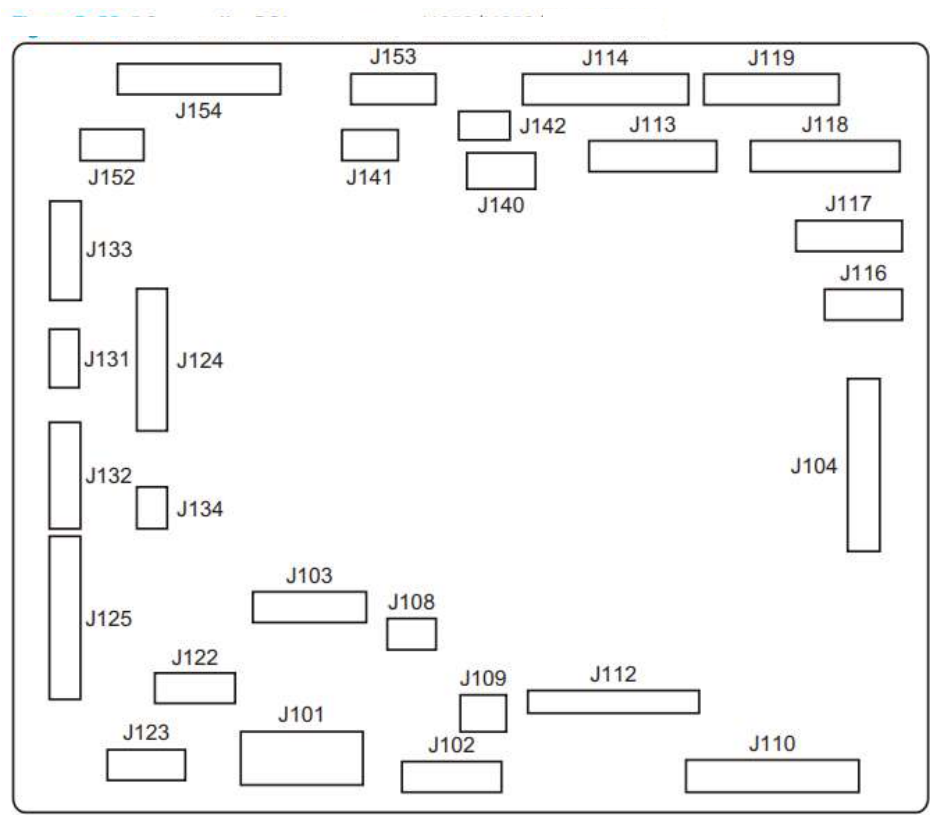

4. If the issue persists, replace the DC Controller.

Table 6-112 DC controller assembly part number

Part description	Part number
DC controller PC board assembly	RM3-7030-000CN
For products: M652/M653	
DC controller PC board assembly	RM3-7031-000CN
For products: M681/M682	

For instructions: *Removal and replacement: DC controller PCA* See the Repair Service Manual for this product.

5. If the engine test prints successfully and the issue persists, elevate the case as per your region's escalation process.

55.01.07 Fuser NVRAM memory warning

Fuser NVRAM memory data error warning.

Printer will display “Checking Printer Please wait” on the control panel



NOTE: Do NOT replace the DC Controller for this event code.

This event code logs when the fuser installed has an old serial number that is not authenticated or not supported.

This issue applies for the following printer series:


- HP Color LaserJet Managed E65150
- HP Color LaserJet Managed E65160
- HP Color LaserJet Managed MFP E67650
- HP Color LaserJet Managed Flow MFP E67660

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, replace the fuser.
 - a. Open the right door of the printer.
 - b. Remove the fuser to verify if the fuser label has an old or new serial number.

Grasp the handles of the fuser (callout 1), and then pull away from the printer to remove the fuser (callout 2).

Figure 6-156 Remove the fuser

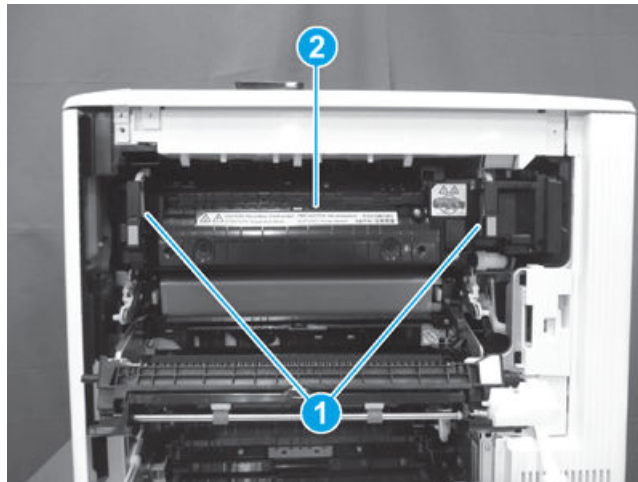

Images to illustrate a fuser label with an old serial number and a new serial number.

Figure 6-157 Old fuser serial number on fuser label



Figure 6-158 New and authenticated fuser serial number on fuser label



- c. Replace the fuser.
 - Part number: 110 V - RM2-1928-020CN
 - Part number: 220 V - RM2-1929-020CN

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions, *Removal and replacement: Fuser* see the Service Manual for this printer.

56.* errors

Errors in the 56.* family indicate a communication problem with an optional paper tray or other external accessory.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. If any third-party hardware is installed, remove it and try printing again.
3. If an optional paper tray is installed, remove it. Check the connectors on the tray for damage. If the connector is damaged, replace the tray.
4. Reinstall the tray, and make sure it is correctly seated.

56.00.YZ

The printer experienced a communication error with the optional paper trays.

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, re-seat the optional paper trays (1 x 500-sheet feeder and/or 3 x 500-sheet feeder).
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

1. Turn the printer off, then on.

2. If the error persists, re-seat the optional paper trays (1 x 500-sheet feeder and/or 3 x 500-sheet feeder).
3. Check the input connectors for damage. If a connector is damaged, replace the connector.

Tray	Tray connector part number	Replacement instructions
550-sheet feeder	RC4-7680-000CN	<i>Removal and replacement: Drawer connector and holder</i> See the Repair Service Manual for this product.
1x550-sheet feeder with stand	RC4-8914-000CN	<i>Removal and replacement: Drawer connector and holder (1x550-sheet feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet feeder with stand	RC4-8914-000CN	<i>Removal and replacement: Drawer connector and holder (3x550-sheet feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCl feeder with stand	RC4-8914-000CN	<i>Removal and replacement: Drawer connector and holder (2500-sheet feeder with stand)</i> See the Repair Service Manual for this product.

56.00.01 Illegal Input Printer Error

The printer experienced an illegal input.

Recommended action

1. Turn the printer off, then on.
2. Remove any third-party hardware and test again.

57.WX.YZ error messages

57.WX.YZ error messages



NOTE: Use the wiring diagram to trace back where the fan gets its supply voltage.

The connectors are supplied in the troubleshooting steps. If after following the steps provided, the issue is not resolved, it may be a voltage source issue from the DC controller or LVPS. Depending on which fan is failing, one of these parts may need to be replaced as a following step.

57.* errors

Errors in the 57.* family indicate a problem with a fan.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.
2. Press the Power button again to turn on the printer.

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Use the printer troubleshooting manual to identify the locations of each fan. Turn the printer off and then on, and listen for noise coming from the area of each fan. Replace any fan that is not making noise.
2. Update the firmware to the latest version. If the latest version firmware is already installed, reinstall it now.

For more information, see:

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. Remove enough parts to access the DC controller or the power supply PCA. Check the connections from each fan to the DC controller or power supply PCA. Reseat them if necessary.
4. With the DC controller or power supply PCA exposed, turn the printer on. Immediately measure the voltage between the connectors for each fan and the DC controller. If the voltage changes from 0V to approximately 24V during the power-on cycle, replace the affected fan. If the voltage remains at 0V, replace the DC controller.

57.00.01 Fan failure

Power supply fan FM1 failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.
2. Press the Power button again to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, then on.
2. Disconnect and reconnect J206 and J207 on the low-voltage power supply assembly.
3. Disconnect and reconnect J102 and J103 on the DC controller PCA.
4. If the error persists, replace the power supply fan FM1.

Part number: RK2-2416-000CN

For instructions: *Removal and replacement: Power supply fan* See the Repair Service Manual for this product.

57.00.02 Fan failure

Cartridge fan FM2 error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.
2. Press the Power button again to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, then on.
2. Disconnect and reconnect J98 on the cartridge fan and intermediate connector J67.
3. Disconnect and reconnect J124 on the DC controller PCA.
4. If the error persists, replace the cartridge fan FM2.

Part number: RK2-6124-000CN

For instructions: *Removal and replacement: Cartridge fan* See the Repair Service Manual for this product.

57.00.04 Fan failure

Left upper front fan FM3 failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.
2. Press the Power button again to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, then on.
2. Disconnect and reconnect J36 on the left upper front fan and connectors J353 and J351 on the high-voltage power supply T PCA.
3. Disconnect and reconnect J114 on the DC controller PCA.
4. If the error persists, replace the left upper front fan FM3.

Part number: RK2-7951-000CN

For instructions: *Removal and replacement: Left upper front and left upper rear fans* See the Repair Service Manual for this product.

57 . 00 . 05 Fan failure

Left upper rear fan FM4 failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.
2. Press the Power button again to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, then on.
2. Disconnect and reconnect J35 on the left upper front fan and connectors J353 and J351 on the high-voltage power supply T PCA.
3. Disconnect and reconnect J114 on the DC controller PCA.
4. If the error persists, replace the left upper rear fan FM4.

Part number: RK2-7949-000CN

For instructions: *Removal and replacement: Left upper front and left upper rear fans* See the Repair Service Manual for this product.

57 . 00 . 08 Fan failure

Front fan FM5 failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.
2. Press the Power button again to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, then on.
2. Disconnect and reconnect J37 on the front fan and connectors J353 and J351 on the high-voltage power supply T PCA.
3. Disconnect and reconnect J114 on the DC controller PCA.
4. If the error persists, replace the front fan FM5.

Part number: RK2-6124-000CN

For instructions: *Removal and replacement: Front fan* See the Repair Service Manual for this product.

57.00.09 Fan failure

Rear fan FM6 has experienced a failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.
2. Press the Power button again to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. Disconnect and reconnect J359 on the high-voltage power supply T PCA.
3. Disconnect and reconnect J114 on the DC controller PCA.
4. If the error persists, replace the front fan FM6.

Part number: RK2-6124-000CN

For instructions: *Remove and replace: Rear Fan FM6* See the Repair Service Manual for this product.

58.WX.YZ error messages

58.* errors

Errors in the 58.* family indicate an electrical problem inside the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Make sure the printer is connected to a dedicated power outlet and not to a surge protector or other type of extension cord.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for LaserJet printers

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.

2. Make sure the printer is connected to a dedicated power outlet and not to a surge protector or other type of extension cord.
3. Check all connections on the DC controller and the power supply. Trace the connections from the DC controller and power supply to the sensors and other components, and reseal them if necessary.
4. If the error persists, replace the DC controller or the power supply.

58.00.02 Error

Environmental sensor failure.

Recommended action for customers

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues.

Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Disconnect and reconnect the connection on the environment sensor and connector J124 on the DC controller PCA.
3. If the error persists, replace the environmental sensor.

Part number: RM2-8440-000CN

For instructions: *Removal and replacement: Environment sensor PCA* See the Repair Service Manual for this product.

58.00.03 Error

DC controller failure.

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.


Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, print an engine test to verify the printer engine is functioning.

- a. Ensure paper is loaded in tray 2.
- b. Use a small, pointed object to depress the test-page switch located on the rear of the product.

Figure 6-159 Engine test button

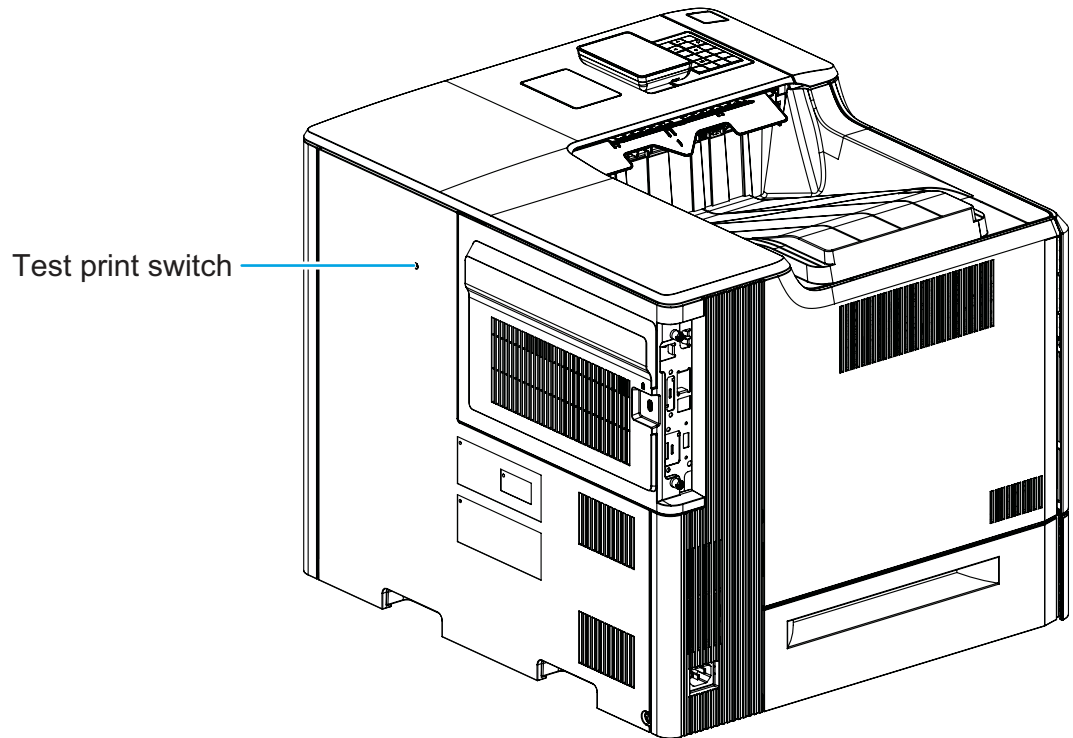

- c. Check if the test page prints successfully.



NOTE: A successful test page will have a series of horizontal lines.

3. If the engine page does NOT print successfully, replace the DC Controller.

Table 6-113 DC controller assembly part number

Part description	Part number
DC controller PC board assembly	RM3-7030-000CN
For products: M652/M653	
DC controller PC board assembly	RM3-7031-000CN
For products: M681/M682	

For instructions: *Removal and replacement: DC controller PCA* See the Repair Service Manual for this product.


4. If the engine test prints successfully and the issue persists, elevate the case as per your region's escalation process

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, print an engine test to verify the printer engine is functioning.
 - a. Ensure paper is loaded in tray 2.
 - b. Use a small, pointed object to depress the test-page switch located on the rear of the product.

Figure 6-160 Engine test button

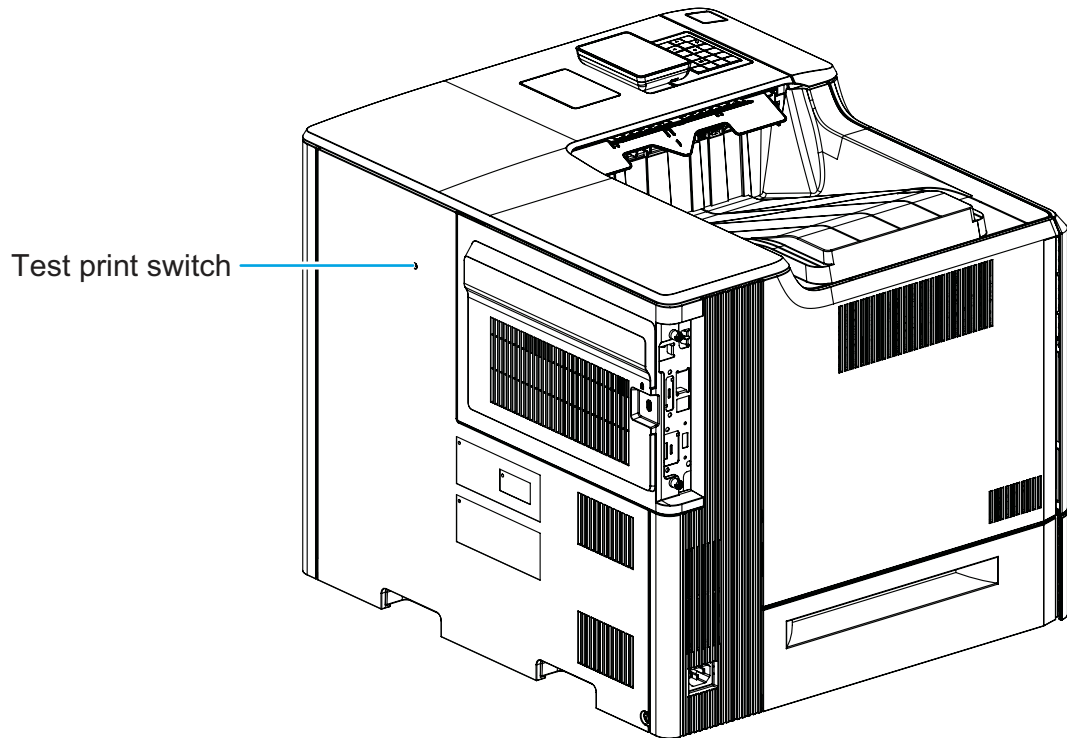


- c. Check if the test page prints successfully.



NOTE: A successful test page will have a series of horizontal lines.

3. If the issue persists, disconnect and reconnect all connections on the DC controller.

Figure 6-161 DC Controller PCA connectors

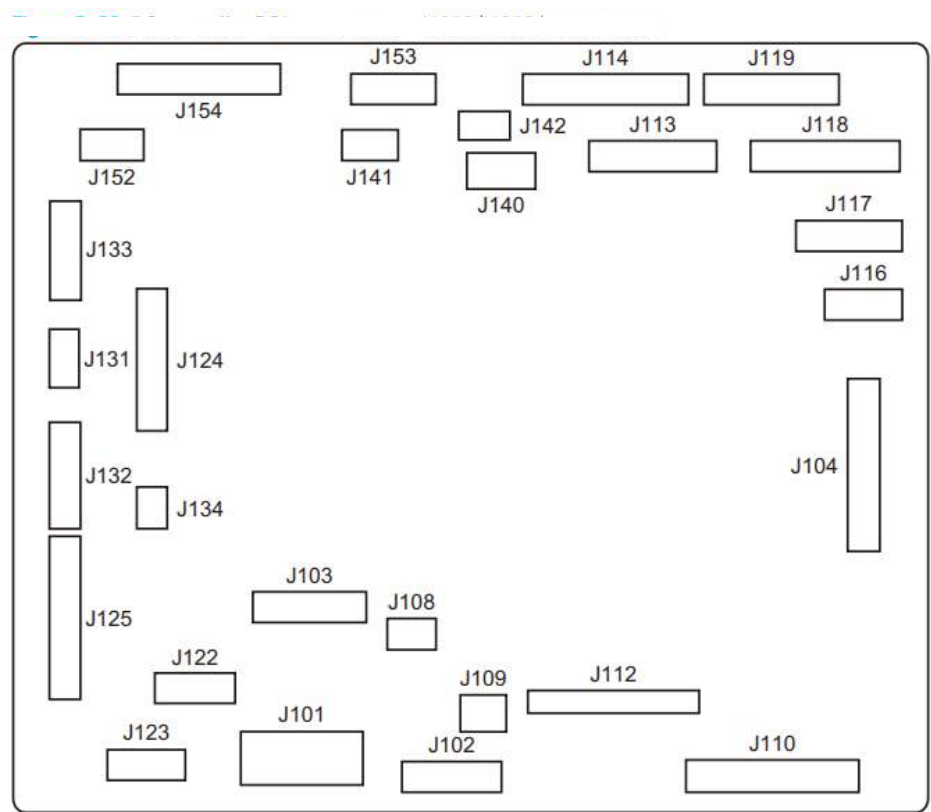

4. If the issue persists, replace the DC Controller.

Table 6-114 DC controller assembly part number

Part description	Part number
DC controller PC board assembly	RM3-7030-000CN
For products: M652/M653	
DC controller PC board assembly	RM3-7031-000CN
For products: M681/M682	

For instructions: *Removal and replacement: DC controller PCA* See the Repair Service Manual for this product.

5. If the engine test prints successfully and the issue persists, elevate the case as per your region's escalation process.

58.00.04 Error

Low-voltage power supply unit malfunction.

Recommended action for customers

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues.

Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues.

Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. Ensure the printer is plug into a dedicated power outlet.
3. Disconnect and reconnect J101, J102, and J103 on the DC controller PCA and ensure the a securely seated.
4. If the error persists, replace the low-voltage power supply (LVPS).

110V part number: RM2-8421-000CN

220V part number: RM2-8422-000CN

For instructions: *Removal and replacement: Low-voltage power supply* See the Repair Service Manual for this product.

58.01.04 Error

24V power supply error during operation.

During a regular printing operation the 24V power supply experienced an error.

Recommended action for customers

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues.

Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues.

Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. Ensure the printer is plug into a dedicated power outlet.
3. If the error persists, replace the low-voltage power supply (LVPS).

110V part number: RM2-8421-000CN

220V part number: RM2-8422-000CN

For instructions: *Removal and replacement: Low-voltage power supply* See the Repair Service Manual for this product.

58.02.04 Error

24V power supply error during printer power on or wake up.

During the printer power on, or when waking from a sleep mode, the printer experienced an error with the 24V power supply.



NOTE: Check the voltage of the unit on the regulatory sticker. This event is directly related to a 220V printer being plugged into a 110V outlet. Ensure that the voltage of the outlet matches the voltage of the printer.

Recommended action for customers

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues.

Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues.

Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. Ensure the printer is plugged into a dedicated power outlet.
3. If the error persists, replace the low-voltage power supply (LVPS).

110V part number: RM2-8421-000CN

220V part number: RM2-8422-000CN

For instructions: *Removal and replacement: Low-voltage power supply* See the Repair Service Manual for this product.

59.WX.YZ error messages

59.* errors

Errors in the 59.* family indicate a problem with one of the motors or with the lifter drive assembly for one of the trays.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Check all connections on the main control board of the printer, (DC controller, Engine control board ECB) each motor, and to the paper feeder drive PCA (for an optional paper feeder). Reseat them if necessary.

59.00.00 Motor error

Paper path motor malfunction M5 pickup motor.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, replace the pickup motor M5.

Part number: RK2-7757-000CN

For instructions: *Removal and replacement: Pickup motor* See the Repair Service Manual for this product.


 **IMPORTANT:** Notes should be added for onsite technician to check the connectors on the DC controller for the specific motor before replacing any parts. This is especially important if any previous parts have been replaced.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.


1. Turn the printer off, and then on.
2. If the issue persists, run the [Tray 2 pickup motor](#) (M5) component test using the printer control panel.
 - a. From the Home screen on the printer control panel, select [Support Tools](#).
 - b. Open the following menus:
 - i. [Troubleshooting](#)
 - ii. [Diagnostic Tests](#)
 - iii. [Component Test](#)
 - c. Select the [Tray 2 pickup motor](#) option, and then select [Start](#).

Figure 6-162 Tray 2 pickup motor component Test

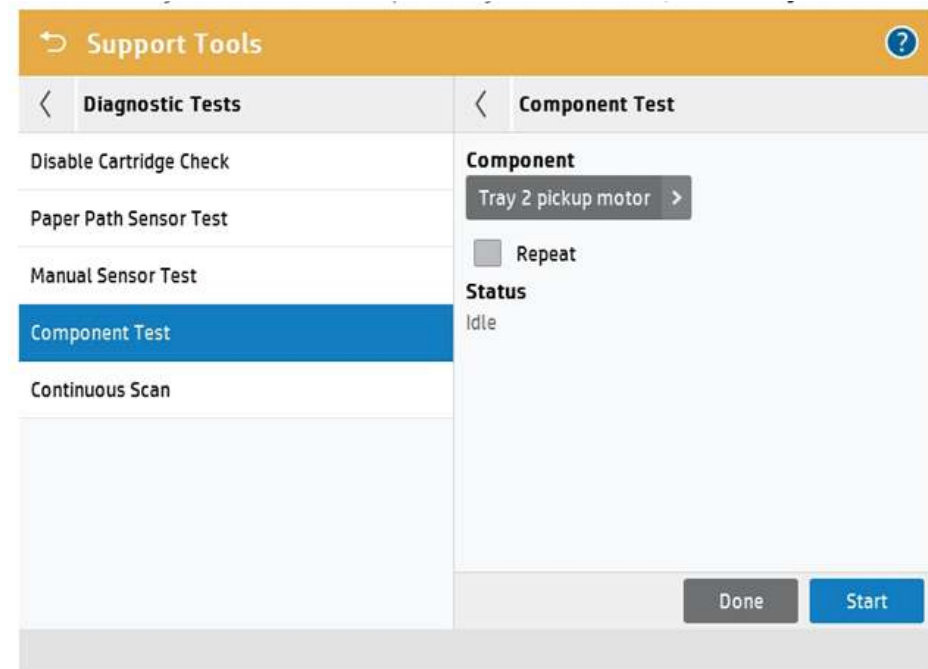

3. If the motor fails to actuate, disconnect and reconnect the pickup motor connector, J122 on the DC controller PCA.

Figure 6-163 J122: Pickup motor connector on the DC controller

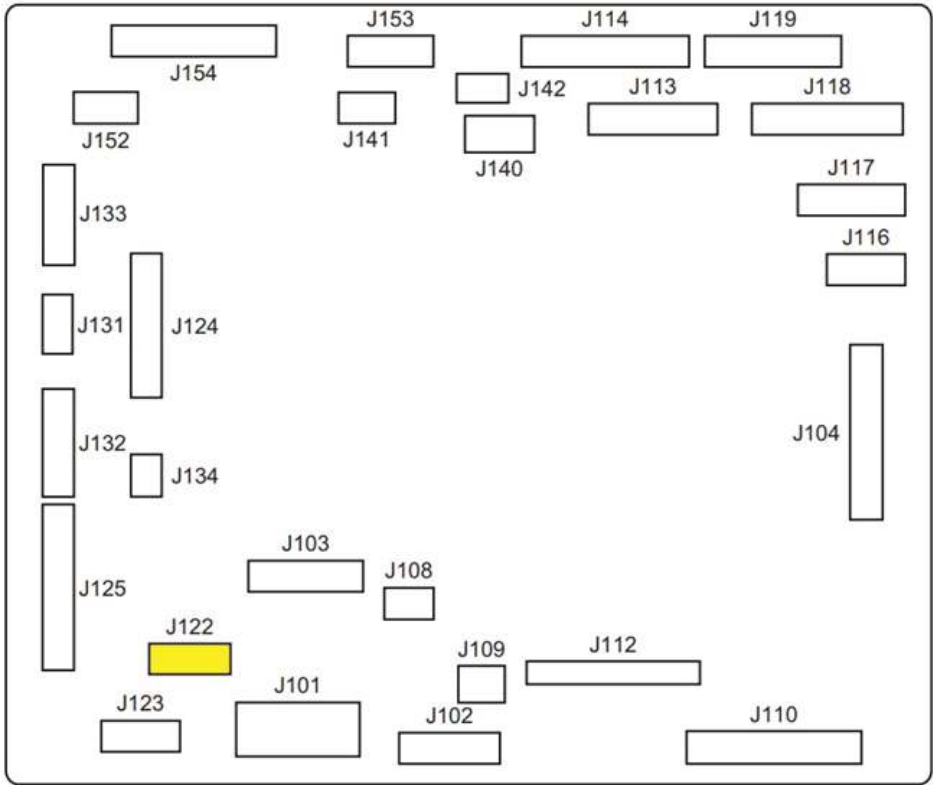

4. If the error persists, replace the pick-up motor M5.

Table 6-115 Pick-up motor part number

Description	Part number
Pick-up motor	RK2-7757-000CN

For instructions: *Removal and replacement: Pickup motor* See the Repair Service Manual for this product.

5. If the error persists after the motor has been replaced, replace the DC controller.

Table 6-116 DC controller assembly part number

Part description	Part number
DC controller PC board assembly	RM3-7030-000CN
For products: M652/M653	
DC controller PC board assembly	RM3-7031-000CN
For products: M681/M682	

For instructions: *Removal and replacement: DC controller PCA* See the Repair Service Manual for this product.

59.00.04 Duplex Motor error

Duplex motor M8 malfunction.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

For more information about this error, go to [HP LaserJet Enterprise, HP PageWide Enterprise - 59.0X.YZ Errors](#).

1. Use the power button to turn off the printer.
2. Disconnect the power cable from the printer.
3. Wait for one minute, and then reconnect the power cable.
4. Use the power button to turn on the printer, and then check if the error persists.
5. If the issue persists, open the right door, and check the paper path for any jams or obstructions.
6. Remove any jammed paper, debris, or objects found in the paper path.
7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then disconnect the power cable from the printer.
2. Wait for one minute, reconnect the power cable, and then turn on the printer. Check if the error persists.
3. If the issue persists, open the right door, and check the paper path for any jams or obstructions.
4. Remove any jammed paper, debris, or objects found in the paper path.
5. If the issue persists, replace the right door assembly.

Part number: RM2-6622-000CN

For instructions: *Removal and replacement: Right door* See the Repair Service Manual for this product.



IMPORTANT: Notes should be added for onsite technician to check the connectors on the DC controller for the specific motor before replacing any parts. This is especially important if any previous parts have been replaced.


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then disconnect the power cable from the printer.


2. Wait for one minute, reconnect the power cable, and then turn on the printer. Check if the error persists.
3. If the issue persists, open the right door, and then check the paper path for any jams or obstructions.
4. Remove any jammed paper, debris, or objects found in the paper path.
5. If the issue persists, run the [Switchback Motor](#) test (M8) to verify motor functionality.
 - a. From the Home screen on the printer control panel, select [Support Tools](#).
 - b. Open the following menus:
 - i. [Troubleshooting](#)
 - ii. [Diagnostic Tests](#)
 - iii. [Component Test](#)
 - c. Select the [Switchback Motor](#) option, and then select [Start](#).

Figure 6-164 Switchback Motor component test

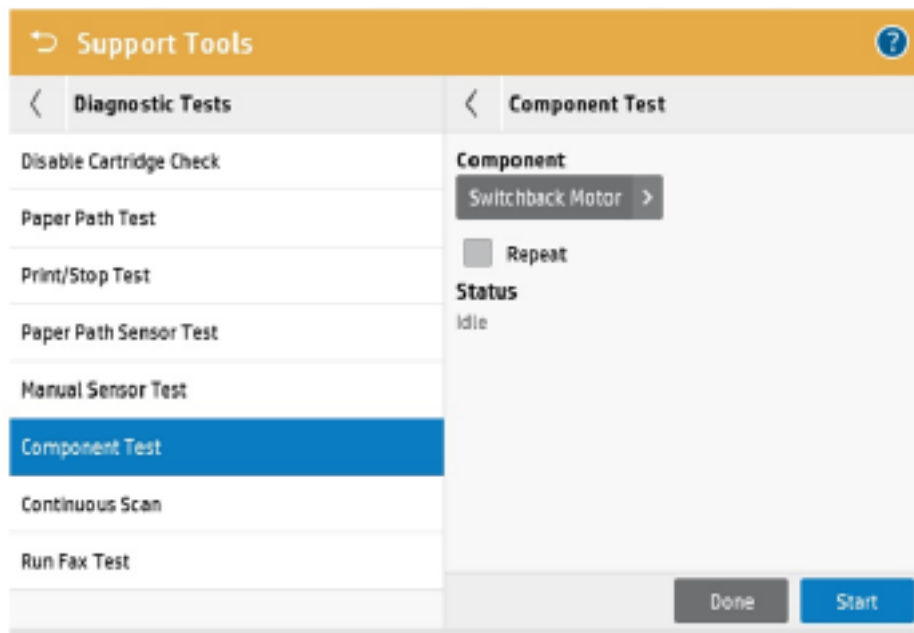

6. If the test fails, disconnect and reconnect the duplex switchback motor connector, J153 on the DC controller PCA and the connector on the M8 motor.

Figure 6-165 J153 connector on the DC controller PCA

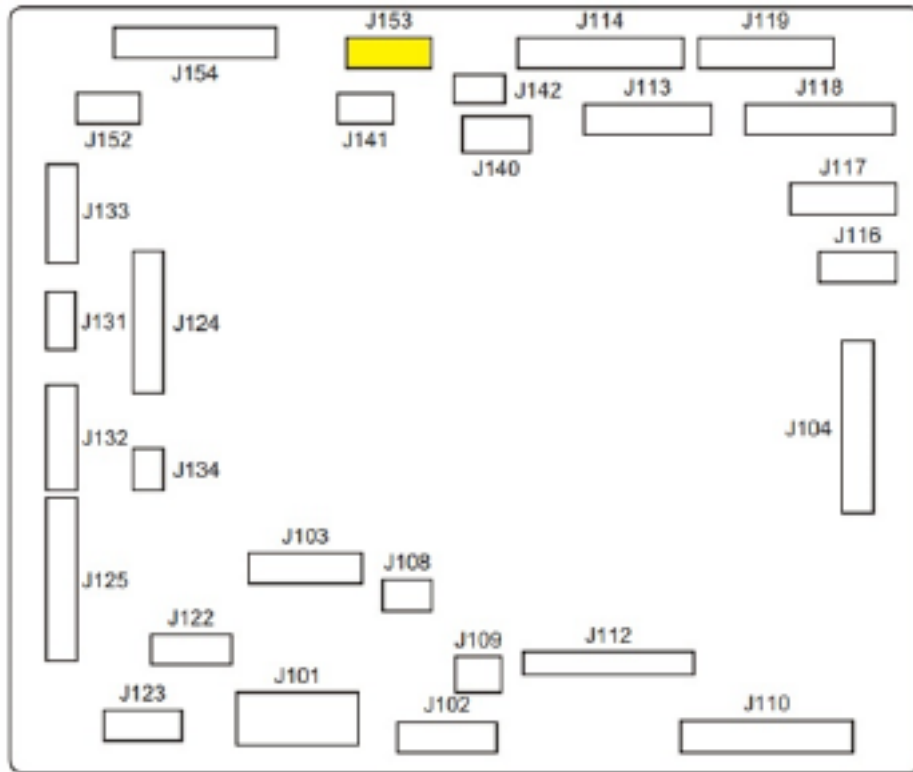

 **NOTE:** To view the motor connection, open the right door and on the bottom right, check the purple cable.

Figure 6-166 Motor connection



7. Repeat the [Switchback Motor](#) test to verify motor functionality. If the test fails, replace the right door assembly.

Table 6-117 Right door assembly part number

Description	Part number
Right door assembly	RM2-6622-000CN

For instructions: *Removal and replacement: Right door* See the Repair Service Manual for this product.

8. If the error persists, replace the DC controller.

Table 6-118 DC controller assembly part number

Part description	Part number
DC controller PC board assembly For products: M652/M653	RM3-7030-000CN
DC controller PC board assembly For products: M681/M682	RM3-7031-000CN
DC controller PCA For products: E65150-E65160	RM3-7603-000CN
DC controller PCA For products: E67650-E67660	RM3-7606-000CN

For instructions: *Removal and replacement: DC controller PCA* See the Repair Service Manual for this product.

59.00.30 or 59.00.40: Fuser error

Fuser motor M4 start up error or fuser motor M4 rotational error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, turn off the printer.
3. Open the right door, remove and reseal the fuser.

 **CAUTION:** The fuser might be hot.

4. Use the power button to turn on the printer, and then check if the error persists.
5. If the issue persists, replace the fuser.

Table 6-119 Fuser assembly part numbers

Description	Part number
110V Fuser Assembly	RM2-1928-030CN
220V Fuser Assembly	RM2-1929-020CN

For instructions: *Removal and replacement: Fuser*

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, turn off the printer.
3. Open the right door, and then remove the fuser.

 **CAUTION:** The fuser might be hot.

4. Rotate the fuser gears to ensure they move freely. If they do not move freely, replace the fuser.

Table 6-120 Fuser assembly part numbers


Description	Part number
110V Fuser Assembly	RM2-1928-030CN
220V Fuser Assembly	RM2-1929-020CN

For instructions: *Removal and replacement: Fuser*

5. If the issue persists, perform a [Fuser motor](#) (M4) component test using the printer control panel.
 - a. From the Home screen on the printer control panel, select [Support Tools](#).
 - b. Open the following menus:
 - i. [Troubleshooting](#)
 - ii. [Diagnostic Tests](#)
 - iii. [Component Test](#)


- c. Select the **Fuser motor** option, and then select **Start**.

Figure 6-167 Fuser motor component test

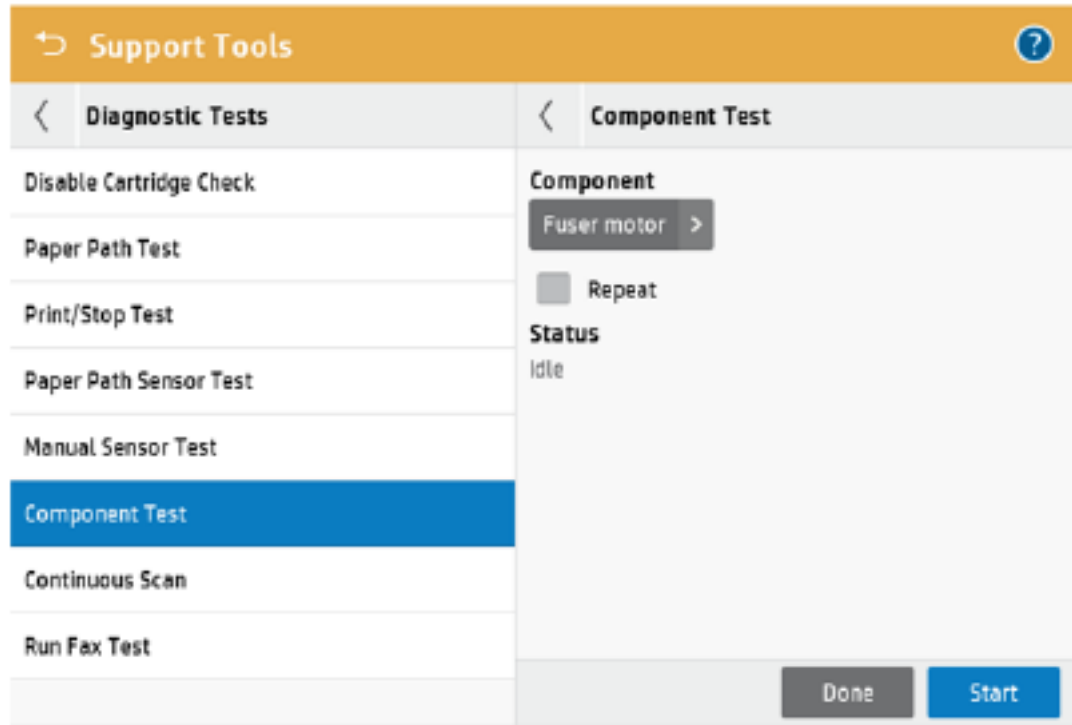

6. If the fuser motor test fails to actuate or does not function correctly, disconnect and reconnect the J118 connector on the DC controller and fuser motor (M4) connector.

Figure 6-168 J118 on the DC Controller

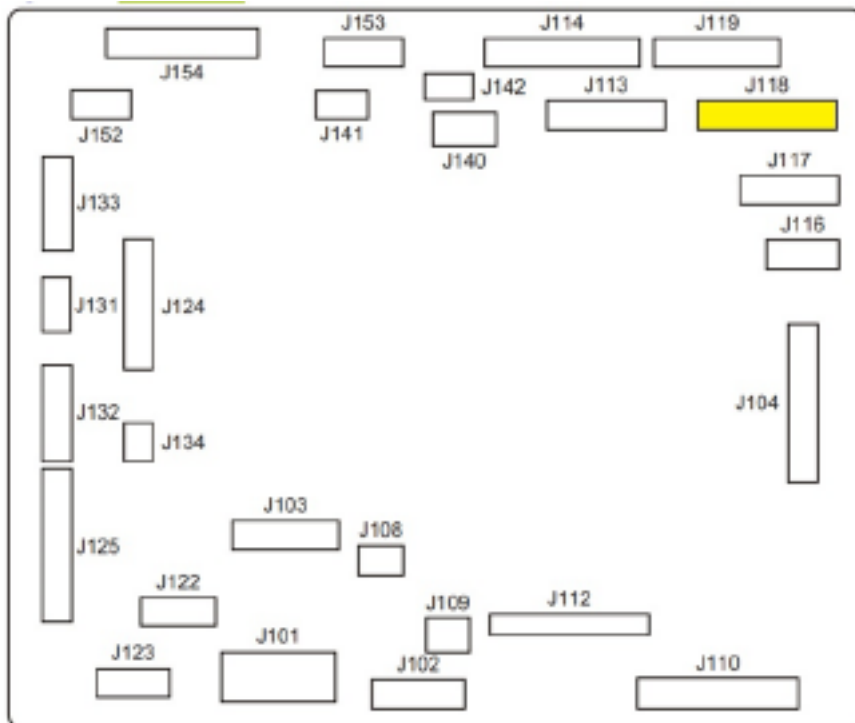

7. Repeat the [Fuser Motor](#) component test. If the test fails, replace the fuser motor assembly.

Table 6-121 Fuser motor (M4) assembly part number

Description	Part number
Fuser motor (M4) assembly	RM2-1955-000CN

For instructions: *Removal and replacement: Fuser motor* See the Repair Service Manual for this product.

8. If the error persists, replace the DC controller.

Table 6-122 DC controller assembly part number

Part description	Part number
DC controller PC board assembly	RM3-7030-000CN
For products: M652/M653	
DC controller PC board assembly	RM3-7031-000CN
For products: M681/M682	

For instructions: *Removal and replacement: DC controller PCA* See the Repair Service Manual for this product.

59 . 00 . B0 Replace Toner Collection Unit

The toner collection unit TCU is full or TCU motor experienced an error.

Recommended action for customers

1. From the control panel, open the [Supplies](#) menu, and then check the status of the toner collection unit (TCU). If the unit is full, replace it.

Part number: RM2-6613-000CN

To order parts, go to <https://www.hp.com/buy/parts>.
2. If the TCU is not full, toner might be clogging the image transfer belt (ITB). Clean the ITB and the purge toner as follows:
 - a. Open the following menus:
 - [Maintenance](#)
 - [Calibration/Cleaning](#)
 - b. Select [Prepare for Shipping](#) and the touch [Start](#). This will move all toner into the TCU from the ITB and cleaning blade area. This test takes about two minutes.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Check the toner collection unit. If the unit is full, replace it.
Part number: RM2-6613-000CN
2. If the TCU is not full, check if there is toner clogging the ITB. Clean and reinstall the ITB as needed.
3. Clean the ITB and the purge toner.
 - a. Open the following menus:
 - [Maintenance](#)
 - [Calibration/Cleaning](#)
 - b. Select [Prepare for Shipping](#) and the touch [Start](#). This will move all toner into the TCU from the ITB and cleaning blade area. This test takes about two minutes.
4. If the error persists replace the ITB

Use the following table to order or replace the ITB for the printer.

Table 6-123 ITB part number

Customer type	Part number	Description
Managed Print Services (MPS)	P1B93-69001	Intermediate Transfer Belt PM Kit
All others (non-MPS)	P1B93-67901	Image transfer belt - Includes tray 2 transfer roller, paper pick-up roller, tray 2 separation roller, retard roller, and transfer roller guide.

For instructions: *Removal and replacement: Intermediate transfer belt*

59.00.C0

Developer alienation motor M6 error

Recommended action for customers

Follow these troubleshooting steps in the order presented.

For more information about this error, go to [HP LaserJet Enterprise, HP PageWide Enterprise - 59.0X.YZ Errors](#).

1. Use the power button to turn off the printer.
2. Disconnect the power cable from the printer.
3. Wait for one minute, and then reconnect the power cable.
4. Use the power button to turn on the printer, and then check if the error persists.
5. If the issue persists, open the front door to remove the four cartridges.
6. Install the cartridge one at a time, and then check if the error occurs.

- a. Open the front door.
 - b. Grasp the handle of the toner cartridge and pull it out to remove it.
 - c. Align the toner cartridge with its slot, and then insert the toner cartridge into the printer.
 - d. Close the front door.
7. If the error occurs for a specific cartridge installed, replace that cartridge.
 8. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then disconnect the power cable from the printer.
2. Wait for one minute, reconnect the power cable, and then turn on the printer. Check if the error persists.
3. If the issue persists, open the front door to remove the four cartridges.
4. Install the cartridge one at a time, close the front door each time, and then check if the error occurs for a specific cartridge.
5. If the error occurs for a specific cartridge installed, replace the defective cartridge.
6. If the error persists when all cartridges are removed, replace the developing disengagement motor (M6).

Table 6-124 Developing disengagement motor (M6) part number

Description	Part number
Developing disengagement motor (M6)	RK2-6027-000CN

For instructions: *Removal and replacement: Developer alienation motor* See the Repair Service Manual for this product.


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then disconnect the power cable from the printer.
2. Wait for one minute, reconnect the power cable, and then turn on the printer. Check if the error persists.
3. If the issue persists, open the front door to remove the four cartridges.
4. Install the cartridge one at a time, close the front door each time, and then check if the error occurs for a specific cartridge.
5. If the error occurs for a specific cartridge installed, replace that cartridge.
6. If the error persists when all cartridges are removed, perform an [Alienation motor](#) test, the developer disengagement motor (M6).


- a. From the Home screen on the printer control panel, select [Support Tools](#).
- b. Open the following menus:
 - i. [Troubleshooting](#)
 - ii. [Diagnostic Tests](#)
 - iii. [Component Test](#)
- c. Select the [Alienation motor](#) option, and then select [Start](#).

Figure 6-169 Alienation motor component test

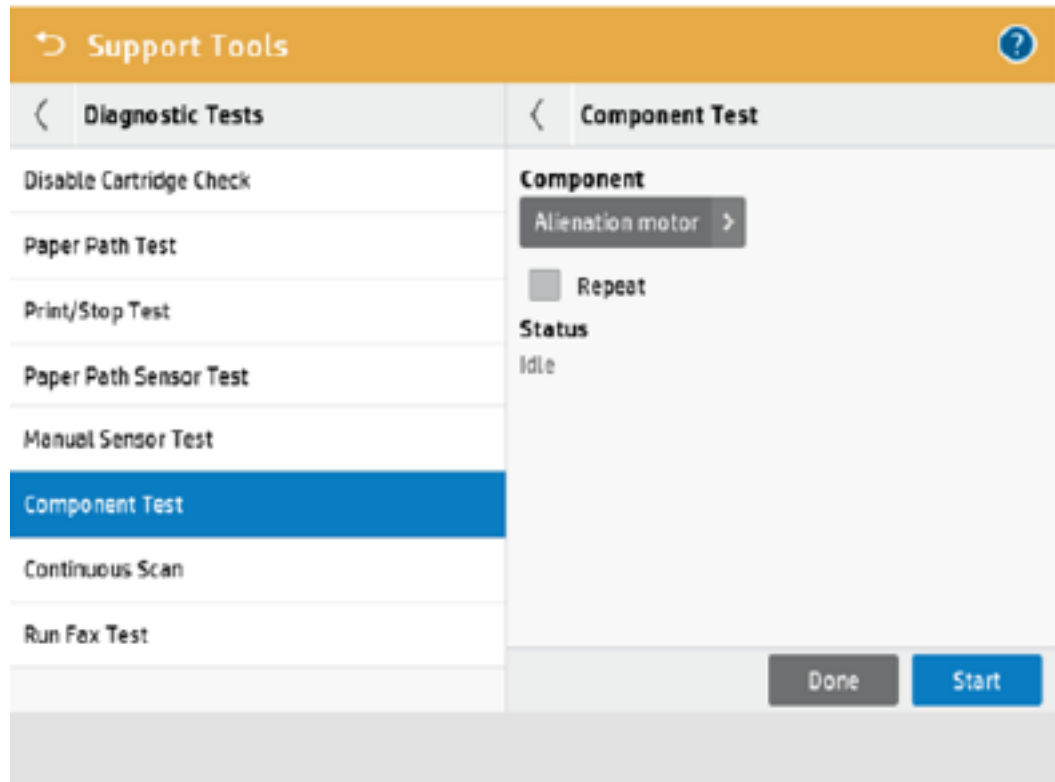

7. If the [Alienation motor](#) component test fails and the developer disengagement motor (M6) fails to actuate or function correctly, disconnect and reconnect J354 on the HVT-T PCA and J38 connection to the developer disengagement motor (M6).

Figure 6-170 J354, HVT-T PCA connectors

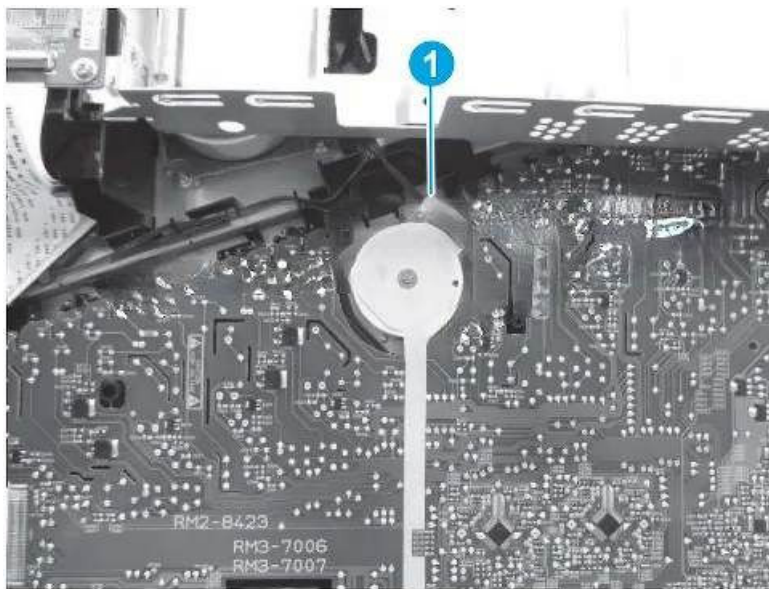

8. If the error persists, replace the developing disengagement motor (M6).

Table 6-125 Developing disengagement motor (M6) part number

Description	Part number
Developing disengagement motor (M6)	RK2-6027-000CN

For instructions: *Removal and replacement: Developer alienation motor* See the Repair Service Manual for this product.

9. If the error persists, replace the Lower high-voltage power supply PC board assembly.

Table 6-126 Lower high-voltage power supply (HVPS) part number

Description	Part number
Lower high-voltage power supply PC board assembly	RM3-7006-000CN

10. If the error persists after the motor has been replaced, replace the DC controller.

Table 6-127 DC controller assembly part number

Part description	Part number
DC controller PC board assembly	RM3-7030-000CN
For products: M652/M653	
DC controller PC board assembly	RM3-7031-000CN
For products: M681/M682	

For instructions: *Removal and replacement: DC controller PCA* See the Repair Service Manual for this product.

59.00.F0

ITB alienation mechanism failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure that the ITB is correctly installed.
3. Replace the ITB assembly.

Use the following table to order or replace the ITB for the printer.

Table 6-128 ITB part number

Customer type	Part number	Description
Managed Print Services (MPS)	P1B93-69001	Intermediate Transfer Belt PM Kit
All others (non-MPS)	P1B93-67901	Image transfer belt - Includes tray 2 transfer roller, paper pick-up roller, tray 2 separation roller, retard roller, and transfer roller guide.

For instructions: *Removal and replacement: Intermediate transfer belt*

4. If the error persists, replace the estrangement detect PCA assembly.

Part number: RM2-7157-000CN

For instructions: *Removal and replacement: Estrangement detect PCA* See the Repair Service Manual for this product.

5. If the error persists, replace the fuser drive assembly.

Part number: RM2-1934-000CN

For instructions: *Removal and replacement: Fuser drive assembly* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Ensure that the ITB is correctly installed.
3. Remove the ITB and manually actuate the alienation mechanism on the ITB. If it does not rotate, replace the ITB.

Use the following table to order or replace the ITB for the printer.

Table 6-129 ITB part number

Customer type	Part number	Description
Managed Print Services (MPS)	P1B93-69001	Intermediate Transfer Belt PM Kit
All others (non-MPS)	P1B93-67901	Image transfer belt - Includes tray 2 transfer roller, paper pick-up roller, tray 2 separation roller, retard roller, and transfer roller guide.

For instructions: *Removal and replacement: Intermediate transfer belt*

4. With the ITB out of the printer, test the alienation home position sensor PS106. Open the following menus:
 - a. [Support Tools](#)
 - b. [Troubleshooting](#)
 - c. [Diagnostic Tests](#)
 - d. [Manual Sensor Test](#)
 - e. Run the T1 roller alienation sensor SR1901 test.
 - f. Defeat the sensor inside the printer where the ITB installs against the back wall.
 - g. If the test fails, reconnect the connector J1901 of the T1 roller alienation sensor, connectors J357 and J351 on the high-voltage power supply -T PCA and connector J114 on the DC controller PCA.
 - h. Retest the sensor. If the error persists, replace the estrangement detect PCA assembly.
 Part number: RM2-7157-000CN
 For instructions: *Removal and replacement: Estrangement detect PCA* See the Repair Service Manual for this product.
5. If the previous procedures check out good and do not resolve the issue, replace the fuser drive assembly.
 Part number: RM2-1934-000CN
 For instructions: *Removal and replacement: Fuser drive assembly* See the Repair Service Manual for this product.

 **NOTE:** When replacing the fuser drive assembly, ensure that the duplex refeed solenoid (blue wires) and the ITB cam rotation (yellow wires) connections are attached correctly. The two connections are the same 2 pin connector, but they connect to different lengths (violet) wires. See the following images

Figure 6-171 Wires correctly connected


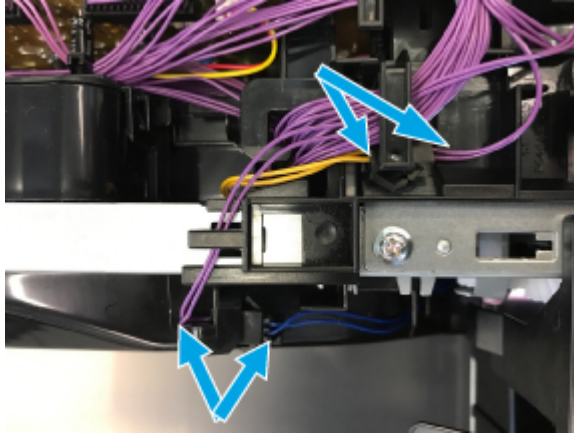


Figure 6-172 Wires connected incorrectly

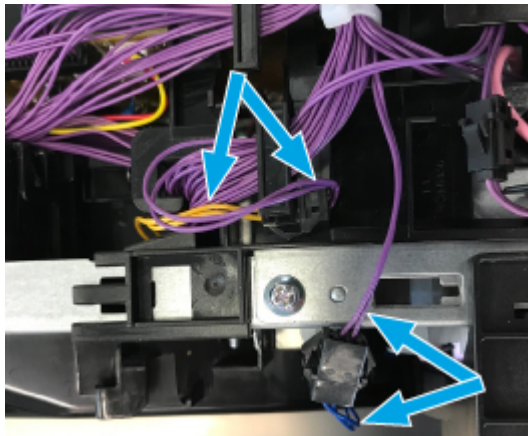

Notice how the duplex refeed solenoid connector (blue wires) will not reach, and is not seated in the retainer to the left.

59.05.50 or 59.05.60

The printer experienced a black drum motor M3 error.

- **59.05.50** Black drum motor startup abnormality.
- **59.05.60** Black drum motor rotation abnormality.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

1. Turn the printer off.
2. Remove the black toner cartridge and turn the printer on.

3. Use the [Disable Cartridge](#) check and run the drum motor component test with the toner cartridge removed.

- If the test passes, replace the black cartridge.

HP 655A Black laser toner cartridge part number: CF450A

HP 656X High capacity Black laser toner cartridge part number: CF460A

HP 657X High capacity replacement Black laser toner cartridge part number: CF470A

- If the test fails, replace the drum motor M3.

Part number: RM2-1956-000CN

For instructions: *Removal and replacement: Drum motor 3* See the Repair Service Manual for this product.

 **IMPORTANT:** Notes should be added for onsite technician to check the connectors on the DC controller for the specific motor before replacing any parts. This is especially important if any previous parts have been replaced.

Recommended action for onsite technicians

1. Turn the printer off.
2. Remove the black toner cartridge and turn the printer on.
3. Use the [Disable Cartridge](#) check and run the drum motor component test with the toner cartridge removed.

- If the test passes, replace the black cartridge. If the printer has been serviced, check the connector at the drum motor assembly and the DC controller.

HP 655A Black laser toner cartridge part number: CF450A

HP 656X High capacity Black laser toner cartridge part number: CF460A

HP 657X High capacity replacement Black laser toner cartridge part number: CF470A

- If the test fails, skip to next step.

4. Disconnect and reconnect the connector J55 of the drum motor 3 and connector J118 on the DC controller PCA.

5. If the error persists, replace the drum motor 3.

Part number: RM2-1956-000CN

For instructions: *Removal and replacement: Drum motor 3* See the Repair Service Manual for this product.

59.06.50 or 59.06.60 – 59.07.50 or 59.07.60

The printer experienced a cyan/magenta drum/developer motor M2 error.

- **59.06.50** Cyan drum motor startup abnormality.
- **59.06.60** Cyan drum motor rotation abnormality.

- **59.07.50** Magenta drum motor startup abnormality.
- **59.07.60** Magenta drum motor rotation abnormality.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

1. Turn the printer off.
2. Remove the cyan and magenta toner cartridges and turn the printer on.
3. Use the [Disable Cartridge](#) check and run the drum motor component test with the toner cartridges removed.

- If the test passes, check each toner cartridge to see if its drum can be rotated by the drive gear.

Replace the defective toner cartridge.

HP 655A Cyan laser toner cartridge part number: CF451A

HP 655A Magenta laser toner cartridge part number: CF452A

HP 656X High capacity Cyan laser toner cartridge part number: CF461A

HP 656X High capacity Magenta laser toner cartridge part number: CF456A

HP 657X High capacity replacement Cyan laser toner cartridge part number: CF471A

HP 657X High capacity replacement Magenta laser toner cartridge part number: CF476A

- If the test fails, replace the drum motor M2.

Part number: RM2-1956-000CN

For instructions: *Removal and replacement: Drum motor 2* See the Repair Service Manual for this product.



IMPORTANT: Notes should be added for onsite technician to check the connectors on the DC controller for the specific motor before replacing any parts. This is especially important if any previous parts have been replaced.

Recommended action for onsite technicians

1. Turn the printer off.
2. Remove the cyan and magenta toner cartridges and turn the printer on.

3. Use the [Disable Cartridge](#) check and run the drum motor component test with the toner cartridges removed.
 - If the test passes, check each toner cartridge to see if its drum can be rotated by the drive gear.

Replace the defective toner cartridge.

HP 655A Cyan laser toner cartridge part number: CF451A

HP 655A Magenta laser toner cartridge part number: CF452A

HP 656X High capacity Cyan laser toner cartridge part number: CF461A

HP 656X High capacity Magenta laser toner cartridge part number: CF456A

HP 657X High capacity replacement Cyan laser toner cartridge part number: CF471A

HP 657X High capacity replacement Magenta laser toner cartridge part number: CF476A
 - If the test fails, skip to next step.
4. Disconnect and reconnect the connector J59 of the drum motor 3 and connector J119 on the DC controller PCA.
5. If the error persists, replace the drum motor 2.

Part number: RM2-1956-000CN

For instructions: *Removal and replacement: Drum motor 2* See the Repair Service Manual for this product.

59.08.50 or 59.08.60

The printer experienced a yellow/magenta drum/developer motor M1 error.

- **59.05.50** Yellow drum motor startup abnormality.
- **59.05.60** Yellow drum motor rotation abnormality.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

1. Turn the printer off.
2. Remove the yellow toner cartridge and turn the printer on.
3. Use the [Disable Cartridge](#) check and run the drum motor component test with the toner cartridge removed.
 - If the test passes, replace the yellow toner cartridge.

HP 655A Yellow laser toner cartridge part number: CF453A

HP 656X High capacity Yellow laser toner cartridge part number: CF463A

HP 657X High capacity replace Yellow laser toner cartridge part number: CF473A

- If the test fails, replace the drum motor M1.

Part number: RM2-1956-000CN

For instructions: *Removal and replacement: Drum motor 1* See the Repair Service Manual for this product.



IMPORTANT: Notes should be added for onsite technician to check the connectors on the DC controller for the specific motor before replacing any parts. This is especially important if any previous parts have been replaced.

Recommended action for onsite technicians

1. Turn the printer off.
2. Remove the yellow toner cartridge and turn the printer on.
3. Use the [Disable Cartridge](#) check and run the drum motor component test with the toner cartridge removed.

- If the test passes, replace the yellow toner cartridge.

HP 655A Yellow laser toner cartridge part number: CF453A

HP 656X High capacity Yellow laser toner cartridge part number: CF463A

HP 657X High capacity replace Yellow laser toner cartridge part number: CF473A

- If the test fails, replace the drum motor M1.

Part number: RM2-1956-000CN

For instructions: *Removal and replacement: Drum motor 1* See the Repair Service Manual for this product.



IMPORTANT: Reconnect the connector J58 of the drum motor 1 and connector J119 on the DC controller PCA.

59.A3.03

Tray 3 lift motor malfunction.


Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer.
2. Disconnect the power cable from the printer.
3. Wait for one minute, and then reconnect the power cable.
4. Use the power button to turn on the printer, and then check if the error persists.

5. If the issue persists, open tray 3 to check the top of the paper stack is below the tray full-indicator.
 - a. If the tray is overfilled, remove the entire stack of paper from the tray, straighten the stack, and then load some of the paper into the tray.
 - b. Make sure that all sheets of paper are below the stack-height markings on the tray.
 - c. Try to print and see if the issue persists.

Figure 6-173 Stack-height markings in tray 3

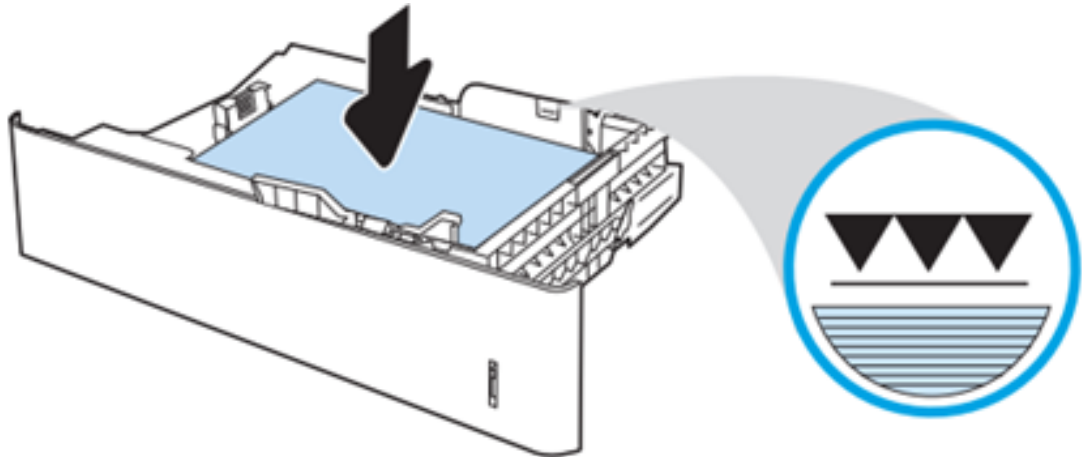


6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then disconnect the power cable from the printer.
2. Wait for one minute, and then reconnect the power cable.
3. Turn on the printer, and then check if the error persists.
4. If the issue persists, open Tray 3 to check the top of the paper stack is below the tray full-indicator.
 - a. If the tray is overfilled, remove the entire stack of paper from the tray, straighten the stack, and then load some of the paper into the tray.
 - b. Make sure that all sheets of paper are below the stack-height markings on the tray.
 - c. Try to print and see if the issue persists.

Figure 6-174 Stack-height markings in tray 3

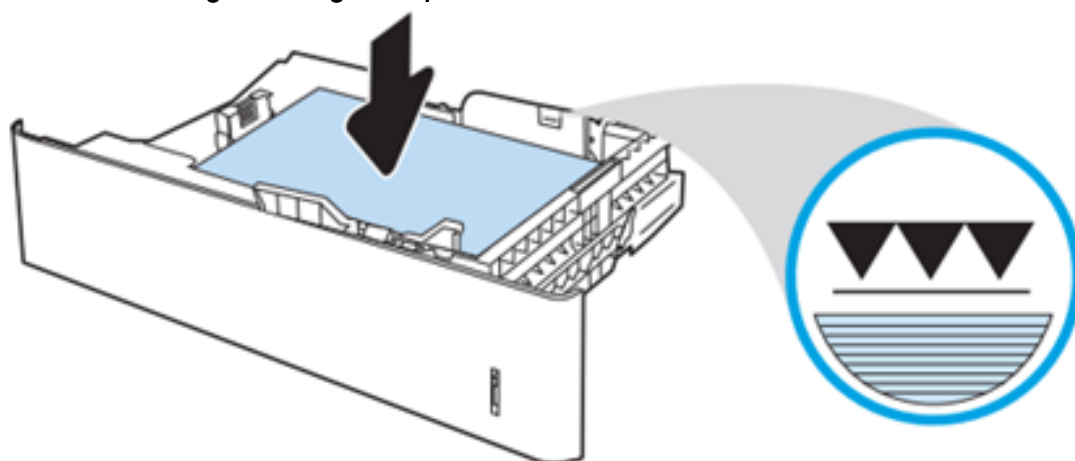

5. If the error persists, replace the pickup drive assembly and lifter drive assembly.

 **NOTE:** Notes should be added for onsite technician to check the connectors for the specific motor before replacing any parts. This is especially important if any previous parts have been replaced.

Table 6-130 Drive assembly part number and removal and replacement instructions

Paper tray	Drive assembly part number	Replacement instructions
550-sheet paper feeder	RM2-6934-000CN	<i>Removal and replacement: Drive assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	RM2-1222-000CN	<i>Removal and replacement: Drive assembly (1x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-1222-000CN	Tray 3: <i>Removal and replacement: Drive assembly (2500-sheet HCI, tray 3)</i> See the Repair Service Manual for this product. Tray 4: <i>Removal and replacement: Drive assembly (2500-sheet HCI, tray 4)</i> See the Repair Service Manual for this product.

Table 6-131 Lifter drive assembly part number and removal and replacement instructions

Paper tray	Lifter drive assembly part number	Replacement instructions
550-sheet paper feeder	RM2-6933-000CN	<i>Removal and replacement: Lifter drive assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (1x550 feeder with stand)</i> See the Repair Service Manual for this product.

Table 6-131 Lifter drive assembly part number and removal and replacement instructions (continued)


Paper tray	Lifter drive assembly part number	Replacement instructions
2500-sheet HCI	RM2-0915-000CN	<i>Removal and replacement: Lifter drive assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then disconnect the power cable from the printer.
2. Wait for one minute, and then reconnect the power cable.
3. Turn on the printer, and then check if the error persists.
4. If the issue persists, open Tray 3 to check the top of the paper stack is below the tray full-indicator.
 - a. If the tray is overfilled, remove the entire stack of paper from the tray, straighten the stack, and then load some of the paper into the tray.
 - b. Make sure that all sheets of paper are below the stack-height markings on the tray.
 - c. Try to print and see if the issue persists.

Figure 6-175 Stack-height markings in tray 3

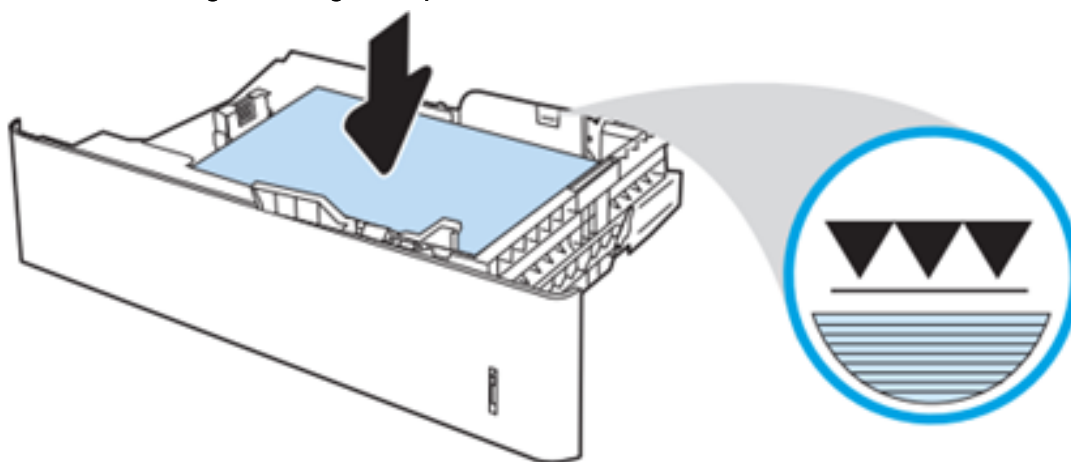


5. If the issue persists, perform a "Tray 3 paper surface" sensor test from the printer control panel.
 - a. From the Home screen on the printer control panel, select [Support Tools](#).
 - b. Open the following menus:
 - i. [Troubleshooting](#)
 - ii. [Diagnostic Tests](#)
 - iii. [Manual Sensor Test](#)
 - iv. [Paper Tray Surface Sensor](#)

- c. Select the [Tray 3 paper surface](#) to test the sensor state, and then select the [Reset](#) button.
- Open tray 3.
 - Check if the sensor actuator test indicator increments from 0 to 1.



NOTE: The sensor actuator count should advance by one each time the tray is opened and closed.

Figure 6-176 Paper Tray Surface Sensor test

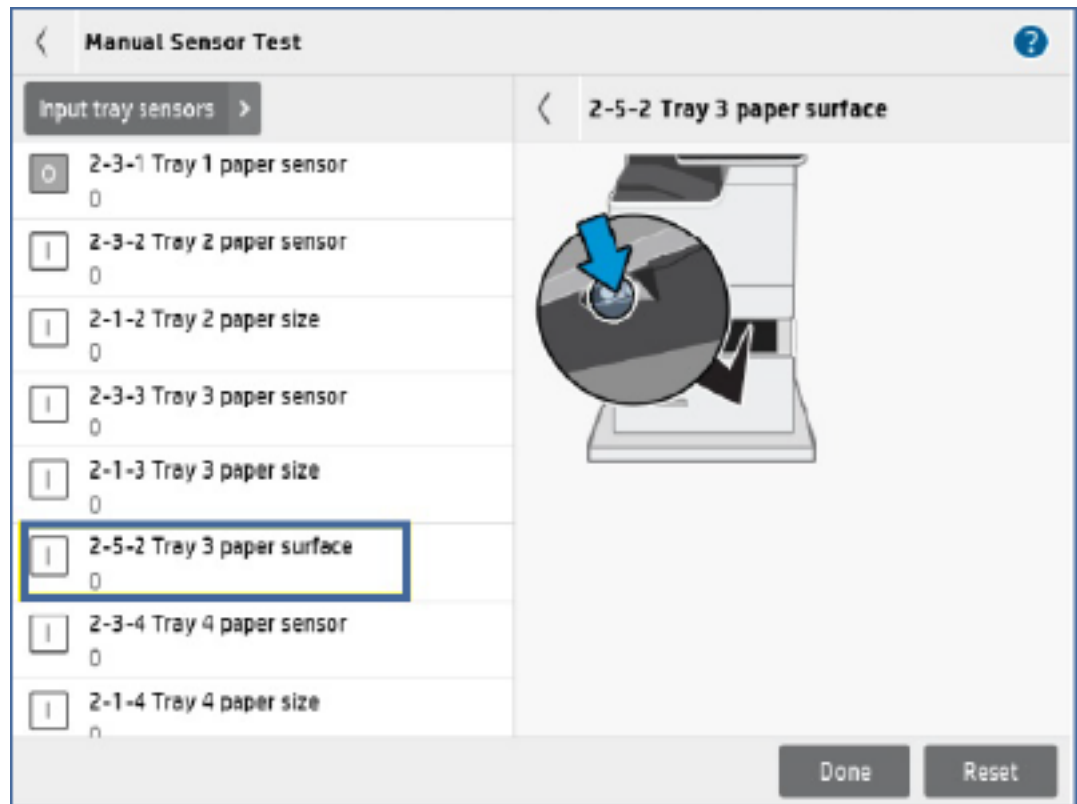

6. If the sensor test fails, disconnect and reconnect the "J5004" connector on the paper deck controller PCA.

Figure 6-177 Paper deck controller PCA connector, 1x550


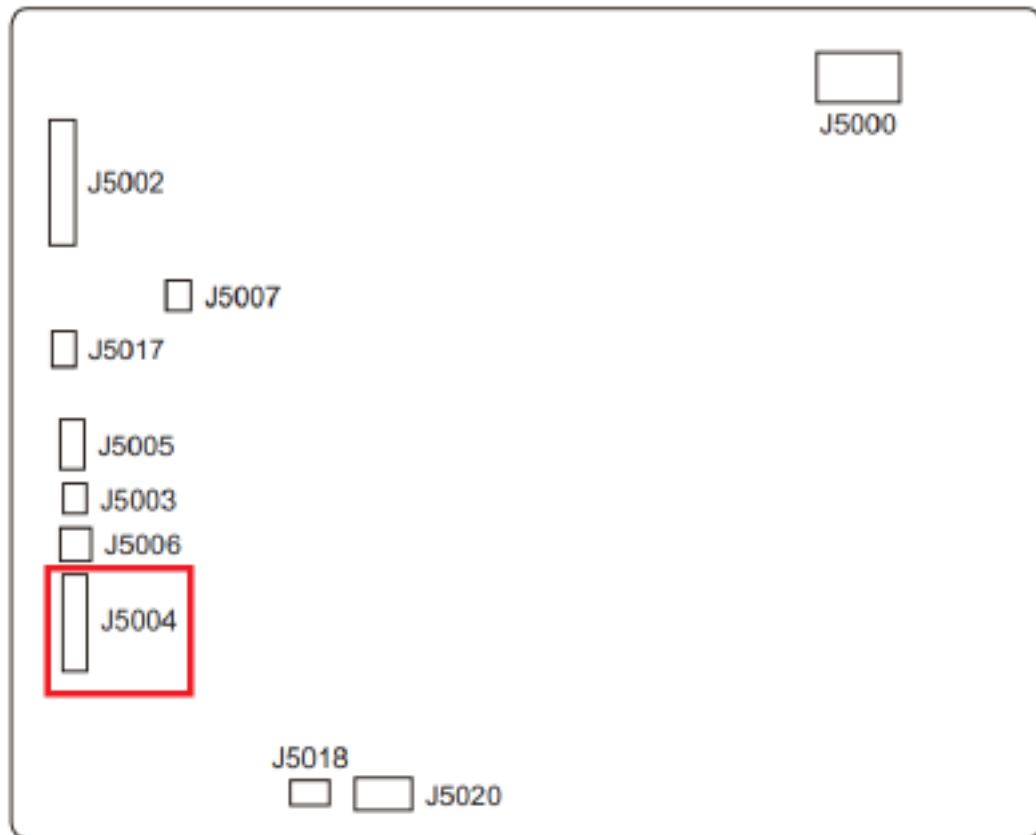


Figure 6-178 Paper deck controller PCA connector, 3x550 and 2,550

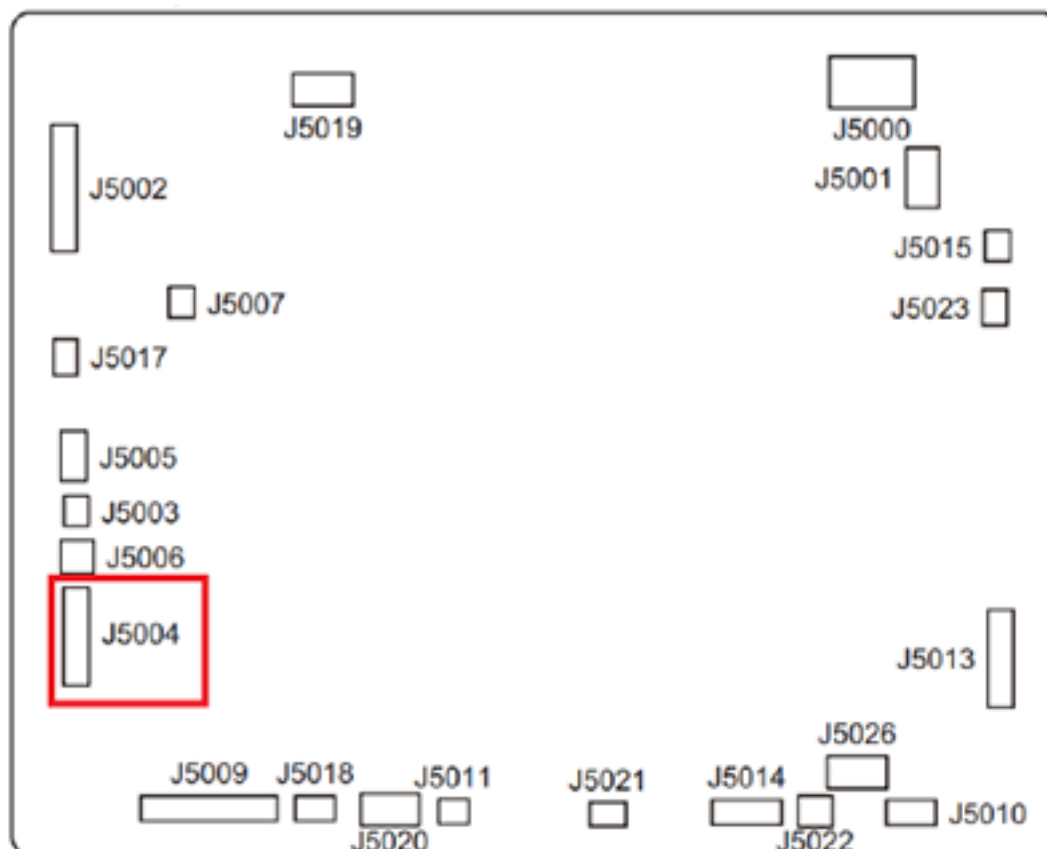

7. If the error persists, replace the appropriate lifter drive assembly.

Table 6-132 Drive assembly part number and removal and replacement instructions

Paper tray	Drive assembly part number	Replacement instructions
550-sheet paper feeder	RM2-6934-000CN	<i>Removal and replacement: Drive assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	RM2-1222-000CN	<i>Removal and replacement: Drive assembly (1x550 feeder with stand)</i> See the Repair Service Manual for this product.

Table 6-133 Lifter drive assembly part number and removal and replacement instructions

Paper tray	Lifter drive assembly part number	Replacement instructions
550-sheet paper feeder	RM2-6933-000CN	<i>Removal and replacement: Lifter drive assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (1x550 feeder with stand)</i> See the Repair Service Manual for this product.

Table 6-133 Lifter drive assembly part number and removal and replacement instructions (continued)

Paper tray	Lifter drive assembly part number	Replacement instructions
2500-sheet HCI	RM2-0915-000CN	<i>Removal and replacement: Lifter drive assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

8. If the issue persists, replace the feeder controller.

Table 6-134 Feeder controller PCA part number and removal and replacement instructions

Paper tray	Feeder controller PCA part number	Replacement instructions
550-sheet paper feeder	RM2-8491-000CN	<i>Removal and replacement: Feeder controller PCA (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	RM2-8482-000CN	<i>Removal and replacement: Feeder controller PCA (1x550 feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-8483-000CN	<i>Removal and replacement: Feeder controller PCA (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-8481-000CN	<i>Removal and replacement: Feeder controller PCA (2500-sheet HCI)</i> See the Repair Service Manual for this product.

9. If the issue persists, replace the DC controller.

Table 6-135 DC controller assembly part number

Part description	Part number
DC controller PC board assembly	RM3-7030-000CN
For products: M652/M653	
DC controller PC board assembly	RM3-7031-000CN
For products: M681/M682	

For instructions: *Removal and replacement: DC controller PCA* See the Repair Service Manual for this product.

59.A3.04

Tray 4 lift motor malfunction.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

1. Turn the printer off, and the on.
2. If the error persists, replace the pickup drive assembly and lifter drive assembly.



NOTE: Notes should be added for onsite technician to check the connectors for the specific motor before replacing any parts. This is especially important if any previous parts have been replaced.

Paper tray	Drive assembly part number	Replacement instructions
550-sheet paper feeder	RM2-6934-000CN	<i>Removal and replacement: Drive assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	RM2-1222-000CN	<i>Removal and replacement: Drive assembly (1x550 feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-1222-000CN	Tray 3 and 5: <i>Removal and replacement: Drive assembly (3x550 feeder with stand, trays 3 and 5)</i> See the Repair Service Manual for this product. Tray 4: <i>Removal and replacement: Drive assembly (3x550 feeder with stand, tray 4)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-1222-000CN	Tray 3: <i>Removal and replacement: Drive assembly (2500-sheet HCI, tray 3)</i> See the Repair Service Manual for this product. Tray 4: <i>Removal and replacement: Drive assembly (2500-sheet HCI, tray 4)</i> See the Repair Service Manual for this product.

Paper tray	Lifter drive assembly part number	Replacement instructions
550-sheet paper feeder	RM2-6933-000CN	<i>Removal and replacement: Lifter drive assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (1x550 feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (3x550 feeder with stand)</i> See the Repair Service Manual for this product.

Paper tray	Lifter drive assembly part number	Replacement instructions
2500-sheet HCI	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

3. If the motor has been replaced and the issue persists, replace the feeder controller.

Paper tray	Feeder controller PCA part number	Replacement instructions
550-sheet paper feeder	RM2-8491-000CN	<i>Removal and replacement: Feeder controller PCA (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	RM2-8482-000CN	<i>Removal and replacement: Feeder controller PCA (1x550 feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-8483-000CN	<i>Removal and replacement: Feeder controller PCA (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-8481-000CN	<i>Removal and replacement: Feeder controller PCA (2500-sheet HCI)</i> See the Repair Service Manual for this product.

Recommended action for onsite technicians

1. Turn the printer off, and the on.
2. Check the tray 4 paper surface sensor.
 - a. Open the following menus:
 - [Support Tools](#)
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
 - b. Run the sensor test on the paper tray surface sensor.
 - c. If the sensor test fails, check the connections on the pickup drive assembly and on the PD controller PCA.
 - d. If the error persists, replace the lifter drive assembly.

Paper tray	Lifter drive assembly part number	Replacement instructions
550-sheet paper feeder	RM2-6933-000CN	<i>Removal and replacement: Lifter drive assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.

Paper tray	Lifter drive assembly part number	Replacement instructions
1x550-sheet paper feeder with stand	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (1x550 feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

3. If after the motor has been replaced and the issue persists, replace the feeder controller.

Paper tray	Feeder controller PCA part number	Replacement instructions
550-sheet paper feeder	RM2-8491-000CN	<i>Removal and replacement: Feeder controller PCA (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	RM2-8482-000CN	<i>Removal and replacement: Feeder controller PCA (1x550 feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-8483-000CN	<i>Removal and replacement: Feeder controller PCA (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-8481-000CN	<i>Removal and replacement: Feeder controller PCA (2500-sheet HCI)</i> See the Repair Service Manual for this product.

59.A3.05

Tray 5 lift motor malfunction.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.

2. If the error persists, replace the pickup drive assembly and lifter drive assembly.



NOTE: Notes should be added for onsite technician to check the connectors for the specific motor before replacing any parts. This is especially important if any previous parts have been replaced.

Paper tray	Drive assembly part number	Replacement instructions
550-sheet paper feeder	RM2-6934-000CN	<i>Removal and replacement: Drive assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	RM2-1222-000CN	<i>Removal and replacement: Drive assembly (1x550 feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-1222-000CN	Tray 3 and 5: <i>Removal and replacement: Drive assembly (3x550 feeder with stand, trays 3 and 5)</i> See the Repair Service Manual for this product. Tray 4: <i>Removal and replacement: Drive assembly (3x550 feeder with stand, tray 4)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-1222-000CN	Tray 3: <i>Removal and replacement: Drive assembly (2500-sheet HCI, tray 3)</i> See the Repair Service Manual for this product. Tray 4: <i>Removal and replacement: Drive assembly (2500-sheet HCI, tray 4)</i> See the Repair Service Manual for this product.

Paper tray	Lifter drive assembly part number	Replacement instructions
550-sheet paper feeder	RM2-6933-000CN	<i>Removal and replacement: Lifter drive assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (1x550 feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

3. If the motor has been replaced and the issue persists, replace the feeder controller.

Paper tray	Feeder controller PCA part number	Replacement instructions
550-sheet paper feeder	RM2-8491-000CN	<i>Removal and replacement: Feeder controller PCA (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	RM2-8482-000CN	<i>Removal and replacement: Feeder controller PCA (1x550 feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-8483-000CN	<i>Removal and replacement: Feeder controller PCA (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-8481-000CN	<i>Removal and replacement: Feeder controller PCA (2500-sheet HCI)</i> See the Repair Service Manual for this product.

Recommended action for onsite technicians

1. Turn the printer off, and the on.
2. Check the tray 5 paper surface sensor.
 - a. Open the following menus:
 - [Support Tools](#)
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
 - b. Run the sensor test on the paper tray surface sensor.
 - c. If the sensor test fails, check the connections on the pickup drive assembly and on the PD controller PCA.
 - d. If the error persists, replace the lifter drive assembly.

Paper tray	Lifter drive assembly part number	Replacement instructions
550-sheet paper feeder	RM2-6933-000CN	<i>Removal and replacement: Lifter drive assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (1x550 feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (3x550 feeder with stand)</i> See the Repair Service Manual for this product.

Paper tray	Lifter drive assembly part number	Replacement instructions
2500-sheet HCI	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

3. If the motor has been replaced and the issue persists, replace the feeder controller.

Paper tray	Feeder controller PCA part number	Replacement instructions
550-sheet paper feeder	RM2-8491-000CN	<i>Removal and replacement: Feeder controller PCA (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	RM2-8482-000CN	<i>Removal and replacement: Feeder controller PCA (1x550 feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-8483-000CN	<i>Removal and replacement: Feeder controller PCA (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-8481-000CN	<i>Removal and replacement: Feeder controller PCA (2500-sheet HCI)</i> See the Repair Service Manual for this product.

60.00.0Y, 61.00.00, 62.00.00 error messages

60.* errors

Errors in the 60.* family are related to one of the optional trays.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Use the [Tray/Bin Manual Sensor](#) test to verify that the sensors for each tray are functioning correctly.
2. Check all connectors on the paper feeder PCA.
3. Replace the optional paper feeder.

60.01.0z Lift motor error

A lift motor error has occurred. The printer cannot load the sheet installed in tray "z".

You can determine the tray number from the last digit in the error number.

- **60.01.02** = Tray 2
- **60.01.03** = Tray 3

- **60.01.04** = Tray 4
- **60.01.05** = Tray 5

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the indicated tray, remove all the paper from the tray, and then remove the tray completely out of the printer.
2. Remove any jammed paper from the tray opening.
3. Reinstall and close the tray to check if the error persists.
4. Reload the paper tray and check if the error persists.



NOTE: Make sure that the tray is not overfilled and the paper tray guides are adjusted correctly.

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Request the customer to perform the following tasks:
 - a. Open the indicated tray and remove all paper from the tray.
 - b. Close the tray and check if the tray lifts successfully when closing.



NOTE: For the tray to lift successfully when closing, the paper level indication should move to the top of the tray.

2. If the error persists and the tray does not lift successfully, dispatch a technician to replace the lifter drive assembly.

Lifter drive part assembly part number: RM2-6669-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Use the Tray/Bin Manual Sensor test to verify that the sensors for the corresponding tray are functioning correctly.
2. Check all connectors on the paper feeder PCA.
3. Replace the lifter drive assembly.

Tray 2 Lifter Drive part number: RM2-6669-000CN

For instructions: *Removal and replacement: Tray 2 lifter drive assembly*, see the Repair Service Manual for this product.

550 Sheet Lifter Drive part number: RM2-6933-000CN



[View a video of how to remove and replace the 550 Sheet Lifter Drive.](#)

For instructions: *Removal and replacement: 550 sheet feeder lifter drive assembly*, see the Repair Service Manual for this product.

1x550 stand, HCI stand, 3x550 stand lifter drive part number: RM2-2091-000CN



[View a video of how to remove and replace the 1x550 stand, HCI stand, 3x550 stand lifter drive.](#)

For instructions: *Removal and replacement: 550 sheet feeder with stand lifter drive assembly*, see the Repair Service Manual for this product.

Removal and replacement: 3x550 sheet feeder, tray 3 and 4 lifter drive assembly, see the Repair Service Manual for this product.

Removal and replacement: 3x550 sheet feeder tray 5 lifter drive assembly, see the Repair Service Manual for this product.

4. If the error persists, replace the paper deck PCA/feeder controller.

550 Sheet feeder controller part number: RM2-8491-000CN

For instructions: *Removal and replacement: 1x550 controller PCA*, see the Repair Service Manual for this product.

1x550 Paper Deck PCA part number: RM2-8482-000CN



[View a video of how to remove and replace the 1x550 Paper Deck PCA.](#)

For instructions: *Removal and replacement: 1x550 with stand controller PCA*, see the Repair Service Manual for this product.

3x550 Paper Deck PCA part number: RM2-8483-000CN



[View a video of how to remove and replace the 3x550 Paper Deck PCA.](#)

For instructions: *Removal and replacement: 3x550 controller PCA*, see the Repair Service Manual for this product.

HCI Paper Deck PCA part number: RM2-8481-000CN



[View a video of how to remove and replace the HCI Paper Deck PCA.](#)

For instructions: *Removal and replacement: HCI controller PCA*, see the Repair Service Manual for this product.

60.10.0z Paper Pickup Mechanism error

A Paper Pickup Mechanism error has occurred. The printer cannot pick the sheet installed in tray "z".

You can determine the tray number from the last digit in the error number.

- **60.10.02** = Tray 2
- **60.10.03** = Tray 3
- **60.10.04** = Tray 4

- **60.10.05** = Tray 5

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the indicated tray, remove all the paper from the tray, and then remove the tray completely out of the printer.
2. Remove any jammed paper from the tray opening.
3. Reinstall and close the tray to check if the error persists.
4. Reload the paper tray and check if the error persists.



NOTE: Make sure that the tray is not overfilled and the paper tray guides are adjusted correctly.

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

Refer the information in the document on WISE to resolve the issue: ish_3478619-3478664-16.

HP Color LaserJet M652, M653, M681, M682, E65150, E65160, E67650, E67660 - 60.10.xx Paper Pickup Mechanism Error or checking printer message when using an optional 3x550-sheet trays paper feeder

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Request the customer to perform the following tasks:
 - a. Open the indicated tray and remove all paper from the tray.
 - b. Close the tray and check if the tray lifts successfully when closing.



NOTE: For the tray to lift successfully when closing, the paper level indication should move to the top of the tray.

- c. Check whether the tray is damaged.
2. If the error persists and the tray does not lift successfully or is not damaged, dispatch a technician to replace the paper pickup assembly.

Paper Pickup part number: RM2-1235-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

Refer the following document on WISE to resolve the error: ish_3478619-3478664-16

HP Color LaserJet M652, M653, M681, M682, E65150, E65160, E67650, E67660 - 60.10.xx Paper Pickup Mechanism Error or checking printer message when using an optional 3x550-sheet trays paper feeder

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Use the Tray/Bin Manual Sensor test to verify that the sensors for the corresponding tray are functioning correctly.
2. Check all connectors on the paper feeder PCA.
3. Replace the paper pickup assembly for the corresponding tray.

Paper Pickup part number: RM2-1235-000CN



NOTE: If a "60.10.03", "60.10.04" and a "60.10.05" error code displays on the control panel at the same time on a 3x550 tray, Stop troubleshooting and consult a technical assistant.



[View a video of how to remove and replace the Paper pickup assembly.](#)

For instructions: *Removal and replacement: 1x550-sheet_feeder with stand*, see the Repair Service Manual for this product.

For instructions: *Removal and replacement: 2,550-sheet_feeder with stand*, see the Repair Service Manual for this product.

4. If the error persists, replace the paper deck PCA/feeder controller.

550 Sheet feeder controller part number: RM2-8491-000CN

For instructions: *Removal and replacement: 1x550 controller PCA*, see the Repair Service Manual for this product.

1x550 Paper Deck PCA part number: RM2-8482-000CN



[View a video of how to remove and replace the 1x550 Paper Deck PCA.](#)

For instructions: *Removal and replacement: 1x550 with stand controller PCA*, see the Repair Service Manual for this product.

3x550 Paper Deck PCA part number: RM2-8483-000CN



[View a video of how to remove and replace the 3x550 Paper Deck](#)

For instructions: *Removal and replacement: 3x550 controller PCA*, see the Repair Service Manual for this product.

HCI Paper Deck PCA part number: RM2-8481-000CN



[View a video of how to remove and replace the HCI Paper Deck PCA.](#)

For instructions: *Removal and replacement: HCI controller PCA*, see the Repair Service Manual for this product.

62.* errors

Errors in the 62.* family indicate a problem with the print engine.

Recommended action for customers

1. Turn the printer off, and then on.

2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Check all connectors on the formatter. Reseat them if necessary.
3. Upgrade the printer firmware.
4. If the error persists print the event log from the control panel, or access it from the HP Embedded Web Server (EWS), then elevate the case using the Standard Support Process.

 **NOTE:** To access the EWS, open a Web browser, and in the address line, enter the printer IP address.

62 . 00 . 00 No system To continue turn off then on

The printer experienced an internal system failure.

Recommended action

1. Turn the printer off, then on.
2. If the error persists, reload the firmware. If the error still persists, perform a firmware upgrade.
3. If the firmware upgrade does not resolve the problem, replace the hard disk.

 **NOTE:** Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-136 Hard disk drive (HDD) part numbers

Part Name	Part Number
HDD, 500GB 5400RPM SED	L41606-011 or 933853-011
HDD, 500GB 5400RPM FIPS/CCC OPAL2 7MM See NOTE above	L42243-021 See NOTE above

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Hard disk drive*

65.WX.YZ error messages

65.* errors

Errors in the 65.* family are related to output accessories.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Verify the output accessory is correctly connected to the printer.
3. If the error persists, replace the output accessory.

66.WX.YZ error messages

66.* errors

Errors in the 66.* family are related to output accessories.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. Verify the output accessory is correctly connected to the printer.
3. If the error persists, replace the output accessory.

66.00.77 Output accessory failure

The output device experienced an internal communication malfunction

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. If the error persists, replace the output accessory controller PCA.

Part number: RM2-8847-000CN

For instructions: *Removal and replacement: SSMBM Controller PCA* See the Repair Service Manual for this product.

66 . 00 . 0A Output accessory failure

STOP_CONTROL timeout error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. If the error persists, replace the output accessory controller PCA.

Part number: RM2-8847-000CN

For instructions: *Removal and replacement: SSMBM Controller PCA* See the Repair Service Manual for this product.

66 . 80 . 01 and 66 . 80 . 02 device failure

An external paper handling accessory error has occurred.

- **66.80.01** Y-align malfunction
- **66.80.02** Jogger malfunction

Recommended action for customers

1. Check the output device for any paper jams or obstructions. Clear paper jams and debris as needed.
2. Turn the printer off, and then on.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following to help resolve the issue.

1. Check the output device for any paper jams or obstructions. Clear paper jams and debris as needed.
2. Turn the printer off, and then on.
3. Disconnect J401 and check for the error 66.80.01. If the error is 66.80.01 reconnect the cable and continue with the following steps.

4. Disconnect J301 (upper feeder assembly). If the printer is booting up and shows the stacker right door is open (which is normal for that sensor), and no more 66.80.01 error. Replace the jogger assembly first.

Part number: RM2-1066-000CN

For instructions: *Removal and replacement: Jogger assembly* See the Repair Service Manual for this product.

5. If the printer still shows the error 66.80.01 replace the upper feeder assembly.

Part number: RM2-1067-000CN

For instructions: *Removal and replacement: Upper paper feed assembly* See the Repair Service Manual for this product.

66.80.03, 66.80.19, 66.80.20 or 66.80.35 device failure

A stapler error has occurred in the external paper handling accessory.

- **66.80.03** Stapler malfunction
- **66.80.19** Stapler malfunction
- **66.80.20** The staple jaw is unable to close, most likely due to a jammed staple.
- **66.80.35** Self priming malfunction

Recommended action for customers

1. Check the output device for any paper jams or obstructions. Clear paper jams and debris as needed.
2. Remove the staple cartridge and check for jammed staples. Clear all jammed staples.
3. Turn the printer off, and then on.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Check the output device for any paper jams or obstructions. Clear paper jams and debris as needed.
2. Remove the staple cartridge and check for jammed staples. Clear all jammed staples.
3. Turn the printer off, and then on.
4. If the error persists, replace the stapler.

Part number: RK2-8148-000CN

For instructions: *Removal and replacement: Stapler assembly* See the Repair Service Manual for this product.

66.80.17 device failure

An external paper handling accessory error has occurred.

- **66.80.17** Fan malfunction

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. If the error persists, replace the fan.

Part number: RK2-8153-000CN

For instructions: *Removal and replacement: SSMBM Fan* See the Repair Service Manual for this product.

66 . 80 . 21, 66 . 80 . 22, 66 . 80 . 23, and 66 . 80 . 33 device failure

An external paper handling accessory error has occurred.

- **66.80.21** Lift up malfunction
- **66.80.22** Lift down malfunction
- **66.80.23** Lift sensor malfunction
- **66.80.33** Alienation malfunction

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. If the error persists, replace the upper paper feed assembly.

Part number: RM2-1067-000CN

For instructions: *Removal and replacement: Upper paper feed assembly* See the Repair Service Manual for this product.

70.WX.YZ error messages

70.* errors

Messages in the 70.* family indicate a problem with the DC controller or Formatter (ECB) depending on your printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

- 1. Turn the printer off, and then on.
- 2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

- 1. Turn the printer off, and then on.
- 2. Replace the DC controller or the Formatter as needed.

70 . 00 . 00 Error To continue turn off then on

DC controller failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

- 1. Turn the printer off, and then on.
- 2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

- 1. Turn the printer off, and then on.
- 2. If the issue persists, replace the DC Controller.

Table 6-137 DC controller assembly part number

Part description	Part number
DC controller PC board assembly	RM3-7030-000CN
For products: M652/M653	
DC controller PC board assembly	RM3-7031-000CN
For products: M681/M682	

For instructions: *Removal and replacement: DC controller PCA* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, replace the DC Controller.

Table 6-138 DC controller assembly part number

Part description	Part number
DC controller PC board assembly	RM3-7030-000CN
For products: M652/M653	
DC controller PC board assembly	RM3-7031-000CN
For products: M681/M682	

For instructions: *Removal and replacement: DC controller PCA* See the Repair Service Manual for this product.

80.WX.YZ, 81.WX.YZ, 82.WX.YZ error messages

80.* errors

Errors in the 80.* family indicate a problem with an external I/O device, such as a Jetdirect card, an EIO card, or an external hard disk.

- **80.00.00 error:** Managed device lost connection to service provider. The product is under a service contract and has lost network connectivity for license validation.
- **80.01.01 error:** HP Accessibility Assistant connection error. Managed device is unable to establish a connection with the HP Accessibility Assistant.
- **80.01.02 error:** Managed Device Unknown HP Accessibility Assistant error.
- **80.01.03 error:** HP Accessibility Assistant connection lost. The product lost communication with the HP Accessibility Assistant.
- **80.01.04 error:** HP Accessibility Assistant disconnected. The HP Accessibility Assistant was disconnected from the product.
- **80.01.05 error:** HP Accessibility Assistant detected. Restart required. The HP Accessibility Assistant was connected to the product after turn on. The HP Accessibility Assistant is not a plug-and-play device.

Recommended action for customers

Customer actions for 80.* errors.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. Reload the printer firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call center agents

Call center agent actions for 80.* errors.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. If the error persists, perform a [Partial Clean](#) procedure using the [Preboot](#) menu.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

- a. Turn the printer on.
 - b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
 - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Partial Clean](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Press the back button once to highlight [Continue](#), and then press the [OK](#) button.
 - g. The printer automatically initializes and then returns to a Ready state.
4. If the error persists, perform a [Format Disk](#) procedure using the [Preboot](#) menu, and then upgrade the firmware to the latest version.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

- a. Turn the printer on.
- b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
- c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
- d. Press the down arrow button to highlight [Format Disk](#), and then press the [OK](#) button.
- e. Press the [OK](#) button again.

- f. Wait for the printer to automatically initialize. The message **99.09.67** appears on the control panel.
 - g. Reload the firmware using a USB flash drive. See [99.09.67 error](#) for more information.
5. If the error persists, dispatch an onsite technician (no replacement parts required).

Recommended action for call center agents

Call center agent actions for 80.* errors.

- 1. Turn the printer off, reconnect the network cable, and then turn the printer on.
- 2. Try another network cable.
- 3. If the error persists, perform a [Partial Clean](#) procedure using the [Preboot](#) menu.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: [HP LaserJet Enterprise](#), [HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#).*

- a. Turn the printer on.
 - b. Press the HP logo that displays in the middle of the screen when you see the **1/8** under the logo.
 - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Partial Clean](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Press the back button once to highlight [Continue](#), and then press the [OK](#) button.
 - g. The printer automatically initializes and then returns to a Ready state.
4. If the error persists, perform a [Format Disk](#) procedure using the [Preboot](#) menu, and then upgrade the firmware to the latest version.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: [HP LaserJet Enterprise](#), [HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#).*

- a. Turn the printer on.
- b. Press the HP logo that displays in the middle of the screen when you see the **1/8** under the logo.
- c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
- d. Press the down arrow button to highlight [Format Disk](#), and then press the [OK](#) button.
- e. Press the [OK](#) button again.
- f. Wait for the printer to automatically initialize. The message **99.09.67** appears on the control panel.
- g. Reload the firmware using a USB flash drive. See [99.09.67 error](#) for more information.

80 . 0x . yz Embedded Jetdirect Error

An Embedded HP JetDirect print server critical error has occurred.

- 80 . 01 . 80 (event log) No heartbeat
- 80 . 01 . 81 (event log) Reclaim time-out
- 80 . 01 . 82 (event log) Invalid data length
- 80 . 01 . 8B (event log) Invalid max outstanding packet header field
- 80 . 01 . 8C (event log) Invalid channel mapping response
- 80 . 03 . 01 (event log) No PGP buffers
- 80 . 03 . 02 (event log) Channel table full
- 80 . 03 . 03 (event log) Producer index not reset
- 80 . 03 . 04 (event log) Consumer index not reset
- 80 . 03 . 05 (event log) Queue position size too small
- 80 . 03 . 06 (event log) Transport overflow
- 80 . 03 . 07 (event log) No overflow packets
- 80 . 03 . 08 (event log) Invalid identify response
- 80 . 03 . 09 (event log) Invalid channel map return status
- 80 . 03 . 10 (event log) Invalid reclaim return status
- 80 . 03 . 12 (event log) Datagram invalid buffer
- 80 . 03 . 13 (event log) Max stream channels
- 80 . 03 . 14 (event log) Max datagram channels
- 80 . 03 . 15 (event log) Card reset failed
- 80 . 03 . 16 (event log) Self-test failure
- 80 . 03 . 17 (event log) Unknown PGP packet
- 80 . 03 . 18 (event log) Duplicate I/O channel

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, disconnect the network or Ethernet cable (RJ45) from the printer.
3. Press the power button to turn on the printer, and then check if the issue occurs.
4. Check if the issue occurs when the network cable is connected.

- a. Turn off the printer.
 - b. Reconnect the Ethernet cable to the Ethernet port on the printer and on the router.
 - c. Turn on the printer.
5. If the error occurs only when the network cable is connected, try using another network cable or check the network settings.
 6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, disconnect the network or Ethernet cable (RJ45) from the printer.
3. Turn on the printer, and then check if the issue occurs.
4. Turn off the printer, reconnect the network cable, and then turn on the printer.
5. If the error occurs only when the network cable is connected, try using another network cable or check the network settings.
6. If the error persists, replace the formatter.

Table 6-139 Formatter part numbers

Description/Product models	Part number
Formatter (main logic) PC board assembly	J7Z98-60001
For products: M652/M653	
Formatter (main logic) PC board assembly (India/China)	J7Z98-67904
For products: M652/M653	
Formatter (main logic) PC board assembly	J8A10-60001
For products: M681/M682	
Formatter (main logic) PC board assembly (India/China)	J8A10-67902
For products: M681/M682	

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, disconnect the network or Ethernet cable (RJ45) from the printer.
3. Turn the printer off, and then on.

4. Reconnect the RJ45 cable, and check if the error occurs only when the RJ45 cable is connected.
5. If the error occurs only when the network cable is connected, try using another network cable or check the network settings.
6. If the error persists, replace the formatter.

Table 6-140 Formatter part numbers

Description/Product models	Part number
Formatter (main logic) PC board assembly	J7Z98-60001
For products: M652/M653	
Formatter (main logic) PC board assembly (India/China)	J7Z98-67904
For products: M652/M653	
Formatter (main logic) PC board assembly	J8A10-60001
For products: M681/M682	
Formatter (main logic) PC board assembly (India/China)	J8A10-67902
For products: M681/M682	

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

7. If the error continues, elevate the case as per your region's elevation process.

81 . wx . yz EIO Error To continue turn off then on

An external I/O card has failed on the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, disconnect the network or Ethernet cable (RJ45) from the printer.
3. Press the power button to turn on the printer, and then check if the issue occurs.
4. Check if the issue occurs when the network cable is connected.
 - a. Turn off the printer.
 - b. Reconnect the Ethernet cable to the Ethernet port on the printer and on the router.
 - c. Turn on the printer.
5. If the error occurs only when the network cable is connected, try using another network cable or check the network settings.
6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, disconnect the network or Ethernet cable (RJ45) from the printer.
3. Turn on the printer, and then check if the issue occurs.
4. Turn off the printer, reconnect the network cable, and then turn on the printer.
5. If the error occurs only when the network cable is connected, try using another network cable or check the network settings.
6. If the error persists, replace the formatter.

Table 6-141 Formatter part numbers

Description/Product models	Part number
Formatter (main logic) PC board assembly	J7Z98-60001
For products: M652/M653	
Formatter (main logic) PC board assembly (India/China)	J7Z98-67904
For products: M652/M653	
Formatter (main logic) PC board assembly	J8A10-60001
For products: M681/M682	
Formatter (main logic) PC board assembly (India/China)	J8A10-67902
For products: M681/M682	

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, disconnect the network or Ethernet cable (RJ45) from the printer.
3. Turn the printer off, and then on.
4. Reconnect the RJ45 cable, and check if the error occurs only when the RJ45 cable is connected.
5. If the error occurs only when the network cable is connected, try using another network cable or check the network settings.

6. If the error persists, replace the formatter.

Table 6-142 Formatter part numbers

Description/Product models	Part number
Formatter (main logic) PC board assembly	J7Z98-60001
For products: M652/M653	
Formatter (main logic) PC board assembly (India/China)	J7Z98-67904
For products: M652/M653	
Formatter (main logic) PC board assembly	J8A10-60001
For products: M681/M682	
Formatter (main logic) PC board assembly (India/China)	J8A10-67902
For products: M681/M682	

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

7. If the error continues, elevate the case as per your region's elevation process.

81.09.00 Error

Internal Jetdirect Inside Networking event.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technician

Follow these troubleshooting steps in the order presented.

1. Verify that the issue occurs with the latest version of firmware.
 - a. Obtain the latest public firmware version for the device from hp.com.
 - b. Update the device firmware.
 - c. The device will reboot during the firmware update process.
 - d. If available (from HP Advance Technical Support), obtain the latest interim version of firmware to perform the same update test.
 - e. If the issue persists, continue with the next troubleshooting step.
2. Verify that the issue occurs when the device has the latest firmware and is not connected to the network.
 - a. Disconnect the network cable from the network I/O port on the device.

2. Try another network cable.
3. For 82.* errors, reload the printer firmware.
Go to: [HP FutureSmart - Latest Firmware Versions](#)
4. Replace the formatter.

82.73.46, 82.73.47

A hard disk or compact flash disk cleaning failed.

This error is usually caused by a failure of the disk hardware.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the product off, and then on.
2. Reload the printer firmware.
For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Use the [Format Disk](#) item in the [Preboot](#) menu.
For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*
3. Reload the firmware.
Go to: [HP FutureSmart - Latest Firmware Versions](#)

90.WX.YZ error messages

90.* errors

Errors in the 90.* family are related to the control panel.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

1. Turn the printer off, and then on.
2. If the error persists, dispatch an onsite technician.

Recommended action for onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off by holding down the power button for at least 10 seconds.
2. Check the connectors on the control panel. Reseat them if necessary.
3. Turn the printer on. If the status LED on the formatter is yellow instead of green, the control panel might be defective. Replace the control panel.

90.15.00

The video interface has been detected.

Communication with the control panel has been detected.

This message is a normal part of booting up and establishing communication with the control panel.

Recommended action

- No action necessary.

90.15.01

The video interface has not been detected.

Communication with the control panel has not been established in the expected time frame. The control panel likely will not display correctly.

Recommended action

1. Turn the printer off, and then on.
2. Turn the printer off by holding down the power button for at least 10 seconds.
3. Ensure that the control panel connectors on control panel are correctly seated.
4. Turn the printer on. If the formatter status LED is yellow, the control panel might be defective.
5. Replace the control panel.

To order parts, go to <https://www.hp.com/buy/parts>.

Control Panel Kit (8 inch display) part number: B5L47-67018

For instructions: *Removal and replacement: Control panel, M681/M682* See the Repair Service Manual for this product.

Control Panel Kit (4.3 inch display) part number: 5851-7252

For instructions: *Removal and replacement: Control panels, M652/M653* See the Repair Service Manual for this product.

Control Panel Kit (2.7 inch display) part number: 5851-7253

For instructions: *Removal and replacement: Control panels, M652/M653* See the Repair Service Manual for this product.

98.0X.0Y error messages

98.* errors

Errors in the 98.* family are related to data corruption in the firmware.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Download and install the most current version of the firmware.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Use the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

4. Reload the firmware.

98.00.01 or 98.01.00 Corrupt data in firmware volume

Data corruption has occurred in the firmware volume.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Use the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

3. Reload the firmware.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

98 . 00 . 02 Corrupt data in the solutions volume

Data corruption has occurred in the solutions volume.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Use the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

3. Reload the firmware.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

98 . 00 . 03 Corrupt data in the configuration volume

Data corruption has occurred in the configuration volume.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.

2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Download the firmware again, and then attempt the upgrade again.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Use the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

4. Reload the firmware.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

98.00.04 Corrupt data in the job data volume

Data corruption has occurred in the job data volume.

Recommended action

1. Turn the printer off, and then on.
2. Make sure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Rerun the file erase function.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

99.WX.YZ error messages

99.* errors

Errors in the 99.* family are related to the firmware upgrade process.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Make sure the connection to the network is good, and then try the firmware upgrade again.

2. If the error persists, try using the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Make sure the connection to the network is good, and then try the upgrade again.
2. Try using the USB upgrade method.
3. If the error persists, run the [Format Disk](#) process from the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

4. If the error persists, replace the hard disk drive.



NOTE: Do NOT replace the formatter board, it will not resolve the issue.

99 . 00 . 01 Upgrade not performed file is corrupt

A remote firmware upgrade (RFU) was not performed.

This is a CRC error in the firmware image (bad image).

Recommended action

- Download the firmware upgrade file, and then attempt the upgrade again.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99 . 00 . 02 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading the header number and size. It indicates a problem with the network environment, not the product.

Recommended action

Follow these troubleshooting steps in the order presented.

The most common cause is an issue with the network environment.

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



NOTE: If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which

signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99 . 00 . 03 Upgrade not performed error writing to disk

A remote firmware upgrade (RFU) was not performed.

This is a disk error. It might indicate a problem or a hard disk drive failure. It might be necessary to check the connection to the hard disk drive or replace the hard disk drive.

Recommended action

1. Download the remote firmware upgrade (RFU) file, and then attempt the upgrade again.
2. If the error persists, run the [Format Disk](#) process from the [Preboot](#) menu. You will need to download the firmware from the [Preboot](#) menu.
3. If the error persists, replace the hard disk drive.



NOTE: Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-143 Hard disk drive (HDD) part numbers

Part Name	Part Number
HDD, 500GB 5400RPM SED	L41606-011 or 933853-011
HDD, 500GB 5400RPM FIPS/CCC OPAL2 7MM See NOTE above	L42243-021 See NOTE above

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Hard disk drive*

99 . 00 . 04 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading the header.

The most common cause is an issue with the network environment.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



NOTE: If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99 . 00 . 05 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading image data.

The most common cause is an issue with the network environment.

Recommended action

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



NOTE: If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99 . 00 . 06 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

This is an unexpected read error when reading the header number and size.

Recommended action

1. Download the remote firmware upgrade (RFU) file, and then attempt the upgrade again.
2. If the error persists, replace the hard disk drive.



NOTE: Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-144 Hard disk drive (HDD) part numbers

Part Name	Part Number
HDD, 500GB 5400RPM SED	L41606-011 or 933853-011

Table 6-144 Hard disk drive (HDD) part numbers (continued)

Part Name	Part Number
HDD, 500GB 5400RPM FIPS/CCC OPAL2 7MM See NOTE above	L42243-021 See NOTE above

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Hard disk drive*

99 . 00 . 07 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

This is an unexpected read error when reading the rest of the header.

Recommended action

1. Download the remote firmware upgrade (RFU) file, and then attempt the upgrade again.
2. If the error persists, replace the hard disk drive.

500 GB Secure Hard disk drive part number: B5L29-67903



NOTE: Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-145 Hard disk drive (HDD) part numbers

Part Name	Part Number
HDD, 500GB 5400RPM SED	L41606-011 or 933853-011
HDD, 500GB 5400RPM FIPS/CCC OPAL2 7MM See NOTE above	L42243-021 See NOTE above

For instructions: *Removal and replacement: Hard disk drive*

99 . 00 . 08 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

This is an unexpected read error when reading image data.

Recommended action

1. Download the remote firmware upgrade (RFU) file, and then attempt the upgrade again.
2. If the error persists, replace the hard disk drive.



NOTE: Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-146 Hard disk drive (HDD) part numbers

Part Name	Part Number
HDD, 500GB 5400RPM SED	L41606-011 or 933853-011
HDD, 500GB 5400RPM FIPS/CCC OPAL2 7MM See NOTE above	L42243-021 See NOTE above

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Hard disk drive*

99 . 00 . 09 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled.

Recommended action

- Resend the remote firmware upgrade (RFU).

99 . 00 . 10 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled when reading the header number and size.

Recommended action

- Resend the remote firmware upgrade (RFU).

99 . 00 . 11 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled when reading the rest of the header, after reading the header number and size.

Recommended action

- Resend the remote firmware upgrade (RFU).

99 . 00 . 12 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The header number is 1, but the header size does not match version 1 size.

Recommended action

1. Download the remote firmware upgrade (RFU) file again.
Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Resend the RFU.

99 . 00 . 13 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The header number is 2, but the header size does not match version 2 size.

Recommended action

1. Download the remote firmware upgrade (RFU) file again.
Make sure that you download the file for the correct printer model.
For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
2. Resend the RFU.

99 . 00 . 14 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The file is invalid.

Recommended action

1. Download the remote firmware upgrade (RFU) file again.
Make sure that you download the file for the correct printer model.
For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
2. Resend the RFU.

99 . 00 . 2x

There is a compatibility issue with the firmware.

The specific message varies depending on the cause, but the solution for each message is the same.

- 99 . 00 . 20 (event log)
The bundle is not for this product.
- 99 . 00 . 21 (event log)
The bundle is not signed with the correct signature, or the signature is invalid.
- 99 . 00 . 22 (event log)
The bundle header version is not supported by this firmware.
- 99 . 00 . 23 (event log)
The package header version is not supported by this firmware.
- 99 . 00 . 24 (event log)

The format of the bundle is invalid.

- 99.00.25 (event log)

The format of the package is invalid.

- 99.00.26 (event log)

A CRC32 check did not pass.

- 99.00.27 (event log)

An I/O error occurred while downloading the bundle.

Recommended action

Follow these troubleshooting steps in the order presented.

1. **99.00.27 only:** Turn the product off, and then on.
2. Download the correct firmware file, and then resend the firmware upgrade.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#) For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).
3. If the error persists, try installing the upgrade by another method (USB or Embedded Web Server).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99.01.xx

A firmware install error has occurred.

The specific message varies depending on the cause, but the solution for each message is the same.

- 99.01.00
- 99.01.10
- 99.01.20
- 99.01.21

Recommended action

Follow these troubleshooting steps in the order presented.

- Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
Firmware update steps,

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99.02.01

Firmware installation was successful.

Recommended action

See recommended action.

- No action necessary.

99.02.09

Firmware upgrade cancelled by user.

Recommended action

See recommended action.

- No action necessary.

99.07.yz Firmware install error (MFP - fax only)

- **99.07.00** Unexpected fax modem FW installer error. Firmware installation failed. The fax installer encountered an error during installation.
- **99.07.10** An error occurred accessing the repository during the fax modem FW install. Firmware installation failed. The fax modem installer encountered an error in the repository.
- **99.07.21** The fax modem could not be reset. Firmware installation failed. The fax modem installer failed to download flash to the modem.
- **99.07.20** The fax modem FW installer could not connect to the fax modem. Firmware installation failed. The fax modem installer encountered an error while detecting or initializing modem.
- **99.07.22** Firmware installation failed. The fax modem installer failed to download firmware to the modem.
- **99.07.23** Fax modem reset failed.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem.



NOTE: For **99.07.22** error on printer models M681, M682, E67550, E67560, E67650, and E67660 series, see the recommended steps for **99.07.22 Firmware install error**.

1. Turn the printer off.
2. Verify the fax card is correctly installed on the formatter. Ensure the fax card is aligned with slot on the formatter chassis and is firmly seated against the formatter board. Turn the printer on.
3. If the error persists, download and reinstall the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

4. If the error persists, perform a partial clean:
 - a. Turn the printer off, and then on.
 - b. Touch the [HP logo](#) that displays in the middle of the screen when you see the “1/8” under the logo. The [Preboot](#) menu will open.
 - c. Touch the down arrow button to highlight [Administrator](#), and then touch the [OK](#) button.
 - d. Use the down arrow button to highlight [Partial Clean](#), and then touch the [OK](#) button.
 - e. Touch the [OK](#) button again.

- f. Touch the **Back** button to highlight **Continue**, and then touch the **OK** button.
 - g. The printer will continue to boot to **Ready**.
- 5. If the error persists, replace the fax kit.

Service part number: CC522-67929

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Fax Kit* See the Repair Service Manual for this product.

99 . 07 . 22 Firmware install error

This error indicates that the firmware installation failed. It displays on the printer control panel when the fax modem installer fails to download the installed firmware to the modem.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Make sure that the network connection is stable and good, and then attempt to update the firmware again.
2. If the error persists, try to update the firmware at the control panel using a USB flash drive.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Use the following general troubleshooting steps to try to resolve the problem.

1. Make sure that the network connection is stable and good, and then attempt to update the firmware again.
2. If the error persists, try to update the firmware at the control panel using a USB flash drive.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).
3. Use the **Format Disk** item in the Preboot menu.

 **CAUTION:** Selecting Format Disk removes all data. The system is not bootable after this action and 99.09.67 displays on the control panel. A firmware download must be performed to return the system to a bootable state. Should any installed workflow solutions be present they will be deleted and require reloading and setup by the customer.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

4. If the issue persists, identify which storage solution is utilized, a hard disk drive (HDD) or embedded multi-media card (eMMC).
 - a. Print or view the device configuration page.
 - b. Reference section **Installed Personalities and Options**.

- c. Reference **Internal Disk: Hard Disk: Enabled**
 - d. Reference **Hard Disk Encryption Status**, "Disk cannot be encrypted" denotes an eMMC storage device.
5. Depending on the storage solution installed, replace either the hard disk drive (HDD) or embedded multi-media card (eMMC).

 **IMPORTANT: WARNING:** Do not replace the printer formatter, it will not resolve this issue.

 **NOTE:** Device is unusable until a new boot device is installed.

 **NOTE:** Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-147 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above
Module 16GB embedded Multimedia Card (eMMC) kit	5851-6587

Recommended action for onsite technicians

Use the following general troubleshooting steps to try to resolve the problem.

1. Make sure that the network connection is stable and good, and then attempt to update the firmware again.
2. If the error persists, try to update the firmware at the control panel using a USB flash drive.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. Use the [Format Disk](#) item in the Preboot menu.

 **CAUTION:** Selecting Format Disk removes all data. The system is not bootable after this action and 99.09.67 displays on the control panel. A firmware download must be performed to return the system to a bootable state. Should any installed workflow solutions be present they will be deleted and require reloading and setup by the customer.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

4. If the issue persists, identify which storage solution is utilized, a hard disk drive (HDD) or embedded multi-media card (eMMC).
 - a. Print or view the device configuration page.
 - b. Reference section **Installed Personalities and Options**.

- c. Reference **Internal Disk: Hard Disk: Enabled**
 - d. Reference **Hard Disk Encryption Status**, “Disk cannot be encrypted” denotes an eMMC storage device.
5. Depending on the storage solution installed, replace either the hard disk drive (HDD) or embedded multi-media card (eMMC).

 **IMPORTANT: WARNING:** Do not replace the printer formatter, it will not resolve this issue.

 **NOTE:** Device is unusable until a new boot device is installed.

 **NOTE:** Most customers have the self-encrypting drive (SED), and should not have a Federal Information Processing Standards (FIPS) drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-148 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above
Module 16GB embedded Multimedia Card (eMMC) kit	5851-6587

6. If the issue persists, elevate using your region’s support process.

99 . 09 . 60 Unsupported disk

This is a **Preboot** menu error.

The hard disk currently installed is not recognized or supported by the printer.

Recommended action

 **NOTE:** Do NOT replace the formatter board, it will not resolve this error.

- Install the correct hard disk for this printer.

99 . 09 . 61 Unsupported disk

The hard disk drive installed is not support in this printer.

The hard disk drive (HDD) is not encrypted and the printer is configured for an encrypted HDD.

Recommended action

 **NOTE:** Do NOT replace the formatter board, it will not resolve this error.

- Access the **Preboot** menu, and then select **Lock Disk** to lock the disk.
 - a. Access the **Preboot** menu
 - b. Turn the product on.

- c. Touch the HP logo that displays in the center of the touchscreen until the [Preboot](#) menu item opens.
- d. Use the arrow buttons on the touchscreen to navigate the [Preboot](#) menu.
- e. Touch the [OK](#) button to select a menu item.

99 . 09 . 62 Unknown disk

This error indicates that there is an encryption mismatch between the HDD and the formatter.

This typically happens because an HDD was swapped into a device from another device.

Recommended action



NOTE: Do NOT replace the formatter board, it will not resolve this error.

1. Use the [Preboot](#) menu to unlock the disk.
 - a. Access the [Preboot](#) menu
 - b. Turn the product on.
 - c. Touch the HP logo that displays in the center of the touchscreen until the [Preboot](#) menu item opens.
 - d. Use the arrow buttons on the touchscreen to navigate the [Preboot](#) menu.
 - e. Touch the [OK](#) button to select a menu item.
2. If a disk is to be reused in a different product, execute the [Erase and Unlock](#) procedure from the [Preboot](#) menu, and then reload the firmware.
 - From the [Preboot](#) menu, open the following menus:
 - [Administration](#) (select 3)
 - [Manage Disks](#) (select 6)
 - [Boot Device](#) (select 6)
 - [Erase / Unlock](#) (select 2)
3. If the previous steps did not resolve the issue, replace the hard disk drive.

99 . 09 . 63 Incorrect disk

Expected encrypted hard disk drive is not present.

This is expected behavior when installing a new hard disk drive in a device where the previous hard disk drive was encrypted.

Recommended action



NOTE: Do NOT replace the formatter board, it will not resolve this error.

1. Load the firmware on the new hard disk drive, and then lock the disk to this printer.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

99.09.64 Disk Nonfunctional

A fatal hard disk drive failure has occurred.

Recommended action



NOTE: Do NOT replace the formatter board, it will not resolve this error.

Use these steps to determine if the hard disk drive needs to be replaced.

1. Try using eMMC (flash drive) as a temporary mass storage solution - eMMC must be installed in the printer prior to step 2b.
2. Enable eMMC from the [Preboot](#) menus as follows:
 - a. Turn the printer off.
The broken hard disk drive must be removed to continue.
 - b. Turn the printer on. The boot sequence is expected to stop at 99.39.67 eMMC Not Bootable error.
 - c. Download the latest firmware. (This will automatically download to eMMC).
For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
During the download to eMMC, the firmware will clear the data migration bit.
3. If the error persists, replace the hard disk drive.



NOTE: Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-149 Hard disk drive (HDD) part numbers

Part Name	Part Number
HDD, 500GB 5400RPM SED	L41606-011 or 933853-011
HDD, 500GB 5400RPM FIPS/CCC OPAL2 7MM See NOTE above	L42243-021 See NOTE above

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Hard disk drive*

99.09.65 Disk data error

Disk data corruption has occurred.

Recommended action



NOTE: Do NOT replace the formatter board, it will not resolve this error.

- Use the [Format Disk](#) procedure from the [Preboot](#) menu, and then resend the remote firmware upgrade (RFU).

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

99 . 09 . 66 No boot device.

A hard disk drive or eMMC is not installed in the printer.

Recommended action for customers



NOTE: Do NOT replace the formatter board, it will not resolve this error.

1. Determine the intended boot device (hard disk drive or eMMC).
2. Install a compatible hard disk drive or eMMC.
3. If a compatible hard disk drive or eMMC is installed, re-seat the hard disk drive or eMMC to make sure that it is connected correctly.
4. If the error persists, replace the hard disk drive or eMMC.

To order parts, go to <https://www.hp.com/buy/parts>.



NOTE: Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-150 Hard disk drive (HDD) part numbers

Part Name	Part Number
HDD, 500GB 5400RPM SED	L41606-011 or 933853-011
HDD, 500GB 5400RPM FIPS/CCC OPAL2 7MM See NOTE above	L42243-021 See NOTE above

For instructions: *Removal and replacement: Hard disk drive*

8 GB eMMC kit part number: B5L32-60003

For instructions: *Removal and replacement: Embedded multimedia card*



NOTE: The printer is unusable until a new boot device is installed.

Recommended action for call-center agents and onsite technicians



NOTE: Do NOT replace the formatter board, it will not resolve this error.

1. Determine the intended boot device (hard disk drive or eMMC).
2. Install a compatible hard disk drive or eMMC.

3. If a compatible hard disk drive or eMMC is installed, re-seat the hard disk drive or eMMC to make sure that it is connected correctly. Reseat all cables on the formatter, except the Flat Flexible cable (FFC).
4. If the error persists, replace the hard disk drive or eMMC.



NOTE: Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-151 Hard disk drive (HDD) part numbers

Part Name	Part Number
HDD, 500GB 5400RPM SED	L41606-011 or 933853-011
HDD, 500GB 5400RPM FIPS/CCC OPAL2 7MM See NOTE above	L42243-021 See NOTE above

For instructions: *Removal and replacement: Hard disk drive*

8 GB eMMC kit part number: B5L32-60003

For instructions: *Removal and replacement: Embedded multimedia card*



NOTE: The printer is unusable until a new boot device is installed.

99 . 09 . 67 Disk is not bootable please download firmware

There is no firmware installed on the hard disk drive or eMMC.

This is usually the result of installing a new hard disk drive or performing a Format Disk procedure from the Preboot menu.



NOTE: When installing a new hard drive or eMMC, the disk should be formatted through the Preboot menu, BEFORE loading firmware.

Recommended action



NOTE: Do NOT replace the formatter board, it will not resolve this error.

1. Press any button to continue to the main [Preboot](#) menu.
2. Press the Help button to see the help text for the error.
3. Select the [Administration](#) menu.



NOTE: If there is a password assigned to the administrator, a prompt to enter the printer displays. Enter the password to proceed.

4. Select the [Format disk](#) option, select [OK](#).
5. Select the [Download](#) item, and then download the latest firmware. The user can now download a new firmware bundle to the printer.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

6. If the download to the printer hard disk drive fails, complete the following:
 - a. Determine if the hard disk drive needs to be replaced.
 - b. Determine if using eMMC as a temporary mass storage solution is an option (eMMC must be present).
 - c. Enable eMMC from the [Preboot](#) menus as follows:
 - i. Turn the printer off.
The broken hard disk drive must be removed to continue.
 - ii. Turn the printer on. The boot sequence is expected to stop at 99.39.67 eMMC Not Bootable.
 - iii. Download the latest firmware. (This will automatically download to eMMC).
For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
During the download to eMMC, the firmware will clear the data migration bit.
 - d. Order a new hard disk drive.

99 . 39 . 64 eMMC Nonfunctional

The eMMC is not functioning.

Recommended action



NOTE: Do NOT replace the formatter board, it will not resolve this error.

- Replace the eMMC.

8 GB eMMC kit part number: B5L32-60003

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Embedded multimedia card*



NOTE: The printer is unusable until a new eMMC is installed.

99 . 39 . 67 eMMC Not Bootable

Data on the eMMC cannot be secured or encrypted.

When the hard disk drive is installed, all data on the eMMC is automatically migrated to the hard disk drive and erased from the eMMC. Once the hard disk drive is installed the eMMC is non-functional.

If this data migration has been completed and the eMMC is put back in for use, this error occurs.

Recommended action



NOTE: Do NOT replace the formatter board, it will not resolve this error.

1. Download firmware to the eMMC.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. If the download fails to eMMC, replace the eMMC.

8 GB eMMC kit part number: B5L32-60003

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Embedded multimedia card*



NOTE: The printer is unusable until a new eMMC is installed.

7 Alphabetical control panel messages

Use the following alphabetical message to see further information on the message.

Alphabetical error messages

Accept bad signature

The product is performing a remote firmware upgrade and the code signature is invalid.

Recommended action

- Download the correct firmware upgrade file for the product, and then reinstall the upgrade.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

Authentication required

A user name and password are required.

Recommended action

- Type the user name and password, or contact the network administrator.

Bad optional tray connection

The optional tray is not connected, not connected correctly, or a connection is not working correctly.

Recommended action for customers

1. Turn the printer off.
2. Remove and reinstall the optional tray.
3. If more than one extra 550-sheet feeder is available, swap the trays and test again.
4. Remove the tray and inspect the connectors on the tray and the printer for damage. If either of them are broken, have bent pins, or otherwise appear damaged, replace them.
5. Carefully reposition printer base onto the optional tray. HP recommends that two people lift the printer.
6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

1. Turn the printer off.
2. Remove and then reinstall the optional tray.

3. If more than one extra 550-sheet feeder is available, swap the trays and test again.
4. Remove the tray and inspect the connectors on the tray and the printer for damage. If either of them are broken, have bent pins, or otherwise appear damaged, replace them.
5. Carefully reposition printer base onto the optional tray. HP recommends that two people lift the printer.
6. If the problem continues, replace the connector for the tray.

Table 7-1 Part numbers

Tray	Tray connector part number	Replacement instructions
550-sheet feeder	RC4-7680-000CN	<i>Removal and replacement: Drawer connector and holder</i> See the Repair Service Manual for this product.
1x550-sheet feeder with stand	RC4-8914-000CN	<i>Removal and replacement: Drawer connector and holder (1x550-sheet feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet feeder with stand	RC4-8914-000CN	<i>Removal and replacement: Drawer connector and holder (3x550-sheet feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI feeder with stand	RC4-8914-000CN	<i>Removal and replacement: Drawer connector and holder (2500-sheet feeder with stand)</i> See the Repair Service Manual for this product.

Binname full

The specified output bin is full.

Recommended action for customers

1. Empty the bin to continue printing.
2. Check the output bin sensor flag to ensure that it moves freely.
3. Continue printing.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Empty the bin to continue printing.
2. Check the output bin sensor flag to ensure that it moves freely.
3. Using diagnostic test, Check the bin full sensor SR62 is functioning correctly. If the sensor does not function correctly, replace the delivery assembly.

Part number: RM2-6621-000CN

For instructions (M652, M653): *Removal and replacement: Delivery assembly (M652, M653)* See the Repair Service Manual for this product.

For instructions (M681, M682): *Removal and replacement: Delivery assembly (M681, M682)* See the Repair Service Manual for this product.

Calibration reset pending

A calibration reset occurs when all jobs are processed.

Recommended action

- To begin the reset sooner, cancel all jobs by pressing the **Stop** button.

Canceling...<jobname>

The printer is canceling the current job <jobname>.

Recommended action

See recommended action.

- No action necessary.

Cartridge low

If this message appears even though the print cartridge is new, perform the following.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Remove and reinstall the toner cartridge.
2. Make sure a genuine HP supply is used.
3. If the error persists, replace the toner cartridge.

To order supplies and customer-replaceable parts, go to store.hp.com. Click on **Ink & toner** at the top of the page. Enter your printer name and model number in the search box.

Cartridge Memory Abnormal

This message appears even though the print cartridge is new.

Recommended action

1. Remove and reinstall the toner cartridge.
2. If the error persists, replace the toner cartridge.

To order supplies and customer-replaceable parts, go to store.hp.com. Click on **Ink & toner** at the top of the page. Enter your printer name and model number in the search box.

Cartridge out

This message appears even though the print cartridge is new.

Recommended action

1. Remove and then reinstall the toner cartridge.

2. Make sure a genuine HP supply is used.
3. If the error persists, replace the toner cartridge.

To order supplies and customer-replaceable parts, go to store.hp.com. Click on **Ink & toner** at the top of the page. Enter your printer name and model number in the search box.

Checking engine

The printer is conducting an internal test.

Recommended action

See recommended action.

- No action necessary.

Checking paper path

The printer is checking for possible paper jams.

Recommended action

See recommended action.

- No action necessary.

Chosen personality not available To continue touch "OK"

A print job requested a printer language (personality) that is not available for this printer. The job will not print and will be cleared from memory.

Recommended action

- Print the job by using a print driver for a different printer language, or add the requested language to the printer (if possible). To see a list of available personalities, print a configuration page.
 - a. From the Home screen on the printer control panel, go to the following menus: **Reports > Configuration/Status Pages**
 - b. Select [Configuration Page](#), then select the [Print](#) button to print the pages.

Cleaning disk <X> complete Do not power off

A storage device is being sanitized or cleaned.

Recommended action

- Do not turn off the printer. The printer's functions are unavailable. The printer will automatically restart when finished.

Cleaning

The printer is performing an automatic cleaning cycle. Printing will continue after the cleaning is complete.

Recommended action

See recommended action.

- No action necessary.

Clearing activity log

This message is displayed while the activity log is cleared. The printer exits the menus when the log has been cleared.

Recommended action

See recommended action.

- No action necessary.

Clearing event log

This message is displayed while the event log is cleared. The printer exits the menus when the event log has been cleared.

Recommended action

See recommended action.

- No action necessary.

Clearing paper path

The printer is attempting to eject jammed paper.

Recommended action

- Check the progress at the bottom of the display.

Close right door

The upper right cover is open.

This message appears even though the right upper cover is closed.

Recommended action for customers

1. Close the right upper cover.
2. Make sure that the right cover is not damaged and that it is completely closed.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Close the right upper cover.
2. Check the projection part for the switch on the right door assembly. If it is damaged, replace the right door assembly.

Part number: RM2-6622-000CN

For instructions: *Removal and replacement: Right door* See the Repair Service Manual for this product.

3. Reconnect the connector of the right door switch and connector on the DC controller PCA.
4. Use the right upper cover switch test in the manual sensor test to verify that the switch is correctly functioning. If the switch fails the test, replace the switch.

Part number: RK2-0535-000CN

For instructions: *Removal and replacement: Microswitch* See the Repair Service Manual for this product.

5. If the problem persists, elevate the case following the Standard Support Process.

Close front door

The front door is open.

This message appears even though the top front door is closed.

Recommended action for customers

1. Close the front door.
2. Make sure the front door is not damaged, that it closes normally, and that it is completely closed.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Close the front door.
2. Check the projection part on the front door. If it is damaged, replace the front door assembly.

Part number: RM2-6658-000CN

For instructions: *Removal and replacement: Front door assembly* See the Repair Service Manual for this product.

3. Use the front door switch test in the manual sensor test to verify that the switch is correctly functioning. If the switch fails the test, replace the switch.
4. Reconnect the connector on the DC controller PCA.
5. If the problem persists, replace the front door switch.

Part number: RM2-7133-000CN

Communication lost

A Communication Lost message appears on the control panel in five different languages.

The communication path from the control panel to the formatter includes the control panel, USB cable, image control board (ICB), and the formatter.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, check the heartbeat LED on the formatter located on the rear of the printer.
 - If the formatter heartbeat LED status flashes **yellow**, it indicates a communication problem between the control panel and the formatter. Replace the control panel.

Table 7-2 Control panel part numbers

Description	Part number
Control panel assembly 68.6 mm, 2.7 inch size	RM21267-010CN
Control panel assembly - 2.7 inch display, 4 line with 10 keys	5851-7975
Control panel assembly - 4.3 inch	5851-7252

- If the formatter heartbeat LED status is solid **red**, it indicates a problem with the formatter. Replace the formatter.

Table 7-3 Formatter part numbers

Description/Product models	Part number
Formatter (main logic) PC board assembly	J7Z98-60001
For products: M652/M653	
Formatter (main logic) PC board assembly (India/China)	J7Z98-67904
For products: M652/M653	
Formatter (main logic) PC board assembly	J8A10-60001
For products: M681/M682	
Formatter (main logic) PC board assembly (India/China)	J8A10-67902
For products: M681/M682	

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, check if the heartbeat LED status on the formatter flashes yellow or red.

 **IMPORTANT:**

- If the formatter heartbeat LED status flashes **yellow**, it indicates a communication problem between the control panel and the formatter.
 - If the formatter heartbeat LED status is solid **red**, it indicates a problem with the formatter.
-

Depending on the formatter heartbeat LED status, perform the task accordingly.

- If the formatter heartbeat LED status flashes **yellow**, reseal the USB cable connection in the control panel.
 - a. Tilt the control panel forward (callout 1), and then open the document feeder (callout 2).




- b. Beginning at the right side of the control-panel cover, carefully release five tabs along the top edge of the cover.



- c. Continue to rotate the top edge of the cover away from the printer, and then remove the cover.



- d. Disconnect and then reconnect the USB cable (callout 2) from the holder.

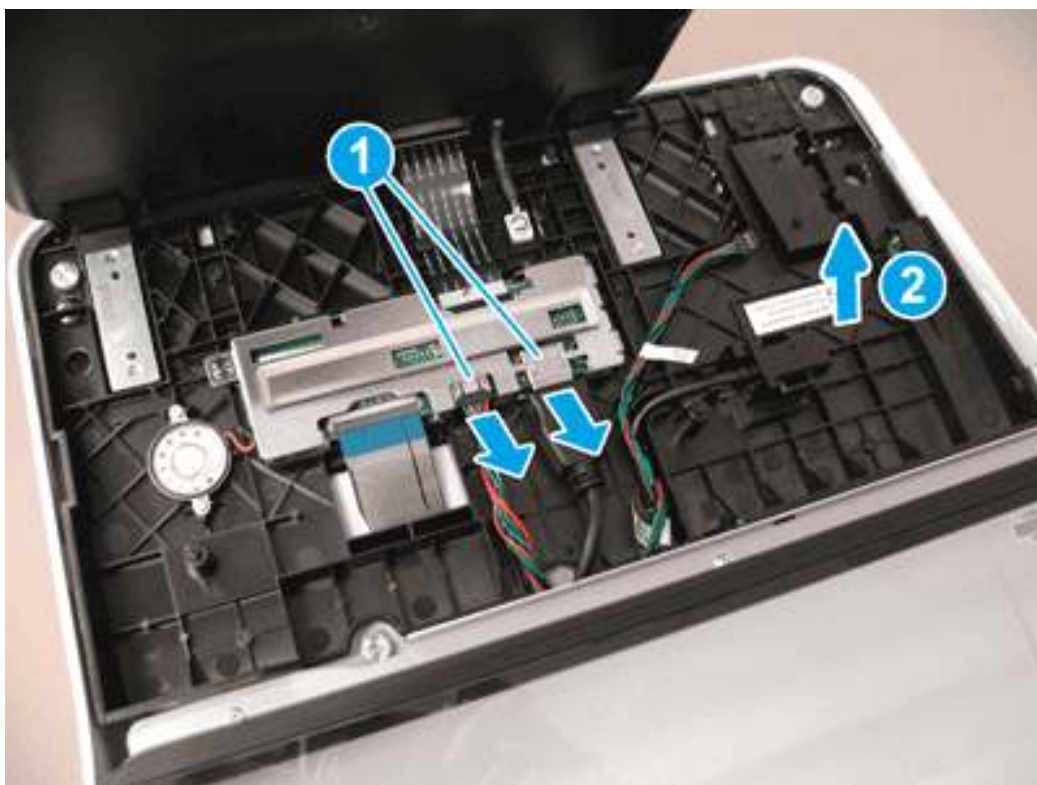

- e. If the issue persists, replace the Control Panel USB cable.

Table 7-4 Control panel USB cable


Description	Part number
Control panel USB cable	J8A10-6011

- f. If the issue persists, replace the control panel.


Table 7-5 Control panel part numbers

Description	Part number
Control panel assembly 68.6 mm, 2.7 inch size	RM2-1267-010CN
Control panel assembly - 2.7 inch display, 4 line with 10 keys	5851-7975
Control panel assembly - 4.3 inch	5851-7252

- If the formatter heartbeat LED status is solid **red**, reseal the formatter flat flexible cable (FFC-J17).
- a. Unscrew the two thumbscrews (callout 1), and then slide the formatter cover (callout 2) away from the printer.

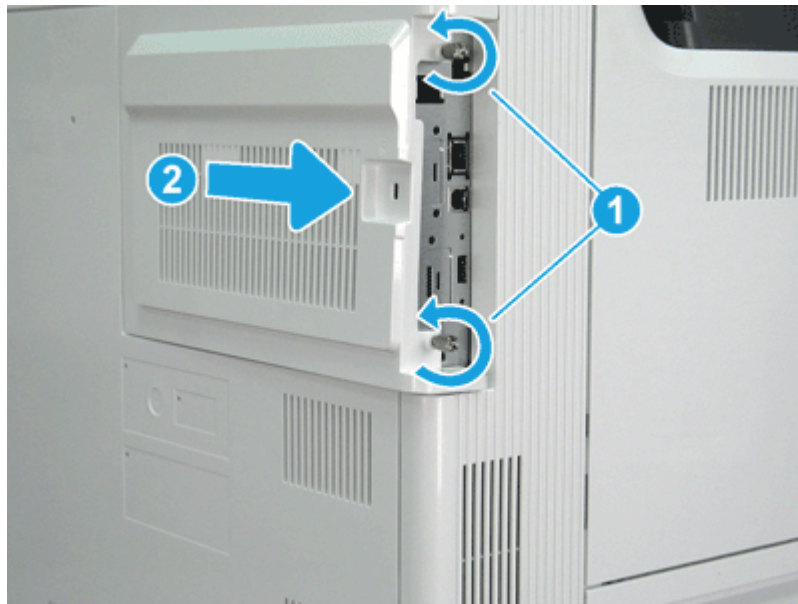

- b. Disconnect and reconnect FFC (J17) and the USB cable connections as indicated in the image below.

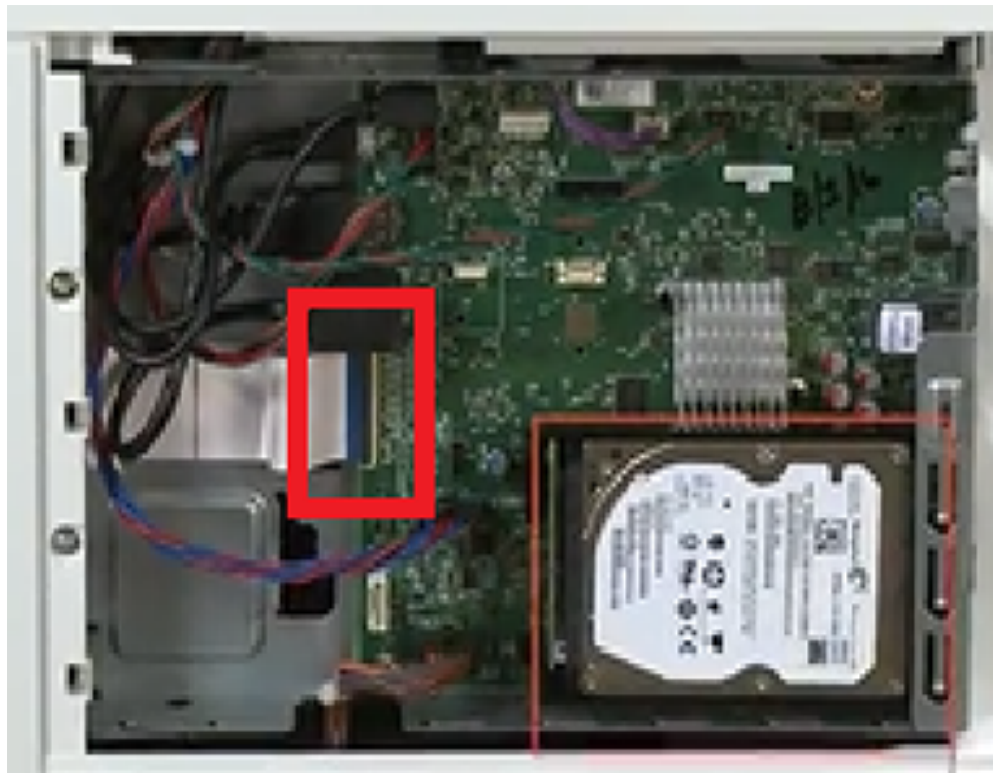

3. If the issue persists, replace the formatter.

Table 7-6 Formatter part numbers

Description/Product models	Part number
Formatter (main logic) PC board assembly	J7Z98-60001
For products: M652/M653	
Formatter (main logic) PC board assembly (India/China)	J7Z98-67904
For products: M652/M653	
Formatter (main logic) PC board assembly	J8A10-60001
For products: M681/M682	
Formatter (main logic) PC board assembly (India/China)	J8A10-67902
For products: M681/M682	

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

4. If the error continues, elevate the case as per your region's elevation process.

Cooling device

The printer is cooling.

Recommended action

See recommended action.

- No action necessary.

Data received To print last page press “OK”

The printer is waiting for the command to print the last page.

Recommended action

- Touch the “OK” button on the control panel to print the last page of the job.

Data received To print last page press “OK”

The printer is waiting for the command to print the last page.

Recommended action

- Touch the OK button to print the last page of the job.

Event log is empty

No printer events are in the log.

Recommended action

See recommended action.

- No action necessary.

Expected drive missing

The printer cannot find the encrypted hard drive.

Recommended action

- Install the encrypted hard disk drive.

External device initializing

An external device is initializing.

Recommended action

See recommended action.

- No action necessary.

Fuser Kit low

10.23.60 (event code)

The printer indicates when a supply is low.

Recommended action

- Replace the fuser.

Fuser Kit 110v part number: RM2-1928-000CN

Fuser Kit 220v part number: RM2-1929-000CN

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Fuser*

Fuser Kit very low To continue, touch “OK”

10.23.70 (event code)

The printer indicates when a supply is very low.

After an HP supply has reached the very low threshold, the HP premium protection warranty for that supply has ended.

Recommended action

- Replace the fuser.

Fuser Kit 110v part number: RM2-1928-000CN

Fuser Kit 220v part number: RM2-1929-000CN

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Fuser*

Gateways failed

There is an incorrect gateway configuration.

Recommended action

- Use the [EIO <X> Jetdirect](#) menu to configure the default gateway.

Genuine HP supply installed

A new genuine HP supply has been installed.

Recommended action

- Touch the [Hide](#) button to remove this message.

HP Secure hard drive disabled

The hard disk drive has been encrypted for another printer.

Recommended action

- Remove the hard disk drive or use the Embedded Web Server for more information.

Incompatible <Supply>

The indicated supply is not compatible with this printer.

- **10.00.35:** (event code) Black toner cartridge
- **10.23.35:** (event code) Fuser kit

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the supply with one that is designed for this printer.

Incompatible supplies

Print cartridges or other supply items are installed that were not designed for this printer. The printer cannot print with these supplies installed.

Event codes are supply specific.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the [OK](#) button to identify the incompatible supplies.
- Replace the supplies with those that are designed for this printer.

Initializing...

The printer is starting.

Recommended action

See recommended action.

- No action necessary.

Install fuser unit

10.23.15: (event code) Fuser Kit

The fuser has been removed or installed incorrectly.

Recommended action

1. Open the right door.
2. Remove the fuser then reinstall it.

 **CAUTION:** The fuser might be hot.

3. If the message remains, replace the fuser.

Fuser Kit 110v part number: RM2-1928-000CN

Fuser Kit 220v part number: RM2-1929-000CN

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Fuser*

Install supplies

More than one supply is missing or is installed incorrectly.

Recommended action

1. Touch the **OK** button to identify the supplies that need to be replaced.
2. Touch the **OK** button a second time for more information about the specific supply.
3. Install the supply or make sure it is correctly installed and fully seated.

Internal disk device failure To clear touch “OK”

82.0X.YY (event code)

The internal disk failed.

Recommended action

1. Touch the **OK** button to clear the error.
2. If the error persists, turn off the printer, and then remove and reinstall the hard drive.
3. Turn on the printer.
4. If the error persists, replace the internal hard drive.

500 GB Secure Hard disk drive part number: B5L29-67903

320 GB Hard disk drive part number: 5851-6712

For instructions: *Removal and replacement: Hard disk drive*

Internal disk device failure To clear touch “OK”

The internal disk failed.

82 . 0X . YY (event code)

Recommended action

1. Touch the **OK** button to clear the error.
2. If the error persists, turn off the product, and then remove and reinstall the hard drive.
3. Turn on the product.
4. If the error persists, replace the internal hard drive.

Internal disk file operation failed

A PjL system command attempted to perform an illogical operation, such as downloading a file to a nonexistent directory.

Recommended action

- Touch the **OK** button to clear the error.

Internal disk file system is full

A PjL system command attempted to write data to the internal hard disk drive but was unsuccessful because the hard disk drive is full.

Recommended action

- Touch the **OK** button to clear the error.

Internal disk not found

The internal hard disk drive was not found at start up.

Recommended action

- Turn the printer off, and then on.

Internal disk not functional

82.0X.YY (event code)

The internal hard drive is not functioning correctly.

Recommended action

1. Turn off the printer, and then remove and reinstall the hard drive.
2. Turn on the printer.

3. If the error persists, replace the hard drive.



NOTE: Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 7-7 Hard disk drive (HDD) part numbers

Part Name	Part Number
HDD, 500GB 5400RPM SED	L41606-011 or 933853-011
HDD, 500GB 5400RPM FIPS/CCC OPAL2 7MM See NOTE above	L42243-021 See NOTE above

To order parts, go to <https://www.hp.com/buy/parts>.

For instructions: *Removal and replacement: Hard disk drive*

Internal disk not initialized

The internal hard disk drive file system must be initialized before it can be used.

Recommended action

- Initialize the internal hard disk drive file system.

For information on performing various actions on the hard disk drive, go to:

[HP LaserJet, OfficeJet, PageWide, ScanJet - HP FutureSmart Firmware Device Hard Disk, SSD, and eMMC Security \(white paper\)](#)

Internal disk spinning up

The internal hard disk drive device is spinning up its platter. Jobs that require hard disk drive access must wait.

Recommended action

See recommended action.

- No action necessary.

Load Tray <X>: [Type], [Size] To use another tray, press “OK”

This message displays when the indicated tray is selected, but is not loaded, and other paper trays are available for use.

It also displays when the tray is configured for a different paper type or size than the print job requires.

Recommended action for customers

1. Load the correct paper in the tray.
2. If prompted, confirm the size and type of paper loaded.

3. Otherwise, press the OK button to select another tray.
4. If the error persists, use the cassette paper present sensor test in the Tray/bin manual sensor test to verify that the sensor is functioning correctly.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

1. Load the correct paper in the tray.
2. If prompted, confirm the size and type of paper loaded.
3. Otherwise, press the OK button to select another tray.
4. If error persists, ensure the paper guides are set to the correct size paper being requested.
5. Make sure that the sensor flag on the paper presence sensor is not damaged and moves freely.
6. If the error persists, use the manual sensor test to check the specific tray paper sensor test in the to test the sensor. If the sensor test fails, replace the associated paper pickup unit.



NOTE: Before replacing any parts disconnect and reconnect the corresponding connector.

Table 7-8 Part numbers

Paper tray	Pickup assembly part number	Replacement instructions
550-sheet paper feeder	RM2-5154-000CN	<i>Removal and replacement: Paper pickup assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (1x550 feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

Loading program <XX> Do not power off

Programs and fonts can be stored on the printer's file system and are loaded into RAM when the printer is turned on. The number <XX> specifies a sequence number indicating the current program being loaded.

Recommended action

See recommended action.

- No action necessary.

Manually feed output stack Then touch "OK" to print second side

The printer has printed the first side of a manual duplex job and is waiting for you (or the applicable user) to insert the output stack to print the second side.

Recommended action

1. Maintaining the same orientation, remove the pages from the output bin.
2. Flip the document printed side up.
3. Load the document in Tray 1.
4. Touch the **OK** button to print the second side of the job.

Manually feed: <Type><Size>

This message appears when manual feed is selected, Tray 1 is not loaded, and other trays are empty.

Recommended action

1. Load the tray with requested paper.
2. If the paper is already in the tray, press the **Help** button to exit the message and then press the **OK** button to print.
3. To use another tray, clear paper from Tray 1, press the **Help** button to exit the message and then press the **OK** button.

Moving solenoid To exit press Stop

The solenoid is moving as part of a component test.

Recommended action

Follow these troubleshooting steps in the order presented.

- No action necessary.
To exit, press the **Stop** button.

Moving solenoid and motor

The solenoid and a motor are moving as part of a component test.

Recommended action

Follow these troubleshooting steps in the order presented.

- No action necessary.
To exit, press the **Stop** button.

No job to cancel

You have pressed the stop button but the printer is not actively processing any jobs.

Recommended action

See recommended action.

- No action necessary.

No USB drive or files found

The formatter was not able to detect the USB thumb drive.


If you experience the “No USB drive or files found” attempting to upgrade printer firmware via the walk up easy-access USB port perform the following.

Recommended action for customers

Follow these steps to try to resolve this error.

If you experience the “No USB drive or files found” attempting to upgrade printer firmware via the walk up easy-access USB port perform the following.

1. After the firmware file has been downloaded from hp.com uncompress the file and copy the xxxxxx.bdl file to the root of a portable USB flash memory storage device (thumb drive), insert the USB flash memory storage device into the easy-access USB port, and attempt to flash the firmware.
2. If the issue persists, verify the USB flash drive is formatted as FAT32. If unsure, format the flash drive as FAT32 and/or try a different flash drive and repeat step 1.
3. If the issue persists, the USB flash drive can be inserted directly into a USB port on the printer's formatter and the firmware flashed.
 - a. Locate the printer's formatter interface located at the rear left side of printer.
 - b. If necessary, rotate the printer for easier access to the formatter ports.
 - c. Locate the USB connection port (callout 2).

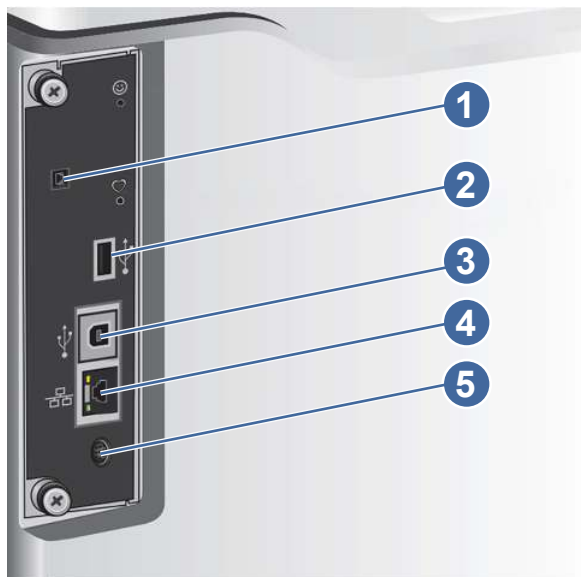

- d. Insert the USB flash drive (callout 2).

- e. Attempt to flash the printer's firmware.
 - f. After the firmware update remove the USB flash drive.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.



NOTE: This issue can occur when the printer formatter was installed previously in a different printer and the formatter NVRAM has become corrupt.

1. After downloading the latest firmware for the printer from *Software and Driver Downloads* webpage, extract the compressed firmware file, and then copy the ".bdl" file to a storage device or a portable USB flash drive.



IMPORTANT: Ensure that the ".bdl" file is not inside a folder and is saved to the main directory.

2. Insert the USB flash drive or storage device into the easy-access USB port on the printer, and upgrade the firmware.
3. If the issue persists, verify the USB flash drive is formatted as FAT32. If the USB flash drive is not formatted as FAT32, use the options below:
- **Option one:** Format the flash drive as FAT32, and then upgrade the firmware.
 - **Option two:** Try a different USB flash drive, and then upgrade the firmware.
4. If the issue persists, insert the USB flash drive with the ".bdl" file on the printer's formatter to upgrade the firmware.
- a. Slide the formatter cover straight out of the printer to remove it.
 - b. Locate the USB connection on the formatter and insert the USB flash drive.

Figure 7-1 Remove formatter



5. If the firmware updated successfully using a USB flash drive on the formatter USB port, perform the appropriate task for your printer model:
- **For MFP printer models (M681/M682/E67550/E67560/E67650/E67660 only):** Dispatch a walk-up USB control panel cable.

Table 7-9 Control panel cable part numbers

Part description	Part number
Control panel cable	J8A10-60111

- **For SFP printer models** (M652/M653/E65050/E65060/E65150/E65160 only): Elevate the case as a service part is not available.
6. If the issue persists after upgrading the firmware using a USB flash drive on the formatter USB port, dispatch a formatter for the printer model.

Table 7-10 Formatter part numbers

Description/Product models	Part number
Formatter (main logic) PC board assembly	J7Z98-60001
For products: M652/M653/E65050/E65060	
Formatter (main logic) PC board assembly (India/China)	J7Z98-67904
For products: M652/M653/E65050/E65060	
Formatter (main logic) PC board assembly	J8A10-60001
For products: M681/M682/E67550/E67560	
Formatter (main logic) PC board assembly (India/China)	J8A10-67902
For products: M681/M682/E67550/E67560	
Kit-Formatter	3GY03-67901
For products: E65150/E65160	
Kit-Formatter (India/China)	3GY03-67902
For products: E65150/E65160	
Kit-Formatter	3GY31-67901
For products: E67650/E67660	
Kit-Formatter (India/China)	3GY31-67902
For products: E67650/E67660	

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. After downloading the latest firmware for the printer from *Software and Driver Downloads* webpage, extract the compressed firmware file, and then copy the ".bdl" file to a storage device or a portable USB flash drive.



IMPORTANT: Ensure that the ".bdl" file is not inside a folder and is saved to the main directory.

2. Insert the USB flash drive or storage device into the easy-access USB port on the printer, and upgrade the firmware.
3. If the issue persists, verify the USB flash drive is formatted as FAT32. If the USB flash drive is not formatted as FAT32, use the options below:
 - **Option one:** Format the flash drive as FAT32, and then upgrade the firmware.
 - **Option two:** Try a different USB flash drive, and then upgrade the firmware.



NOTE: This issue can occur when the printer formatter was installed previously in a different printer and the formatter NVRAM has become corrupt.


4. If the issue persists, investigate if the printer's formatter was replaced recently or swapped from another printer. If possible, install the original formatter.
5. If the issue persists, insert the USB flash drive with the ".bdl" file on the printer's formatter to upgrade the firmware.
 - a. Slide the formatter cover straight out of the printer to remove it.
 - b. Locate the USB connection on the formatter and insert the USB flash drive.

Figure 7-2 Remove formatter



6. If the firmware updated successfully using a USB flash drive on the formatter USB port, perform the appropriate task for your printer model:
 - **For SFP printer models** (M652/M653/E65050/E65060/E65150/E65160 only): Remove and reconnect the J13 connector on the formatter.
 - **For MFP printer models** (M681/M682/E67550/E67560/E67650/E67660 only): Remove and reconnect the J20 connector on the formatter.

Figure 7-3 Connector: J13 for SFP and J20 for MFP

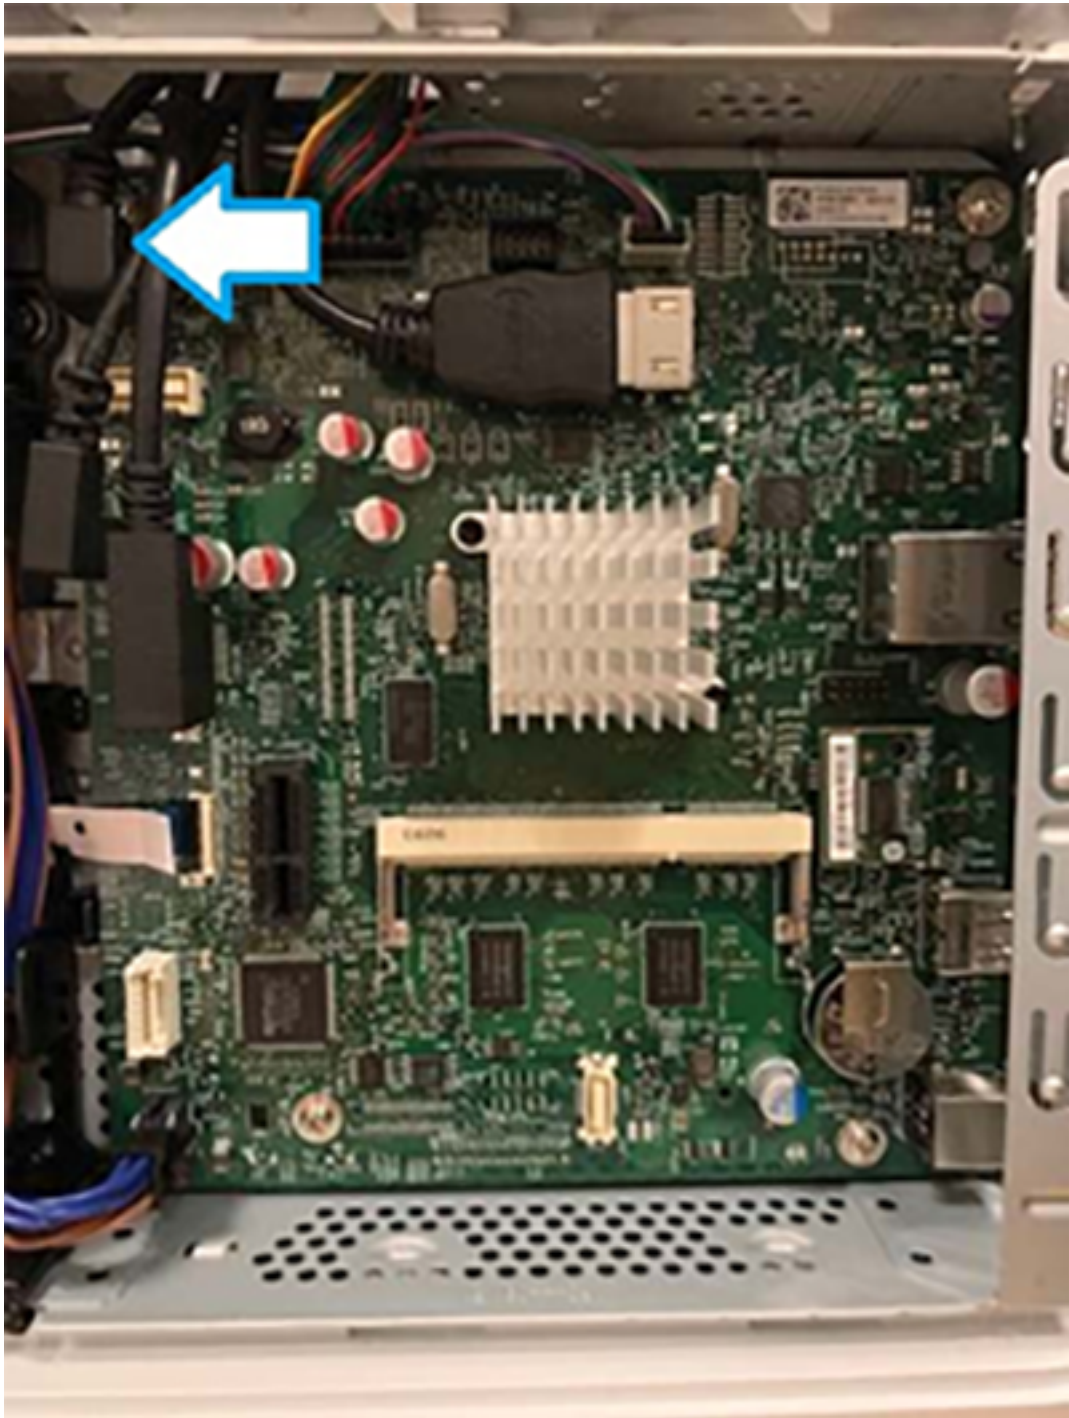

7. If the issue persists from the walk-up USB port, replace the walk-up USB control panel cable for your printer model.

Table 7-11 Control panel cable part numbers

Part description	Part number
Control panel cable	J8A10-60111

8. If the issue persists from the walk-up USB port, and after upgrading the firmware using a USB flash drive on the formatter USB port, replace the formatter.

Table 7-12 Formatter part numbers

Description/Product models	Part number
Formatter (main logic) PC board assembly	J7Z98-60001
For products: M652/M653/E65050/E65060	
Formatter (main logic) PC board assembly (India/China)	J7Z98-67904
For products: M652/M653/E65050/E65060	
Formatter (main logic) PC board assembly	J8A10-60001
For products: M681/M682/E67550/E67560	
Formatter (main logic) PC board assembly (India/China)	J8A10-67902
For products: M681/M682/E67550/E67560	
Kit-Formatter	3GY03-67901
For products: E65150/E65160	
Kit-Formatter (India/China)	3GY03-67902
For products: E65150/E65160	
Kit-Formatter	3GY31-67901
For products: E67650/E67660	
Kit-Formatter (India/China)	3GY31-67902
For products: E67650/E67660	

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

9. If the issue persists, elevate the case using the standard support process.

NON HP Supply Installed

This message is displayed for about 6 seconds when a new non-HP supply is installed.

10.99.31 (event code)

Recommended action

1. Use a genuine HP supply for the printer.

2. If you believe a genuine HP supply is being used, go to www.hp.com/go/anticounterfeit.

Output Bin Full

This message displays when the output bin is full and paper must be removed before printing can continue.

Recommended action for customers

1. Remove the paper from the output bin.
2. If this error appears even though the output bin is not full, make sure that the output bin sensor flag is not damaged and can move freely.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Remove the paper from the output bin.
2. If this message appears even though the output bin is not full.
 - a. Make sure that the output bin sensor flag is not damaged and can move freely. If the flag is damaged, replace the delivery drive assembly.
 - b. Use the output bin full sensor test in the manual sensor test to test the sensor. If it does not respond, replace the replace the delivery assembly.

Part number: RM2-6621-000CN

For instructions (M652, M653): *Removal and replacement: Delivery assembly (M652, M653)* See the Repair Service Manual for this product.

For instructions (M681, M682): *Removal and replacement: Delivery assembly (M681, M682)* See the Repair Service Manual for this product.

Paused...

The printer is paused, and there are no error messages pending at the display. The I/O continues receiving data until the memory is full.

Recommended action

- Press the **Stop** button.

Performing Paper Path Test

A paper path test is being performed.

Recommended action

See recommended action.

- No action necessary.

Please Wait...

The printer is in the process of clearing data.

Recommended action

See recommended action.

- No action necessary.

Printing Configuration...

The printer is printing the Configuration page.

Recommended action

See recommended action.

- No action necessary.

Printing Demo Page

The demo page is being generated. The printer will return to the Ready state when the page is complete.

Recommended action

- No action necessary.

Printing engine test...

The printer is printing an engine test page.

Recommended action

See recommended action.

- No action necessary.

Printing Event Log...

The printer is printing the Event Log page.

Recommended action

See recommended action.

- No action necessary.

Printing File Directory...

The printer is printing the File Directory pages.

Recommended action

See recommended action.

- No action necessary.

Printing Font List...

The printer is printing the Font List pages.

Recommended action

See recommended action.

- No action necessary.

Printing Help Page...

The printer is printing the Help page.

Recommended action

See recommended action.

- No action necessary.

Printing Menu Map...

The printer is printing the Menu Map pages.

Recommended action

See recommended action.

- No action necessary.

Printing stopped...

Time has expired on the Print/Stop test.

Recommended action

See recommended action.

- No action necessary.

Printing Supplies Status Page...

The printer is printing the Supplies Status page.

Recommended action

See recommended action.

- No action necessary.

Printing Usage Page...

The printer is printing the Usage page.

Recommended action

See recommended action.

- No action necessary.

Processing...

The printer is currently processing a job but is not yet picking pages. When paper motion begins, this message is replaced by a message that indicates the tray the job is using.

Recommended action

See recommended action.

- No action necessary.

Processing... copy <x> of <y>

The printer is currently processing or printing collated copies. The message indicates that copy number <x> of total copies <y> is currently being processed.

Recommended action

See recommended action.

- No action necessary.

Processing duplex job Do not grab paper until job completes

Paper temporarily comes into the output bin while printing a duplex job.

Recommended action

See recommended action.

- No action necessary.

Processing job from tray <x>... Do not grab paper until job completes

The printer is actively processing a job from the designated tray.

Recommended action

See recommended action.

- No action necessary.

RAM disk device failure To clear press "OK"

The specified device failed.

Recommended action

- Touch the **OK** button to clear the error.

RAM disk file operation failed To clear press "OK"

A PJL command was received that attempted to perform an illegal operation, such as downloading a file to a nonexistent directory.

Recommended action

- Touch the **OK** button to clear the error.

RAM disk file system is full To clear press “OK”

The RAM disk is full.

Recommended action

- Touch the [OK](#) button to clear the error.

RAM disk not initialized

The RAM disk file system must be initialized before it can be used.

Recommended action

- Initialize the RAM disk file system.

RAM disk is write protected To clear press “OK”

The device is protected and no new files can be written to it.

Recommended action

- Touch the [OK](#) button to clear the error.

Ready

The printer is online and ready for data. No status or printer attendance messages are pending at the display.

Recommended action

See recommended action.

- No action necessary.

Ready <IP Address>

The printer is online and ready for data. No status or printer attendance messages are pending at the display. The printer IP address displays.

Recommended action

See recommended action.

- No action necessary.

Receiving Upgrade

The printer is receiving a firmware upgrade.

Recommended action

- Do not turn the printer off until it reaches the [Ready](#) state.

Remove USB accessory

This message displays when an unsupported USB device is inserted into a host USB port on the printer.

Recommended action

- Remove the unsupported USB device.

Replace <Supply>

This alert displays only if the printer is configured to stop when a supply reaches the very low threshold. The printer indicates when a supply level is at its estimated end of life. The actual life remaining might be different than estimated.

The supply does not need to be replaced now unless the print quality is no longer acceptable.



NOTE: HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

The printer can be configured to stop when the supply level is very low. The supply might still be able to produce acceptable print quality.

Recommended action

- Replace the specified supply.

Or, configure the printer to continue printing using the [Manage Supplies](#) menu on the printer control panel.

Replace Supplies

This alert displays only if the printer is configured to stop when a supply reaches the very low threshold. The printer indicates when a supply level is at its estimated end of life. The actual life remaining might be different than estimated.

The supply does not need to be replaced now unless the print quality is no longer acceptable.



NOTE: HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

The printer can be configured to stop when the supply level is very low. The supply might still be able to produce acceptable print quality.

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the specified supply.

Or, configure the printer to continue printing using the [Manage Supplies](#) menu on the printer control panel.

Resend external accessory firmware

An external accessory requires a firmware upgrade. Printing can continue, but jams might occur if the job uses the external accessory.

Recommended action

- Perform a firmware upgrade.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

Resend Upgrade

A firmware upgrade did not complete successfully.

Recommended action

- Upgrade the firmware again.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

Restore Factory Settings

The printer is restoring factory settings.

Recommended action

See recommended action.

- No action necessary.

RFU Load Error Send full RFU on <X> Port

The printer displays this message before the firmware is loaded at initialization when an error has occurred during a firmware upgrade.

Recommended action

- Resend the firmware upgrade.

ROM disk device failed To clear press “OK”

The specified device failed.

Recommended action

- Touch the **OK** button to clear the error.

ROM disk file operation failed To clear press “OK”

A PjL command was received that attempted to perform an illegal operation, such as downloading a file to a nonexistent directory.

Recommended action

- Touch the **OK** button to clear the error.

ROM disk file system is full To clear press “OK”

The specified device is full.

Recommended action

- Touch the **OK** button to clear the error.

ROM disk is write protected To clear press “OK”

The device is protected and no new files can be written to it.

Recommended action

- Touch the **OK** button to clear the error.

ROM disk not initialized To clear press “OK”

The ROM disk file system must be initialized before it can be used.

Recommended action

- Initialize the ROM disk file system.

Rotating Motor

The printer is executing a component test and the component selected is a motor.

Recommended action

1. Press the **STOP** button when ready to stop this test.
2. To exit, press **X**.

Sanitizing disk <X> complete Do Not power off

The hard disk is being cleaned.

Recommended action

- Contact the network administrator.

Size mismatch in Tray <X>

The paper in the listed tray does not match the size specified for that tray.

If using adhesive or self-sealing media, go to **WISE** and search for the following document: A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper (ish_3199741-3199797-16). A *"13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper.*

Recommended action

1. Load the correct paper.
2. Make sure that the paper is positioned correctly.
3. Close the tray, and then make sure that the control panel lists the correct size and type for the specified tray.

4. If necessary, use the control panel menus to reconfigure the size and type settings for the specified tray.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

1. Load the correct paper.
2. Make sure that the paper is positioned correctly.
3. Close the tray, and then make sure that the control panel lists the correct size and type for the specified tray.
4. If necessary, use the control panel menus to reconfigure the size and type settings for the specified tray.
5. If this message appears even though the correct size paper is loaded in the correct paper tray, perform the following troubleshooting steps:
 - a. Run the manual sensor test and check the failing tray paper size sensor test to test the switches. If they do not respond, replace the associated tray size sensor.

Tray	Size sensor part number	Replacement instructions
550 sheet paper feeder tray 3	RM2-5147-000CN	<i>Removal and replacement: Size detect switch, 550-sheet feeder</i> See the Repair Service Manual for this product.
550 sheet feeder with stand	RM2-0857-000CN	<i>Removal and replacement: Size sensor, 1x550 sheet feeder with stand</i> See the Repair Service Manual for this product.
3x550 with stand (all trays)	RM2-0857-000CN	<i>Removal and replacement: Size sensor, 3x550-sheet feeder with stand</i> See the Repair Service Manual for this product.
2500 HCI tray 3	RM2-0857-000CN	<i>Removal and replacement: Size sensor, 2500-sheet feeder tray 3</i> See the Repair Service Manual for this product.
2500 HCI tray 4	RM2-0918-000CN	<i>Removal and replacement: Size sensor, 2500-sheet feeder tray 4</i> See the Repair Service Manual for this product.

- b. Reconnect tray connectors on the media size switch, and then reconnect the connector on the DC controller to the tray.
- c. If the error persists, replace the lifter drive assembly.

Paper tray	Lifter drive assembly part number	Replacement instructions
550-sheet paper feeder	RM2-6933-000CN	<i>Removal and replacement: Lifter drive assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.

Paper tray	Lifter drive assembly part number	Replacement instructions
1x550-sheet paper feeder with stand	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (1x550 feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-2091-000CN	<i>Removal and replacement: Lifter drive assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

Sleep mode on

The printer is in sleep mode. Pressing a control-panel button, receiving a print job, or occurrence of an error condition clears this message.

Recommended action

See recommended action.

- No action necessary.

Supplies low

Multiple supplies on the printer have reached the low threshold.

Recommended action

- Replace the supply when print quality is no longer acceptable.

Supply memory warning

The printer cannot read or write to the e-label or the e-label is missing.

Recommended action

See recommended action.

- No action necessary.

The unit has corrupt data

Data corruption has occurred in the firmware volume.

- 98 . 00 . 01 : Corrupt data in the firmware volume
- 98 . 00 . 02 : Corrupt data in the solutions volume
- 98 . 00 . 03 : Corrupt data in the configuration volume
- 98 . 00 . 04 : Corrupt data in the job data volume

Recommended action for 98.00.01, 98.00.02, and 98.00.03

For 98 . 00 . 01 , 98 . 00 . 02 , and 98 . 00 . 03 , perform the following steps:

1. Turn the printer off, and then on.
2. Use the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: [HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#).*

3. Reload the firmware.

Recommended action for 98.00.04

For 98 . 00 . 04 , perform the following steps:

1. Turn the printer off, and then on.
2. Run the file erase function.

For the steps to perform this procedure, go to [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#).

Too many jobs in queue

This message displays a USB file is selected to print, and 100 files are already in the print queue.

Recommended action

- To select another file already in the print queue, touch the [OK](#) button.

Tray <X> empty: [Type], [Size]

The specified tray is empty and the current job does not need this tray to print.

- X = 1: Tray 1
- X = 2: Tray 2
- X = 3: Tray 3
- X = 4: Tray 4
- X = 5: Tray 5

Recommended action

Follow these troubleshooting steps in the order presented.

- Refill the tray at a convenient time.



NOTE: This could be a false message. If the tray is loaded without removing the shipping lock, the printer does not sense that the paper is loaded. Remove the shipping lock, and then load the tray.

Tray <X> lifting

The printer is in the process of lifting paper in the indicated tray.

- X = 2: Tray 2
- X = 3: Tray 3
- X = 4: Tray 4
- X = 5: Tray 5

Recommended action

- No action necessary.

Tray <X> open

The specified tray is open or not closed completely.

- X = 2: Tray 2
- X = 3: Tray 3
- X = 4: Tray 4
- X = 5: Tray 5

Recommended action for customers

1. Close the tray.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Close the tray.
2. If this message displays after the lifter drive assembly was removed or replaced, make sure that the connector of the assembly is connected correctly and fully seated.
3. If the error persists, use the media size switches test in the [Support Tools > Troubleshooting, Diagnostic tests > manual sensor test](#) to test the failing tray switches. If they do not respond, replace associated tray size sensor.

Table 7-13 Part numbers

Tray	Size sensor part number	Replacement instructions
550 sheet paper feeder tray 3	RM2-5147-000CN	<i>Removal and replacement: Size detect switch, 550-sheet feeder</i> See the Repair Service Manual for this product.
550 sheet feeder with stand	RM2-0857-000CN	<i>Removal and replacement: Size sensor, 1x550 sheet feeder with stand</i> See the Repair Service Manual for this product.

Table 7-13 Part numbers (continued)

Tray	Size sensor part number	Replacement instructions
3x550 with stand (all trays)	RM2-0857-000CN	<i>Removal and replacement: Size sensor, 3x550-sheet feeder with stand</i> See the Repair Service Manual for this product.
2500 HCI tray 3	RM2-0857-000CN	<i>Removal and replacement: Size sensor, 2500-sheet feeder tray 3</i> See the Repair Service Manual for this product.
2500 HCI tray 4	RM2-0918-000CN	<i>Removal and replacement: Size sensor, 2500-sheet feeder tray 4</i> See the Repair Service Manual for this product.

Tray <X> overfilled

The tray is filled above the stack-height mark.

- X = 2: Tray 2
- X = 3: Tray 3
- X = 4: Tray 4
- X = 5: Tray 5

The overfilled condition is sensed by the stack surface sensor when the tray is first closed. If the stack surface sensor does not move down (because the tray is too full), the overfilled message will be displayed and the tray will not be available for printing.

Recommended action for customers

1. Open the tray and remove paper until the tray filled indicators can be seen.
2. Close the tray.
3. If the message persists, remove all the paper from the tray and close the tray.

If the message clears, load the paper below the fill indicator.

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Open the tray and remove paper until the tray filled indicators can be seen.
2. Close the tray.
3. If the issue persists after removing paper from the tray, replace paper pickup assembly.



NOTE: Before replacing the paper pickup assembly perform the following steps.

- a. If the error persists, use the media size switches test in the [Support Tools > Troubleshooting, Diagnostic tests > manual sensor test](#) to test the failing tray switches. If they do not respond, replace associated tray size sensor.

Table 7-14 Part numbers

Tray	Size sensor part number	Replacement instructions
550 sheet paper feeder tray 3	RM2-5147-000CN	<i>Removal and replacement: Size detect switch, 550-sheet feeder</i> See the Repair Service Manual for this product.
550 sheet feeder with stand	RM2-0857-000CN	<i>Removal and replacement: Size sensor, 1x550 sheet feeder with stand</i> See the Repair Service Manual for this product.
3x550 with stand (all trays)	RM2-0857-000CN	<i>Removal and replacement: Size sensor, 3x550-sheet feeder with stand</i> See the Repair Service Manual for this product.
2500 HCI tray 3	RM2-0857-000CN	<i>Removal and replacement: Size sensor, 2500-sheet feeder tray 3</i> See the Repair Service Manual for this product.
2500 HCI tray 4	RM2-0918-000CN	<i>Removal and replacement: Size sensor, 2500-sheet feeder tray 4</i> See the Repair Service Manual for this product.

- b. Verify that all connections from the DC controller to the paper pickup assembly and lifting drive assembly are fully seated and connected. A loose or missing connection can cause this error.
- c. If this message appears after lifter drive assembly was removed or replaced, make sure that the connector on the assembly is correctly connected and fully seated.
- d. If the error persists, replace the paper pickup assembly.

Table 7-15 Part numbers

Paper tray	Pickup assembly part number	Replacement instructions
550-sheet paper feeder	RM2-5154-000CN	<i>Removal and replacement: Paper pickup assembly (550-sheet paper feeder)</i> See the Repair Service Manual for this product.
1x550-sheet paper feeder with stand	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (1x550 feeder with stand)</i> See the Repair Service Manual for this product.
3x550-sheet paper feeder with stand	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (3x550 feeder with stand)</i> See the Repair Service Manual for this product.
2500-sheet HCI	RM2-1235-000CN	<i>Removal and replacement: Paper pickup assembly (2500-sheet HCI)</i> See the Repair Service Manual for this product.

Type mismatch Tray <x>

The specified tray contains a paper type that does not match the configured type.

Recommended action

The specified tray will not be used until this condition is addressed. Printing can continue from other trays.

1. Load the correct paper in the specified tray.
2. On the printer control panel, make sure the paper type loaded in the tray matches the specified setting for the tray.

Unsupported drive installed To continue, touch “OK”

A non-supported hard disk drive has been installed. The hard disk drive is unusable by this printer.

Recommended action

1. Turn the printer off.
2. Remove the hard drive.
3. Turn the printer on.

Unsupported supply in use OR Unsupported supply installed To continue, touch “OK”

The printer has one or more HP genuine supplies, designed for a different printer, in use.

- **10.00.41** (event code): Black print cartridge

Recommended action

- Install the correct supplies for this printer.
 - HP 655A Black laser toner cartridge part number: CF450A
 - HP 655A Cyan laser toner cartridge part number: CF451A
 - HP 655A Magenta laser toner cartridge part number: CF452A
 - HP 655A Yellow laser toner cartridge part number: CF453A
 - HP 656X High capacity Black laser toner cartridge part number: CF460A
 - HP 656X High capacity Cyan laser toner cartridge part number: CF461A
 - HP 656X High capacity Magenta laser toner cartridge part number: CF456A
 - HP 656X High capacity Yellow laser toner cartridge part number: CF463A
 - HP 657X High capacity replacement Black laser toner cartridge part number: CF470A
 - HP 657X High capacity replacement Cyan laser toner cartridge part number: CF471A
 - HP 657X High capacity replacement Magenta laser toner cartridge part number: CF476A
 - HP 657X High capacity replacement Yellow laser toner cartridge part number: CF473A

Unsupported tray configuration

The printer has too many optional trays installed.

Recommended action

- Turn the printer off, remove the unsupported trays, and then turn the printer on.

Unsupported USB accessory detected Remove USB accessory

A non-supported USB accessory has been installed.

Recommended action

- Turn the printer off, remove the USB accessory, and then turn the printer on.

USB device is not responding. Please remove it.

An optional USB device that has been connected is no longer recognized by the firmware.

(MFP Z bundle ONLY)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Turn off the printer and unplug both the walk-up USB, and the hardware integration pocket (HIP) USB from the printer.
3. Turn the printer on.
4. If the error persists, turn off the printer. Unplug the wireless card and then turn the printer on.
5. If the error is cleared with the wireless card unplugged, order the wireless (WIFI) module.
Wireless PC board assembly - Embedded part number: 0960-3654
6. If the error persists, elevate the case using the standard support process.

USB accessory not functional

A parameter in the USB accessory is not correctly functioning.

Recommended action

1. Turn the printer off.
2. Remove the USB accessory.

3. Insert a replacement USB accessory.
4. Turn the printer on.

USB hubs are not fully supported Some operations may not work properly

Some USB hubs require more power than the printer has available.

Recommended action

- Remove the USB hub.

USB is write protected To clear press “OK”

The device is protected and no new files can be written to it.

Recommended action

- Touch the **OK** button to clear the error.

USB needs too much power Remove USB and then turn off and on

A USB accessory is drawing too much electrical current. Printing cannot continue.

Recommended action

1. Turn the printer off, remove the USB accessory, and then turn the printer on.
2. Use a USB accessory that uses less power or that contains its own power supply.

USB not initialized

The USB device file system must be initialized before it can be used.

Recommended action

1. Enable the USB port using the following steps:
 - **FutureSmart 3:**
 - a. From the Home screen on the printer control panel, open the following menus:
 - i. **Administration**
 - ii. **General Settings**
 - b. Select **Enable Device USB**.
 - c. Select **Enabled**, and then select **Save**.
 - d. Touch the Back button  to return to the **General Settings** menu.
 - **FutureSmart 4:**
 - a. From the Home screen on the printer control panel, select **Settings**.
 - b. Select **Copy/Print**.
 - c. Select **Enable Device USB**, and then select **Enabled**.

- d. Touch the Back button  to return to the [Settings](#) menu.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

USB storage accessory removed Clearing any associated data

This message displays for about 6 seconds after a USB device is removed.

Recommended action

- Touch the [OK](#) button to remove this message.

USB storage device failure To clear press “OK”

The specified device failed.

Recommended action

- Touch the [OK](#) button to clear the error.

USB storage file operation failed To clear press “OK”

A P/JL file system command was received that attempted to perform an illegal operation, such as downloading a file to a nonexistent directory.

Recommended action

- Touch the [OK](#) button to clear the error.

USB storage file system is full To clear press “OK”

The file system on the installed USB device is full.

Recommended action

- Touch the [OK](#) button to clear the error.

Used supply installed To continue, touch “OK” OR Used supply in use

The toner cartridges or supplies has been previously used.

Recommended action

Follow these troubleshooting steps in the order presented.

- If you believe a genuine HP supply is being used, go to www.hp.com/go/anticounterfeit.

Verifying, Please Wait

This message displays when the printer is retrieving a print job from device memory, but can cause the printer control panel to lock up.

After selecting the desired print jobs from the **Retrieve from Device Memory** menu, the message **Verifying, Please Wait** displays on the control panel. The status bar will move for a moment, and then might lock up. Typically, if you wait a few minutes, the error will clear and the job will print.

In rare cases, the message will lock up permanently and the printer must be restarted.

The event log might show the following errors as a result of restarting the printer during lockup:

- 48.05.05
- 98.03.11

Recommended action

1. Turn the printer off, and then on.
2. Make sure the firmware is the latest revision.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

Waiting for tray <x> to lift

The specified tray is in the process of lifting paper to the top of the tray (so it can correctly feed).

Recommended action

See recommended action.

- No action necessary.

Index

Symbols/Numerics

76.00.24 5

B

backup error
 32.WX.YZ error 4
 reset error 4
 restore error 4

C

connector error
 65.WX.YZ error 5

D

DC controller communication error
 55.WX.YZ error 4
DC controller firmware error
 70.WX.YZ error 5
digital sending error (firmware)
 44.WX.YZ error 4
document feeder error
 31.WX.YZ error 4
duplexer error
 69.WX.YZ error 5

E

Embedded Jetdirect error
 80.WX.YZ error 5
engine error (LaserJet)
 46.WX.YZ error 4
 63.WX.YZ error 5
engine error (PageWide)
 61.WX.YZ error 4
event log error (firmware)
 42.WX.YZ error 4

F

fan error
 58.WX.YZ error 4
firmware communication error
 49.WX.YZ error 4
firmware install error
 99.WX.YZ error 5
hard disk error 5
remote firmware upgrade
 error 5

fuser error
 41.WX.YZ error 4
 laser scanner error 4
 paper path error 4
fuser error (LaserJet)
 50.WX.YZ error 4

H

hard disk partition error
 98.WX.YZ error 5

I

input accessory error
 67.WX.YZ error 5
input/output error
 40.WX.YZ error 4
internal diagnostics error
 90.WX.YZ error 5
 video display error 5

J

jam error (LaserJet)
 13.WX.YZ error 3
jam error (PageWide)
 13.WX.YZ error 4
job accounting error (firmware)
 48.WX.YZ error 4
job management error
 (firmware) 4
job pipeline error (firmware) 4
job parser error (firmware)
 47.WX.YZ error 4
printer calibration error 4

L

laser scanner error (LaserJet)
 51.WX.YZ error 4
 52.WX.YZ error 4
last update 1

M

memory error
 82.WX.YZ error 5
EMMC error 5
hard disk error 5

motor error (LaserJet)
 59.WX.YZ error 4

N

Near Field Communication error
 81.WX.YZ error 5
 Bluetooth error 5
 external I/O card error 5
 internal EIO error 5
 wireless error 5

O

output accessory error
 66.WX.YZ error 5
OXPd/Web kit error
 45.WX.YZ error 4

P

page error
 21.WX.YZ error 4
paper handling error (LaserJet)
 56.WX.YZ error 4
print bar error (PageWide)
 62.WX.YZ error 5
printer memory error
 20.WX.YZ error 4

R

real-time clock error
 11.WX.YZ error 3

S

scanner error
 30.WX.YZ error 4
security error
 33.WX.YZ error 4
sensor error
 54.WX.YZ error 4
 58.WX.YZ error 4
supplies error (LaserJet)
 10.WX.YZ error 3
supplies error (PageWide)
 17.WX.YZ error 4
system error (LaserJet)
 62.WX.YZ error 5

T

tray motor error (LaserJet)
60.WX.YZ error 4