



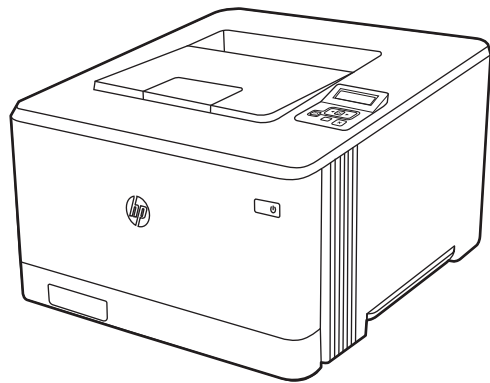

HP Color LaserJet Pro M454
HP Color LaserJet Pro MFP M479

Control Panel Message Document (CPMD)

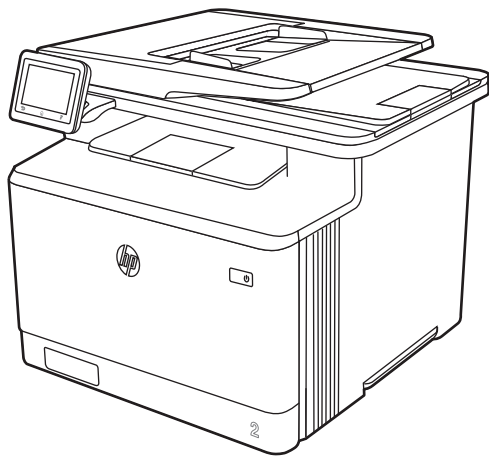

www.hp.com/support/colorljM454
www.hp.com/support/colorljM479MFP



HP Color LaserJet Pro M454, HP Color LaserJet Pro MFP M479 - Control Panel Message Document (CPMD)

SUMMARY

This document provides error-code troubleshooting information

Legal information

Copyright and License

© Copyright 2023 HP Development Company, L.P.

Reproduction, adaptation, or translation without prior written permission is prohibited, except as allowed under the copyright laws.

The information contained herein is subject to change without notice.

The only warranties for HP products and services are set forth in the express warranty statements accompanying such products and services. Nothing herein should be construed as constituting an additional warranty. HP shall not be liable for technical or editorial errors or omissions contained herein.

Edition 2, 04/2025

Trademark Credits

Adobe®, Adobe Photoshop®, Acrobat®, and PostScript® are trademarks of Adobe Systems Incorporated.

Apple and the Apple logo are trademarks of Apple Inc., registered in the U.S. and other countries.

macOS is a trademark of Apple Inc., registered in the U.S. and other countries.

AirPrint is a trademark of Apple Inc., registered in the U.S. and other countries.

Google™ is a trademark of Google Inc.

Microsoft®, Windows®, and Windows Server® are U.S. registered trademarks of Microsoft Corporation.

UNIX® is a registered trademark of The Open Group.

Table of contents

1 Document last updated	1
2 About this document.....	2
3 Control-panel message types.....	3
Error-code and control-panel-message troubleshooting overview.....	3
Error codes (types and structure)	3
4 How to search for printer documentation	6
WISE - How to access and use.....	6
Accessing WISE.....	6
Using WISE to search for error codes.....	10
Using WISE to access repair and replace videos for FRUs	12
5 Printer service information.....	17
6 Numerical control panel messages.....	18
10.WX.YZ error messages	18
10.00.00, 10.01.00, 10.02.00, 10.03.00 Supply problem or Supply memory error	18
10.0x.0z Supply problem or Supply memory error	19
10.00.10, 10.01.10, 10.02.10, 10.03.10 Supply memory error	21
10.0x.10 or 10.0x.11 or 10.0x.12.....	22
10.00.30, 10.01.30, 10.02.30 or 10.03.30 Unauthorized <Color> supply	26
10.00.31, 10.01.31, 10.02.31, 10.03.31 Starting to print with non-HP cartridges.....	26
10.0X.35, 10.wx.43 Incompatible <supply>	27
10.00.40, 10.01.40, 10.02.40, 10.03.40 No longer printing with non-HP supplies.....	27
10.00.57, 10.01.57, 10.02.57, 10.03.57 Protected <Color> supply installed.....	28
10.00.70, 10.01.70, 10.02.70, 10.03.70 Printing past very low <Color> supply	28
10.00.71 Starting to print in black only	28
10.00.81 No longer printing in black only	31
10.20.43, 10.21.43, 10.22.43, 10.23.43 Incompatible Cartridge.....	31
13.WX.YZ error messages	38
13.02.yz Paper is jammed in Tray 1	38
13.03.yz Paper is jammed in Tray 2	44
13.04.yz Paper is jammed in Tray 3	48
13.08.yz,13.09.yz, 13.14.yz, 13.15.yz Paper is jammed inside the printer	51
13.10.yz, 13.11.yz, 13.13.yz Paper is jammed in the output bin	53
21.WX.YZ error messages	54
21.* errors	54
21.00.00 Page Too Complex.....	54
30.WX.YZ error messages	55
30.01.08 Home position error	55
30.03.14 Scanner error	56
30.03.20.....	56

30.03.22 Scanner failure.....	57
30.03.30 Scanner Failure.....	57
31.WX.YZ error messages.....	58
31.01.47 Document feeder not detected.....	58
31.03.14 Backside scanner EEPROM error.....	58
31.03.20 backside scanner not detected.....	59
31.03.22 Scanner calibration failure.....	59
31.03.31 Document feeder motor stall.....	60
31.13.01 Document feeder pick error.....	61
31.13.02 Jam in document feeder.....	61
32.WX.YX error messages.....	62
32.* errors.....	62
32.21.11 Cold Reset Performed.....	63
33.WX.YZ error messages.....	63
33.05.00, Boot code corrupt.....	63
33.05.04 Upgrade corrupt.....	63
33.05.10 Code sign error.....	64
44.WX.YZ error messages.....	64
44.34.10 Fax DSP not detected.....	64
44.34.11 Fax DSP Failed.....	65
44.34.12 Fax CSP1040 Failed.....	66
44.34.13 Fax connected to wall jack.....	67
44.34.14 Fax connect to wall fail.....	67
44.34.15 Fax phone cord connect correct.....	67
44.34.16 Fax phone cord connect correct failed.....	67
44.34.19 Fax line condition result.....	68
44.34.1A Fax line condition result fail.....	68
44.34.1B Fax dial tone test result.....	68
44.34.1C Fax dial tone test result fail.....	69
44.34.1D Fax hardware test result.....	70
44.92.10 Fax communication error.....	70
44.92.12 Fax memory full.....	71
44.92.13 Fax cannot reprint.....	71
50.WX.YZ error messages.....	71
50.* errors.....	71
50.00.00.....	72
50.01.00.....	73
50.02.00.....	74
50.03.00.....	75
50.04.00.....	76
50.05.00.....	77
50.07.00.....	78
50.08.00.....	82
50.09.00.....	83
50.11.00.....	84
50.12.00.....	85
51.WX.YZ, 52.WX.YZ error messages.....	87

51.* errors	87
51.wx.00	87
52.* errors	88
52.00.00	89
53.WX.YZ error messages	89
53.17.00	89
53.18.00	90
54.WX.YZ error messages	91
54.01.00	91
54.06.00	91
54.07.00 or 54.08.00 or 54.09.00 or 54.11.00	92
54.11.yz or 54.12.yz	92
54.14.00	93
54.15.yz	93
54.wx.00	94
54.19.00 or 54.25.00	95
54.1C.00	95
54.21.00	96
55.WX.YZ error messages	97
55.* errors	97
55.00.00, 55.01.00, 55.30.00 or 55.40.00	97
55.03.00	98
55.06.01, 55.06.02	99
55.90.28	99
56.WX.YZ error messages	100
56.* errors	100
56.01.00	100
57.WX.YZ error messages	100
57.* errors	100
57.01.00 Fan failure	101
57.02.00 Fan failure	102
58.WX.YZ error messages	102
58.* errors	102
58.04.00	103
59.WX.YZ error messages	104
59.* errors	104
59.03.00 or 59.04.00 Fuser error	104
59.09.00 or 59.0A.00	105
59.5x.00 or 59.6x.00	106
59.7x.00 or 59.8x.00	107
59.00.C0 or 59.00.F0	108
60.WX.YZ error messages	108
60.* errors	108
60.02.00	109
60.03.00	109

7 Alphabetical control panel messages..... 111

Alphabetical error messages	111
Canceling...<jobname>	111
Wrong cartridges in slot	111
<Color> cartridge low	111
<Color> cartridge very low	112
Cartridge Memory Error	112
Cartridge Memory Missing	112
Cooling device	115
Checking engine	116
Checking paper path	116
Cleaning	116
Close the cartridge access door	116
Data received To print last page press "OK"	118
Device error. Press [OK] to continue	118
Device is busy. Tray again later.....	118
Document feeder jam. Clear and reload	119
Document feeder miss-pick. reload.....	119
Fax is busy. Canceled send	120
Fax line surge.....	121
Fax receive error	121
Fax send error	122
Fax storage is full. Canceling the fax send/receive.....	122
Genuine HP cartridge installed	122
Genuine HP supply installed	122
Incompatible supplies	123
Incompatible <Supply>	123
Initializing... ..	123
Insert or close Tray <X> to continue.....	123
Install <color> cartridge.....	123
Jam in output bin. Open rear door and clear jam.....	124
Jam in Tray 1. Clear the jam, and then press "OK"	125
Jam in Tray 2. Clear the jam, and then press "OK"	128
Jam in Tray 3. Clear the jam, and then press "OK"	130
Jam in print paper path. Open rear door and clear jam.....	131
Load Tray <X>: [Type], [Size] To use another tray, press "OK"	132
Manually feed output stack Then touch "OK" to print second side	133
Manually feed: <Type><Size>	133
Misprint. Press [OK] to continue.....	133
No Dial tone.....	134
No Fax detected.....	134
No job to cancel	134
NON HP Supply Installed	135
Printer out of memory, job too big	135
Output Bin Full	135
Paused... ..	136
Printing Configuration... ..	136
Printing engine test... ..	136
Printing Event Log... ..	136
Printing File Directory... ..	136

Printing Font List..	137
Printing Help Page..	137
Printing Menu Map..	137
Printing Supplies Status Page..	137
Printing Usage Page..	137
Power Failure Recovery.....	137
Power supply malfunction.	138
Protected <COLOR> cartridge.....	138
Ready	138
Ready <IP Address>	138
Rear door open.....	139
Replace Supplies	139
Restore Factory Settings	140
Supplies low	140
Supply memory warning	140
Tray <X> empty: [Type], [Size]	140
Tray <X> lifting error	141
Tray <X> Overfilled.....	141
Type mismatch Tray <x>	141
Used or Counterfeit in Use	142
Used supply installed To continue, touch “OK” OR Used supply in use	142
Waiting for tray <x> to lift	142

Index.....	143
------------	-----

1 Document last updated

The following is the last time this document was updated:

Last update: April 15, 2025

2 About this document

This document provides error-code troubleshooting information.



IMPORTANT: Procedures and part numbers change. For current information, use the browser-based format.

Verify PDF is the most current before use. PDF part numbers must be verified with web-based error code information or parts look-up before parts are ordered.

Choose the format that best meets your needs.

Table 2-1 Content format types

Format	Document title example	Recommended use
Web-based	Go to: Product Detail page > Error Code Look-up	Quick access to individual web-based error code troubleshooting TIP: Save Product Detail page URL location in favorites
Web-Base	Go To: WISE default Search page > Enter [Product] and error code	- Access to individual web-based error code troubleshooting - Web-based: Most up-to-date information available
PDF	[Product] - Control Panel Message Document (CPMD) PDF	- Use when support portals are NOT accessible at time of service - Use when a printable document is needed NOTE: Always refer to the printer service manual for removal and replacement procedures NOTE: For current information, use the Web-based format.

3 Control-panel message types

The control-panel messages and event code entries indicate the current printer status or situations that might require action.



NOTE: Event log errors do not appear on the control-panel display. Open the event log to view or print the event log errors.

A control-panel message displays temporarily and might require you (or the applicable user) to acknowledge the message by touching the **OK** button to resume printing or by touching the **Stop** button to cancel the job.

With certain messages, the job might not finish printing, or the print quality might be affected. If the message is related to printing and the auto-continue feature is on, the printer will attempt to resume printing after the message has appeared for 10 seconds without acknowledgement.

For some messages, restarting the printer might fix the problem. If a critical error persists, the printer might require service.

Error-code and control-panel-message troubleshooting overview

This section provides information on error codes and searching for information.

Error codes (types and structure)

Error codes and control-panel messages display on the printer control panel to indicate the current printer status or situations that might require action. Error codes are numerical, or alphanumerical, and have a set structure with six characters (example: 13.WX.YZ).

- The first two characters are numeric and represent the system component that is causing the error. For example, in error code 10 . 22 . 15, **10** = **Supplies** for HP LaserJets.
- The remaining four characters (W, X, Y, and Z values) further define the error.

HP LaserJet and HP PageWide Enterprise error codes are documented in the control panel message document (CPMD) for each printer.

The CPMD is a comprehensive list of error codes, diagnostic and troubleshooting steps to clear or resolve the error, and other helpful information such as service mode pins and part numbers.

The CPMD is continually updated and republished with the latest information for the following error codes.

Table 3-1 ERROR CODES: The first two characters

Error code	System Component	System Error Description
10.WX.YZ	Supplies (LaserJet)	Supply error or supply memory error.
11.WX.YZ	Real-time clock	Internal error with the clock on the formatter.
13.WX.YZ	Jam (LaserJet)	Paper jam or open door jam error.

Table 3-1 ERROR CODES: The first two characters (continued)

Error code	System Component	System Error Description
15.WX.YZ	Jam (PageWide)	Paper jam or open door jam error.
17.WX.YZ	Supplies (PageWide)	Supply error or supply memory error.
20.WX.YZ	Printer memory	Insufficient memory or buffering error.
21.WX.YZ	Page	Page complexity causing a decompression error when trying to process job.
30.WX.YZ	Scanner	Flatbed scanner error occurring inside the unit.
31.WX.YZ	Document feeder	Document feeder, scanner, or jam error.
32.WX.YZ	Backup, restore, or reset	Backup, restore, or reset notification or error.
33.WX.YZ	Security	Backup, Disk, EFI BIOS, Firmware integrity (SureStart), or Trusted Platform Module (TPM) notification or error.
40.WX.YZ	Input/Output (I/O)	Partition manager, secure erase, or USB accessory error.
41.WX.YZ	Fuser, Laser scanner, or Paper path	Miscellaneous error including general and misprint or mismatch errors typically involving (but not limited to) the fuser, the laser scanner, or the paper path.
42.WX.YZ	Firmware	Firmware failure involving the Event Log, Shell, System Manager, or other component.
44.WX.YZ	Firmware	Firmware failure involving a digital sending component.
45.WX.YZ	OXPd/Web Kit (PageWide)	Informational notifications involving the OXPd Web Kit (communications log).
46.WX.YZ	Engine (LaserJet)	Engine communication error.
47.WX.YZ	Firmware	Job parser or printer calibration error.
48.WX.YZ	Firmware	PJA job accounting, job management, or job pipeline error.
49.WX.YZ	Firmware	Firmware communication error.
50.WX.YZ	Fuser (LaserJet)	Fuser error.
51.WX.YZ	Laser scanner (LaserJet)	Laser scanner beam error.
52.WX.YZ	Laser scanner (LaserJet)	Laser scanner startup error.
54.WX.YZ	Sensor	Sensor error (not jam related).
55.WX.YZ	DC controller (LaserJet)	DC controller communication error.
56.WX.YZ	Paper handling (LaserJet)	Paper input/output or accessory error.
57.WX.YZ	Fan	Fan error.
58.WX.YZ	Sensor	Engine sensor failure.
59.WX.YZ	Motor (LaserJet)	Motor error.
60.WX.YZ	Tray motor error (LaserJet)	Tray lifting or pick up error.
61.WX.YZ	Engine (PageWide)	Print engine error with the 8-bit data package.

Table 3-1 ERROR CODES: The first two characters (continued)

Error code	System Component	System Error Description
62.WX.YZ	System (LaserJet)	LaserJet internal system error.
	Print bar (PageWide)	PageWide print system error.
63.WX.YZ	Engine (LaserJet)	General engine error (electrical, communication, etc.).
65.WX.YZ	Connector	Output accessory connection error.
66.WX.YZ	Output accessory	Output accessory error.
67.WX.YZ	Input accessory	Input accessory connection error
69.WX.YZ	Duplexer	Duplexer error.
70.WX.YZ	DC controller (LaserJet)	DC controller firmware error.
76.WX.YZ	DC controller (LaserJet)	Power supply fluctuations causes formatter and DC controller communication issue and results them not to be in synchronization.
80.WX.YZ	Managed device	Embedded Jetdirect error.
81.WX.YZ	Near Field Communication (NFC)	Wireless, Bluetooth or internal EIO error.
82.WX.YZ	Memory (SSD, HDD, EMMC, etc.)	Disk hardware error.
90.WX.YZ	Internal diagnostics	Internal test of systems (i.e. disk, CPB, display) or interconnection error.
98.WX.YZ	SSD or HDD	SSD or Hard disk partition error.
99.WX.YZ	Firmware installer	Remote Firmware Upgrade (RFU), firmware install (engine or accessory), or disk error.

4 How to search for printer documentation

The CPMD, error codes, and other support documentation for each printer is available on the HP portals.

For HP internal access to WISE, go to [WISE](#).

For HP channel partners access WISE, see [Accessing WISE for HP channel partners \(HP Partner Portal\) on page 6](#) or [Accessing WISE for HP channel partners \(CSDP\)](#).

WISE is available to call agents, service technicians, and HP internal users. The level of detail available depends on your access credentials. To learn how to find support content in WISE, [watch the video here](#).

WISE - How to access and use

Learn how to access and use Web-based Interactive Search Engines (WISE) to locate available support information. WISE is a repository of technical support documentation including service manuals, user guides, videos, and general support information.

Accessing WISE

Learn how to access Web-based Interactive Search Engines (WISE) if you are an HP channel partner or an internal HP user.

Accessing WISE for HP channel partners (HP Partner Portal)


Learn how to access WISE by accessing the HP Partner Portal if you are an HP Channel Partner.

 **NOTE:** If this is your first visit to the HP Partner Portal, you will be asked to create an account. Follow the setup directions using your HP Partner credentials.

 [View a video of how to access WISE for HP channel partners](#)


1. Sign-in to the HP Partner Portal (click <https://partner.hp.com> to access the sign-in page).

Figure 4-1 HP Partner Portal sign-in page

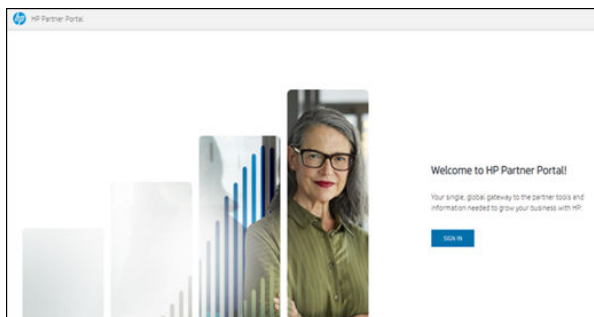


2. On the HP Partner Portal home page, click the **Services & Support** item.

Figure 4-2 HP Partner Portal home page

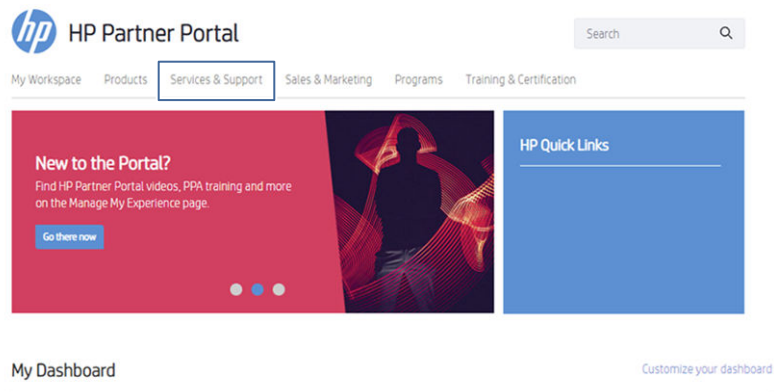


3. Select the **Technical Support (WISE)** item.

Figure 4-3 HP Partner Portal Service & Support page

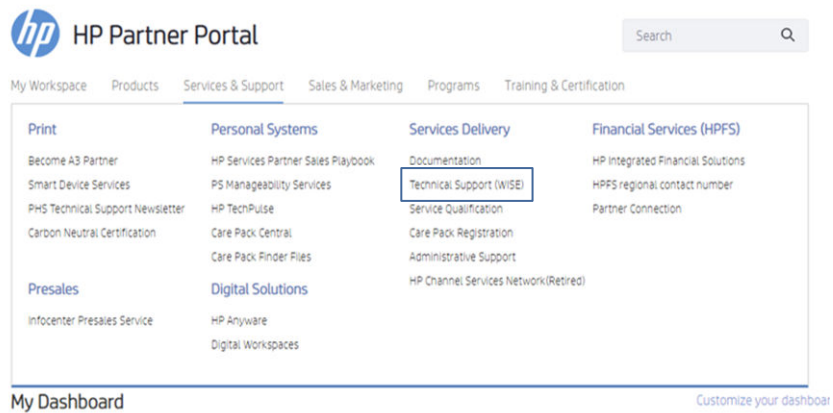


4. Select the **Technical Documentation** item.

Figure 4-4 HP Partner Portal Technical Support (WISE)page

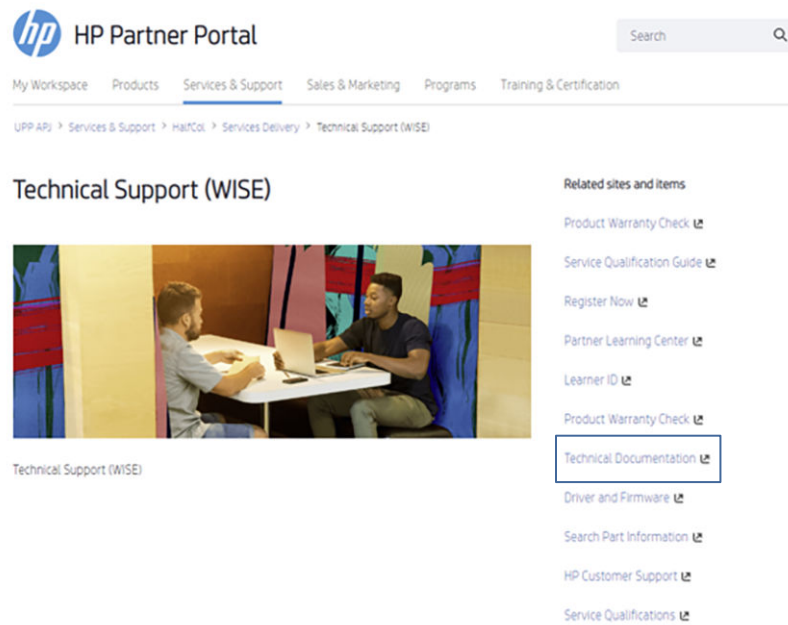

5. Use the WISE portal to search for printer information.

Figure 4-5 WISE portal home page

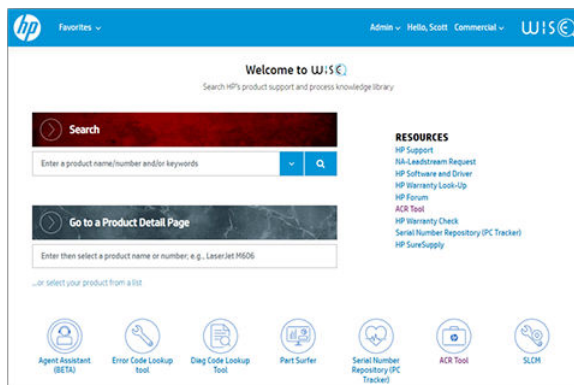

Accessing WISE for internal HP users

Learn how to access WISE if you are an internal HP user.

1. Open one of the Web-based Interactive Search Engines (WISE) URLs listed below.

Americas (AMS)

- [WISE - English](#)
- [WISE - Spanish](#)
- [WISE - Portuguese](#)
- [WISE - French](#)

Asia Pacific / Japan (APJ)


- [WISE - English](#)
- [WISE - Japanese](#)
- [WISE - Korean](#)
- [WISE - Chinese \(simplified\)](#)
- [WISE - Chinese \(traditional\)](#)
- [WISE - Thai](#)

Europe / Middle East / Africa (EMEA)


- [WISE - English](#)

2. Select **Commercial** from the drop-down menu.

Figure 4-6 Choose an experience

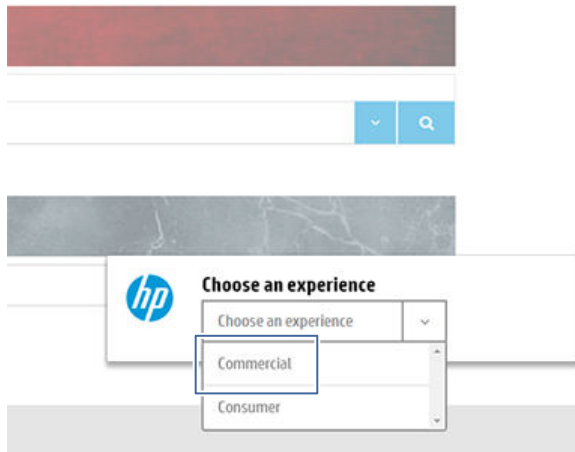

3. The WISE home page appears.

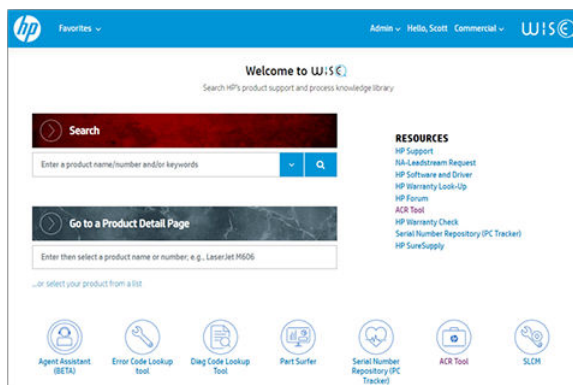

Play the video:



[View a video of how access WISE \(internal HP users\)](#)

Using WISE to search for error codes

Learn how to use WISE to look up error codes.



NOTE: The model used in the instructional videos is an example. The same steps apply to all printer models.

You will need the printer type (e.g. HP LaserJet), model number (e.g. M607), and bundle option (e.g. dn, dh, z).

Search for error codes using the lookup widget

Learn how to search for a specific error code using the WISE Error Code Lookup widget.

1. Enter a printer model number (for example, M606) in the **Go to a Product Detail page** dialog box.



TIP: To find a Product Detail Page (PDP) from a list of products by product type, select the **...or select your product from a list** item just below the dialog box.

2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.



NOTE: Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

3. Type the error code (for example, 13.E1.D3) in the **Error Code Lookup** field, and then select the search icon.

Error Code Lookup

Enter a specific error code in the field below, e.g. 13.b7 d7

1 2

Other Content

- Advisories (0)
- Bulletins (21)
- Guides, Manuals, etc. (76)
- Notices (1)
- Product Change Not... (0)
- Software-Drivers-F...
- Top Issues (7)
- Videos (127)

4. The error code troubleshooting content displays in the **All Search Results** area.

All Search Results

13.E1.D3 Fuser Area Jam
Last Modified Date: "2022/03/11"

Click on the article to see the full content.

Recommended action for customers

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size...

13.* errors
Last Modified Date: "2022/11/30"

Click on the article to see the full content.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open....

HP LaserJet Enterprise M607, M608, M608nk, M609, M610, M611, M612, HP LaserJet Managed E60055-E60075, E60155-E60175 printers - Control Panel Messages Document (CPMD)
Last Modified Date: "2022/11/22"

Play the video:



[View a video of how to search for error codes using the Product Detail Page \(PDP\) or the Error Code Lookup tool.](#)

Search for error codes from the WISE home page

Learn how to search for a specific error code from the WISE home page.

1. On the WISE home page, enter a printer model number (for example, M606) in the **Search** dialog box.

Search

Enter a product name/number and/or keywords

Go to a Product Detail Page


Enter then select a product name or number; e.g., LaserJet M606

...or select your product from a list


2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.




NOTE: Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

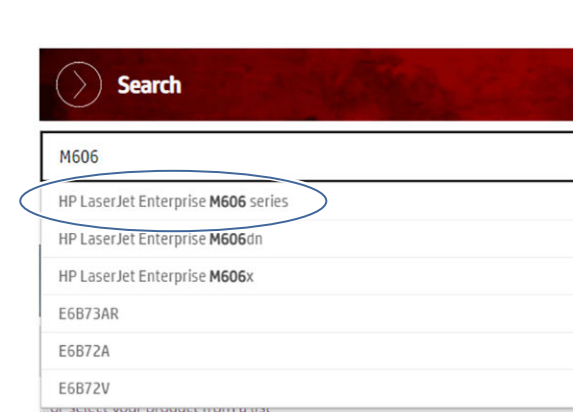

3. Type the error code (for example, 13.E1.D3) in the **Search** keyword field, and then select the search icon.

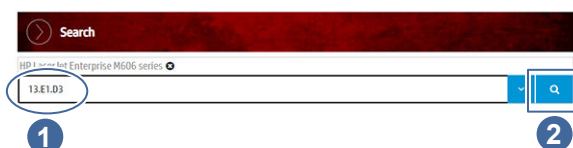

4. The error code troubleshooting content displays in the **All Search Results** area.

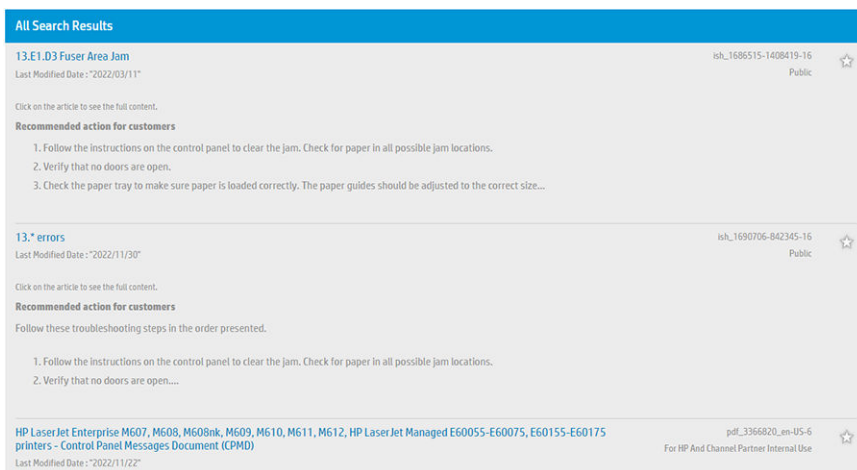

Using WISE to access repair and replace videos for FRUs

Learn how to use WISE to access repair and replace videos for FRUs.



NOTE: The model used in the instructional videos is an example. The same steps apply to all printer models.


You will need the printer type (e.g. HP LaserJet), model number (e.g. M607), and bundle option (e.g. dn, dh, z).

Search for videos using the Product Detail Page (PDP)

Learn how to search WISE for product specific information. Quickly review the steps and then play the video.


1. Enter a printer model number (for example, M606) in the **Go to a Product Detail page** dialog box.

 **TIP:** To find a Product Detail Page (PDP) from a list of products by product type, select the **...or select your product from a list** item just below the dialog box.

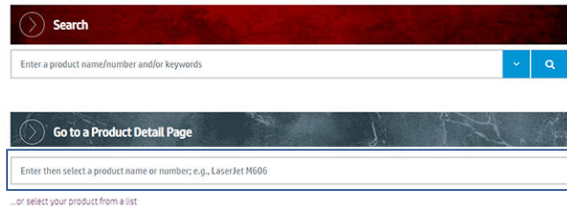


2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.

 **NOTE:** Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

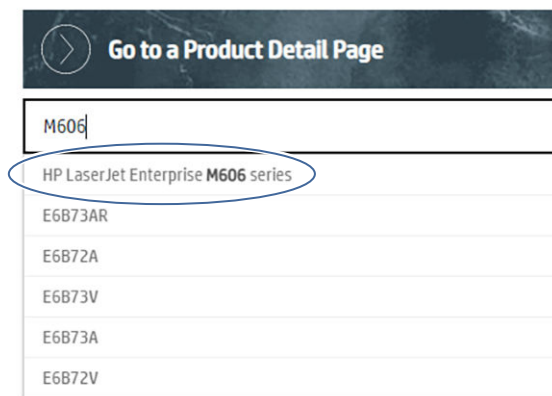


3. Select the link to **Videos** in the **Other Content** menu at the bottom-right of the screen.

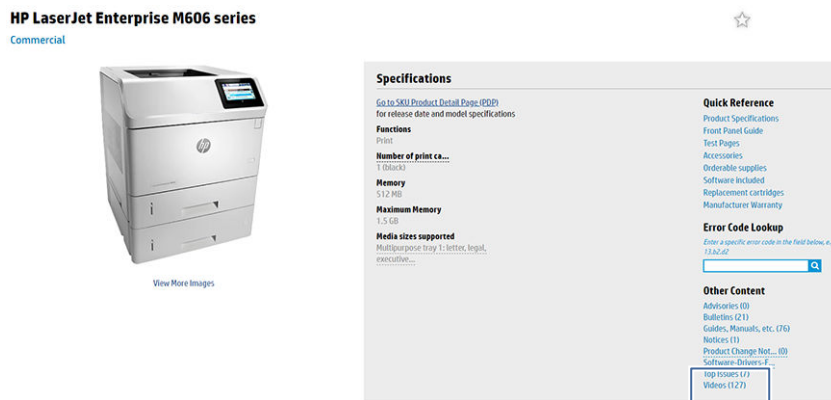

4. Select the desired video from the list of videos.



TIP: Select the **Add Or Remove Hardware & Customer Self Repair** filter under **Troubleshooting** to limit the search results to repair and replace videos.

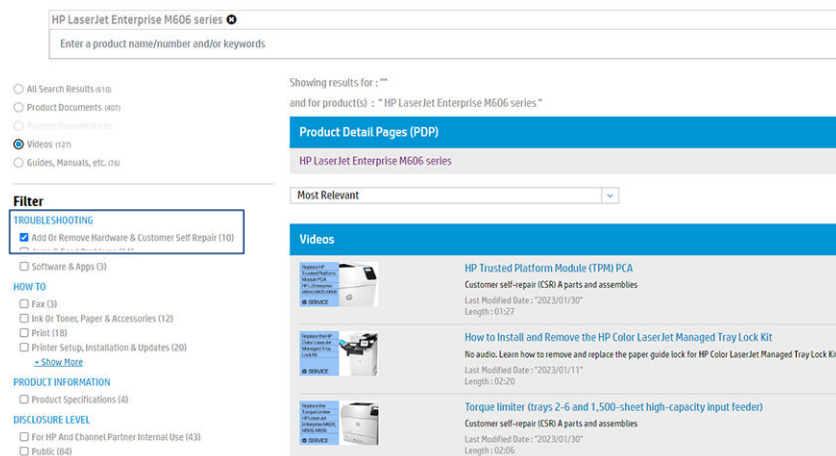

Play the video:




[View a video of how to search for the printer's Product Detail Page \(PDP\)](#)

Search for videos using the WISE search function


Learn how to search WISE using the model number. Quickly review the steps and then play the video.

1. On the WISE home page, enter a printer model number (for example, M606) in the **Search** dialog box.

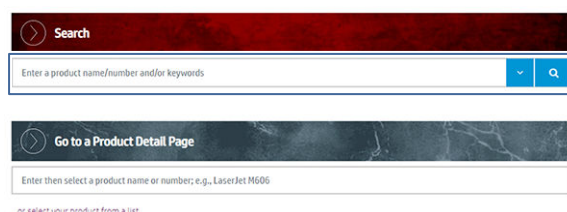


2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.


 **NOTE:** Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

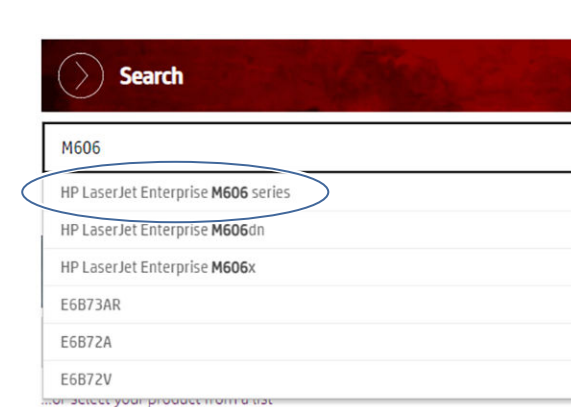

3. Select the search icon.

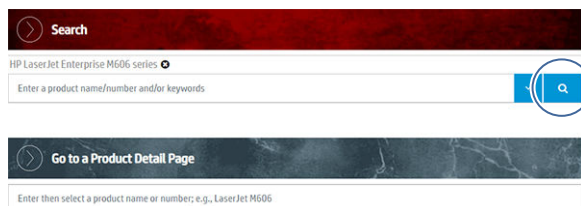

4. To refine the search results, select the radio button labeled **Videos** in the upper-right portion of the screen.

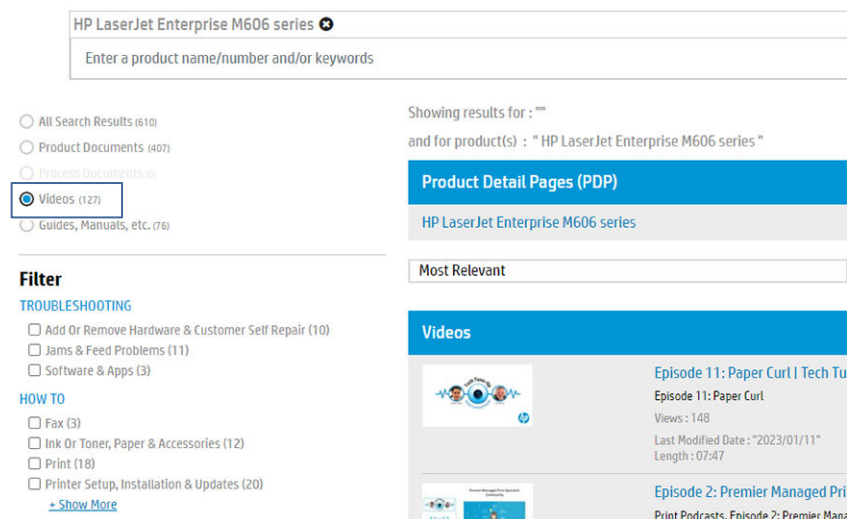

 **TIP:** To refine video search results, type a part name in the keyword search bar, and then select the search icon. For example, entering the word **fuser** to the keyword search bar returns videos related to repair and replacement of the fuser.

HP LaserJet Enterprise M606 series

Fuser

All Search Results (34)

Product Documents (28)

Process Documents (8)

Videos (2)

Guides, Manuals, etc. (4)

Filter

TROUBLESHOOTING

Add Or Remove Hardware & Customer Self Repair (1)

Jams & Feed Problems (1)

DISCLOSURE LEVEL

Public (2)

Showing results for : "fuser"

and for product(s) : "HP LaserJet Enterprise M606 series"

Product Detail Pages (PDP)

HP LaserJet Enterprise M606 series

Most Relevant

Videos

Fuser jams

HP LaserJet

HP Fuser Kit

Enterprise M606

Series L6060

HOW TO

Clear paper jams in the fuser area

Clear paper jams

Last Modified Date : "2022/08/03"

Length : 01:51

Replace the Fuser

HP LaserJet Enterprise M606

Series M606

HOW TO

No audio. Customer self-repair (CSR) A parts and assemblies.

Last Modified Date : "2022/08/03"

Length : 01:54

Play the video:



[View a video of how to perform a model number search](#)

5 Printer service information

The following information provides the document's last updated date and the printer service PIN.

Last update: April 15, 2025

Service mode PIN number:

M454, M479: Not Applicable



NOTE: When possible, always update the printer firmware to the latest available version at [HP.com](https://www.hp.com) as part of the troubleshooting performed for any of the following errors.

6 Numerical control panel messages

Use the following numerical error message troubleshooting to resolve your issue.

10.WX.YZ error messages

10.00.00, 10.01.00, 10.02.00, 10.03.00 Supply problem or Supply memory error

The printer is unable to read the toner cartridge data. The toner cartridge is present but defective.

If multiple supplies have this error, a 10.0X.00 error for the first supply detected with the error displays. After the user resolves the error that corresponds to the first supply, another 10.0X.00 error displays for the next supply. This continues for all supply memory errors.

- **10.00.00** Black toner cartridge
- **10.01.00** Cyan toner cartridge
- **10.02.00** Magenta toner cartridge
- **10.03.00** Yellow toner cartridge

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the front door and remove the toner cartridge causing the error.
2. Reinstall the toner cartridge.
3. Close the front door. If the message reappears, turn the printer off, and then on.
4. Verify if the cartridge is a genuine HP toner cartridge. To check the authenticity of your cartridges, go to hp.com/go/anticounterfeit and enter the serial number from the security label.



NOTE: This printer uses cartridges that have security chips or electronic circuitry. Cartridges using a non-HP chip or modified or non-HP circuitry may not work, and those that work today may not work in the future.

Non-HP Chips and modified or non-HP electronic circuitry are not produced or validated by HP. HP cannot guarantee that these chips or circuitry will work in your printer now or in the future. If you are using a non-original HP cartridge, please check with your supplier to ensure your cartridge has an original HP security chip or unmodified HP electronic circuitry.

5. If the error persists, and it is a genuine HP toner cartridge, contact HP customer care by phone for assistance in resolving the issue at: www.hp.com/go/contactHP.

6. If it is an aftermarket (non-hp) or re-manufactured toner cartridge, return the defective toner cartridge to the vendor where purchased.



NOTE: Service or repairs that are required as a result of using unsupported supplies is not covered under HP warranty.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the front door and remove the suspected toner cartridge.
2. Check the supplies memory chip. If it is damaged, replace the toner cartridge.
3. Reinstall the toner cartridge.
4. Close the front door.
5. If the message displays again, turn the printer off, then on again.
6. Verify if the cartridge is a genuine HP toner cartridge. To check the authenticity of your cartridges, go to hp.com/go/antcounterfeit or visit hp.com/go/ok and enter the serial number from the security label.
7. If it is an aftermarket (non-hp) or re-manufactured toner cartridge, return the defective toner cartridge to the vendor where purchased.



NOTE: Service or repairs that are required as a result of using unsupported supplies is not covered under HP warranty.

8. If the error persists, and it is a genuine HP toner cartridge, replace the toner cartridge.
9. If the error persists with a new toner cartridge, elevate the case using your Standard Support Process.

10 . 0x . 0z Supply problem or Supply memory error

The printer is unable to authenticate the toner cartridge. The toner cartridge is detected but cannot be authenticated.

When this error occurs, a question mark appears on the gas gauge of the supply or supplies with the error.

10.0x.0z

x = Toner cartridge color.

- 0 - Black toner cartridge
- 1 - Cyan toner cartridge
- 2 - Magenta toner cartridge
- 3 - Yellow toner cartridge

z = error and can be any number from 1-3 or 5-8.

Examples:

- **10.00.01, 10.00.02, 10.00.05** Black toner cartridge
- **10.01.02, 10.01.03, 10.01.07** Cyan toner cartridge
- **10.02.02, 10.02.05, 10.02.06** Magenta toner cartridge
- **10.03.03, 10.03.05, 10.03.08** Yellow toner cartridge

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the front door and remove the toner cartridge causing the error.
2. Reinstall the toner cartridge.
3. Close the front door. If the message reappears, turn the printer off, and then on.
4. Verify if the cartridge is a genuine HP toner cartridge. To check the authenticity of your cartridges, go to hp.com/go/antcounterfeit and enter the serial number from the security label.



NOTE: This printer uses cartridges that have security chips or electronic circuitry. Cartridges using a non-HP chip or modified or non-HP circuitry may not work, and those that work today may not work in the future.

Non-HP Chips and modified or non-HP electronic circuitry are not produced or validated by HP. HP cannot guarantee that these chips or circuitry will work in your printer now or in the future. If you are using a non-original HP cartridge, please check with your supplier to ensure your cartridge has an original HP security chip or unmodified HP electronic circuitry.

5. If the error persists, and it is a genuine HP toner cartridge, contact HP customer care by phone for assistance in resolving the issue at: www.hp.com/go/contactHP.
6. If it is an aftermarket (non-hp) or re-manufactured toner cartridge, return the defective toner cartridge to the vendor where purchased.



NOTE: Service or repairs that are required as a result of using unsupported supplies is not covered under HP warranty.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the front door and remove the suspected toner cartridge.
2. Check the supplies memory chip. If it is damaged, replace the toner cartridge.
3. Reinstall the toner cartridge.
4. Close the front door.
5. If the message displays again, turn the printer off, then on again.
6. Verify if the cartridge is a genuine HP toner cartridge. To check the authenticity of your cartridges, go to hp.com/go/antcounterfeit or visit hp.com/go/ok and enter the serial number from the security label.

7. If it is an aftermarket (non-hp) or re-manufactured toner cartridge, return the defective toner cartridge to the vendor where purchased.



NOTE: Service or repairs that are required as a result of using unsupported supplies is not covered under HP warranty.

8. If the error persists, and it is a genuine HP toner cartridge, replace the toner cartridge.
9. If the error persists with a new toner cartridge, elevate the case using your Standard Support Process.

10.00.10, 10.01.10, 10.02.10, 10.03.10 Supply memory error

The printer is unable to read the toner cartridge data. The toner cartridge is present but defective.

When this error occurs, a question mark appears on the gas gauge of the supply or supplies with the error.

If multiple supplies have this error, a 10.OX.10 error for the first supply detected with the error displays. After the user resolves the error that corresponds to the first supply, another 10.OX.Y0 error displays for the next supply. This continues for all supplies memory errors.

- **10.00.10** Black toner cartridge
- **10.01.10** Cyan toner cartridge
- **10.02.10** Magenta toner cartridge
- **10.03.10** Yellow toner cartridge

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the front door and remove the toner cartridge causing the error.
2. Reinstall the toner cartridge.
3. Close the front door. If the message reappears, turn the printer off, and then on.
4. Verify if the cartridge is a genuine HP toner cartridge. To check the authenticity of your cartridges, go to hp.com/go/antcounterfeit and enter the serial number from the security label.



NOTE: This printer uses cartridges that have security chips or electronic circuitry. Cartridges using a non-HP chip or modified or non-HP circuitry may not work, and those that work today may not work in the future.

Non-HP Chips and modified or non-HP electronic circuitry are not produced or validated by HP. HP cannot guarantee that these chips or circuitry will work in your printer now or in the future. If you are using a non-original HP cartridge, please check with your supplier to ensure your cartridge has an original HP security chip or unmodified HP electronic circuitry.

5. If the error persists, and it is a genuine HP toner cartridge, contact HP customer care by phone for assistance in resolving the issue at: www.hp.com/go/contactHP.

6. If it is an aftermarket (non-hp) or re-manufactured toner cartridge, return the defective toner cartridge to the vendor where purchased.



NOTE: Service or repairs that are required as a result of using unsupported supplies is not covered under HP warranty.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the front door and remove the suspected toner cartridge.
2. Check the supplies memory chip. If it is damaged, replace the toner cartridge.
3. Reinstall the toner cartridge.
4. Close the front door.
5. If the message displays again, turn the printer off, then on again.
6. Verify if the cartridge is a genuine HP toner cartridge. To check the authenticity of your cartridges, go to hp.com/go/anticoncounterfeit or visit hp.com/go/ok and enter the serial number from the security label.
7. If it is an aftermarket (non-hp) or re-manufactured toner cartridge, return the defective toner cartridge to the vendor where purchased.



NOTE: Service or repairs that are required as a result of using unsupported supplies is not covered under HP warranty.

8. If the error persists, and it is a genuine HP toner cartridge, replace the toner cartridge.
9. If the error persists with a new toner cartridge, elevate the case using your Standard Support Process.

10.0x.10 or 10.0x.11 or 10.0x.12

Toner cartridge supply memory error.

When this error occurs, a question mark appears on the gas gauge of the supply or supplies with the error.

- 10.00.10 or 10.00.11 or 10.00.12 Black toner cartridge
- 10.01.10 or 10.01.11 or 10.01.12 Cyan toner cartridge
- 10.02.10 or 10.02.11 or 10.02.12 Magenta toner cartridge
- 10.03.10 or 10.03.11 or 10.03.12 Yellow toner cartridge



IMPORTANT: The cause of this issue can be related to a firmware defect.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the front door and remove the toner cartridge causing the error.

2. Reinstall the toner cartridge.
3. Close the front door. If the message reappears, turn the printer off, and then on.
4. Verify if the cartridge is a genuine HP toner cartridge. To check the authenticity of your cartridges, go to hp.com/go/antcounterfeit and enter the serial number from the security label.

 **NOTE:** This printer uses cartridges that have security chips or electronic circuitry. Cartridges using a non-HP chip or modified or non-HP circuitry may not work, and those that work today may not work in the future.

Non-HP Chips and modified or non-HP electronic circuitry are not produced or validated by HP. HP cannot guarantee that these chips or circuitry will work in your printer now or in the future. If you are using a non-original HP cartridge, please check with your supplier to ensure your cartridge has an original HP security chip or unmodified HP electronic circuitry.

5. If the error persists, and it is a genuine HP toner cartridge, contact HP customer care by phone for assistance in resolving the issue at: www.hp.com/go/contactHP.
6. If it is an aftermarket (non-hp) or re-manufactured toner cartridge, return the defective toner cartridge to the vendor where purchased.

 **NOTE:** Service or repairs that are required as a result of using unsupported supplies is not covered under HP warranty.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

 **NOTE:** Do Not replace the engine control unit (ECU) or formatter for this issue. If the error persists after following the steps below, obtain the information requested in step 7, and then escalate the case to ATS.

1. Ensure the printer is turned on, and then open the front door to remove the toner cartridge that is in the error state.

 **NOTE:** Toner cartridges that display a "10.0x11" or "**Supply Memory Error**" will continue to have this error if used in different printers.

Dispose or recycle the defective toner cartridge as these toner cartridges cannot be used in any printer.

2. Reinstall the toner cartridge.
3. Close the front door. If the message reappears, turn the printer off, and then on.
4. Verify if the cartridge is a genuine HP toner cartridge. To check the authenticity of the cartridges, go to hp.com/go/antcounterfeit or visit hp.com/go/ok and enter the serial number from the security label.

If authenticity cannot be verified, it might be a refilled or re-manufactured HP cartridge. Tell the customer to return the toner cartridge to the retailer or vendor where it was purchased and read the following statement:

 **NOTE:** "This printer is enabled with dynamic security. It is intended to be used only with cartridges with an original HP chip. Cartridges using a non-HP chip might not work, and those that work today may not work in the future."

"Refilled or remanufactured supplies that still use an Original HP chip will continue to be accepted by the printer. If you are using a refilled or remanufactured cartridge and wish to continue to do so, then you should check with your toner cartridge supplier as to whether or not the cartridge has an Original HP chip."

 **NOTE:** Service or repairs that are required as a result of using unsupported supplies is not covered under HP warranty.

5. If it is a genuine HP toner cartridge, replace the toner cartridge(s) in the error state with a new cartridge, and then close the cartridge door. Use the provided list to order the correct part number for the designated country/region when replacing the cartridge.

 **NOTE:** Do not replace all the four toner cartridges. Make sure to replace only the affected toner cartridge.

Table 6-1 Toner cartridge part details

Part Number	Description	Region
W2020A	HP 414A Black LaserJet Toner Cartridge	ROW
W2021A	HP 414A Cyan LaserJet Toner Cartridge	ROW
W2022A	HP 414A Yellow LaserJet Toner Cartridge	ROW
W2023A	HP 414A Magenta LaserJet Toner Cartridge	ROW
W2020X	HP 414X Black LaserJet Toner Cartridge	ROW
W2021X	HP 414X Cyan LaserJet Toner Cartridge	ROW
W2022X	HP 414X Yellow LaserJet Toner Cartridge	ROW
W2023X	HP 414X Magenta LaserJet Toner Cartridge	ROW
W2030A	HP 415A Black LaserJet Toner Cartridge	EMEA
W2031A	HP 415A Cyan LaserJet Toner Cartridge	EMEA
W2032A	HP 415A Yellow LaserJet Toner Cartridge	EMEA
W2033A	HP 415A Magenta LaserJet Toner Cartridge	EMEA
W2030X	HP 415X Black LaserJet Toner Cartridge	EMEA
W2031X	HP 415X Cyan LaserJet Toner Cartridge	EMEA
W2032X	HP 415X Yellow LaserJet Toner Cartridge	EMEA
W2033X	HP 415X Magenta LaserJet Toner Cartridge	EMEA

Table 6-1 Toner cartridge part details (continued)

Part Number	Description	Region
W2040A	HP 416A Black LaserJet Toner Cartridge	APJ
W2041A	HP 416A Cyan LaserJet Toner Cartridge	APJ
W2042A	HP 416A Yellow LaserJet Toner Cartridge	APJ
W2043A	HP 416A Magenta LaserJet Toner Cartridge	APJ
W2040X	HP 416X Black LaserJet Toner Cartridge	APJ
W2041X	HP 416X Cyan LaserJet Toner Cartridge	APJ
W2042X	HP 416X Yellow LaserJet Toner Cartridge	APJ
W2043X	HP 416X Magenta LaserJet Toner Cartridge	APJ

6. Download the following firmware version for your printer model from [HP Support](#): 002.2118A
7. Wait for the firmware update to complete, and then print a Configuration Page.
8. On the Configuration Page, make sure that the firmware version installed is **002.2118A**.
9. Attempt to print and check if the issue persists.
10. If the issue persists, collect the following information and note it in a CDAX case:
 - a. Type "Supply memory error:10.0x.11" in the case subject.
 - b. Enter the error code and message displayed on the printer control panel.
 - c. Obtain pictures of the cartridge and with the electrical contact. Attach the pictures in the CDAX case.
 - d. Check for defect on the electrical contact of the toner and printer.
 - e. Check whether the toner used is an HP genuine toner.
 - f. Ask the customer to provide answers to the following questions:
 - i. When did the issue begin/start, OOB? While printing or when idle?
 - ii. Was there any preceding error or defect prior to this issue?
 - iii. Were there any parts replaced or software updates prior to this error?
 - iv. Was the cartridge used in multiple printers?
 - v. Did this issue happen on set-up cartridge or after market cartridge (trade)?
11. Ensure the information in the CDAX case is valid, and then elevate the case to elevate the case using your Standard Support Process.

10.00.30, 10.01.30, 10.02.30 or 10.03.30 Unauthorized <Color> supply

A used or non-HP toner cartridge has been detected while Cartridge Policy is set to Authorized HP.

Unauthorized Cartridge (Admin configures printer to only accept HP cartridges).

- **10.00.30** Black toner cartridge
- **10.01.30** Cyan toner cartridge
- **10.02.30** Magenta toner cartridge
- **10.03.30** Yellow toner cartridge

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Install a genuine HP toner cartridge in the corresponding slot.
2. If a genuine HP toner cartridge is installed, validate the authenticity of your cartridges, go to hp.com/go/anticounterfeit or visit hp.com/go/ok and enter the serial number from the security label.
3. If the error persists, and it is a genuine HP toner cartridge, contact HP customer care by phone for assistance in resolving the issue. Use the following link to contact the correct support center by region.

Recommended action onsite technician

Follow these troubleshooting steps in the order presented.

1. If the user is the administrator and no longer wants the setting to be configured, change the **Cartridge Policy** to **Off** or replace the cartridge to continue printing.
2. Install a genuine HP toner cartridge in the corresponding slot.
3. If a genuine HP toner cartridge is installed, validate the authenticity of your cartridges, go to hp.com/go/anticounterfeit or visit hp.com/go/ok and enter the serial number from the security label.
4. If the error persists, and it is a genuine HP toner cartridge, replace the toner cartridge.



NOTE: Do not replace all the four toner cartridges. Make sure to replace only the affected toner cartridge.



IMPORTANT: See the AGENT troubleshooting steps for part numbers:

Ensure you select the correct model and toner cartridge from the below tables.

5. If the error persists with a new toner cartridge, elevate the case using your Standard Support Process.

10.00.31, 10.01.31, 10.02.31, 10.03.31 Starting to print with non-HP cartridges

More than one non-HP cartridge is in use.

The 10.0x.31 is an Event Log only code.

The printer will display the message [Starting to print with used or counterfeit supplies](#).

- **10.00.31** Black toner cartridge
- **10.01.31** Cyan toner cartridge
- **10.02.31** Magenta toner cartridge
- **10.03.31** Yellow toner cartridge

Recommended action

Follow these troubleshooting steps in the order presented.

1. No action necessary.
2. If the customer believes they purchased a new genuine HP supply, go to hp.com/go/anticounterfeit or visit hp.com/go/ok and enter the serial number from the security label.



NOTE: Service or repairs that are required as a result of using unsupported supplies is not covered under HP warranty.

10.0x.35, 10.wx.43 Incompatible <supply>

The printer displays this message when the indicated supply is not compatible with this printer.

The 10.0x.35 and 10.wx.43 are an event log only message, it will not show on the control panel. The only message to display will be **Incompatible <supply>**.

- **10.00.35, 10.00.43, 10.10.43, 10.20.43** Black toner cartridge (event code)
- **10.01.35, 10.01.43, 10.11.43, 10.21.43** Cyan toner cartridge (event code)
- **10.02.35, 10.02.43, 10.12.43, 10.22.43** Magenta toner cartridge (event code)
- **10.03.35, 10.03.43, 10.13.43, 10.23.43** Yellow toner cartridge (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

- Install a supply that is designed for this printer.

10.00.40, 10.01.40, 10.02.40, 10.03.40 No longer printing with non-HP supplies

Printer is no longer printing with non-HP supplies.

The printer displays this message when genuine HP supplies are in use.

The 10.0x.40 is an event log only message, it will not show on the control panel.

Recommended action

There is no action needed for this message.

- No action necessary.

10.00.57, 10.01.57, 10.02.57, 10.03.57 Protected <Color> supply installed

A protected toner cartridge is installed.

The printer indicates when the supplies in use are protected for anti-theft.

- **10.00.57** Black toner cartridge
- **10.01.57** Cyan toner cartridge
- **10.02.57** Magenta toner cartridge
- **10.03.57** Yellow toner cartridge

Recommended action

There is no action needed for this message.

- No action necessary.

10.00.70, 10.01.70, 10.02.70, 10.03.70 Printing past very low <Color> supply

The printer indicates when one of the supplies is printing past very low. The actual remaining supply life might vary.

The 10.0x.70 is an event log only message, it will not show on the control panel. The only message to display will be a warning message **<Supply> very low**.

- **10.00.70** Black toner cartridge (event code)
- **10.01.70** Cyan toner cartridge (event code)
- **10.02.70** Magenta toner cartridge (event code)
- **10.03.70** Yellow toner cartridge (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

- If the print quality is no longer acceptable, the customer must order and pay for a new toner cartridge.

 **NOTE:** After an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer is responsible for replacing the supply.

 **NOTE:** Advise the customer that HP recommends that they have replacement supplies available to install when the print quality is no longer acceptable.

10.00.71 Starting to print in black only

Cartridge Very Low - Printing Black

The printer indicates when it is printing in black only and the toner is very low for the black toner cartridge.

Recommended action

Follow these troubleshooting steps in the order presented.

- If the print quality is no longer acceptable, replace the toner cartridge.



NOTE: HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

Table 6-2 Toner Cartridges

Item	Description	Part number (service)	Product number (new)
Toner cartridge	HP 414A Black Original LaserJet Toner Cartridge	W2020-67901	W2020A
Toner cartridge	HP 414X High Yield Black Original LaserJet Toner Cartridge	W2020-67902	W2020X
Toner cartridge	HP 414X High Yield (Contract) Black Original LaserJet Toner Cartridge	W2020-67903	W2020XC
Toner cartridge	HP 414A Cyan Original LaserJet Toner Cartridge	W2021-67901	W2021A
Toner cartridge	HP 414X High Yield Cyan Original LaserJet Toner Cartridge	W2021-67902	W2021X
Toner cartridge	HP 414X High Yield (Contract) Cyan Original LaserJet Toner Cartridge	W2021-67903	W2021XC
Toner cartridge	HP 414A Yellow Original LaserJet Toner Cartridge	W2022-67901	W2022A
Toner cartridge	HP 414X High Yield Yellow Original LaserJet Toner Cartridge	W2022-67902	W2022X
Toner cartridge	HP 414X High Yield (Contract) Yellow Original LaserJet Toner Cartridge	W2022-67903	W2022XC
Toner cartridge	HP 414A Magenta Original LaserJet Toner Cartridge	W2023-67901	W2023A
Toner cartridge	HP 414X High Yield Magenta Original LaserJet Toner Cartridge	W2023-67902	W2023X
Toner cartridge	HP 414X High Yield (Contract) Magenta Original LaserJet Toner Cartridge	W2023-67903	W2023XC
Toner cartridge	HP 415A Black Original LaserJet Toner Cartridge	W2030-67901	W2030A
Toner cartridge	HP 415X High Yield Black Original LaserJet Toner Cartridge	W2030-67902	W2030X
Toner cartridge	HP 415X High Yield (Contract) Black Original LaserJet Toner Cartridge	W2030-67903	W2030XC

Table 6-2 Toner Cartridges (continued)

Item	Description	Part number (service)	Product number (new)
Toner cartridge	HP 415A Cyan Original LaserJet Toner Cartridge	W2031-67901	W2031A
Toner cartridge	HP 415X High Yield Cyan Original LaserJet Toner Cartridge	W2031-67902	W2031X
Toner cartridge	HP 415X High Yield (Contract) Cyan Original LaserJet Toner Cartridge	W2031-67903	W2031XC
Toner cartridge	HP 415A Yellow Original LaserJet Toner Cartridge	W2032-67901	W2032A
Toner cartridge	HP 415X High Yield Yellow Original LaserJet Toner Cartridge	W2032-67902	W2032X
Toner cartridge	HP 415X High Yield (Contract) Yellow Original LaserJet Toner Cartridge	W2032-67903	W2032XC
Toner cartridge	HP 415A Magenta Original LaserJet Toner Cartridge	W2033-67901	W2033A
Toner cartridge	HP 415X High Yield Magenta Original LaserJet Toner Cartridge	W2033-67902	W2033X
Toner cartridge	HP 415X High Yield (Contract) Magenta Original LaserJet Toner Cartridge	W2033-67903	W2033XC
Toner cartridge	HP 416A Black Original LaserJet Toner Cartridge	W2040-67901	W2040A
Toner cartridge	HP 416X High Yield Black Original LaserJet Toner Cartridge	W2040-67902	W2040X
Toner cartridge	HP 416X High Yield (Contract) Black Original LaserJet Toner Cartridge	W2040-67903	W2040XC
Toner cartridge	HP 416A Cyan Original LaserJet Toner Cartridge	W2041-67901	W2041A
Toner cartridge	HP 416X High Yield Cyan Original LaserJet Toner Cartridge	W2041-67902	W2041X
Toner cartridge	HP 416X High Yield (Contract) Cyan Original LaserJet Toner Cartridge	W2041-67903	W2041XC
Toner cartridge	HP 416A Yellow Original LaserJet Toner Cartridge	W2042-67901	W2042A
Toner cartridge	HP 416X High Yield Yellow Original LaserJet Toner Cartridge	W2042-67902	W2042X
Toner cartridge	HP 416X High Yield (Contract) Yellow Original LaserJet Toner Cartridge	W2042-67903	W2042XC

Table 6-2 Toner Cartridges (continued)

Item	Description	Part number (service)	Product number (new)
Toner cartridge	HP 416A Magenta Original LaserJet Toner Cartridge	W2043-67901	W2043A
Toner cartridge	HP 416X High Yield Magenta Original LaserJet Toner Cartridge	W2043-67902	W2043X
Toner cartridge	HP 416X High Yield (Contract) Magenta Original LaserJet Toner Cartridge	W2043-67903	W2043XC

10.00.81 No longer printing in black only

Black only printing has ended.

The printer lets the end user know when the printer is no longer printing in black only mode.

the 10.00.81 is an event log only message and will not appear. The control panel will display **No longer printing in black only**.

Recommended action

There is no action needed for this message.

- No action necessary.

10.20.43, 10.21.43, 10.22.43, 10.23.43 Incompatible Cartridge

The printer displays this message when the indicated supply is not compatible with this printer.

An error message "**Incompatible Cartridge. Event Code 10.2x.43**" displays on a control panel of an HP Color LaserJet Pro after replacing a regionalized toner cartridge.

The "X" variable indicates the color of the toner cartridge. Depending on the toner cartridge color, one of the following error codes will display in the Event Log:

- **10.20.43** = Black (K) cartridge error
- **10.21.43** = Cyan cartridge error
- **10.22.43** = Magenta cartridge error
- **10.23.43** = Yellow cartridge error

This issue occurs when the replacement toner cartridge part number does not match the original region toner cartridge (designed for use only in a specific region) part number that was installed when the printer was set up out of the box.

HP manufactures toner cartridges specific to three worldwide regions (AMS, APJ, EMEA). The toner cartridge designed for each region has a different part number. The cartridge region set on the printer depends on the region the toner cartridge was installed in the printer at the first initial power up of the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the cartridge door and remove the toner cartridge causing the error.
2. Verify that the toner cartridge being used is the correct region for the printer.
3. Install a toner cartridge for the specific region.
4. If the error persists, and it is a genuine HP toner cartridge for the specified region, contact your HP-authorized service or support provider or contact HP customer support for assistance in resolving the issue.

<http://www.hp.com/go/contactHP>

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Make sure that the message displayed on the printer's control panel includes " Event Code 10.20.43" in the error message.
2. Check if the region part number is the same for the existing toner cartridge and the replaced toner cartridge.



NOTE: Toner cartridges for each region will have a unique cartridge part number.

3. Depending if the part number for the existing and replaced toner cartridges is same or different, perform the following task:
 - If the toner cartridge part number is different or an incorrect toner cartridge is purchased for a specific region, inform the customer about the toner cartridge options for the AMS, APJ, and EMEA regions, and see the next step to resolve the issue.
 - If the existing and replaced toner cartridge part number is the same, and the error message displays on the printer control panel, elevate the case to the ATS team or the next level of technical support.
4. Use one of the following options to resolve the toner cartridge issue:
 - **Option one:** Obtain a regionalized toner cartridge Obtain a toner cartridge part number that has the same region part number as the cartridge that was working in the printer.
 - **Option two:** Modify the "Printer Supply Region Reset" setting to re-regionalize the printer You can modify the Printer Supply Region Reset setting option on the printer control panel or the Embedded Web Server (EWS).

See: [Methods to modify the "Printer Supply Region Reset" setting to re-regionalize the printer on page 32](#)



NOTE: The model numbers listed in the example images might differ from the printer in use but the steps are the same.

Methods to modify the "Printer Supply Region Reset" setting to re-regionalize the printer

Use one of the following methods to modify the [Printer Supply Region Reset](#) setting option.

- [Method one: Use the printer control panel to modify the "Printer Supply Region Reset" setting on page 33](#)
- [Method two: Use the EWS to modify the "Printer Supply Region Reset" setting on page 36](#)

Method one: Use the printer control panel to modify the "Printer Supply Region Reset" setting

Depending on a touchscreen or LCD (2-line LCD) display printer control panel, follow these steps to resolve the issue.

1. From the Home screen, select the **Setup** menu.
 - **Touchscreen display:** From the Home screen, touch the Settings  icon, and then select the **Setup** menu.
 - **LCD display:** From the Home screen, press the **OK** button to go to the **Main Menu**, and then select the **Setup** menu.

Figure 6-1 LCD display: Setup menu



2. Select the **Printer Maintenance** menu.

Figure 6-2 Touchscreen display: Printer Maintenance menu

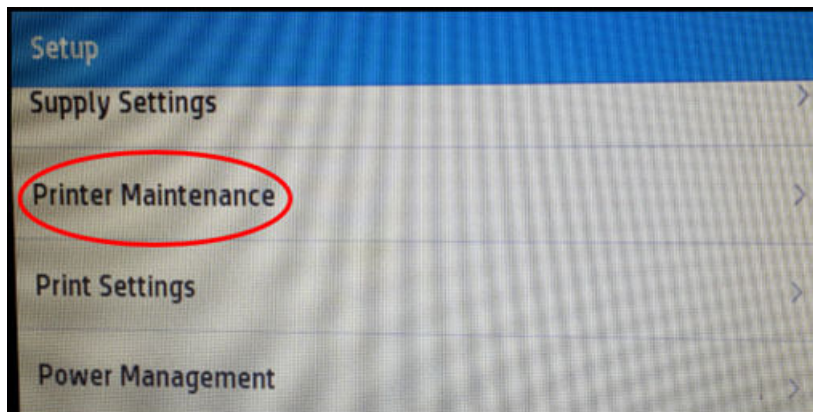


Figure 6-3 LCD display: Printer Maintenance menu



3. Select the **Restore** menu.

Figure 6-4 Touchscreen display: Restore menu

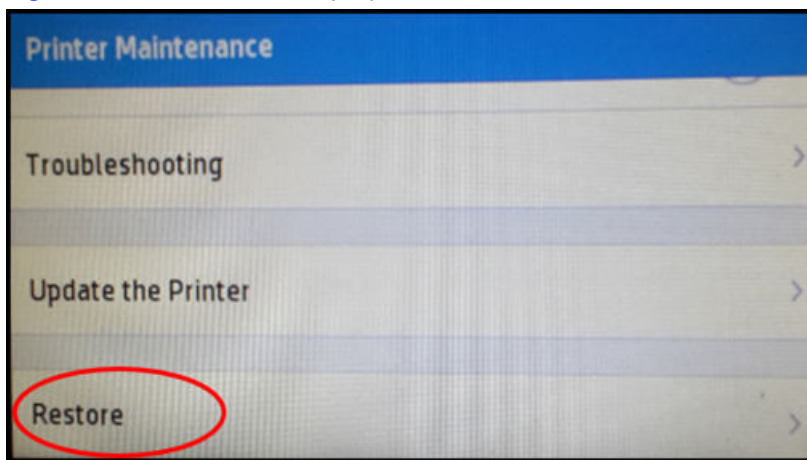


Figure 6-5 LCD display: Restore menu



4. On the [Restore](#) menu, select the [Printer Supply Region Reset](#) option.

Figure 6-6 Touchscreen display: Printer Supply Region Reset option


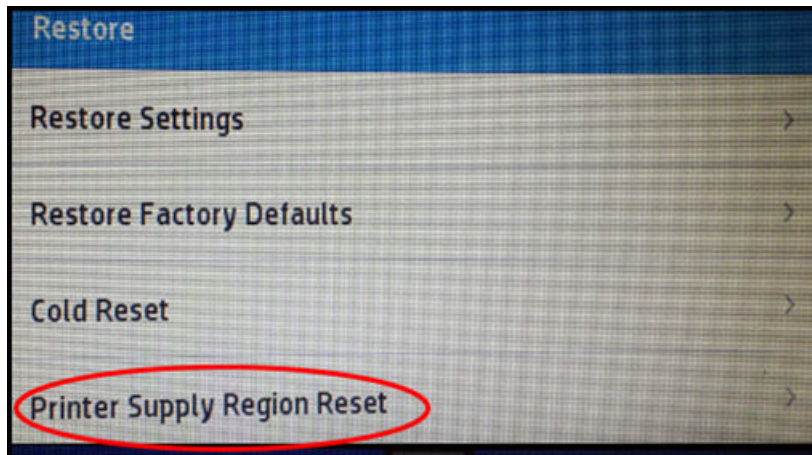


Figure 6-7 LCD display: Printer Supply Region Reset option

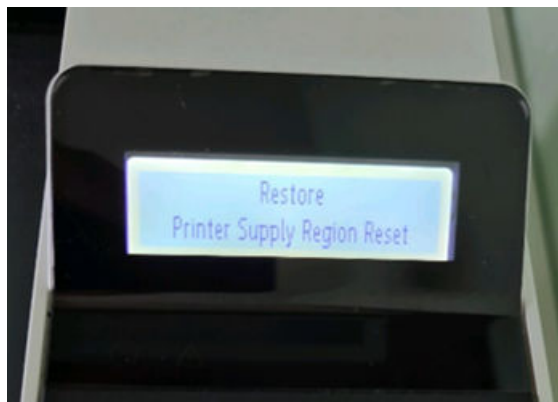

5. Select the [OK](#) button to reset the printer supply region for the new toner cartridge.

⚠ WARNING! Do not attempt to modify the "[Printer Supply Region Reset](#)" more than twice, the printer region setting will be locked and set to the last cartridge region.

Figure 6-8 Touchscreen display: Message confirming to reset the printer supply region

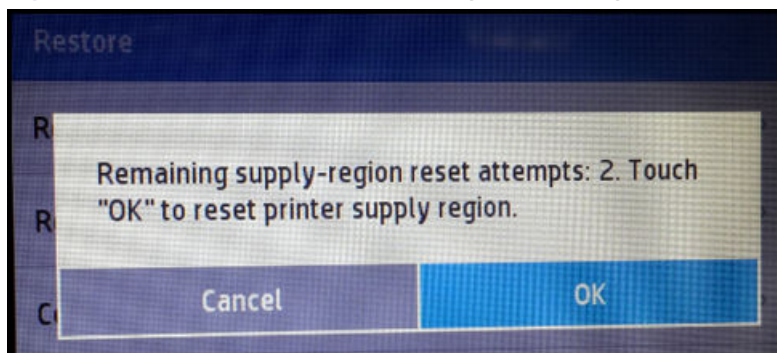


Figure 6-9 LCD display: Message confirming to reset the printer supply region




Method two: Use the EWS to modify the "Printer Supply Region Reset" setting

Follow these steps to open the Embedded Web Server (EWS) and modify the Printer Supply Region Reset" setting option.


1. Open the HP Embedded Web Server (EWS).
 - a. Obtain the IP address or hostname of the printer from either the control panel or a Configuration Page.
 - b. Open a web browser, type the IP address or host name in the address bar and then press the Enter key on the keyboard to open the Embedded Web Server (EWS).




NOTE: If the printer in use requires a PIN number to access the printer settings in the EWS, open the cartridge door of the printer to obtain the default PIN.

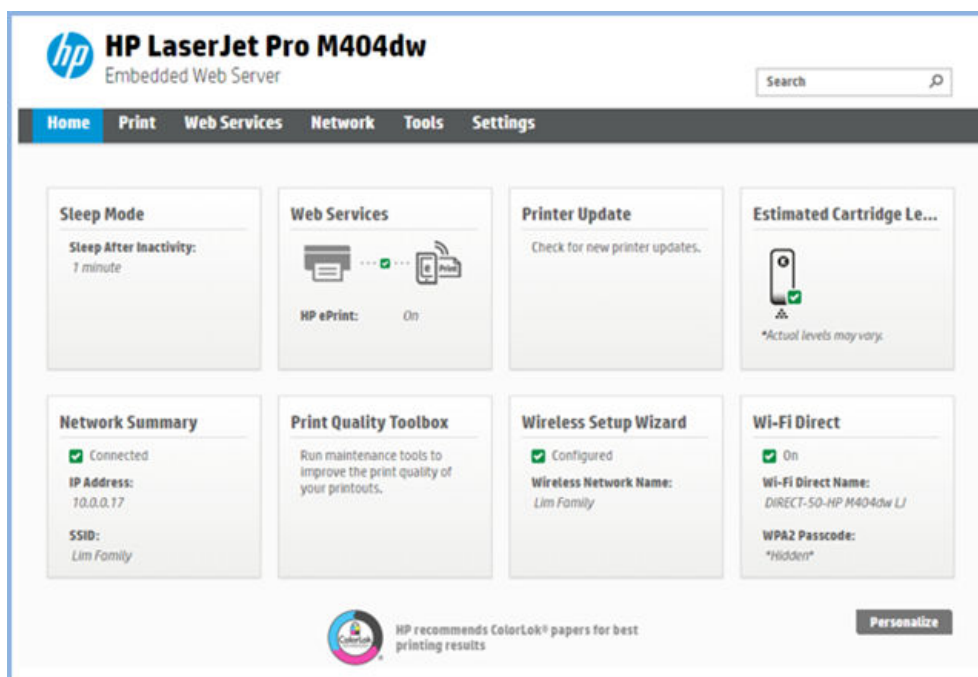

2. Select the **Settings** tab.

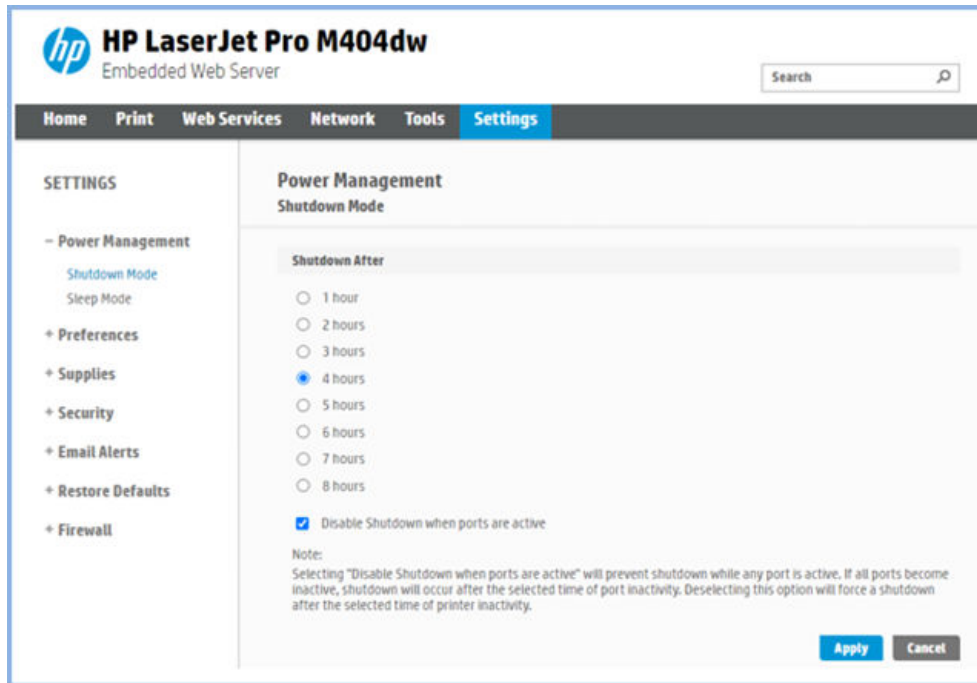


3. In the left navigation pane, select the **Security** setting, and then select the **Printer Supply Region Reset** option.

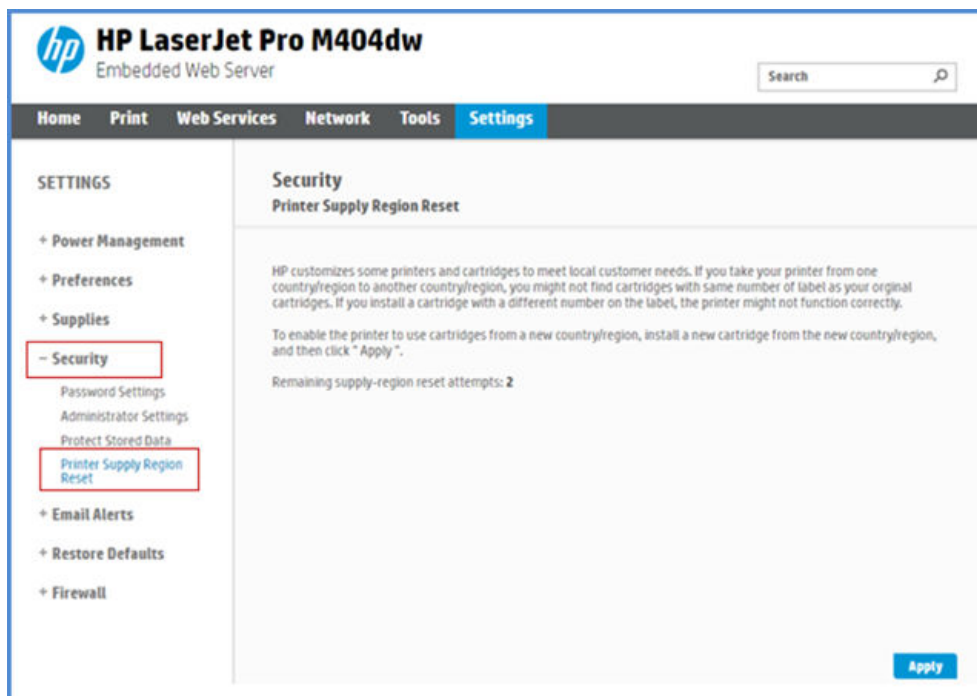

4. Read the information on the **Printer Supply Region Reset** section, and then click the **Apply** button.

5. A message confirming the "Printer Supply Region Reset" operation was successful will display on the EWS screen.

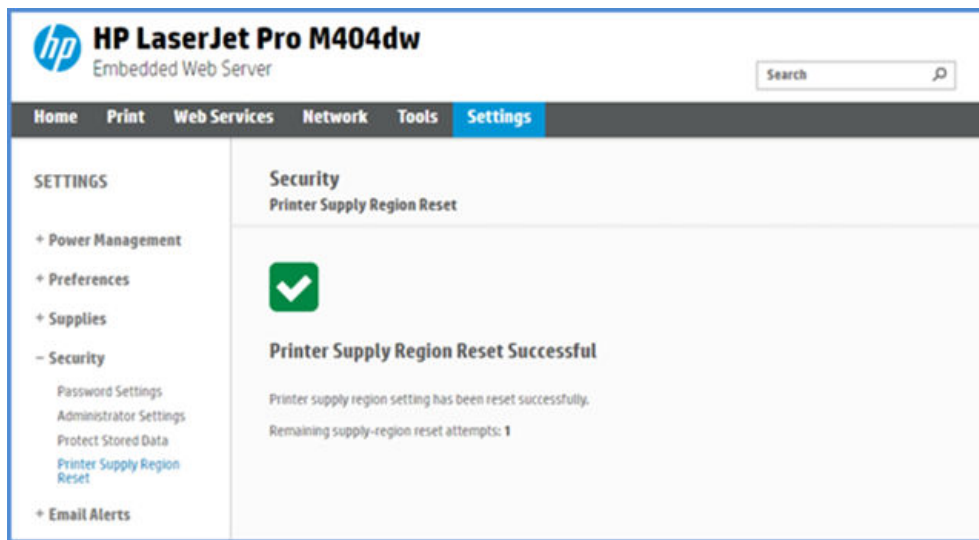

13.WX.YZ error messages

13 . 02 . yz Paper is jammed in Tray 1

Paper jam when printing from tray 1.

Y and Z are variables and can be any of the following 0-9 or A-F.


Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Remove all paper from tray 1.

- b. Open the front cover and clear any paper found.

Figure 6-10 Check inside front cover

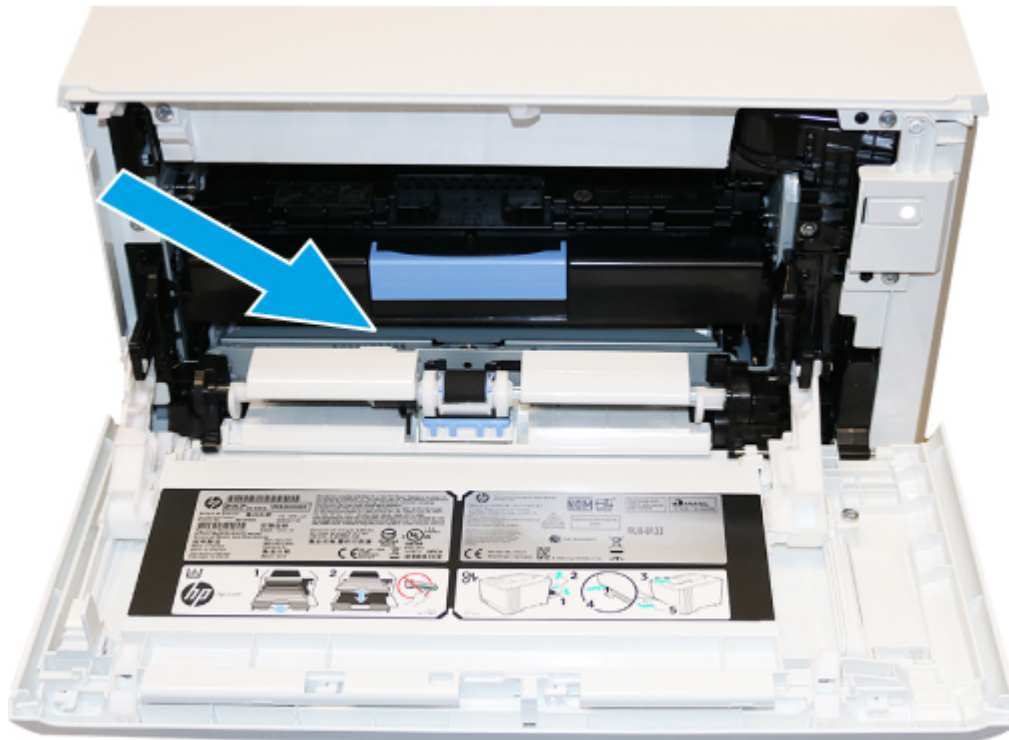


- c. close the front cover and remove tray 2.

Figure 6-11 Remove tray 2



- d. Open the jam access area inside the tray 2 opening. Press the green button on the right side to drop open the access area.


Figure 6-12 Open jam access

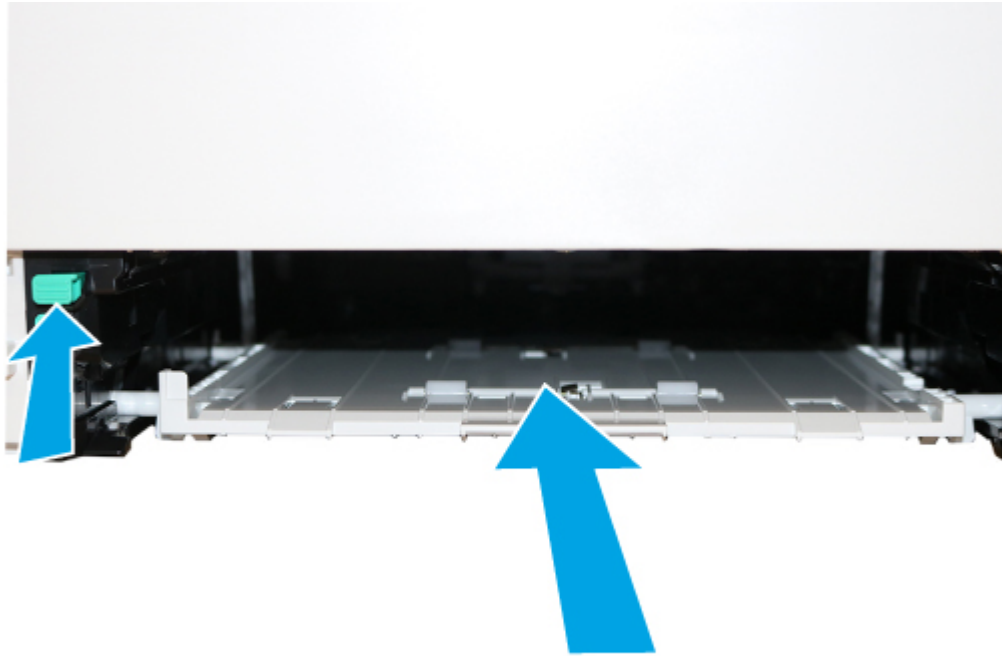

- e. Look for and clear any paper present or obstructions in the paper path.
 - f. Raise the access plate up to the closed position and reinstall tray 2.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.

3. Ensure that the tray 1 width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-13 Check guides

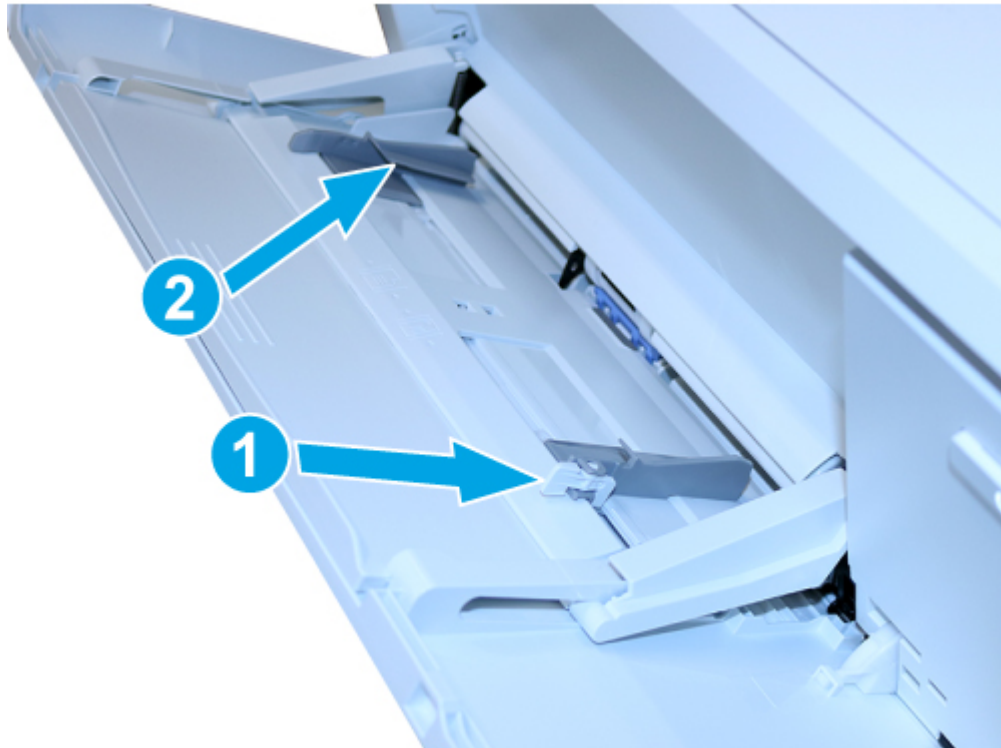

Call-out 1 – Tray adjustment

Call-out 2 – Height guide

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.


Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Remove all paper from tray 1.

- b. Open the front cover and clear any paper found.

Figure 6-14 Check inside front cover

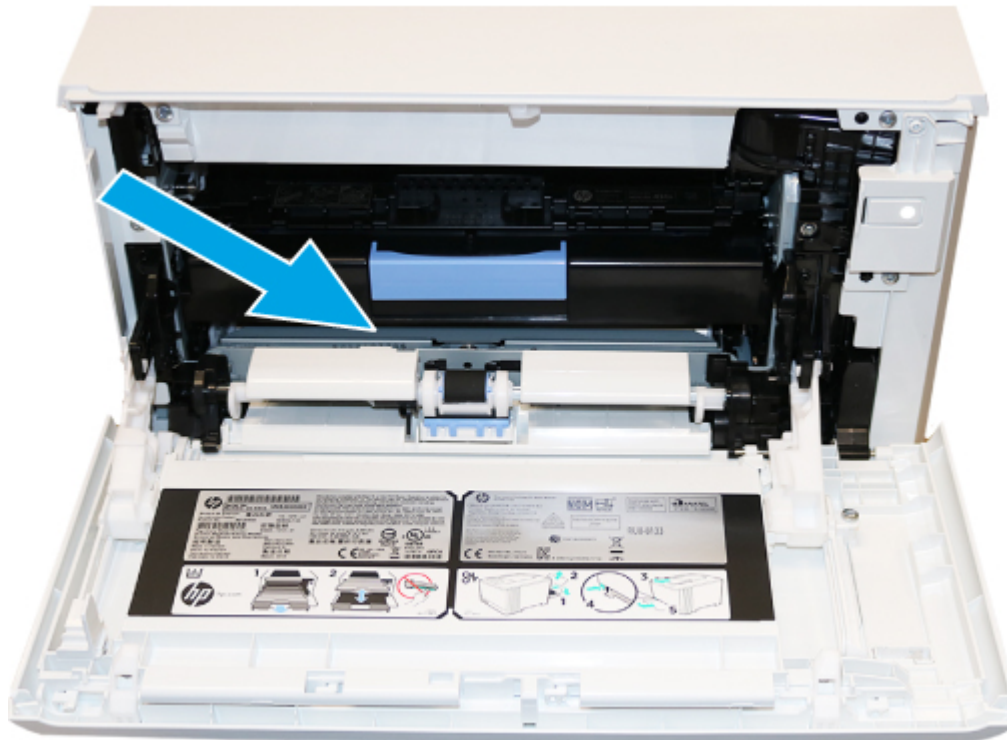


- c. close the front cover and remove tray 2.

Figure 6-15 Remove tray 2



- d. Open the jam access area inside the tray 2 opening. Press the green button on the right side to drop open the access area.


Figure 6-16 Open jam access

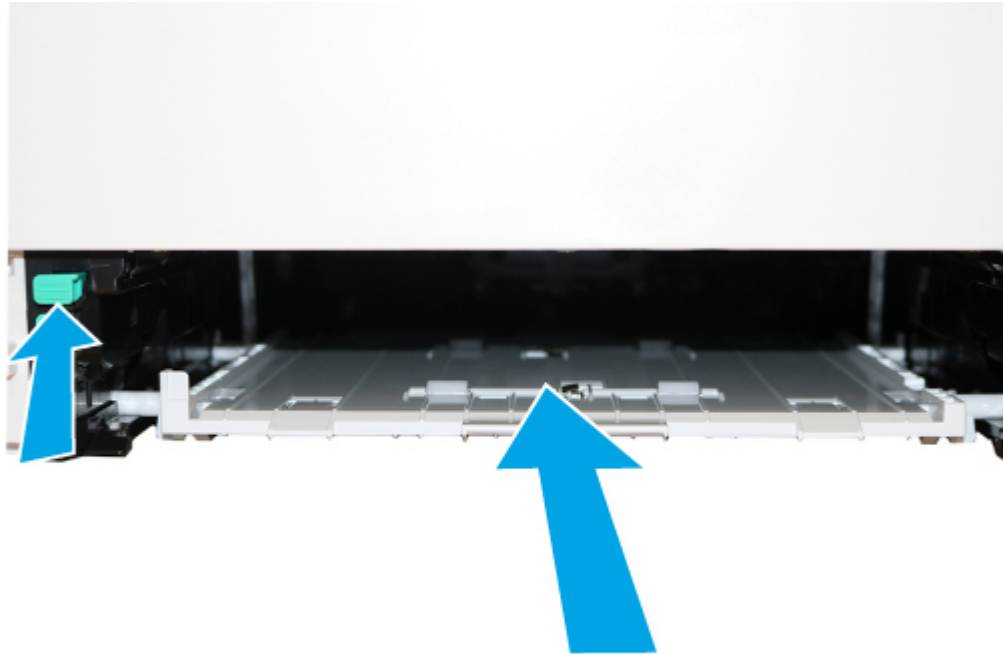

- e. Look for and clear any paper present or obstructions in the paper path.
 - f. Raise the access plate up to the closed position and reinstall tray 2.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.

3. Ensure that the tray 1 width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-17 Check guides

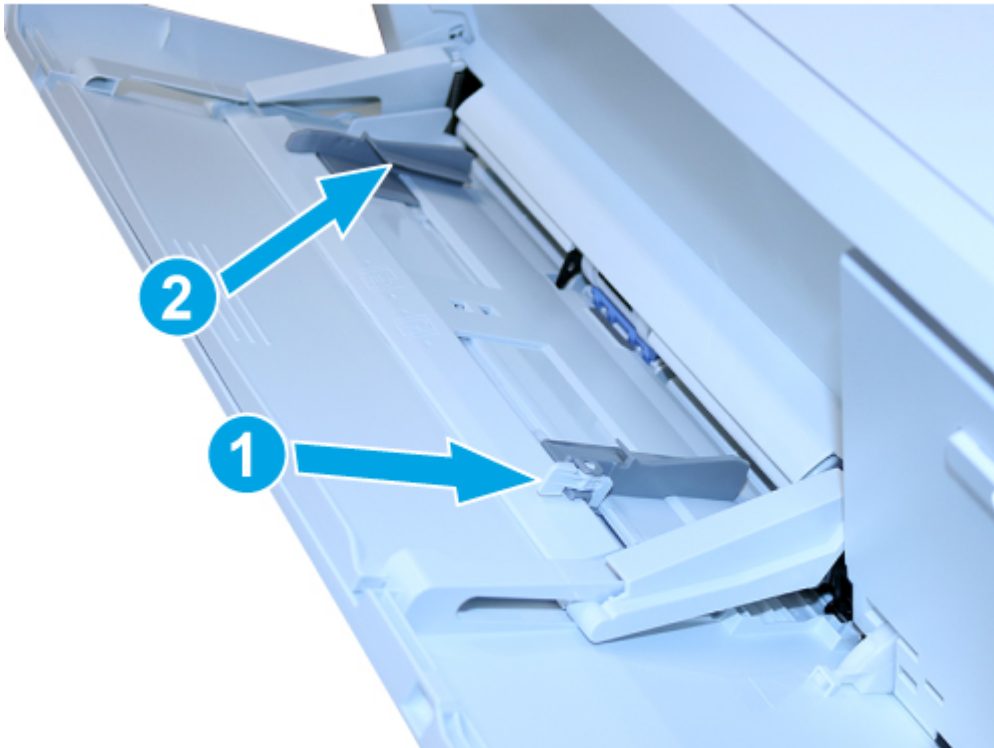

Call-out 1 – Tray adjustment

Call-out 2 – Height guide

4. Ensure that the Tray 1 pickup roller and separation pad are installed correctly and show no damage or wear.
5. Clean or replace the pickup roller and separation pad as needed.
Tray 1 pickup roller part number: RL1-2593-000CN
Tray 1 separation pad assembly part number: RM2-6406-000CN
For instructions:
 - Removal and replacement: See the Service Manual for this printer.
6. If the issue persists, elevate the case using the Standard Support Process.

13.03.yz Paper is jammed in Tray 2

Paper jam when printing from tray 2

Y and Z are variables and can be any of the following 0-9 or A-F.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.

- a. Open tray 2 and remove any jammed paper.
- b. Open the rear door and look for and clear any paper present or obstructions in the paper path.

Figure 6-18 Open rear cover




Figure 6-19 Clear Jam



- c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.

3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab (line below 3 triangles). See following images.

Figure 6-20 Tray 2 paper guides

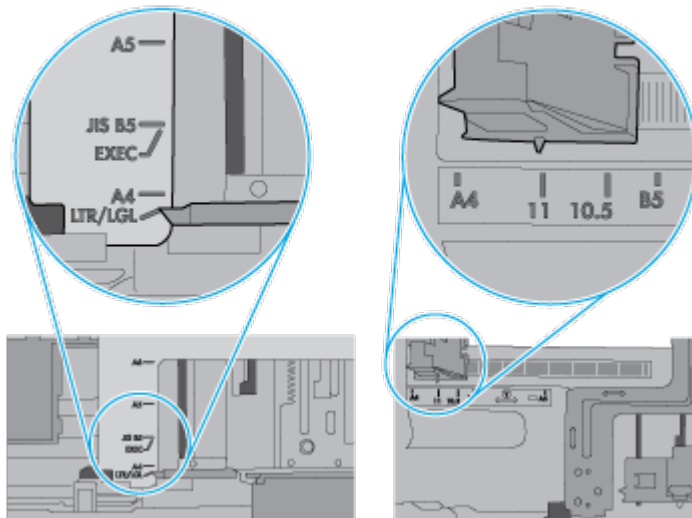

4. If the error persists, please contact HP customer support.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open tray 2 and remove any jammed paper.
 - b. Open the rear door and look for and clear any paper present or obstructions in the paper path.

Figure 6-21 Open rear cover

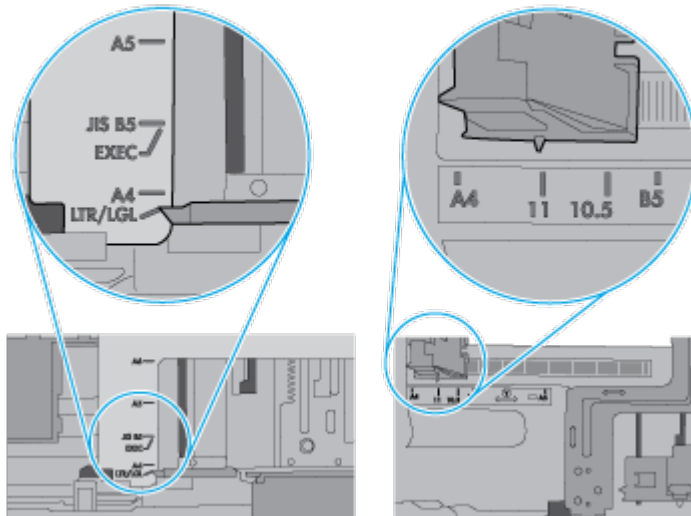


Figure 6-22 Clear Jam



- c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab (line below 3 triangles). See following images.

Figure 6-23 Tray 2 paper guides



4. Ensure that the tray 2 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.

Roller, paper pickup assembly part number: RM2-5576-000CN

Roller, feed assembly part number: RM2-5577-000CN

Roller, separation part number: RM2-5881-000CN

For instructions, search for the following documents on **WISE**:

HP Color LaserJet Pro M454, MFP M479 - Removal and replacement: Tray 2 pickup and feed rollers (c06352627)

HP Color LaserJet Pro M454, MFP M479 - Removal and replacement: Tray 2 separation roller (c06352666)

6. If the issue persists, try to engage the registration sensor with a piece of paper, if there are no obstructions close the rear door and see if the error clears.

7. If the error persists, replace the following parts as needed.

Registration assembly part number: RM2-6374-000CN

For instructions: See the Service manual for this printer.

Paper pick up assembly part number: RM2-6372-000CN

For instructions: See the Service manual for this printer.

8. If the issue persists, elevate the case using the Standard Support Process.

13.04.yz Paper is jammed in Tray 3

Paper jam when printing from tray 3.

Y and Z are variables and can be any of the following 0-9 or A-F.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the rear door and look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.

3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-24 Paper tray guides


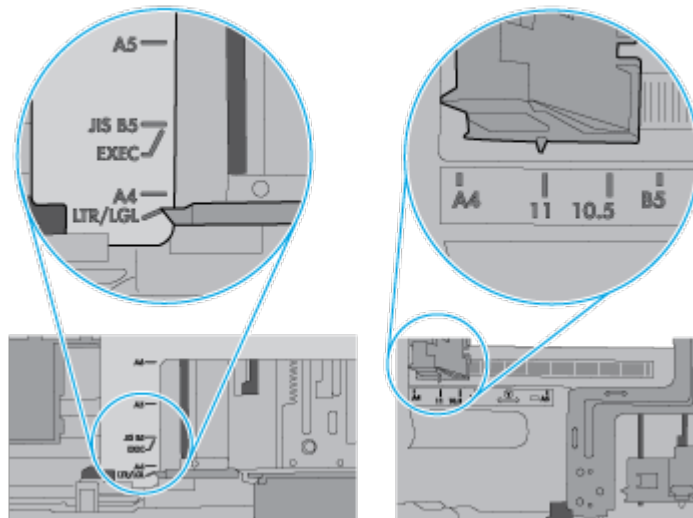


Figure 6-25 Paper height guides

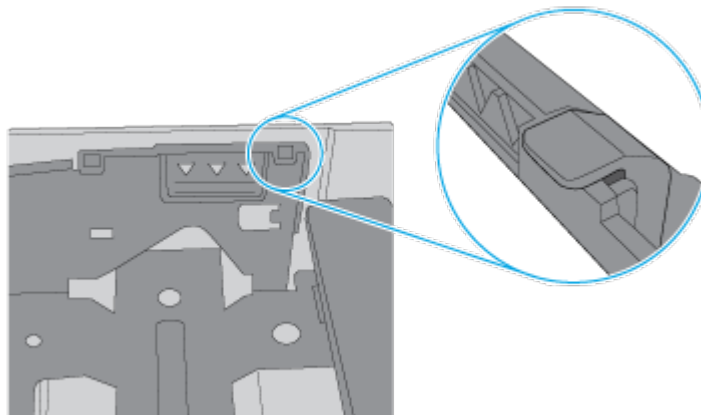

4. If the error persists, contact customer support at www.hp.com/go/contactHP, or contact an HP-authorized service or support provider.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the rear door and look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.

3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-26 Paper tray guides


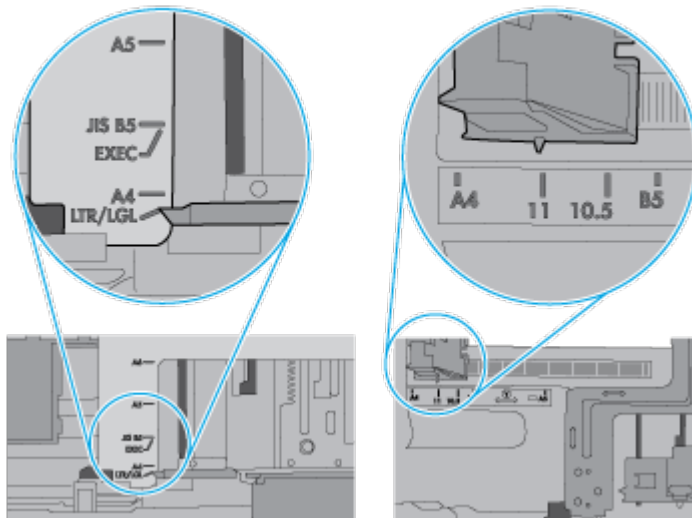


Figure 6-27 Paper height guides

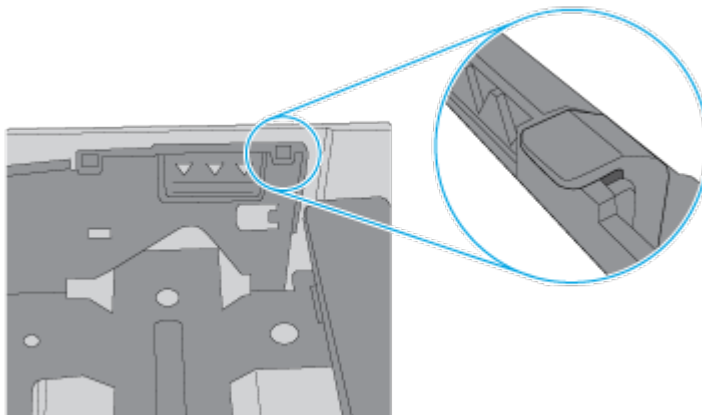

4. Ensure that the tray pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.

Roller, paper pickup assembly part number: RM2-5576-000CN

Roller, feed assembly part number: RM2-5577-000CN

Roller, separation part number: RM2-5881-000CN

For instructions:

See the Service Manual for this printer.

Removal and replacement: See the Service Manual for this printer.

6. If the jam persists, replace the Tray 3 Assembly.

Optional 550-sheet paper feeder part number: CF404-67902

13.08.yz, 13.09.yz, 13.14.yz, 13.15.yz Paper is jammed inside the printer

Paper is jammed inside the rear door of the printer.

Y and Z are variables and can be any of the following 0-9 or A-F.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open the rear door and look for and clear any paper present or obstructions in the paper path.

Figure 6-28 Open rear cover



Figure 6-29 Clear Jam



- b. Close the rear door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. Make sure the printer is located in an area meets the environmental specifications for the printer.

4. Adjust the paper guides in the tray. Ensure the front paper guide is pushing the paper against the back edge of the tray.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open the rear door and look for and clear any paper present or obstructions in the paper path.

Figure 6-30 Open rear cover



Figure 6-31 Check these areas



- b. Close the rear door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. Make sure the printer is located in an area meets the environmental specifications for the printer.
4. Adjust the paper guides in the tray. Ensure the front paper guide is pushing the paper against the back edge of the tray.
5. If the paper stopped before the fuser, complete these troubleshooting steps:

- Check the ITB and T2 roller at the transfer area, ensure that everything is correctly seated and that there are no damaged parts. Replace the ITB or T2 roller as needed.

ITB part number: RM2-6454-000CN or CF388-69009

For instructions: See the Service Manual for this printer.

Secondary transfer roller (T2) part number: RM2-6455-000CN

For instructions: See the Service Manual for this printer.

6. If the paper stopped in or at the fuser, complete these troubleshooting steps:

- Remove the fuser and inspect the fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.

Fuser (simplex; 110-127V) part number: RM2-1833-010CN

Fuser (simplex; 220-240V) part number: RM2-1834-010CN

Fuser (duplex; 110-127V) part number: RM2-6460-010CN

Fuser (duplex; 220-240V) part number: RM2-6461-010CN

For instructions: See the Service Manual for this printer.

13.10.yz, 13.11.yz, 13.13.yz Paper is jammed in the output bin

Paper is jammed in the output bin of the printer.

Y and Z are variables and can be any of the following 0-9 or A-F.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Follow the instructions on the control panel to clear the jammed paper.
2. Open the rear door and look for and clear any paper present or obstructions in the paper path.

Figure 6-32 Open rear cover



3. Close the rear door to allow the printer to attempt to clear the jam message.
4. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
5. Ensure the printer is located in an area meets the environmental specifications for the printer.

6. Adjust the paper guides in the tray. Ensure the front paper guide is pushing the paper against the back edge of the tray.
7. If the error persists, please contact HP customer support.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Follow the instructions on the control panel to clear the jammed paper.
2. Open the rear door and look for and clear any paper present or obstructions in the paper path.
3. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
4. Ensure the printer is located in an area meets the environmental specifications for the printer.
5. Adjust the paper guides in the tray. Ensure the front paper guide is pushing the paper against the back edge of the tray.
6. Remove the fuser and inspect the fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.

Fuser (simplex; 110-127V) part number: RM2-1833-010CN

Fuser (simplex; 220-240V) part number: RM2-1834-010CN

Fuser (duplex; 110-127V) part number: RM2-6460-010CN

Fuser (duplex; 220-240V) part number: RM2-6461-010CN

For instructions: See the Service Manual for this printer.

21.WX.YZ error messages

21.* errors

Errors in the 21.* family are related to the printer memory and complexity of the image being printed. The page might require more memory than the printer has available.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Touch the **OK** button to clear the error.
2. Reduce the page complexity.
3. Add product memory.

21.00.00 Page Too Complex

The printer displays this message to indicate that the page decompression process was too slow for the printer.



IMPORTANT: This event can appear on in the event log right before a paper jam.

Users will almost always see a 21.00.00 in the event log along with a 13.YY.ZZ event. Unfortunately, the order of these events occurring is such that when Video loses BD, it has not yet been determined that it was due to a jam.

The error can occur from the following sequence.

- 1) A jam occurs.
- 2) Video loses Beam Detect because engine stops instantly.
- 3) Video posts 21.00.00 error .
- 4) EI learns of the jam from the engine.
- 5) Video immediately removes the 21.00.00 error from the screen (user actually never sees this, happens very fast).
- 6) EI posts Jam event.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to continue. There may be some data loss on the page that was being formatted when the error occurred.

30.WX.YZ error messages

30 . 01 . 08 Home position error

The scanner optic failed to return to the home position.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Verify that the printer has the most recent firmware from HP.
3. Verify that the (flat flexible cables (FFC's) to the scanner assembly are seated correctly on the formatter board.
4. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly (M479) (simplex) part number: W1A73-60111

Integrated scanner assembly (M479) (duplex) part number: W1A73-60110

For instructions: See the Service Manual for this printer.

30.03.14 Scanner error

Front side scanner EEPROM (NVM) error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Verify that the printer has the most recent firmware from HP.
3. Verify that the (flat flexible cables (FFC's) to the scanner assembly are seated correctly on the formatter board.
4. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly (M479) (simplex) part number: W1A73-60111

Integrated scanner assembly (M479) (duplex) part number: W1A73-60110

For instructions: See the Service Manual for this printer.

30.03.20

The firmware cannot communicate with the PCA on the assembly.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Verify that the printer has the most recent firmware from HP.
3. Verify that the (flat flexible cables (FFC's) to the scanner assembly are seated correctly on the formatter board.
4. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly (M479) (simplex) part number: W1A73-60111

Integrated scanner assembly (M479) (duplex) part number: W1A73-60110

For instructions: See the Service Manual for this printer.

30 . 03 . 22 Scanner failure

Front side illumination calibration failure.

The scan module cannot see the illumination module, or the illumination is marginal.

The optical assembly might not be parked under the calibration strip.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Verify that the printer has the most recent firmware from HP.
3. Verify that the (flat flexible cables (FFC's) to the scanner assembly are seated correctly on the formatter board.
4. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly (M479) (simplex) part number: W1A73-60111

Integrated scanner assembly (M479) (duplex) part number: W1A73-60110

For instructions: See the Service Manual for this printer.

30 . 03 . 30 Scanner Failure

Flatbed motor shutdown.

The scanner control board (SCB) cannot communicate with the flatbed scanner motor.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Verify that the printer has the most recent firmware from HP.
3. Verify that the (flat flexible cables (FFC's) to the scanner assembly are seated correctly on the formatter board.
4. If the error persists, replace the integrated scanner assembly.

Integrated scanner assembly (M479) (simplex) part number: W1A73-60111

Integrated scanner assembly (M479) (duplex) part number: W1A73-60110

For instructions: See the Service Manual for this printer.

31.WX.YZ error messages

31 . 01 . 47 Document feeder not detected

The document feeder was not detected. The document feeder might not be connected.

The flatbed glass is still available for scanning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off and then on.
2. Verify that the printer has the most recent firmware from HP.
3. Verify that the (flat flexible cables (FFC's) to the scanner assembly are seated correctly on the formatter board.
4. If the issue persists, replace the document feeder.

Integrated scanner assembly (M479) (simplex) part number: W1A73-60111

Integrated scanner assembly (M479) (duplex) part number: W1A73-60110

For instructions: See the Service Manual for this printer.

31 . 03 . 14 Backside scanner EEPROM error

Backside scanner EEPROM (NVM) error.

A non-fatal error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off and then on.
2. Verify that the printer has the most recent firmware from HP.
3. Verify that the (flat flexible cables (FFC's) to the scanner assembly are seated correctly on the formatter board.
4. If the issue persists, replace the document feeder.

Integrated scanner assembly (M479) (simplex) part number: W1A73-60111

Integrated scanner assembly (M479) (duplex) part number: W1A73-60110

For instructions: See the Service Manual for this printer.

31 . 03 . 20 backside scanner not detected

Backside scanner is not detected.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off and then on.
2. Verify that the printer has the most recent firmware from HP.
3. Verify that the (flat flexible cables (FFC's) to the scanner assembly are seated correctly on the formatter board.
4. If the issue persists, replace the document feeder.

Integrated scanner assembly (M479) (simplex) part number: W1A73-60111

Integrated scanner assembly (M479) (duplex) part number: W1A73-60110

For instructions: See the Service Manual for this printer.

31 . 03 . 22 Scanner calibration failure

Backside illumination calibration failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off and then on.
2. Verify that the printer has the most recent firmware from HP.
3. Verify that the (flat flexible cables (FFC's) to the scanner assembly are seated correctly on the formatter board.
4. If the issue persists, replace the document feeder.

Integrated scanner assembly (M479) (simplex) part number: W1A73-60111

Integrated scanner assembly (M479) (duplex) part number: W1A73-60110

For instructions: See the Service Manual for this printer.

31.03.31 Document feeder motor stall

The document feeder feed motor is not turning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off and then on.
2. Verify that the printer has the most recent firmware from HP.
3. Verify that the (flat flexible cables (FFC's) to the scanner assembly are seated correctly on the formatter board.
4. If the issue persists, replace the document feeder.

Integrated scanner assembly (M479) (simplex) part number: W1A73-60111

Integrated scanner assembly (M479) (duplex) part number: W1A73-60110

For instructions: See the Service Manual for this printer.

31 . 13 . 01 Document feeder pick error

Document feeder job error, pick error.

Paper pick was initiated, but the page didn't did not make it to the pick success sensor.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the document feeder lid, pull the sheets back into the input tray, and then resume the job.
2. Check the paper guides and make sure that they are set to the correct paper width.
3. Make sure that the input tray is not overloaded and the tray guides are correctly aligned to both edges of the paper.
4. Verify that the paper meets the printer specifications.
5. Verify there are no staples or paper clips on the stack of originals. Verify the originals are straightened out from previous folds or curl.
6. Clean the document feeder pick and feed rollers with a damp lint free cloth.
7. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the document feeder lid, pull the sheets back into the input tray, and then resume the job.
2. Check the paper guides and make sure that they are set to the correct paper width.
3. Make sure that the input tray is not overloaded and the tray guides are correctly aligned to both edges of the paper.
4. Verify that the paper meets the printer specifications.
5. Clean the document feeder pick and feed rollers with a damp lint free cloth.
6. If the error persists, replace the document feeder top cover assembly or the integrated scanning assembly.

Integrated scanner assembly (M479) (simplex) part number: W1A73-60111

Integrated scanner assembly (M479) (duplex) part number: W1A73-60110

For instructions: See the Service Manual for this printer.

Document feeder top cover part number: W1A77-67903

31 . 13 . 02 Jam in document feeder

Document feeder jam error.

The paper passed the pick-success sensor, and then jammed in the automatic document feeder paper path.

This issue might be describe as the following:

- Automatic document feeder jam
- ADF Jamming
- ADF paper jam
- Jams in document feeder

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the document feeder lid, pull the sheets back into the input tray, and then resume the job.
2. Check the paper guides and make sure that they are set to the correct paper width.
3. Make sure that the input tray is not overloaded and the tray guides are correctly aligned to both edges of the paper.
4. Verify that the paper meets the printer specifications.
5. Verify there are no staples or paper clips on the stack of originals. Verify the originals are straightened out from previous folds or curl.
6. Clean the document feeder pick and feed rollers with a damp lint free cloth.
7. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the document feeder lid, pull the sheets back into the input tray, and then resume the job.
2. Check the paper guides and make sure that they are set to the correct paper width.
3. Make sure that the input tray is not overloaded and the tray guides are correctly aligned to both edges of the paper.
4. Verify that the paper meets the printer specifications.
5. Clean the document feeder pick and feed rollers with a damp lint free cloth.
6. If the error persists, replace the document feeder top cover assembly or the integrated scanning assembly.

Integrated scanner assembly (M479) (simplex) part number: W1A73-60111

Integrated scanner assembly (M479) (duplex) part number: W1A73-60110

For instructions: See the Service Manual for this printer.

Document feeder top cover part number: W1A77-67903

32.WX.YX error messages

32.* errors

Errors in the 32.* family are related to either product start events or to backup and restore events.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. Retry the job.

32.21.11 Cold Reset Performed

The printer has had a cold reset performed.

Recommended action

There is no action needed for this message.

- No action necessary.

33.WX.YZ error messages

33 . 05 . 00, Boot code corrupt

The boot firmware boot code is corrupt.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, upgrade to the latest version of firmware, or re-download the firmware.
3. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, upgrade to the latest version of firmware, or re-download the firmware.
3. If the error persists, elevate the case using the Standard Support Process.

33 . 05 . 04 Upgrade corrupt

the firmware upgrade is corrupt.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, upgrade to the latest version of firmware, or re-download the firmware.
3. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, upgrade to the latest version of firmware, or re-download the firmware.
3. If the error persists, elevate the case using the Standard Support Process.

33.05.10 Code sign error

The printer experienced a code sign error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, upgrade to the latest version of firmware, or re-download the firmware.
3. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, upgrade to the latest version of firmware, or re-download the firmware.
3. If the error persists, elevate the case using the Standard Support Process.

44.WX.YZ error messages

44.34.10 Fax DSP not detected

The Fax DSP PCA was not detected.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Verify the that the FFC to the fax PCA is correctly installed on the formatter.
 - a. Remove the right cover following the directions in the Service Manual.
 - b. Check the FFC connection on the Formatter at J12 Fax. Ensure the FFC is correctly connected and seated.
 - c. If it is not correctly connected, reconnect and test the Fax again.
3. If the error persists, replace the Fax PCA.

Fax PCA (M479; US) Part number: W1A78-67906

Fax PCA (M479; Europe) Part number: W1A78-67907

Fax PCA (M479; Brazil) Part number: W1A78-67908

Fax PCA (M479; Philippines/AP) Part number: W1A78-67909

For instructions: See the Service Manual for this printer.

 **IMPORTANT:** Before replacing the Fax PCA check the connection of the FFC to the PCA to make sure it is not loose and is connected and seated correctly.

44 . 34 . 11 Fax DSP Failed

The FAX DSP failed.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Verify the that the FFC to the fax PCA is correctly installed on the formatter.
 - a. Remove the right cover following the directions in the Service Manual.
 - b. Check the FFC connection on the Formatter at J12 Fax. Ensure the FFC is correctly connected and seated.
 - c. If it is not correctly connected, reconnect and test the Fax again.

3. If the error persists, replace the Fax PCA.

Fax PCA (M479; US) Part number: W1A78-67906

Fax PCA (M479; Europe) Part number: W1A78-67907

Fax PCA (M479; Brazil) Part number: W1A78-67908

Fax PCA (M479; Philippines/AP) Part number: W1A78-67909

For instructions: See the Service Manual for this printer.

 **IMPORTANT:** Before replacing the Fax PCA check the connection of the FFC to the PCA to make sure it is not loose and is connected and seated correctly.

44 . 34 . 12 Fax CSP1040 Failed

The printer experienced a Fax CSP1040 failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommend action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Ensure that the Fax phone cord is correctly connected to the wall jack and that the wall jack is capable of handling Fax.
3. Ensure that the fax phone cord is good. If need replace the phone cord.
4. Verify the that the FFC to the fax PCA is correctly installed on the formatter.
 - a. Remove the right cover following the directions in the Service Manual.
 - b. Check the FFC connection on the Formatter at J12 Fax. Ensure the FFC is correctly connected and seated.
 - c. If it is not correctly connected, reconnect and test the Fax again.
5. If the error persists, replace the Fax PCA.

Fax PCA (M479; US) Part number: W1A78-67906

Fax PCA (M479; Europe) Part number: W1A78-67907

Fax PCA (M479; Brazil) Part number: W1A78-67908

Fax PCA (M479; Philippines/AP) Part number: W1A78-67909

For instructions: See the Service Manual for this printer.

 **IMPORTANT:** Before replacing the Fax PCA check the connection of the FFC to the PCA to make sure it is not loose and is connected and seated correctly.

44 . 34 . 13 Fax connected to wall jack

The printer fax is connected to a wall jack.

Recommended action

Follow these troubleshooting steps in the order presented.

1. This is an informational only message. No action is required.
2. If the message continues to appear, ensure that the phone cord is correctly connected to the wall jack.
3. Ensure the phone cord is good. Replace the phone cord as needed.

44 . 34 . 14 Fax connect to wall fail

The printer Fax connection to the wall failed.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Ensure the phone cord is correctly connect to the wall jack.
2. Ensure the wall jack is a phone line compatible with Fax.
3. Ensure that the phone cord good and not damaged or defective. Replace the phone cord as needed.
4. For more information, go to the following document:

[HP LaserJet Pro MFP - Fax troubleshooting checklist](#)

44 . 34 . 15 Fax phone cord connect correct

The printer indicates that the Fax cord is correctly connected.

Recommended action

Follow these troubleshooting steps in the order presented.

1. This is an informational only message. No action is required.
2. If the message continues to appear, ensure that the phone cord is correctly connected to the wall jack.
3. Ensure the phone cord is good. Replace the phone cord as needed.

44 . 34 . 16 Fax phone cord connect correct failed

The printer indicates that the Fax phone cord connection failed.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Ensure the phone cord is correctly connect to the wall jack.
2. Ensure the wall jack is a phone line compatible with Fax.
3. Ensure that the phone cord good and not damaged or defective. Replace the phone cord as needed.
4. For more information, go to the following document:

[HP LaserJet Pro MFP - Fax troubleshooting checklist](#)

44 . 34 . 19 Fax line condition result

The printer indicates the Fax phone line connection failed.

Recommended action

Follow these troubleshooting steps in the order presented.

1. This is an informational only message. No action is required.
2. If the message continues to appear, ensure that the phone cord is correctly connected to the wall jack.
3. Ensure the phone cord is good. Replace the phone cord as needed.

44 . 34 . 1A Fax line condition result fail

The printer experienced a fax line condition fail.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Ensure the phone cord is correctly connect to the wall jack.
2. Ensure the wall jack is a phone line compatible with Fax.
3. Ensure that the phone cord good and not damaged or defective. Replace the phone cord as needed.
4. For more information, go to the following document:

[HP LaserJet Pro MFP - Fax troubleshooting checklist](#)

44 . 34 . 1B Fax dial tone test result

The printer fax has performed a dial tone test.

Recommended action

Follow these troubleshooting steps in the order presented.

1. This is an informational only message. No action is required.
2. If the message continues to appear, ensure that the phone cord is correctly connected to the wall jack.
3. Ensure the phone cord is good. Replace the phone cord as needed.

44 . 34 . 1C Fax dial tone test result fail

The printer fax dial tone test failed.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Ensure the phone cord is correctly connect to the wall jack.
2. Ensure the wall jack is a phone line compatible with Fax.
3. Ensure that the phone cord good and not damaged or defective. Replace the phone cord as needed.
4. For more information, go to the following document:
[HP LaserJet Pro MFP - Fax troubleshooting checklist](#)
5. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommend action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Ensure that the Fax phone cord is correctly connected to the wall jack and that the wall jack is capable of handling Fax.
3. Ensure that the fax phone cord is good. If need replace the phone cord.
4. Verify the that the FFC to the fax PCA is correctly installed on the formatter.
 - a. Remove the right cover following the directions in the Service Manual.
 - b. Check the FFC connection on the Formatter at J12 Fax. Ensure the FFC is correctly connected and seated.
 - c. If it is not correctly connected, reconnect and test the Fax again.
5. If the error persists, replace the Fax PCA.

Fax PCA (M479; US) Part number: W1A78-67906

Fax PCA (M479; Europe) Part number: W1A78-67907

Fax PCA (M479; Brazil) Part number: W1A78-67908

Fax PCA (M479; Philippines/AP) Part number: W1A78-67909

For instructions: See the Service Manual for this printer.



IMPORTANT: Before replacing the Fax PCA check the connection of the FFC to the PCA to make sure it is not loose and is connected and seated correctly.

44 . 34 . 1D Fax hardware test result

A printer fax hardware test was performed.

Recommended action

Follow these troubleshooting steps in the order presented.

1. This is an informational only message. No action is required.
2. If the message continues to appear, ensure that the phone cord is correctly connected to the wall jack.
3. Ensure the phone cord is good. Replace the phone cord as needed.

44 . 92 . 10 Fax communication error

The printer experienced a fax communication error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Ensure the phone cord is correctly connect to the wall jack.
2. Ensure the wall jack is a phone line compatible with Fax.
3. Ensure that the phone cord good and not damaged or defective. Replace the phone cord as needed.
4. For more information, go to the following document:
[HP LaserJet Pro MFP - Fax troubleshooting checklist](#)
5. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommend action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Ensure that the Fax phone cord is correctly connected to the wall jack and that the wall jack is capable of handling Fax.
3. Ensure that the fax phone cord is good. If need replace the phone cord.
4. Verify the that the FFC to the fax PCA is correctly installed on the formatter.
 - a. Remove the right cover following the directions in the Service Manual.

- b. Check the FFC connection on the Formatter at J12 Fax. Ensure the FFC is correctly connected and seated.
 - c. If it is not correctly connected, reconnect and test the Fax again.
 - 5. If the error persists, replace the Fax PCA.
 - Fax PCA (M479; US) Part number: W1A78-67906
 - Fax PCA (M479; Europe) Part number: W1A78-67907
 - Fax PCA (M479; Brazil) Part number: W1A78-67908
 - Fax PCA (M479; Philippines/AP) Part number: W1A78-67909
 - For instructions: See the Service Manual for this printer.

 **IMPORTANT:** Before replacing the Fax PCA check the connection of the FFC to the PCA to make sure it is not loose and is connected and seated correctly.

44 . 92 . 12 Fax memory full

The fax memory is full.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Remove faxes from the memory by printing them out and/or deleting them.
2. Delete faxes from memory.

[HP LaserJet Pro MFP - Delete faxes from memory](#)

In addition to clearing the reprint memory, this procedure clears any fax that is currently being sent, unsent faxes that are pending redial, faxes that are scheduled to be sent at a future time, and faxes that are not printed or forwarded.

44 . 92 . 13 Fax cannot reprint

The fax cannot reprint the job.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Once the printer comes to ready, go into the saved faxes and try to reprint the Fax.
3. If the fax cannot be printed, have the original fax resent and print.

50.WX.YZ error messages

50.* errors

Errors in the 50.* family indicate a problem with the fuser.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and remove the fuser. Check the fuser for damage or obstructions. Reinstall or replace the fuser as needed.

 **CAUTION:** The fuser might be hot.

2. Check the connectors between the fuser and the DC controller and from the fuser to the printer.
3. Replace the fuser. If it has already been replaced, replace the fuser power supply.

50.00.00

Fuser temperature failure

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.

4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

7. Ensure that there is no residual paper in the fuser.
8. If the error persists, replace the fuser assembly.

Fuser (simplex; 110-127V) part number: RM2-1833-010CN

Fuser (simplex; 220-240V) part number: RM2-1834-010CN

Fuser (duplex; 110-127V) part number: RM2-6460-010CN

Fuser (duplex; 220-240V) part number: RM2-6461-010CN

For instructions: See the Service Manual for this printer.

For instructions: See the Service Manual for this printer.

50.01.00

Low fuser temperature failure

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.

5. Ensure the paper type and fuser mode are correct for paper being used.
6. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

7. Ensure that there is no residual paper in the fuser.

8. If the error persists, replace the fuser assembly.

Fuser (simplex; 110-127V) part number: RM2-1833-010CN

Fuser (simplex; 220-240V) part number: RM2-1834-010CN

Fuser (duplex; 110-127V) part number: RM2-6460-010CN

Fuser (duplex; 220-240V) part number: RM2-6461-010CN

For instructions: See the Service Manual for this printer.

9. If the error persists, replace the low-voltage power assembly.

110v Low-voltage power supply part number: RM3-7241-000CN

220v Low-voltage power supply part number: RM3-7242-000CN

For instructions: See the Service Manual for this printer.

50.02.00

Slow fuser error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
3. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.

4. Remove the fuser and check the fuser for damage or obstructions. Reinstall or replace the fuser as needed. Ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

5. Ensure that there is no residual paper in the fuser.
6. If the error persists, replace the fuser assembly.

Fuser (simplex; 110-127V) part number: RM2-1833-010CN

Fuser (simplex; 220-240V) part number: RM2-1834-010CN

Fuser (duplex; 110-127V) part number: RM2-6460-010CN

Fuser (duplex; 220-240V) part number: RM2-6461-010CN

For instructions: See the Service Manual for this printer.

50.03.00

High fuser temperature.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

4. Ensure that there is no residual paper in the fuser.
5. Check the paper type setting in the printer control panel menus and in the print driver. Ensure that the settings match and are correct for the type of paper being used.
6. If the error persists, replace the fuser assembly.

Fuser (simplex; 110-127V) part number: RM2-1833-010CN

Fuser (simplex; 220-240V) part number: RM2-1834-010CN

Fuser (duplex; 110-127V) part number: RM2-6460-010CN

Fuser (duplex; 220-240V) part number: RM2-6461-010CN

For instructions: See the Service Manual for this printer.

For instructions: See the Service Manual for this printer.

7. If the error persists, replace the low-voltage power assembly.

110v Low-voltage power supply part number: RM3-7241-000CN

220v Low-voltage power supply part number: RM3-7242-000CN

For instructions: See the Service Manual for this printer.

50.04.00

Fuser drive error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

4. Check the printer power source. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.

 **NOTE:** If the printer does not meet the power requirement of 43 to 67Hz frequency, the fuser temperature control does not work correctly and this will cause the error.

5. Reconnect the connector (J109) on the engine controller PCA.

6. If the error persists, replace the low-voltage power assembly.

110v Low-voltage power supply part number: RM3-7241-000CN

220v Low-voltage power supply part number: RM3-7242-000CN

For instructions: See the Service Manual for this printer.

50.05.00

Fuser error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

7. Ensure that there is no residual paper in the fuser.
8. If the error persists, replace the fuser assembly.

Fuser (simplex; 110-127V) part number: RM2-1833-010CN

Fuser (simplex; 220-240V) part number: RM2-1834-010CN

Fuser (duplex; 110-127V) part number: RM2-6460-010CN

Fuser (duplex; 220-240V) part number: RM2-6461-010CN

For instructions: See the Service Manual for this printer.

For instructions: See the Service Manual for this printer.

50.07.00

Fuser open error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. Remove and reinstall the fuser.

 **CAUTION:** The fuser might be hot.

 **NOTE:** If a 50.7 occurs at power-on or is followed immediately by a jam error, there might be a small piece of paper stuck in the fuser.

4. Check for paper in the fuser.

- a. Check for jammed paper or paper remnants in the following locations.

Figure 6-33 Fuser input area

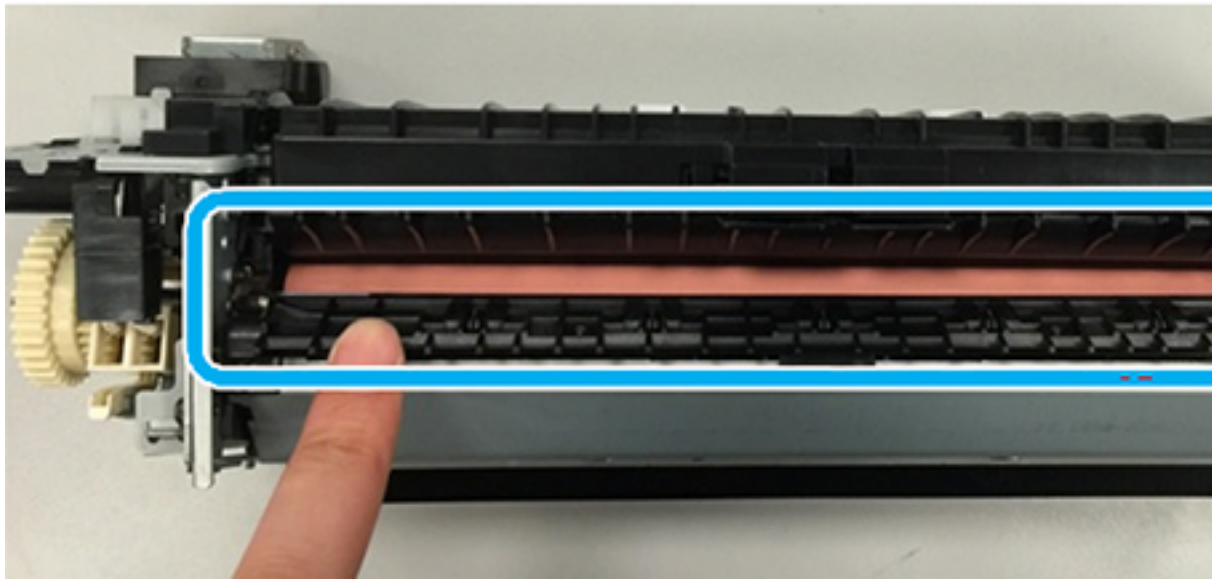


Figure 6-34 Fuser rear side


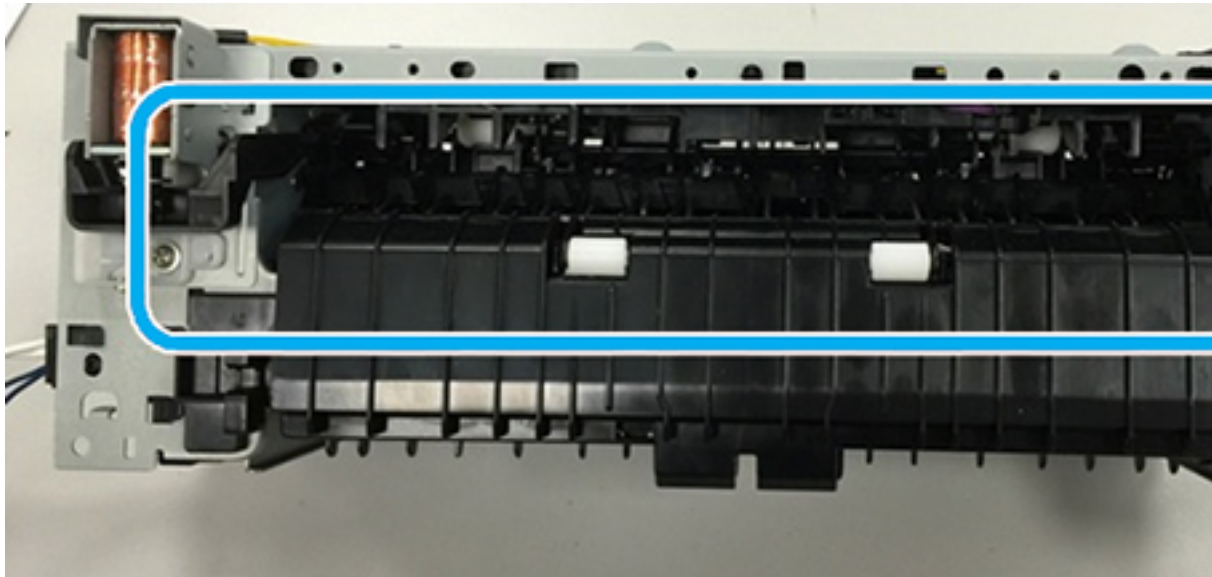


Figure 6-35 Fuser output area

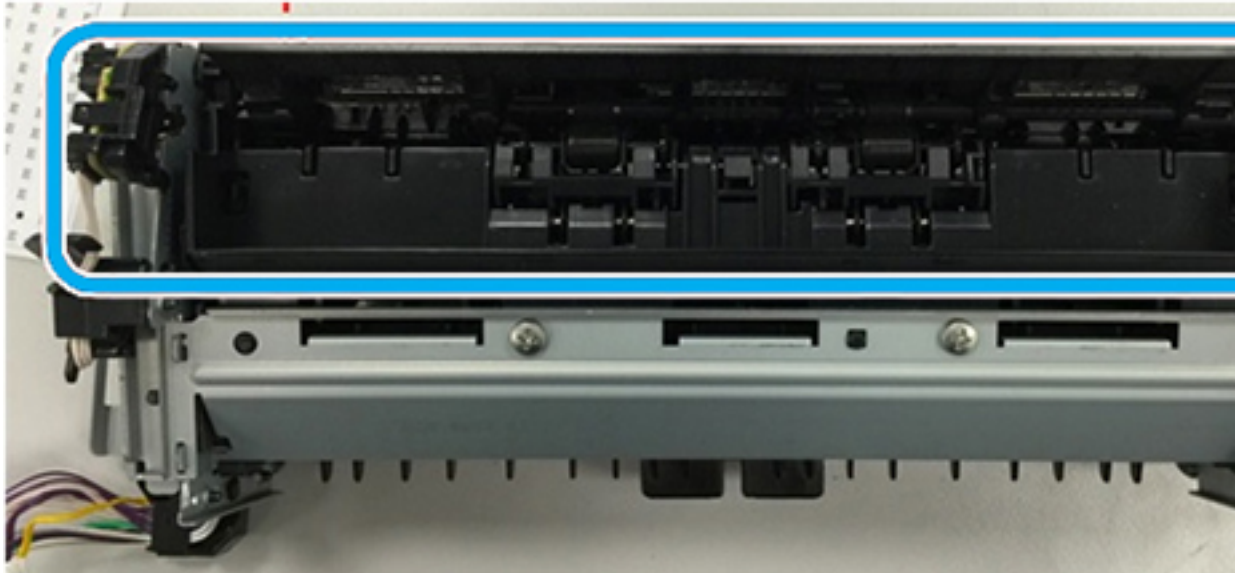

- b. If no paper is obvious in the above locations or it is difficult to remove, the fuser might need to be disassembled to find and/or remove the jammed paper.

Figure 6-36 Remove two (2) screws

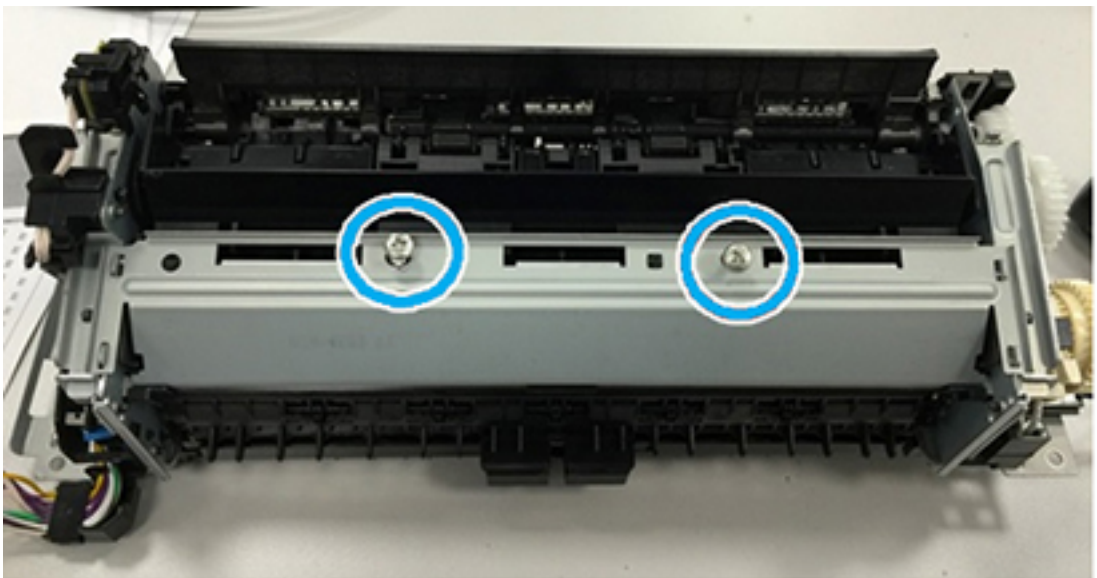


Figure 6-37 Remove the top sheet metal



Figure 6-38 Remove the plastic cover



Figure 6-39 Lift up right side first the left side to remove this panel



- c. Remove the paper from the fuser.
- 5. Reinstall the fuser.
- 6. If the error persists, replace the fuser.

Fuser (simplex; 110-127V) part number: RM2-1833-010CN

Fuser (simplex; 220-240V) part number: RM2-1834-010CN

Fuser (duplex; 110-127V) part number: RM2-6460-010CN

Fuser (duplex; 220-240V) part number: RM2-6461-010CN

For instructions: See the Service Manual for this printer.



NOTE: Before replacing the fuser, check connector J112 on the engine controller PCA. Ensure the connection is seated correctly and not damaged.

- 7. If the error persists, replace the fuser motor M4.
Motor, fuser (M4) part number: RM2-7349-000CN
For instructions: See the Service Manual for this printer.
- 8. If the error persists, replace the printer.

50.08.00

Fuser ow sub-thermistor fuser error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

- 1. Turn off the power by using the power switch, and then wait at least 30 seconds.
- 2. Turn on the power and wait for the product to initialize

3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

7. Ensure that there is no residual paper in the fuser.
8. If the error persists, replace the fuser assembly.
 Fuser (simplex; 110-127V) part number: RM2-1833-010CN
 Fuser (simplex; 220-240V) part number: RM2-1834-010CN
 Fuser (duplex; 110-127V) part number: RM2-6460-010CN
 Fuser (duplex; 220-240V) part number: RM2-6461-010CN
 For instructions: See the Service Manual for this printer.
9. If the error persists, replace the low-voltage power assembly.
 110v Low-voltage power supply part number: RM3-7241-000CN
 220v Low-voltage power supply part number: RM3-7242-000CN
 For instructions: See the Service Manual for this printer.

50.09.00

Fuser high sub-thermistor fuser error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.

2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. Remove and reinstall the fuser. ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

7. Ensure that there is no residual paper in the fuser.
8. If the error persists, replace the fuser assembly.
 Fuser (simplex; 110-127V) part number: RM2-1833-010CN
 Fuser (simplex; 220-240V) part number: RM2-1834-010CN
 Fuser (duplex; 110-127V) part number: RM2-6460-010CN
 Fuser (duplex; 220-240V) part number: RM2-6461-010CN
 For instructions: See the Service Manual for this printer.
9. If the error persists, replace the low-voltage power assembly.
 110v Low-voltage power supply part number: RM3-7241-000CN
 220v Low-voltage power supply part number: RM3-7242-000CN
 For instructions: See the Service Manual for this printer.

50.11.00

High fuser temperature 3.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. Remove and reinstall the fuser. ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

7. Ensure that there is no residual paper in the fuser.
8. If the error persists, replace the fuser assembly.
Fuser (simplex; 110-127V) part number: RM2-1833-010CN
Fuser (simplex; 220-240V) part number: RM2-1834-010CN
Fuser (duplex; 110-127V) part number: RM2-6460-010CN
Fuser (duplex; 220-240V) part number: RM2-6461-010CN
For instructions: See the Service Manual for this printer.
9. If the error persists, replace the low-voltage power assembly.
110v Low-voltage power supply part number: RM3-7241-000CN
220v Low-voltage power supply part number: RM3-7242-000CN
For instructions: See the Service Manual for this printer.

50.12.00

Low fuser temperature 3.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the paper type and fuser mode are correct for paper being used.
6. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

7. Ensure that there is no residual paper in the fuser.
8. If the error persists, replace the fuser assembly.
Fuser (simplex; 110-127V) part number: RM2-1833-010CN
Fuser (simplex; 220-240V) part number: RM2-1834-010CN
Fuser (duplex; 110-127V) part number: RM2-6460-010CN
Fuser (duplex; 220-240V) part number: RM2-6461-010CN
For instructions: See the Service Manual for this printer.
9. If the error persists, replace the low-voltage power assembly.
110v Low-voltage power supply part number: RM3-7241-000CN
220v Low-voltage power supply part number: RM3-7242-000CN
For instructions: See the Service Manual for this printer.

51.WX.YZ, 52.WX.YZ error messages

51.* errors

Errors in the 51.* family are related to the laser scanner.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Ensure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Check all connections on the laser/scanner and from the laser/scanner to the DC controller, and reseal them if necessary.
3. If the error persists, replace the laser scanner.

51.wx.00

An error with the laser/scanner assembly has occurred in the printer.

- **51.00.00** Beam detect or laser error
- **51.20.00** Black laser scanner error
- **51.21.00** Cyan laser scanner error
- **51.22.00** Magenta laser scanner error
- **51.23.00** Yellow laser scanner error
- **51.30.00** Beam detect or laser error

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Make sure that the printer is not plugged into any surge protectors or power strips. Plug the printer directly into a wall outlet.
3. Turn on the power and wait for the product to initialize.
4. If the error returns, check the wire harness from the laser/scanner to the DC controller.
 - a. Check the following connectors on engine controller PCA J110, J111, and J123.
 - b. Check the connectors on the laser/scanner J801 and J802.
 - c. If either cable is damaged, replace the cable.
J110/J801 cable part number: RM2-8662-000CN
J123/J802 cable part number: RM2-8663-000CN
5. If the error persists, replace the laser/scanner assembly.
Part number: RM2-5612-000CN
For instructions: See the Service Manual for this printer.
For instructions: See the Service Manual for this printer.

52.* errors

Errors in the 52.* family are related to the laser scanner.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.
For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Ensure the printer is running the most current version of firmware.
For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Check all connections on the laser/scanner and from the laser/scanner to the DC controller, and reseal them if necessary.
3. If the error persists, replace the laser scanner.

52.00.00

A printer laser/scanner motor error occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Make sure that the printer is not plugged into any surge protectors or power strips. Plug the printer directly into a wall outlet.
3. Turn on the power and wait for the product to initialize.
4. If the error returns, check the wire harness from the laser/scanner to the DC controller.
 - a. Check the following connectors on engine controller PCA J110, J111, and J123.
 - b. Check the connectors on the laser/scanner J801 and J802.
 - c. If either cable is damaged, replace the cable.

J110/J801 cable part number: RM2-8662-000CN
J123/J802 cable part number: RM2-8663-000CN
5. If the error persists, replace the laser/scanner assembly.

Part number: RM2-5612-000CN

For instructions: See the Service Manual for this printer.

53.WX.YZ error messages

53.17.00

Tray 2 lift error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the indicated tray and remove all the paper.
2. Close the tray and see if the error still persists.
3. Reload the paper tray making sure the tray guides are set correctly and the tray is not over loaded.
4. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open tray 2 and remove all the paper from the cassette.
2. Close the tray to see if it will lift successfully.
3. If the error persists, remove the tray 2 cassette and check the tray for any damage or defects that might keep it from lifting. If the tray is damaged, replace the cassette tray.

Cassette (Tray 2) assembly part number: RM2-6377-000CN

For instructions: See the Service Manual for this printer.

4. If the tray is not damaged and the error persists, replace the lifter drive assembly.

Lifter drive assembly part number: RM2-6370-000CN

For instructions: See the Service Manual for this printer.

53.18.00

Tray 3 lift error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the indicated tray and remove all the paper.
2. Close the tray and see if the error still persists.
3. Reload the paper tray making sure the tray guides are set correctly and the tray is not over loaded.
4. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open tray 3 and remove all the paper from the cassette.
2. Close the tray to see if it will lift successfully.
3. If the error persists, remove the tray 3 cassette and check the tray for any damage or defects that might keep it from lifting. If the tray is damaged, replace the cassette tray.

Cassette assembly (550-sheet feeder) part number: RM2-6486-000CN

For instructions: See the Service Manual for this printer.

4. If the tray is not damaged and the error persists, replace the lifter drive assembly.

Lifter drive assembly (550-sheet feeder) part number: RM2-6493-000CN

For instructions: See the Service Manual for this printer.

54.WX.YZ error messages

54.01.00

Environment sensor error

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure that the connector for the environment sensor on the engine controller J121 is correctly seated and not damaged.
3. Replace the environment sensor PCA assembly.

Part number: RM2-7236-000CN

For instructions: See the Service Manual for this printer.

54.06.00

Density sensor error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. From the [Printer Maintenance](#) menu run the [Full Calibration](#).
3. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.
2. From the [Printer Maintenance](#) menu run the [Full Calibration](#).

3. If the error persists, replace the density detect sensor assembly.

Sensor, density detect part number: RM2-7399-000CN

For instructions: See the Service Manual for this printer.

54.07.00 or 54.08.00 or 54.09.00 or 54.11.00

The printer experienced drum phase control sensor error.

- **54.07.00** - Yellow Drum Phase Control Sensor Error
- **54.08.00** - Magenta Drum Phase Control Sensor Error
- **54.09.00** - Cyan Drum Phase Control Sensor Error
- **54.10.00** - Black Drum Phase Control Sensor Error

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, replace the drum motor.

Part number: RM2-7342-000CN

For instructions: See the Service Manual for this printer.

54.11.yz or 54.12.yz

Density sensor out of range or density measurement abnormality.

- **54.11.00** or **54.12.00**– Black
- **54.11.01** or **54.12.01**– Cyan
- **54.11.02** or **54.12.02**– Magenta
- **54.11.03** or **54.12.03**– Yellow

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. From the **Printer Maintenance** menu run the **Full Calibration**.
3. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.
2. Check the supplies status page to ensure that the toner cartridges are not past their useful life.



NOTE: After an HP supply has reached the very low threshold, the HP premium protection warranty ends and the customer is responsible for replacing the part(s).

3. Check the Intermediate transfer belt (ITB) for damage and replace the Intermediate transfer belt (ITB) as needed.

ITB part number: RM2-6454-000CN or CF388-69009

For instructions: See the Service Manual for this printer.

4. From the [Printer Maintenance](#) menu run the [Full Calibration](#).
5. If the error persists, replace the density detect sensor assembly.

Sensor, density detect part number: RM2-7399-000CN

For instructions: See the Service Manual for this printer.

54.14.00

CPR sensor error

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. From the [Printer Maintenance](#) menu run the [Full Calibration](#).
3. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.
2. From the [Printer Maintenance](#) menu run the [Full Calibration](#).
3. If the error persists, replace the density detect sensor assembly.

Sensor, density detect part number: RM2-7399-000CN

For instructions: See the Service Manual for this printer.

54.15.yz

CPR Pattern Error.

- **54.15.01** – Cyan CPR pattern can't be read.
- **54.15.02** – Magenta CPR pattern can't be read.

- **54.15.03** – Yellow CPR pattern can't be read.
- **54.15.99** – Black CPR pattern can't be read.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. From the [Printer Maintenance](#) menu run the [Full Calibration](#).
3. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the power off, and then on.
2. Check the supplies status page to ensure that the toner cartridges are not past their useful life.



NOTE: After an HP supply has reached the very low threshold, the HP premium protection warranty ends and the customer is responsible for replacing the part(s).

3. Check the Intermediate transfer belt (ITB) for damage and replace the Intermediate transfer belt (ITB) as needed.

ITB part number: RM2-6454-000CN or CF388-69009

For instructions: See the Service Manual for this printer.

4. From the [Printer Maintenance](#) menu run the [Full Calibration](#).
5. If the error persists, replace the density detect sensor assembly.

Sensor, density detect part number: RM2-7399-000CN

For instructions: See the Service Manual for this printer.

54.wx.00

Toner level sensor error

- **54.15.00** – Yellow toner level sensor error.
- **54.16.00** – Magenta toner level sensor error.
- **54.17.00** – Cyan toner level sensor error.
- **54.18.00** – Black toner level sensor error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. If the error persists, and a surge protector is in use, perform the following:
 - a. Turn the printer off.
 - b. Remove the surge protector and plug the printer directly into the wall socket.
 - c. Turn the printer on.
4. If the error persists, reseal the density sensor connections on the DC Controller.
5. If the error persists, replace the density detect sensor assembly.
Sensor, density detect part number: RM2-7399-000CN
For instructions: See the Service Manual for this printer.
6. If the error persists, replace the printer.

54.19.00 or 54.25.00

TOP / Registration sensor failure

54.19.00 - Bad TOP Sensor

54.25.00 - TOP Sensor error

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Clean any toner dust and debris from the registration sensor and the surrounding areas using compressed air and/or a soft brush.
3. If the error persists, replace the registration assembly.
Registration assembly part number: RM2-6374-000CN
For instructions: See the Service Manual for this printer.

54.1C.00

Density sensor or CPR contamination warning

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. If the error persists, and a surge protector is in use, perform the following:
 - a. Turn the printer off.
 - b. Remove the surge protector and plug the printer directly into the wall socket.
 - c. Turn the printer on.
4. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. If the error persists, and a surge protector is in use, perform the following:
 - a. Turn the printer off.
 - b. Remove the surge protector and plug the printer directly into the wall socket.
 - c. Turn the printer on.
4. If the error persists, reseal the density sensor connections on the DC Controller.
5. If the error persists, replace the density detect sensor assembly.

Sensor, density detect part number: RM2-7399-000CN
For instructions: See the Service Manual for this printer.
6. If the error persists, replace the printer.

54.21.00

Laser/scanner beam detect error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error returns, check the wire harness from the laser/scanner to the DC controller.
 - a. Check the following connectors on DC controller J110, 111 and J123.
 - b. Check the connectors on the laser/scanner J801 and J802.
3. If the error persists, replace the laser/scanner assembly.

Part number: RM2-5612-000CN

For instructions: See the Service Manual for this printer.

55.WX.YZ error messages

55.* errors

Errors in the 55.* family often indicate a problem with the DC controller.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Reset the printer:
 - a. Turn the printer off using the power switch, and then wait at least 30 seconds.
 - b. Turn the printer on and wait for it to initialize.
2. Make sure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
3. If the error persists, replace the DC controller.

55.00.00, 55.01.00, 55.30.00 or 55.40.00

Engine communication or memory error.

- **55.00.00** Engine communication error.
- **55.01.00** DC Controller memory error.
- **55.30.00** Engine communication error.
- **55.40.00** Engine communication timeout error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. If the error persists, replace the Engine Controller PCB Assembly:
Engine controller PCA part number: RM3-7238-000CN
For instructions: See the Service Manual for this printer.

55.03.00

Engine or formatter communication error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If issue remains, perform a firmware upgrade.
3. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If issue remains, perform a firmware upgrade.
3. If the error persists, replace the DC controller PCA.
DC controller PCA part number: RM3-7238-000CN
For instructions: See the Service Manual for this printer.
4. If the error still persists, replace the formatter.
Formatter PCA, (M454nw) part number: W1Y43-67901
Formatter PCA, (M454nw) China only part number: W1Y43-67902
Formatter PCA, (M454dn) part number: W1Y44-67901
Formatter PCA, (M454dn) China only part number: W1Y44-67902
Formatter PCA (M454dw) part number: W1Y45-67901

Formatter PCA (M454dw-China only) part number: W1Y45-67902

Formatter PCA (M479dw) part number: W1A77-67901

Formatter PCA (M79dw-China only) part number: W1A77-67902

Formatter PCA (M479fnw) part number: W1A78-67901

Formatter PCA (M479fnw-China only) part number: W1A78-67902

Formatter PCA (M479fdw) part number: W1A80-67901

Formatter PCA (M479fdw-China only) part number: W1A80-67902

For instructions: See the Service Manual for this printer.

55.06.01, 55.06.02

DC controller NVRAM memory error.

- **55.06.01** - DC controller NVRAM data error
- **55.06.02** - DC controller NVRAM access error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. If the error persists, replace the Engine Controller PCB Assembly:

Engine controller PCA part number: RM3-7238-000CN

For instructions: See the Service Manual for this printer.

55.90.28

DC controller NVRAM restore.

Recommended action

Follow these troubleshooting steps in the order presented.

- No action necessary.

 **NOTE:** This is an information message only.

56.WX.YZ error messages

56.* errors

Errors in the 56.* family indicate a communication problem with an optional paper tray or other external accessory.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. If any third-party hardware is installed, remove it and try printing again.
3. If an optional paper tray is installed, remove it. Check the connectors on the tray for damage. If the connector is damaged, replace the tray.
4. Reinstall the tray, and make sure it is correctly seated.

56.01.00

The printer experienced an illegal input.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, then on.
2. Remove any third-party hardware and test again.

57.WX.YZ error messages

57.* errors

Errors in the 57.* family indicate a problem with a fan.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.

2. Press the Power button again to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Use the printer troubleshooting manual to identify the locations of each fan. Turn the printer off and then on, and listen for noise coming from the area of each fan. Replace any fan that is not making noise.
2. Update the firmware to the latest version. If the latest version firmware is already installed, reinstall it now.

For more information, see:

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. Remove enough parts to access the DC controller or the power supply PCA. Check the connections from each fan to the DC controller or power supply PCA. Reseat them if necessary.
4. With the DC controller or power supply PCA exposed, turn the printer on. Immediately measure the voltage between the connectors for each fan and the DC controller. If the voltage changes from 0V to approximately 24V during the power-on cycle, replace the affected fan. If the voltage remains at 0V, replace the DC controller.

57 . 01 . 00 Fan failure

Power supply fan FM1 failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, then on.
2. Disconnect and reconnect J205 on the driver PCA.
3. If the error persists, replace the power supply fan FM1.

Part number: RK2-6270-000CN

For instructions: See the Service Manual for this printer.

57.02.00 Fan failure

Cartridge fan FM2 error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Disconnect and reconnect J206 on the driver PCA.
3. If the error persists, replace the cartridge fan FM2..

Part number: RK2-6270-000CN

For instructions: See the Service Manual for this printer.

58.WX.YZ error messages

58.* errors

Errors in the 58.* family indicate an electrical problem inside the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Make sure the printer is connected to a dedicated power outlet and not to a surge protector or other type of extension cord.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Make sure the printer is connected to a dedicated power outlet and not to a surge protector or other type of extension cord.

3. Check all connections on the DC Controller and the power supply. Trace the connections from the DC Controller and power supply to the sensors and other components and reseal them if necessary.

58.04.00

AC/LVPS Power Failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues.

Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.



NOTE: This error might be caused by source power related issues.

Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

4. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.
5. Ensure the printer is plug into a dedicated power outlet.
6. Check the voltage label on the back of the product. If the product is rated 220V and is plugged into a 110V outlet, this error might occur. In most cases, no damage is caused to the product. If a power transformer is used to convert 220V power to 110V, verify that the transformer power rating is sufficient to operate the product.
7. If the error persists, replace the low-voltage power supply (LVPS).

Low-voltage power supply (110-127V) part number: RM3-7241-000CN
Low-voltage power supply (220-240V) part number: RM3-7242-000CN
For instructions: See the Service Manual for this printer.
8. If the error persists, replace the printer.

59.WX.YZ error messages

59.* errors

Errors in the 59.* family indicate a problem with one of the motors or with the lifter drive assembly for one of the trays.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Check all connections on the main control board of the printer, (DC controller, Engine control board ECB) each motor, and to the paper feeder drive PCA (for an optional paper feeder). Reseat them if necessary.

59.03.00 or 59.04.00 Fuser error

Fuser motor M4 start up error or fuser motor M4 rotational error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.

4. If the error persists, replace the fuser motor M4.

Fuser motor M4, part number: RM2-7349-000CN



NOTE: Before replacing the motor, the service technician should ensure that the fuser assembly is not damaged and causing the issue.

For instructions: See the Service Manual for this printer.

5. If the error persists after the motor has been replaced, replace the DC controller.

Engine controller PCA part number: RM3-7238-000CN

For instructions: See the Service Manual for this printer.

59.09.00 or 59.0A.00

Main motor error.

An ITB motor error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. If the error persists, replace the drum motor M2.

Drum motor part number: RM2-7342-000CN

For instructions: See the Service Manual for this printer.



IMPORTANT: If replacing the drum motor, please read the following:

Some replacement drum motor assemblies do not include a white gear or pin. The white gear and pin must be removed from the original drum motor assembly and installed on the replacement drum motor assembly.

For more information, go to WISE and search for the following document: HP Color LaserJet Pro M377, M452, M477 - Missing gear and pin on drum motor assembly (c05967223)

5. If the error persists after the motor has been replaced, replace the DC controller.

Engine controller PCA part number: RM3-7238-000CN

For instructions: See the Service Manual for this printer.

59.5x.00 or 59.6x.00

The printer experienced drum motor M2 error.

- **59.50.00** Image drum motor startup error - black.
- **59.51.00** Image drum motor startup error - cyan.
- **59.52.00** Image drum motor startup error - magenta.
- **59.53.00** Image drum motor startup error - yellow.
- **59.60.00** Image drum rotation startup error - black.
- **59.61.00** Image drum rotation startup error - cyan.
- **59.62.00** Image drum rotation startup error - magenta.
- **59.63.00** Image drum rotation startup error - yellow.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. Open the front cover and remove the indicated toner cartridge. Ensure the toner cartridge is an authentic HP supply. Inspect the toner cartridge for damage that might cause it not to rotate correctly. Replace the toner cartridge as needed.



NOTE: If the toner cartridge is damaged or if the drum in the cartridge does not rotate correctly it might cause this error

4. If the error persists, replace the drum motor assembly.

Drum motor part number: RM2-7342-000CN

For instructions: See the Service Manual for this printer.



IMPORTANT: If replacing the drum motor, please read the following:

Some replacement drum motor assemblies do not include a white gear or pin. The white gear and pin must be removed from the original drum motor assembly and installed on the replacement drum motor assembly. For more information about this issue, go to **WISE** and search for the following document: HP Color LaserJet Pro M377, M452, M477 - Missing gear and pin on drum motor assembly (c05967223).

59.7x.00 or 59.8x.00

The printer experienced a developer motor M3 error.

- **59.70.00** Black developer motor startup error.
- **59.71.00** Cyan developer motor startup error.
- **59.72.00** Magenta developer motor startup error.
- **59.73.00** Yellow developer motor startup error.
- **59.80.00** Black developer motor rotation error.
- **59.81.00** Cyan developer motor rotation error.
- **59.82.00** Magenta developer motor rotation error.
- **59.83.00** Yellow developer motor rotation error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, check whether original HP cartridges are used, and replace them accordingly.
3. If original HP cartridges are used, check for any cartridge low warning, and replace them accordingly.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize
3. If the error persists, check whether original HP cartridges are used, and advise the customer to replace them accordingly.
4. If original HP cartridges are used, check for any cartridge low warning, and advise the customer to replace them accordingly.
5. If the error persists, replace the developer motor assembly M3.

Developer motor M3 part number: RM2-7344-000CN



IMPORTANT: The service technician should check the connectors on the DC controller for the specific motor before replacing any parts. This is especially important if any previous parts have been replaced.

For instructions: See the Service Manual for this printer.

59.00.C0 or 59.00.F0

ITB alienation mechanism failure or developer motor issue.



NOTE: The M3 Developer motor uses switches for the contact/alienation of developer roller from the ITB also.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the power by using the power switch, and then wait at least 30 seconds.
2. Turn on the power and wait for the product to initialize.
3. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
4. If the error persists, replace the Intermediate transfer belt (ITB).

ITB part number: RM2-6454-000CN or CF388-69009

For instructions: See the Service Manual for this printer.

60.WX.YZ error messages

60.* errors

Errors in the 60.* family are related to one of the optional trays.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.



NOTE: You can determine the tray number from the last digit in the error number. For example:

- 60.00.02 or 60.01.02 = Tray 2
- 60.00.03 or 60.01.03 = Tray 3

1. Open the failing tray and remove all paper from the tray.
2. Close the tray to check if the error persists.
3. Reload the paper and test the printer.

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Use the [Tray/Bin Manual Sensor](#) test to verify that the sensors for each tray are functioning correctly.
2. Check all connectors on the paper feeder PCA.
3. Replace the optional paper feeder.

60.02.00

Tray 2 lift motor error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the indicated tray and remove all the paper.
2. Close the tray and see if the error still persists.
3. Reload the paper tray making sure the tray guides are set correctly and the tray is not over loaded.
4. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open tray 2 and remove all the paper from the cassette.
2. Close the tray to see if it will lift successfully.
3. If the error persists, remove the tray 2 cassette and check the tray for any damage or defects that might keep it from lifting. If the tray is damaged, replace the cassette tray.

Cassette (Tray 2) assembly part number: RM2-6377-000CN

For instructions: See the Service Manual for this printer.

4. If the tray is not damaged and the error persists, replace the lifter drive assembly.

Lifter drive assembly part number: RM2-6370-000CN

For instructions: See the Service Manual for this printer.

60.03.00

Tray 3 lift motor error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the indicated tray and remove all the paper.
2. Close the tray and see if the error still persists.
3. Reload the paper tray making sure the tray guides are set correctly and the tray is not over loaded.
4. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open tray 3 and remove all the paper from the cassette.
2. Close the tray to see if it will lift successfully.
3. If the error persists, remove the tray 3 cassette and check the tray for any damage or defects that might keep it from lifting. If the tray is damaged, replace the cassette tray.

Cassette assembly (550-sheet feeder) part number: RM2-6486-000CN

For instructions: See the Service Manual for this printer.

4. If the tray is not damaged and the error persists, replace the lifter drive assembly.

Lifter drive assembly (550-sheet feeder) part number: RM2-6493-000CN

For instructions: See the Service Manual for this printer.

7 Alphabetical control panel messages

Use the following alphabetical message to see further information on the message.

Alphabetical error messages

Canceling...<jobname>

The printer is canceling the current job <jobname>.

Recommended action

See recommended action.

- No action necessary.

Wrong cartridges in slot

The printer displays this message when 1 or more toner cartridges are installed in the wrong slot.

Recommended action

Follow these troubleshooting steps in the order presented.

- Reinstall the toner cartridges in the correct slots.

From front to back, the toner cartridges should be installed in this order:

- Black
- Cyan
- Magenta
- Yellow

<Color> cartridge low

The indicated toner cartridge is nearing the end of its useful life.

<Color> =

Black

Cyan

Magenta

Yellow

Recommended action

Follow these troubleshooting steps in the order presented.

- Printing can continue, but consider having a replacement supply on hand.

<Color> cartridge very low

The indicated toner cartridge is very low.

The indicated toner cartridge is at the end of its useful life. A customer configurable option on this product is "Low threshold" this can be set to the percentage for the very low message. This option is provided as a customer convenience and is not an indication these pages will have acceptable print quality.

<Color> =

Black

Cyan

Magenta

Yellow

Recommended action

Follow these troubleshooting steps in the order presented.

- To ensure optimal print quality, HP recommends replacing the toner cartridge at this point. You can continue printing until you notice a decrease in print quality. Actual cartridge life might vary.



NOTE: Once an HP supply has reached Very Low, HP's Premium Protection Warranty on that supply has ended. All print defects or cartridge failures incurred when an HP supply is used in Continue at very low mode will not be considered to be defects in materials or workmanship in the supply under the HP Print Cartridge Warranty Statement.

Cartridge Memory Error

Unable to read cartridge data from the indicated cartridges.

Recommended action

Follow these troubleshooting steps in the order presented.

- You can try to re-install the cartridge. If the problem still occurs, you have to replace the cartridge now.

Cartridge Memory Missing

Unable to read cartridge data from the indicated cartridges.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the front door and remove the toner cartridge causing the error.
2. Reinstall the toner cartridge.
3. Close the front door. If the message reappears, turn the printer off, and then on.

4. Verify if the cartridge is a genuine HP toner cartridge. To check the authenticity of your cartridges, go to hp.com/go/anticounterfeit and enter the serial number from the security label.



NOTE: This printer uses cartridges that have security chips or electronic circuitry. Cartridges using a non-HP chip or modified or non-HP circuitry may not work, and those that work today may not work in the future.

Non-HP Chips and modified or non-HP electronic circuitry are not produced or validated by HP. HP cannot guarantee that these chips or circuitry will work in your printer now or in the future. If you are using a non-original HP cartridge, please check with your supplier to ensure your cartridge has an original HP security chip or unmodified HP electronic circuitry.

5. If the error persists, and it is a genuine HP toner cartridge, contact HP customer care by phone for assistance in resolving the issue at: www.hp.com/go/contactHP.
6. If it is an aftermarket (non-hp) or re-manufactured toner cartridge, return the defective toner cartridge to the vendor where purchased.



NOTE: Service or repairs that are required as a result of using unsupported supplies is not covered under HP warranty.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: Do Not replace the engine control unit (ECU) or formatter for this issue. If the error persists after following the steps below, obtain the information requested in step 7, and then escalate the case to ATS.

1. Ensure the printer is turned on, and then open the front door to remove the toner cartridge that is in the error state.



NOTE: Toner cartridges that display a "10.0x11" or "**Supply Memory Error**" will continue to have this error if used in different printers.

Dispose or recycle the defective toner cartridge as these toner cartridges cannot be used in any printer.

2. Reinstall the toner cartridge.
3. Close the front door. If the message reappears, turn the printer off, and then on.
4. Verify if the cartridge is a genuine HP toner cartridge. To check the authenticity of the cartridges, go to hp.com/go/anticounterfeit or visit hp.com/go/ok and enter the serial number from the security label.

If authenticity cannot be verified, it might be a refilled or re-manufactured HP cartridge. Tell the customer to return the toner cartridge to the retailer or vendor where it was purchased and read the following statement:



NOTE: "This printer is enabled with dynamic security. It is intended to be used only with cartridges with an original HP chip. Cartridges using a non-HP chip might not work, and those that work today may not work in the future."

"Refilled or remanufactured supplies that still use an Original HP chip will continue to be accepted by the printer. If you are using a refilled or remanufactured cartridge and wish to continue to do so,

then you should check with your toner cartridge supplier as to whether or not the cartridge has an Original HP chip."

 **NOTE:** Service or repairs that are required as a result of using unsupported supplies is not covered under HP warranty.

5. If it is a genuine HP toner cartridge, replace the toner cartridge(s) in the error state with a new cartridge, and then close the cartridge door. Use the provided list to order the correct part number for the designated country/region when replacing the cartridge.

 **NOTE:** Do not replace all the four toner cartridges. Make sure to replace only the affected toner cartridge.

Table 7-1 Toner cartridge part details

Part Number	Description	Region
W2020A	HP 414A Black LaserJet Toner Cartridge	ROW
W2021A	HP 414A Cyan LaserJet Toner Cartridge	ROW
W2022A	HP 414A Yellow LaserJet Toner Cartridge	ROW
W2023A	HP 414A Magenta LaserJet Toner Cartridge	ROW
W2020X	HP 414X Black LaserJet Toner Cartridge	ROW
W2021X	HP 414X Cyan LaserJet Toner Cartridge	ROW
W2022X	HP 414X Yellow LaserJet Toner Cartridge	ROW
W2023X	HP 414X Magenta LaserJet Toner Cartridge	ROW
W2030A	HP 415A Black LaserJet Toner Cartridge	EMEA
W2031A	HP 415A Cyan LaserJet Toner Cartridge	EMEA
W2032A	HP 415A Yellow LaserJet Toner Cartridge	EMEA
W2033A	HP 415A Magenta LaserJet Toner Cartridge	EMEA
W2030X	HP 415X Black LaserJet Toner Cartridge	EMEA
W2031X	HP 415X Cyan LaserJet Toner Cartridge	EMEA
W2032X	HP 415X Yellow LaserJet Toner Cartridge	EMEA
W2033X	HP 415X Magenta LaserJet Toner Cartridge	EMEA
W2040A	HP 416A Black LaserJet Toner Cartridge	APJ

Table 7-1 Toner cartridge part details (continued)

Part Number	Description	Region
W2041A	HP 416A Cyan LaserJet Toner Cartridge	APJ
W2042A	HP 416A Yellow LaserJet Toner Cartridge	APJ
W2043A	HP 416A Magenta LaserJet Toner Cartridge	APJ
W2040X	HP 416X Black LaserJet Toner Cartridge	APJ
W2041X	HP 416X Cyan LaserJet Toner Cartridge	APJ
W2042X	HP 416X Yellow LaserJet Toner Cartridge	APJ
W2043X	HP 416X Magenta LaserJet Toner Cartridge	APJ

6. Download the following firmware version for your printer model from [HP Support](#): 002.2118A
7. Wait for the firmware update to complete, and then print a Configuration Page.
8. On the Configuration Page, make sure that the firmware version installed is **002.2118A**.
9. Attempt to print and check if the issue persists.
10. If the issue persists, collect the following information and note it in a CDAX case:
 - a. Type "Supply memory error:10.0x.11" in the case subject.
 - b. Enter the error code and message displayed on the printer control panel.
 - c. Obtain pictures of the cartridge and with the electrical contact. Attach the pictures in the CDAX case.
 - d. Check for defect on the electrical contact of the toner and printer.
 - e. Check whether the toner used is an HP genuine toner.
 - f. Ask the customer to provide answers to the following questions:
 - i. When did the issue begin/start, OOB? While printing or when idle?
 - ii. Was there any preceding error or defect prior to this issue?
 - iii. Were there any parts replaced or software updates prior to this error?
 - iv. Was the cartridge used in multiple printers?
 - v. Did this issue happen on set-up cartridge or after market cartridge (trade)?
11. Ensure the information in the CDAX case is valid, and then elevate the case to elevate the case using your Standard Support Process.

Cooling device

The printer is cooling.

Recommended action

See recommended action.

- No action necessary.

Checking engine

The printer is conducting an internal test.

Recommended action

See recommended action.

- No action necessary.

Checking paper path

The printer is checking for possible paper jams.

Recommended action

See recommended action.

- No action necessary.

Cleaning

The printer is performing an automatic cleaning cycle. Printing will continue after the cleaning is complete.

Recommended action

See recommended action.

- No action necessary.

Close the cartridge access door

The front cartridge access door is open.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Close the front cartridge access door.
2. If the error persists with the door closed, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Close the front cartridge access door.

2. Check the flat projection part on the top left on the inside of the door. If it is damaged, replace the front door assembly.

Figure 7-1 Check front door flag



Front (cartridge) door assembly (SFP) part number: RM2-1823-000CN

Front (cartridge) door assembly (MFP) part number: RM2-1824-000CN

3. If the problem persists, replace the front door switch SW7.

Door open switch (SW7, SW501) part number: RK2-0534-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Close the front cartridge access door.
2. Check the flat projection part on the top left on the inside of the door. If it is damaged, replace the front door assembly.

Figure 7-2 Check front door flag



Front (cartridge) door assembly (SFP) part number: RM2-1823-000CN

Front (cartridge) door assembly (MFP) part number: RM2-1824-000CN

For instructions: See the Service Manual for this printer.

3. Check the connection for switch SW7 Front door switch (micro-switch) on the DC controller PCA J211.
4. If the problem persists, replace the front door switch SW7.
Door open switch (SW7, SW501) part number: RK2-0534-000CN
For instructions: See the Service Manual for this printer.

Data received To print last page press “OK”

The printer is waiting for the command to print the last page.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the “OK” button on the control panel to print the last page of the job.

Device error. Press [OK] to continue

Paper has been delayed as it moves through the product.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Press the OK button to clear the message.
2. To avoid this problem, try the following solutions:
 - Adjust the paper guides in the tray. Ensure the front paper guide is pushing the paper against the back edge of the tray.
 - Use paper that meets HP specifications. Store paper unopened in its original packaging.
 - Use the product in an area that meets the environmental specifications for this product.

Device is busy. Tray again later

The product is currently in use.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Wait for the product to finish the current job, or to finish initializing.
2. Turn the product off, then on, to see whether it comes to a Ready state.
3. Restore the device to the factory default settings. (Setup Menu -> Service Menu -> Restore Defaults)
4. If the issue persists, upgrade to the latest firmware.

Document feeder jam. Clear and reload

Paper is jammed in the document feeder tray or a sensor has incorrectly detected media in the document feeder paper path.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the document feeder lid, pull the sheets back into the input tray, and then resume the job.
2. Check the paper guides and make sure that they are set to the correct paper width.
3. Make sure that the input tray is not overloaded and the tray guides are correctly aligned to both edges of the paper.
4. Verify that the paper meets the printer specifications.
5. Verify there are no staples or paper clips on the stack of originals. Verify the originals are straightened out from previous folds or curl.
6. Clean the document feeder pick and feed rollers with a damp lint free cloth.
7. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the document feeder lid, pull the sheets back into the input tray, and then resume the job.
2. Check the paper guides and make sure that they are set to the correct paper width.
3. Make sure that the input tray is not overloaded and the tray guides are correctly aligned to both edges of the paper.
4. Verify that the paper meets the printer specifications.
5. Clean the document feeder pick and feed rollers with a damp lint free cloth.
6. If the error persists, replace the document feeder top cover assembly or the integrated scanning assembly.

Integrated scanner assembly (M479) (simplex) part number: W1A73-60111

Integrated scanner assembly (M479) (duplex) part number: W1A73-60110

For instructions: See the Service Manual for this printer.

Document feeder top cover part number: W1A77-67903

Document feeder miss-pick. reload

Document feeder did not pick the paper from the tray correctly.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the document feeder lid, pull the sheets back into the input tray, and then resume the job.
2. Check the paper guides and make sure that they are set to the correct paper width.
3. Make sure that the input tray is not overloaded and the tray guides are correctly aligned to both edges of the paper.
4. Verify that the paper meets the printer specifications.
5. Verify there are no staples or paper clips on the stack of originals. Verify the originals are straightened out from previous folds or curl.
6. Clean the document feeder pick and feed rollers with a damp lint free cloth.
7. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the document feeder lid, pull the sheets back into the input tray, and then resume the job.
2. Check the paper guides and make sure that they are set to the correct paper width.
3. Make sure that the input tray is not overloaded and the tray guides are correctly aligned to both edges of the paper.
4. Verify that the paper meets the printer specifications.
5. Clean the document feeder pick and feed rollers with a damp lint free cloth.
6. If the error persists, replace the document feeder top cover assembly or the integrated scanning assembly.

Integrated scanner assembly (M479) (simplex) part number: W1A73-60111

Integrated scanner assembly (M479) (duplex) part number: W1A73-60110

For instructions: See the Service Manual for this printer.

Document feeder top cover part number: W1A77-67903

Fax is busy. Canceled send

The fax line to which you were sending a fax was busy. The product has canceled sending the fax.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Call the recipient to ensure that the fax machine is on and ready.
2. Verify that the fax number is correct.
3. Verify that the [Redial if Busy](#) option is enabled.
4. Open the [Support](#) menu, and then touch the [Fax Diagnostics](#) menu. Touch the [Run Fax Test](#) button.



NOTE: This test verifies that the phone cord is connected to the correct port and that the phone line has a signal. The product prints a report with the results.

5. For additional fax sending/receiving troubleshooting go to this document.

[HP LaserJet Pro MFP - Solve problems sending or receiving faxes \(includes fax error messages and event log codes\)](#)

Fax line surge

The product experienced current on the fax line over 125 mA for more than 15 seconds.

Recommended action

Follow these troubleshooting steps in the order presented.

- Increase the default surge value of 125 mA to 145 mA:
 - a. Open the [Service](#) menu.
 - b. Select [System Configuration](#) menu.
 - c. Key in the number 141 and press [OK](#).
 - d. Change the default value of 178 to 186 and press [OK](#).
 - e. Turn the printer off, and then on to make the change effective.

Fax receive error

An error occurred while trying to receive a fax.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Ask the sender to resend the fax.
2. To verify that the telephone cord is securely connected, disconnect and reconnect the telephone cord.
3. Verify that you are using the telephone cord that came with the product.
4. Open the [Support](#) menu, and then touch the [Fax Diagnostics](#) menu. Touch the [Run Fax Test](#) button.



NOTE: This test verifies that the phone cord is connected to the correct port and that the phone line has a signal. The product prints a report with the results.

5. Decrease the fax speed. Ask the sender to resend the fax.
6. Turn off error-correction mode. Ask the sender to resend the fax.



NOTE: Turning off error-correction mode might reduce the quality of the fax image.

7. Connect the product to a different phone line.
8. For additional fax sending/receiving troubleshooting go to this document.

[HP LaserJet Pro MFP - Solve problems sending or receiving faxes \(includes fax error messages and event log codes\)](#)

Fax send error

An error occurred while trying to send a fax.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Resend the fax.
2. Try faxing to another fax number.
3. To verify that the telephone cord is securely connected, disconnect and reconnect the telephone cord. Check that the telephone cord is securely connected by unplugging and replugging the cord.
4. Verify that you are using the telephone cord that came with the product.
5. Open the [Support](#) menu, and then touch the [Fax Diagnostics](#) menu. Touch the [Run Fax Test](#) button.



NOTE: This test verifies that the phone cord is connected to the correct port and that the phone line has a signal. The product prints a report with the results.

6. Connect the product to a different phone line.
7. Set the fax resolution to [Standard](#) instead of the default of [Fine](#).
8. For additional fax sending/receiving troubleshooting go to this document.

[HP LaserJet Pro MFP - Solve problems sending or receiving faxes \(includes fax error messages and event log codes\)](#)

Fax storage is full. Canceling the fax send/receive.

The amount of available memory for storing faxes is insufficient to store an incoming fax.

Recommended action

Follow these troubleshooting steps in the order presented.

1. If you are using the [Private Receive](#) feature, print all received faxes to regain some memory.
2. If the issue persists, clear faxes from memory:

Genuine HP cartridge installed

A new genuine HP toner cartridge has been installed. The message appears for about 6 seconds before the printer returns to the READY state.

Recommended action

See recommended action.

- No action necessary.

Genuine HP supply installed

A new genuine HP supply has been installed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the [Hide](#) button to remove this message.

Incompatible supplies

Print cartridges or other supply items are installed that were not designed for this printer. The printer cannot print with these supplies installed.

Event codes are supply specific.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the [OK](#) button to identify the incompatible supplies.
Replace the supplies with those that are designed for this printer.

Incompatible <Supply>

The indicated supply is not compatible with this printer.

- **10.00.35:** (event code) Black toner cartridge
- **10.23.35:** (event code) Fuser kit

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the supply with one that is designed for this printer.

Initializing...

The printer is starting.

Recommended action

See recommended action.

- No action necessary.

Insert or close Tray <X> to continue.

A paper tray is open causing a blocked paper path.

Recommended action

Follow these troubleshooting steps in the order presented.

- Insert or close Tray <X> to continue.

Install <color> cartridge

The indicated toner cartridge is missing or not seated correctly.

<Color> =

Black

Cyan

Magenta

Yellow

Recommended action

Follow these troubleshooting steps in the order presented.

1. If the toner cartridge is missing, install a new toner cartridge.
2. If the toner cartridge is installed, remove and reinstall the toner cartridge.

Jam in output bin. Open rear door and clear jam.

A paper jam occurred in the output bin area of the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Follow the instructions on the control panel to clear the jammed paper.
2. Open the rear door and look for and clear any paper present or obstructions in the paper path.

Figure 7-3 Open rear cover



3. Close the rear door to allow the printer to attempt to clear the jam message.
4. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
5. Ensure the printer is located in an area meets the environmental specifications for the printer.
6. Adjust the paper guides in the tray. Ensure the front paper guide is pushing the paper against the back edge of the tray.
7. If the error persists, please contact HP customer support.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Follow the instructions on the control panel to clear the jammed paper.
2. Open the rear door and look for and clear any paper present or obstructions in the paper path.
3. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
4. Ensure the printer is located in an area meets the environmental specifications for the printer.
5. Adjust the paper guides in the tray. Ensure the front paper guide is pushing the paper against the back edge of the tray.
6. Remove the fuser and inspect the fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.

Fuser (simplex; 110-127V) part number: RM2-1833-010CN

Fuser (simplex; 220-240V) part number: RM2-1834-010CN

Fuser (duplex; 110-127V) part number: RM2-6460-010CN

Fuser (duplex; 220-240V) part number: RM2-6461-010CN

For instructions: See the Service Manual for this printer.

Jam in Tray 1. Clear the jam, and then press "OK".

A paper jam occurred while printing from tray 1.


Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Remove all paper from tray 1.

- b. Open the front cover and clear any paper found.

Figure 7-4 Check inside front cover

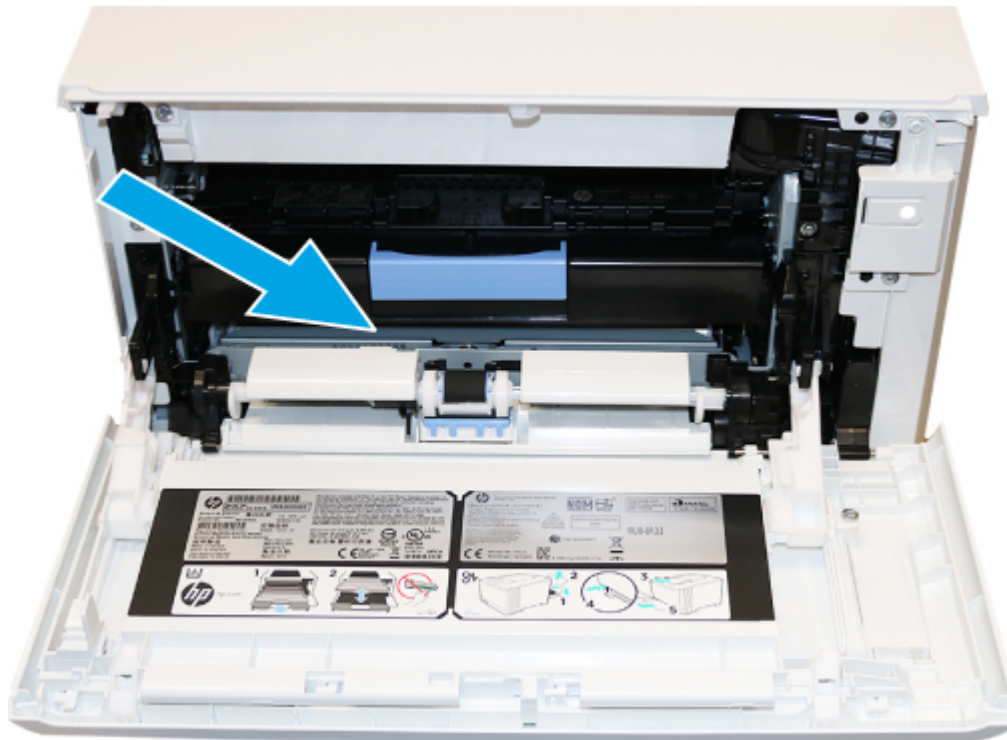


- c. close the front cover and remove tray 2.

Figure 7-5 Remove tray 2



- d. Open the jam access area inside the tray 2 opening. Press the green button on the right side to drop open the access area.


Figure 7-6 Open jam access

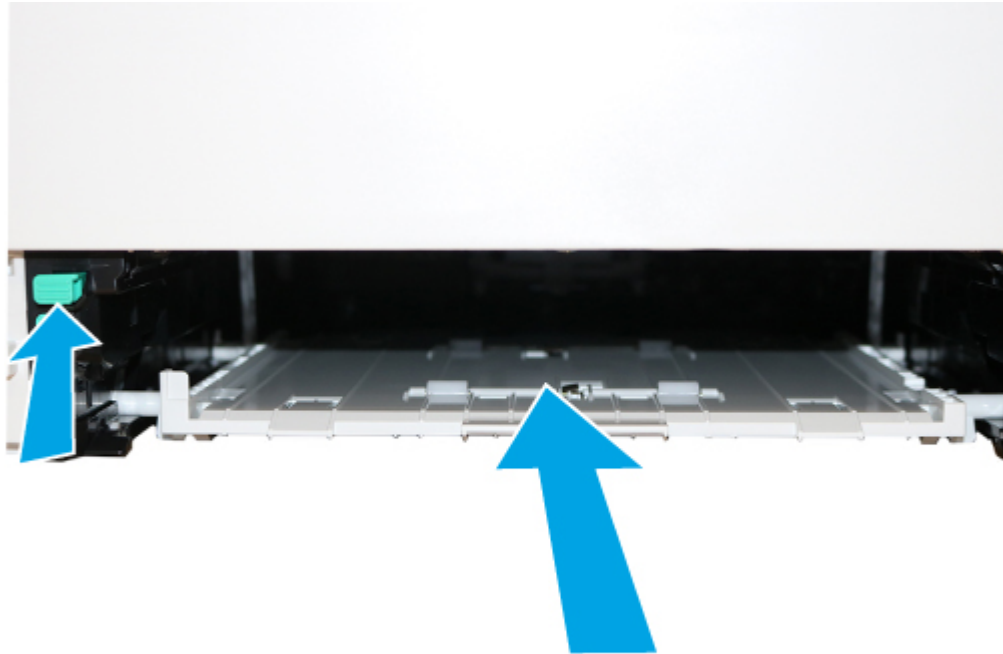

- e. Look for and clear any paper present or obstructions in the paper path.
 - f. Raise the access plate up to the closed position and reinstall tray 2.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.

3. Ensure that the tray 1 width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 7-7 Check guides

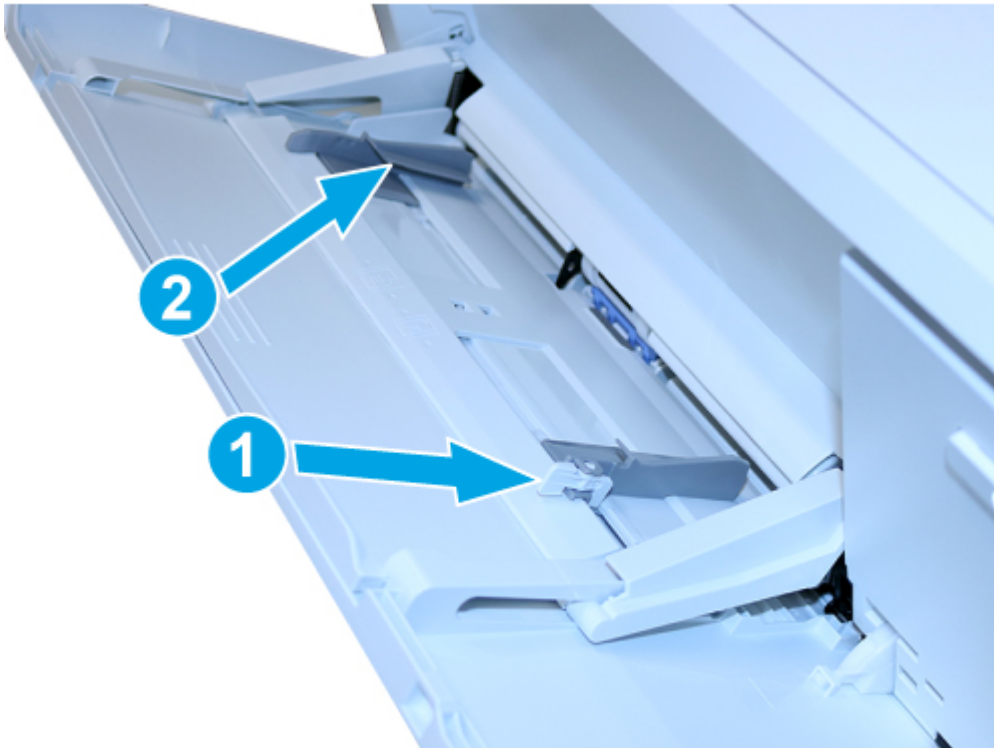

Call-out 1 – Tray adjustment

Call-out 2 – Height guide

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Jam in Tray 2. Clear the jam, and then press "OK".

A paper jam occurred when printing from tray 2.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open tray 2 and remove any jammed paper.

- b. Open the rear door and look for and clear any paper present or obstructions in the paper path.

Figure 7-8 Open rear cover




Figure 7-9 Clear Jam



- c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.

3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab (line below 3 triangles). See following images.

Figure 7-10 Tray 2 paper guides

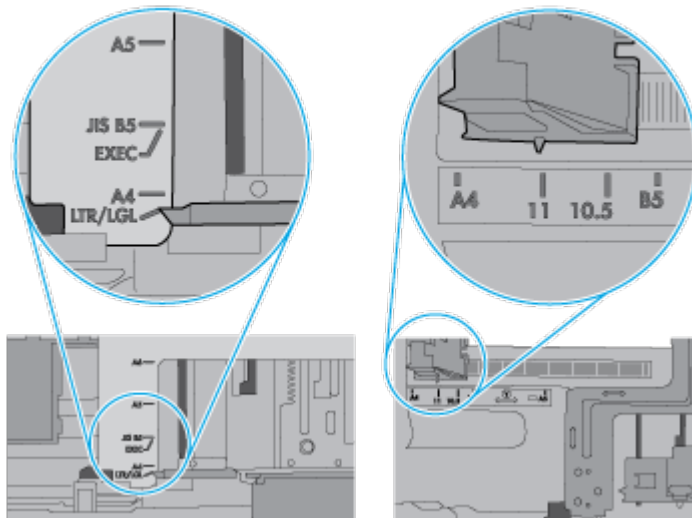

4. If the error persists, please contact HP customer support.

Jam in Tray 3. Clear the jam, and then press "OK".

Paper jam while printing from tray 3.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the rear door and look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.

3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 7-11 Paper tray guides


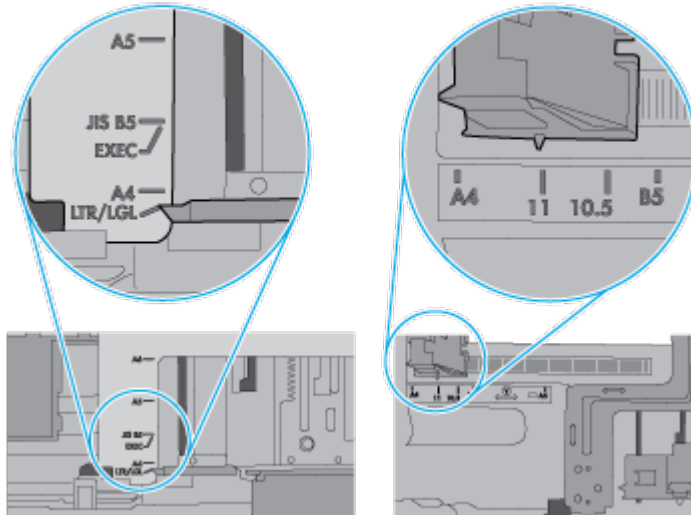


Figure 7-12 Paper height guides

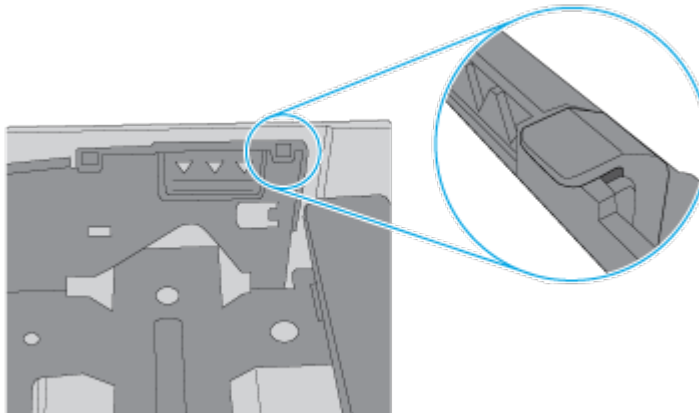

4. If the error persists, contact customer support at www.hp.com/go/contactHP, or contact an HP-authorized service or support provider.

Jam in print paper path. Open rear door and clear jam.

A paper jam occurred in the rear door/fuser area.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.

- a. Open the rear door and look for and clear any paper present or obstructions in the paper path.

Figure 7-13 Open rear cover



Figure 7-14 Clear Jam



- b. Close the rear door to allow the printer to attempt to clear the jam message.
2. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
3. Make sure the printer is located in an area meets the environmental specifications for the printer.
4. Adjust the paper guides in the tray. Ensure the front paper guide is pushing the paper against the back edge of the tray.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Load Tray <X>: [Type], [Size] To use another tray, press “OK”

This message displays when the indicated tray is selected, but is not loaded, and other paper trays are available for use.

It also displays when the tray is configured for a different paper type or size than the print job requires.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Load the correct paper in the tray.
2. If prompted, confirm the size and type of paper loaded.
3. Otherwise, press the **OK** button to select another tray.

Manually feed output stack Then touch "OK" to print second side

The printer has printed the first side of a manual duplex job and is waiting for you (or the applicable user) to insert the output stack to print the second side.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Maintaining the same orientation, remove the pages from the output bin.
2. Flip the document printed side up.
3. Load the document in Tray 1.
4. Touch the **OK** button to print the second side of the job.

Manually feed: <Type><Size>

This message appears when manual feed is selected, Tray 1 is not loaded, and other trays are empty.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Load the tray with requested paper.
2. If the paper is already in the tray, press the **Help** button to exit the message and then press the **OK** button to print.
3. To use another tray, clear paper from Tray 1, press the **Help** button to exit the message and then press the **OK** button.

Misprint. Press [OK] to continue.

Paper has been delayed as it moves through the printer.

Recommended action

Use the following steps to resolve the error.

1. Press the **OK** button to clear the message.
2. To avoid this problem, try the following solutions:
 - a. Adjust the paper guides in the tray. Make sure the front paper guide is pushing the paper against the back edge of the tray.
 - b. Make sure the type and quality of the paper being used meets the HP specifications for the printer. Store paper unopened in its original packaging.
 - c. Make sure to use the printer in an area that meets the environmental specifications for this printer.

No Dial tone

The product could not detect a dial tone.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Check for a dial tone on the phone line by touching the [Start Fax](#) button.
2. Unplug the telephone cord from both the product and the wall. Reconnect the cord at both ends ensuring you are using the FAX port on the back of the printer. Looking at the back of the printer, the FAX port is towards the middle. DO NOT connect the fax line to the port with the telephone icon.
3. Verify that you are using the telephone cord that came with the product.
4. Open the [Support](#) menu, and then touch the [Fax Diagnostics](#) menu. Touch the [Run Fax Test](#) button.



NOTE: This test verifies that the phone cord is connected to the correct port and that the phone line has a signal. The product prints a report with the results.

5. For additional fax sending/receiving troubleshooting go to this document.

[HP LaserJet Pro MFP - Solve problems sending or receiving faxes \(includes fax error messages and event log codes\)](#)

No Fax detected

The product answered the incoming call but did not detect that a fax machine was calling.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Open the [Support](#) menu, and then touch the [Fax Diagnostics](#) menu. Touch the [Run Fax Test](#) button.



NOTE: This test verifies that the phone cord is connected to the correct port and that the phone line has a signal. The product prints a report with the results.

2. For additional fax sending/receiving troubleshooting go to this document.

[HP LaserJet Pro MFP - Solve problems sending or receiving faxes \(includes fax error messages and event log codes\)](#)

3. If the error persists, replace the Fax PCA.

Fax PCA (M479; US) part number: W1A78-67906

Fax PCA (M479; Europe) part number: W1A78-67907

Fax PCA (M479; Brazil) part number: W1A78-67908

Fax PCA (M479; Philippines/AP) part number: W1A78-67909

No job to cancel

You have pressed the stop button but the printer is not actively processing any jobs.

Recommended action

See recommended action.

- No action necessary.

NON HP Supply Installed

This message is displayed for about 6 seconds when a new non-HP supply is installed.

10.99.31 (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

1. Use a genuine HP supply for the printer.
2. If you believe a genuine HP supply is being used, go to www.hp.com/go/anticounterfeit.

Printer out of memory, job too big

Printer out of memory, job too big.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to print the transferred data. Some data might be lost.
2. Reduce the page complexity or add printer memory.

Output Bin Full

This message displays when the output bin is full and paper must be removed before printing can continue.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Remove the paper from the output bin.
2. If the message persists and the tray is empty, please contact customer support at: www.hp.com/go/contactHP.

Recommended action

Use the following to resolve the issue.

1. Remove the paper from the output bin.
2. If this message appears even though the output bin is not full.
 - Make sure that the output bin sensor flag is not damaged and can move freely. If the flag is damaged, replace the fuser/output assembly.

Fuser (simplex; 110-127V) part number: RM2-6431-000CN

Fuser (simplex; 220-240V) part number: RM2-1834-000CN

Fuser (duplex; 110-127V) part number: RM2-6460-010CN

Fuser (duplex; 220-240V) part number: RM2-6461-010CN

For instructions: See the Service Manual for this printer.

For instructions: See the Service Manual for this printer.

Paused...

The printer is paused, and there are no error messages pending at the display. The I/O continues receiving data until the memory is full.

Recommended action

Follow these troubleshooting steps in the order presented.

- Press the [Stop](#) button.

Printing Configuration...

The printer is printing the Configuration page.

Recommended action

See recommended action.

- No action necessary.

Printing engine test...

The printer is printing an engine test page.

Recommended action

See recommended action.

- No action necessary.

Printing Event Log...

The printer is printing the Event Log page.

Recommended action

See recommended action.

- No action necessary.

Printing File Directory...

The printer is printing the File Directory pages.

Recommended action

See recommended action.

- No action necessary.

Printing Font List...

The printer is printing the Font List pages.

Recommended action

See recommended action.

- No action necessary.

Printing Help Page...

The printer is printing the Help page.

Recommended action

See recommended action.

- No action necessary.

Printing Menu Map...

The printer is printing the Menu Map pages.

Recommended action

See recommended action.

- No action necessary.

Printing Supplies Status Page...

The printer is printing the Supplies Status page.

Recommended action

See recommended action.

- No action necessary.

Printing Usage Page...

The printer is printing the Usage page.

Recommended action

See recommended action.

- No action necessary.

Power Failure Recovery

Recovering from power failure. Please wait.

Recommended action

There is no action needed for this message.

- No action necessary.

Power supply malfunction.

Power supply malfunction. Restart the printer.

Recommended action

Follow these troubleshooting steps in the order presented.

- Turn the printer on to restart it.

Protected <COLOR> cartridge

A previously protected cartridge was installed in a printer other than the one that initiated the cartridge protection.

The indicated cartridges can only be used in the printer or fleet of printers that initially protected the cartridges using the HP Cartridge Protection feature.

Recommended action

Follow these troubleshooting steps in the order presented.

- Please check the printer and replace the cartridge.



NOTE: The indicated cartridges can only be used in the printer or fleet of printers that initially protected the cartridges using the HP Cartridge Protection feature. These cartridges are not usable in this printer and must be replaced.

The HP Cartridge Protection feature allows a printer or fleet owner to restrict usage of a cartridge to their printer or fleet of printers. If you believe you purchased Genuine HP cartridges, visit us at: www.hp.com/go/anticounterfeit for more information or to report fraud.

Ready

The printer is online and ready for data. No status or printer attendance messages are pending at the display.

Recommended action

See recommended action.

- No action necessary.

Ready <IP Address>

The printer is online and ready for data. No status or printer attendance messages are pending at the display. The printer IP address displays.

Recommended action

See recommended action.

- No action necessary.

Rear door open

The rear door of the printer is open.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Close the rear door of the printer.
2. If the message persists with the rear door completely closed, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Close the rear door.
2. If the message persists, check the rear door sensor flag.

Figure 7-15 Check flag



3. If the flag is damaged or broken, replace the rear door.
Door, rear (simplex models) part number: RM2-1825-000CN
Duplex door assembly part number: RM2-6383-000CN

Replace Supplies

This alert displays only if the printer is configured to stop when a supply reaches the very low threshold. The printer indicates when a supply level is at its estimated end of life. The actual life remaining might be different than estimated.

The supply does not need to be replaced now unless the print quality is no longer acceptable.



NOTE: HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

The printer can be configured to stop when the supply level is very low. The supply might still be able to produce acceptable print quality.

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the specified supply.

Or, configure the printer to continue printing using the [Manage Supplies](#) menu on the printer control panel.

Restore Factory Settings

The printer is restoring factory settings.

Recommended action

See recommended action.

- No action necessary.

Supplies low

Multiple supplies on the printer have reached the low threshold.

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the supply when print quality is no longer acceptable.

Supply memory warning

The printer cannot read or write to the e-label or the e-label is missing.

Recommended action

See recommended action.

- No action necessary.

Tray <X> empty: [Type], [Size]

The specified tray is empty and the current job does not need this tray to print.

- X = 1: Tray 1
- X = 2: Tray 2
- X = 3: Tray 3
- X = 4: Tray 4
- X = 5: Tray 5

Recommended action

Follow these troubleshooting steps in the order presented.

- Refill the tray at a convenient time.



NOTE: This could be a false message. If the tray is loaded without removing the shipping lock, the printer does not sense that the paper is loaded. Remove the shipping lock, and then load the tray.

Tray <X> lifting error

Tray "X" has experienced a tray lifting error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the indicated tray and check the paper guides.
2. Ensure the paper is correctly install in the paper tray and that the tray is not over-filled.
3. If the message persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the indicated tray and check the paper guides.
2. Ensure the paper is correctly install in the paper tray and that the tray is not over-filled.
3. If the error persists, check the event log for the following errors: 53.16.00, 53.17.00, 53.18.00, or 60.02.00, 60.03.00. Use these error codes to further troubleshoot the error message.

Tray <X> Overfilled

Too much paper has been loaded in Tray <X>

Recommended action

Follow these troubleshooting steps in the order presented.

- Open the tray and make sure the paper is below the paper stack tab or line shown on the tray.

Type mismatch Tray <x>

The specified tray contains a paper type that does not match the configured type.

Recommended action

Follow these troubleshooting steps in the order presented.

The specified tray will not be used until this condition is addressed. Printing can continue from other trays.

1. Load the correct paper in the specified tray.
2. On the printer control panel, make sure the paper type loaded in the tray matches the specified setting for the tray.

Used or Counterfeit in Use

A used cartridge has been installed.

Recommended action

Follow these troubleshooting steps in the order presented.

- A used cartridge has been installed. If you believe you purchased a genuine HP cartridge, visit us at <http://www.hp.com/go/anticounterfeit>.

Any printer repair required as a result of using used supplies is not covered under warranty. Supply status and features depending on supply status will not be available. Press "OK" to continue.

Used supply installed To continue, touch "OK" OR Used supply in use

The toner cartridges or supplies has been previously used.

Recommended action

Follow these troubleshooting steps in the order presented.

- If you believe a genuine HP supply is being used, go to www.hp.com/go/anticounterfeit.

Waiting for tray <x> to lift

The specified tray is in the process of lifting paper to the top of the tray (so it can correctly feed).

Recommended action

See recommended action.

- No action necessary.

Index

Symbols/Numerics

10.20.43 31
10.21.43 31
10.22.43 31
10.23.43 31
76.00.24 5

B

backup error
 32.WX.YZ error 4
 reset error 4
 restore error 4

C

connector error
 65.WX.YZ error 5

D

DC controller communication error
 55.WX.YZ error 4
DC controller firmware error
 70.WX.YZ error 5
digital sending error (firmware)
 44.WX.YZ error 4
document feeder error
 31.WX.YZ error 4
Drive partition error
 98.WX.YZ error 5
duplexer error
 69.WX.YZ error 5

E

Embedded Jetdirect error
 80.WX.YZ error 5
engine error (LaserJet)
 46.WX.YZ error 4
 63.WX.YZ error 5
engine error (PageWide)
 61.WX.YZ error 4
error message 31
Event code error 31
event log error (firmware)
 42.WX.YZ error 4

F

fan error
 58.WX.YZ error 4
firmware communication error
 49.WX.YZ error 4
firmware install error
 99.WX.YZ error 5
 Drive error 5
 remote firmware upgrade
 error 5
fuser error
 41.WX.YZ error 4
 laser scanner error 4
 paper path error 4
fuser error (LaserJet)
 50.WX.YZ error 4

I

Incompatible Cartridges 31
input accessory error
 67.WX.YZ error 5
input/output error
 40.WX.YZ error 4
internal diagnostics error
 90.WX.YZ error 5
 video display error 5

J

jam error (LaserJet)
 13.WX.YZ error 3
jam error (PageWide)
 13.WX.YZ error 4
job accounting error (firmware)
 48.WX.YZ error 4
job management error
 (firmware) 4
job pipeline error (firmware) 4
job parser error (firmware)
 47.WX.YZ error 4
printer calibration error 4

L

laser scanner error (LaserJet)
 51.WX.YZ error 4
 52.WX.YZ error 4
last update 1

M

memory error
 82.WX.YZ error 5
 Drive error 5
 EMMC error 5
 SSD error 5
motor error (LaserJet)
 59.WX.YZ error 4

N

Near Field Communication error
 81.WX.YZ error 5
 Bluetooth error 5
 external I/O card error 5
 internal EIO error 5
 wireless error 5

O

output accessory error
 66.WX.YZ error 5
OXPd/Web kit error
 45.WX.YZ error 4

P

page error
 21.WX.YZ error 4
paper handling error (LaserJet)
 56.WX.YZ error 4
print bar error (PageWide)
 62.WX.YZ error 5
printer memory error
 20.WX.YZ error 4

R

real-time clock error
 11.WX.YZ error 3

S

scanner error
 30.WX.YZ error 4
security error
 33.WX.YZ error 4
sensor error
 54.WX.YZ error 4
 58.WX.YZ error 4

supplies error (LaserJet)
10.WX.YZ error 3
supplies error (PageWide)
17.WX.YZ error 4
system error (LaserJet)
62.WX.YZ error 5

T

tray motor error (LaserJet)
60.WX.YZ error 4