



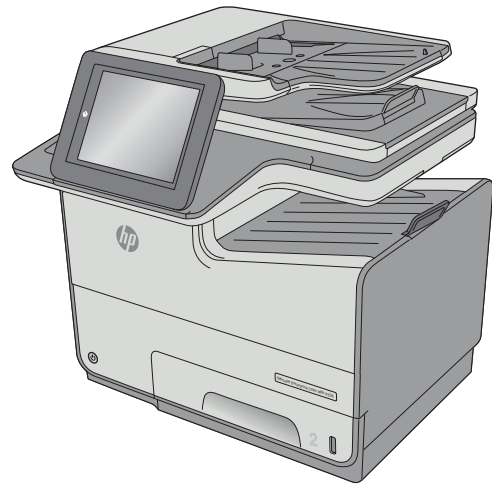

HP PageWide Enterprise Color 556

HP PageWide Enterprise Color MFP 586

Control Panel Message Document (CPMD)

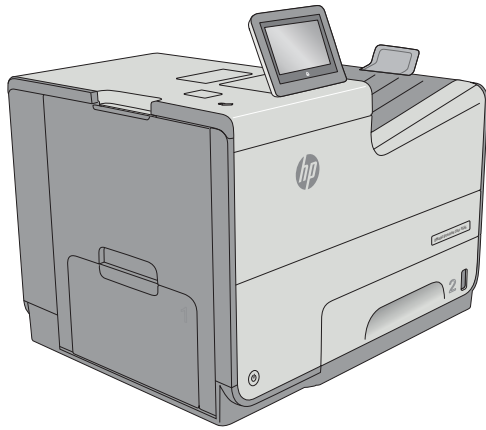

www.hp.com/support/pagewidecolor556
www.hp.com/support/pagewidecolor586MFP



HP PageWide Enterprise, Color 556, MFP 586, Managed Color MFP 58650 - Control Panel Message Document (CPMD)

SUMMARY

This document provides error-code troubleshooting information

Legal information

Copyright and License

© Copyright 2022 HP Development Company, L.P.

Reproduction, adaptation, or translation without prior written permission is prohibited, except as allowed under the copyright laws.

The information contained herein is subject to change without notice.

The only warranties for HP products and services are set forth in the express warranty statements accompanying such products and services. Nothing herein should be construed as constituting an additional warranty. HP shall not be liable for technical or editorial errors or omissions contained herein.

Edition 1.4, 9/2022

Trademark Credits

Adobe®, Adobe Photoshop®, Acrobat®, and PostScript® are trademarks of Adobe Systems Incorporated.

Apple and the Apple logo are trademarks of Apple Inc., registered in the U.S. and other countries.

macOS is a trademark of Apple Inc., registered in the U.S. and other countries.

AirPrint is a trademark of Apple Inc., registered in the U.S. and other countries.

Google™ is a trademark of Google Inc.

Microsoft®, Windows®, and Windows Server® are U.S. registered trademarks of Microsoft Corporation.

UNIX® is a registered trademark of The Open Group.

Table of contents

1 Document last updated	1
2 About this document	2
3 Control-panel message types	3
Error-code and control-panel-message troubleshooting overview	3
Error codes (types and structure)	3
4 How to search for printer documentation	6
WISE - How to access and use	6
Accessing WISE	6
Using WISE to search for error codes	9
Using WISE to access repair and replace videos for FRUs	11
5 Printer service information	15
6 Numerical control panel messages	16
0x61 errors	16
6100000B	16
6100002D or 6100002E	16
11.XX.YZ error messages	21
11.* errors	21
11.00.01 or 11.00.02 Internal clock error	21
15.WX.YZ error messages	22
15.* errors	22
15.00.00 Unknown Jam	24
15.AX.Y1 Input Jam	24
15.AX.Y2 Input Jam	41
15.Ax.y3 Input Jam	60
15.Bx.yz Image Area (Print Zone) Jam from Tray X	79
15.B0.F0 Image Area Jam at Power On	106
15.C0.yz, 15.C1.yz, 15.C2.yz or 15.CA.yz Output area Jam from Tray X	107
15.C0.F0 Jam in left door at Power On	136
15.Dx.yz Duplex Jam from Tray X	136
15.Ex.yz Output jam from Tray X	151
15.FX.YZ unknown jam from Tray X	164
17.XX.YZ error messages (supply errors)	169
17.* error messages	169

17.0X.00 Failed Cartridge	169
17.0X.34 Counterfeit or refilled cartridge installed	170
17.0X.35 Incompatible <supply>	170
17.0X.36 Non-Startup cartridge at startup	170
17.0X.37 Startup Cartridge after startup completed	171
17.0X.38 Cartridge might be empty	171
17.0X.39 Use new cartridges	172
17.0X.42 General printing error	172
17.0X.52 Supply upgrade detected	173
17.0X.53 Supply upgrade successful	173
17.0X.54/17.0X.55 Supply upgrade problem	173
17.0X.56 Ink sensor warning	174
17.0X.57 HP Cartridge Protection enabled	174
17.0X.60 Cartridge Low Warning	174
17.0X.65 or 17.0X.80 Install Supply	175
17.0X.69 Cartridge Very Low	175
17.0X.70 Printing past very low	176
17.31.60 Supply Ink Collection Warning	176
17.31.65 Install Supply Ink Collection Unit	176
17.31.69 Supply Ink Collection full	177
17.31.71 Reinstall Supply Ink Collection	178
17.31.72 Supply Ink Collection reinstalled	178
17.31.73 New Supply Ink Collection	178
17.31.80 Replace Supply Ink Collection	178
17.99.31 Non-HP supply in use	178
17.99.32 Previously used HP Supply installed	179
17.99.40 Supplies installed	179
17.99.49 Startup Cartridge Override	179
17.99.58 HP Cartridge Protection enabled	179
20.XX.YZ, 21.XX.YZ error messages	179
20.* errors	179
21.* errors	180
20.00.00 Insufficient memory: <Device>	180
21.00.00 Page Too Complex	180
21.1C.2D Page complex error	180
30.XX.YZ error messages – X586 only	181
30.* errors	181
30.01.01	181
30.01.02 Scanner calibration failure	182
30.01.08 Home position error	185
30.01.14 Scan system EEPROM error	185
30.01.15 Scanner error	186
30.01.18 Scanner Error	186
30.01.19 Scanner lamp error	187
30.01.30 or 30.01.32	187
30.01.36 Upgrade Error Try downloading upgrade again	188
30.01.41, 30.01.44, 30.01.45 Scanner error	188
30.01.42 Scanner error	189

30.01.43 Scanner memory failure	190
30.01.46 Scanner Error	191
30.01.48 Scanner error	191
30.01.50 Scanner error	191
30.03.14	192
30.03.yz	192
30.03.45.....	193
31.XX.YZ error messages – X586 only	194
31.* errors.....	194
31.01.47 Document feeder not detected	195
31.03.14	196
31.03.20 Backside scanner not detected	196
31.03.22 Scanner calibration failure	197
31.03.30, 31.03.31 or 31.03.32	199
31.03.33 Backside scanner calibration area dirty	200
31.03.34 Background missing	203
31.13.00 Document feeder multi-pick error	204
31.13.01	221
31.13.02	238
31.13.13	255
31.13.14	256
32.WX.YZ error messages	258
32.* errors.....	258
32.08.A1, 32.08.A2, 32.08.A3	258
32.1C.05	258
32.1C.06 (event code).....	258
32.1C.07 (event code)	259
32.1C.08 (event code).....	259
32.1C.09 (event code).....	259
32.1C.0A (event code)	259
32.1C.0D (event code).....	259
32.1C.11 (event code)	260
32.1C.13, 32.1C.14	260
32.1C.15	260
32.1C.2E	260
32.1C.2F	260
32.1C.40	260
32.1C.41	261
32.1C.42	261
32.1C.43	261
32.1C.44	261
32.1C.45	261
32.1C.46	261
32.1C.47	262
32.1C.48	262
32.1C.49	262
32.1C.4A	262
32.1C.56	262

32.1C.57	263
32.1C.58	263
32.1C.60	263
32.1C.61	263
32.1C.62	263
32.1C.68	263
32.1C.69	264
32.1C.6A	264
32.1C.6D	264
33.XX.YZ error messages.....	264
33.* errors.....	264
33.02.01 Used board/disk installed	264
33.03.XX	265
33.03.03 Incompatible formatter installed	265
33.03.05 EFI Boot error	266
33.04.01 Missing TPM.....	267
33.04.02 Missing TPM.....	268
33.04.03 Unknown TPM	268
33.04.04 or 33.04.05 Unknown TPM.....	269
33.05.0z SureStart errors	270
33.05.1x Whitelisting errors	270
33.05.2x Intrusion detection errors	271
33.05.5z Intrusion detection errors	272
40.XX.YZ error messages.....	273
40.* errors.....	273
40.00.01 USB I/O buffer overflow To continue, touch “OK”	273
40.00.02 Embedded I/O buffer overflow To continue, touch “OK”	273
40.00.03 EIO [x] buffer overflow To continue, touch “OK”	273
40.00.04 EIO [x] bad transmission To continue, touch “OK”	273
40.00.05 Embedded I/O bad transmission To continue, touch OK	274
40.08.0x USB storage accessory removed	274
40.0x.05 USB storage accessory removed	274
41.XX.YZ error messages.....	274
41.* errors.....	274
41.03.YZ Unexpected size in tray <X>	275
42.XX.YY error messages.....	275
42.XX.YY Error Event Log message	275
44.XX.XX error messages - X586 only	275
44.* errors.....	275
44.01.XX Error Event log message (Multifunction product only.).....	276
44.02.xx Error Event log message (Multifunction product only.).....	276
44.03.XX Error Event log message (Multifunction product only.).....	276
44.04.xx Error Event log message (Multifunction product only.).....	277
44.05.xx Error Event log message (Multifunction product only.).....	277
44.07.xx Error Event log message (Multifunction product only.).....	277
44.08.xx Error Event log message (Multifunction product only.).....	277
44.10.xx Error Event log message (Multifunction product only.).....	277

44.11.xx Error Event log message (Multifunction product only.).....	277
44.11.0E Error Event log message (Multifunction product only.).....	278
44.12.xx Error Event log message (Multifunction product only.).....	278
44.12.0E Error Event log message (Multifunction product only.).....	278
44.16.01 Error Event log message (Multifunction product only.).....	278
44.16.02 Error Event log message (Multifunction product only.).....	279
44.16.03 Error Event log message (Multifunction product only.).....	279
44.16.04 Error Event log message (Multifunction product only.).....	279
44.16.05 Error Event log message (Multifunction product only.).....	279
44.16.06 Error Event log message (Multifunction product only.).....	280
44.16.07 Error Event log message (Multifunction product only.).....	280
44.16.08 Error Event log message (Multifunction product only.).....	280
44.16.09 Error Event log message (Multifunction product only.).....	280
44.16.0A Error Event log message (Multifunction product only.).....	281
44.16.0B Error Event log message (Multifunction product only.).....	281
44.16.0D Error Event log message (Multifunction product only.).....	281
44.16.0E Error Event log message (Multifunction product only.).....	281
44.16.0F Error Event log message (Multifunction product only.).....	281
44.16.10 Error Event log message (Multifunction product only.).....	282
44.16.FF Error Event log message (Multifunction product only.).....	282
44.34.XX Error Event log message (Multifunction product only.).....	282
44.90.XX, 44.91.XX, 44.92.XX Error Event log message (Multifunction product only.).....	282
45.WX.YZ error messages	282
45.00.YZ	282
47.XX.XX error messages.....	283
47.* errors.....	283
47.00.xx	283
47.01.xx	284
47.02.xx	284
47.03.xx	285
47.04.xx	285
47.05.xx	286
47.06.xx	286
47.FC.yz Printer Calibration Failed To continue, touch "OK"	287
48.XX.YY error messages	288
48.XX.YY	288
49.XX.YY error messages.....	288
49.XX.YY Error To continue turn off then on	288
54.XX.YZ error messages.....	290
54.* errors.....	290
54.30.00 Calibration error	290
58.XX error messages.....	291
58.* errors.....	291
58.10.02 Ink Sensor Failure.....	291
61.00.0X Error Messages.....	292
61.wx.yz	292
61.00.00 Print Engine Error	294

61.00.01, 61.00.02, and 61.00.03	303
61.00.04, 61.00.05	306
61.00.06	310
61.10.01	314
61.30.00	321
61.30.01	322
61.Ax.yz	322
61.C0.YZ	323
61.C4.YZ	324
61.C4.D3	328
62.wx.yz error messages	335
62.* errors	335
62.0F.YZ, 62.0X.YZ, 62.11.YZ, 62.12.YZ	335
62.12.35	338
81.XX.YY, 82.XX.YY error messages	345
82.* errors	345
81.WX.YZ Embedded Jetdirect Error To continue turn off then on	346
81.WX.00 Wireless Network Error To continue turn off then on	347
82.73.45 Disk Successfully cleaned	347
82.73.46, 82.73.47	347
98.0X.0Y error messages	348
98.* errors	348
98.00.01 or 98.01.00 Corrupt data in firmware volume	348
98.00.02 Corrupt data in the solutions volume	349
98.00.03 Corrupt data in the configuration volume	350
98.00.04 Corrupt data in the job data volume	350
99.XX.YY error messages	350
99.* errors	350
99.00.01 Upgrade not performed file is corrupt	351
99.00.02 Upgrade not performed timeout during receive	351
99.00.03 Upgrade not performed error writing to disk	352
99.00.04 Upgrade not performed timeout during receive	352
99.00.05 Upgrade not performed timeout during receive	352
99.00.06 Upgrade not performed error reading upgrade	353
99.00.07 Upgrade not performed error reading upgrade	353
99.00.08 Upgrade not performed error reading upgrade	353
99.00.09 Upgrade canceled by user	354
99.00.10 Upgrade canceled by user	354
99.00.11 Upgrade canceled by user	354
99.00.12 Upgrade not performed the file is invalid	354
99.00.13 Upgrade not performed the file is invalid	354
99.00.14 Upgrade not performed the file is invalid	355
99.00.2x	355
99.01.xx	356
99.02.01	356
99.02.09	356
99.09.60 Unsupported disk	356
99.09.61 Unsupported disk	357

99.09.62 Unknown disk	357
99.09.63 Incorrect disk	358
99.09.64 Disk malfunction	358
99.09.65 Disk data error	358
99.09.66 No disk installed	358
99.09.67 Disk is not bootable please download firmware	359
99.XX.YY	365

7 Alphabetical control panel messages.....366

Alphabetical error messages.....	366
<binname> full Remove all paper from bin	366
<Supply> almost full	366
<Supply> low OR Supplies low	366
<Supply> very low OR Supplies very low	367
<Tray X> lifting	367
[File System] device failure To clear touch "OK"	367
[File System] file operation failure To clear touch "OK"	367
[File System] file system is full To clear touch "OK"	367
[File System] is not initialized	367
[File System] is write protected	368
Accept bad signature	368
Document feeder not detected	368
Document feeder Misfeed	368
Automatic Document Feeder cover open	368
Bad optional tray connection	368
Calibration reset pending	369
Canceling	369
Canceling...<jobname>	369
Cartridge Problem; Ink cartridge problem	369
Checking engine	369
Checking paper path	369
Chosen personality not available To continue touch "OK"	369
Clear Output Area	370
Clearing event log	370
Clearing paper path	370
Close Ink Access Door	370
Close Left door	371
Close upper Left door	371
Cooling device	371
Counterfeit Cartridge Advisory	371
Data received To print last page press "OK"	371
Do not use startup cartridges	371
Empty Ink Cartridge	372
Event log is empty	372
Expected drive missing	372
Fax is disabled – ignoring call	372
FIM Load Error Send full FIM on <X> port	372
Flatbed cover open or Close Flatbed cover	372
Gateways failed	373

Gateways OK	373
Genuine HP cartridge installed	373
Genuine HP supply installed	373
HP Protected Cartridge Installed	373
HP Secure hard drive disabled	374
Incompatible ink cartridges	374
Ink cartridges depleted	374
Ink Sensor Failure	374
Low on ink	375
Initializing... ..	375
Install <supply>	375
Internal disk device failure To clear touch "OK"	375
Internal disk file operation failed	376
Internal disk file system is full	376
Internal disk is write protected	376
Internal disk not found	376
Internal disk not functional	376
Internal disk not initialized	376
Internal disk spinning up	377
Jam in document feeder	377
Load Tray 1: [Type], [Size] To use another tray, press "OK"	377
Load Tray 2: [Type], [Size] To use another tray, press "OK"	398
Load Tray 3: [Type], [Size] To use another tray, press "OK" -or- Load Tray 4: [Type], [Size] To use another tray, press "OK" -or- Load Tray 5: [Type], [Size] To use another tray, press "OK"	411
Loading program <XX> Do not power off	424
Main Tray 2 Missing or Open	424
Manually feed output stack Then touch "OK" to print second side	424
Manually feed: <Type><Size>	425
No job to cancel	425
Non-HP Cartridge(s) Non-HP ink cartridges installed	425
Output Bin Full	425
Paused... ..	426
Paper Jam	426
Paper Jam in Automatic Document Feeder	426
Paper too short	426
Paper too short to aut duplex	426
Paper type mismatch	426
Performing Paper Path Test	427
Please Wait... ..	427
Printer Failure	427
Printer Supply Upgrade	427
Printer Supply Upgrade Problem	427
Print head Jam	428
Printing Configuration... ..	428
Printing Event Log... ..	428
Printing File Directory... ..	428
Printing Font List... ..	428
Printing Help Page... ..	428
Printing Menu Map... ..	428

Printing stopped...	429
Printing Supplies Status Page...	429
Printing Usage Page...	429
Printing engine test...	429
Problem with Printer Preparation	429
Problem with startup Cartridge(s)	429
Processing job from tray <x>... Do not grab paper until job completes	429
Processing...	430
Processing... copy <x> of <y>	430
RAM disk device failure To clear press "OK"	430
RAM disk file operation failed To clear press "OK"	430
RAM disk file system is full To clear press "OK"	430
RAM disk is write protected To clear press "OK"	430
RAM disk not initialized	431
Ready	431
Ready <IP Address>	431
Receiving Upgrade	431
Remove USB accessory	431
Resend Upgrade	431
Restore Factory Settings	431
ROM disk device failed To clear press "OK"	432
ROM disk file operation failed To clear press "OK"	432
ROM disk file system is full To clear press "OK"	432
ROM disk is write protected To clear press "OK"	432
ROM disk not initialized To clear press "OK"	432
Service Ink Capacity Warning	432
Size mismatch in Tray <x>	433
Sleep mode on	433
Standard bin full	433
Startup Routine Ink Alert	443
The unit has corrupt data	443
Tray <X> empty: [Type], [Size] / Tray X Out of Paper	444
Tray <X> lifting	444
Tray <X> open	444
Tray <X> [type] [size]	444
Type mismatch Tray <x>	445
Use startup cartridges	445
Used HP Ink Cartridge(s) installed	445
Used or Counterfeit Cartridge Detected	445
Unsupported drive installed To continue, touch "OK"	446
Unsupported supply in use OR Unsupported supply installed to continue touch OK	446
Unsupported USB accessory detected Remove USB accessory	446
Upgrade Error	446
USB accessory not functional	446
USB hubs are not fully supported Some operations may not work properly	447
USB is write protected To clear press "OK"	447
USB needs too much power Remove USB and then turn off and on	447
USB not initialized	447
USB storage accessory removed Clearing any associated data	448

USB storage device failure To clear press “OK” 448

USB storage file operation failed To clear press “OK” 448

USB storage file system is full To clear press “OK” 448

Very Low on Ink 448

Windows Login Required to Use this Feature 448

Index..... 450

1 Document last updated

The following is the last time this document was updated:

Last update: September 7, 2022

2 About this document

This document provides error-code troubleshooting information.



IMPORTANT: Procedures and part numbers change. For current information, use the browser-based format.

Verify PDF is the most current before use. PDF part numbers must be verified with web-based error code information or parts look-up before parts are ordered.

Choose the format that best meets your needs.

Table 2-1 Content format types

Format	Document title example	Recommended use
Web-based	Go to: Product Detail page > Error Code Look-up	Quick access to individual web-based error code troubleshooting TIP: Save Product Detail page URL location in favorites
Web-Base	Go To: WISE default Search page > Enter [Product] and error code	- Access to individual web-based error code troubleshooting - Web-based: Most up-to-date information available
PDF	[Product] - Control Panel Message Document (CPMD) PDF	- Use when support portals are NOT accessible at time of service - Use when a printable document is needed NOTE: Always refer to the printer service manual for removal and replacement procedures NOTE: For current information, use the Web-based format.

3 Control-panel message types

The control-panel messages and event code entries indicate the current printer status or situations that might require action.



NOTE: Event log errors do not appear on the control-panel display. Open the event log to view or print the event log errors.

A control-panel message displays temporarily and might require you (or the applicable user) to acknowledge the message by touching the **OK** button to resume printing or by touching the **Stop** button to cancel the job.

With certain messages, the job might not finish printing, or the print quality might be affected. If the message is related to printing and the auto-continue feature is on, the printer will attempt to resume printing after the message has appeared for 10 seconds without acknowledgement.

For some messages, restarting the printer might fix the problem. If a critical error persists, the printer might require service.

Error-code and control-panel-message troubleshooting overview

This section provides information on error codes and searching for information.

Error codes (types and structure)

Error codes and control-panel messages display on the printer control panel to indicate the current printer status or situations that might require action. Error codes are numerical, or alphanumerical, and have a set structure with six characters (example: 13.WX.YZ).

- The first two characters are numeric and represent the system component that is causing the error. For example, in error code 10 . 22 . 15, **10** = **Supplies** for HP LaserJets.
- The remaining four characters (W, X, Y, and Z values) further define the error.

HP LaserJet and HP PageWide Enterprise error codes are documented in the control panel message document (CPMD) for each printer.

The CPMD is a comprehensive list of error codes, diagnostic and troubleshooting steps to clear or resolve the error, and other helpful information such as service mode pins and part numbers.

The CPMD is continually updated and republished with the latest information for the following error codes.

Table 3-1 ERROR CODES: The first two characters

Error code	System Component	System Error Description
10.WX.YZ	Supplies (LaserJet)	Supply error or supply memory error.
11.WX.YZ	Real-time clock	Internal error with the clock on the formatter.
13.WX.YZ	Jam (LaserJet)	Paper jam or open door jam error.
15.WX.YZ	Jam (PageWide)	Paper jam or open door jam error.
17.WX.YZ	Supplies (PageWide)	Supply error or supply memory error.
20.WX.YZ	Printer memory	Insufficient memory or buffering error.
21.WX.YZ	Page	Page complexity causing a decompression error when trying to process job.
30.WX.YZ	Scanner	Flatbed scanner error occurring inside the unit.
31.WX.YZ	Document feeder	Document feeder, scanner, or jam error.
32.WX.YZ	Backup, restore, or reset	Backup, restore, or reset notification or error.
33.WX.YZ	Security	Backup, Disk, EFI BIOS, Firmware integrity (SureStart), or Trusted Platform Module (TPM) notification or error.
40.WX.YZ	Input/Output (I/O)	Partition manager, secure erase, or USB accessory error.
41.WX.YZ	Fuser, Laser scanner, or Paper path	Miscellaneous error including general and misprint or mismatch errors typically involving (but not limited to) the fuser, the laser scanner, or the paper path.
42.WX.YZ	Firmware	Firmware failure involving the Event Log, Shell, System Manager, or other component.
44.WX.YZ	Firmware	Firmware failure involving a digital sending component.
45.WX.YZ	OXPd/Web Kit (PageWide)	Informational notifications involving the OXPd Web Kit (communications log).
46.WX.YZ	Engine (LaserJet)	Engine communication error.
47.WX.YZ	Firmware	Job parser or printer calibration error.
48.WX.YZ	Firmware	PJA job accounting, job management, or job pipeline error.
49.WX.YZ	Firmware	Firmware communication error.
50.WX.YZ	Fuser (LaserJet)	Fuser error.
51.WX.YZ	Laser scanner (LaserJet)	Laser scanner beam error.
52.WX.YZ	Laser scanner (LaserJet)	Laser scanner startup error.
54.WX.YZ	Sensor	Sensor error (not jam related).
55.WX.YZ	DC controller (LaserJet)	DC controller communication error.
56.WX.YZ	Paper handling (LaserJet)	Paper input/output or accessory error.
57.WX.YZ	Fan	Fan error.
58.WX.YZ	Sensor	Engine sensor failure.

Table 3-1 ERROR CODES: The first two characters (continued)

Error code	System Component	System Error Description
59.WX.YZ	Motor (LaserJet)	Motor error.
60.WX.YZ	Tray motor error (LaserJet)	Tray lifting or pick up error.
61.WX.YZ	Engine (PageWide)	Print engine error with the 8-bit data package.
62.WX.YZ	System (LaserJet)	LaserJet internal system error.
	Print bar (PageWide)	PageWide print system error.
63.WX.YZ	Engine (LaserJet)	General engine error (electrical, communication, etc.).
65.WX.YZ	Connector	Output accessory connection error.
66.WX.YZ	Output accessory	Output accessory error.
67.WX.YZ	Input accessory	Input accessory connection error
69.WX.YZ	Duplexer	Duplexer error.
70.WX.YZ	DC controller (LaserJet)	DC controller firmware error.
80.WX.YZ	Managed device	Embedded Jetdirect error.
81.WX.YZ	Near Field Communication (NFC)	Wireless, Bluetooth or internal EIO error.
82.WX.YZ	Memory (hard disk, EMMC, etc.)	Disk hardware error.
90.WX.YZ	Internal diagnostics	Internal test of systems (i.e. disk, CPB, display) or interconnection error.
98.WX.YZ	Hard disk	Hard disk partition error.
99.WX.YZ	Firmware installer	Remote Firmware Upgrade (RFU), firmware install (engine or accessory), or disk error.

4 How to search for printer documentation

The CPMD, error codes, and other support documentation for each printer is found on the internal HP portals.

These portals are on WISE for Channel (please see [Accessing WISE for HP channel partners \(HP Partner Portal\) on page 6](#) below for instructions on how to navigate to the site) and [WISE](#). WISE for Channel is available to HP channel partners and WISE is available to call agents, service technicians, and other HP internal users. The level of detail available will depend on your access credentials. To learn how to find support content in WISE, [watch the video here](#).

WISE - How to access and use

Learn how to access and use Web-based Interactive Search Engines (WISE) to locate available support information. WISE is a repository of technical support documentation including service manuals, user guides, videos, and general support information.

Accessing WISE

Learn how to access Web-based Interactive Search Engines (WISE) if you are an HP channel partner or an internal HP user.


Accessing WISE for HP channel partners (HP Partner Portal)

Learn how to access WISE by accessing the HP Partner Portal if you are an HP Channel Partner.




NOTE: If this is your first visit to the HP Partner Portal, you will be asked to create an account. Follow the setup directions using your HP Partner credentials.


1. Open the HP Partner First Portal located at <https://partner.hp.com>.

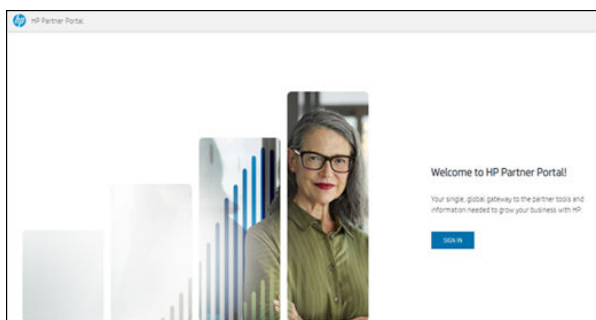

2. Select the **Services & Support** tab, and then select **Technical Support**.

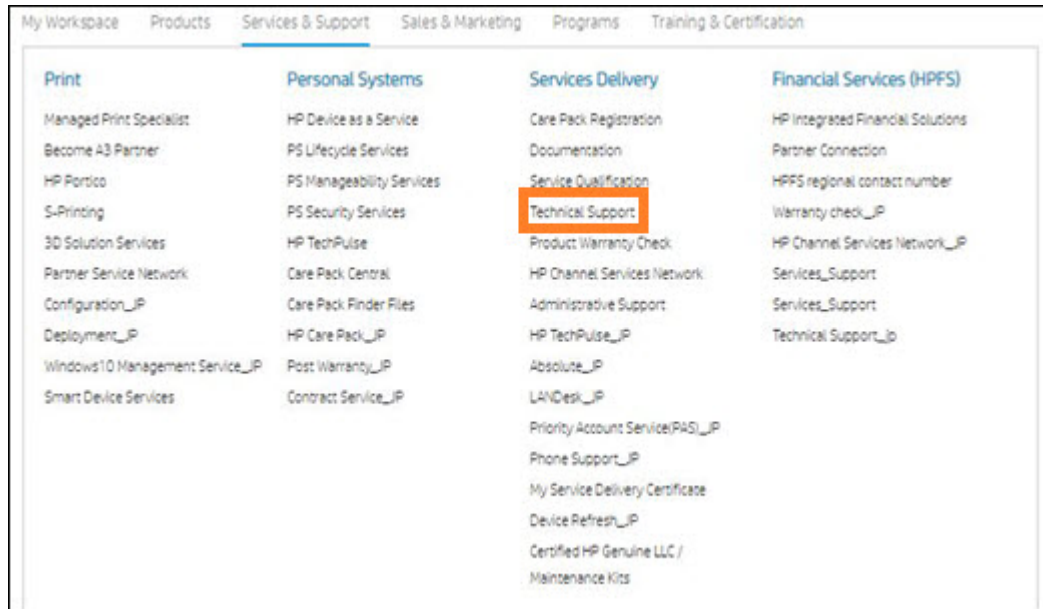

3. Select **Technical Documentation**.

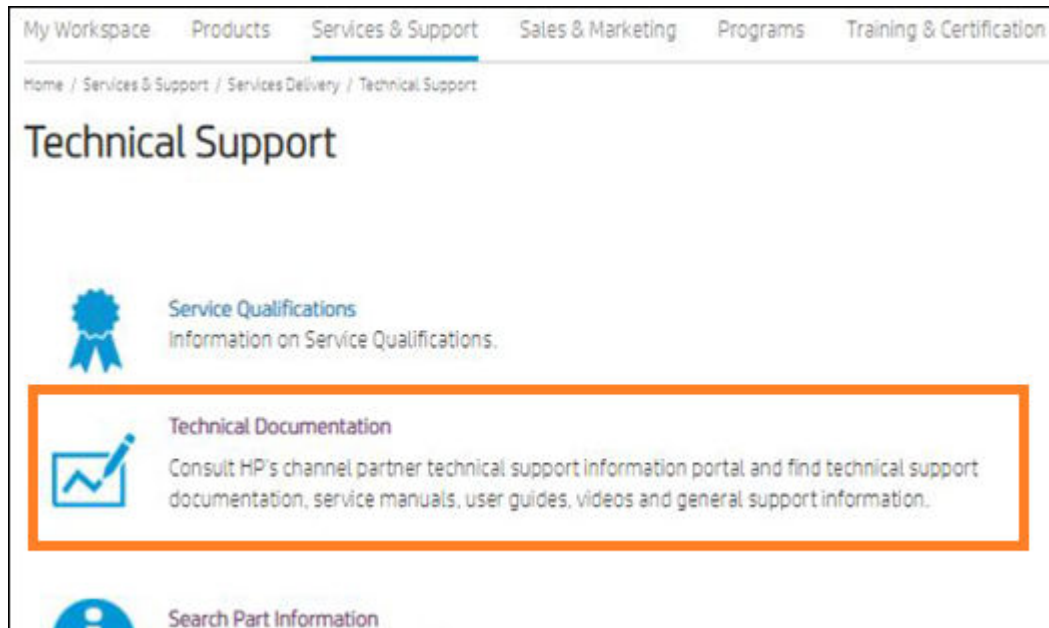

4. You will be taken to the WISE portal.




Play the video:

 [View a video of how to access WISE \(HP channel partners\)](#)

Accessing WISE for internal HP users

Learn how to access WISE if you are an internal HP user.

1. Open one of the Web-based Interactive Search Engines (WISE) URLs listed below.
2. Select **Commercial** from the drop-down menu.

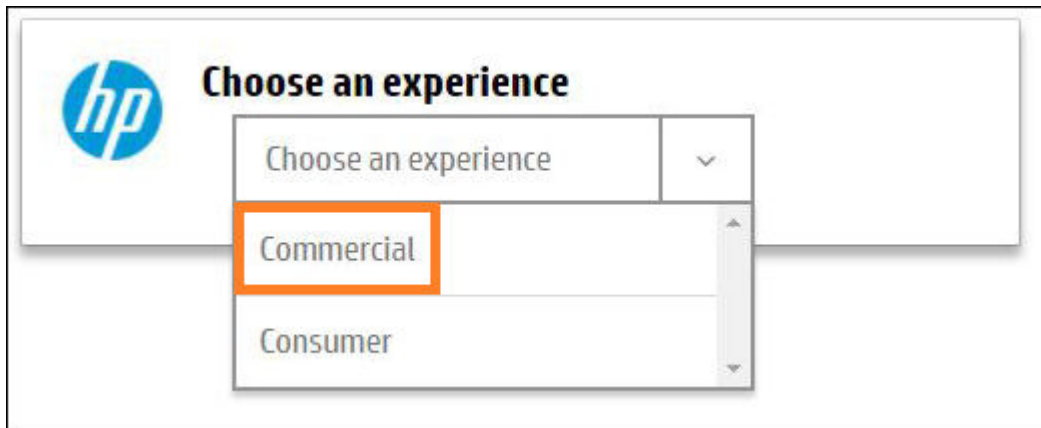

3. You will be taken to the WISE homepage.



AMS

- <https://support.hp.com/wise/home/ams-en>
- <https://support.hp.com/wise/home/ams-es>
- <https://support.hp.com/wise/home/ams-pt>
- <https://support.hp.com/wise/home/ams-fr>

APJ

- <https://support.hp.com/wise/home/apj-en>
- <https://support.hp.com/wise/home/apj-ja>
- <https://support.hp.com/wise/home/apj-ko>
- <https://support.hp.com/wise/home/apj-zh-Hans>
- <https://support.hp.com/wise/home/apj-zh-Hant>

- <https://support.hp.com/wise/home/api-th>

EMEA

- <https://support.hp.com/wise/home/emea-en>

Play the video:



[View a video of how access WISE \(internal HP users\)](#)

Using WISE to search for error codes

Learn how to use WISE to look up error codes.



NOTE: The model used in the instructional videos is an example. The same steps apply to all printer models.

You will need the printer type (e.g. HP LaserJet), model number (e.g. M607), and bundle option (e.g. dn, dh, z).

Search for error codes using the lookup widget

Learn how to search for a specific error code using the WISE Error Code Lookup widget.

1. Select **Products** in the navigation bar of the WISE portal home page.
2. Using the type, model number and bundle option of the printer to be repaired, select **HP Printers > Type of Printer > Model Group > Model Number > Bundle Option > Product Number**, and then select **Launch Product Detail Page**. The PDP page will open.

Locate Product SKU

Es: HP ENVY Printers, HP OfficeJet Printers, HP LaserJet Printers, HP Photosmart Printers, HP Desktop Printers, HP PageWide Printers, HP Sprocket Printers, HP AMP Printers, HP Ink Tank Printers, HP Tango, HP DesignJet Printers, HP Industrial Printers, Samsung Printers, HP PSC Printers

HP LaserJet E70000, HP LaserJet E80000, HP LaserJet M11-M31, HP LaserJet M100, HP LaserJet M200, HP LaserJet M300, HP LaserJet M400, HP LaserJet M500, HP LaserJet M600, HP LaserJet M700, HP LaserJet M800, HP LaserJet M1000, HP LaserJet M2000, HP LaserJet M3000, HP LaserJet M4000


HP Color LaserJet Enterprise MFP M600 series, HP Color LaserJet Enterprise MFP M601 series, HP Color LaserJet Enterprise MFP M602 series, HP Color LaserJet Managed M651 series, HP Color LaserJet Managed MFP M650 series, HP LaserJet Enterprise 600 Printer M601 series, HP LaserJet Enterprise 600 Printer M602 series, HP LaserJet Enterprise 600 Printer M603 series, HP LaserJet Enterprise M604 series, HP LaserJet Enterprise M605 series, HP LaserJet Enterprise M606 series, HP LaserJet Enterprise M607 series, HP LaserJet Enterprise M608 series, HP LaserJet Enterprise M609 series, HP LaserJet Enterprise M610 series

HP LaserJet Enterprise M607 dn, HP LaserJet Enterprise M607n


K0Q11SA, K0Q11SAR

[Launch Product Detail Page](#)

- Enter the error code in the widget in the **Error Code Lookup** area at the bottom-right of the screen and click the search icon or press the Enter button.

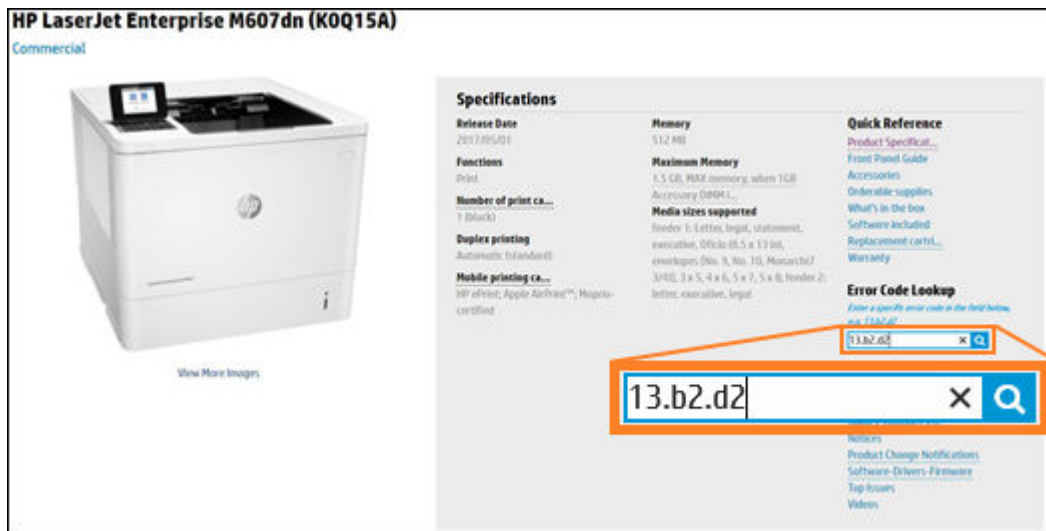

- Select the desired topic from the search results.

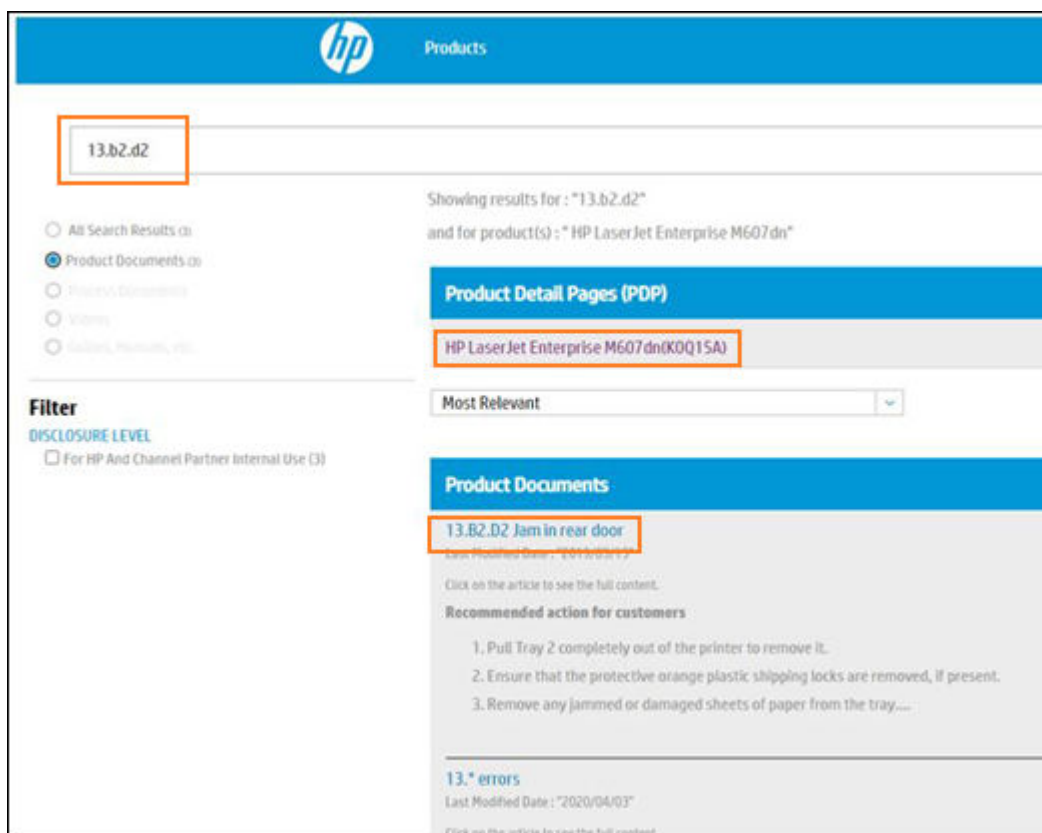

Search for error codes from the WISE home page


Learn how to search for a specific error code from the WISE home page.

1. Enter the model number in the search field on the WISE home page. The search is predictive, and a drop-down menu will appear with available selections.


 **NOTE:** Selecting the **series** item from the drop-down list is recommended for the most accurate search return.



2. Enter the error code in the search field.

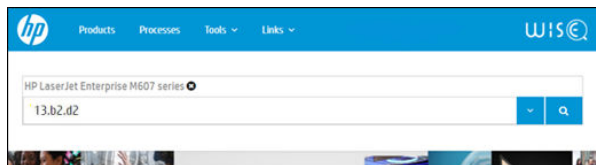

3. Select the desired topic from the search results.

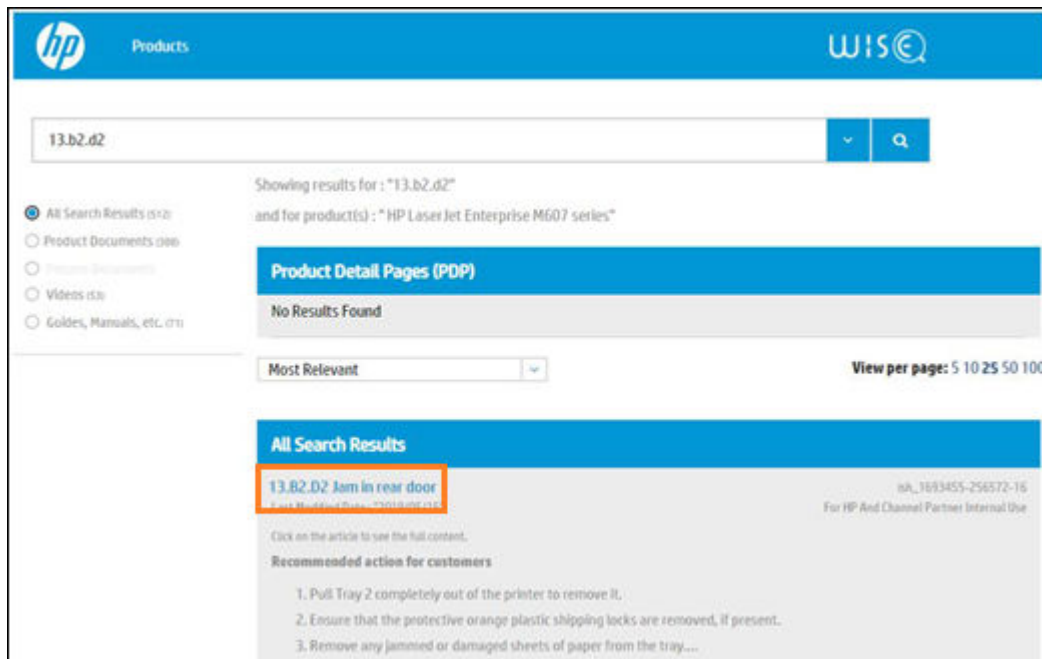

Using WISE to access repair and replace videos for FRUs

Learn how to use WISE to access repair and replace videos for FRUs.




NOTE: The model used in the instructional videos is an example. The same steps apply to all printer models.

You will need the printer type (e.g. HP LaserJet), model number (e.g. M607), and bundle option (e.g. dn, dh, z).

Search for a printer's Product Detail Page (PDP)

Learn how to search WISE for product specific information. Quickly review the steps and then play the video.


1. Select **Products** in the navigation bar of the WISE portal home page.
2. Using the type, model number and bundle option of the printer to be repaired, select **HP Printers > Type of Printer > Model Group > Model Number > Bundle Option > Product Number**, and then select **Launch Product Detail Page**. The PDP page will open.

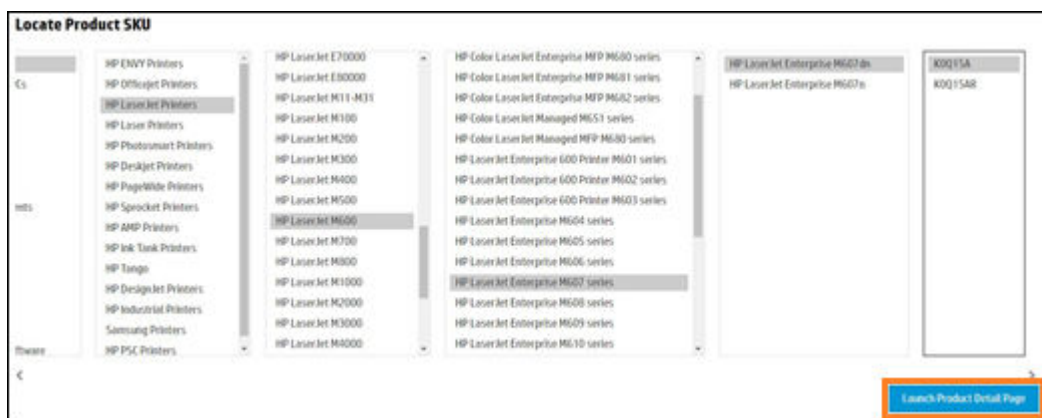

3. Select the link to **Videos** in the **Other Content** menu at the bottom-right of the screen.



4. Select the desired video from the list of videos.

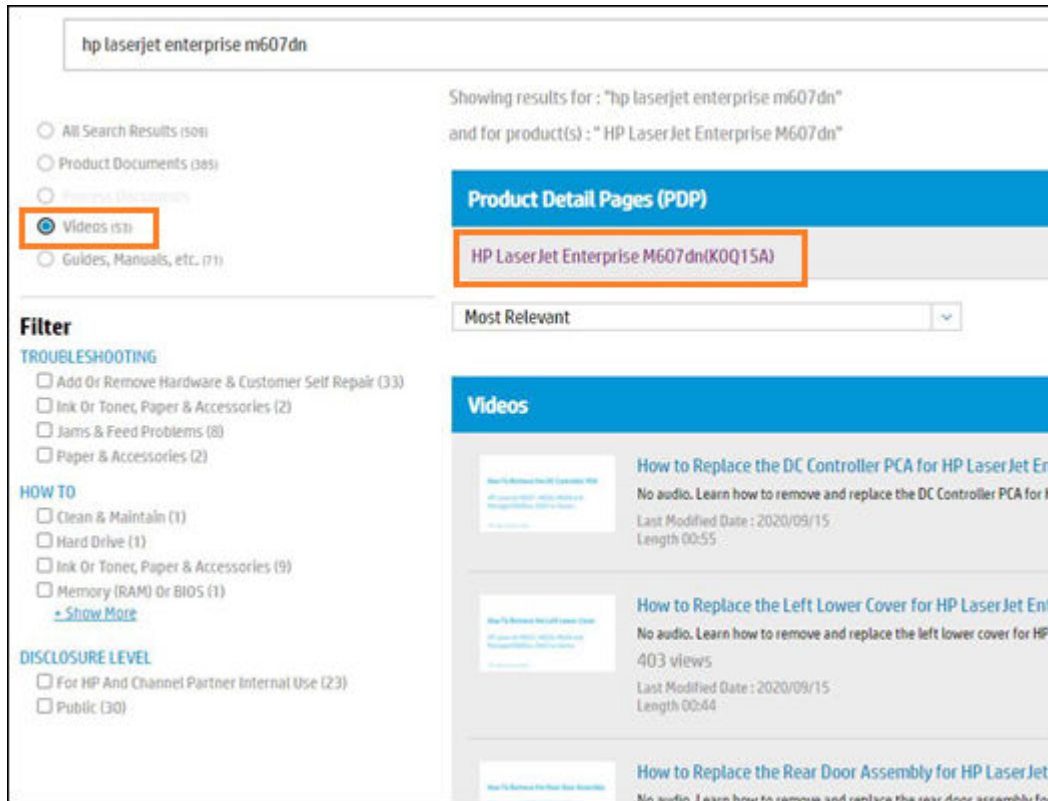

Play the video:



[View a video of how to search for the printer's Product Detail Page \(PDP\)](#)

Perform a model number search using the search function

Learn how to search WISE using the model number. Quickly review the steps and then play the video.

1. Enter the model number in the search field on the WISE home page. The search is predictive, and a drop-down menu will appear with available selections.




NOTE: Selecting the **series** item from the drop-down list is recommended for the most accurate search return.




2. Click the search icon to the right.

3. To refine the search results, select the radio button labeled **video** in the upper-right portion of the screen.

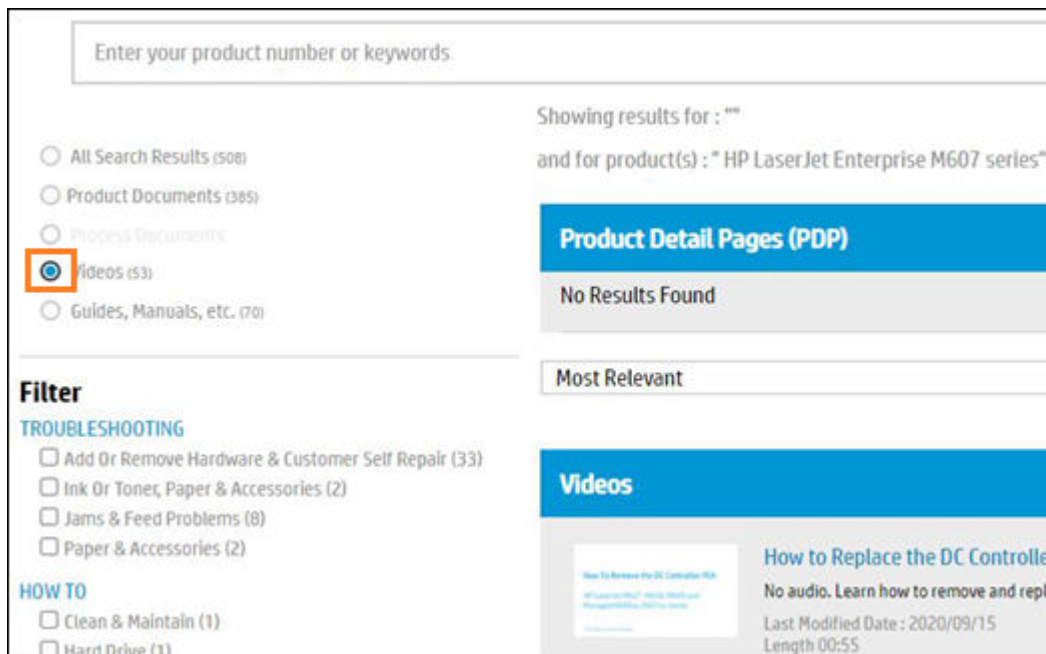

TIP: To refine video search results, append a part name to the model detail shown in the search bar. For example, adding the word **fuser** to the detail in the search bar will return videos related to repair and replacement of the fuser.

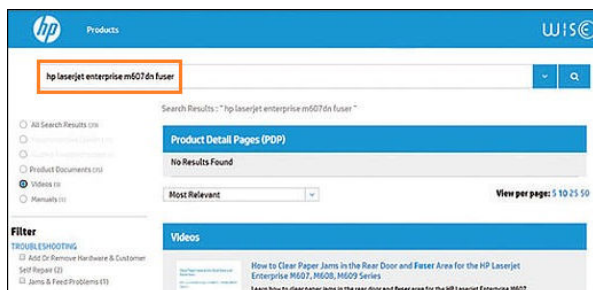

Play the video:

 [View a video of how to perform a model number search](#)

5 Printer service information

The following information provides the document's last updated date and the printer service PIN.

Last update: September 7, 2022

Service mode PIN numbers:

- 556, MFP 58650: 05058616
- 586: 05055616



NOTE: When possible, always update the printer firmware to the latest available version at [HP.com](https://www.hp.com) as part of the troubleshooting performed for any of the following errors.

After the firmware updates, re-enable autosend through the control panel

6 Numerical control panel messages

Use the following numerical error message troubleshooting to resolve your issue.

0x61 errors

6100000B

The printer is too cold at OOBE; it needs to warm up.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call center agents

1. Ask the customer to turn off the printer, and then turn it back on.
If the error persists, continue to the next step.
2. Dispatch a technician for on-site service.

Recommended action for call center agents

1. If the room temperature is below 5° C, or the printer was stored in an environment below 5° C, ask the customer to move the printer to a location where the ambient temperature is above 5°C and then allow a minimum of 4 hours for the printer to warm up.



NOTE: It can take up to 12 hours for the printer to warm up.

2. Ask the customer to remove all supplies from any cardboard packaging so they can warm up.
If this error persists after warming up, the Mech Kit has failed and needs to be replaced.

6100002D or 6100002E

Tray 2 is not picking because it does not see the index flag. The engine attempts to spin the pick shaft but does not detect motion whether through a failure to move the input tray (swing arm failure), or failure to detect (pick index sensor failure).

- **0x6100002D:** occurs when the engine is preparing for pick
- **0x6100002E:** occurs during printing

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call center agents


1. Ask the customer to turn off the printer, and then turn it back on.
If the error persists, continue to the next step.
2. Dispatch a technician for on-site service.

Recommended action for onsite service technician

Try the following solutions (in the order presented) to resolve the issue. If the first solution resolves the issue, there is no need to continue troubleshooting.

1. **Solution one:**
 - a. Turn the printer off, and then on.
 - b. Remove Tray 2 and locate the pick shaft.
 - c. Manually rotate the pick shaft 90°, and then use a marker to make a small mark on the white round part.


Figure 6-1 Mark the white round part with a marker

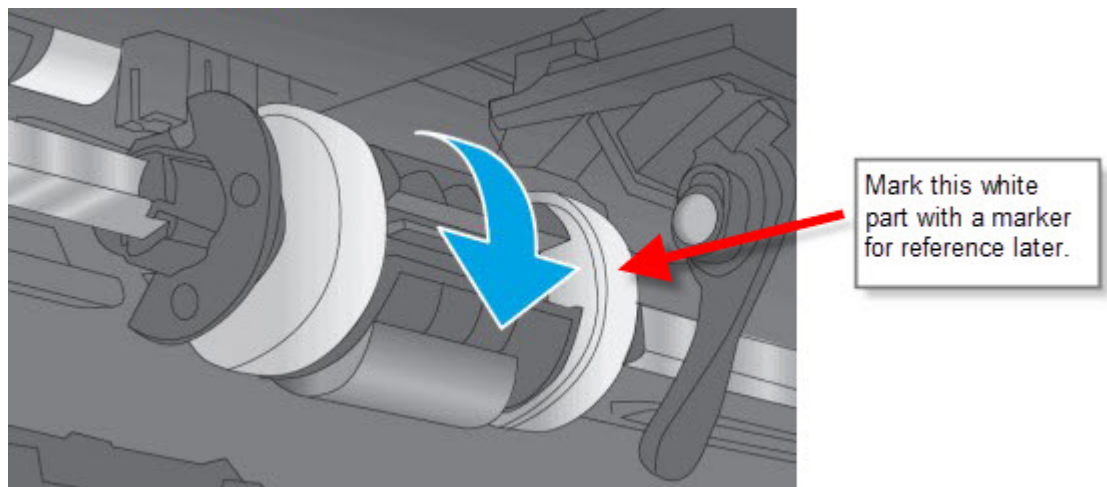

- d. Reinsert Tray 2, and then turn the printer off and back on.
- e. Wait for the printer to initialize to ensure that the printer has completed the tray boost.

- f. Remove Tray 2 and inspect the pick shaft to see if it turned and then proceed accordingly:
 - If the pick shaft turned, you will not be able to see the mark that you made on the white round part. Proceed with the following steps:
 - i. Using compressed air, blow away any dust from the Opto sensor and the surrounding components.

Figure 6-2 Opto sensor (circled in red)

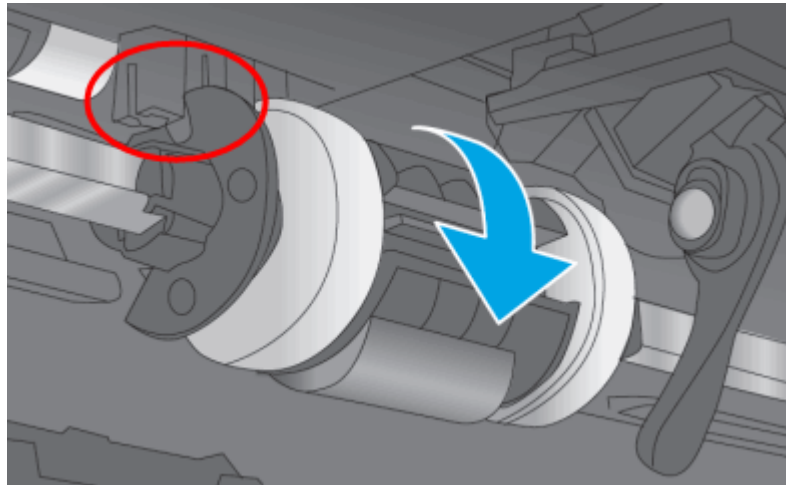

- ii. Test the printer again.
 - If the pick shaft **did not turn**, continue to Solution two.

2. Solution two:

If the previous solution did not resolve the issue, the problem could be that the plastic bearing is pressed too far onto the pick roller shaft. This could have occurred during manufacturing. When this happens, there is too much slack in the shaft which causes the pick sensor to be hit incorrectly. Follow the steps in this solution to correct the problem.

The photos below help to demonstrate the issue with the pick shaft and bearing.



NOTE: In these photos, the pick shaft has been removed from the printer.

Figure 6-3 Pick shaft with three lines drawn on it



Figure 6-4 Bearing in the proper location



Figure 6-5 Bearing in the over-pressed position



Figure 6-6 During repair, apply pressure to the plastic bearing and push it off



Figure 6-7 Push the bearing until it drops off the ridge at point 2



Use the steps and video below to resolve the issue with the pick shaft and bearing.


[Video: Clear Error Codes 6100002D or 6100002E](#)



NOTE: The video demonstrates how to adjust the pick tire shaft.

- a. Remove Tray 2 and locate the pick shaft in the upper left corner.

Figure 6-8 Locate the pick shaft

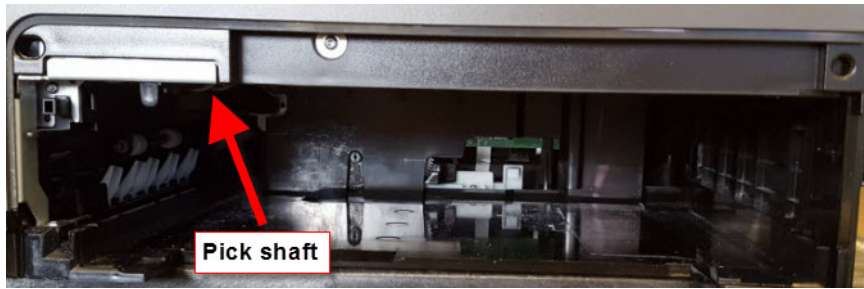

- b. Verify that the pick shaft can move back and forth about 3-5 millimeters.

Figure 6-9 Verify pick shaft movement




- c. Hold onto the pick tire hub with one hand, and then push on the white-plastic bearing (using a pen or long screwdriver) to move it about 3 millimeters.



NOTE: The idea is to decrease the amount of movement, not completely eliminate the movement.

Figure 6-10 Hold pick tire hub with one hand and move bearing to decrease the amount of movement

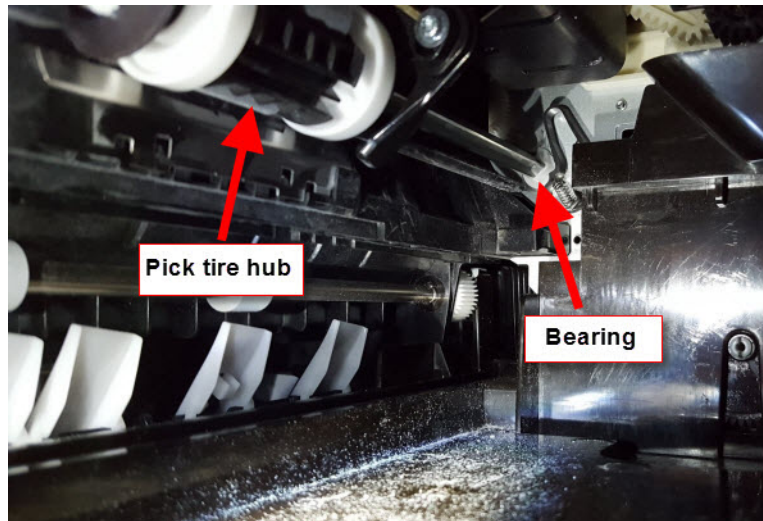

If these steps do not resolve the assert error, replace the Mech Kit.

11.XX.YZ error messages

11.* errors

Errors in the 11.* family are related to the printer real-time clock.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Set the time and date on the printer control panel.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Set the time and date on the printer control panel.
2. If the error persists, remove and reinstall the formatter. Make sure it is fully seated.
3. If the error still persists, replace the formatter.

11.00.01 or 11.00.02 Internal clock error

This message indicates a problem with the formatter's real time clock.

The product real time clock has experienced an error.

01=dead clock

02=dead real time clock

Recommended action for customers

1. Whenever the product is turned off and then turned on again, set the time and date on the control panel.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

1. Whenever the product is turned off and then turned on again, set the time and date on the control panel.
2. If the error persists, you might need to replace the formatter.

For instructions: See the Repair Service Manual for this product.

Table 6-1 Part numbers

Part description	Part number
Formatter PCA (556)	G1W46-67911
Formatter PCA (586)	G1W39-67914
Formatter PCA - China only (556)	G1W46-67912
Formatter PCA - China only (586)	G1W39-67939

15.WX.YZ error messages

15.* errors

Errors in the 15.* family are related to jams. More than 1000 unique error codes are possible. Use the following information to understand the jam code. Not all codes apply to all printers.

Message format: 15.WX.YZ

- W represents the jam location.
- X represents the sensor or door that triggered the jam.
- Y represents the jam condition (delay, stay, wrap, etc.)
- Z represents the paper source

For example, the message 15.B1.C2 indicates a jam in the print zone, detected by the TOF sensor. The sheet was delayed reaching the sensor for the duplex job, and the job was printing from Tray 2.

Value	W (location)	X (sensor)	Y (condition)	Z (paper source)
0	Unknown	Unknown	Unknown	Unknown
1		TOF (feed roller) sensor		Multipurpose tray

Value	W (location)	X (sensor)	Y (condition)	Z (paper source)
2		pz jam (star wheel) sensor	Unexpected sheet (duplex)	Main (Tray 2)
3			Staple jam	Tray 3
4				Tray 4
5				Tray 5
8			Door open (duplex)	
9			Stay (page never left - duplex)	
A	Input	Left door sensor	Stay (page never left - simplex)	
B	Print zone			
C	Output		Delay (duplex)	
D	Duplex		Delay (simplex)	
E	Eject		Door open (simplex)	
F	Multiple zones	Multiple sensors	Power on jam	

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. For video instructions on troubleshooting paper jams in Pagewide printers, go to: [Fixing a Paper Jam on Pagewide Enterprise printers](#).
2. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
3. Verify that no doors are open.
4. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size, and the tray should not be filled above the maximum fill marks or tabs.
5. Verify that the paper meets specifications for this printer.
6. Use a damp, lint-free cloth to clean the rollers in the appropriate tray. Replace rollers that are worn.
7. If the issue persists, open the Administration > Troubleshooting > Paper Path Page menu to move paper from the tray to the output bin.
8. Run the Advance Jam Recovery Utility using a heavy paper on Tray 1 (Administration / Troubleshooting / Advance Jam Recovery). Run it a few times in order to clear jams at the print zone.

See this document for more information: [HP Officejet Enterprise Color X555, MFP X585 and HP PageWide Enterprise Color 556, MFP 586 - 15.B0.XX Errors](#)

9. If the error persists, elevate the case using the Standard Support Process.

15.00.00 Unknown Jam

A paper jam has occurred in the printer at an unknown location.

Recommended action

1. Follow the jam removal instructions on the screen.

For video steps on troubleshooting paper jams in Pagewide printers, go to: [Fixing a Paper Jam on Pagewide Enterprise printers](#).

2. Open all doors and trays and remove all paper from the paper path.
3. Run the Paper Path Diagnostics procedure to move paper from the tray to the output bin. ([Administration / Troubleshooting / Paper Path Page](#)).

15.AX.Y1 Input Jam

An input jam occurred from Tray 1.

This jam occurs when the paper does not reach the Feed roller RED sensor, for Tray 1 in designated amount of time after the start of paper pick-up from Tray 1.



NOTE: This device is equipped with “Auto Jam Recovery Feature”. This enables the printer to attempt to automatically eject any paper jammed in the paper path to the output bin.

As result of this feature you may not find paper in the paper path.

- **15.A0.00:** Input paper jam. There is a paper jam at unknown location at unknown sensor when printing from an unknown tray
- **15.A0.01:** Input paper jam. There is a paper jam at unknown location at unknown sensor when printing from tray 1.
- **15.A1.D0:** Input paper jam. There is a paper jam at input area at TOF Redi Sensor when printing from an unknown tray Delay (simplex)
- **15.A1.D1:** Input paper jam. There is a paper jam at input area at TOF Redi Sensor when printing from tray 1. Delay (simplex)

Recommended action for customers:

Follow these troubleshooting steps in the order presented.

For customer troubleshooting steps go to the link provided or follow the instructions listed.

[HP PageWide Enterprise Color 556, MFP 586 - Clear jams in Tray 1 \(multipurpose tray\)](#).

1. Clear the paper jam from tray 1.

- a. Remove any and all paper from tray 1.




- b. Return tray 1 to the upright closed position.



2. Remove paper from the left side of the printer.


- a. Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

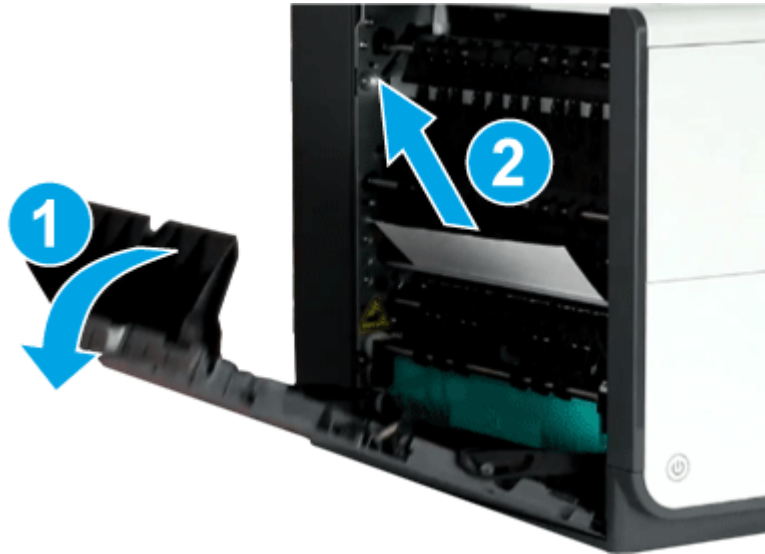


- b. With the left door open, remove ink collection unit (ICU) using the green handle.



- c. Inspect the ICU for jammed paper and remove any paper found. (Avoid touching the waste ink reservoir highlighted in BLUE in the following image.)

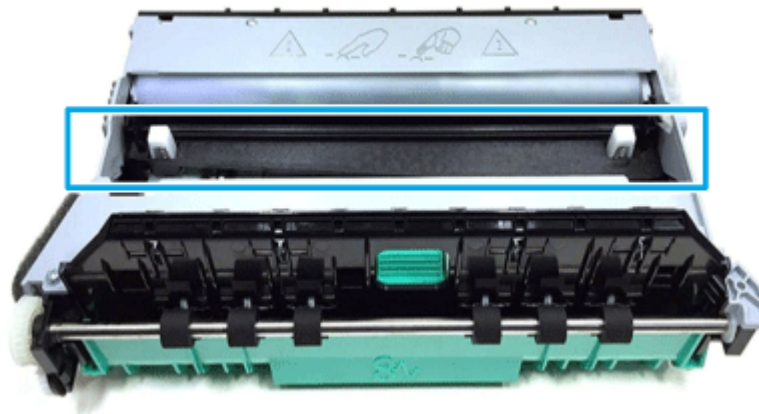


- d. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

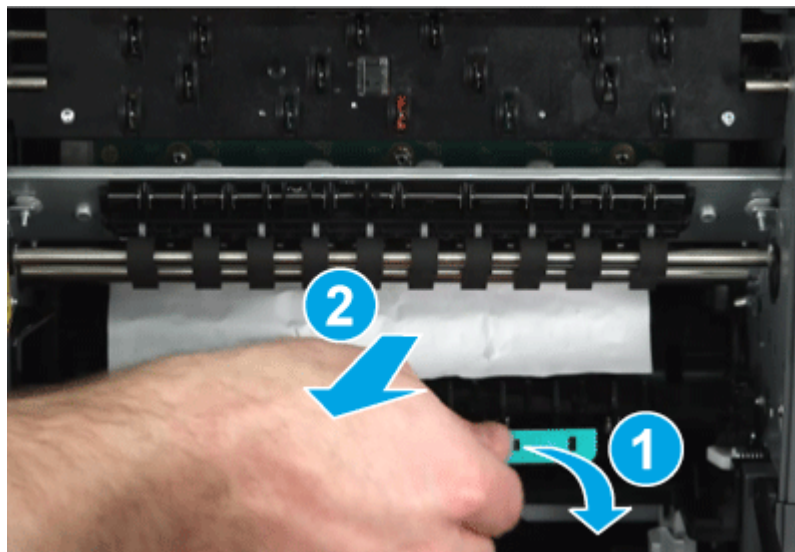

- e. Push the green tab up to put the platen door back into position.

- f. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.

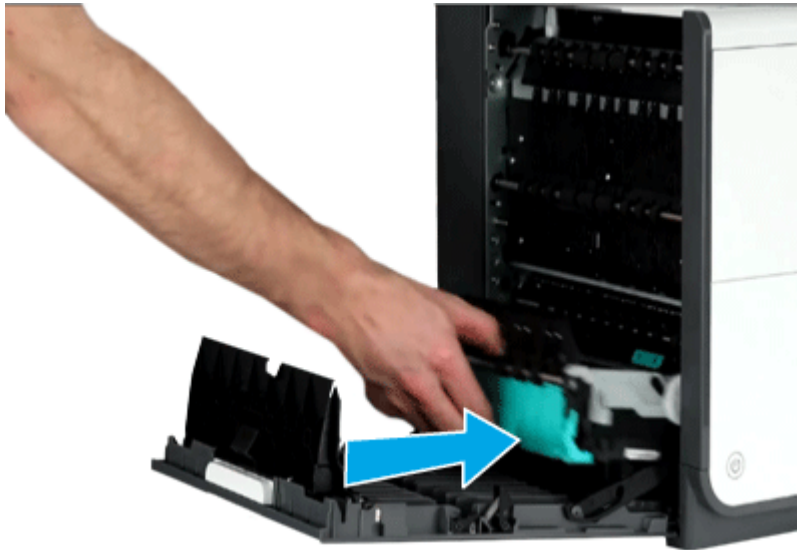

- 3. Remove paper from output bin.

- a. Remove any paper from the output rollers and bin. Pull out the wrinkled paper in the tray and any remaining pieces of paper.



- b. Check if the output bin delivery flap functions correctly or is stuck. Use your finger to open the flap and see if it closes correctly.



NOTE: If you encounter Paper Jam - Clear Output Bin Area / Standard Bin Full investigate the following possible symptoms related to the Output Flap.



- If the output flap is slightly open as pictured or fully open and will not close. Please call HP support.
 - If the output flap doesn't open at all. Please Call HP support.
4. Test the printer to see if the issue is resolved.
 5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam and check the printer for other sheets in the paper path.

For customer troubleshooting steps go to:

[HP PageWide Enterprise Color 556, MFP 586 - Clear jams in Tray 1 \(multipurpose tray\)](#).

2. Clear the paper jam from tray 1.

- a. Remove any and all paper from tray 1.




- b. Return tray 1 to the upright closed position.



3. Remove paper from the left side of the printer.


- a. Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

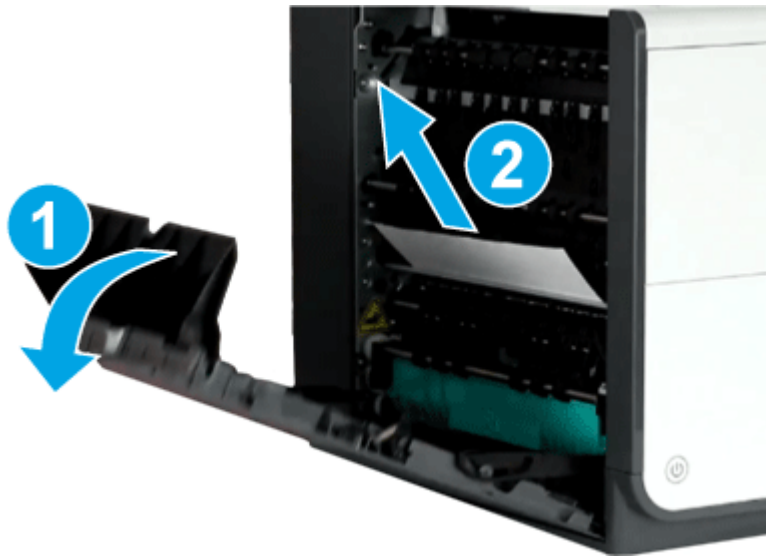


- b. With the left door open, remove ink collection unit (ICU) using the green handle.



- c. Inspect the ICU for jammed paper and remove any paper found. (Avoid touching the waste ink reservoir highlighted in BLUE in the following image.)

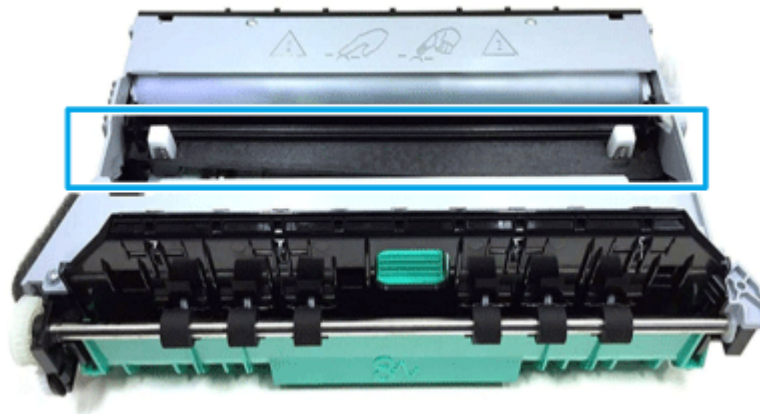

- d. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

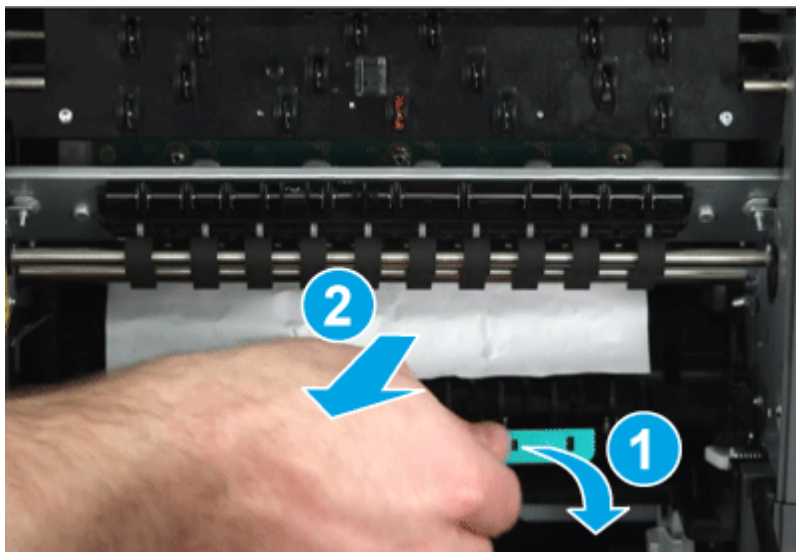

- e. Push the green tab up to put the platen door back into position.

- f. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.



- 4. Remove paper from output bin.
 - a. Remove any paper from the output rollers and bin. Pull out the wrinkled paper in the tray and any remaining pieces of paper.



- b. Check if the output bin delivery flap functions correctly or is stuck. Use your finger to open the flap and see if it closes correctly.



NOTE: If you encounter Paper Jam - Clear Output Bin Area / Standard Bin Full investigate the following possible symptoms related to the Output Flap.



- If the output flap is slightly open as pictured or fully open and will not close, dispatching a technician to replace the following parts.

Output flap / Sensor kit part number: D3Q24-67004

- If the output flap doesn't open at all, dispatching a technician to replace the following parts.

Output drive kit part number: D3Q24-67003

VIDEO: [Resolving Output Bin Full Errors on HP PageWide](https://youtu.be/69zN63uLKEg) <https://youtu.be/69zN63uLKEg>

5. Verify the paper meets the specifications for the tray.
6. Ensure that the tray width setting is set to the size of paper being installed into the tray.
The arrow on the guide should line up exactly with the line for the paper size.
7. Make sure the tray is not loaded above the marking shown on the tray side guide.
How to load paper trays document: <http://www.hp.com/cposupport/en/docs/c04612806.html>
8. If paper is not picking from tray 1, dispatch onsite technician to clean and check pick up rollers and order Duplex drive module - to be replaced. (this motor is also responsible for Tray 1 pick and feed operation).

Duplex drive module part number: D3Q24-67016

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam and check the printer for other sheets in the paper path.

For customer troubleshooting steps go to:

[HP PageWide Enterprise Color 556, MFP 586 - Clear jams in Tray 1 \(multipurpose tray\).](#)

2. Clear the paper jam from tray 1.
 - a. Remove any and all paper from tray 1.




- b. Return tray 1 to the upright closed position.



3. Remove paper from the left side of the printer.


- a. Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

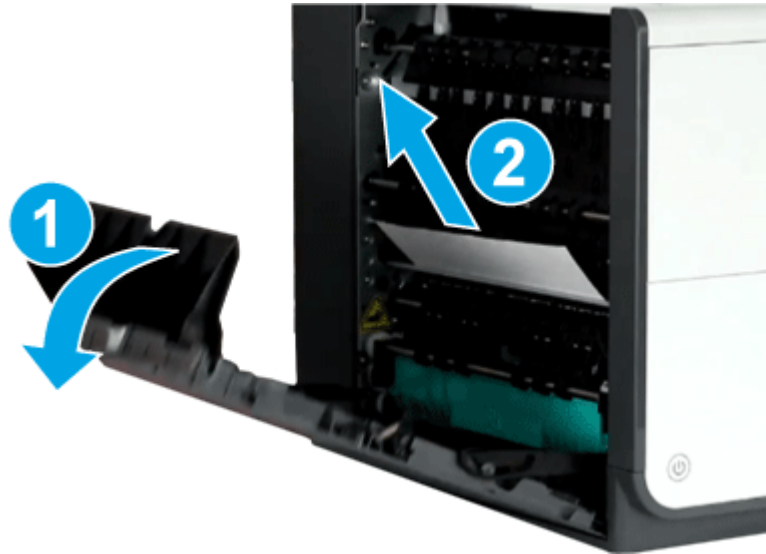


- b. With the left door open, remove ink collection unit (ICU) using the green handle.



- c. Inspect the ICU for jammed paper and remove any paper found. (Avoid touching the waste ink reservoir highlighted in BLUE in the following image.)

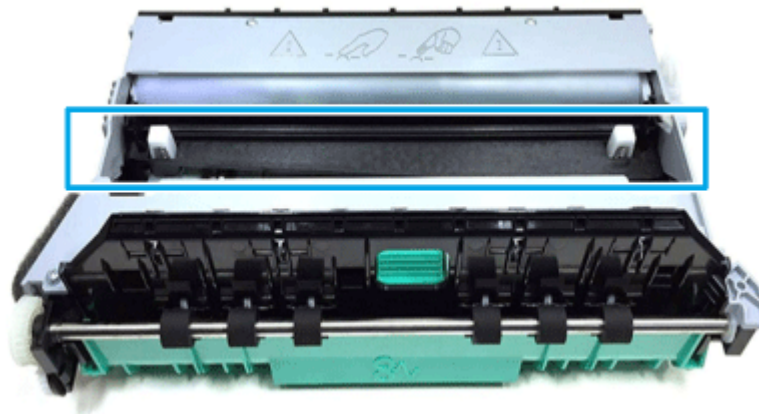


- d. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

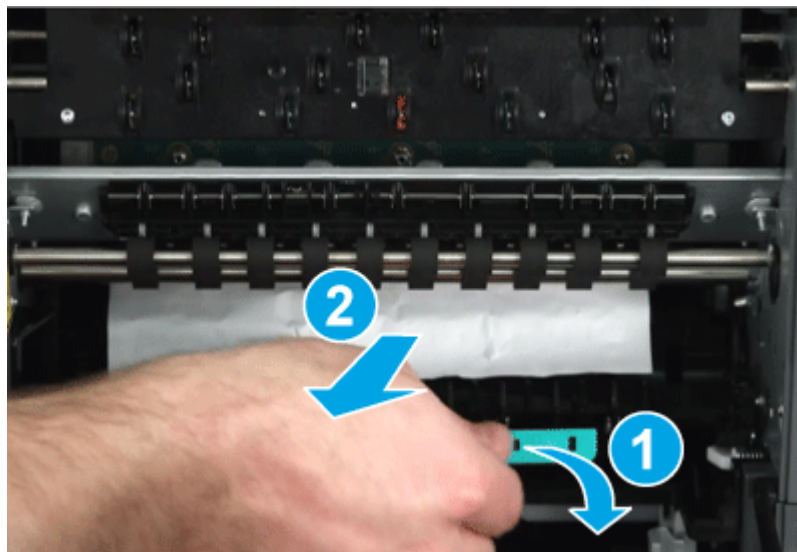

- e. Push the green tab up to put the platen door back into position.

- f. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.

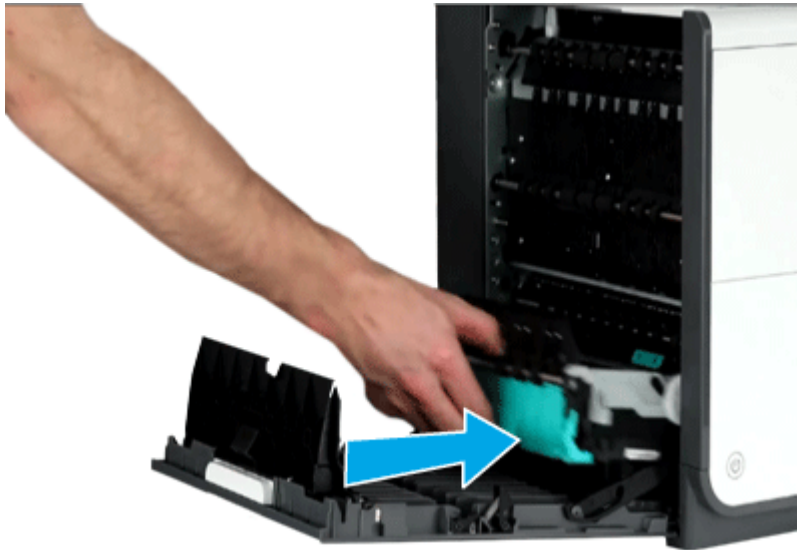

- 4. Remove paper from output bin.

- a. Remove any paper from the output rollers and bin. Pull out the wrinkled paper in the tray and any remaining pieces of paper.



- b. Check if the output bin delivery flap functions correctly or is stuck. Use your finger to open the flap and see if it closes correctly.



NOTE: If you encounter Paper Jam - Clear Output Bin Area / Standard Bin Full investigate the following possible symptoms related to the Output Flap.



- If the output flap is slightly open as pictured or fully open and will not close, replace the following parts.

Output flap / Sensor kit part number: D3Q24-67004


- If the output flap doesn't open at all, replace the following parts.

Output drive kit part number: D3Q24-67003

VIDEO: [Resolving Output Bin Full Errors on HP PageWide](https://youtu.be/69zN63uLKEg) <https://youtu.be/69zN63uLKEg>

5. Verify the paper meets the specifications for the tray.
6. Ensure that the tray width setting is set to the size of paper being installed into the tray.
The arrow on the guide should line up exactly with the line for the paper size.
7. Make sure the tray is not loaded above the marking shown on the tray side guide.
8. If the paper continues to NOT pick from Tray 1, check and clean the pick up rollers with a damp lint free cloth.
9. If the issue persists after cleaning the rollers and rollers do not rotate, test the Duplex drive module using the following steps:

- a. Mark one of the gears on the ICU as shown in the following image.

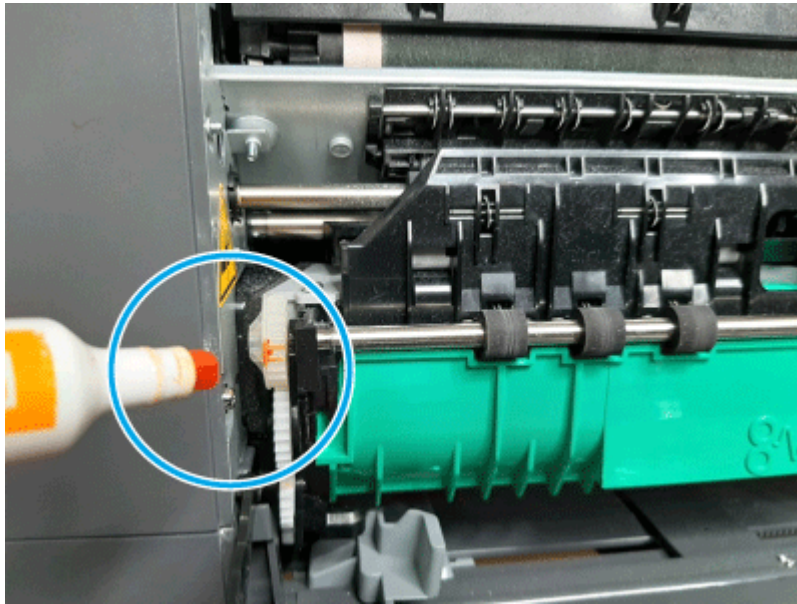


- b. Print a (simplex) job from Tray 1 (source) using the Paper Path Test, **Support Tools > Troubleshooting > Diagnostic Tests > Paper Path Test**.




NOTE: The Duplex Drive and Tray 1 use the same motor.

- c. Open the left door and check if the marked gear has changed position.

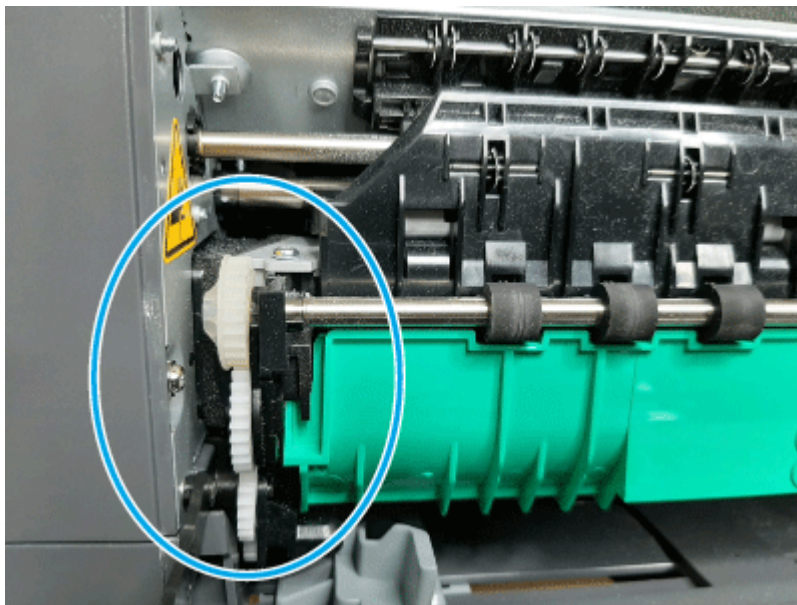

- d. If the gear **DOES NOT** rotate (the mark is in the same place, indicating the gear did not move), replace: the duplex drive module assembly.

Duplex drive module assembly: CN598-67036

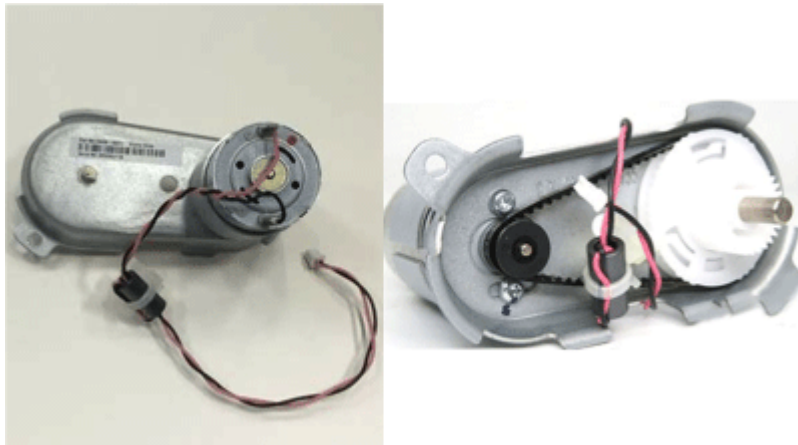

- e. After replacing the Duplex Drive Module, test printer functionality by printing a job from Tray 1.
10. If the gear DOES rotate (the mark is in a different place, indicating the gear has moved) and there is still a duplex jam error, please elevate the case using the Standard Support Process.

15 . AX . Y2 Input Jam

No Pick: "Did not pick page from Tray 2".

This jam occurs when the paper does not reach the Feed roller REDI sensor TOF for Tray 2 in designated amount of time after the start of paper pick-up from Tray 2.

 **NOTE:** *Delay Jam (simplex): This jam occurs when the paper does not reach the Feed roller REDI sensor TOF for in designated amount of time after the start of paper pick-up from Tray X.

 **NOTE:** This device is equipped with "Auto Jam Recovery Feature". This enables the printer to attempt to automatically eject any paper jammed in the paper path to the output bin.

As result of this feature you may not find paper in the paper path.

 **NOTE:** If the error is that the paper does not reach the Feed roller REDI sensor TOF [1], the sensor, should be OK, due the fact that the sensor is capable to receive the light reflected and is working, therefore Root cause could be mechanical


- **15.A0.02:** Input paper jam. There is a paper jam at unknown location at unknown sensor when printing from tray 2.
- **15.A1.D2:** Input paper jam. There is a paper jam at input area at TOF Redi Sensor when printing from tray 2. Delay (simplex)

Recommended action for customers:

Follow these troubleshooting steps in the order presented.

1. For customer troubleshooting steps go to the link provided or follow the instructions listed.
[HP PageWide Enterprise Color 556, MFP 586 - Clear jams in Tray 2](#)
2. Clear the paper jam and check the printer for other sheets in the paper path.

- a. Remove tray 2 from the printer. Grab the tray 2 handle and slide open the tray, with other hand, use your thumb and push corner of the paper tray, then pull out the tray.

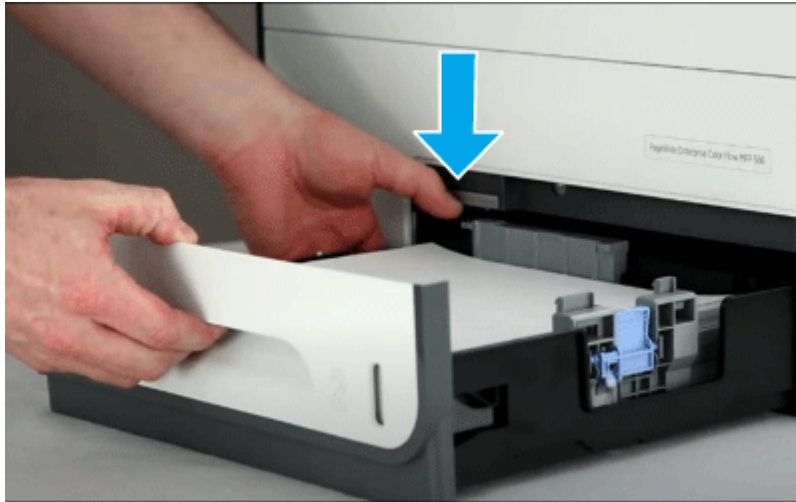


- b. Remove any jammed piece of paper from inside the tray 2 slot.




- c. Remove damaged paper inside tray 2.



- d. Slide tray 2 back into the printer.

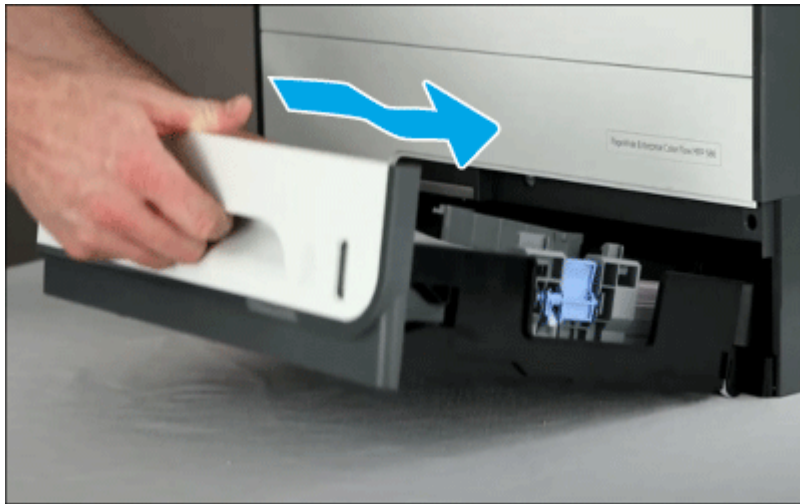


- e. Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

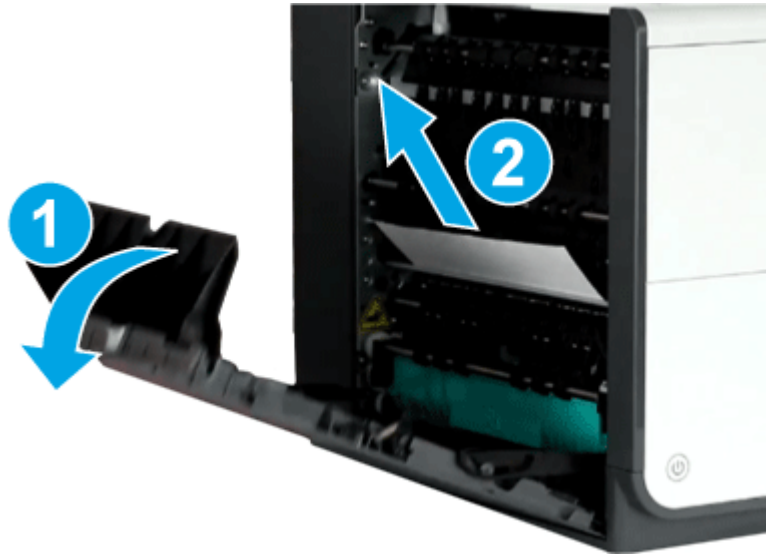


- f. With the left door open, remove ink collection unit (ICU) using the green handle.



- g. Inspect the ICU for jammed paper and remove any paper found. (Avoid touching the waste ink reservoir highlighted in BLUE in the following image.)

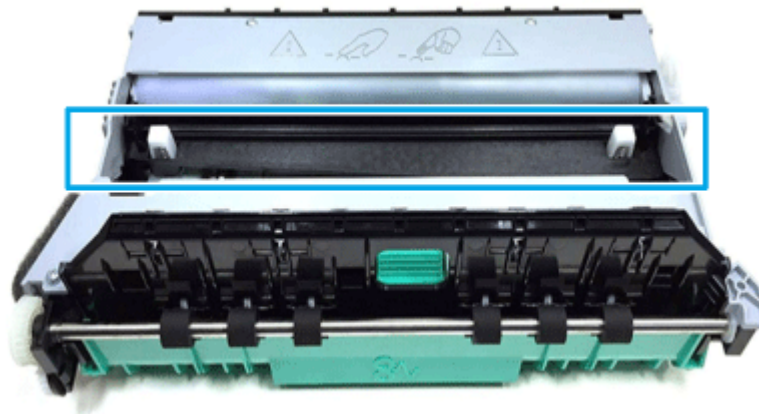


- h. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

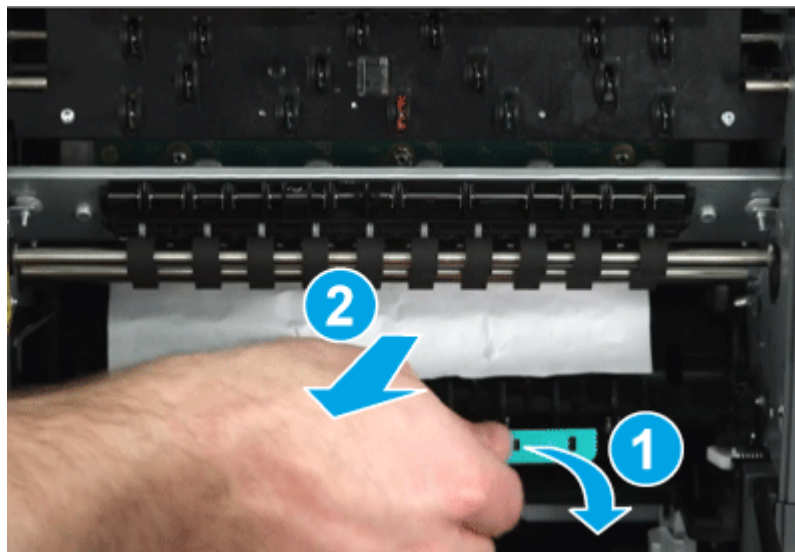

- i. Push the green tab up to put the platen door back into position.

- j. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.

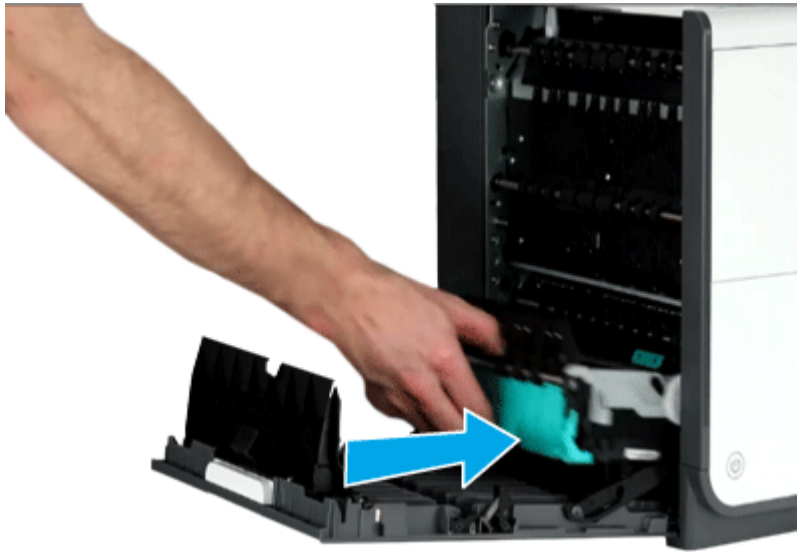

- k. Remove any paper from the output rollers and bin. Pull out the wrinkled paper in the tray and any remaining pieces of paper.



- l. Check if the output bin delivery flap functions correctly or is stuck. Use your finger to open the flap and see if it closes correctly.



NOTE: If you encounter Paper Jam - Clear Output Bin Area / Standard Bin Full investigate the following possible symptoms related to the Output Flap.



- If the output flap is slightly open as pictured or fully open and will not close. Please call HP support.
 - If the output flap doesn't open at all. Please Call HP support.
3. If paper is still jamming in tray 2, try printing a job from another tray. If jamming is also occurring when printing from other trays, follow the instructions for the new error code presented.
 4. If the issue ONLY happens from Tray 2, use the following troubleshooting:
 - a. Check Tray 2 pick and feed rollers for wear, damage or a build-up of paper dust.
 - b. Clean the rollers with a damp lint free cloth, or replace rollers as needed.

[How to Repair the Tray 2 Rollers on the HP PageWide Enterprise Color 556 Printer](#)
 5. Load Tray 2 with fresh paper and test the tray. If it prints fine with new media, the printer hardware is OK and the paper and acclimation of media need to be investigated.
 6. Verify the paper meets the specifications for the tray.


[HP PageWide Enterprise and HP Managed Color Printers and MFP - Media guide](#)
 7. Ensure that the tray width setting is set to the size of paper being installed into the tray.

The arrow on the guide should line up exactly with the line for the paper size.
 8. Make sure the tray is not loaded above the marking shown on the tray side guide.

How to load paper trays document:<http://www.hp.com/cposupport/en/docs/c05426973.html>
 9. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

1. For customer troubleshooting steps go to the link provided or follow the instructions listed.
[HP PageWide Enterprise Color 556, MFP 586 - Clear jams in Tray 2](#)
2. Clear the paper jam and check the printer for other sheets in the paper path.
 - a. Remove tray 2 from the printer. Grab the tray 2 handle and slide open the tray, with other hand, use your thumb and push corner of the paper tray, then pull out the tray.

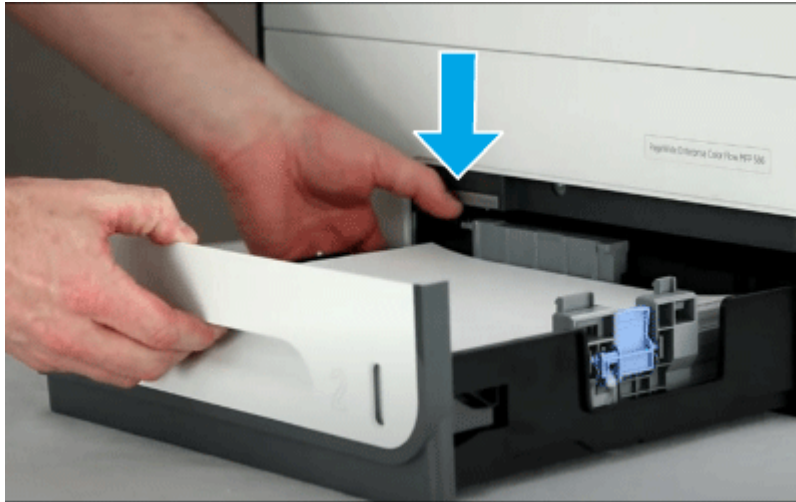


- b. Remove any jammed piece of paper from inside the tray 2 slot.




- c. Remove damaged paper inside tray 2.



- d. Slide tray 2 back into the printer.

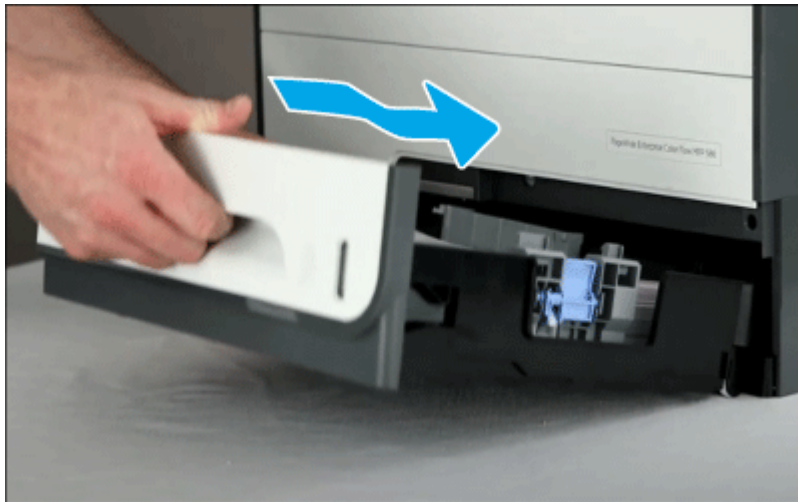


- e. Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

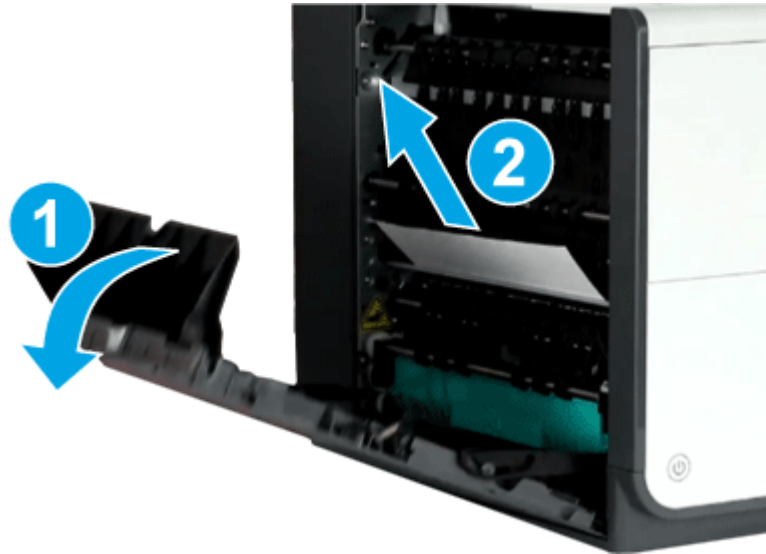


- f. With the left door open, remove ink collection unit (ICU) using the green handle.



- g. Inspect the ICU for jammed paper and remove any paper found. (Avoid touching the waste ink reservoir highlighted in BLUE in the following image.)

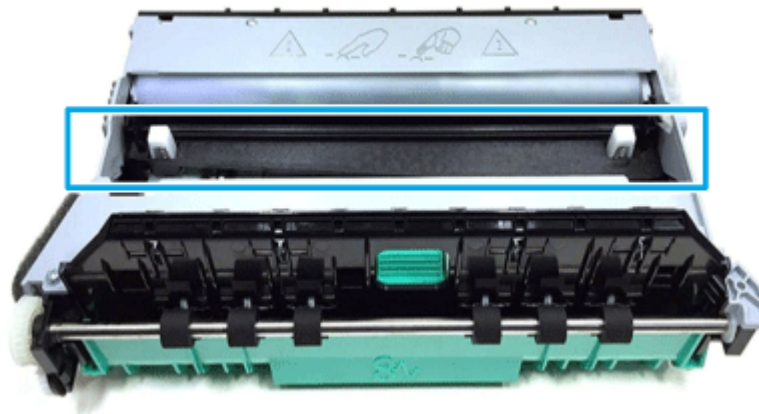


- h. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

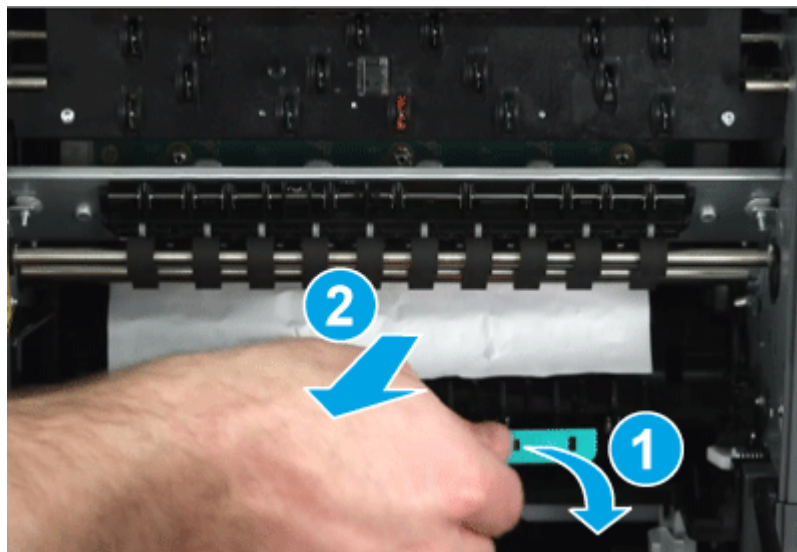

- i. Push the green tab up to put the platen door back into position.

- j. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.

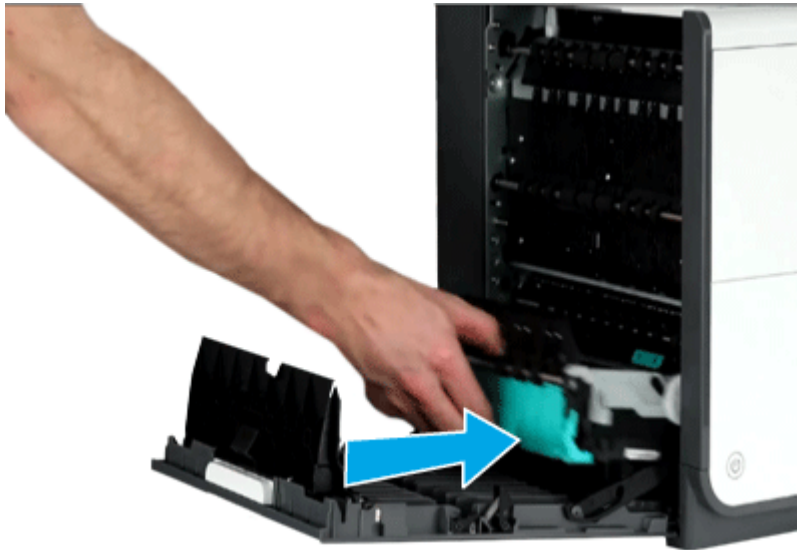

- k. Remove any paper from the output rollers and bin. Pull out the wrinkled paper in the tray and any remaining pieces of paper.



- l. Check if the output bin delivery flap functions correctly or is stuck. Use your finger to open the flap and see if it closes correctly.



NOTE: If you encounter Paper Jam - Clear Output Bin Area / Standard Bin Full investigate the following possible symptoms related to the Output Flap.



- If the output flap is slightly open as pictured or fully open and will not close, dispatching a technician to replace the following parts.

Output flap / Sensor kit part number: D3Q24-67004

- If the output flap doesn't open at all, dispatching a technician to replace the following parts.

Output drive kit part number: D3Q24-67003

3. If paper is still jamming in tray 2, try printing a job from another tray. If jamming is also occurring when printing from other trays, follow the instructions for the new error code presented.
4. If the issue ONLY happens from Tray 2, use the following troubleshooting:

- a. Check Tray 2 pick and feed rollers for wear, damage or a build-up of paper dust.
- b. Clean the rollers with a damp lint free cloth.

[How to Repair the Tray 2 Rollers on the HP PageWide Enterprise Color 556 Printer](#)

5. Load Tray 2 with fresh paper and test the tray. If it prints fine with new media, the printer hardware is OK and the paper and acclimation of media need to be investigated.
6. Verify the paper meets the specifications for the tray.

[HP PageWide Enterprise and HP Managed Color Printers and MFP - Media guide](#)

7. Ensure that the tray width setting is set to the size of paper being installed into the tray.

The arrow on the guide should line up exactly with the line for the paper size.

8. Make sure the tray is not loaded above the marking shown on the tray side guide.

How to load paper trays document: <http://www.hp.com/cposupport/en/docs/c05426973.html>

9. If the issue persists, dispatch a technician with separation pick-up roller assembly - For tray 2.

Separation pick-up roller assembly - For tray 2 - CN598-67018


Recommended action for call agents and service technicians

1. For customer troubleshooting steps go to the link provided or follow the instructions listed.

[HP PageWide Enterprise Color 556, MFP 586 - Clear jams in Tray 2](#)

2. Clear the paper jam and check the printer for other sheets in the paper path.

- a. Remove tray 2 from the printer. Grab the tray 2 handle and slide open the tray, with other hand, use your thumb and push corner of the paper tray, then pull out the tray.

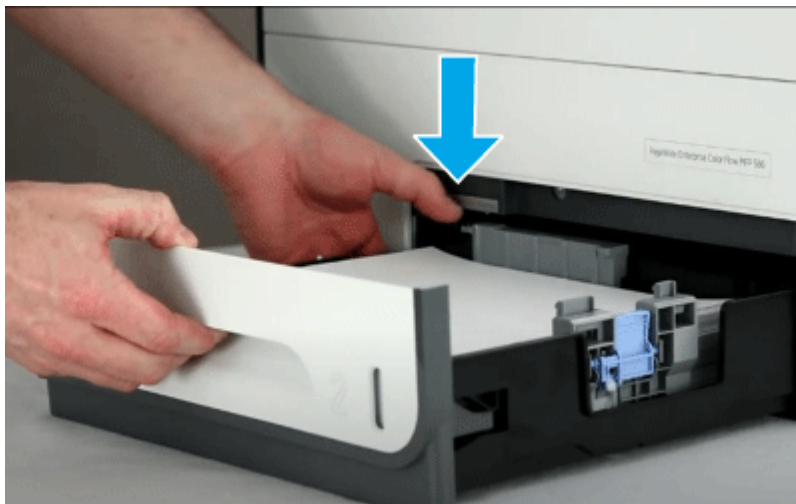


- b. Remove any jammed piece of paper from inside the tray 2 slot.




- c. Remove damaged paper inside tray 2.



- d. Slide tray 2 back into the printer.

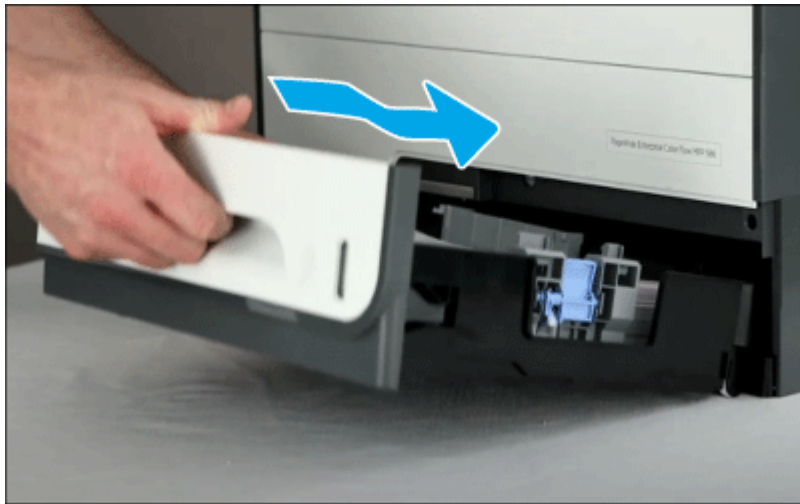


- e. Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

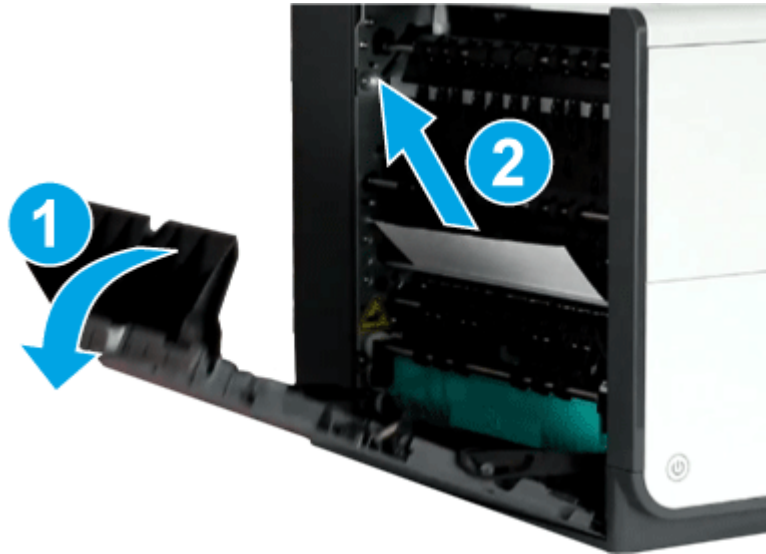


- f. With the left door open, remove ink collection unit (ICU) using the green handle.



- g. Inspect the ICU for jammed paper and remove any paper found. (Avoid touching the waste ink reservoir highlighted in BLUE in the following image.)

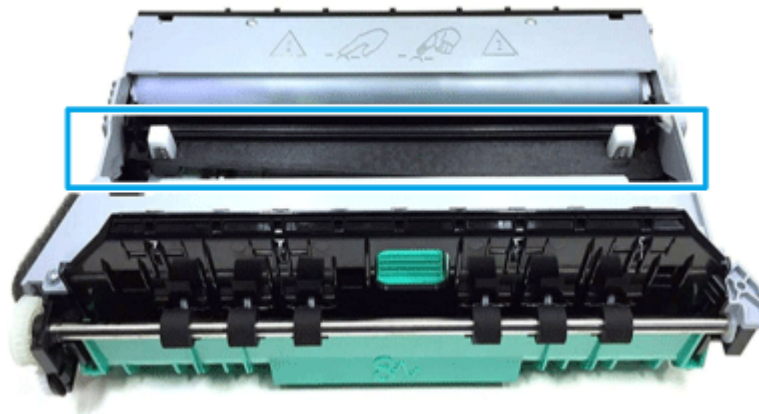


- h. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

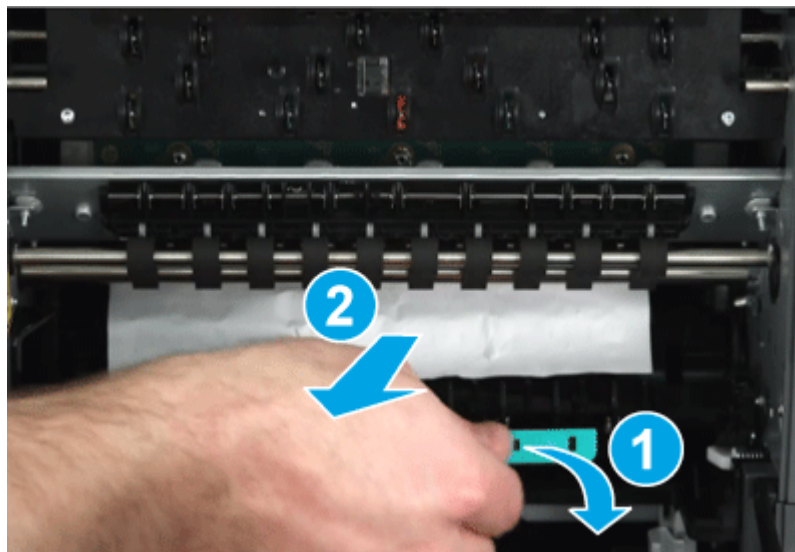

- i. Push the green tab up to put the platen door back into position.

- j. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.

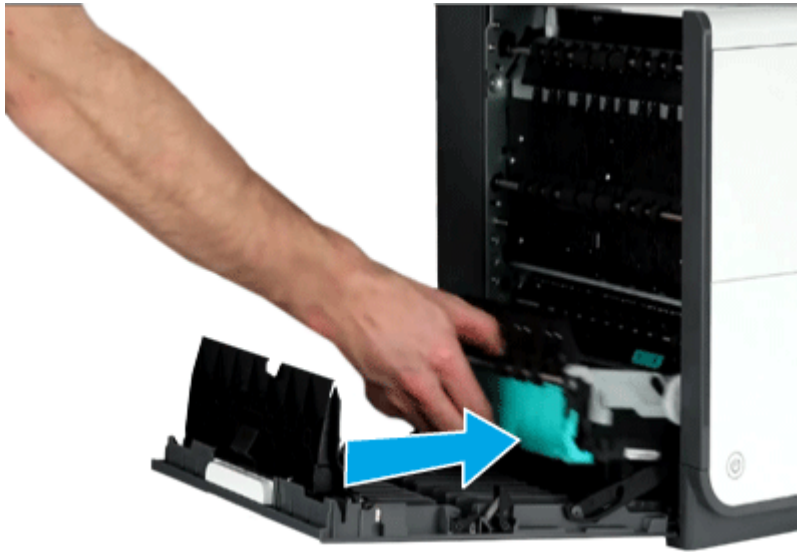

- k. Remove any paper from the output rollers and bin. Pull out the wrinkled paper in the tray and any remaining pieces of paper.



- l. Check if the output bin delivery flap functions correctly or is stuck. Use your finger to open the flap and see if it closes correctly.



NOTE: If you encounter Paper Jam - Clear Output Bin Area / Standard Bin Full investigate the following possible symptoms related to the Output Flap.



- If the output flap is slightly open as pictured or fully open and will not close, dispatching a technician to replace the following parts.

Output flap / Sensor kit part number: D3Q24-67004

- If the output flap doesn't open at all, dispatching a technician to replace the following parts.

Output drive kit part number: D3Q24-67003

3. If paper is still jamming in tray 2, try printing a job from another tray. If jamming is also occurring when printing from other trays, follow the instructions for the new error code presented.
4. If the issue ONLY happens from Tray 2, use the following troubleshooting:

- a. Check Tray 2 pick and feed rollers for wear, damage or a build-up of paper dust.
- b. Clean the rollers with a damp lint free cloth.

[How to Repair the Tray 2 Rollers on the HP PageWide Enterprise Color 556 Printer](#)

5. Load Tray 2 with fresh paper and test the tray. If it prints fine with new media, the printer hardware is OK and the paper and acclimation of media need to be investigated.
6. Verify the paper meets the specifications for the tray.

[HP PageWide Enterprise and HP Managed Color Printers and MFP - Media guide](#)

7. Ensure that the tray width setting is set to the size of paper being installed into the tray.

The arrow on the guide should line up exactly with the line for the paper size.

8. Make sure the tray is not loaded above the marking shown on the tray side guide.

How to load paper trays document: <http://www.hp.com/cposupport/en/docs/c05426973.html>

9. If the issue persists, dispatch a technician with separation pick-up roller assembly - For tray 2.

Separation pick-up roller assembly - For tray 2 - CN598-67018

15 . A x . y 3 Input Jam

No Pick "Did not pick page from Tray 3"

This jam occurs when the paper does not reach the Feed roller REDI sensor TOF for Tray 3 in designated amount of time after the start of paper pick-up from Tray 3.



NOTE: This device is equipped with "Auto Jam Recovery Feature". This enables the printer to attempt to automatically eject any paper jammed in the paper path to the output bin.

As result of this feature you may not find paper in the paper path.



NOTE: If the error is that the paper does not reach the Feed roller REDI sensor TOF [1], the sensor, should be OK, due the fact that the sensor is capable to receive the light reflected and is working, therefore Root cause could be mechanical

- **15.A0.03:** Input paper jam. There is a paper jam at unknown location at unknown sensor when printing from tray 3.
- **15.A1.D3:** Input paper jam. There is a paper jam at input area at TOF Redi Sensor when printing from tray 3. Delay (simplex)

Recommended action for customers:

Follow these troubleshooting steps in the order presented.

1. For customer troubleshooting steps go to the link provided or follow the instructions listed.

[HP PageWide Enterprise Color 556, MFP 586 - Clear jams in Tray 3](#)

2. Clear paper from the side cabinet door.

- a. Open the left side cabinet door.



- b. Remove damaged paper inside tray 3.




- c. Remove any jammed piece of paper from inside the tray 3 slot.



- d. Slide tray 3 back into the printer.


- e. Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

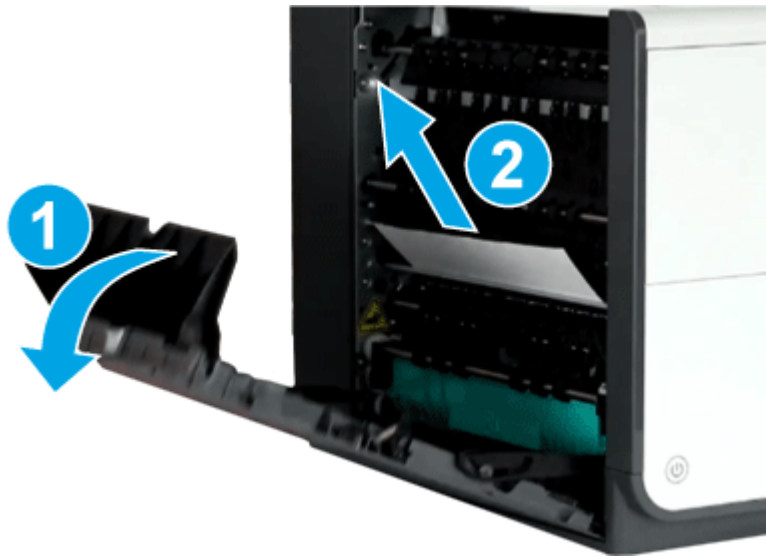


- f. With the left door open, remove ink collection unit (ICU) using the green handle.



- g. Inspect the ICU for jammed paper and remove any paper found. (Avoid touching the waste ink reservoir highlighted in BLUE in the following image.)

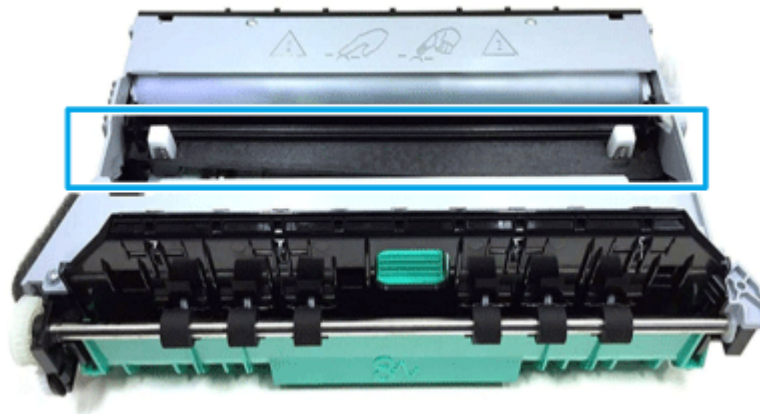

- h. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

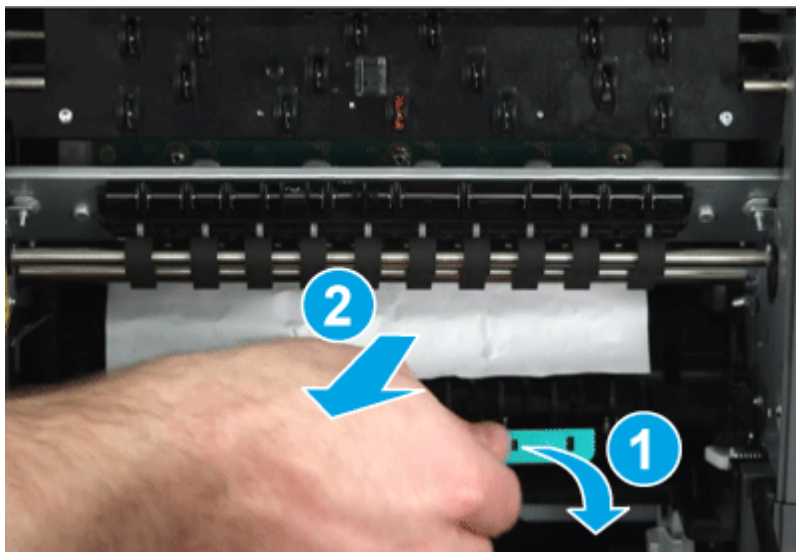

- i. Push the green tab up to put the platen door back into position.

- j. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.



- k. Remove any paper from the output rollers and bin. Pull out the wrinkled paper in the tray and any remaining pieces of paper.



- l. Check if the output bin delivery flap functions correctly or is stuck. Use your finger to open the flap and see if it closes correctly.



NOTE: If you encounter Paper Jam – Clear Output Bin Area / Standard Bin Full investigate the following possible symptoms related to the Output Flap.



- If the output flap is slightly open as pictured or fully open and will not close. Please call HP support.
 - If the output flap doesn't open at all. Please Call HP support.
4. If paper is still jamming in tray 3, try printing a job from another tray. If jamming is also occurring when printing from other trays, follow the instructions for the new error code presented.
 5. If the issue ONLY happens from Tray 3, use the following troubleshooting:
 - a. Check Tray 3 pick and feed rollers for wear, damage or a build-up of paper dust.
 - b. Clean the rollers with a damp lint free cloth, or replace rollers as needed.
 6. Verify the paper meets the specifications for the tray.
[HP PageWide Enterprise and HP Managed Color Printers and MFP - Media guide](#)
 7. Ensure that the tray width setting is set to the size of paper being installed into the tray.
 The arrow on the guide should line up exactly with the line for the paper size.
 8. Make sure the tray is not loaded above the marking shown on the tray side guide.
 How to load paper trays document: <http://www.hp.com/cposupport/en/docs/c05426973.html>
 9. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

1. For customer troubleshooting steps go to the link provided or follow the instructions listed.
[HP PageWide Enterprise Color 556, MFP 586 - Clear jams in Tray 3](#)
2. Clear paper from the side cabinet door.
 - a. Open the left side cabinet door.



- b. Remove paper jam and then close the cabinet door.




3. Clear the paper jam and check the printer for other sheets in the paper path.

- a. Remove any jammed piece of paper from inside the tray 3 slot.




- b. Slide tray 3 back into the printer.
- c. Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

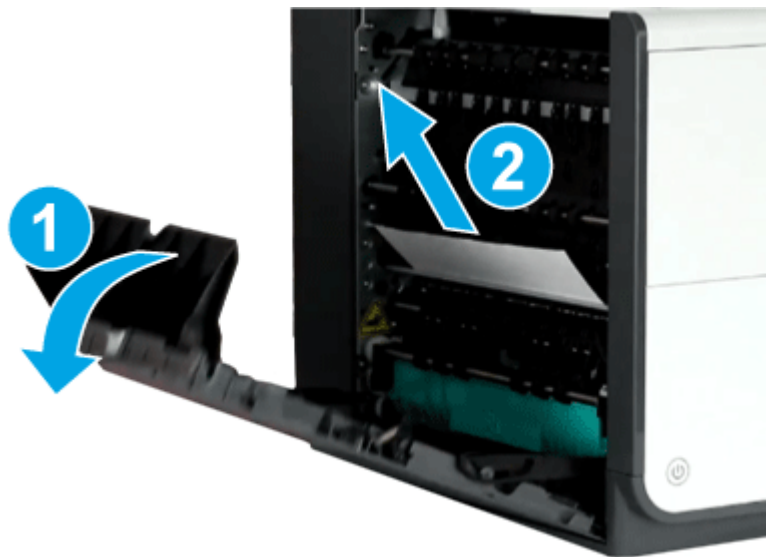


- d. With the left door open, remove ink collection unit (ICU) using the green handle.




- e. Inspect the ICU for jammed paper and remove any paper found. (Avoid touching the waste ink reservoir highlighted in BLUE in the following image.)

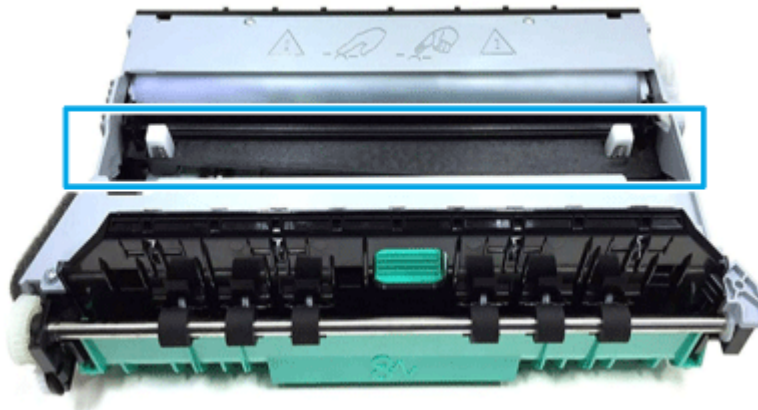

- f. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

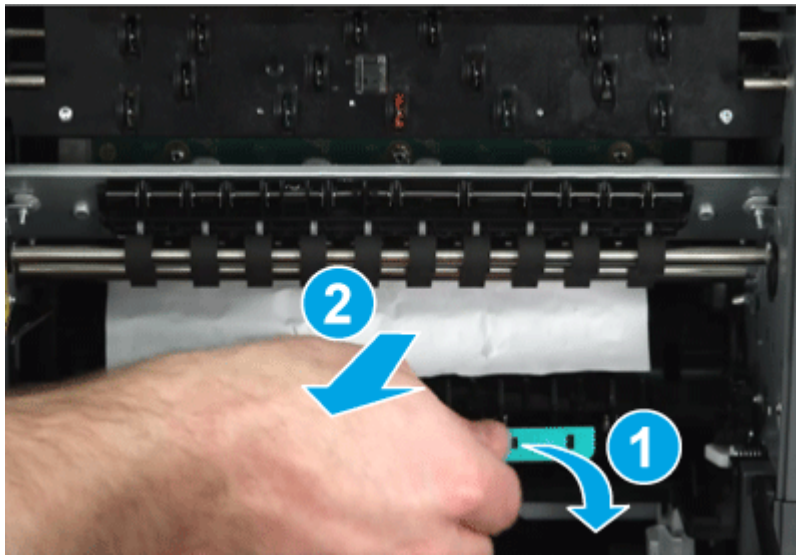

- g. Push the green tab up to put the platen door back into position.
- h. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.

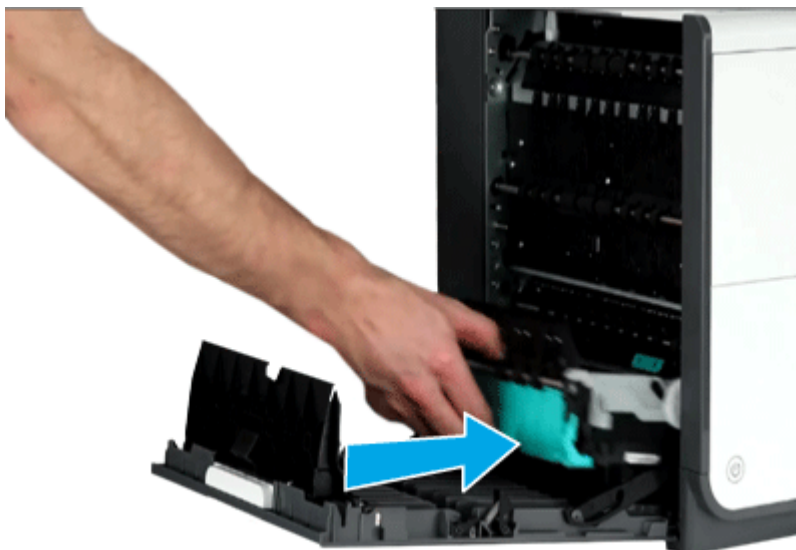

- i. Remove any paper from the output rollers and bin. Pull out the wrinkled paper in the tray and any remaining pieces of paper.



- i. Check if the output bin delivery flap functions correctly or is stuck. Use your finger to open the flap and see if it closes correctly.



NOTE: If you encounter Paper Jam - Clear Output Bin Area / Standard Bin Full investigate the following possible symptoms related to the Output Flap.



- If the output flap is slightly open as pictured or fully open and will not close, dispatching a technician to replace the following parts.

Output flap / Sensor kit part number: D3Q24-67004

- If the output flap doesn't open at all, dispatching a technician to replace the following parts.

Output drive kit part number: D3Q24-67003

4. If paper is still jamming in tray 3, try printing a job from another tray. If jamming is also occurring when printing from other trays, follow the instructions for the new error code presented.
5. If the issue ONLY happens from Tray 3, use the following troubleshooting:
 - a. Check Tray 3 pick and feed rollers for wear, damage or a build-up of paper dust.
 - b. Clean the rollers with a damp lint free cloth.
6. Load Tray 3 with fresh paper and test the tray. If it prints fine with new media, the printer hardware is OK and the paper and acclimation of media need to be investigated.
7. Verify the paper meets the specifications for the tray.
[HP PageWide Enterprise and HP Managed Color Printers and MFP - Media guide](#)
8. Ensure that the tray width setting is set to the size of paper being installed into the tray.
 The arrow on the guide should line up exactly with the line for the paper size.
9. Make sure the tray is not loaded above the marking shown on the tray side guide.
 How to load paper trays document: <http://www.hp.com/cposupport/en/docs/c05426973.html>
10. If the issue persists, dispatch a technician with a pick-up and separation roller assembly - For tray 3.
 Pick-up and separation roller assembly - For tray 3 - D3Q21-67002

Recommended action for service technicians

1. For customer troubleshooting steps go to the link provided or follow the instructions listed.
[HP PageWide Enterprise Color 556, MFP 586 - Clear jams in Tray 3](#)
2. Clear paper from the side cabinet door.
 - a. Open the left side cabinet door.



- b.** Remove paper jam and then close the cabinet door.




3. Clear the paper jam and check the printer for other sheets in the paper path.

- a.** Remove any jammed piece of paper from inside the tray 3 slot.



- b.** Slide tray 3 back into the printer.


- c. Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

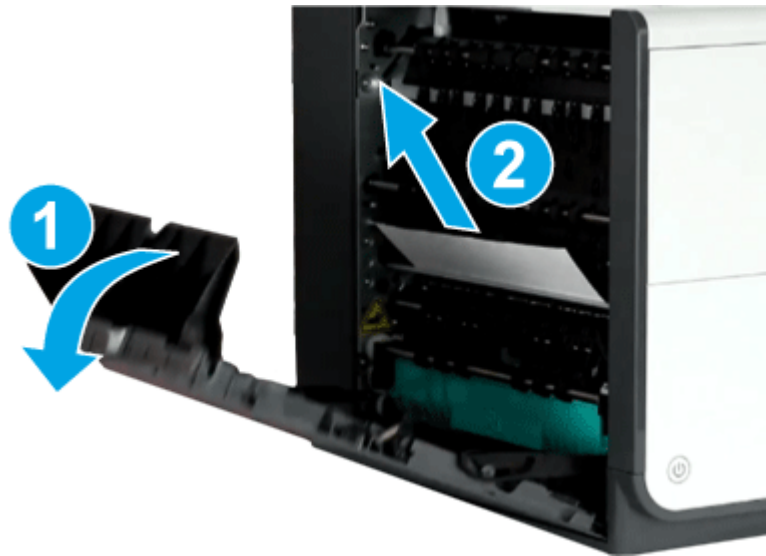


- d. With the left door open, remove ink collection unit (ICU) using the green handle.



- e. Inspect the ICU for jammed paper and remove any paper found. (Avoid touching the waste ink reservoir highlighted in BLUE in the following image.)

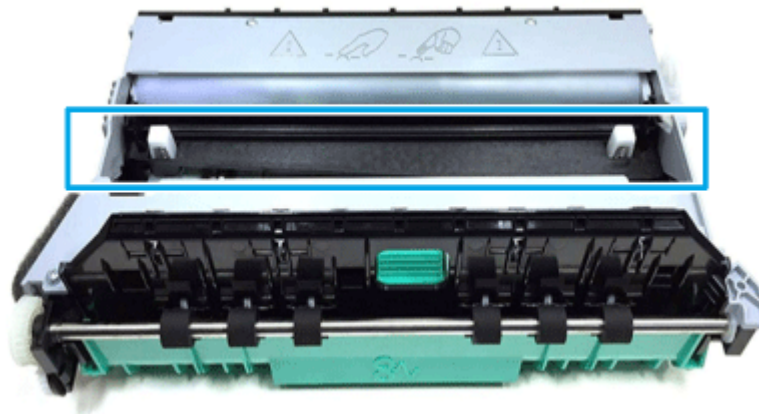


- f. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

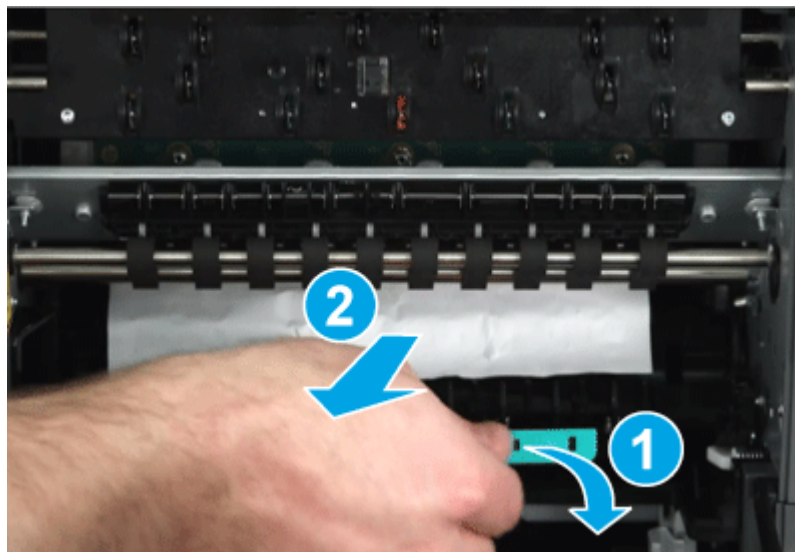

- g. Push the green tab up to put the platen door back into position.

- h. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.

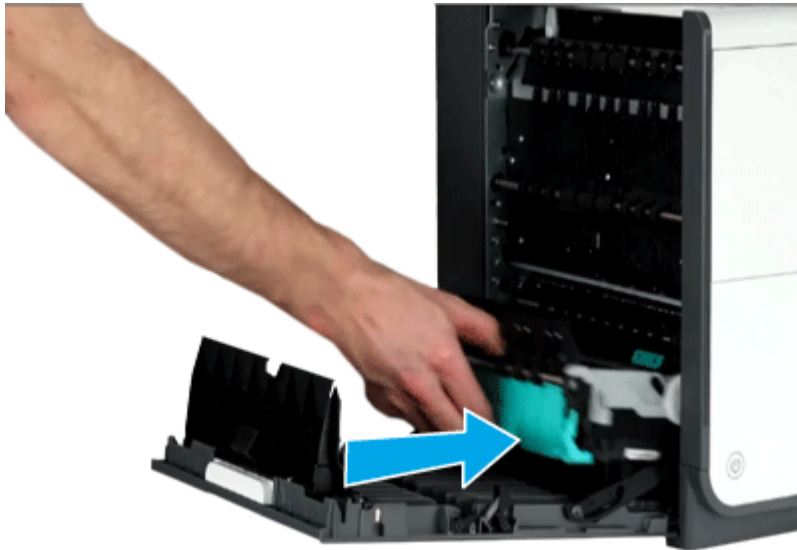

- i. Remove any paper from the output rollers and bin. Pull out the wrinkled paper in the tray and any remaining pieces of paper.



- j. Check if the output bin delivery flap functions correctly or is stuck. Use your finger to open the flap and see if it closes correctly.



NOTE: If you encounter Paper Jam - Clear Output Bin Area / Standard Bin Full investigate the following possible symptoms related to the Output Flap.



- If the output flap is slightly open as pictured or fully open and will not close, dispatching a technician to replace the following parts.

Output flap / Sensor kit part number: D3Q24-67004

- If the output flap doesn't open at all, dispatching a technician to replace the following parts.

Output drive kit part number: D3Q24-67003

4. Verify the paper meets the specifications for the tray.

[HP PageWide Enterprise and HP Managed Color Printers and MFP - Media guide](#)

5. Ensure that the tray width setting is set to the size of paper being installed into the tray.

The arrow on the guide should line up exactly with the line for the paper size.

6. Make sure the tray is not loaded above the marking shown on the tray side guide.

How to load paper trays document: <http://www.hp.com/cposupport/en/docs/c05426973.html>

7. Ensure the tray 3 pick-sensor flag is not out of position (Callout 2). If it is out of position, gently move the lever to the correct position (Callout 1) as seen in the following images:

Figure 6-11 Flag lever in correct position


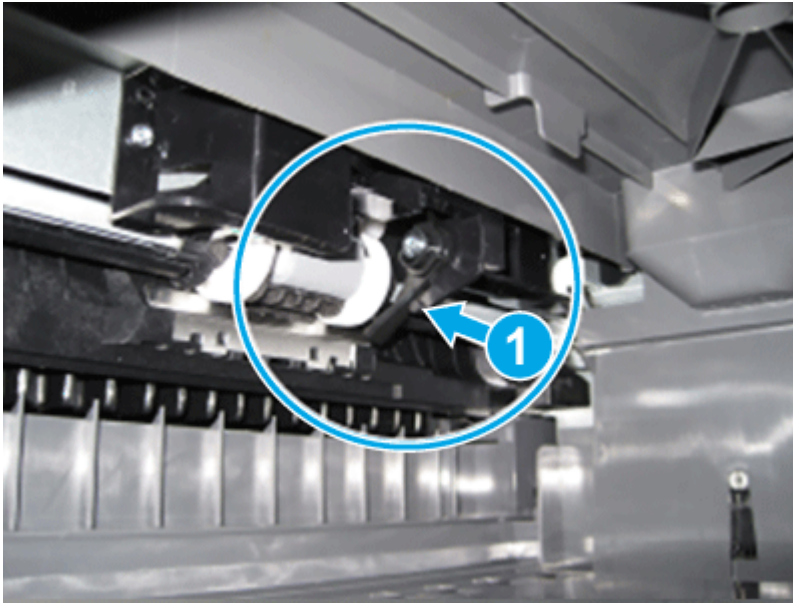


Figure 6-12 Flag lever out of position (Incorrect)

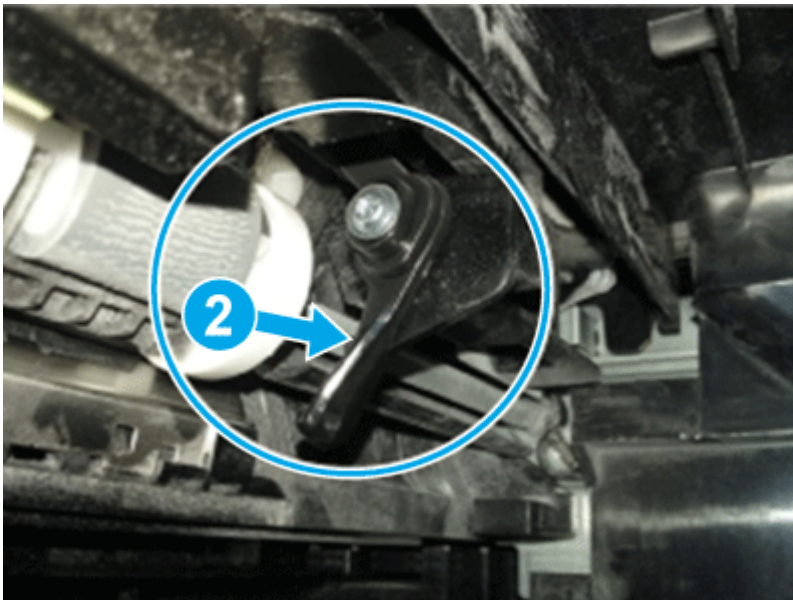

8. If paper is still jamming in tray 3, try printing a job from another tray. If jamming is also occurring when printing from other trays, follow the instructions for the new error code presented.
9. If the issue ONLY happens from Tray 3, use the following troubleshooting:
 - a. Check Tray 3 pick and feed rollers for wear, damage or a build-up of paper dust.
 - b. Clean the rollers with a damp lint free cloth.

Pick-up and separation roller assembly - For tray 3 - D3Q21-67002

10. Run the Paper Path Diagnostics procedure to move paper from the tray to the output bin.
Administration > Troubleshooting > Paper Path Page.
11. If the issue persists, elevate the case using the Standard Support Process.

15 . Bx . yz Image Area (Print Zone) Jam from Tray X

A print zone jam occurred when printing from tray "x".



NOTE: This device is equipped with "Auto Jam Recovery Feature". This enables the printer to attempt to automatically eject any paper jammed in the paper path to the output bin.

As result of this feature you may not find paper in the paper path.

Example: Image Area STAY jam printing from tray 3.

- **15.B0.00 :** Print zone paper jam. There is a paper jam in the print zone when printing from an unknown tray.
- **15.B0.01 :** Print zone paper jam. There is a paper jam in the print zone when printing from tray 1. Print zone paper jam. There is a paper jam in the print zone when printing from an unknown tray.
- **15.B0.02 :** Print zone paper jam. There is a paper jam in the print zone when printing from tray 2 (main).
- **15.B0.03 :** Print zone paper jam. There is a paper jam in the print zone when printing from tray 3.
- **15.B1.A0 :** Print zone paper jam. There is a paper stay jam in the print zone at TOF (feed roller) sensor when printing from an unknown tray (page never left the sensor).
- **15.B1.A1 :** Print zone paper jam. There is a paper stay jam in the print zone at TOF (feed roller) sensor when printing from tray 1 (page never left the sensor).
- **15.B1.A2 :** Print zone paper jam. There is a paper stay jam in the print zone at TOF (feed roller) sensor when printing from tray 2 (page never left the sensor).
- **15.B1.A3 :** Print zone paper jam. There is a paper stay jam in the print zone at TOF (feed roller) sensor when printing from tray 3 (page never left the sensor).
- **15.B2.A0 :** Print zone paper jam. There is a paper stay jam in the print zone at PZ (star wheel) sensor when printing from an unknown tray.
- **15.B2.A1 :** Print zone paper jam. There is a paper stay jam in the print zone at PZ (star wheel) sensor when printing from tray 1.
- **15.B2.A2 :** Print zone paper jam. There is a paper stay jam in the print zone at PZ (star wheel) sensor when printing from tray 2.
- **15.B2.A3 :** Print zone paper jam. There is a paper stay jam in the print zone at PZ (star wheel) sensor when printing from tray 3.
- **15.B2.E0 :** Print zone paper jam. There is a paper stay jam in the print zone at PZ (star wheel) sensor when printing from an unknown tray (Door opened during printing).
- **15.B2.E1 :** Print zone paper jam. There is a paper stay jam in the print zone at PZ (star wheel) sensor when printing from tray 1 (Door opened during printing).
- **15.B2.E2 :** Print zone paper jam. There is a paper stay jam in the print zone at PZ (star wheel) sensor when printing from tray 2 (Door opened during printing).

- **15.B2.E3** : Print zone paper jam. There is a paper stay jam in the print zone at PZ (star wheel) sensor when printing from tray 3 (Door opened during printing).
- **15.B0.F0** : Print zone paper jam. There is a paper stay jam in the print zone at unknown sensor from an unknown tray. (power on jam)
- **15.B1.F0** : Print zone paper jam. There is a paper stay jam in the print zone at TOF (feed roller) sensor when printing from an unknown tray (power on jam).
- **15.B0.00** : Print zone paper jam. There is a paper jam in the print zone when printing from an unknown tray.
- **15.B1.F1** : Print zone paper jam. There is a paper stay jam in the print zone at TOF (feed roller) sensor when printing from tray 1 (power on jam).
- **15.B1.F2** : Print zone paper jam. There is a paper stay jam in the print zone at TOF (feed roller) sensor when printing from tray 2 (power on jam).
- **15.B1.F3** : Print zone paper jam. There is a paper stay jam in the print zone at TOF (feed roller) sensor when printing from tray 3 (power on jam).
- **15.B2.F0** : Print zone paper jam. There is a paper stay jam in the print zone at TOF (feed roller) sensor when printing from an unknown tray (power on jam).
- **15.B0.00** : Print zone paper jam. There is a paper jam in the print zone when printing from an unknown tray.
- **15.B2.F1** : Print zone paper jam. There is a paper stay jam in the print zone at TOF (feed roller) sensor when printing from tray 1 (power on jam).
- **15.B0.00** : Print zone paper jam. There is a paper jam in the print zone when printing from an unknown tray.
- **15.B2.F2** : Print zone paper jam. There is a paper stay jam in the print zone at TOF (feed roller) sensor when printing from tray 2 (power on jam).
- **15.B2.F3** : Print zone paper jam. There is a paper stay jam in the print zone at TOF (feed roller) sensor when printing from tray 3 (power on jam).

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam and check the printer for other sheets in the paper path.



NOTE: The following content is for the PageWide Pro A4 series printers. However, the troubleshooting is applicable to the PageWide A4 Enterprise printers as well. The hardware is the same, but the error codes and interface are different.

Use these links to help troubleshoot the jam issue, or skip to the next main step for step by step instructions.

- a. This document contains several troubleshooting methods for clearing a paper jam. Try the following solutions in the order presented to resolve the paper jam issue. If any of the solutions resolve the issue, you do not need to continue troubleshooting.

[HP PageWide 300, 400, 500 series - Resolve paper jams, "Print Zone" jams, and "0x61000013" error](#)

[Clearing Print Zone Paper Jams](#)

- b. This document provides information on clearing jams in the output area:

[How to Clear a Paper Jam in the Output Bin Area on the HP PageWide Enterprise Color 586 MFP Printer](#)

- c. This document provides information on ensuring the paper is loaded correctly and the appropriate paper tray settings are set:

[HP LaserJet, HP PageWide, HP OfficeJet - Configure the paper size and type settings on the printer](#)

2. Remove paper from the output bin and check exit flap.

- a. Remove any paper from the output rollers and bin. Pull out the wrinkled paper in the tray and any remaining pieces of paper.




- b. Check if the output bin delivery flap functions correctly or is stuck. Use your finger to open the flap and see if it closes correctly.



NOTE: If you encounter Paper Jam - Clear Output Bin Area / Standard Bin Full investigate the following possible symptoms related to the Output Flap.




- If the output flap is slightly open as pictured or fully open and will not close. Please call HP support.
 - If the output flap doesn't open at all. Please Call HP support.
3. Remove paper from the left door.
- a. Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

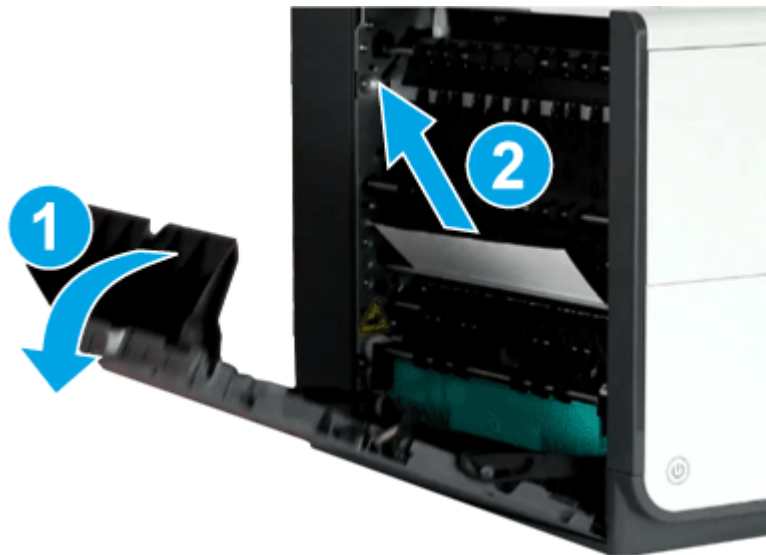


- b. With the left door open, remove ink collection unit (ICU) using the green handle.




- c. Inspect the ICU for jammed paper and remove any paper found. (Avoid touching the waste ink reservoir highlighted in BLUE in the following image.)

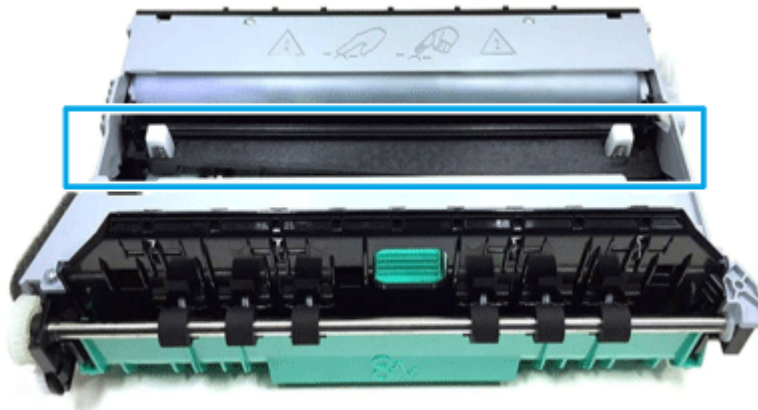

- d. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

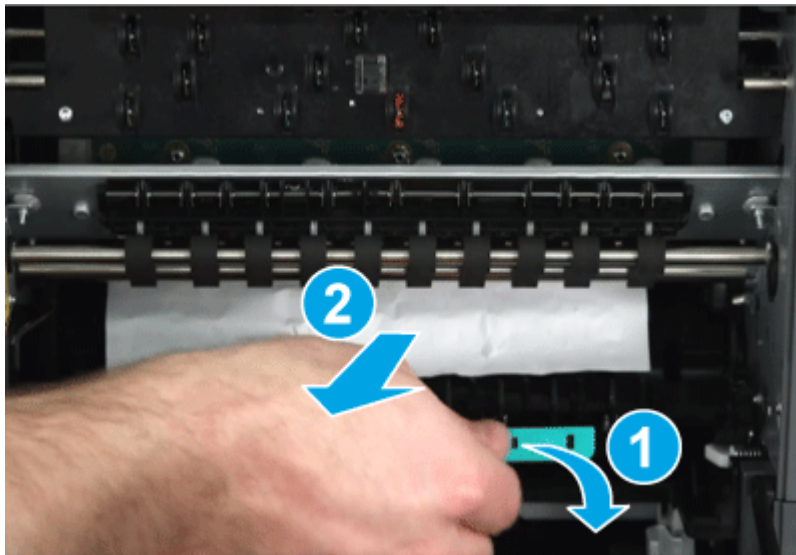

- e. Push the green tab up to put the platen door back into position.
- f. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.

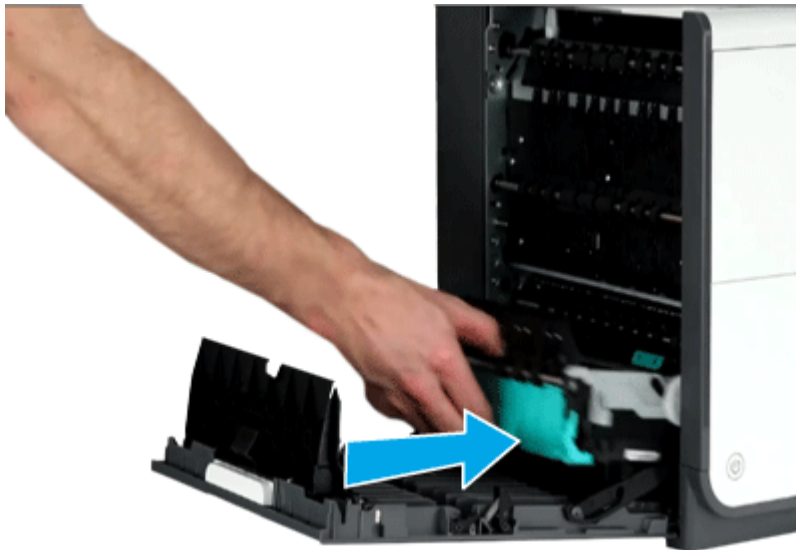


- 4. Check the paper being used and causing the jam. If it's different than the regular 80 g/m2 plain paper, try using this instead and check the result. Ensure that the printer is configured to use the specific media type/size.
- 5. Try using a different tray to see if the issue occurs from there as well.
 - If the print job prints successfully, check the tray or rollers for the failing paper tray. Clean the rollers, and test printing from that tray.

If issue persists after cleaning rollers, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

- If the print job fails from another tray, then perform the following:
 - Run the Advance Jam Recovery Utility using a heavy paper on Tray 1
 - From the control panel go to: **Administration > Troubleshooting > Advance Jam Recovery**.
 - It is recommended to run it a few times in order to clear jams at the print zone. Instructions for running the utility can be found in this public document: [HP Officejet Enterprise Color X555, MFP X585 and HP PageWide Enterprise Color 556, MFP 586 - 15.B0.XX Errors](#)


If issue persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

6. If the printer is showing “**Left Door is OPEN**”, or if the 15.Bx error indicates the door was open during printing, OPEN and RECLOSE the Left Door. Check the following.

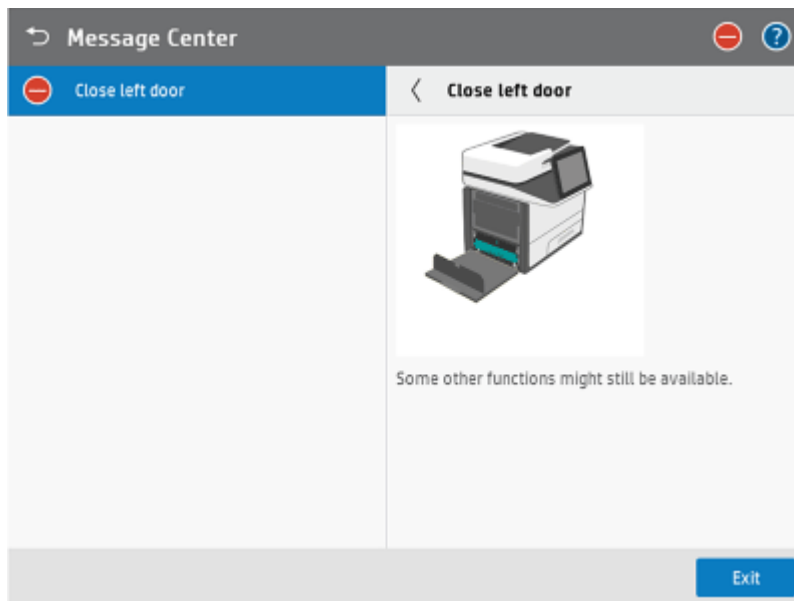

- a. If the printer shows the door open, but the Left Door is closed, check the magnetic door sensor on the door and in the printer.

- b. Remove and obstructions or debris for the sensor in the printer.

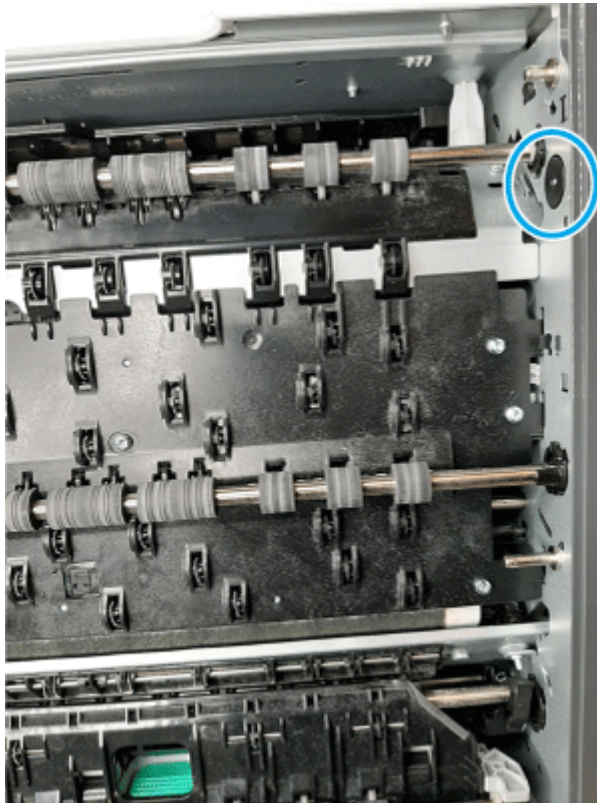

- c. Remove any obstructions or debris for the magnet on the left door.



- 7. If the printer returns to a **READY** state, try to print.
- 8. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

- 1. Clear the paper jam and check the printer for other sheets in the paper path.

 **NOTE:** The following content is for the PageWide Pro A4 series printers. However, the troubleshooting is applicable to the PageWide A4 Enterprise printers as well. The hardware is the same, but the error codes and interface are different.

Use these links to help troubleshoot the jam issue, or skip to the next main step for step by step instructions.

- a. This document contains several troubleshooting methods for clearing a paper jam. Try the following solutions in the order presented to resolve the paper jam issue. If any of the solutions resolve the issue, you do not need to continue troubleshooting.

[HP PageWide 300, 400, 500 series - Resolve paper jams, "Print Zone" jams, and "0x61000013" error](#)

[Clearing Print Zone Paper Jams](#)

- b. This document provides information on clearing jams in the output area:

[How to Clear a Paper Jam in the Output Bin Area on the HP PageWide Enterprise Color 586 MFP Printer](#)

- c. This document provides information on ensuring the paper is loaded correctly and the appropriate paper tray settings are set:

[HP LaserJet, HP PageWide, HP OfficeJet - Configure the paper size and type settings on the printer](#)

- 2. Remove paper from the output bin and check exit flap.

- a. Remove any paper from the output rollers and bin. Pull out the wrinkled paper in the tray and any remaining pieces of paper.



- b. Check if the output bin delivery flap functions correctly or is stuck. Use your finger to open the flap and see if it closes correctly.



NOTE: If you encounter Paper Jam - Clear Output Bin Area / Standard Bin Full investigate the following possible symptoms related to the Output Flap.



- If the output flap is slightly open as pictured or fully open and will not close, dispatching a technician to replace the following parts.


Output flap / Sensor kit part number: D3Q24-67004

- If the output flap doesn't open at all, dispatching a technician to replace the following parts.

Output drive kit part number: D3Q24-67003

3. Remove paper from the left door.


- a. Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

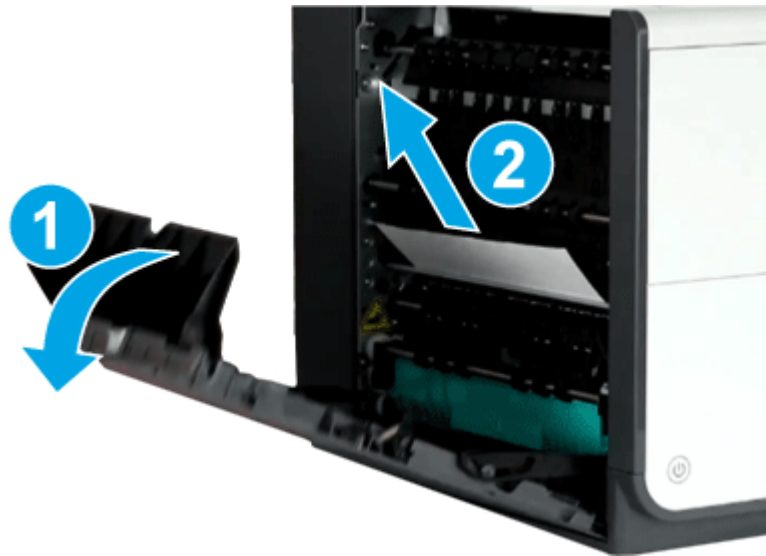


- b. With the left door open, remove ink collection unit (ICU) using the green handle.



- c. Inspect the ICU for jammed paper and remove any paper found. (Avoid touching the waste ink reservoir highlighted in BLUE in the following image.)

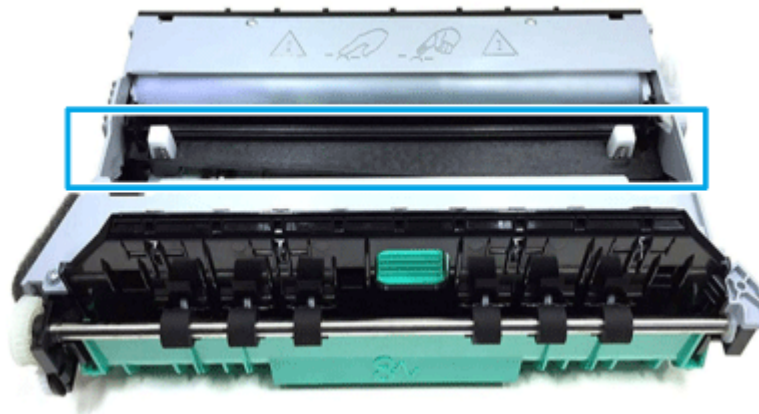


- d. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

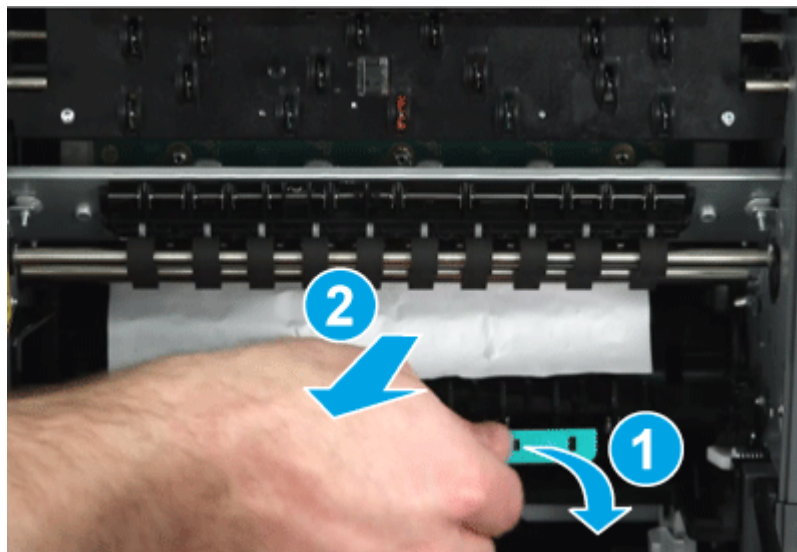

- e. Push the green tab up to put the platen door back into position.

- f. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.

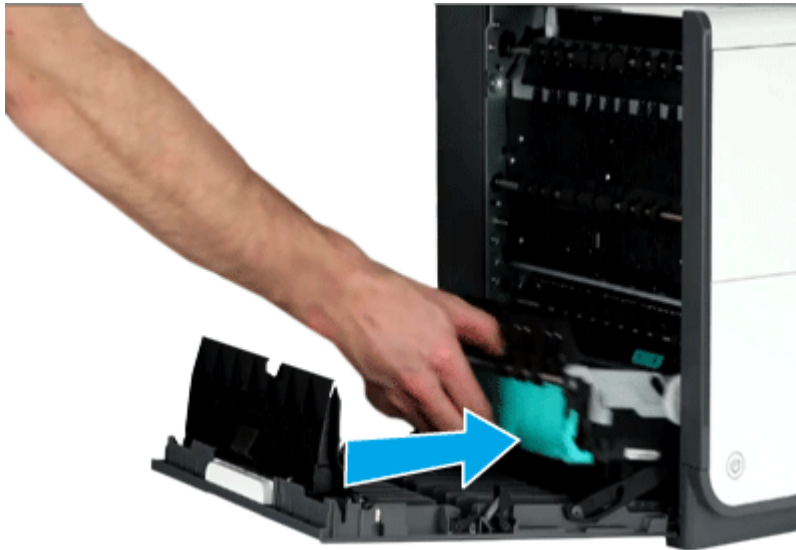

4. Check the paper being used and causing the jam. If it's different than the regular 80 g/m2 plain paper, try using this instead and check the result. Ensure that the printer is configured to use the specific media type/size.
5. Try using a different tray to see if the issue occurs from there as well.
 - If the print job prints successfully, check the tray or rollers for the failing paper tray. Clean the rollers, and test printing from that tray.


If roller are worn or damaged, dispatch an onsite technician, with pick-up roller assembly, for the specific tray.

Separation pick-up roller assembly - For tray 2 - CN598-67018


Pick-up and separation roller assembly - For tray 3 - D3Q21-67002

Pick-up and separation roller assembly - For tray 4 and 5 - D3Q21-67003
 - If the print job fails from another tray, then perform the following:
 - Run the Advance Jam Recovery Utility using a heavy paper on Tray 1
 - From the control panel go to: **Administration > Troubleshooting > Advance Jam Recovery**.
 - It is recommended to run it a few times in order to clear jams at the print zone. Instructions for running the utility can be found in this public document: [HP Officejet Enterprise Color X555, MFP X585 and HP PageWide Enterprise Color 556, MFP 586 - 15.B0.XX Errors](#)
 - If the error persists, continue with the next troubleshooting step.

6. If the printer is showing “Left Door is OPEN”, or if the 15.Bx error indicates the door was open during printing, OPEN and RECLOSE the Left Door. Check the following.

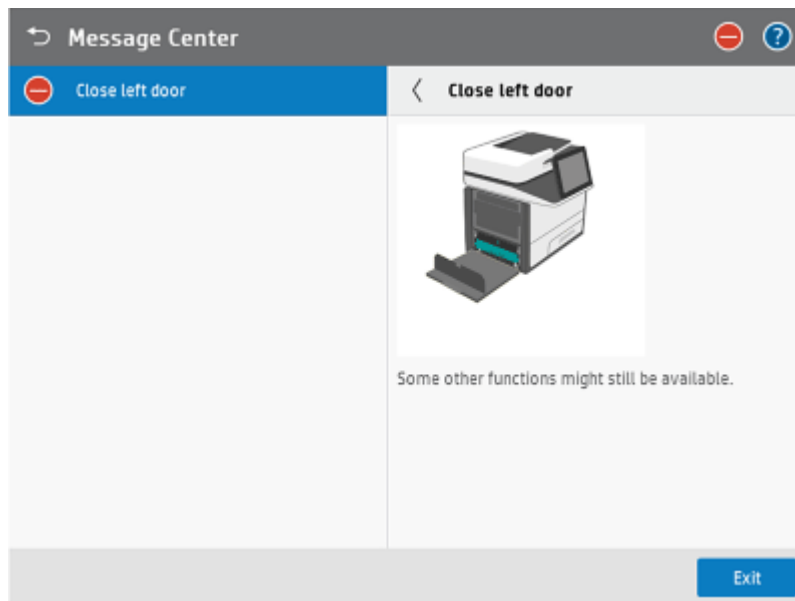

- a. If the printer shows the door open, but the Left Door is closed, check the magnetic door sensor on the door and in the printer.
- b. Remove any obstructions or debris for the sensor in the printer.

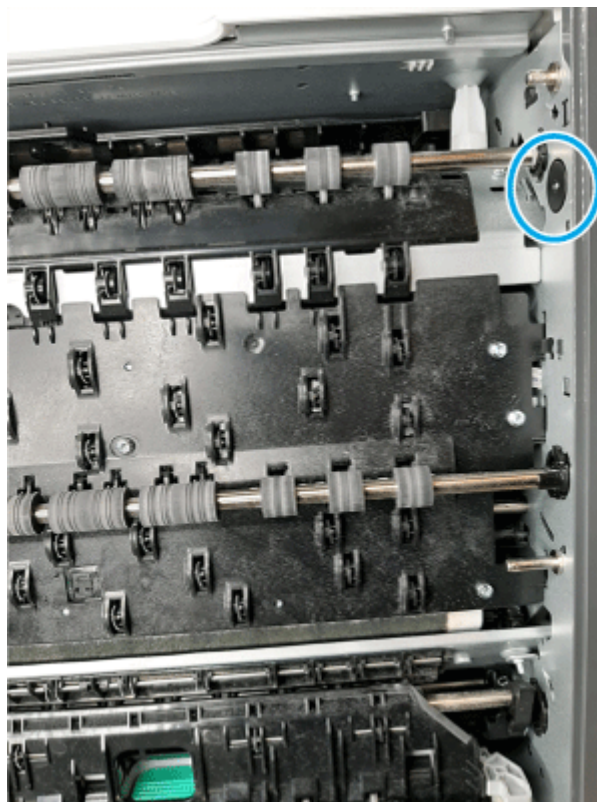

- c. Remove any obstructions or debris for the magnet on the left door.



- If the printer returns to a **READY** state, try to print.
- If the mirror on the door is damaged or missing, send onsite technician with left door assembly.

Left Door Assembly part number: G1W39-67926

7. If the error persists, dispatch an onsite technician with the Print Zone REDI sensor.



NOTE: As this is a stay jam, it means, PZ (star wheel) sensor, is not able to see its own light, this can be caused by a dirty mirror and/or faulty sensor. Cleaning both the sensor and mirror may be all that is needed.

Platen Eject REDI sensors (PZ -star wheel-sensor) [CN598-67038](#)

Recommended action for onsite technicians

1. Clear the paper jam and check the printer for other sheets in the paper path.



NOTE: The following content is for the PageWide Pro A4 series printers. However, the troubleshooting is applicable to the PageWide A4 Enterprise printers as well. The hardware is the same, but the error codes and interface are different.

Use these links to help troubleshoot the jam issue, or skip to the next main step for step by step instructions.

- a. This document contains several troubleshooting methods for clearing a paper jam. Try the following solutions in the order presented to resolve the paper jam issue. If any of the solutions resolve the issue, you do not need to continue troubleshooting.

[HP PageWide 300, 400, 500 series - Resolve paper jams, "Print Zone" jams, and "0x61000013" error](#)

[Clearing Print Zone Paper Jams](#)

- b. This document provides information on clearing jams in the output area:

[How to Clear a Paper Jam in the Output Bin Area on the HP PageWide Enterprise Color 586 MFP Printer](#)

- c. This document provides information on ensuring the paper is loaded correctly and the appropriate paper tray settings are set:

[HP LaserJet, HP PageWide, HP OfficeJet - Configure the paper size and type settings on the printer](#)

2. Remove paper from the output bin and check exit flap.

- a. Remove any paper from the output rollers and bin. Pull out the wrinkled paper in the tray and any remaining pieces of paper.



- b. Check if the output bin delivery flap functions correctly or is stuck. Use your finger to open the flap and see if it closes correctly.



NOTE: If you encounter Paper Jam – Clear Output Bin Area / Standard Bin Full investigate the following possible symptoms related to the Output Flap.



- If the output flap is slightly open as pictured or fully open and will not close, replace the following parts.


Output flap / Sensor kit part number: D3Q24-67004

- If the output flap doesn't open at all, replace the following parts.

Output drive kit part number: D3Q24-67003

3. Remove paper from the left door.


- a.** Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

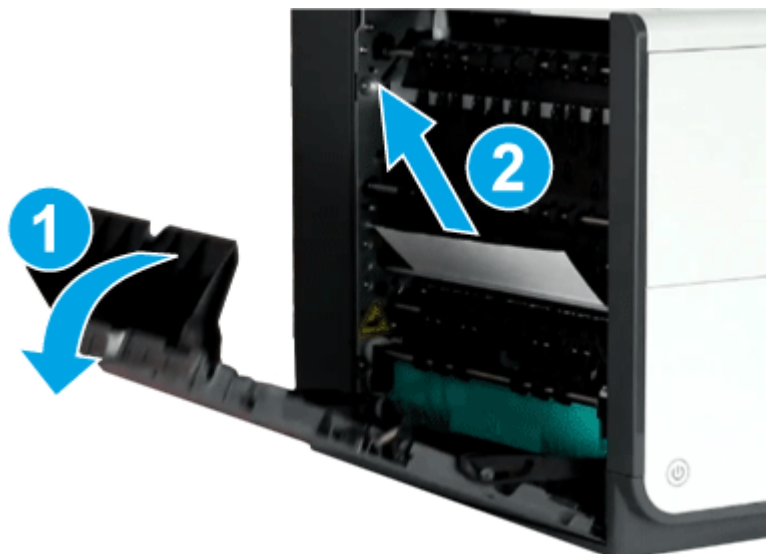


- b. With the left door open, remove ink collection unit (ICU) using the green handle.




- c. Inspect the ICU for jammed paper and remove any paper found. (Avoid touching the waste ink reservoir highlighted in BLUE in the following image.)

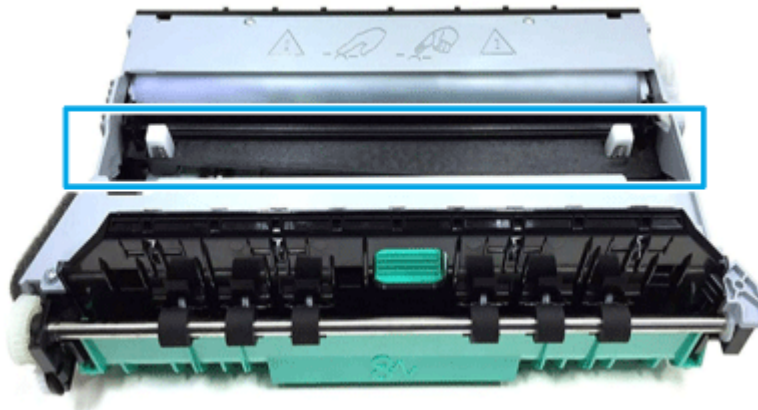

- d. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

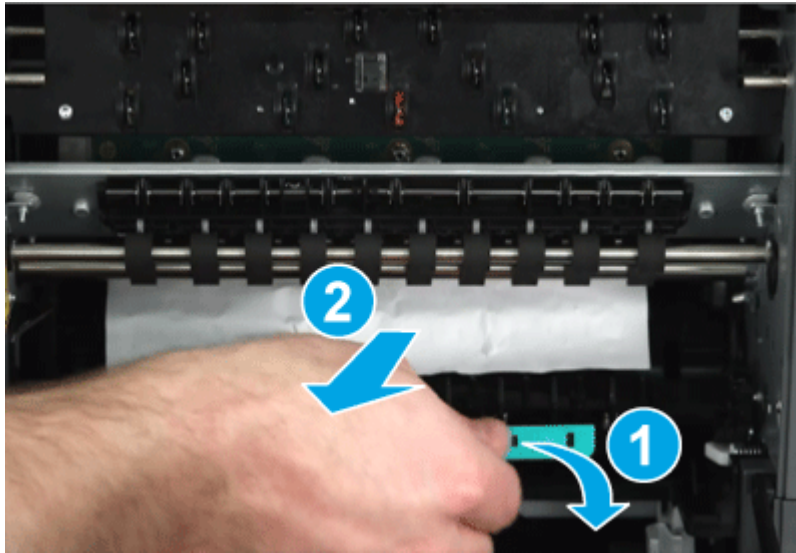

- e. Push the green tab up to put the platen door back into position.
- f. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.

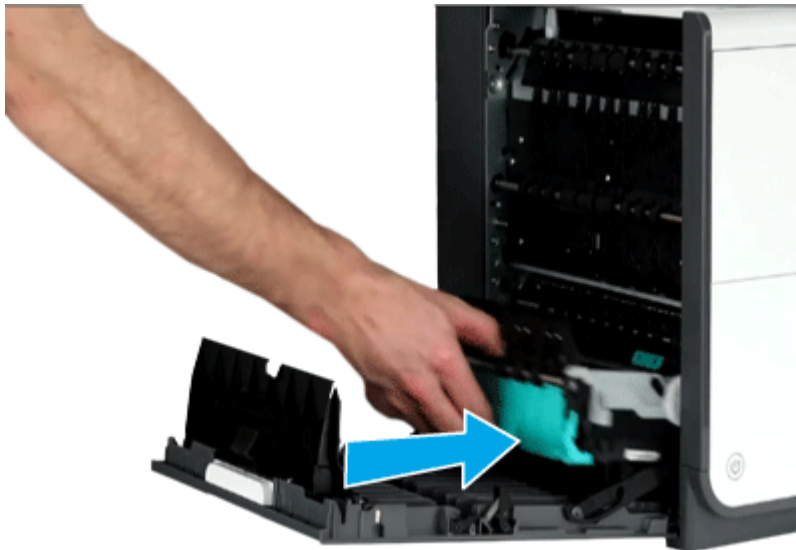

- 4. Check the paper being used and causing the jam. If it's different than the regular 80 g/m2 plain paper, try using this instead and check the result. Ensure that the printer is configured to use the specific media type/size.
- 5. Try using a different tray to see if the issue occurs from there as well.
 - If the print job prints successfully, check the tray or rollers for the failing paper tray. Clean the rollers, and test printing from that tray.


If roller are worn or damaged, replace the pick-up roller assembly, for the specific tray.

Separation pick-up roller assembly - For tray 2 - CN598-67018

Pick-up and separation roller assembly - For tray 3 - D3Q21-67002


Pick-up and separation roller assembly - For tray 4 and 5 - D3Q21-67003

- If the print job fails from another tray, then perform the following:
 - Run the Advance Jam Recovery Utility using a heavy paper on Tray 1
 - From the control panel go to: **Administration** > **Troubleshooting** > **Advance Jam Recovery**.
 - It is recommended to run it a few times in order to clear jams at the print zone. Instructions for running the utility can be found in this public document: [HP Officejet Enterprise Color X555, MFP X585 and HP PageWide Enterprise Color 556, MFP 586 - 15.B0.XX Errors](#)
 - If the error persists, continue with the next troubleshooting step.
- 6. If the printer is showing “**Left Door is OPEN**”, or if the 15.Bx error indicates the door was open during printing, OPEN and RECLOSE the Left Door. Check the following.

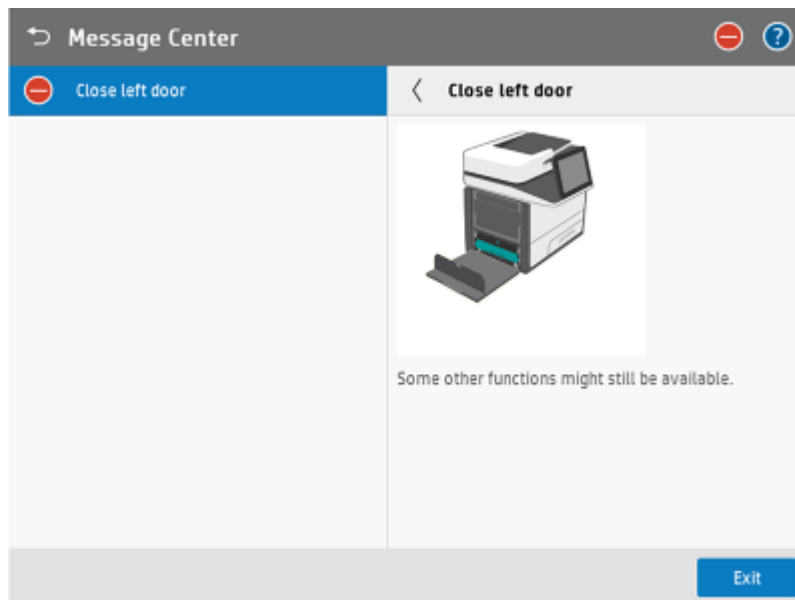

- a. If the printer shows the door open, but the Left Door is closed, check the magnetic door sensor on the door and in the printer.


- b. Remove any obstructions or debris from the sensor in the printer.

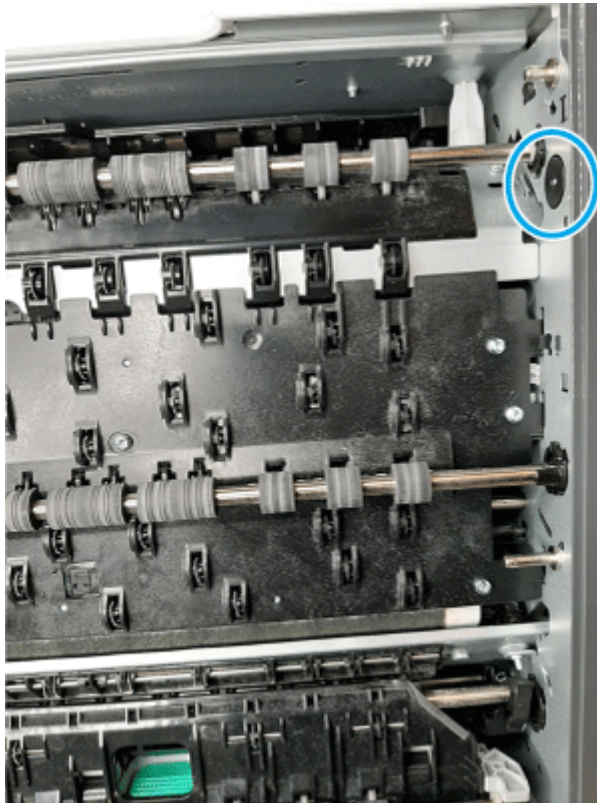

- c. Remove any obstructions or debris for the magnet on the left door.



- If the printer returns to a **READY** state, try to print.
- If the printer still shows "CLOSE Left Door", then use a magnet to test the sensor (pictured below). If the status does not change, the sensor is faulty. Please elevate case using Standard Support Process

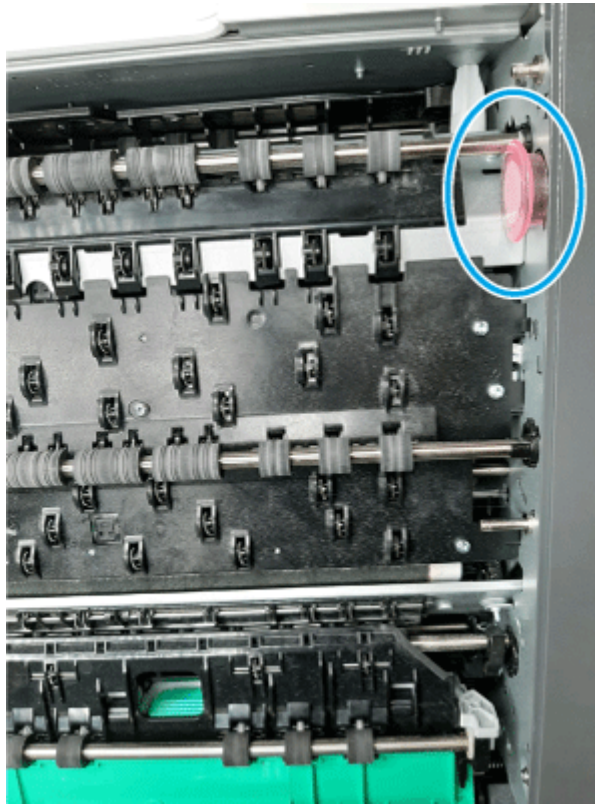

- If the unit goes back to a READY state, then the issue is with the metal mirror on the left door. If the mirror on the door (pictured) is damaged or missing, replace left door assembly

Left Door Assembly part number: G1W39-67926

- If the mirror on the door is damaged or missing, replace the left door assembly.

Left Door Assembly part number: G1W39-67926

7. Pull down the green tab to view the REDI sensor (Callout 2) and clean with a lint free cloth. Clean the mirror located on top of the REDI sensor, you can check its location by closing the platen and looking just above it.




NOTE: As this is a stay jam, it means, PZ (star wheel) sensor, is not able to see its own light, this can be caused by a dirty mirror and/or faulty sensor. Cleaning both the sensor and mirror may be all that is needed.




IMPORTANT: Before replacing the REDI sensor, Check and clean the PZ (star wheel) sensor, located on the Platen access door, as well as the reflection sensor (mirror) on the inside of printer (pictured below)

Figure 6-13 Sensor location

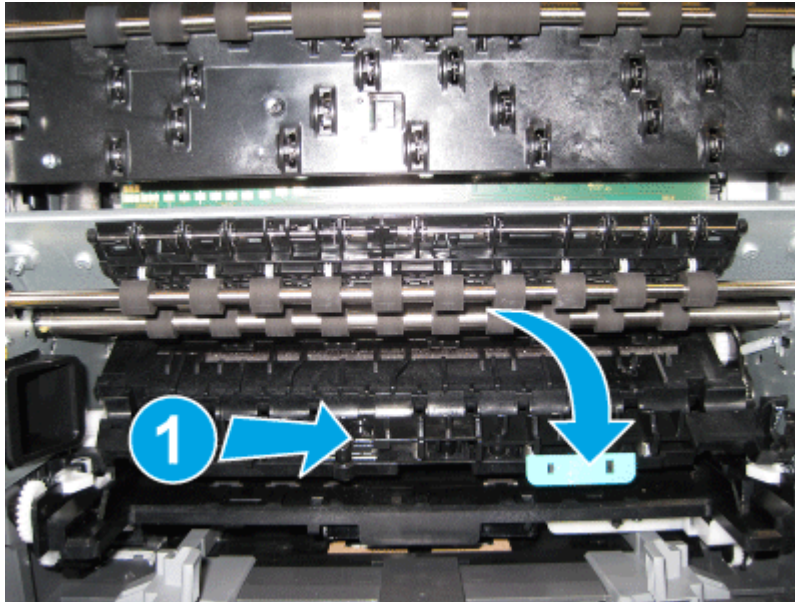

Callout 1: Sensor location

Figure 6-14 Clean sensor and reflector

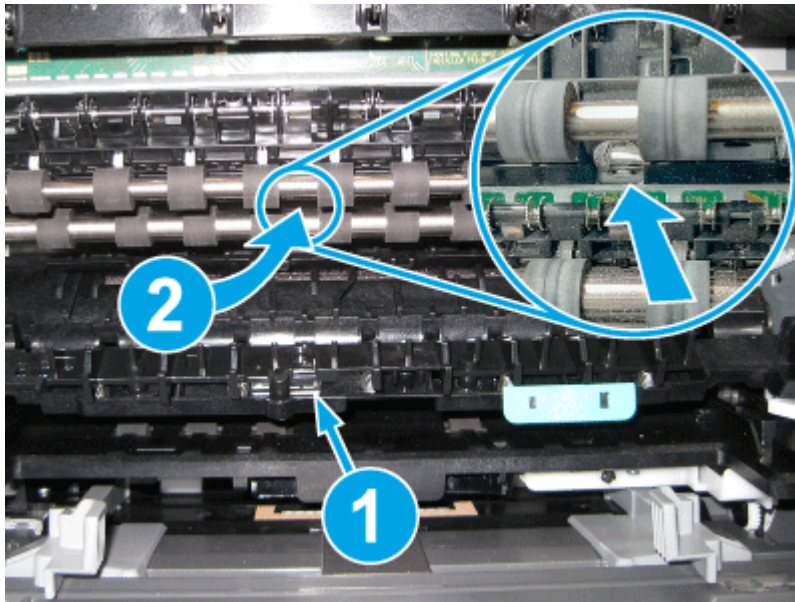

Callout 1: Sensor

Callout 2: Reflector

8. If the error persists, replace the Print Zone REDI sensor.
Platen Eject REDI sensors (PZ -star wheel-sensor) [CN598-67038](#)
9. If the error persists, Clean the Top Form REDI sensor and reflector.
T-10 Torx tool required.

- a. Using a long handle T10 driver, remove the REDI sensor retaining screw. Hold the platen while removing the REDI sensor hold down screw.



- b. Use the following images to help locate and remove the sensor and reflector for cleaning.

Figure 6-15 Lift up the retainer to access the sensor

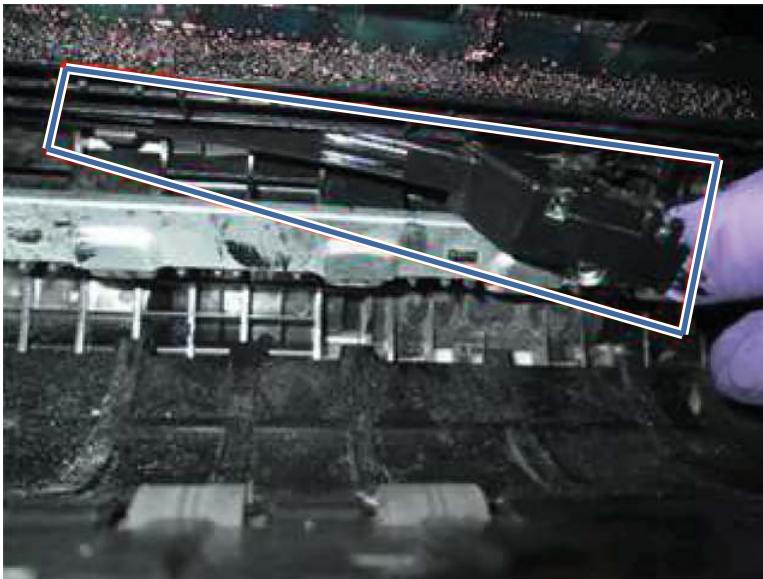


Figure 6-16 Clean the sensor



Figure 6-17 Clean the reflector Callout 1


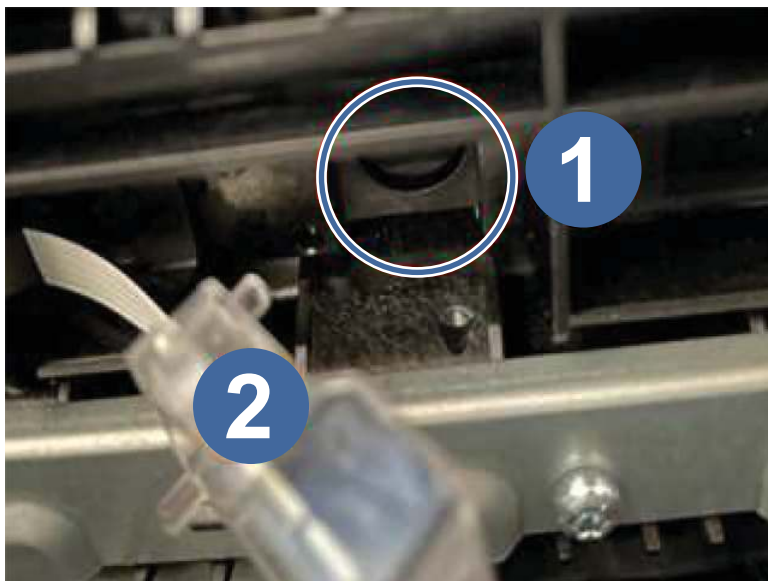


Figure 6-18 Sensor installed without retainer. Callout 3

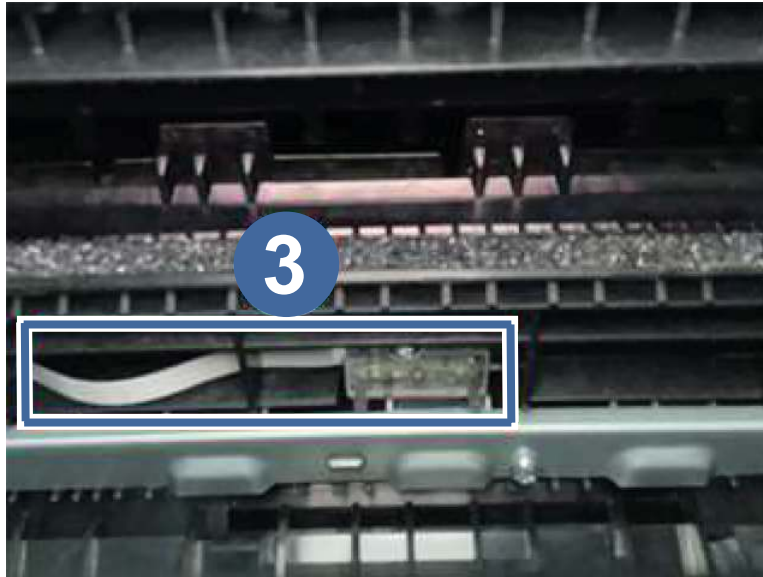

10. If the issue persists after performing these steps, please elevate the case using the Standard Support Process.

15 . B0 . F0 Image Area Jam at Power On

A jam occurred in the Image area at Power On.

Recommended action for customers:

- Clear the jam. For customer troubleshooting steps go to:

[Resolve paper jams including "Print Zone" jams](#)

If the printer has a serial number beginning with CN799xxxxx or higher and a "Print Zone Jam" message displays on the printer control panel, view the following video.

[Clearing Print Zone Paper Jams](#)

On units with a serial number between CN5Cxxxxxx and CN61xxxxxx, a paper jam might occur if the web nose roof dust cover has dislodged inside the printer.

To determine if this is the issue, refer to the following document and follow the instructions provided:

[Possible cause of a paper jam error message or print bar assert error](#)

Recommended action for call agents and service technicians:

1. Clear the jam. For customer troubleshooting steps go to:

[Resolve paper jams including "Print Zone" jams](#)

If the printer has a serial number beginning with CN799xxxxx or higher and a "Print Zone Jam" message displays on the printer control panel, view the following video.

[Clearing Print Zone Paper Jams](#)

On units with a serial number between CN5Cxxxxxx and CN61xxxxxx, a paper jam might occur if the web nose roof dust cover has dislodged inside the printer.

To determine if this is the issue, refer to the following document and follow the instructions provided:

[Possible cause of a paper jam error message or print bar assert error](#)

2. Check and clear all possible paper jam locations.
 - a. Open the left door.
 - b. Remove the Duplex/Waste Ink module.
 - c. Lower the platen to remove paper.
 - d. Lift the green tab to raise the platen back into position.
 - e. Install the Duplex/Waste Ink module.
 - f. Close the left door.
3. Run the Paper Path Diagnostics procedure to move paper from the tray to the output bin. ([Administration / Troubleshooting / Paper Path Page](#)).
4. Run the Advance Jam Recovery Utility using a heavy paper on Tray 1 ([Administration / Troubleshooting / Advance Jam Recovery](#)). It is recommended to run it a few times in order to clear jams at the print zone. Instructions for running the utility can be found in this public document:
[HP Officejet Enterprise Color X555, MFP X585 and HP PageWide Enterprise Color 556, MFP 586 - 15.B0.XX Errors](#)
5. If the issue persists, elevate the case.

15.C0.yz, 15.C1.yz, 15.C2.yz or 15.CA.yz Output area Jam from Tray X

An output jam occurred while printing from the indicated tray or area.



NOTE: This device is equipped with “Auto Jam Recovery Feature”. This enables the printer to attempt to automatically eject any paper jammed in the paper path to the output bin. As result of this feature you may not find paper in the paper path.

- **15.C0.A0:** Paper Output jam. There is a paper stay jam in left door in an unknown sensor when printing from an unknown tray (page never left the sensor).
- **15.C0.A1:** Paper Output jam. There is a paper stay jam in left door in an unknown sensor when printing from Tray 1 (page never left the sensor).
- **15.C0.A2:** Paper Output jam. There is a paper stay jam in left door in an unknown sensor when printing from Tray 2 (page never left the sensor).
- **15.C0.A3:** Paper Output jam. There is a paper stay jam in left door in an unknown sensor when printing from Tray 3 (page never left the sensor).
- **15.C0.F0:** Print Output jam. There is a paper stay jam in the Left Door at an unknown sensor from an unknown tray. (power on jam)
- **15.C1.A0:** Paper Output jam. There is a paper stay jam in left door in the Lower Paper Path (LPP) RED sensor when printing from an unknown tray (page never left the sensor).
- **15.C1.A1:** Paper Output jam. There is a paper stay jam in left door in the Lower Paper Path (LPP) RED sensor when printing from Tray 1 (page never left the sensor).

- **15.C1.A2:** Paper Output jam. There is a paper stay jam in left door in the Lower Paper Path (LPP) REDI sensor when printing from Tray 2 (page never left the sensor).
- **15.C1.A3:** Paper Output jam. There is a paper stay jam in left door in the Lower Paper Path (LPP) REDI sensor when printing from Tray 3 (page never left the sensor).
- **15.C1.F0:** Print Output jam. There is a paper stay jam in the Left Door at the Lower Paper Path (LPP) REDI sensor from an unknown tray. (power on jam)
- **15.C2.A0:** Paper Output jam. There is a paper stay jam in left door in the Upper Paper Path (UPP) REDI sensor when printing from an unknown tray (page never left the sensor).
- **15.C2.A1:** Paper Output jam. There is a paper stay jam in left door in the Upper Paper Path (UPP) REDI sensor when printing from Tray 1 (page never left the sensor).
- **15.C2.A2:** Paper Output jam. There is a paper stay jam in left door in the Upper Paper Path (UPP) REDI sensor when printing from Tray 2 (page never left the sensor).
- **15.C2.A3:** Paper Output jam. There is a paper stay jam in left door in the Upper Paper Path (UPP) REDI sensor when printing from Tray 3 (page never left the sensor).
- **15.C2.F0:** Print Output jam. There is a paper stay jam in the Left Door at the Upper Paper Path (LPP) REDI sensor from an unknown tray. (power on jam)
- **15.CA.E0:** Paper Output jam. There is a paper stay jam in left door when printing from an unknown tray (Door opened during printing).
- **15.CA.E1:** Paper Output jam. There is a paper stay jam in left door when printing from Tray 1 (Door opened during printing).
- **15.CA.E2:** Paper Output jam. There is a paper stay jam in left door when printing from Tray 2 (Door opened during printing).
- **15.CA.E3:** Paper Output jam. There is a paper stay jam in left door when printing from Tray 3 (Door opened during printing).

Recommended action for customers:

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam and check the printer for other sheets in the paper path.



NOTE: The following content is for the PageWide Pro A4 series printers. However, the troubleshooting is applicable to the PageWide A4 Enterprise printers as well. The hardware is the same, but the error codes and interface are different.

Use these links to help troubleshoot the jam issue, or skip to the next main step for step by step instructions.

- a. This document contains several troubleshooting methods for clearing a paper jam. Try the following solutions in the order presented to resolve the paper jam issue. If any of the solutions resolve the issue, you do not need to continue troubleshooting.

[HP PageWide 300, 400, 500 series - Resolve paper jams, "Print Zone" jams, and "0x61000013" error](#)

[Clearing Print Zone Paper Jams](#)

- b. This document provides information on clearing jams in the output area:

[How to Clear a Paper Jam in the Output Bin Area on the HP PageWide Enterprise Color 586 MFP Printer](#)

- c. This document provides information on ensuring the paper is loaded correctly and the appropriate paper tray settings are set:

[HP LaserJet, HP PageWide, HP OfficeJet - Configure the paper size and type settings on the printer](#)

2. Remove paper from the output bin and check exit flap.

- a. Remove any paper from the output rollers and bin. Pull out the wrinkled paper in the tray and any remaining pieces of paper.




- b. Check if the output bin delivery flap functions correctly or is stuck. Use your finger to open the flap and see if it closes correctly.



NOTE: If you encounter Paper Jam – Clear Output Bin Area / Standard Bin Full investigate the following possible symptoms related to the Output Flap.




- If the output flap is slightly open as pictured or fully open and will not close. Please call HP support.
 - If the output flap doesn't open at all. Please Call HP support.
3. Remove paper from the left door.
- a. Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

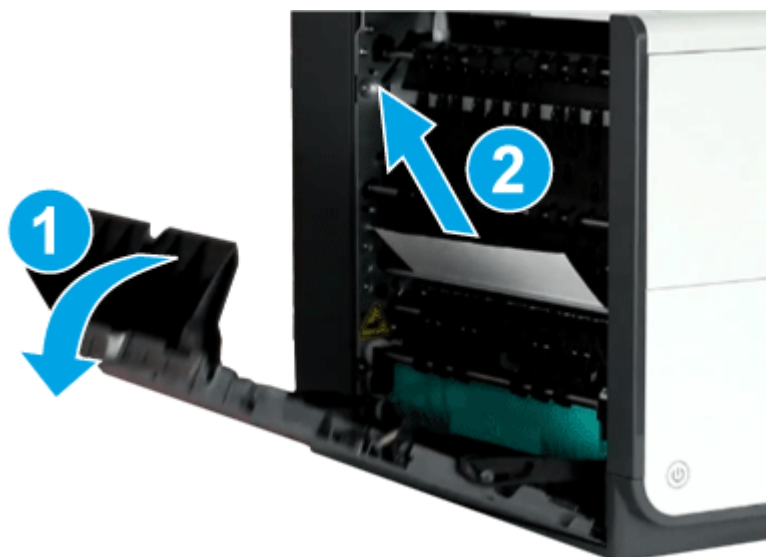


- b. With the left door open, remove ink collection unit (ICU) using the green handle.




- c. Inspect the ICU for jammed paper and remove any paper found. (Avoid touching the waste ink reservoir highlighted in BLUE in the following image.)

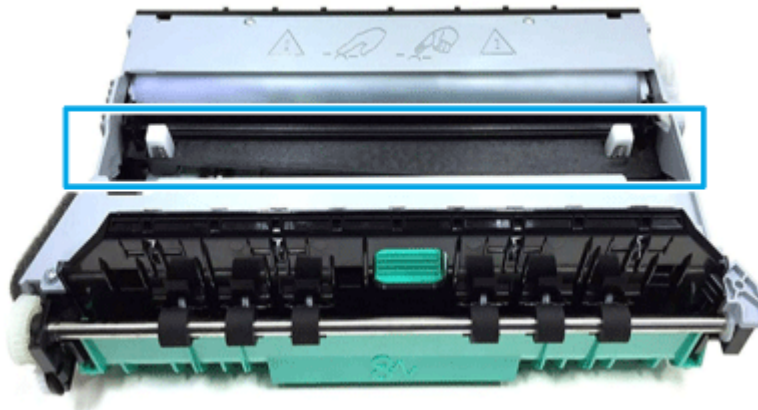

- d. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

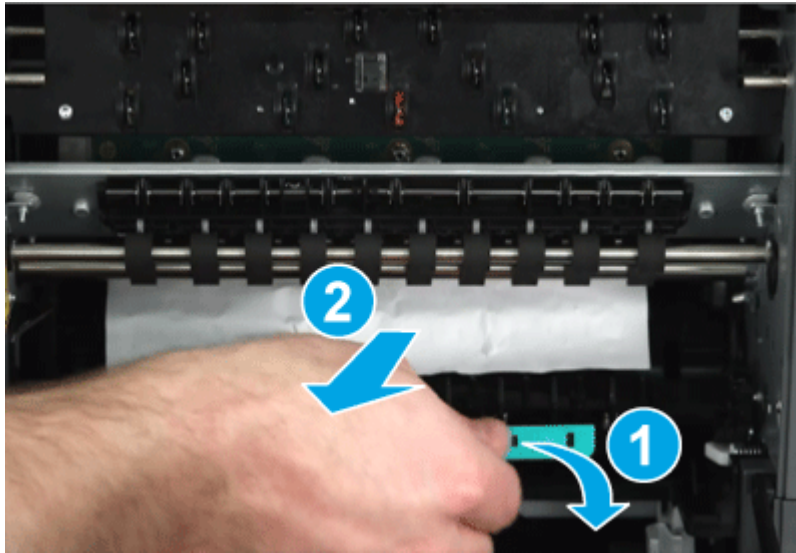

- e. Push the green tab up to put the platen door back into position.
- f. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.

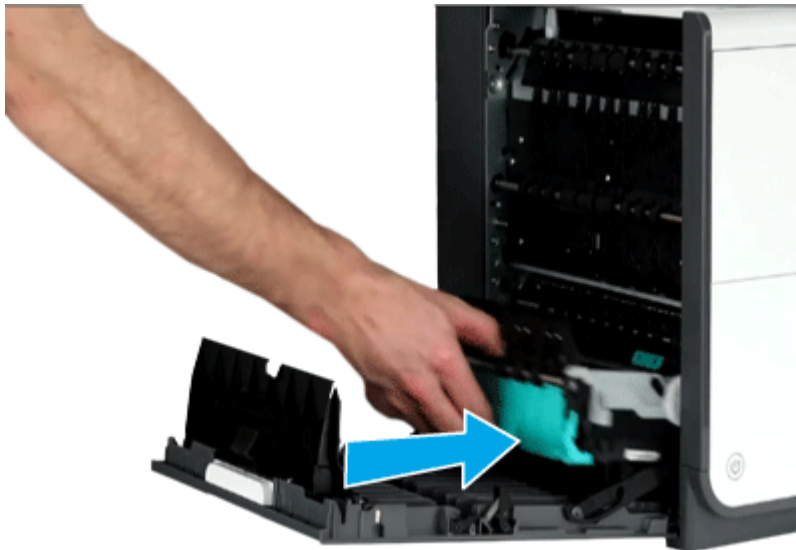


- 4. Check the paper being used and causing the jam. If it's different than the regular 80 g/m2 plain paper, try using this instead and check the result. Ensure that the printer is configured to use the specific media type/size.
- 5. Try using a different tray to see if the issue occurs from there as well.
 - If the print job prints successfully, check the tray or rollers for the failing paper tray. Clean the rollers, and test printing from that tray.

If issue persists after cleaning rollers, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

- If the print job fails from another tray, then perform the following:
 - Run the Advance Jam Recovery Utility using a heavy paper on Tray 1
 - From the control panel go to: **Administration > Troubleshooting > Advance Jam Recovery.**
 - It is recommended to run it a few times in order to clear jams at the print zone. Instructions for running the utility can be found in this public document: [HP Officejet Enterprise Color X555, MFP X585 and HP PageWide Enterprise Color 556, MFP 586 - 15.B0.XX Errors](#)


If issue persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

6. If the printer is showing “**Left Door is OPEN**”, or if the 15.Bx error indicates the door was open during printing, OPEN and RECLOSE the Left Door. Check the following.

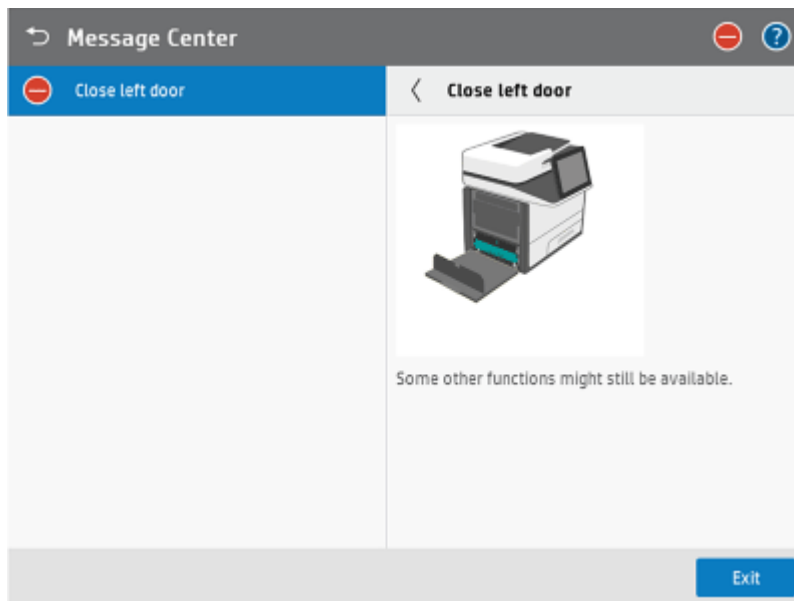

- a. If the printer shows the door open, but the Left Door is closed, check the magnetic door sensor on the door and in the printer.

- b. Remove any obstructions or debris from the sensor in the printer.

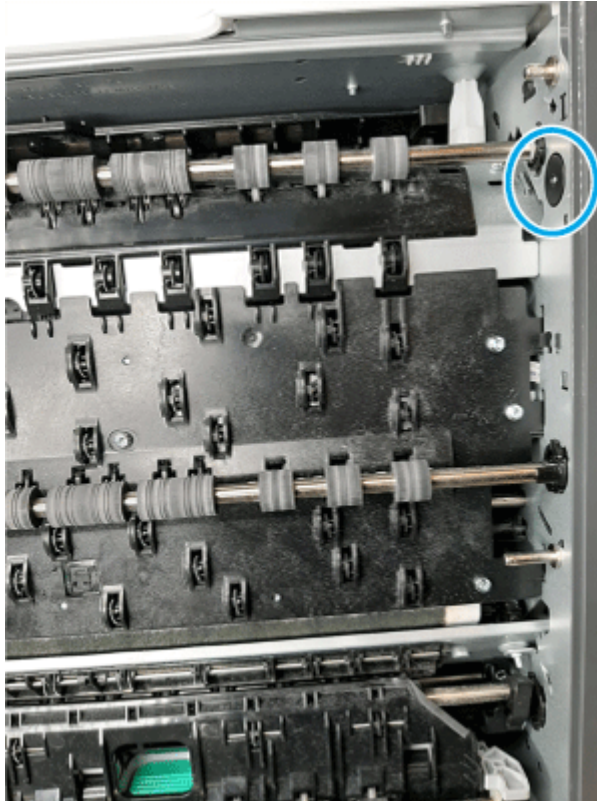

- c. Remove any obstructions or debris for the magnet on the left door.



- 7. If the printer returns to a **READY** state, try to print.
- 8. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

- 1. Clear the paper jam and check the printer for other sheets in the paper path.

 **NOTE:** The following content is for the PageWide Pro A4 series printers. However, the troubleshooting is applicable to the PageWide A4 Enterprise printers as well. The hardware is the same, but the error codes and interface are different.

Use these links to help troubleshoot the jam issue, or skip to the next main step for step by step instructions.

- a. This document contains several troubleshooting methods for clearing a paper jam. Try the following solutions in the order presented to resolve the paper jam issue. If any of the solutions resolve the issue, you do not need to continue troubleshooting.

[HP PageWide 300, 400, 500 series - Resolve paper jams, "Print Zone" jams, and "0x61000013" error](#)

[Clearing Print Zone Paper Jams](#)

- b. This document provides information on clearing jams in the output area:

[How to Clear a Paper Jam in the Output Bin Area on the HP PageWide Enterprise Color 586 MFP Printer](#)

- c. This document provides information on ensuring the paper is loaded correctly and the appropriate paper tray settings are set:

[HP LaserJet, HP PageWide, HP OfficeJet - Configure the paper size and type settings on the printer](#)

- 2. Remove paper from the output bin and check exit flap.

- a. Remove any paper from the output rollers and bin. Pull out the wrinkled paper in the tray and any remaining pieces of paper.



- b. Check if the output bin delivery flap functions correctly or is stuck. Use your finger to open the flap and see if it closes correctly.



NOTE: If you encounter Paper Jam - Clear Output Bin Area / Standard Bin Full investigate the following possible symptoms related to the Output Flap.



- If the output flap is slightly open as pictured or fully open and will not close, dispatching a technician to replace the following parts.


Output flap / Sensor kit part number: D3Q24-67004

- If the output flap doesn't open at all, dispatching a technician to replace the following parts.

Output drive kit part number: D3Q24-67003

3. Remove paper from the left door.


- a. Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

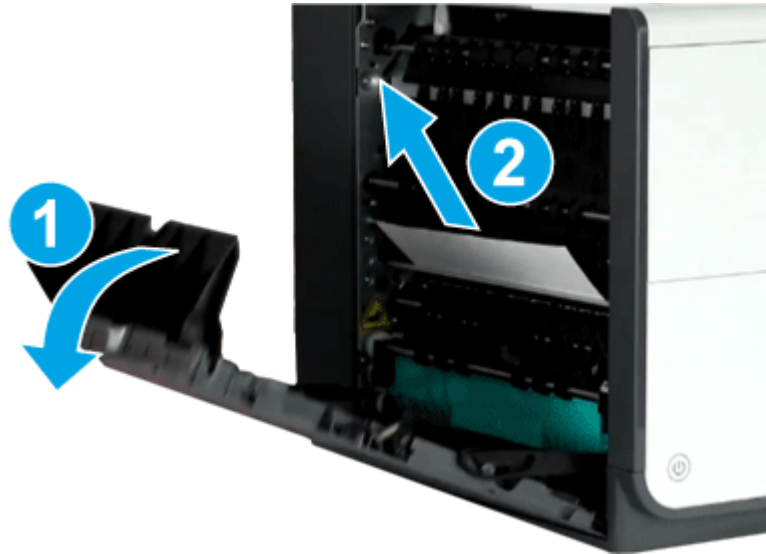


- b. With the left door open, remove ink collection unit (ICU) using the green handle.



- c. Inspect the ICU for jammed paper and remove any paper found. (Avoid touching the waste ink reservoir highlighted in BLUE in the following image.)

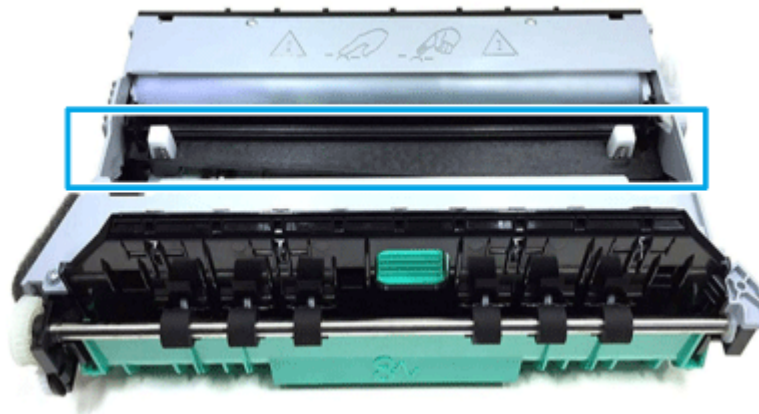


- d. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

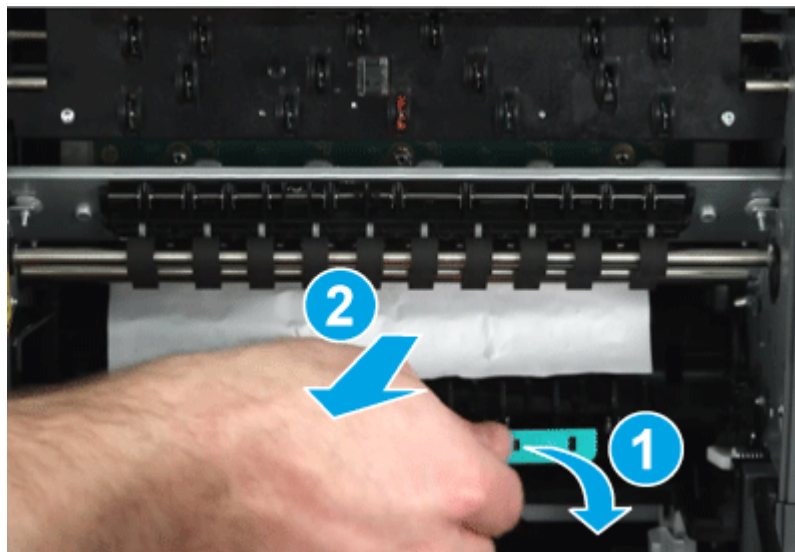

- e. Push the green tab up to put the platen door back into position.

- f. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.

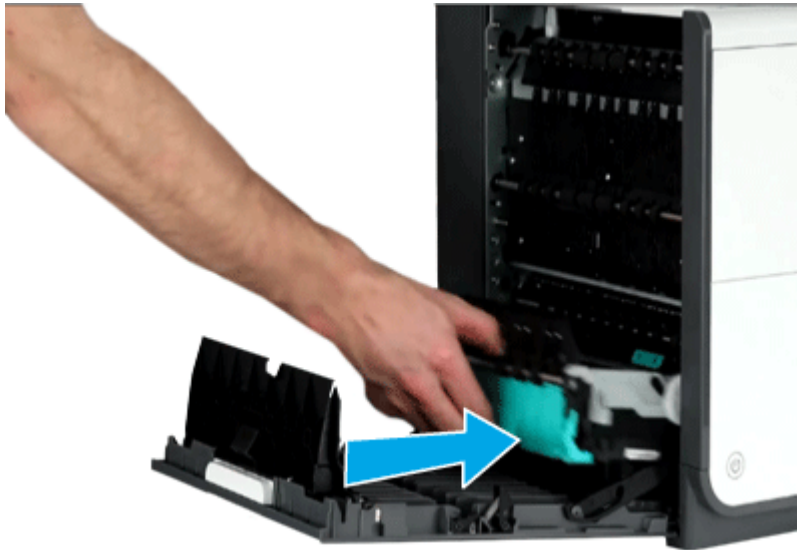

4. Check the paper being used and causing the jam. If it's different than the regular 80 g/m2 plain paper, try using this instead and check the result. Ensure that the printer is configured to use the specific media type/size.
5. Try using a different tray to see if the issue occurs from there as well.
 - If the print job prints successfully, check the tray or rollers for the failing paper tray. Clean the rollers, and test printing from that tray.


If roller are worn or damaged, dispatch an onsite technician, with pick-up roller assembly, for the specific tray.

Separation pick-up roller assembly - For tray 2 - CN598-67018


Pick-up and separation roller assembly - For tray 3 - D3Q21-67002

Pick-up and separation roller assembly - For tray 4 and 5 - D3Q21-67003
 - If the print job fails from another tray, then perform the following:
 - Run the Advance Jam Recovery Utility using a heavy paper on Tray 1
 - From the control panel go to: **Administration > Troubleshooting > Advance Jam Recovery**.
 - It is recommended to run it a few times in order to clear jams at the print zone. Instructions for running the utility can be found in this public document: [HP Officejet Enterprise Color X555, MFP X585 and HP PageWide Enterprise Color 556, MFP 586 - 15.B0.XX Errors](#)
 - If the error persists, continue with the next troubleshooting step.

6. If the printer is showing “Left Door is OPEN”, or if the 15.Bx error indicates the door was open during printing, OPEN and RECLOSE the Left Door. Check the following.

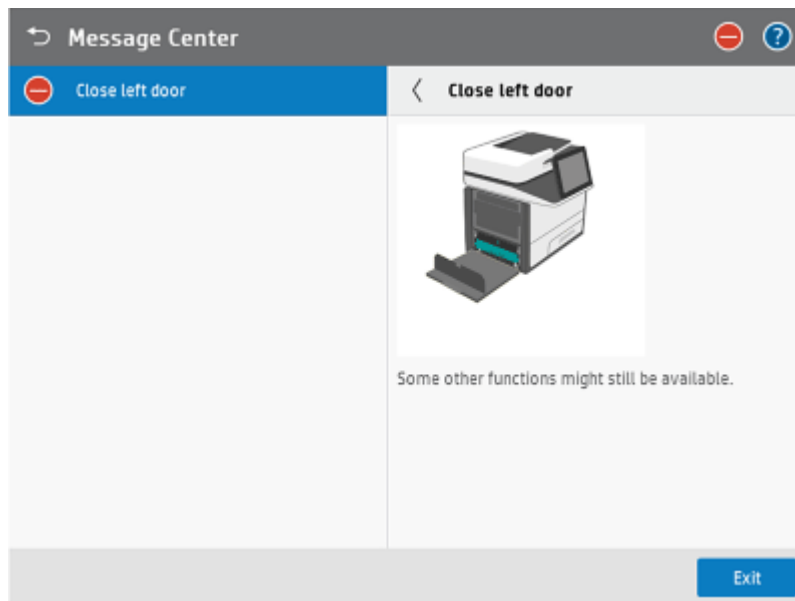

- a. If the printer shows the door open, but the Left Door is closed, check the magnetic door sensor on the door and in the printer.
- b. Remove any obstructions or debris for the sensor in the printer.

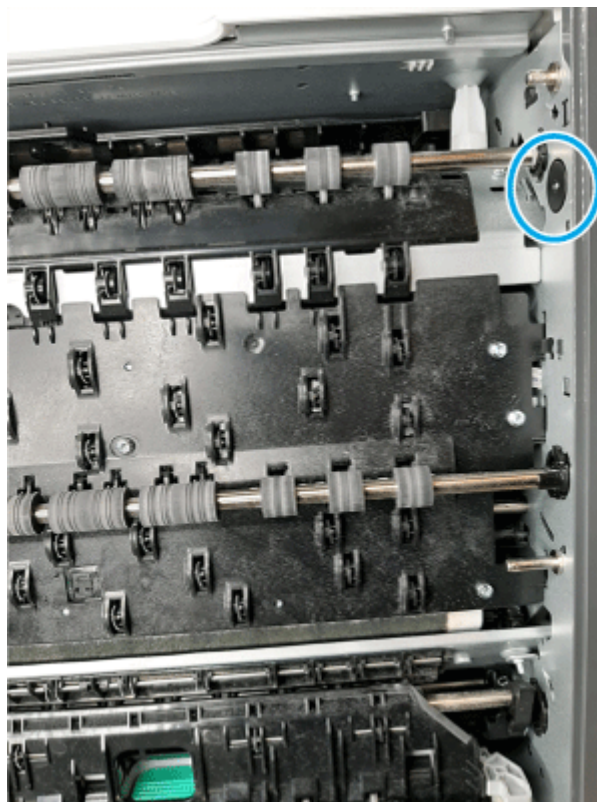


- c. Remove any obstructions or debris for the magnet on the left door.



- If the printer returns to a **READY** state, try to print.
- If the mirror on the door is damaged or missing, send onsite technician with left door assembly.

Left Door Assembly part number: G1W39-67926

7. Check the lower paper path (LPP) and upper paper path (UPP) REDI sensors for missing/damaged mirrors and REDI sensor. Clean mirrors and REDI sensors if dirty:

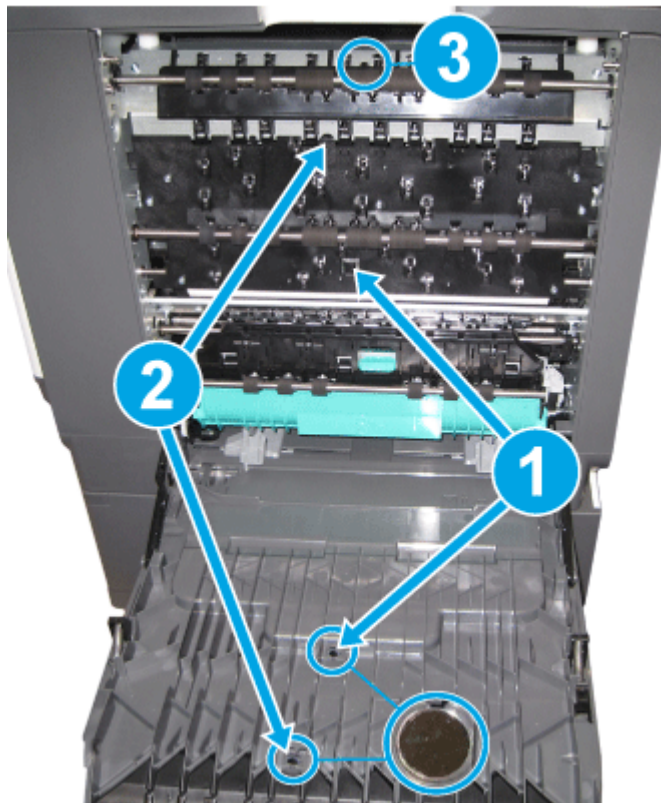

Callout 1: Lower REDI sensor (15.C1.yz)

Callout 2: Upper REDI sensor (15.C2.yz)

Callout 3: Eject jam REDI sensor

- Open the left door and locate the two mirror labels



8. Reposition the mirror label if it is found to be out place. If the mirror label will not stick or is missing, send onsite technician with: left door assembly.

Left Door Assembly part number: G1W39-67926

Figure 6-19 CORRECTLY positioned mirror label:



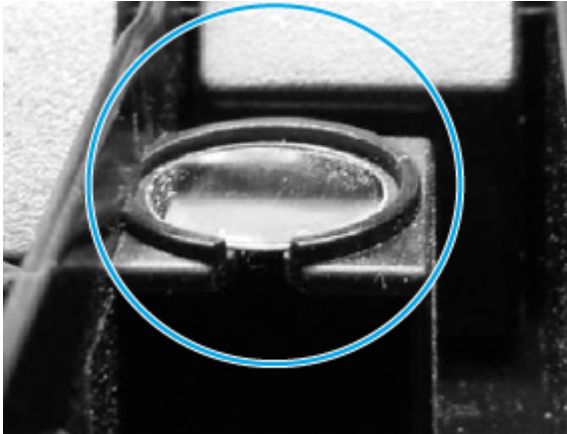


Figure 6-20 INCORRECTLY positioned mirror label:

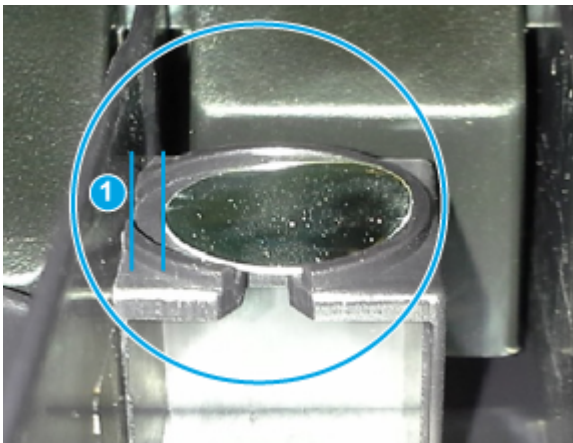

9. Check the two REDI reflection sensors on the inside of the printers output path (see following image). Make sure they are clear of debris and are clean.

Figure 6-21 REDI reflection sensors

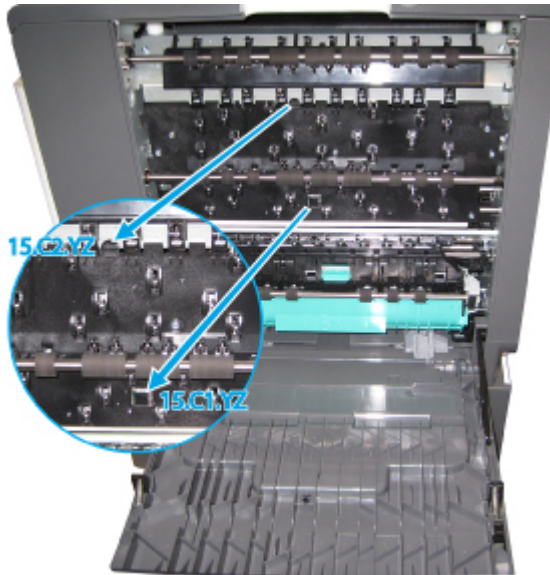

10. If sensors are OK, paper may not be transporting through the left door properly. Check to see if the plastic bushing (following image) is broken. If damaged, send onsite technician with:transfer 3 shaft.

Transfer 3 shaft part number: CN459-60106



11. If any of these issues persist, elevate the case using the Standard Support Process.

Recommended action for onsite technicians:

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam and check the printer for other sheets in the paper path.



NOTE: The following content is for the PageWide Pro A4 series printers. However, the troubleshooting is applicable to the PageWide A4 Enterprise printers as well. The hardware is the same, but the error codes and interface are different.

Use these links to help troubleshoot the jam issue, or skip to the next main step for step by step instructions.

- a. This document contains several troubleshooting methods for clearing a paper jam. Try the following solutions in the order presented to resolve the paper jam issue. If any of the solutions resolve the issue, you do not need to continue troubleshooting.

[HP PageWide 300, 400, 500 series - Resolve paper jams, "Print Zone" jams, and "0x61000013" error](#)

[Clearing Print Zone Paper Jams](#)

- b. This document provides information on clearing jams in the output area:

[How to Clear a Paper Jam in the Output Bin Area on the HP PageWide Enterprise Color 586 MFP Printer](#)

- c. This document provides information on ensuring the paper is loaded correctly and the appropriate paper tray settings are set:

[HP LaserJet, HP PageWide, HP OfficeJet - Configure the paper size and type settings on the printer](#)

2. Remove paper from the output bin and check exit flap.

- a. Remove any paper from the output rollers and bin. Pull out the wrinkled paper in the tray and any remaining pieces of paper.



- b. Check if the output bin delivery flap functions correctly or is stuck. Use your finger to open the flap and see if it closes correctly.



NOTE: If you encounter Paper Jam - Clear Output Bin Area / Standard Bin Full investigate the following possible symptoms related to the Output Flap.



- If the output flap is slightly open as pictured or fully open and will not close, replace the following parts.


Output flap / Sensor kit part number: D3Q24-67004

- If the output flap doesn't open at all, replace the following parts.


Output drive kit part number: D3Q24-67003

3. Remove paper from the left door.


- a.** Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

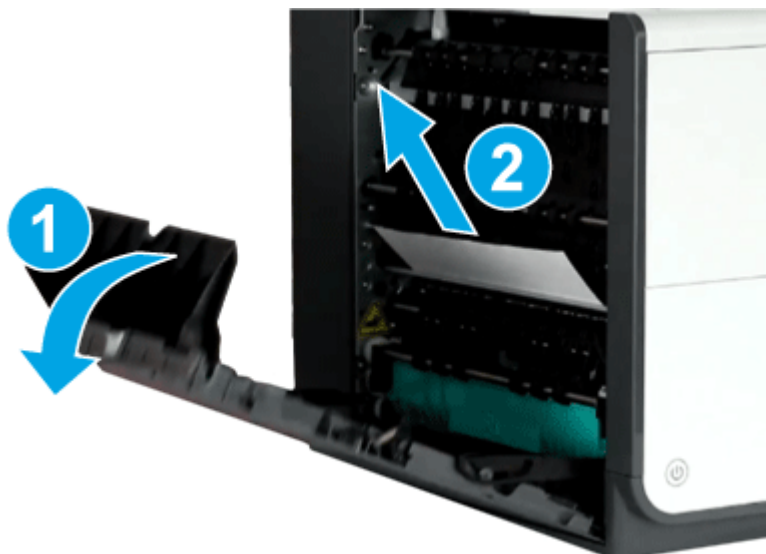


- b. With the left door open, remove ink collection unit (ICU) using the green handle.

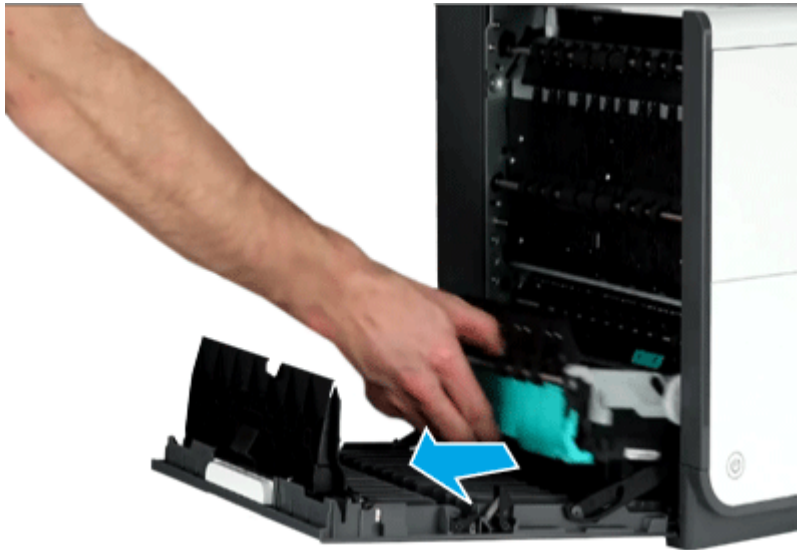

- c. Inspect the ICU for jammed paper and remove any paper found. (Avoid touching the waste ink reservoir highlighted in BLUE in the following image.)

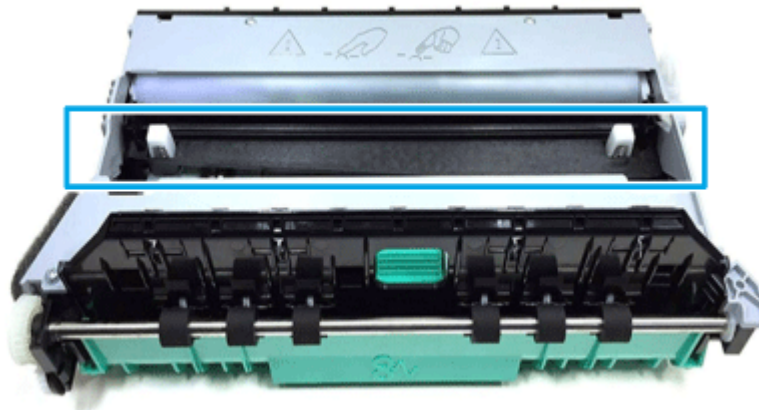

- d. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

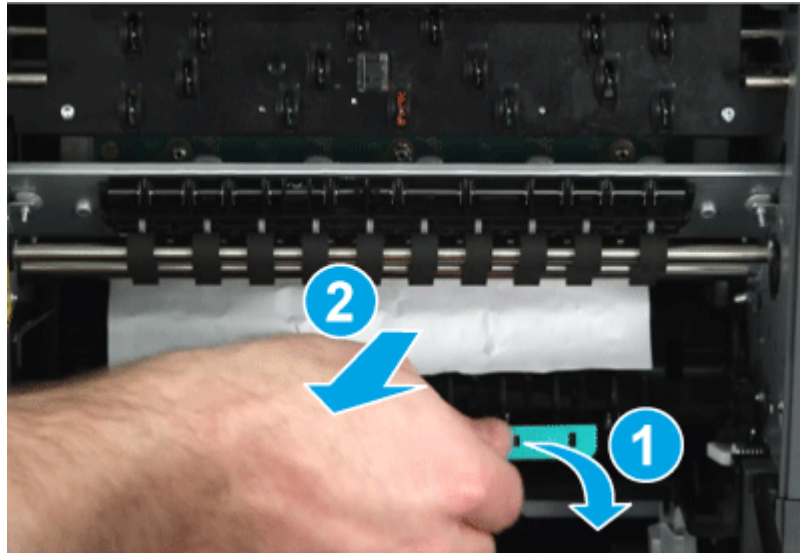

- e. Push the green tab up to put the platen door back into position.
- f. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.



4. Check the paper being used and causing the jam. If it's different than the regular 80 g/m2 plain paper, try using this instead and check the result. Ensure that the printer is configured to use the specific media type/size.
5. Try using a different tray to see if the issue occurs from there as well.
- If the print job prints successfully, check the tray or rollers for the failing paper tray. Clean the rollers, and test printing from that tray.


If roller are worn or damaged, replace the pick-up roller assembly, for the specific tray.

Separation pick-up roller assembly - For tray 2 - CN598-67018

Pick-up and separation roller assembly - For tray 3 - D3Q21-67002


Pick-up and separation roller assembly - For tray 4 and 5 - D3Q21-67003

- If the print job fails from another tray, then perform the following:
 - Run the Advance Jam Recovery Utility using a heavy paper on Tray 1
 - From the control panel go to: **Administration > Troubleshooting > Advance Jam Recovery**.
 - It is recommended to run it a few times in order to clear jams at the print zone. Instructions for running the utility can be found in this public document: [HP Officejet Enterprise Color X555, MFP X585 and HP PageWide Enterprise Color 556, MFP 586 - 15.B0.XX Errors](#)
 - If the error persists, continue with the next troubleshooting step.
- 6. If the printer is showing “**Left Door is OPEN**”, or if the 15.Bx error indicates the door was open during printing, OPEN and RECLOSE the Left Door. Check the following.

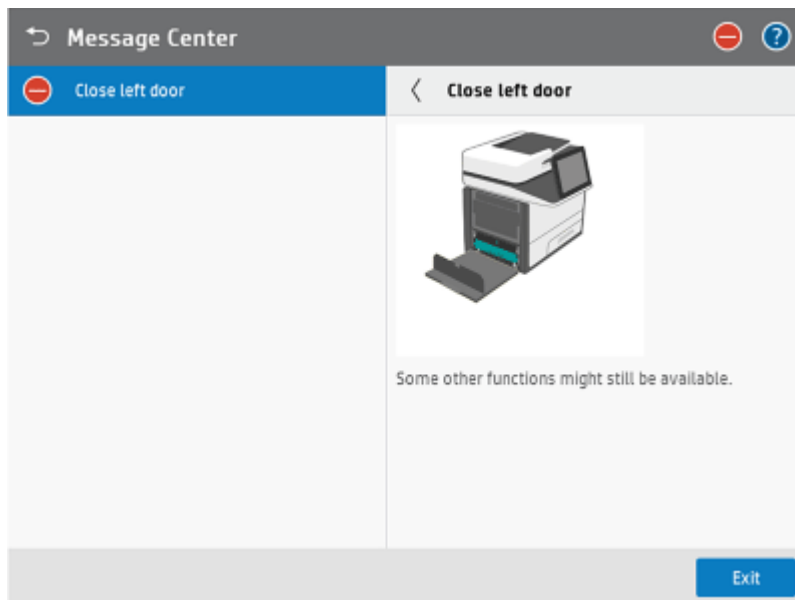

- a. If the printer shows the door open, but the Left Door is closed, check the magnetic door sensor on the door and in the printer.

- b. Remove any obstructions or debris from the sensor in the printer.

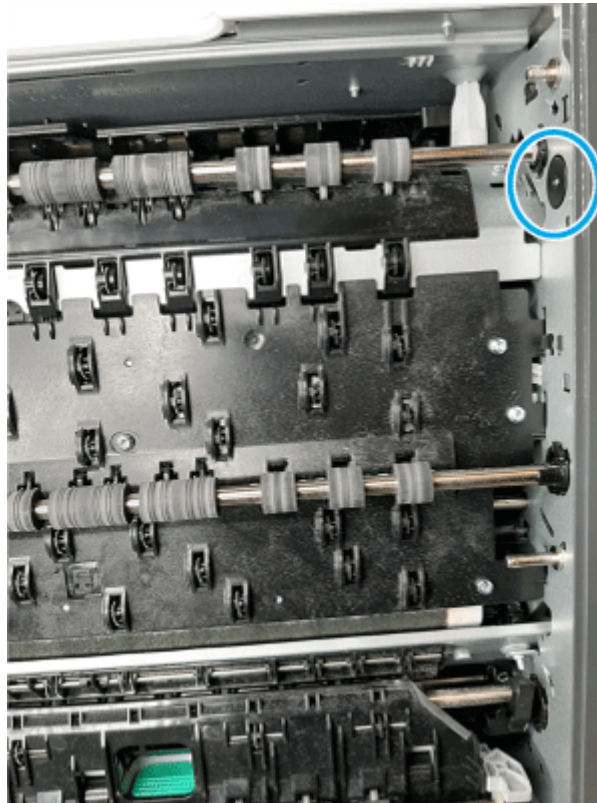


- c. Remove any obstructions or debris for the magnet on the left door.



- If the printer returns to a **READY** state, try to print.
- If the mirror on the door is damaged or missing, replace the left door assembly.

Left Door Assembly part number: G1W39-67926

7. Check the lower paper path (LPP) and upper paper path (UPP) REDI sensors for missing/damaged mirrors and REDI sensor. Clean mirrors and REDI sensors if dirty:

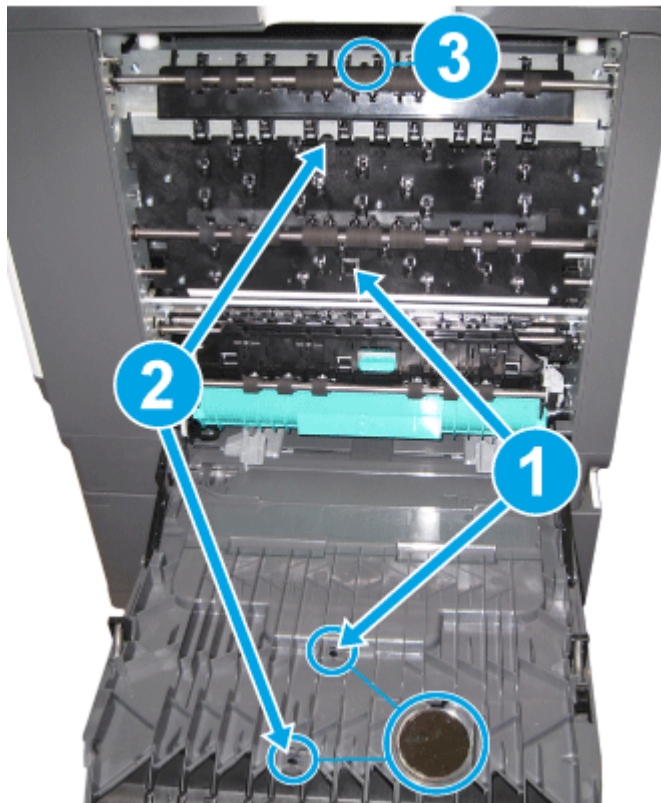

Callout 1: Lower REDI sensor (15.C1.yz)

Callout 2: Upper REDI sensor (15.C2.yz)

Callout 3: Eject jam REDI sensor

- Open the left door and locate the two mirror labels



8. Reposition the mirror label if it is found to be out place. If the mirror label will not stick or is missing, replace the left door assembly.

Left Door Assembly part number: G1W39-67926

Figure 6-22 CORRECTLY positioned mirror label:



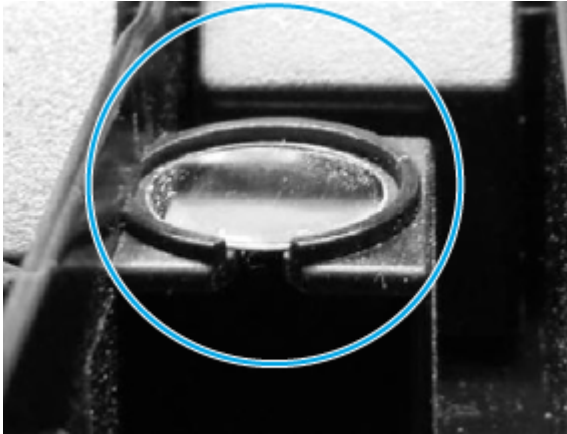


Figure 6-23 INCORRECTLY positioned mirror label:

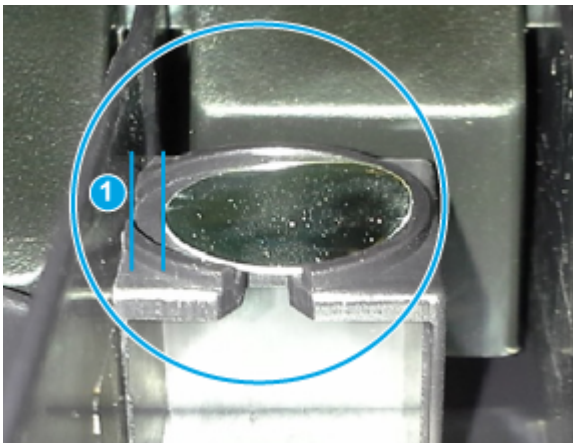


9. Check the two REDI reflection sensors on the inside of the printers output path (see following image). Make sure they are clear of debris and are clean.

Figure 6-24 REDI reflection sensors

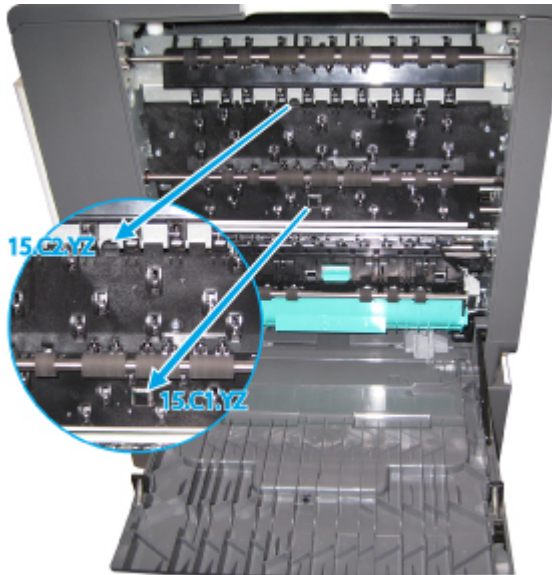

10. If sensors are OK, paper may not be transporting through the left door properly. Check to see if the plastic bushing (following image) is broken. If damaged, replace the transfer 3 shaft.

Transfer 3 shaft part number: CN459-60106

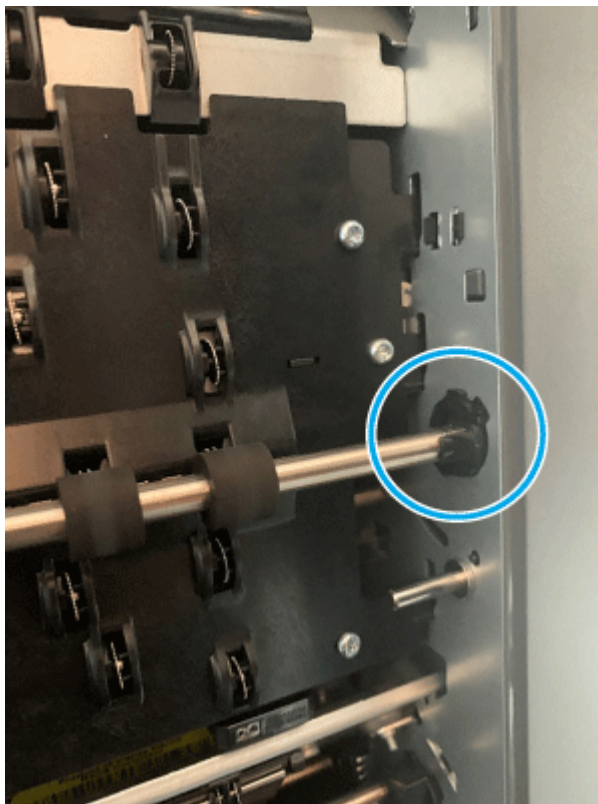

11. If any of these issues persist, elevate the case using the Standard Support Process.

15 .C0 .F0 Jam in left door at Power On

A jam occurred in the left door at power on.

Recommended action for customers:

- Clear the jam. For customer troubleshooting steps go to:

[HP PageWide Enterprise Color 556, MFP 586 - Clear jams in the left door](#)

Recommended action for call agents and service technicians:

1. Clear all possible paper jam locations (Open left door, remove Duplex/Waste Ink module, lower flap, clear paper, raise flap, install Duplex/Waste Ink module, close door).
 - a. Open the left door.
 - b. Remove the Duplex/Waste Ink module.
 - c. Lower the platen to remove paper.
 - d. Lift the green tab to raise the platen back into position.
 - e. Install the Duplex/Waste Ink module.
 - f. Close the left door.
2. Run the Paper Path Diagnostics procedure to move paper from the tray to the output bin ([Administration / Troubleshooting / Paper Path Page](#)).
3. Run the Advance Jam Recovery Utility using a heavy paper on Tray 1 ([Administration / Troubleshooting / Advance Jam Recovery](#)). It is recommended to run it a few times in order to clear jams at the print zone. Instructions for running the utility can be found in this public document:
[HP Officejet Enterprise Color X555, MFP X585 and HP PageWide Enterprise Color 556, MFP 586 - 15.B0.XX Errors](#)
4. If the issue persists, elevate the case using the Standard Support Process..

15 .Dx .yz Duplex Jam from Tray X

A duplex jam occurred from the tray designated.

The page has passed the output feed area and is reversing back through the duplex area and has not reached the Top of Form (TOF) sensor within the designated time.



NOTE: This device is equipped with “Auto Jam Recovery” Feature. This enables the printer to attempt to automatically eject any paper jammed in the paper path to the output bin.

As result of this feature you may not find paper in the paper path.



NOTE: Before beginning troubleshooting, try printing in simplex. If it prints fine continue with the following, if a simplex job generates a different error, troubleshoot that error accordingly.

- **15.D1.C0:** Paper Duplex jam. There is a paper delay jam in the duplexer (ICU) at the Top of Form (TOF) REDI Sensor when printing from an unknown tray (page never made it to the sensor).
- **15.D1.C1:** Paper Duplex jam. There is a paper delay jam in the duplexer (ICU) at the Top of Form (TOF) REDI Sensor when printing from an tray 1 (page never made it to the sensor).

- **15.D1.C2:** Paper Duplex jam. There is a paper delay jam in the duplexer (ICU) at the Top of Form (TOF) REDI Sensor when printing from an tray 2 (page never made it to the sensor).
- **15.D1.C3:** Paper Duplex jam. There is a paper delay jam in the duplexer (ICU) at the Top of Form (TOF) REDI Sensor when printing from an tray 3 (page never made it to the sensor).
- **15.D1.D0:** Paper Duplex jam. There is a paper delay jam in the duplexer (ICU) at the Top of Form (TOF) REDI Sensor when printing from an unknown tray (page never left the sensor).
- **15.D1.D1:** Paper Duplex jam. There is a paper delay jam in the duplexer (ICU) at the Top of Form (TOF) REDI Sensor when printing from an tray 1 (page never left the sensor).
- **15.D1.D2:** Paper Duplex jam. There is a paper delay jam in the duplexer (ICU) at the Top of Form (TOF) REDI Sensor when printing from an tray 2 (page never left the sensor).
- **15.D1.D3:** Paper Duplex jam. There is a paper delay jam in the duplexer (ICU) at the Top of Form (TOF) REDI Sensor when printing from an tray 3 (page never left the sensor).


Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam from duplexer (ICU) and check the printer for other sheets in the paper path.


Follow steps in video for: [HOW TO CLEAR A PAPER JAM IN THE INK COLLECTION AREA ON THE HP PAGEWIDE ENTERPRISE COLOR 586 MFP PRINTER](#)

- a. Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

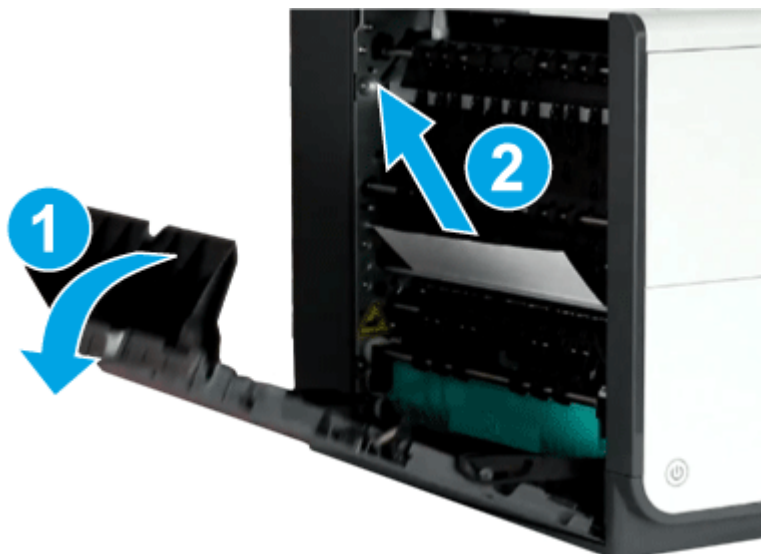


- b. Remove the Duplex/Waste Ink module.

Figure 6-25 Duplex/Waste module

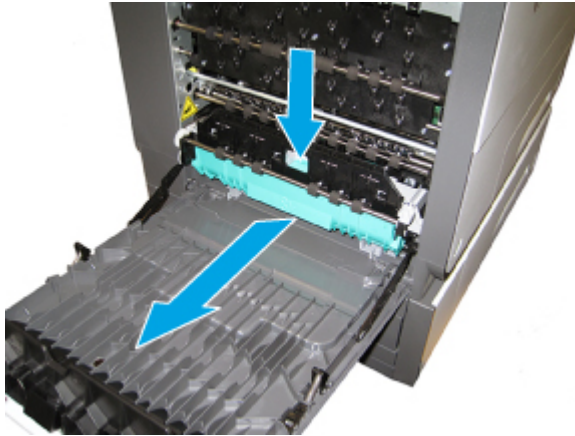


- c. With the green cartridge/ Duplex-Ink collection/reservoir unit (ICU) removed, inspect ICU and avoid red zone. Check both ICU and duplex drive Gears

Figure 6-26 Check the following areas.

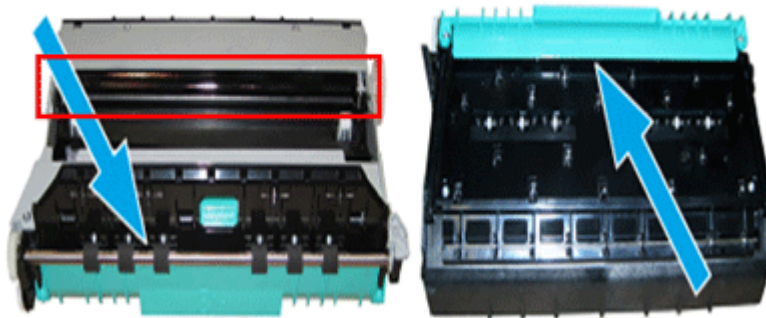

- d. Check the ICU-Duplex unit gears for damage, (i.e. broken teeth or ink build-up).

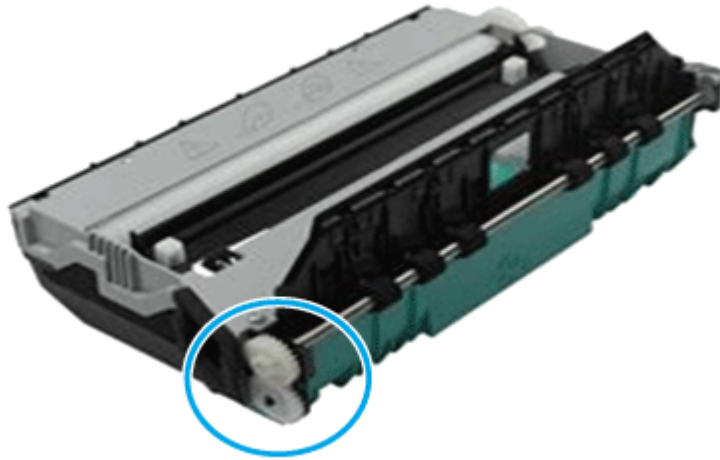

If the Duplex/Ink collection/reservoir unit (ICU) gears are damaged, the ICU will need to be replaced:




NOTE: The printer's ink collection unit (ICU) collects unused ink for later disposal. The life tracking on this supply is accomplished via a numeric percent life remaining (PLR) that starts at 100% and decreases in 1% increments as pages are printed. The engine counts the number of ink droplet that go into the ICU and reports this information to the formatter as a percentage of life remaining. The expected life of the ICU is nominally 120,000 pages* but this will vary depending on printing patterns.




NOTE: Reset ICU counter before new installation: **Settings > Manage Supplies > Reset Supplies > Ink Collection Unit.**

Waste Ink unit (ICU): D3Q24-67016

- e. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

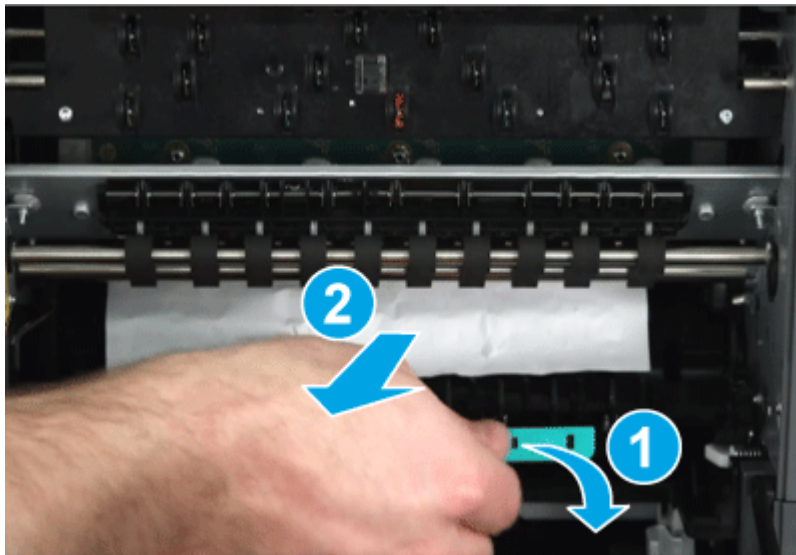

- f. Push the green tab up to put the platen door back into position.
- g. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.

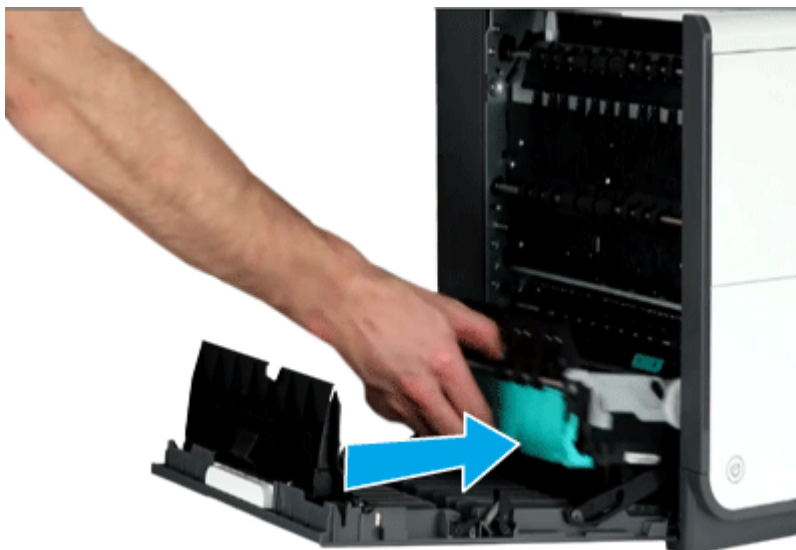

- 2. Test the printer to see if the issue is resolved.
- 3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.


Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

- 1. Clear the paper jam from duplexer (ICU) and check the printer for other sheets in the paper path.


Follow steps in video for: [HOW TO CLEAR A PAPER JAM IN THE INK COLLECTION AREA ON THE HP PAGEWIDE ENTERPRISE COLOR 586 MFP PRINTER](#)

- a. Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

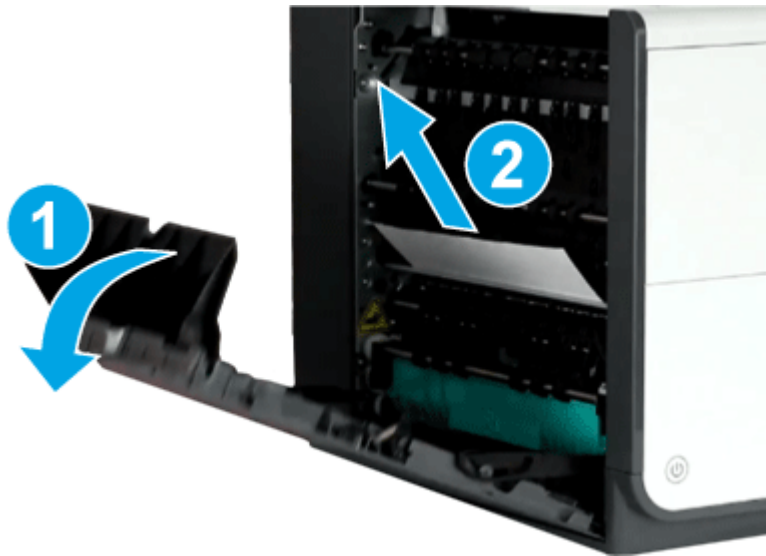


- b. Remove the Duplex/Waste Ink module.

Figure 6-27 Duplex/Waste module

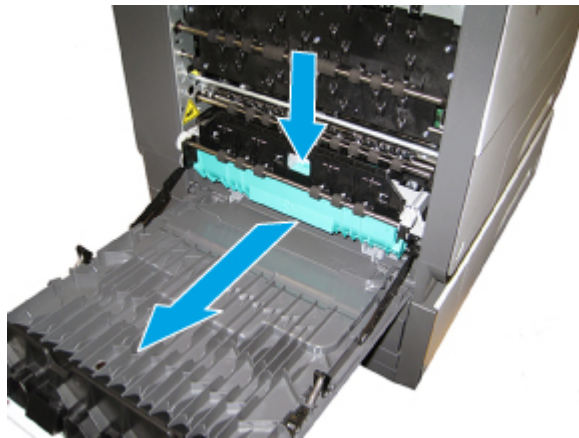


- c. With the green cartridge/ Duplex-Ink collection/reservoir unit (ICU) removed, inspect ICU and avoid red zone. Check both ICU and duplex drive Gears

Figure 6-28 Check the following areas.

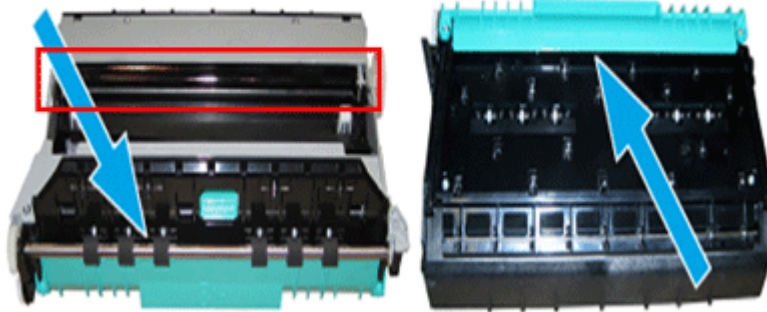

- d. Check the ICU-Duplex unit gears for damage, (i.e. broken teeth or ink build-up).

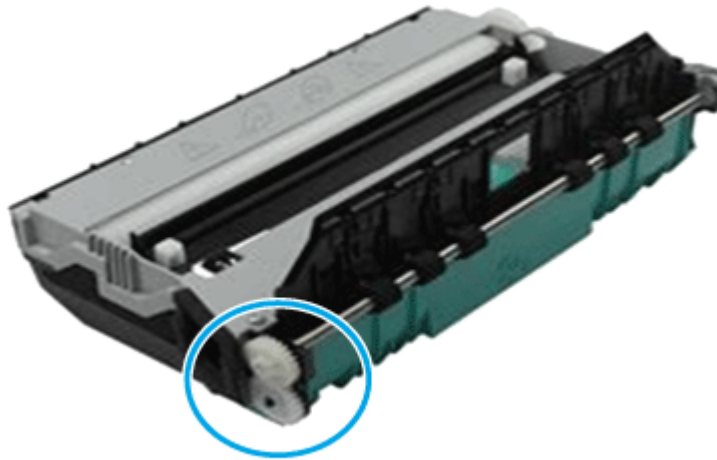

If the Duplex/Ink collection/reservoir unit (ICU) gears are damaged, the ICU will need to be replaced:




NOTE: The printer's ink collection unit (ICU) collects unused ink for later disposal. The life tracking on this supply is accomplished via a numeric percent life remaining (PLR) that starts at 100% and decreases in 1% increments as pages are printed. The engine counts the number of ink droplet that go into the ICU and reports this information to the formatter as a percentage of life remaining. The expected life of the ICU is nominally 120,000 pages* but this will vary depending on printing patterns.

 **NOTE:** Reset ICU counter before new installation: **Settings > Manage Supplies > Reset Supplies > Ink Collection Unit.**


Waste Ink unit (ICU): D3Q24-67016

- e. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

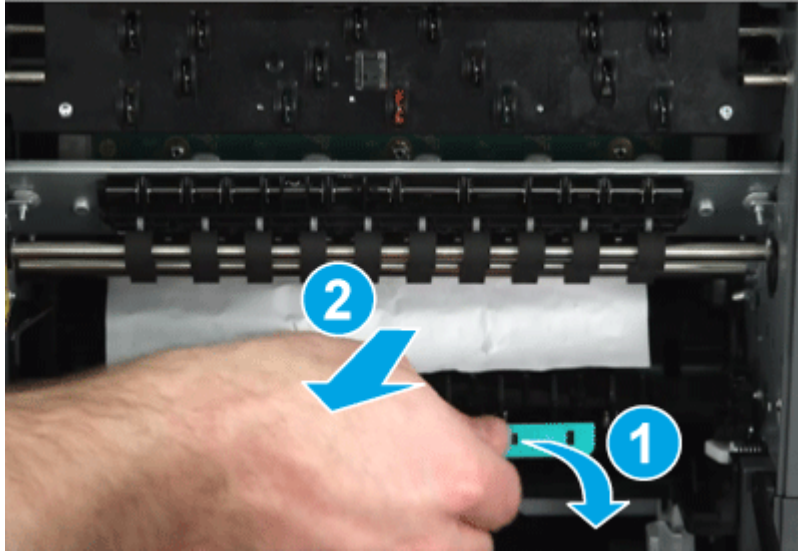


- f. Push the green tab up to put the platen door back into position.

- g. Help the customer check the duplexer drive gears inside the left door.

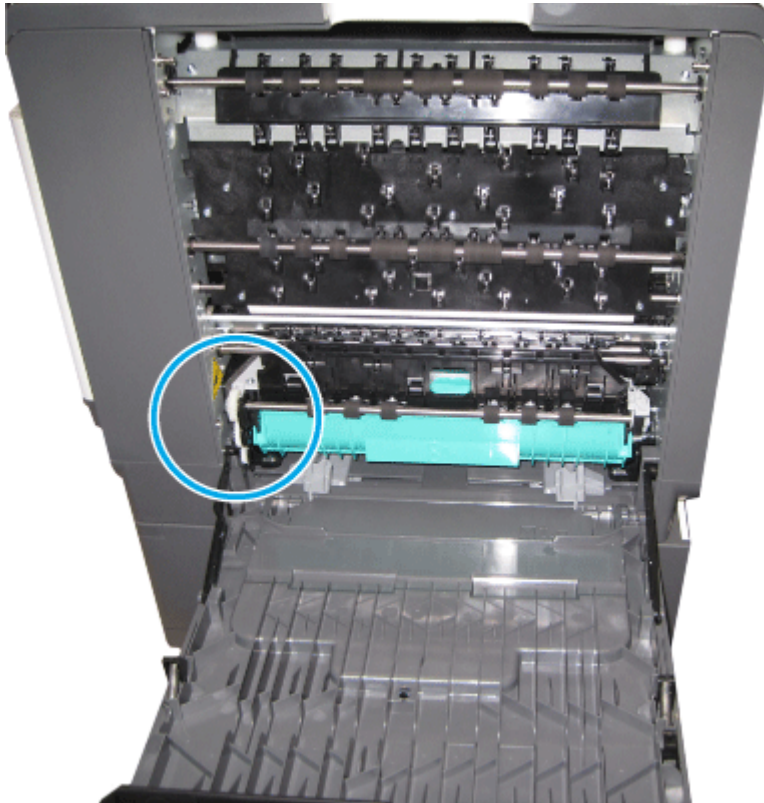

 **NOTE:** If gears on the chassis are damaged, Elevate the case using the Standard Support Process.

 **NOTE:** If possible, capture a picture of damaged gears to provide to HP Customer Support.

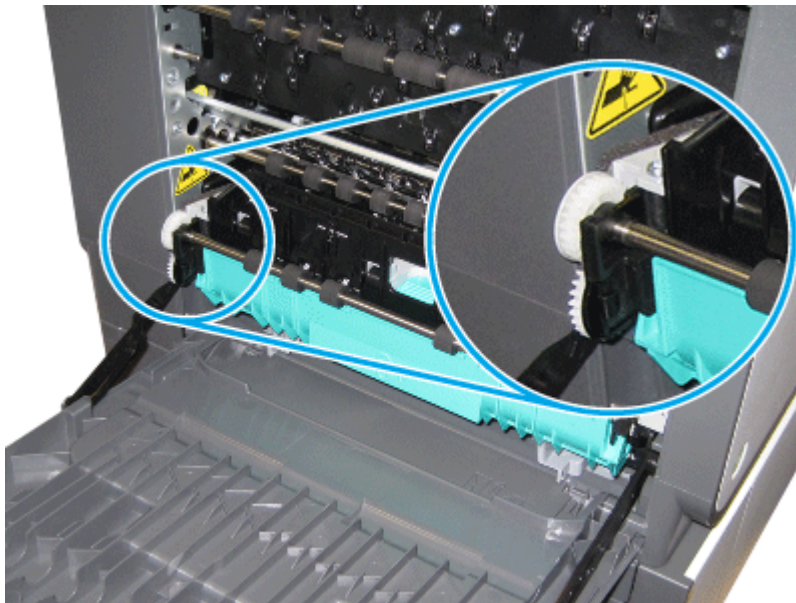

- h. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.



- 2. If the gears do not appear damaged or covered with ink and issue persists, dispatch onsite technician with Duplex drive module assembly.

Duplex drive module assembly part number: CN598-67036


Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

- 1. Clear the paper jam from duplexer (ICU) and check the printer for other sheets in the paper path.


Follow steps in video for: [HOW TO CLEAR A PAPER JAM IN THE INK COLLECTION AREA ON THE HP PAGEWIDE ENTERPRISE COLOR 586 MFP PRINTER](#)

- a. Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

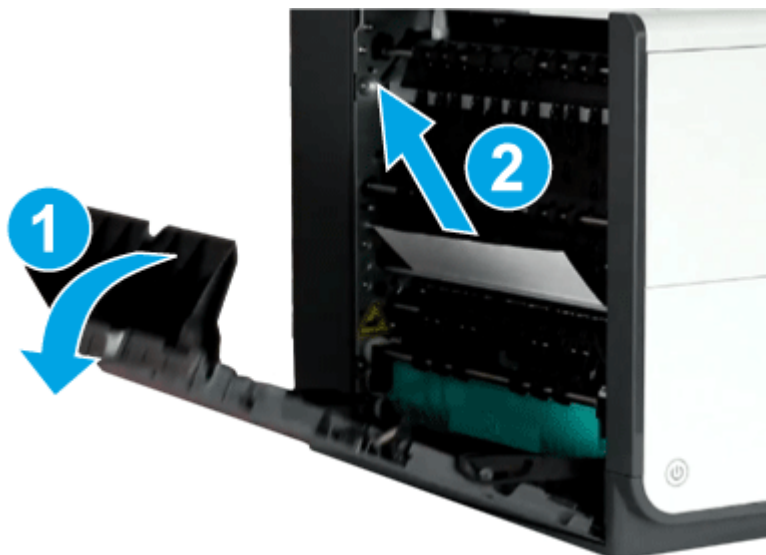


- b. Remove the Duplex/Waste Ink module.

Figure 6-29 Duplex/Waste module

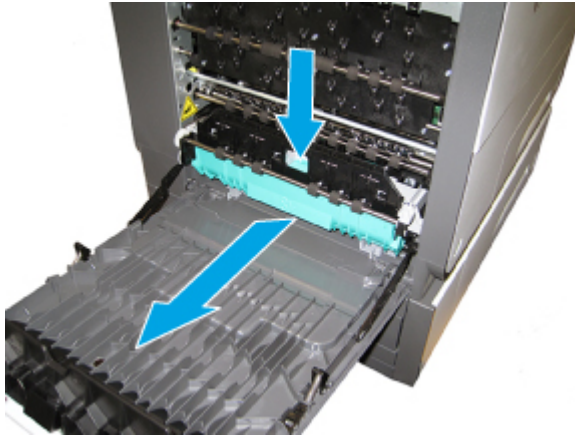


- c. With the green cartridge/ Duplex-Ink collection/reservoir unit (ICU) removed, inspect ICU and avoid red zone. Check both ICU and duplex drive Gears

Figure 6-30 Check the following areas.

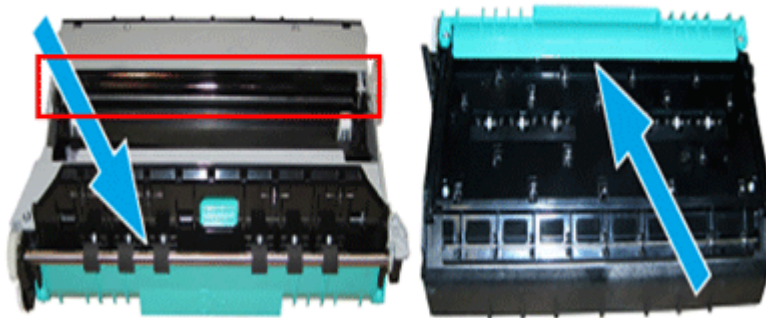

- d. Check the ICU-Duplex unit gears for damage, (i.e. broken teeth or ink build-up).

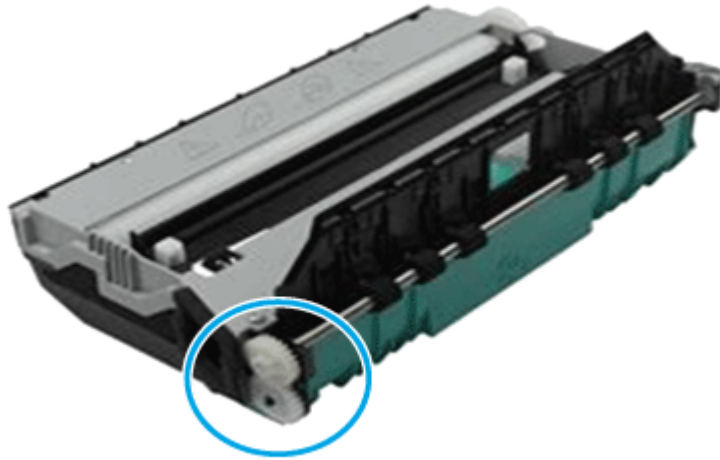


If the Duplex/Ink collection/reservoir unit (ICU) gears are damaged, the ICU will need to be replaced:

 **NOTE:** The printer's ink collection unit (ICU) collects unused ink for later disposal. The life tracking on this supply is accomplished via a numeric percent life remaining (PLR) that starts at 100% and decreases in 1% increments as pages are printed. The engine counts the number of ink droplet that go into the ICU and reports this information to the formatter as a percentage of life remaining. The expected life of the ICU is nominally 120,000 pages* but this will vary depending on printing patterns.

 **NOTE:** Reset ICU counter before new installation: **Settings > Manage Supplies > Reset Supplies > Ink Collection Unit.**


Waste Ink unit (ICU): D3Q24-67016

- e. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

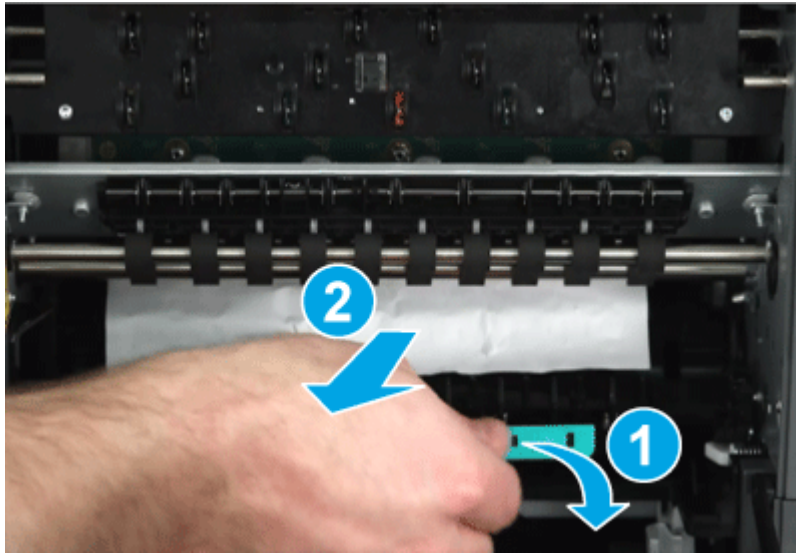


- f. Push the green tab up to put the platen door back into position.

- g. Help the customer check the duplexer drive gears inside the left door.

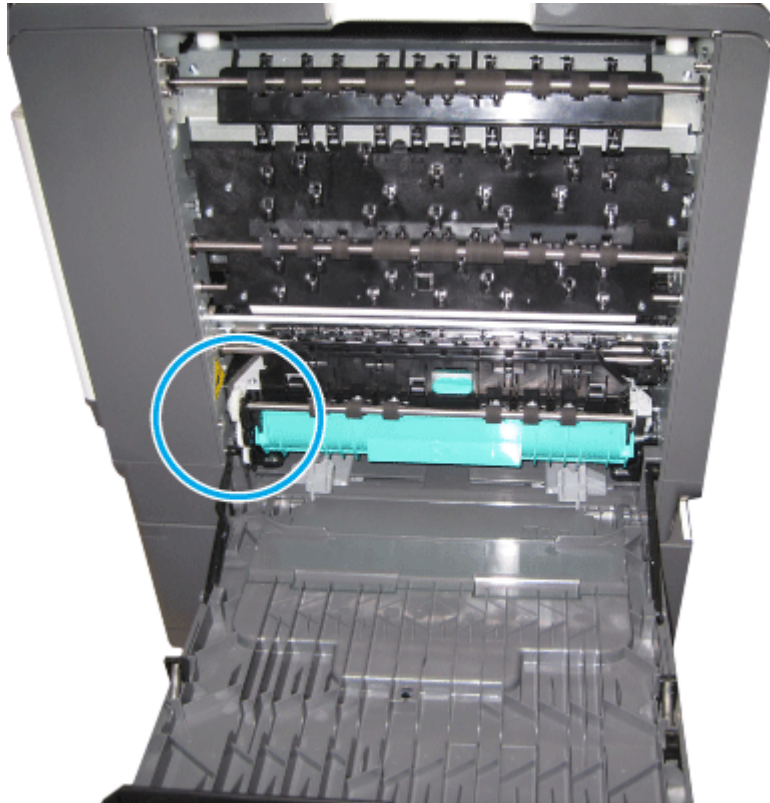


 **NOTE:** If gears on the chassis are damaged, Elevate the case using the Standard Support Process.


 **NOTE:** If possible, capture a picture of damaged gears to provide to HP Customer Support.

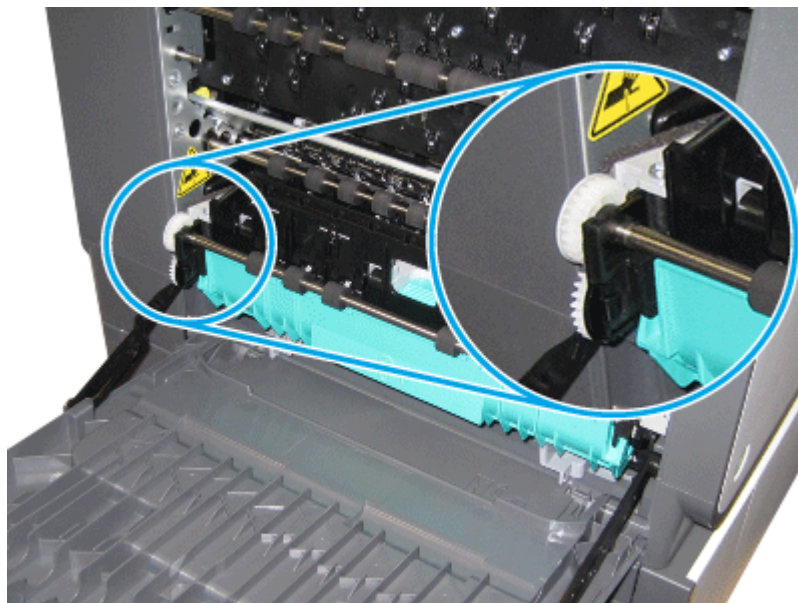

- h. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.

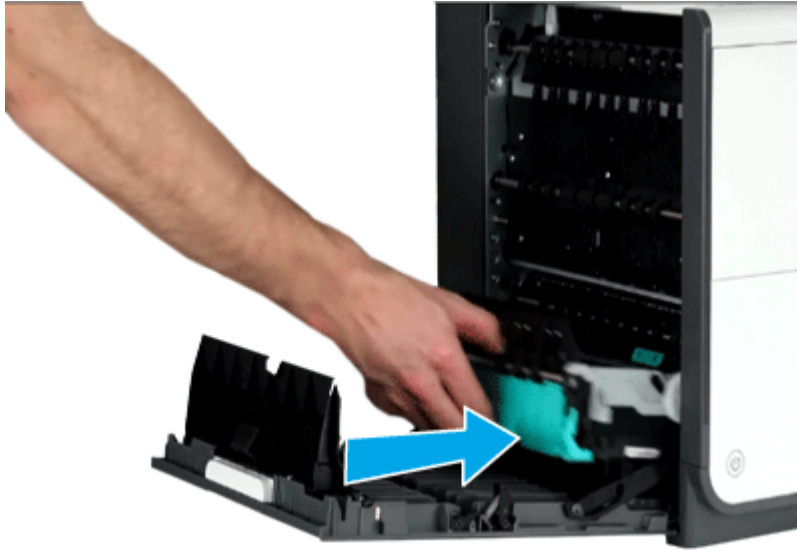

- 2. If the issue persists, test the Duplex drive module assembly using the steps below:
 - a. Mark one of the gears on the ICU as shown in the following image.

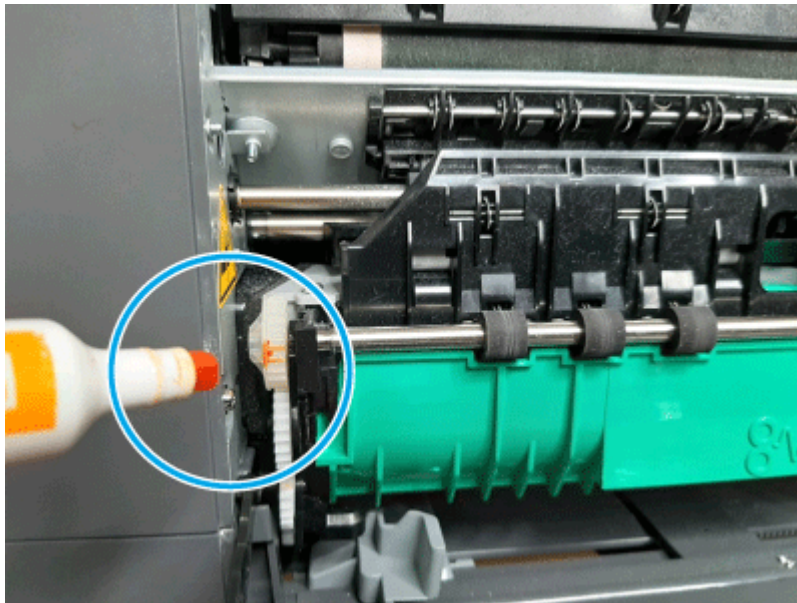


- b. Print a (simplex) job from Tray 1 (source) using the Paper Path Test, **Support Tools > Troubleshooting > Diagnostic Tests > Paper Path Test**.




NOTE: The Duplex Drive and Tray 1 use the same motor.

- c. Open the left door and check if the marked gear has changed position.

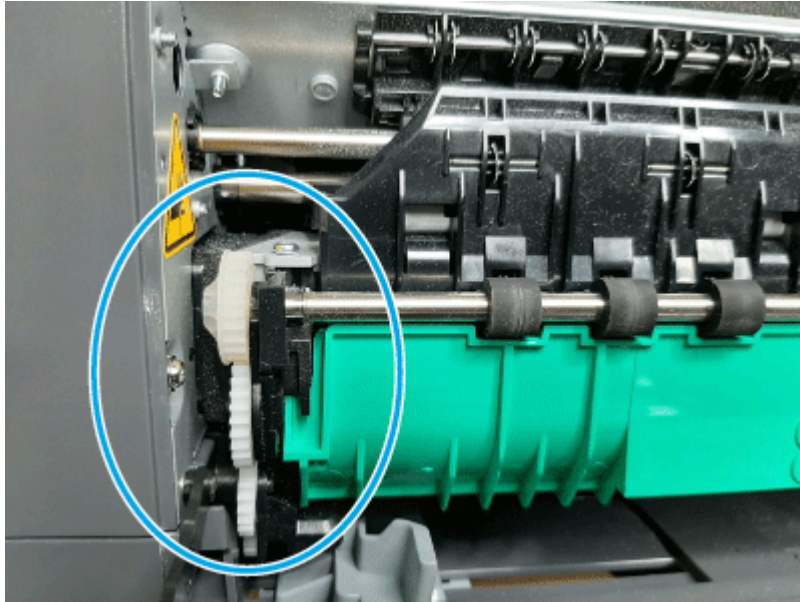

- d. If the gear **DOES NOT** rotate (the mark is in the same place, indicating the gear did not move), replace: the duplex drive module assembly.

Duplex drive module assembly: CN598-67036

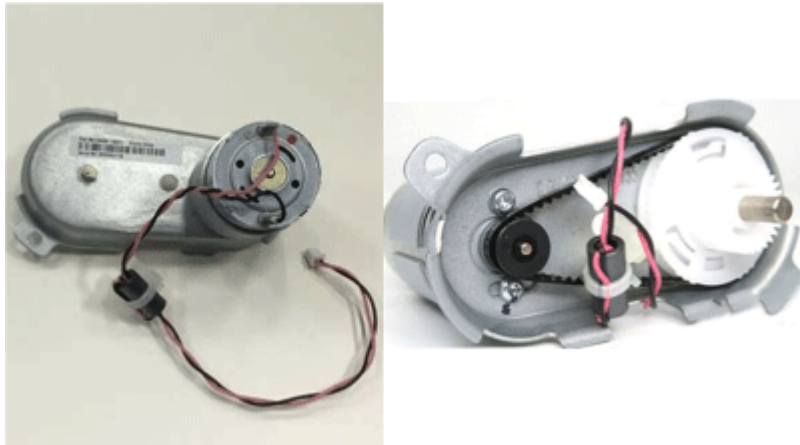

3. If the gear **DOES** rotate (the mark is in a different place, indicating the gear has moved) and there is still a duplex jam error, please elevate the case using the Standard Support Process.

15 . Ex . yz Output jam from Tray X

A jam has occurred in the EJECT area (UPPER LEFT DOOR) from the designated tray.

- **15.E0.02:** Paper Eject jam. There is a paper jam in upper left door when printing from Tray2.
- **15.E0.03:** Paper Eject jam. There is a paper jam in upper left door when printing from Tray3.
- **15.E1.A0:** Paper Eject jam. There is a paper stay jam in upper left door at the REDI sensor when printing from an unknown tray (page never left the sensor).

- **15.E1.A2:** Paper Eject jam. There is a paper stay jam in upper left door at the REDI sensor when printing from tray 2 (page never left the sensor).
- **15.E1.A3:** Paper Eject jam. There is a paper stay jam in upper left door at the REDI sensor when printing from tray 3 (page never left the sensor).
- **15.E1.D2:** Paper Eject jam. There is a paper delay jam in upper left door at the REDI sensor when printing from tray 2 (page never reached the sensor).
- **15.E1.D3:** Paper Eject jam. There is a paper delay jam in upper left door at the REDI sensor when printing from tray 3 (page never reached the sensor).

Recommended action for customers:

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam and check the printer for other sheets in the paper path.

For customer troubleshooting steps go to:

[HP PageWide Enterprise Color MFP 586 - Clear jams in the output bin](#)

- a. Remove any paper from the output rollers and bin. Pull out the wrinkled paper in the tray and any remaining pieces of paper.




- b. Check if the output bin delivery flap functions correctly or is stuck. Use your finger to open the flap and see if it closes correctly.




NOTE: If you encounter Paper Jam - Clear Output Bin Area / Standard Bin Full investigate the following possible symptoms related to the Output Flap.




- If the output flap is slightly open as pictured or fully open and will not close. Please call HP support.
 - If the output flap doesn't open at all. Please Call HP support.
- c. Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

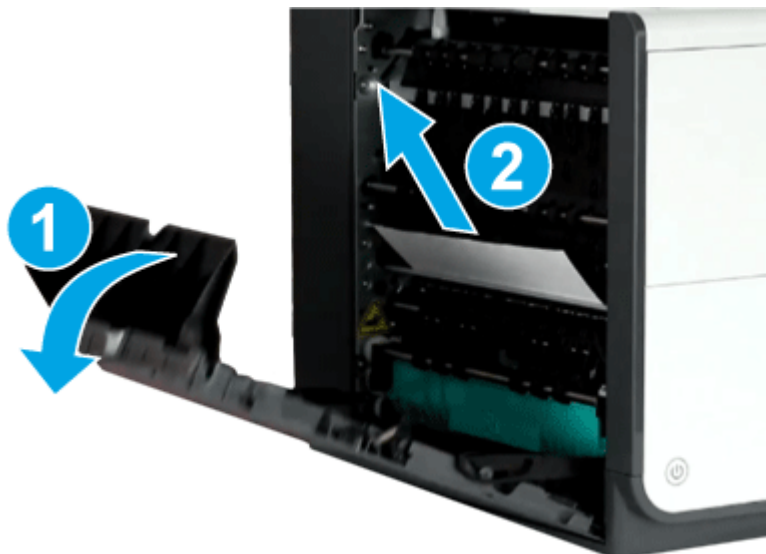


- d. With the left door open, remove ink collection unit (ICU) using the green handle.

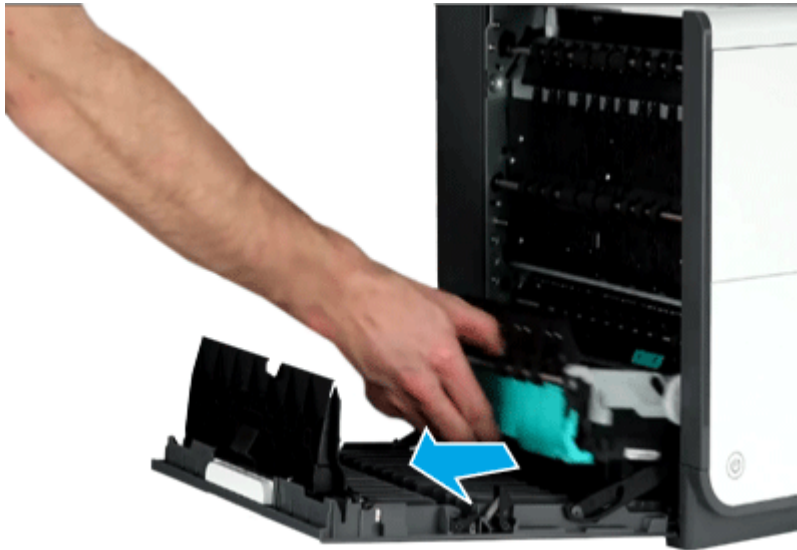

- e. Inspect the ICU for jammed paper and remove any paper found. (Avoid touching the waste ink reservoir highlighted in BLUE in the following image.)

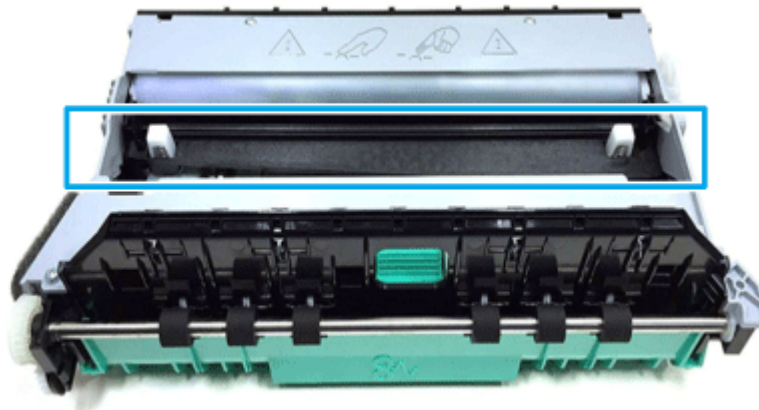

- f. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

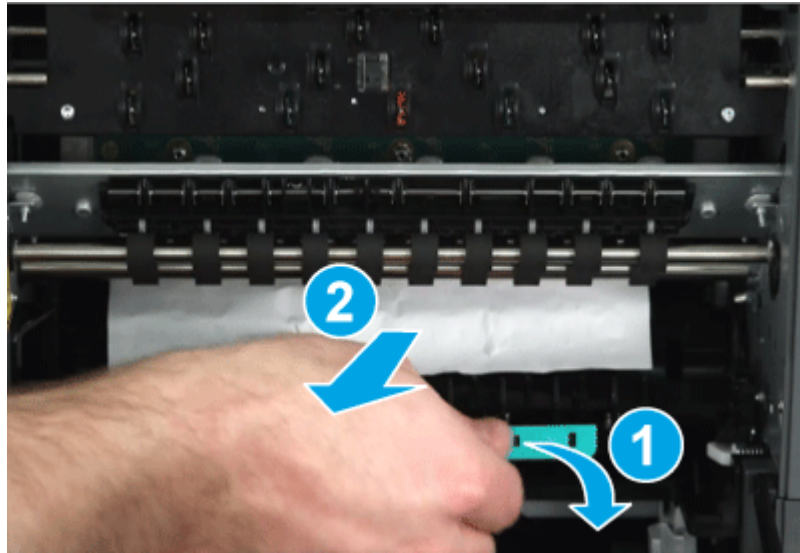

- g. Push the green tab up to put the platen door back into position.
- h. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.



- 2. Test the printer to see if the issue is resolved.
- 3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents:

Follow these troubleshooting steps in the order presented.

- 1. Clear the paper jam and check the printer for other sheets in the paper path.

For customer troubleshooting steps go to:

[HP PageWide Enterprise Color MFP 586 - Clear jams in the output bin](#)

- a. Remove any paper from the output rollers and bin. Pull out the wrinkled paper in the tray and any remaining pieces of paper.



- b. Check if the output bin delivery flap functions correctly or is stuck. Use your finger to open the flap and see if it closes correctly.



NOTE: If you encounter Paper Jam - Clear Output Bin Area / Standard Bin Full investigate the following possible symptoms related to the Output Flap.




- If the output flap is slightly open as pictured or fully open and will not close, dispatching a technician to replace the following parts.

Output flap / Sensor kit part number: D3Q24-67004

- If the output flap doesn't open at all, dispatching a technician to replace the following parts.

Output drive kit part number: D3Q24-67003


- c. Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

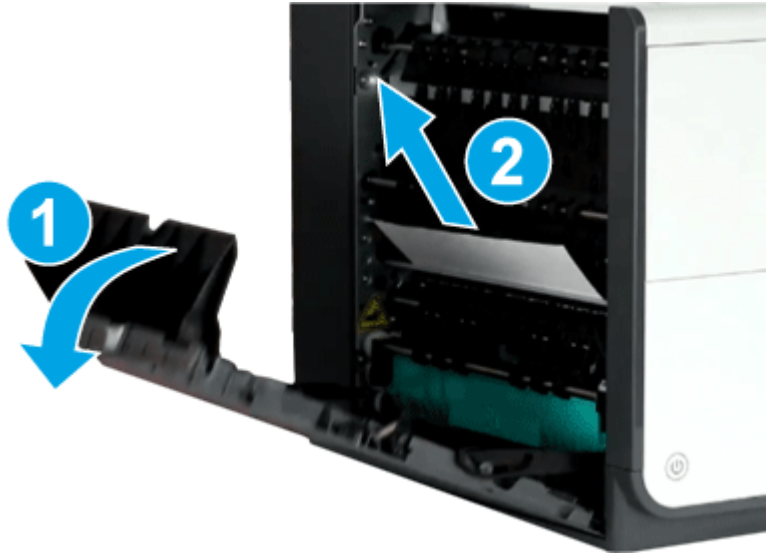


- d. With the left door open, remove ink collection unit (ICU) using the green handle.



- e. Inspect the ICU for jammed paper and remove any paper found. (Avoid touching the waste ink reservoir highlighted in BLUE in the following image.)

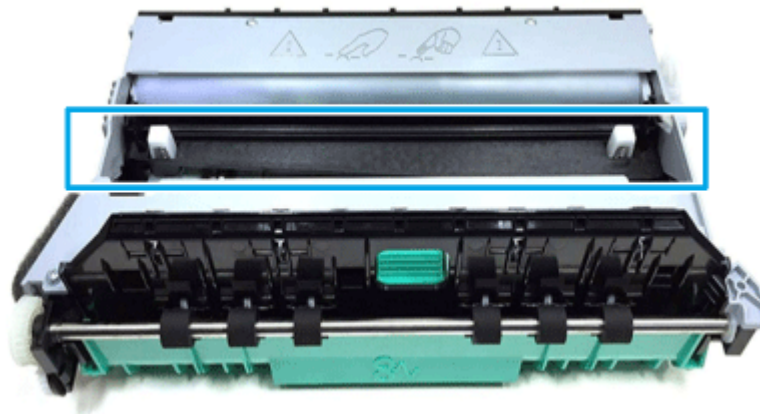

- f. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

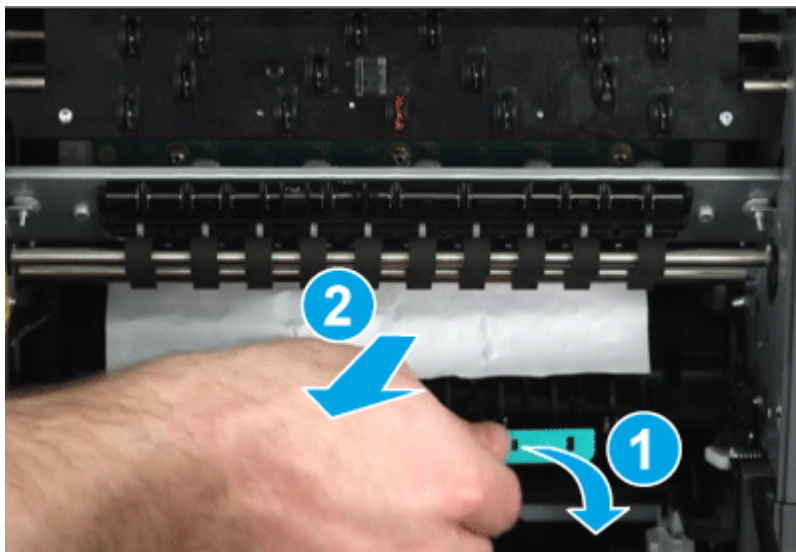

- g. Push the green tab up to put the platen door back into position.

- h. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.



2. If the issue persists, dispatch a service technician to replace the following parts.
- Output drive assembly - Eject drive gear module - D3Q24-67003
 - Eject jam REDI sensor - CN598-67038

Recommended action for service technicians:

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam and check the printer for other sheets in the paper path.

For customer troubleshooting steps go to:

[HP PageWide Enterprise Color MFP 586 - Clear jams in the output bin](#)

- a. Remove any paper from the output rollers and bin. Pull out the wrinkled paper in the tray and any remaining pieces of paper.



- b. Check if the output bin delivery flap functions correctly or is stuck. Use your finger to open the flap and see if it closes correctly.



NOTE: If you encounter Paper Jam - Clear Output Bin Area / Standard Bin Full investigate the following possible symptoms related to the Output Flap.



- If the output flap is slightly open as pictured or fully open and will not close, dispatching a technician to replace the following parts.


Output flap / Sensor kit part number: D3Q24-67004

- If the output flap doesn't open at all, dispatching a technician to replace the following parts.

Output drive kit part number: D3Q24-67003

VIDEO: [Resolving Output Bin Full Errors on HP PageWide https://youtu.be/69zN63uLKEg](https://youtu.be/69zN63uLKEg)


- c. Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

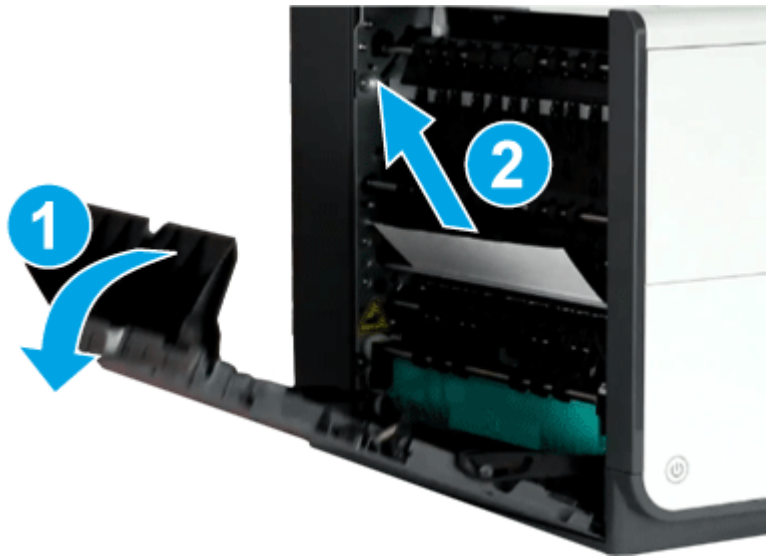


- d. With the left door open, remove ink collection unit (ICU) using the green handle.



- e. Inspect the ICU for jammed paper and remove any paper found. (Avoid touching the waste ink reservoir highlighted in BLUE in the following image.)

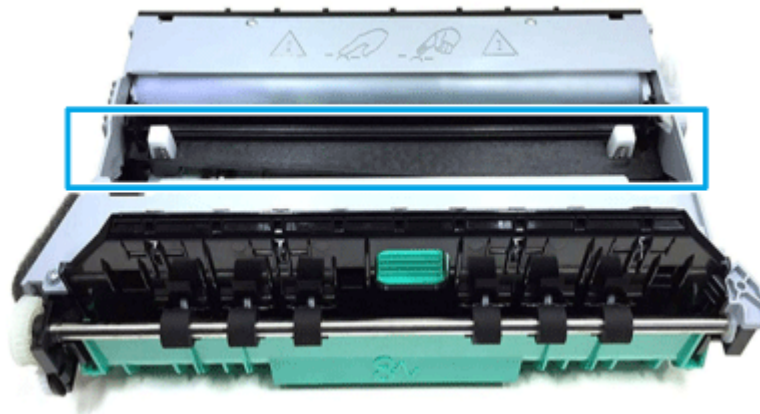

- f. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

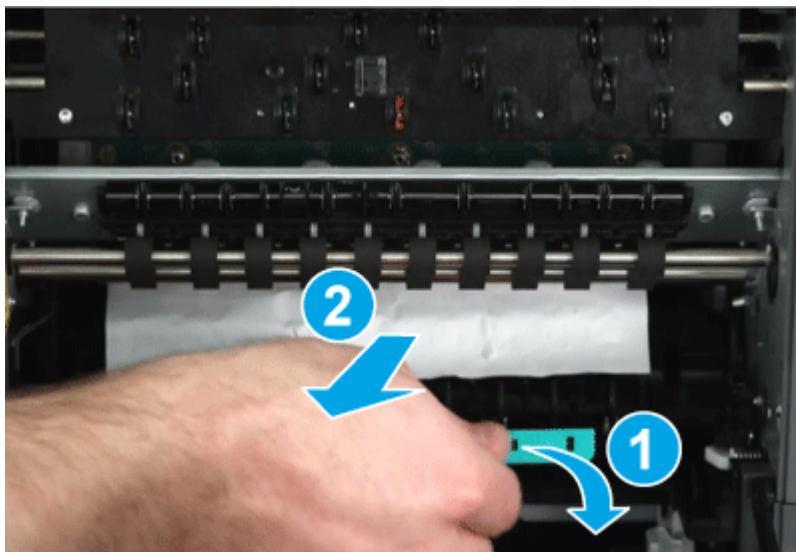


- g. Push the green tab up to put the platen door back into position.

- h. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.



- 2. If the issue persists, clean the mirror and beam surfaces of the elect floor REDI sensors.

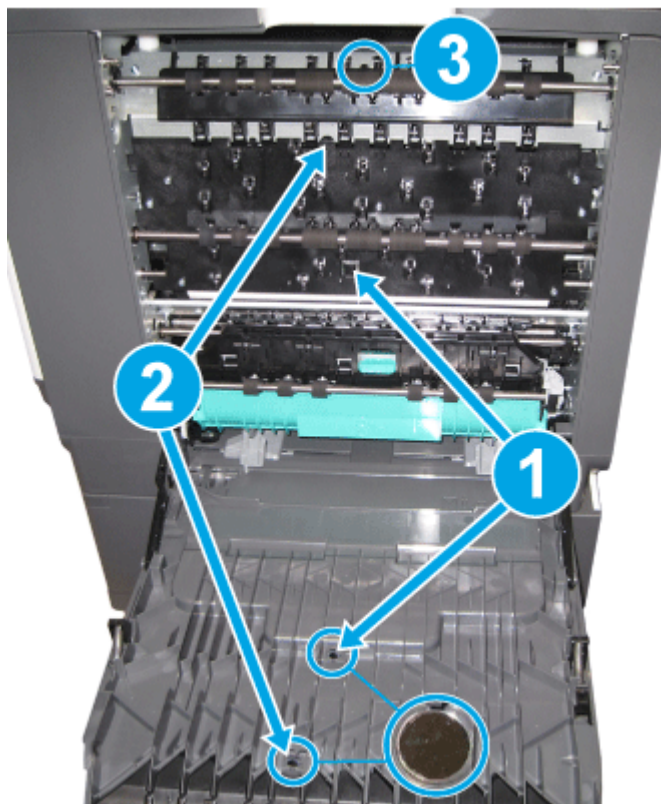

Callout 1: Lower REDI sensor

Callout 2: Upper REDI sensor

Callout 3: Eject jam REDI sensor

3. If issue persist, try to print a page and double check if the eject rollers rotate.



If the eject rollers are **NOT** rotating, replace the output drive assembly.

Output drive assembly - Eject drive gear module - D3Q24-67003

4. If the issue persists, replace the Eject Floor REDI sensor.
 - Output drive assembly - Eject drive gear module - D3Q24-67003
 - Eject floor REDI sensor - CN598-67038
5. If the issue persists, please elevate the case using the Standard Support Process.

 **IMPORTANT:** Do Not order a Mech Kit without first elevating the case using your regional standard support process.

15 . FX . YZ unknown jam from Tray X

A jam has occurred at multiple sensors or at a unknown sensor from the tray designated.

Example: 15.F0.02 – multiple sensor or unknown sensor jam from Tray 2

Recommended action for customers:

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam and check the printer for other sheets in the paper path.

For customer troubleshooting steps go to:

[HP PageWide Enterprise Color MFP 586 - Clear jams in the output bin](#)

- a. Remove any paper from the output rollers and bin. Pull out the wrinkled paper in the tray and any remaining pieces of paper.



- b. Check if the output bin delivery flap functions correctly or is stuck. Use your finger to open the flap and see if it closes correctly.




NOTE: If you encounter Paper Jam - Clear Output Bin Area / Standard Bin Full investigate the following possible symptoms related to the Output Flap.



- If the output flap is slightly open as pictured or fully open and will not close. Please call HP support.
- If the output flap doesn't open at all. Please Call HP support.


- c. Open left door/side panel (callout 1) and remove any jammed paper (callout 2).

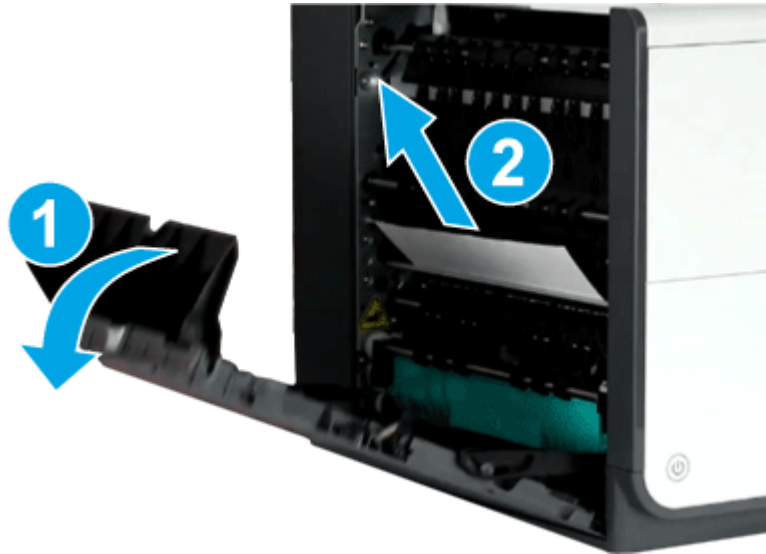


- d. With the left door open, remove ink collection unit (ICU) using the green handle.



- e. Inspect the ICU for jammed paper and remove any paper found. (Avoid touching the waste ink reservoir highlighted in BLUE in the following image.)

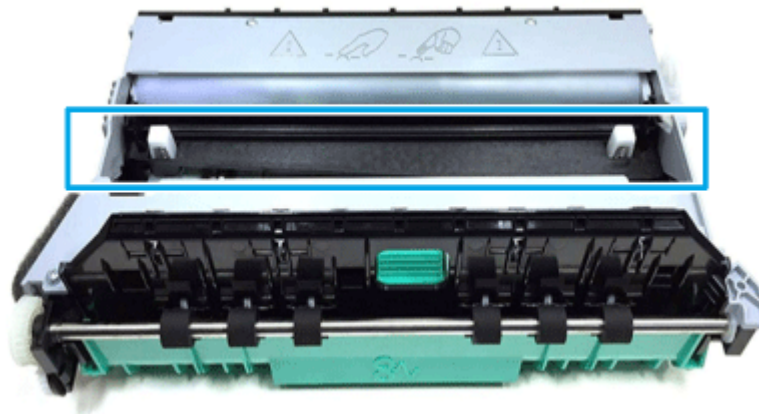


- f. Clear any jammed paper found in the ICU cavity. Pull down jam access lever (callout 1) and remove any paper (callout 2).

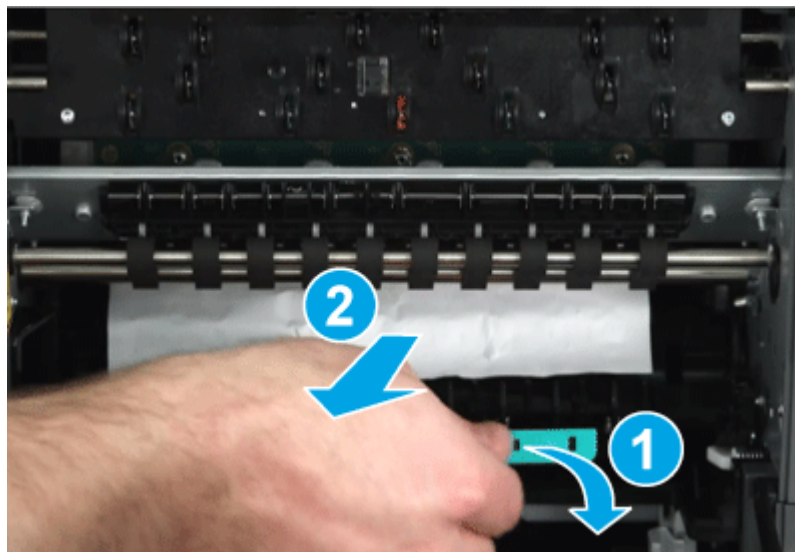

- g. Push the green tab up to put the platen door back into position.

- h. Reinstall Duplex-Ink Collection Unit (ICU) and close left door.

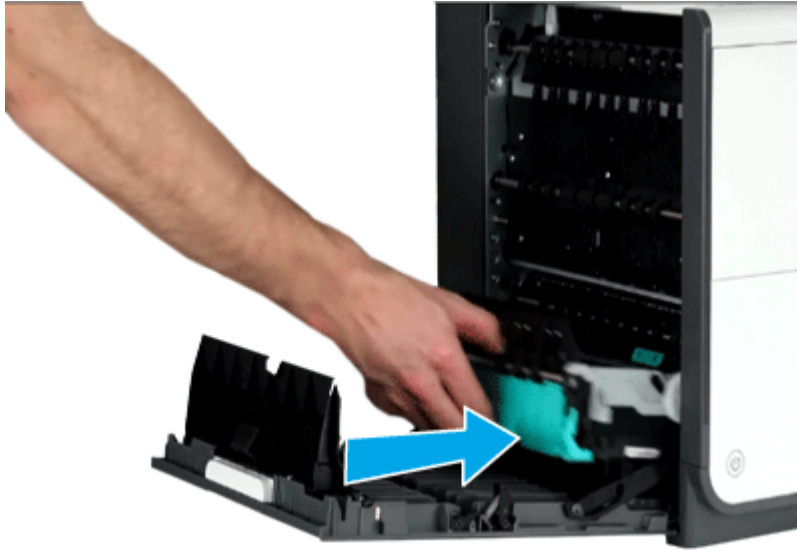

- 2. Test the printer to see if the issue is resolved.
- 3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

- 1. Clear all possible paper jam locations.
 - a. Open the Tray 3 jam-access door and remove paper if present.
 - b. Pull all paper trays completely out and remove the paper stack.
 - c. Remove jammed paper from the feed rollers inside the printer.
 - d. Open the left door.
 - e. Remove the ICU.
 - f. Lower the platen to remove paper.
 - g. Lift the green tab to raise the platen back into position.
 - h. Install the ICU.
 - i. Close the left door.
 - j. Remove paper from the output rollers and bin.
- 2. Run the Paper Path Diagnostics procedure to move paper from the tray to the output bin. ([Administration / Troubleshooting / Paper Path Page](#)).
- 3. If the issue persists, elevate the case using the Standard Support Process..

17.XX.YZ error messages (supply errors)

17.* error messages

Errors in the 17.* family are related to ink cartridges and other supply items that require regular replacement as part of routine printer maintenance.

The customer is expected to order replacement supplies and install them as necessary. Use the following list to identify the supply item affected:



NOTE: Not all printers have all of these supplies.

- 17.00.xx = Black ink cartridge
- 17.01.xx = Cyan ink cartridge
- 17.02.xx = Magenta ink cartridge
- 17.03.xx = Yellow ink cartridge
- 17.31.xx = Ink collection unit

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. For ink cartridges:
 - a. Remove and reinstall the cartridge.
 - b. Check the supplies memory chip. If it is damaged, replace the cartridge.
 - c. If print quality is unacceptable, or if printing cannot continue, replace the cartridge.
2. For the ink collection unit:
 - a. Remove the ink collection unit and reinstall it.
 - b. If the ink collection unit is nearly full, replace it with a new one. Using an ink collection unit until it is overfilled can damage the printer.

17.0x.00 Failed Cartridge

The indicated cartridge is detected but its data is corrupt or invalid in some way.

- **17.00.00** – Black Cartridge
- **17.01.00** – Cyan Cartridge
- **17.02.00** – Magenta Cartridge
- **17.03.00** – Yellow Cartridge

Recommended action

1. Remove the cartridge, reinstall it and close the ink door.
2. Turn the printer off, and then on again.

3. Replace the failing cartridge.
4. If the issue persists, elevate the case using the Standard Support Process.

17 . 0x . 34 Counterfeit or refilled cartridge installed

The supply being used is either a counterfeit or refilled cartridge.

- **17.00.34** – Black Cartridge
- **17.01.34** – Cyan Cartridge
- **17.02.34** – Magenta Cartridge
- **17.03.34** – Yellow Cartridge

Recommended action

To avoid this condition always use genuine HP cartridges.

1. The user must replace with a genuine HP cartridge or approve the use of refilled cartridges before printing can continue.
2. If you believe you purchased a genuine HP supply, go to www.hp.com/go/anticounterfeit. Any print quality repair required as a result of using used cartridges is not covered under warranty. Supply status and features depending on supply status are not available.

17 . 0x . 35 Incompatible <supply>

The indicated supply is not compatible with this printer.

- **17.00.35** – Black Cartridge
- **17.01.35** – Cyan Cartridge
- **17.02.35** – Magenta Cartridge
- **17.03.35** – Yellow Cartridge

Recommended action

1. To avoid this condition, always use genuine HP cartridges.
2. The user must replace with a genuine HP cartridge or approve the use of refilled cartridges before printing can continue.

17 . 0x . 36 Non-Startup cartridge at startup

Non-Startup cartridge is being used at startup.

A trade cartridge has been installed before the purge process has been completed.

- **17.00.36** – Black Cartridge
- **17.01.36** – Cyan Cartridge
- **17.02.36** – Magenta Cartridge
- **17.03.36** – Yellow Cartridge

Recommended action

1. To avoid this condition always use the startup cartridges that shipped with the printer.
2. Do not override and use trade cartridges unless absolutely necessary. If the user later finds the startup cartridges after initialization, these startup cartridges will be unusable on this printer.

17 . 0x . 37 Startup Cartridge after startup completed

Startup cartridge is being used after startup completed.

- **17.00.37** – Black Cartridge
- **17.01.37** – Cyan Cartridge
- **17.02.37** – Magenta Cartridge
- **17.03.37** – Yellow Cartridge

Recommended action

- To avoid this condition, always use trade cartridges after initialization has completed and the original startup cartridges are spent.

Startup cartridges can only be used the first time the printer is initialized.

Once a startup cartridge has been used for initialization its memory tag contents are changed to indicate it will now behave and be detected as a trade cartridge.

17 . 0x . 38 Cartridge might be empty

The cartridge indicated might be empty.

Continuing may cause image quality issues.

This is a transient condition that occurs when the cartridge memory tag indicates empty and the cartridge is newly inserted into a printer.

- **17.00.38** – Black Cartridge
- **17.01.38** – Cyan Cartridge
- **17.02.38** – Magenta Cartridge
- **17.03.38** – Yellow Cartridge

Recommended action

- There are several possible outcomes when this condition is detected.
 - a. The user removes the cartridge from the printer and replaces it with a non-empty cartridge.
 - b. The user touches **OK** and approves the use of the possibly empty cartridge.
 - The printer attempts to pump/prime ink but is unsuccessful. The cartridge is declared as “Empty”.
 - Some ink was previously stranded due to tilt and the pump/prime is successful. The cartridge is declared as “Low” or possibly “Very Low”.

- Cartridge has been refilled and now after printing some number of pages, the cartridge will be declared as “Refilled”.

17.0x.39 Use new cartridges

The startup-trade cartridge override feature has been enabled and a partially used cyan cartridge has been installed before the ink initialization process completed.

The cartridge might not be able to complete the ink initialization.

Using a new cartridge allows the process to complete in one session, preventing the user from leaving and coming back to find the process incomplete.

- **17.00.39** – Black Cartridge
- **17.01.39** – Cyan Cartridge
- **17.02.39** – Magenta Cartridge
- **17.03.39** – Yellow Cartridge

Recommended action

Touch **OK** to continue or use a new cartridge.

If a “Too Low to Prime” condition occurs, use the following steps.

1. The engine has determined that there is probably not enough ink in the installed trade cartridge to complete the initialization (ink purge) process.
2. The user can touch **OK** to proceed anyway (they may see this same message again once the current cartridge is depleted).
3. The user can replace the partially full trade cartridge with a replacement that is full.

17.0x.42 General printing error

Ink supply ran low sooner than expected (SHAID too early) or an ink delivery system failure has occurred.

The SHAID PCA reads the ink supply information from the cartridge acumen and detects low-ink conditions. It also collects and distributes signals to drive the ink delivery system.

- **17.00.42** – Black Cartridge
- **17.01.42** – Cyan Cartridge
- **17.02.42** – Magenta Cartridge
- **17.03.42** – Yellow Cartridge



NOTE: This condition does not distinguish between SHAID too early and a failure in the ink delivery system.

Recommended action

1. Turn the printer off, and then on again.
2. Replace the cartridge.

3. If the issue persists, elevate the case using the Standard Support Process.

17 . 0x . 52 Supply upgrade detected

The indicated supply upgrade was detected.

- **17.00.52** – Black Cartridge
- **17.01.52** – Cyan Cartridge
- **17.02.52** – Magenta Cartridge
- **17.03.52** – Yellow Cartridge

Recommended action

- Touch **OK** to continue or change cartridge.

17 . 0x . 53 Supply upgrade successful

The indicated supply upgrade was successful.

- **17.00.53** – Black Cartridge
- **17.01.53** – Cyan Cartridge
- **17.02.53** – Magenta Cartridge
- **17.03.53** – Yellow Cartridge

Recommended action

- No action necessary.

17 . 0x . 54/17 . 0x . 55 Supply upgrade problem

The indicated supply encountered an upgrade problem.

The requested upgrade (addition of a new cartridge to the list of supported cartridges stored in the engine NVRAM) using a trade cartridge did not succeed. The formatter does not know why the failure occurred, only that it did fail.

- **17.00.54** – Black Cartridge
- **17.01.54** – Cyan Cartridge
- **17.02.54** – Magenta Cartridge
- **17.03.54** – Yellow Cartridge
- **17.00.55** – Black Cartridge
- **17.01.55** – Cyan Cartridge
- **17.02.55** – Magenta Cartridge
- **17.03.55** – Yellow Cartridge

Recommended action

1. Replace the failed cartridge with one that is known good and then reinsert the upgrade cartridge and try again.
2. Turn the printer off, and then on again.
3. Remove the upgrade cartridge and go back to using the cartridge(s) supported at release.
4. If the issue persists, elevate the case using the Standard Support Process.

17 . 0x . 56 Ink sensor warning

The ink sensor might not be able to detect when supplies are empty or the cartridge has been refilled.

The indicated cartridge has printed past approximately 150% of its expected capacity and there has been no SHAID event. The SHAID PCA detects information from the cartridge acumen and should have produced a error message before this 150% capacity warning.

- **17.00.56** – Black Cartridge
- **17.01.56** – Cyan Cartridge
- **17.02.56** – Magenta Cartridge
- **17.03.56** – Yellow Cartridge

Recommended action

1. If print quality issues exist, replace the cartridge.
2. Check cartridge warranty and manufacture date. Check event log for low on ink code. If user acknowledges, assume cartridge has been refilled.

17 . 0x . 57 HP Cartridge Protection enabled

The indicated cartridge that has been protected using the HP cartridge protection feature has been detected.

The target cartridge has been locked to a different printer and cannot be used on this device.

- **17.00.57** – Black Cartridge
- **17.01.57** – Cyan Cartridge
- **17.02.57** – Magenta Cartridge
- **17.03.57** – Yellow Cartridge

Recommended action

1. Replace the indicated cartridge with one that has not been protected on another device.
2. Once a cartridge is locked to a given device there is no way to unlock the cartridge.

17 . 0x . 60 Cartridge Low Warning

The indicated cartridge is low.

- **17.00.60** – Black Cartridge
- **17.01.60** – Cyan Cartridge
- **17.02.60** – Magenta Cartridge
- **17.03.60** – Yellow Cartridge

Recommended action

- No action necessary.

17 . 0x . 65 or 17 . 0x . 80 Install Supply

The indicated cartridge is not installed or missing or has a damaged acumen.

- **17.00.65** – Black Cartridge
- **17.01.65** – Cyan Cartridge
- **17.02.65** – Magenta Cartridge
- **17.03.65** – Yellow Cartridge
- **17.00.80** – Black Cartridge
- **17.01.80** – Cyan Cartridge
- **17.02.80** – Magenta Cartridge
- **17.03.80** – Yellow Cartridge

Recommended action

1. Reinstall the supply.
2. Replace the indicated supply.

17 . 0x . 69 Cartridge Very Low

The indicated cartridge is very low.

- **17.00.69** – Black Cartridge
- **17.01.69** – Cyan Cartridge
- **17.02.69** – Magenta Cartridge
- **17.03.69** – Yellow Cartridge

The target cartridge has been depleted and the only ink remaining is in the X chamber and print head. The cartridge can be replaced in this state without any loss of ink to the system.

Recommended action

- No action necessary.

17 . 0x . 70 Printing past very low

The indicated cartridge is printing past very low.

- **17.00.70** – Black Cartridge
- **17.01.70** – Cyan Cartridge
- **17.02.70** – Magenta Cartridge
- **17.03.70** – Yellow Cartridge

Recommended action

1. The print quality should not degrade in any way when the ink cartridge approaches end-of-life as the printer will halt printing when all of the usable ink has been depleted.
2. Customers should have a spare cartridge on-hand as the indicated cartridge will transition to Empty in just a few pages.
3. If print quality is not acceptable replace the indicated cartridge.

17 . 31 . 60 Supply Ink Collection Warning

The ink collection unit almost full. The percentage of life remaining is 2%.

The printer's ink collection unit (ICU) collects unused ink for later disposal. The life tracking on this supply is accomplished via a numeric percent life remaining (PLR) that starts at 100% and decreases in 1% increments as pages are printed. The engine counts the number of ink droplet that go into the ICU and reports this information to the formatter as a percentage of life remaining. The expected life of the ICU is nominally 120,000 pages but this will vary depending on printing patterns.

Recommended action

- A new ICU should be ordered and printing can continue.



NOTE: There is no sensor that indicates when the ICU has been replaced. For this reason the user will be asked near end of ICU life if the ICU has been replaced each time the left door closes or a power-on occurs.

17 . 31 . 65 Install Supply Ink Collection Unit

The ink collection unit (ICU) is not installed.

This numerical code shows up whenever ICU is removed, for instance, for removing a paper jam. So, even though it's logged in the event log, it doesn't mean that the sensor is not working.

Recommended action for customers

1. Install the ICU. Make sure the ICU is aligned and installed correctly.
2. If message continues to appear, replace the ICU.

For instructions: *Removal and replacement: Ink collection unit*

Part number: B5L04-67906

Recommended action for call-center agents

1. Install the ICU. Make sure the ICU is aligned and installed correctly.
2. If message continues to appear, replace the ICU.

For instructions: *Removal and replacement: Ink collection unit*

Ink collection/reservoir unit part number: B5L04-67906

Recommended action for on-site technicians

1. Install the ICU. Make sure the ICU is aligned and installed correctly.
2. If the ICU sent via CSR did not solve the issue, consider replacing the PCA behind the power button PCA, which includes the hall effect sensor monitoring it. Part number is not available though, so we should replace the Mech Kit.

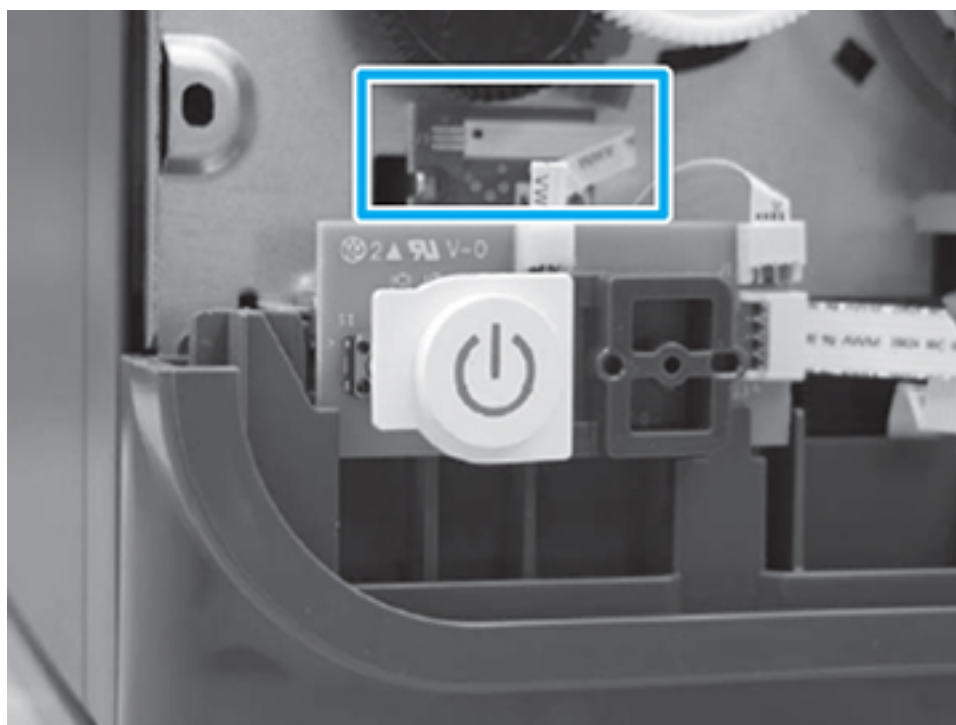


Table 6-2 Part numbers

HP Part Number	Description
G1W39-69001	Multi-function print mechanism kit
G1W46-69001	Mech-KIT-V1-PWE-556SFP-WW

17 . 31 . 69 Supply Ink Collection full

The ink collection unit is full. This is the second warning that the ICU life is almost depleted. The percentage of life remaining is 1% or less.

The printer's ink collection unit (ICU) collects unused ink for later disposal. The life tracking on this supply is accomplished via a numeric percent life remaining (PLR) that starts at 100% and decreases in 1% increments as pages are printed. The engine counts the number of ink droplet that go into the ICU and

reports this information to the formatter as a percentage of life remaining. The expected life of the ICU is nominally 120,000 pages but this will vary depending on printing patterns.

Recommended action

- Replace the ICU or continue printing until the replace ICU message appears.

For instructions: *Removal and replacement: Ink collection unit*

Part number: B5L04-67906

17 . 31 . 71 Reinstall Supply Ink Collection

The printer has prompted the user to remove and reinstall the ink collection unit (ICU) to maintain print quality.

Recommended action

- Remove and reinstall ICU. Make sure the ICU is aligned and installed correctly.

17 . 31 . 72 Supply Ink Collection reinstalled

The user removed and reinstalled the ink collection unit (ICU).

Recommended action

- No action necessary.

17 . 31 . 73 New Supply Ink Collection

The ink collection unit (ICU) counter has been reset.

Recommended action

- There is no sensor that indicates when the ICU has been replaced. For this reason the user will be asked near end of ICU life if the ICU has been replaced each time the left door closes or a power-on occurs. When **YES** is selected the reset will be performed.

17 . 31 . 80 Replace Supply Ink Collection

The ink collection unit (ICU) is full and must be replaced.

Recommended action

- Replace the ICU.

For instructions: *Removal and replacement: Ink collection unit*

Part number: B5L04-67906

17 . 99 . 31 Non-HP supply in use

A non-HP supply is in use.

This message does not distinguish between supplies.

Recommended action

- No action necessary.

17 . 99 . 32 Previously used HP Supply installed

An original HP supply that started its life in another printer is in use.

This message does not distinguish between supplies.

Recommended action

- No action necessary.

17 . 99 . 40 Supplies installed

At least one non-HP supply has been replaced with a genuine HP supply.

This message does not distinguish between supplies.

Recommended action

- No action necessary.

17 . 99 . 49 Startup Cartridge Override

User has overridden using startup cartridges.

This message does not distinguish between supplies.

Recommended action

- No action necessary.

17 . 99 . 58 HP Cartridge Protection enabled

A user enabled the HP Cartridge Protection Feature, protecting their cartridges and restricting the cartridges to only be usable in the printer that originally protected them.

Recommended action

- No action necessary.

20.XX.YZ, 21.XX.YZ error messages

20.* errors

Errors in the 20.* family are related to the printer memory. The page might require more memory than the printer has available.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Touch the **OK** button to continue.
2. Reduce the page complexity.
3. Add product memory.

21.* errors

Errors in the 21.* family are related to the printer memory and complexity of the image being printed. The page might require more memory than the printer has available.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Touch the **OK** button to clear the error.
2. Reduce the page complexity.
3. Add product memory.

20 . 00 . 00 Insufficient memory: <Device>

The product does not have enough memory to print the page.

Event log error message 20.00.00.

The product received more data than can fit in the available memory. You might have tried to transfer too many macros, soft fonts, or complex graphics.

Recommended action

1. Touch the **OK** button to print the transferred data. Some data might be lost.
2. Reduce the page complexity or add product memory.

21 . 00 . 00 Page Too Complex

The product displays this message to indicate that the page decompression process was too slow for the product.

Event log error message 21.00.00.

Recommended action

- Touch the **OK** button to continue. There may be some data loss on the page that was being formatted when the error occurred.

21 . 1C . 2D Page complex error

The product displays this message to indicate that the page decompression process was too slow for the product.

Event log error message 21.1C.2D.

Recommended action

- Touch the **OK** button to continue. There may be some data loss on the page that was being formatted when the error occurred.

30.XX.YZ error messages – X586 only

30.* errors

Errors in the 30.* family are related to the flatbed scanner.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Calibrate the scanner. Open these menus: [Device Maintenance > Calibrate-Cleaning > Calibrate Scanner](#).
2. Clean the scanner glass and glass strips.
3. Perform the tests for scanner diagnostics. Open these menus: [Administration > Troubleshooting > Diagnostic Tests > Scanner Tests](#).
4. Upgrade the firmware.
Go to [HP FutureSmart - Latest Firmware Versions](#).
5. Check all connections on the scanner control board and from the scanner control board to the formatter and the DC controller or the engine control board. If all connections are good, replace the scanner control board.
6. Replace the formatter.
7. If the error persists, replace the scanner assembly.

30.01.01

The flatbed cover sensor was interrupted.

The scanner flatbed cover is open.

This message appears only in the event log and is not posted on the control panel.

The control panel will read **Flatbed Cover Open**.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

No action necessary. This error message should automatically clear.

If the error persists, open the [Scanner Tests](#) to test the flatbed cover sensor.

1. If the cover is closed, check the cover sensor at the right rear of the scanner for correct mechanical functionality, using the scanner sensor test in the [Administration / Troubleshooting / Diagnostics / Scanner Tests](#) Menu.
2. Check the connectors on the scanner control board (SCB) for loose connections.
3. Replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: G1W39-67935

4. Replace the integrated scanning assembly (ISA).

For instructions: See the Repair Service Manual for this product.

Part number: G1W39-67943

30 . 01 . 02 Scanner calibration failure

The scanner calibration failed.

Recommended action

1. Turn the product off, and then on again.
2. After the product warms up, repeat the calibration process.
Device Maintenance / Calibrate-Cleaning / Calibrate Scanner
3. If the error persists, clean the scanner glass and calibration strips.




NOTE: Dust might appear on the underside of the glass, but this cannot be cleaned.

- a. Press the power button to turn the product off, and then disconnect the power cable from the electrical outlet.

- b. Open the scanner lid.

Figure 6-31 Open the scanner lid

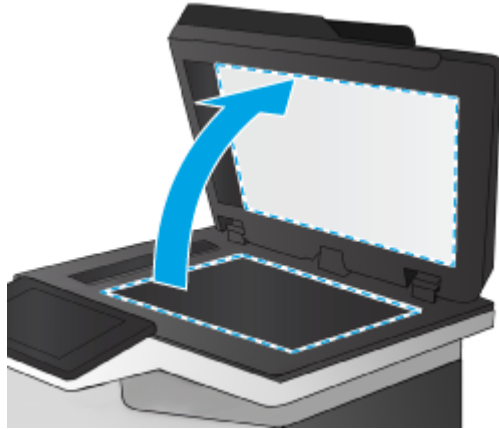

- c. Use a soft, lint-free cloth moistened with water to clean the calibration white strips and reflector plate (see call-outs). Also clean the document feeder glass, flatbed glass and plastic lid backing.

Figure 6-32 Calibration/reflector strips and glass



NOTE: If needed, lens cleaner or nonabrasive glass cleaner can be applied to the cloth before cleaning the glass. Spray only onto the cloth and not directly onto the glass or device. Do not spray water or glass cleaner on the glass as it can seep under it and possibly damage the printer. Do not use abrasives, acetone, benzene, ethyl alcohol, or carbon tetrachloride on the glass; these can damage it and/or leave residue on the glass resulting in degraded copy/scan quality.

- 4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the product off, and then on again.
2. After the product warms up, repeat the calibration process.

Device Maintenance / Calibrate-Cleaning / Calibrate Scanner

3. If the error persists, clean the scanner glass and calibration strips.



NOTE: Dust might appear on the underside of the glass, but this cannot be cleaned.

- a. Press the power button to turn the product off, and then disconnect the power cable from the electrical outlet.
- b. Open the scanner lid.

Figure 6-33 Open the scanner lid



- c. Use a soft, lint-free cloth moistened with water to clean the calibration white strips and reflector plate (see call-outs). Also clean the document feeder glass, flatbed glass and plastic lid backing.

Figure 6-34 Calibration/reflector strips and glass



NOTE: If needed, lens cleaner or nonabrasive glass cleaner can be applied to the cloth before cleaning the glass. Spray only onto the cloth and not directly onto the glass or device. Do not spray water or glass cleaner on the glass as it can seep under it and possibly damage the printer. Do not use abrasives, acetone, benzene, ethyl alcohol, or carbon tetrachloride on the glass; these can damage it and/or leave residue on the glass resulting in degraded copy/scan quality.

4. If the error persists, replace the Integrated Scanning Assembly (ISA).

For instructions: See the Repair Service Manual for this product.

30 . 01 . 08 Home position error

The scanner optics assembly failed to return to the home position.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Before continuing please see if the error matches the issues listed in the emerging issue document c05785967. [HP PageWide Enterprise Color 556 /586 MFP series - Wavy lines or images in middle page of a scan when scanning from the flatbed, 30.01.08, 30.03.30 \(Emerging Issue\)](#)
2. Turn the product off, and then on again.
3. Observe the movement of the optics assembly.
4. If the error persists, run the scanner motor test under component test. **Administration/Troubleshooting/Scanner tests/Flatbed motor test**
5. If issue still remains and firmware has been upgraded replace scanner control board (SCB).



IMPORTANT: Check all cables on the SCB for proper connection and seating before replacing any parts, and then test again.

6. If the error persists, replace the integrated scanning assembly (ISA).

For instructions: See the Repair Service Manual for this product.

Part number: G1W39-67943

30 . 01 . 14 Scan system EEPROM error

Scanner control board (SCB) EEPROM error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the product off, and then on again.
2. Ensure all connectors on the SCB are connected and properly seated.
3. Ensure the MFP has the latest SCB firmware version.

4. Replace the SCB.

For instructions: See the Repair Service Manual for this product.

Part number: G1W39-67935

30.01.15 Scanner error

The scanner did not initialize (internal error).

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the product off, and then on again.
2. Verify that all covers are installed correctly and that the ADF and ADF jam cover are closed.
3. Check all sensors on the scanner to ensure they are not blocked.
4. Look through the vents on back of scanner check to see if the green SCB LEDs are lit.
5. Check all connections between the SCB and the print engine, and make sure they are properly seated.
6. Replace the SCB.

For instructions: See the Repair Service Manual for this product.

Part number: G1W39-67935

30.01.18 Scanner Error

Scanner internal optical sensor error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

1. Turn the product off, and then on again.
2. Make sure that all the connectors on the SCB are properly seated.
3. Make sure that the MFP has the latest SCB firmware version.

4. Replace the SCB.

For instructions: See the Repair Service Manual for this product.

Part number: G1W39-67935

5. If the error persists, replace the integrated scanning assembly (ISA).

For instructions: See the Repair Service Manual for this product.

Part number: G1W39-67943

30 . 01 . 19 Scanner lamp error

Scanner internal lamp sensor error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the product off, and then on again.
2. Determine if the scanner lamp turns on and off approximately 12 seconds after the product turns on.
3. Test the lower lamp using the scanner test located in the Diagnostics menu.
4. Re-seat the interconnect cables between the optical carriage and the SCB.
5. Replace the integrated scanning assembly (ISA).

For instructions: See the Repair Service Manual for this product.

Part number: G1W39-67943

30 . 01 . 30 or 30 . 01 . 32

HP image ASIC error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the product off, and then on again.
2. Check all connections on the SCB.

3. Replace the SCB.

For instructions: See the Repair Service Manual for this product.

Part number: G1W39-67935

30.01.36 Upgrade Error Try downloading upgrade again

Scanner firmware upgrade error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Re-send the scanner firmware upgrade.
2. If the error persists, replace the SCB.

For instructions: See the Repair Service Manual for this product.

Part number: G1W39-67935

30.01.41, 30.01.44, 30.01.45 Scanner error

Scanner control board (SCB) communication error.

The formatter lost connections with the SCB or communication was corrupted.

Recommended action for customers

- See this support document: [– HP LaserJet Enterprise Printers - 30.01.XX Error - c04583162](#)

Recommended action for call center agents

1. Have the customer turn the printer off, and then on to see if the error persists.
2. If the error persists, turn the printer off and remove and then re-seat the formatter, and then turn the printer on.
3. If the issue persists, upgrade the firmware.
[– HP LaserJet Enterprise - Update firmware using a USB flash drive or the Embedded Web Server \(EWS\)](#)
4. Verify that all cables are connected to the product and to the interconnect board / formatter and the scanner control board (SCB).
5. Verify that the scanner control board (SCB) has power.
6. Replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: G1W39-67935

7. Replace the formatter.

For instructions: See the Repair Service Manual for this product.

Table 6-3 Part numbers

Part description	Part number
Formatter PCA (556)	G1W46-67911
Formatter PCA (586)	G1W39-67914
Formatter PCA - China only (556)	G1W46-67912
Formatter PCA - China only (586)	G1W39-67939

Recommended action for service technicians

1. Turn the printer off, and then on to see if the error persists.
2. If the error persists, turn the printer off and remove and then re-seat the formatter, and then turn the printer on.
3. If the issue persists, upgrade the firmware.

[HP LaserJet Enterprise - Update firmware using a USB flash drive or the Embedded Web Server \(EWS\)](#)

4. Verify that all cables are connected to the product and to the interconnect board / formatter and the scanner control board (SCB).
5. Verify that the scanner control board (SCB) has power.
6. Replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: G1W39-67935

7. Replace the formatter.

For instructions: See the Repair Service Manual for this product.

Table 6-4 Part numbers

Part description	Part number
Formatter PCA (556)	G1W46-67911
Formatter PCA (586)	G1W39-67914
Formatter PCA - China only (556)	G1W46-67912
Formatter PCA - China only (586)	G1W39-67939

30.01.42 Scanner error

Internal product communication error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the product off, and then on again.
2. If the error persists, turn the product off, and then check that all scanner control board (SCB) connectors are fully seated.
3. If this error occurs after a formatter, fax card or hard disk has been replaced, check that the formatter connectivity LED (smile face icon on the formatter) is illuminated. Check the fax card for proper seating on the formatter. If the fax card is not properly seated it can prevent the formatter from seating properly in the product.
4. Verify that all cables are connected to the product and to the interconnect board / formatter and SCB.
5. If the error persists, replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: G1W39-67935

30 . 01 . 43 Scanner memory failure

Scan memory error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the product off, and then on again.
2. If the error persists, turn the product off, and then re-seat the formatter.
3. If the error persists, replace the formatter.

For instructions: See the Repair Service Manual for this product.

Table 6-5 Part numbers

Part description	Part number
Formatter PCA (556)	G1W46-67911
Formatter PCA (586)	G1W39-67914
Formatter PCA - China only (556)	G1W46-67912
Formatter PCA - China only (586)	G1W39-67939

30 . 01 . 46 Scanner Error

The firmware cannot find the copy processor board (CPB).

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the product off, and then on again.
2. If the error persists, turn the product off, and then re-seat the formatter.
3. If the error persists, replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: G1W39-67935

30 . 01 . 48 Scanner error

A scanner error has occurred.

Scanner error.

Scanner power is not connected.

Recommended action for customers

- See this support document: [– HP LaserJet Enterprise Printers - 30.01.XX Error - c04583162](#)

Recommended action for call agents and service technicians

1. Turn the product off, and then on again.
2. If the error persists, use another known good power cord, make sure printer is connected to a known good dedicated power outlet and not to UPS or surge protector.
3. If the error persists, turn the product off, and then check the scanner wire-harness connectors and the scanner power supply fan.
4. If the error persists, replace integrated scanning assembly (ISA).

For instructions: See the Repair Service Manual for this product.

Part number: G1W39-67943

 **IMPORTANT:** On-site technicians need to check the scanner wire-harness, all SCB connectors, and the scanner power before replacing any parts.

30 . 01 . 50 Scanner error

Internal scanner control board (SCB) error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the product off, and then on again.
2. Upgrade the firmware.
3. If the error persists, replace the SCB.

For instructions: See the Repair Service Manual for this product.

Part number: G1W39-67935

30.03.14

A non-fatal error has occurred.

A scanner EEPROM (NVM) error has occurred.

Recommended action

- No action necessary.

30.03.yz

A PCA, scan, or flatbed error has occurred.

30.03.20: The copy processor board firmware cannot communicate with the PCA on the optical assembly.

30.03.22: Front side illumination calibration failure. The scan module cannot see the illumination module, or marginal illumination. The optical assembly may not be parked under the calibration strip.

30.03.23: Flatbed alignment calibration error.

30.03.30: Flatbed motor shutdown. The scanner control board (SCB) cannot communicate with the flatbed scanner motor.

Recommended action for customers

- See these support documents:
 - [HP LaserJet Enterprise and OfficeJet Enterprise MFP Printers - 30.03.23 Error](#)
 - [HP LaserJet Enterprise MFP Series - 30.03.45 Error](#)

Recommended action for call agents and service technicians

1. Before continuing please see if the error matches the issues listed in the emerging issue document c05785967. [HP PageWide Enterprise Color 556 /586 MFP series - Wavy lines or images in middle page of a scan when scanning from the flatbed, 30.01.08, 30.03.30 \(Emerging Issue\)](#)

2. Turn the product off, and then on again. As the product turns on, verify that the scan head moves.
3. Check the service event log for other scanner errors, and then resolve those errors.
4. Upgrade the firmware.
5. Verify that the drive belt is in the correct position.
6. Run diagnostics on the flatbed scanner to see if the scan bar moves.
7. Replace the integrated scanning assembly (ISA).

For instructions: See the Repair Service Manual for this product.

Part number: G1W39-67943

 **IMPORTANT:** On-site technicians need to check the scanner wire-harness, all SCB connectors, and the scanner power before replacing any parts.

30.03.45

Scanner control board firmware assertion failure.

Scanner control board (SCB) firmware assertion failure. SCB firmware assert controls the scan head motor.

Recommended action for customers

1. See these support documents:
 - [HP LaserJet Enterprise and OfficeJet Enterprise MFP Printers - 30.03.23 Error](#)
 - [HP LaserJet Enterprise MFP Series - 30.03.45 Error](#)
2. Turn the printer off and disconnect the power cord. Wait for at least 30 seconds before turning the printer on.
3. Upgrade the firmware to the latest version available

Recommended action for call agents and service technicians

For a public document, go to:

– [HP LaserJet Enterprise and OfficeJet Enterprise MFP Printers - 30.03.23 Error](#)

– [HP LaserJet Enterprise MFP Series - 30.03.45 Error](#)

1. Turn the printer off and disconnect the power cord. Wait for at least 30 seconds before turning the printer on.
2. Upgrade the firmware to the latest version available.
3. Before continuing please see if the error matches the issues listed in the emerging issue document c05785967. [HP PageWide Enterprise Color 556 /586 MFP series - Wavy lines or images in middle page of a scan when scanning from the flatbed, 30.01.08, 30.03.30 \(Emerging Issue\)](#)
4. Turn the product off, and then on again. As the product turns on, verify that the scan head moves.
5. Check the service event log for other scanner errors, and then resolve those errors.
6. Run diagnostics on the flatbed scanner to see if the scan bar moves.

7. If it's not solved dispatch the following part:

Scanner sub assembly - Includes white backing and retention clips part number: G1W39-67943



IMPORTANT: On-site technicians need to check the scanner wire-harness, all SCB connectors, and the scanner power before replacing any parts.

Recommended action for call agents and service technicians

1. Before continuing please see if the error matches the issues listed in the emerging issue document c05785967. [HP PageWide Enterprise Color 556 /586 MFP series - Wavy lines or images in middle page of a scan when scanning from the flatbed, 30.01.08, 30.03.30 \(Emerging Issue\)](#)
2. Turn the printer off and disconnect the power cord.
3. Verify that the drive belt in the scanner is in the correct position.
4. Turn the product off, and then on again. As the product turns on, verify that the scan head moves.
5. Run diagnostics on the flatbed scanner to see if the scan bar moves.

Troubleshooting menu > Diagnostic Tests > Continuous scan.

6. Check the scanner wire-harness, all SCB connectors, and the scanner power before replacing any parts.
7. Replace the scanner sub-assembly.

Part number: G1W39-67943

For instructions: See the Repair Service Manual for this product.

31.XX.YZ error messages – X586 only

31.* errors

Errors in the 31.* family are related to the document feeder.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Verify the document feeder top cover is completely closed when feeding pages through it.
2. Verify the document feeder input tray is not overloaded and that the guides are adjusted correctly.
3. Open the document feeder top cover and check the rollers. Clean or replace them if necessary.
4. Clean the scanner glass and all the calibration strips.
5. Calibrate the scanner. Open these menus: [Device Maintenance > Calibrate-Cleaning > Calibrate Scanner](#).
6. Clean the scanner glass and glass strips, and clean the white strips used for calibration.

7. Perform the tests for scanner diagnostics. Open these menus: [Administration > Troubleshooting > Diagnostic Tests > Scanner Tests](#). Look for tests related to the document feeder, such as the [Jam Cover Sensor](#) test.
8. Upgrade the firmware.
Go to [HP FutureSmart - Latest Firmware Versions](#).
9. Check all connections from the document feeder to the scanner control board, and reseal them if necessary.
10. If the error persists, replace the document feeder assembly.

31 . 01 . 47 Document feeder not detected

The document feeder was not detected.

The document feeder might not be connected. The flatbed glass is still available for scanning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians


1. Turn the product off and then on.
2. If the error persists, replace the document feeder.

For instructions: See the Repair Service Manual for this product.

 **NOTE:** Before replacing the document feeder, technicians should verify that the connections between the document feeder and the product are fully seated. Check one flat cable (callout 1), one ground screw (callout 2), and five connectors (callout 3).

Part number: G1W41-67908

Figure 6-35 Check connectors and ground screw

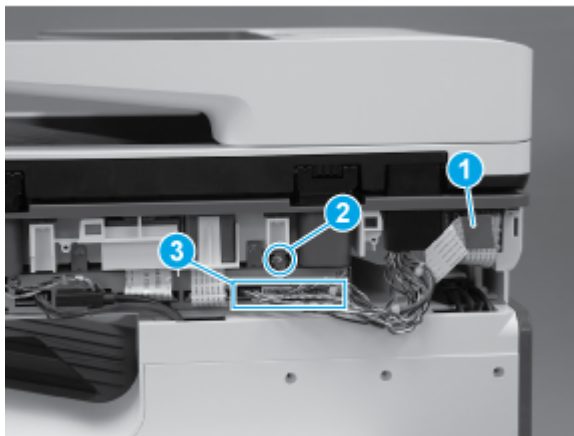

31.03.14

Backside scanner EEPROM (NVM) error.

A non-fatal error has occurred.

Recommended action

- No action necessary.

31.03.20 Backside scanner not detected

Backside scanner not detected.

Recommended action for customers

1. Turn the product off, and then on again.
2. Try to make a double side copy, if it fails again, power cycle to clear the error and try a single side copy; it should work, and you could use it until your unit is fixed.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

1. Instruct the customer to turn the printer off. Remove the power cord and waiting for 30 sec before plugging the printer in and then turn on again.
2. Make sure the customer can make single side copies and suggest that as a workaround if it works.
3. If it doesn't solve the issue, dispatch an onsite CE with the ADF assembly listed below, depending on the model.

Table 6-6 Part numbers

HP Part Number	Description
B5L47-67907	ADF whole unit replacement - Workflow series
B5L47-67906	ADF whole enterprise unit replacement - Non-workflow series

Recommended action for onsite technicians

1. Turn the product off, and then on again.
2. Verify the cables between scanner and scanner control board (SCB) are connected.
 - a. Turn the printer off and disconnect power cord.
 - b. Remove the back cover from to expose the SCB and all connections.
 - c. Remove and reseal all connections on the SCB paying special attention to the FFC cable coming from the ADF.
 - d. Turn the printer back on and try to do a duplex copy.

3. If the error is not resolved, replace the document feeder assembly

Table 6-7 Part numbers

HP Part Number	Description
B5L47-67907	ADF whole unit replacement - Workflow series
B5L47-67906	ADF whole enterprise unit replacement - Non-workflow series

For instructions: See the Repair Service Manual for this product.

31 . 03 . 22 Scanner calibration failure

Backside illumination calibration failure.

Recommended action for customers

1. Turn the product off, and then on again.
2. After the product warms up, repeat the calibration process.

Device Maintenance / Calibrate-Cleaning / Calibrate Scanner

3. If the error persists, clean the scanner glass and calibration strips.



NOTE: Dust might appear on the underside of the glass, but this cannot be cleaned.


- a. Press the power button to turn the product off, and then disconnect the power cable from the electrical outlet.
- b. Open the scanner lid.

Figure 6-36 Open the scanner lid



- c. Use a soft, lint-free cloth moistened with water to clean the calibration white strips and reflector plate (see call-outs). Also clean the document feeder glass, flatbed glass and plastic lid backing.

Figure 6-37 Calibration/reflector strips and glass

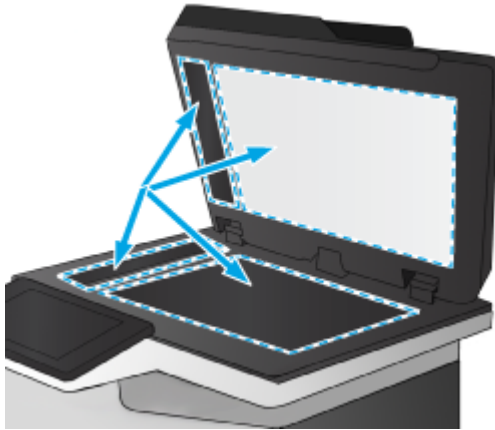

NOTE: If needed, lens cleaner or nonabrasive glass cleaner can be applied to the cloth before cleaning the glass. Spray only onto the cloth and not directly onto the glass or device. Do not spray water or glass cleaner on the glass as it can seep under it and possibly damage the printer. Do not use abrasives, acetone, benzene, ethyl alcohol, or carbon tetrachloride on the glass; these can damage it and/or leave residue on the glass resulting in degraded copy/scan quality.

- 4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

- 1. Turn the product off, and then on again.
- 2. After the product warms up, repeat the calibration process.

Device Maintenance / Calibrate-Cleaning / Calibrate Scanner

- 3. If the error persists, clean the scanner glass and calibration strips.




NOTE: Dust might appear on the underside of the glass, but this cannot be cleaned.

- a. Press the power button to turn the product off, and then disconnect the power cable from the electrical outlet.

- b. Open the scanner lid.

Figure 6-38 Open the scanner lid

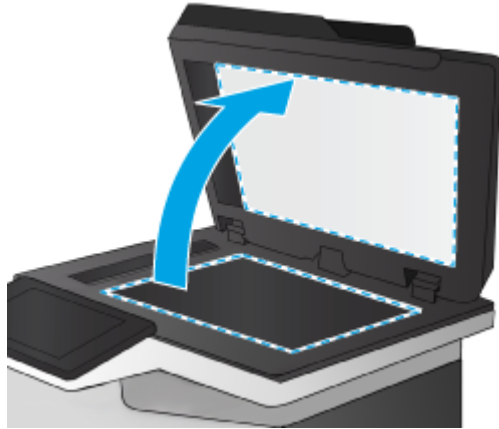

- c. Use a soft, lint-free cloth moistened with water to clean the calibration white strips and reflector plate (see call-outs). Also clean the document feeder glass, flatbed glass and plastic lid backing.

Figure 6-39 Calibration/reflector strips and glass



NOTE: If needed, lens cleaner or nonabrasive glass cleaner can be applied to the cloth before cleaning the glass. Spray only onto the cloth and not directly onto the glass or device. Do not spray water or glass cleaner on the glass as it can seep under it and possibly damage the printer. Do not use abrasives, acetone, benzene, ethyl alcohol, or carbon tetrachloride on the glass; these can damage it and/or leave residue on the glass resulting in degraded copy/scan quality.

- 4. If the error persists, replace the Integrated Scanning Assembly (ISA).

For instructions: See the Repair Service Manual for this product.

Part number: G1W39-67943

31.03.30, 31.03.31 or 31.03.32

Document feeder motor problem.

31.03.30: The document feeder pick motor is not turning.

31.03.31: The document feeder feed motor is not turning.

31.03.32: The document feeder de-skew motor is not turning.

Recommended action for customers

1. Verify that the paper meets the product specifications.
2. Make sure that the feed tray is not overloaded.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Verify that the paper meets the product specifications.
2. Make sure that the feed tray is not overloaded.
3. Check the event log for document feeder errors, and then resolve any errors first.
4. Open and close the top cover to see if the pick motor turns without posting this error. If the motor turns, then the motor is good.
5. Verify that the motor cables are connected.
6. Re-seat the document feeder to the scanner control board (SCB).
7. Replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number: G1W41-67908

31 . 03 . 33 Backside scanner calibration area dirty

The white area used for backside scanner calibration is dirty.

Recommended action for customers

1. Turn the product off, and then on again.
 2. After the product warms up, repeat the calibration process.
- Device Maintenance / Calibrate-Cleaning / Calibrate Scanner**
3. If the error persists, clean the scanner glass and calibration strips.




NOTE: Dust might appear on the underside of the glass, but this cannot be cleaned.

- a. Press the power button to turn the product off, and then disconnect the power cable from the electrical outlet.

- b. Open the scanner lid.

Figure 6-40 Open the scanner lid

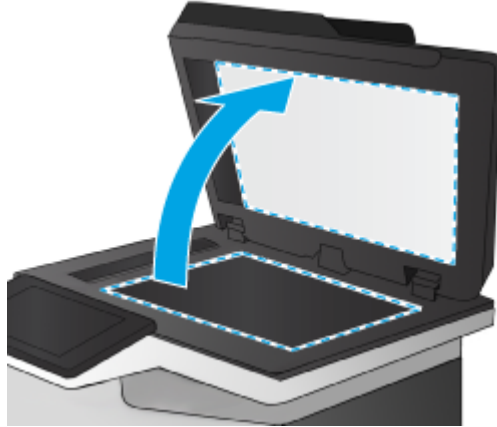

- c. Use a soft, lint-free cloth moistened with water to clean the calibration white strips and reflector plate (see call-outs). Also clean the document feeder glass, flatbed glass and plastic lid backing.

Figure 6-41 Calibration/reflector strips and glass



NOTE: If needed, lens cleaner or nonabrasive glass cleaner can be applied to the cloth before cleaning the glass. Spray only onto the cloth and not directly onto the glass or device. Do not spray water or glass cleaner on the glass as it can seep under it and possibly damage the printer. Do not use abrasives, acetone, benzene, ethyl alcohol, or carbon tetrachloride on the glass; these can damage it and/or leave residue on the glass resulting in degraded copy/scan quality.

- 4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians


- 1. Remove the white background and clean it.
- 2. If the error persists, clean the scanner glass and calibration strips.



NOTE: Dust might appear on the underside of the glass, but this cannot be cleaned.

- a. Press the power button to turn the product off, and then disconnect the power cable from the electrical outlet.
- b. Open the scanner lid.

Figure 6-42 Open the scanner lid

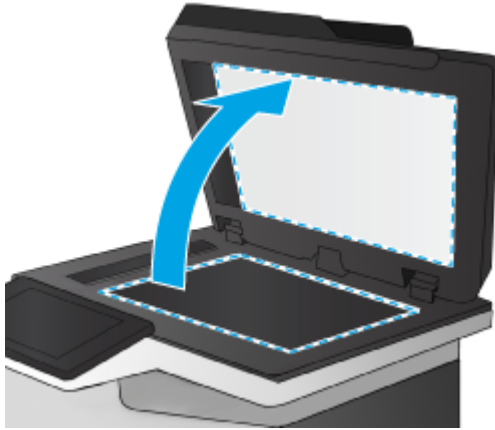

- c. Use a soft, lint-free cloth moistened with water to clean the calibration white strips and reflector plate (see call-outs). Also clean the document feeder glass, flatbed glass and plastic lid backing.

Figure 6-43 Calibration/reflector strips and glass



NOTE: If needed, lens cleaner or nonabrasive glass cleaner can be applied to the cloth before cleaning the glass. Spray only onto the cloth and not directly onto the glass or device. Do not spray water or glass cleaner on the glass as it can seep under it and possibly damage the printer. Do not use abrasives, acetone, benzene, ethyl alcohol, or carbon tetrachloride on the glass; these can damage it and/or leave residue on the glass resulting in degraded copy/scan quality.

3. Clean the backside scanner glass.
4. If issue remains replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number: G1W41-67908

31 . 03 . 34 Background missing

The removable background for the backside scanner is either missing or not fully snapped into place.

Recommended action for customers

1. Turn the product off, and then on again.
2. After the product warms up, repeat the calibration process.

Device Maintenance / Calibrate-Cleaning / Calibrate Scanner

3. If the error persists, clean the scanner glass and calibration strips.

 **NOTE:** Dust might appear on the underside of the glass, but this cannot be cleaned.

- a. Press the power button to turn the product off, and then disconnect the power cable from the electrical outlet.
- b. Open the scanner lid.

Figure 6-44 Open the scanner lid



- c. Use a soft, lint-free cloth moistened with water to clean the calibration white strips and reflector plate (see call-outs). Also clean the document feeder glass, flatbed glass and plastic lid backing.

Figure 6-45 Calibration/reflector strips and glass





NOTE: If needed, lens cleaner or nonabrasive glass cleaner can be applied to the cloth before cleaning the glass. Spray only onto the cloth and not directly onto the glass or device. Do not spray water or glass cleaner on the glass as it can seep under it and possibly damage the printer. Do not use abrasives, acetone, benzene, ethyl alcohol, or carbon tetrachloride on the glass; these can damage it and/or leave residue on the glass resulting in degraded copy/scan quality.

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Remove the white background and clean it.
2. Clean the backside scanner glass.
3. If issue remains replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number: G1W41-67908

31.13.00 Document feeder multi-pick error

A multiple pick error was reported by the document feeder assembly (ADF).

Issue might be described as the following:



- Picking multiple documents
- Picking more than one page
- Multiple sheets pulled from ADF
- Multiple pages picked

Recommended action for customer


Follow these troubleshooting steps in the order presented.


For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

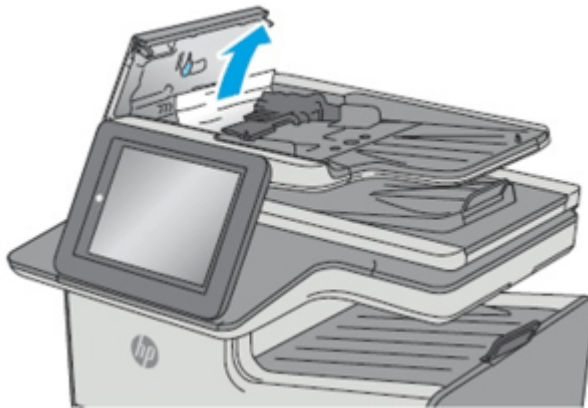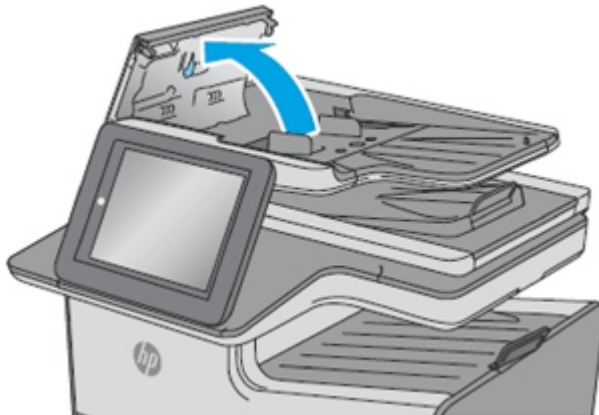

2. Lift the document-feeder input tray and remove any jammed paper.

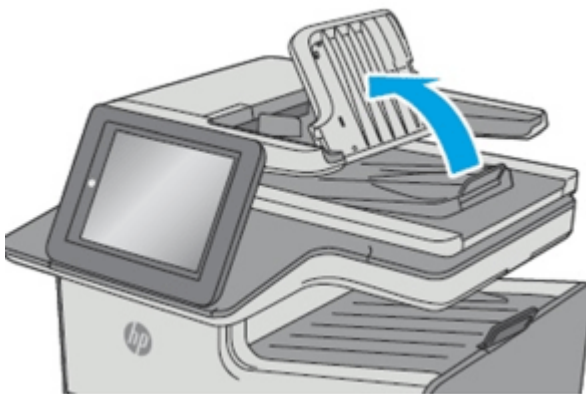

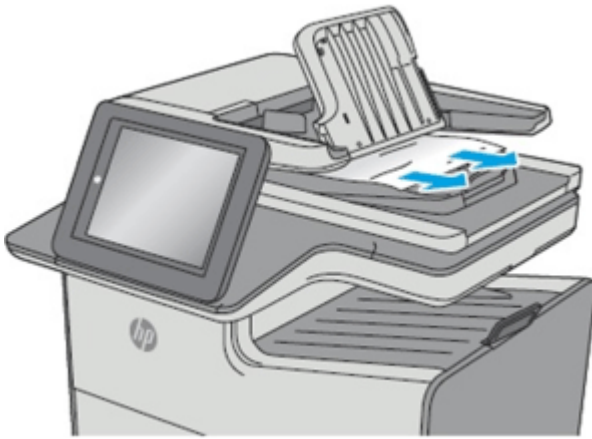

3. Lower the document-feeder input tray and then close the document feeder cover.



NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.


4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.

Figure 6-46 Set the ADF guides

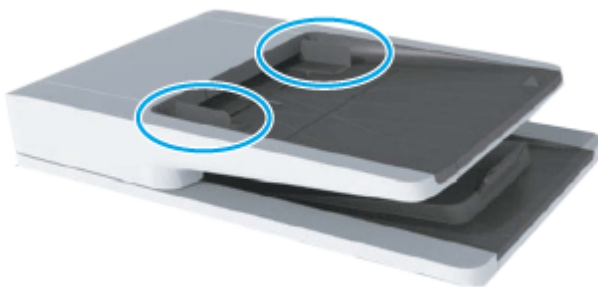


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.




NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

6. Check the Document Feeder Kit consumable status.


- a. Navigate to and select **Supplies** on the control panel.

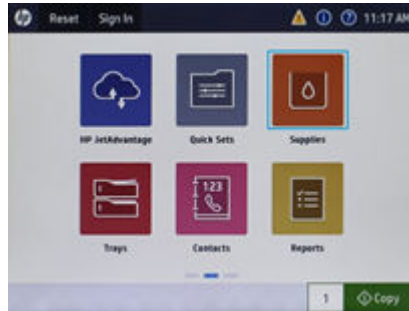

- b. Select **Document Feeder Kit**.

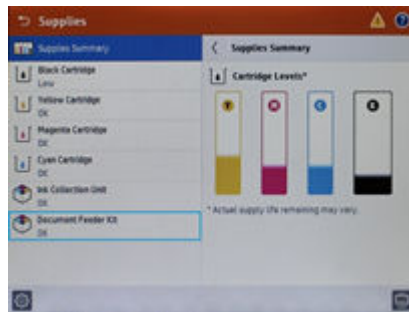

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

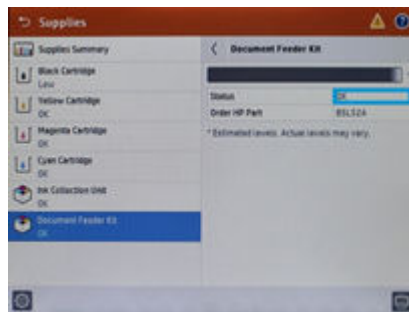


- d. Recommend that the customer replace the Document Feeder Kit if the status is **Low** or **Very Low**.

Part number: [W5U23A](https://store.hp.com/W5U23A)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm

water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

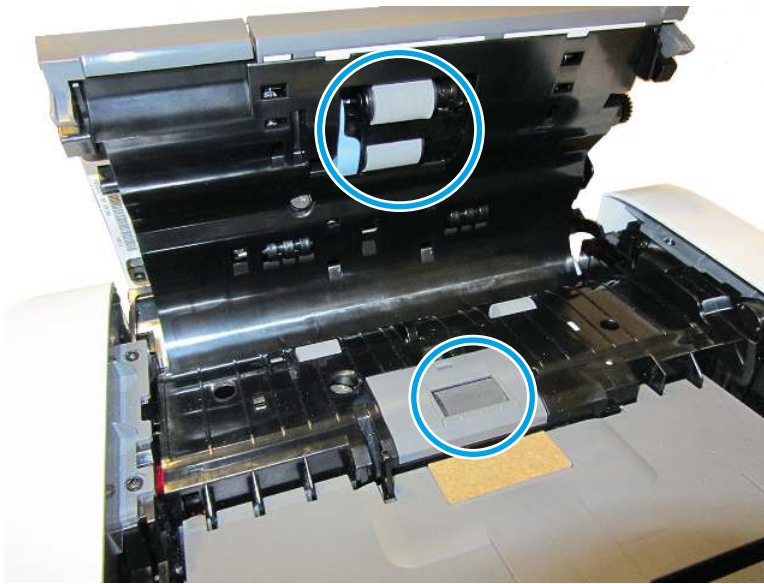

NOTE: Lift up the roller assembly to access and clean the second roller



8. If necessary, replace the Document Feeder Kit rollers and separation pad.
Part number: W5U23A/HP 200 ADF Roller Replacement Kit
To order parts, go to <https://store.hp.com>
9. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents


Follow these troubleshooting steps in the order presented.


For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

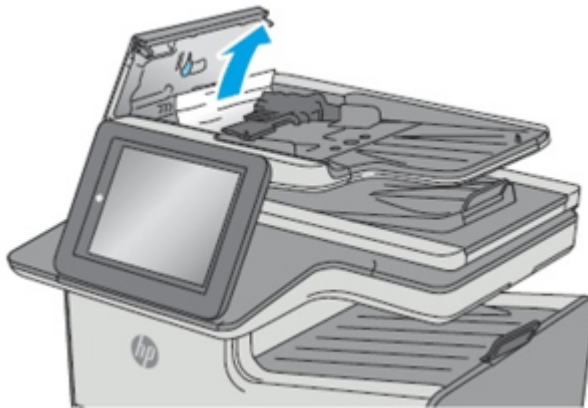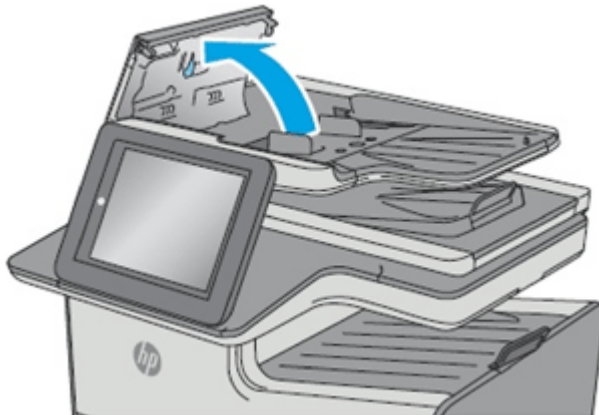

2. Lift the document-feeder input tray and remove any jammed paper.

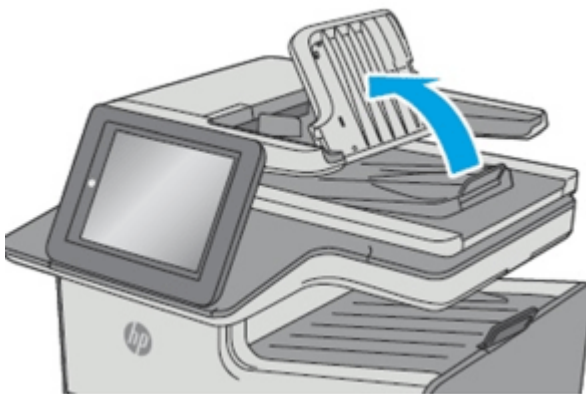

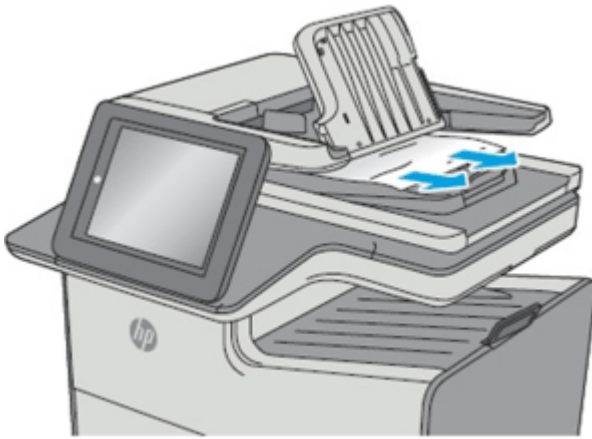

3. Lower the document-feeder input tray and then close the document feeder cover.



NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.


4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.

Figure 6-47 Set the ADF guides

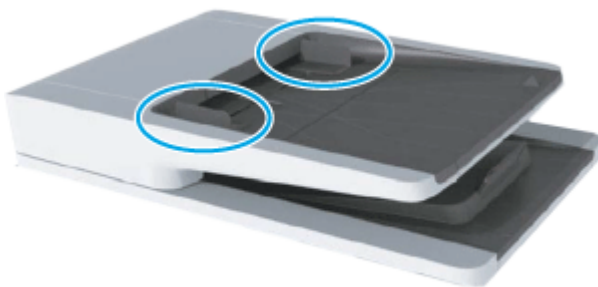


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.




NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

6. Check the Document Feeder Kit consumable status.


- a. Navigate to and select **Supplies** on the control panel.

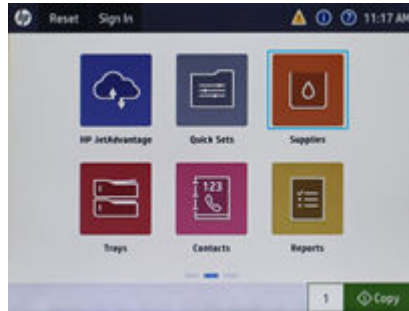

- b. Select **Document Feeder Kit**.

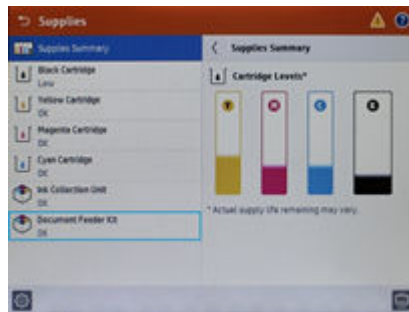

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

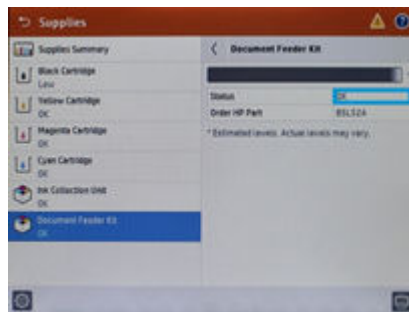

- d. If the status is **Low** or **Very Low**, recommend that the customer replace the Document Feeder Kit.


Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace the (ADF maintenance replacement roller kit) - W5U23-67901

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm

water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

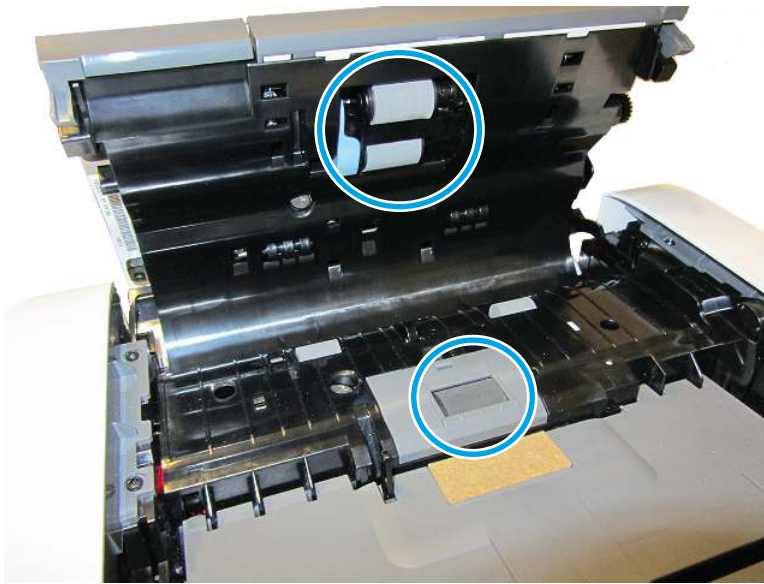

 **NOTE:** Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

ADF Roller Replacement Kit Part number: [W5U23-67901](#)

To order parts, go to <https://store.hp.com>

 **NOTE:** If a grinding noise is heard or reported in conjunction with the pick or feed of paper through the ADF, replace the document feeder (ADF) unit.

Document Feeder (ADF) whole unit part numbers for Non-Flow and Flow models:



- **NON-Flow models** part number: B5L47-67908
- **Flow models** part number: B5L47-67909

Recommended action for onsite technicians


Follow these troubleshooting steps in the order presented.


For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

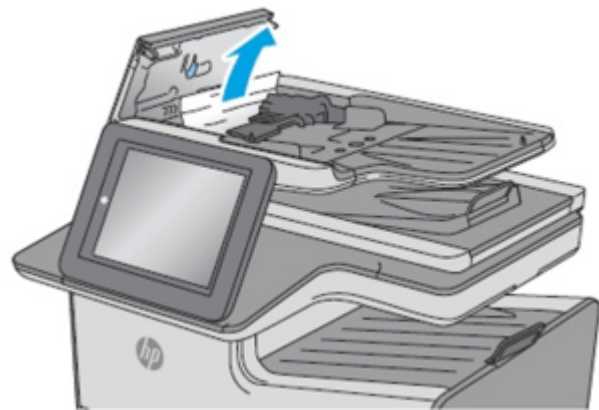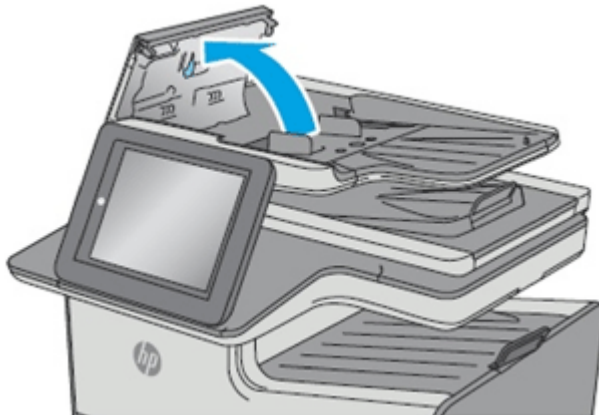

2. Lift the document-feeder input tray and remove any jammed paper.

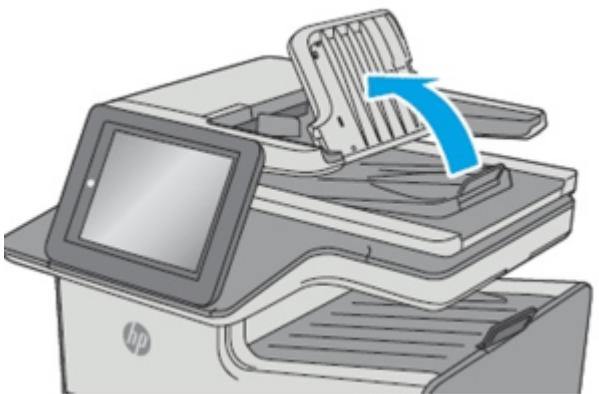

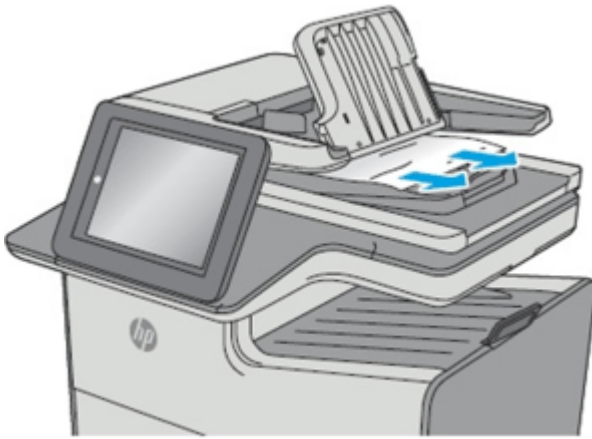

3. Lower the document-feeder input tray and then close the document feeder cover.



NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.


4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.

Figure 6-48 Set the ADF guides

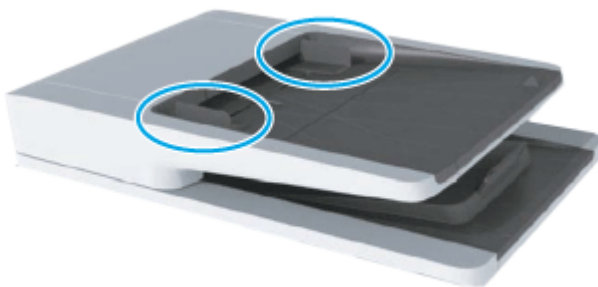


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.




NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

6. Check the Document Feeder Kit consumable status.


- a. Navigate to and select **Supplies** on the control panel.

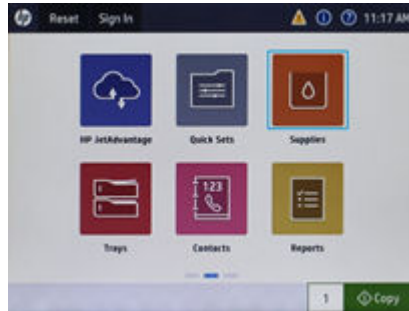

- b. Select **Document Feeder Kit**.

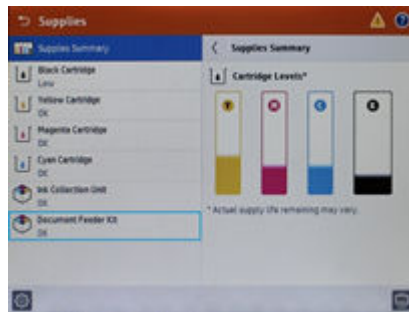

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

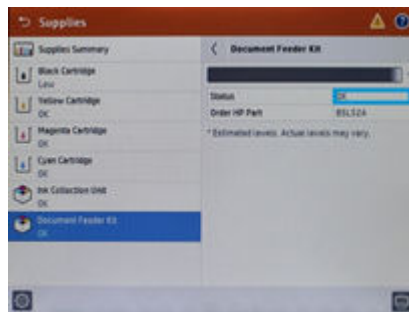

- d. If the status is **Low** or **Very Low**, recommend that the customer replace the Document Feeder Kit.


Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace the (ADF maintenance replacement roller kit) - W5U23-67901

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm

water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

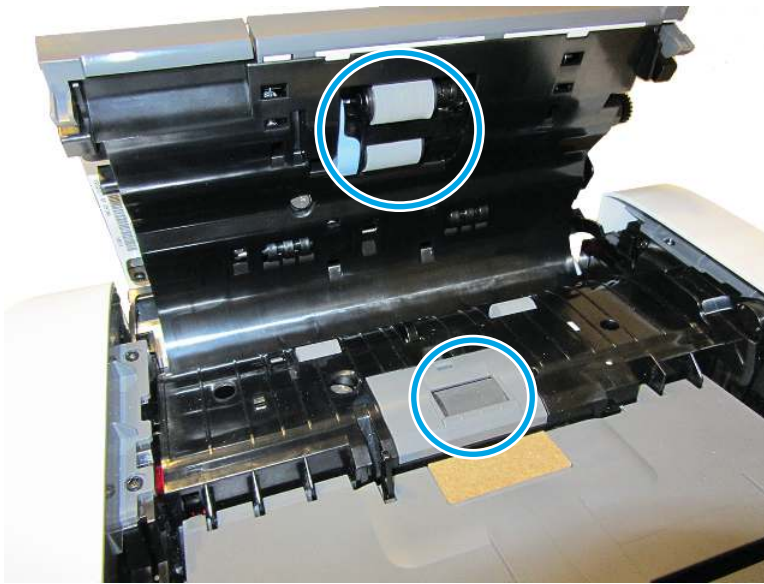

 **NOTE:** Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

ADF Roller Replacement Kit Part number: [W5U23-67901](#)

To order parts, go to <https://store.hp.com>


 **NOTE:** If a grinding noise is heard or reported in conjunction with the pick or feed of paper through the ADF, replace the document feeder (ADF) unit.

Document Feeder (ADF) whole unit part numbers for Non-Flow and Flow models:


- **NON-Flow models** part number: B5L47-67908
 - **Flow models** part number: B5L47-67909
9. If the ADF is physically picking up the media, and there is still a 31.13.01 error, the root cause can be a defective sensor. Follow the steps below to verify sensors functionality:

Depending on Printer Model, Inspect the following sensors:

- Standard MFP models: ADF paper path Deskew sensor, see callout.

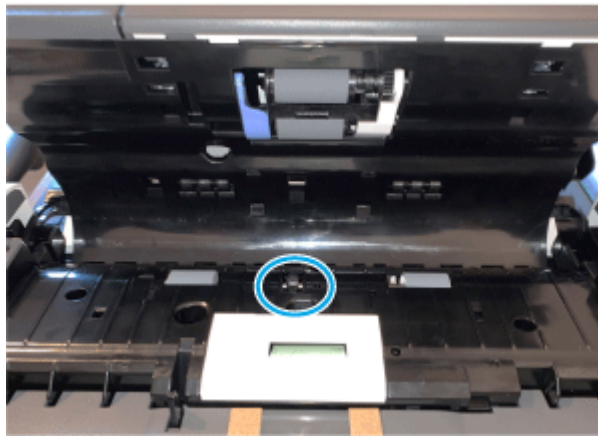


- FLOW MODELS ONLY: Pick Success Sensor, callouts 2 and 3)

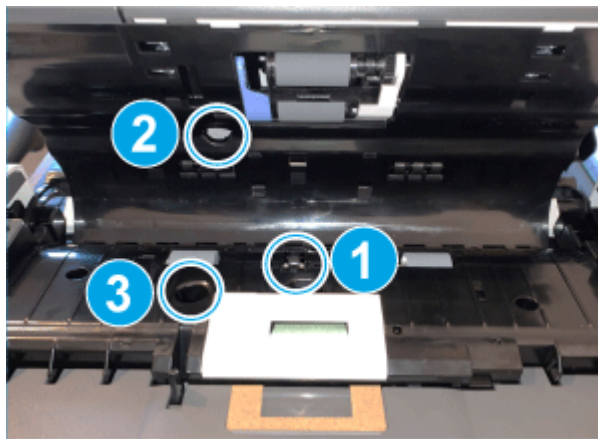


If there is any dust or fiber remnants, clean by using a can of compressed air to blow out and clean (receiver and emitter in FLOW MODELS).

10. Verify that the connections between the automatic document feeder and the SCB are correctly seated.

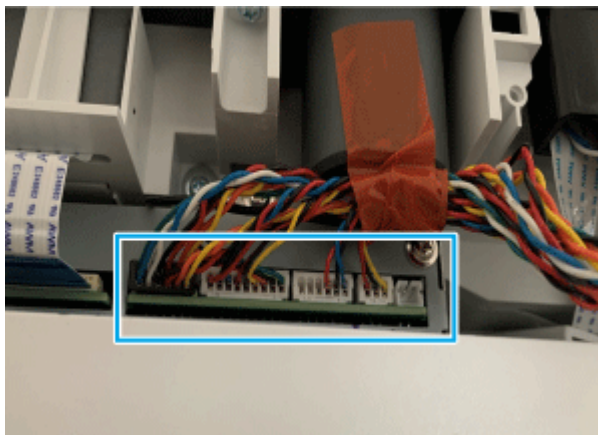


11. Using the Manual Scanner Sensor Test verify functionality of the ADF Paper Path Pick Success sensor.


- a. Navigate to and select **Support Tools**.

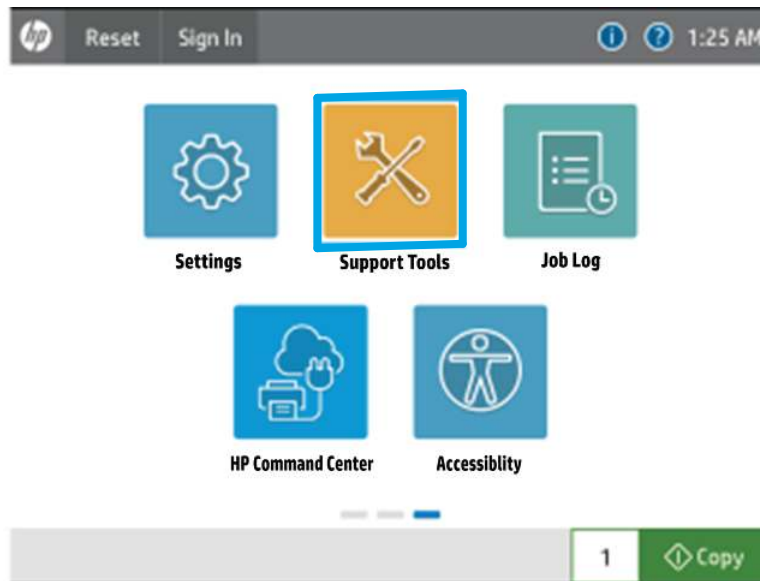


- b. Select **Troubleshooting**.

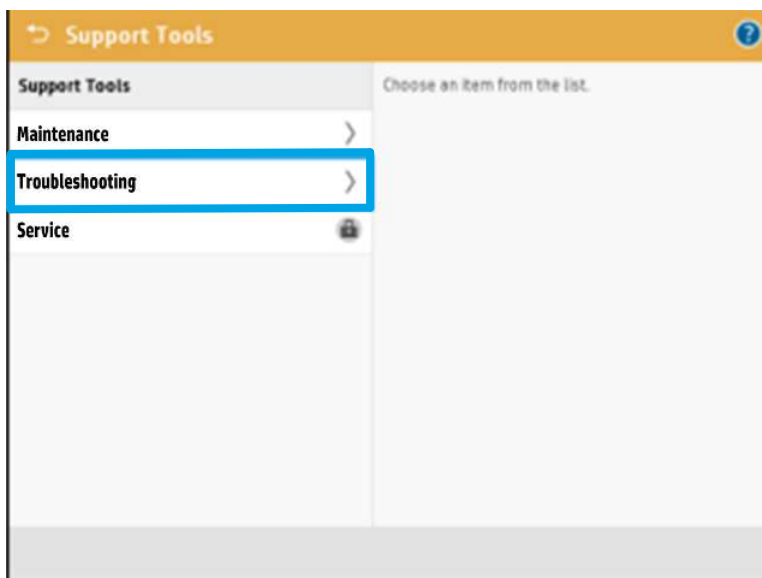


- c. Select **Diagnostic Tests**.

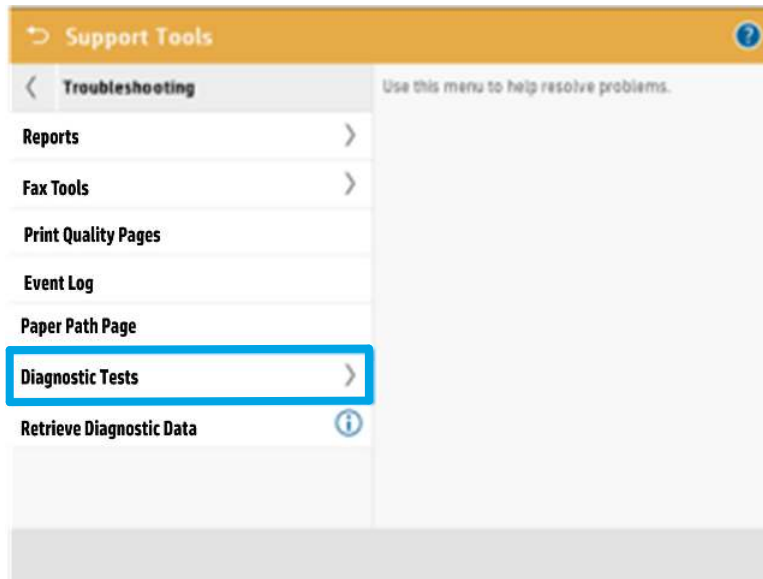

- d. Select **Continue**.

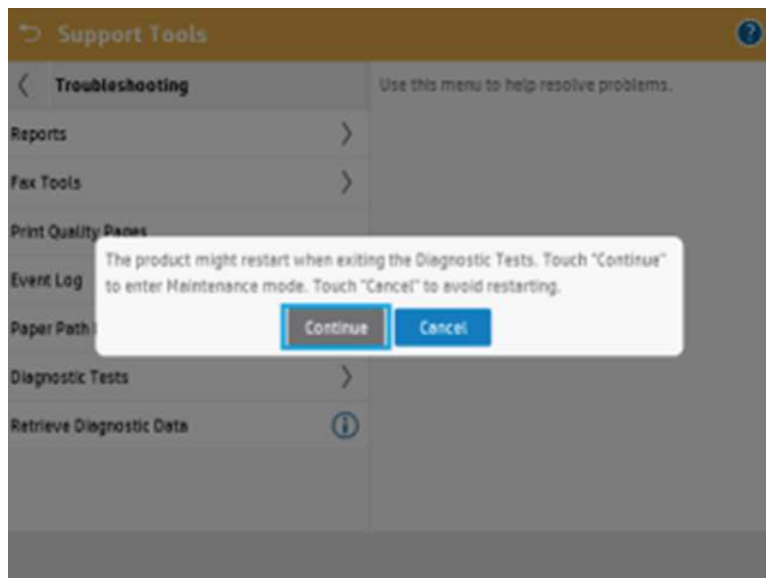

- e. Select **Manual Sensor Test**.

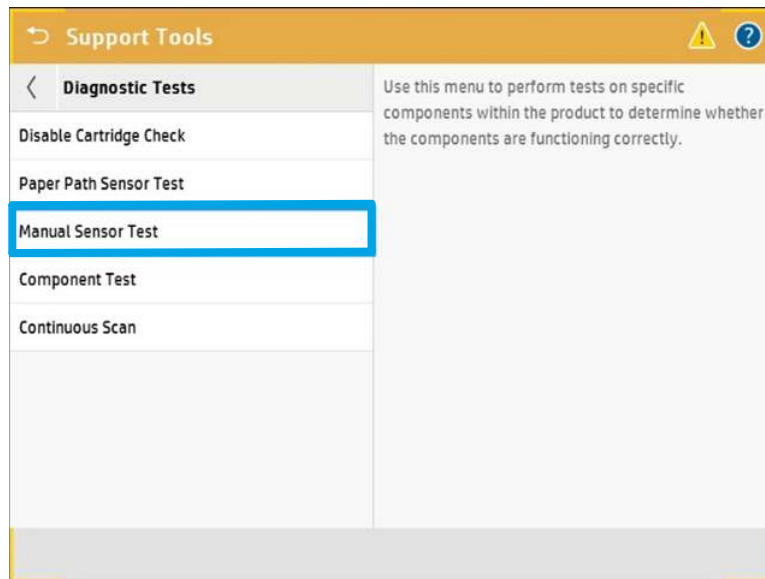

- f. Select **ADF Paper Path Deskew**.



- g. Select **ADF Paper Path Pick Success**.

(Only in FLOW-MODELS)



NOTE: Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advancing.



- h. Close the ADF cover and ensure that is secure and closed correctly.
- 12. If the ADF Deskew sensor test or ADF Paper Path Pick Success test fails, replace the document feeder.

NON-Flow models part number: B5L47-67908


Flow models part number: B5L47-67909

For instructions: See the Repair Service Manual for this product.

31.13.01

Document feeder job error pick error.

Paper pick was initiated, but the page did not make it to the ADF paper path deskew sensor (Callout 1)

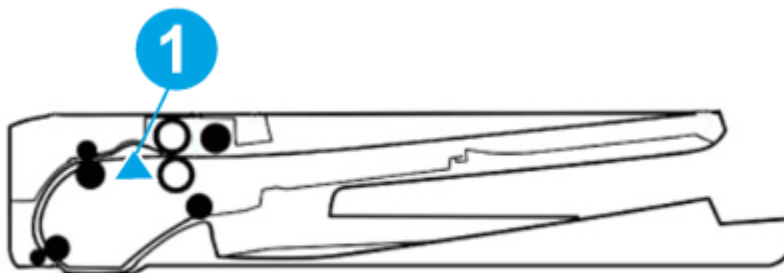

NOTE: The ADF paper path deskew sensor: Detects the top of the page before feeding a page through the ADF and the end of the page after feeding/scanning is complete.

ADF Pick error.



ADF Pick Jam

Recommended action for customer


Follow these troubleshooting steps in the order presented.


For further troubleshooting, please view this video: [Fixing 31.13.01/02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

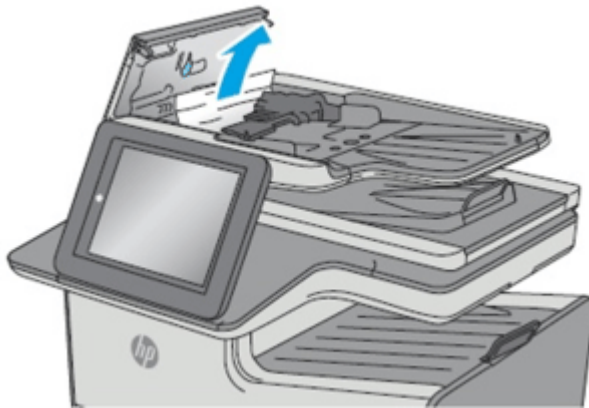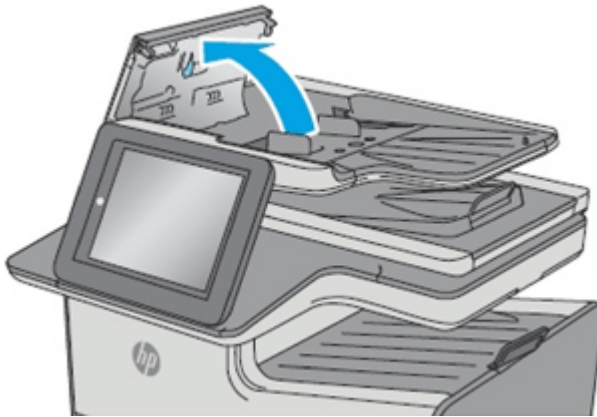

2. Lift the document-feeder input tray and remove any jammed paper.

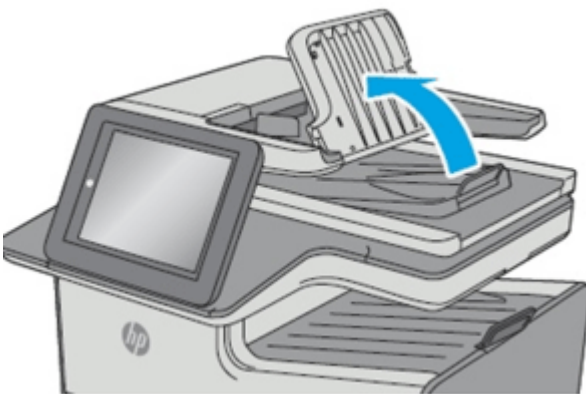

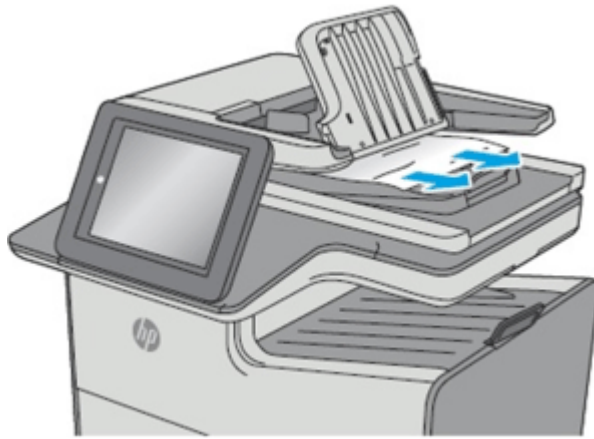

3. Lower the document-feeder input tray and then close the document feeder cover.



NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.


4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.

Figure 6-49 Set the ADF guides

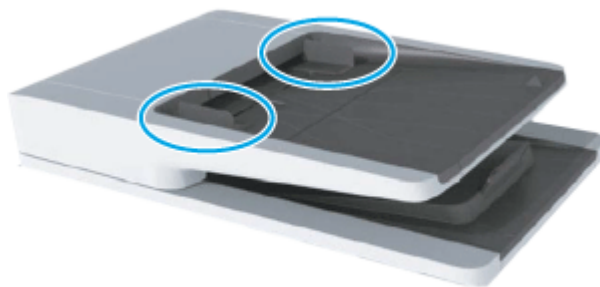


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.




NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

6. Check the Document Feeder Kit consumable status.


- a. Navigate to and select **Supplies** on the control panel.

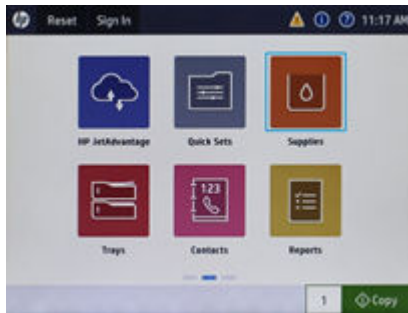

- b. Select **Document Feeder Kit**.

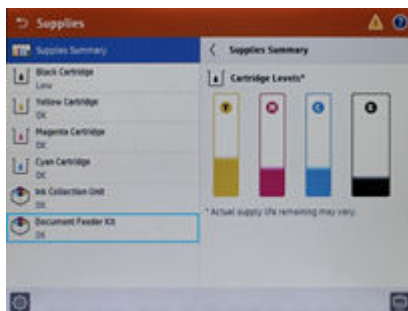

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

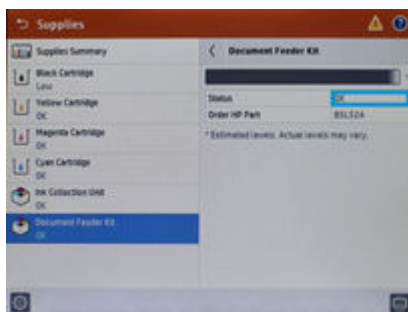


- d. Recommend that the customer replace the Document Feeder Kit if the status is **Low** or **Very Low**.

Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm

water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

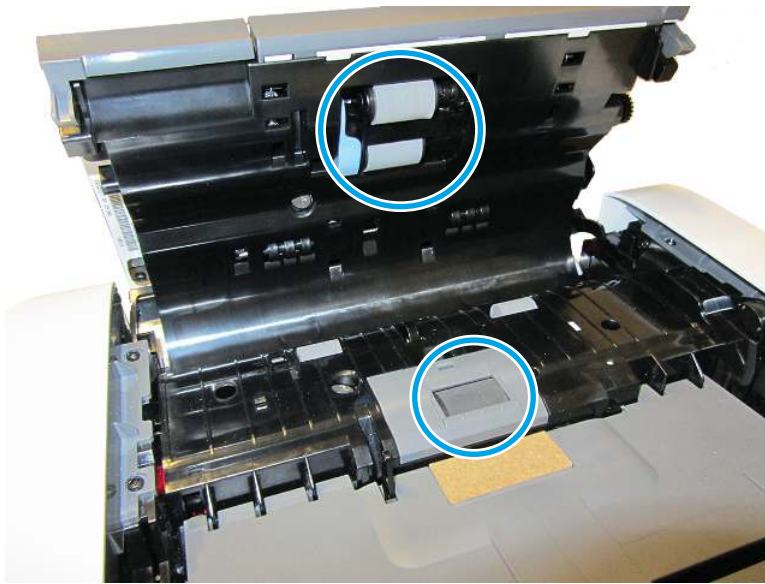

 **NOTE:** Lift up the roller assembly to access and clean the second roller



8. If necessary, replace the Document Feeder Kit rollers and separation pad.
Part number: W5U23A/HP 200 ADF Roller Replacement Kit
To order parts, go to <https://store.hp.com>
9. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents


Follow these troubleshooting steps in the order presented.


For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

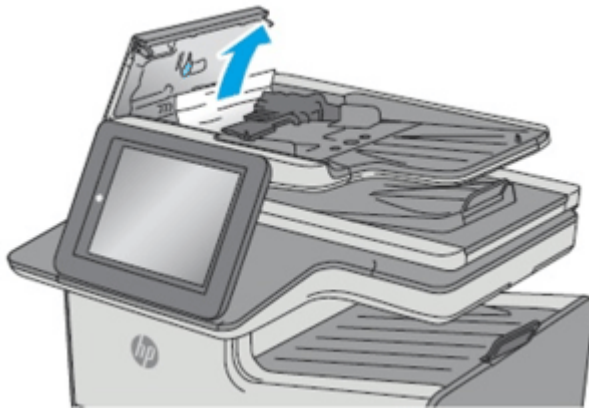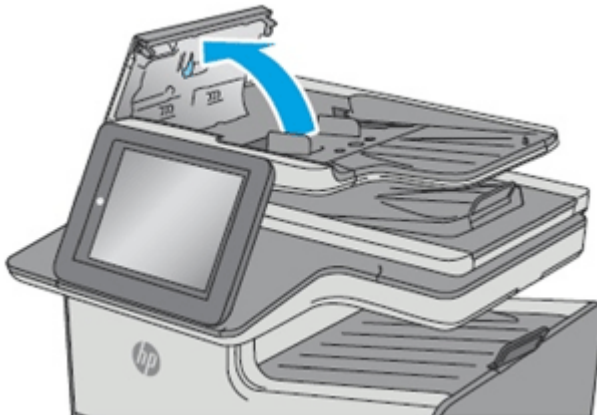

2. Lift the document-feeder input tray and remove any jammed paper.

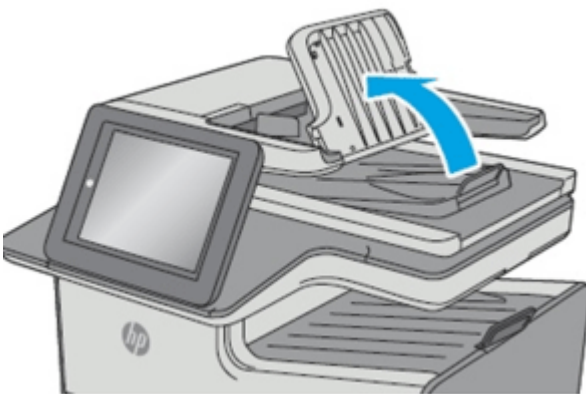

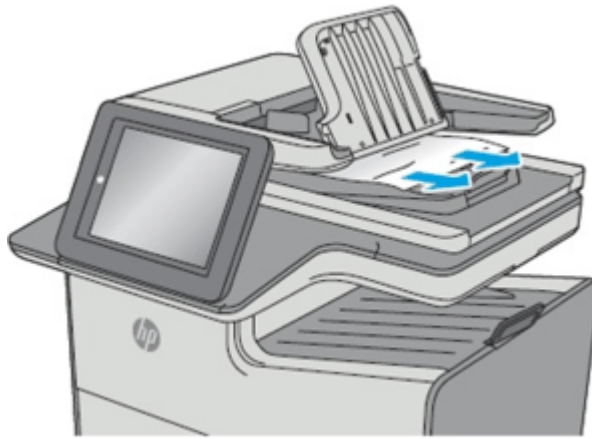

3. Lower the document-feeder input tray and then close the document feeder cover.



NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.


4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.

Figure 6-50 Set the ADF guides

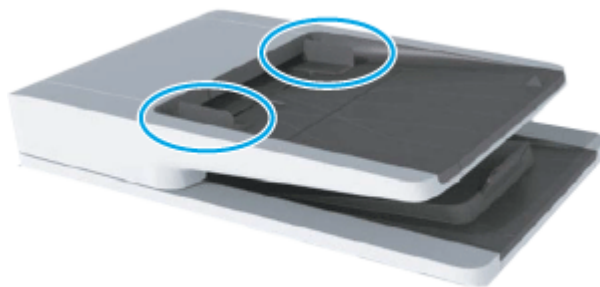


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.




NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

6. Check the Document Feeder Kit consumable status.


- a. Navigate to and select **Supplies** on the control panel.

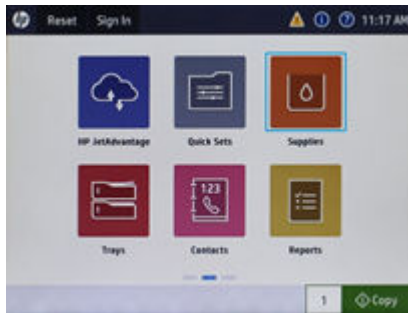

- b. Select **Document Feeder Kit**.

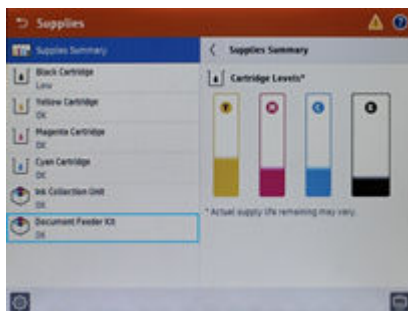

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

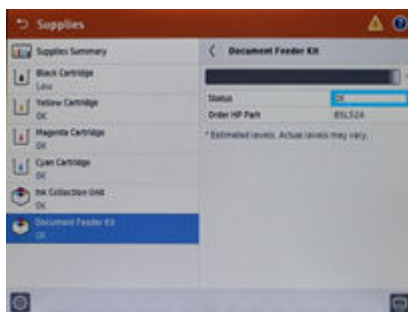

- d. If the status is **Low** or **Very Low**, recommend that the customer replace the Document Feeder Kit.


Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace the (ADF maintenance replacement roller kit) - W5U23-67901

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm

water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

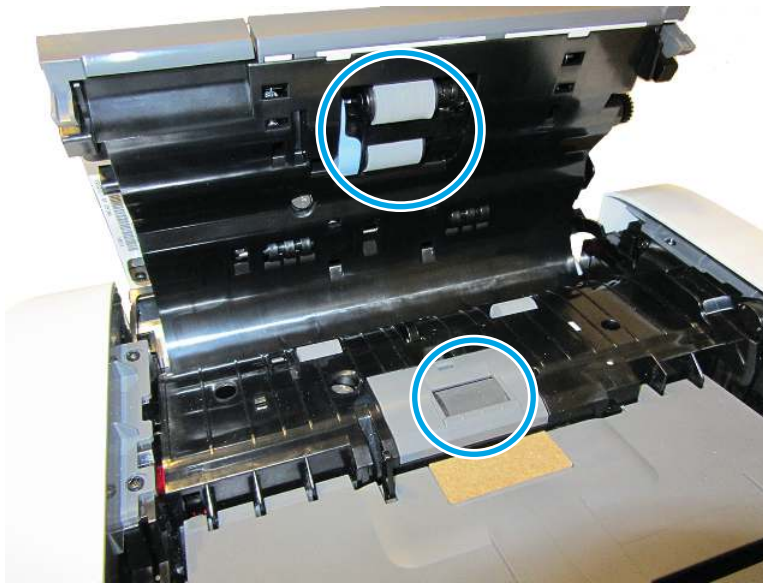

 **NOTE:** Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

ADF Roller Replacement Kit Part number: [W5U23-67901](#)

To order parts, go to <https://store.hp.com>

 **NOTE:** If a grinding noise is heard or reported in conjunction with the pick or feed of paper through the ADF, replace the document feeder (ADF) unit.

Document Feeder (ADF) whole unit part numbers for Non-Flow and Flow models:



- **NON-Flow models** part number: B5L47-67908
- **Flow models** part number: B5L47-67909

Recommended action for onsite technicians


Follow these troubleshooting steps in the order presented.


For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

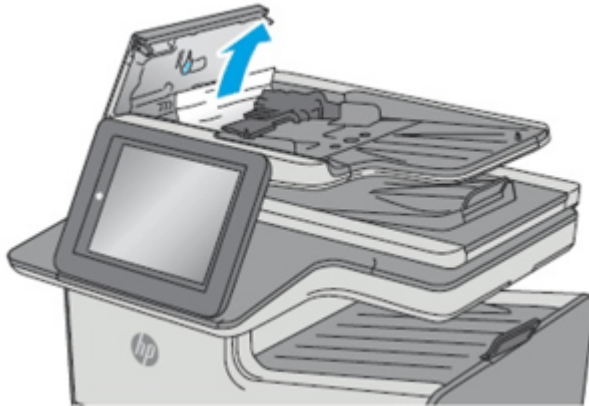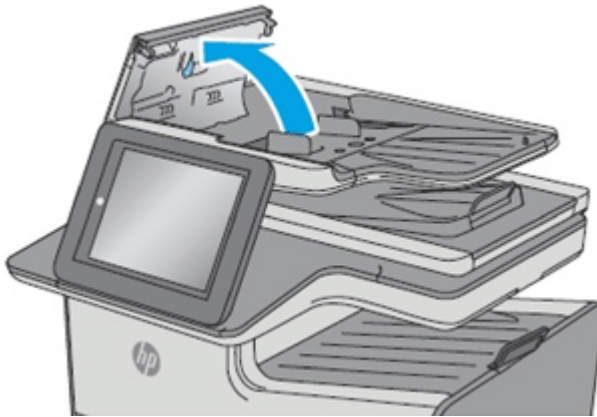

2. Lift the document-feeder input tray and remove any jammed paper.

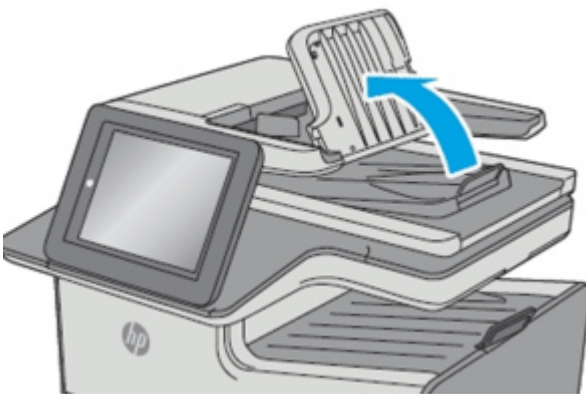

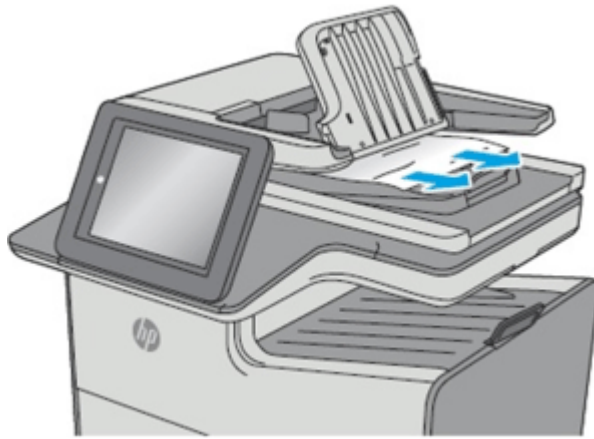

3. Lower the document-feeder input tray and then close the document feeder cover.



NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.


4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.

Figure 6-51 Set the ADF guides

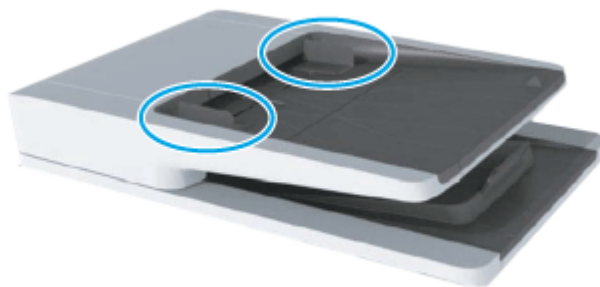


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.




NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

6. Check the Document Feeder Kit consumable status.


- a. Navigate to and select **Supplies** on the control panel.

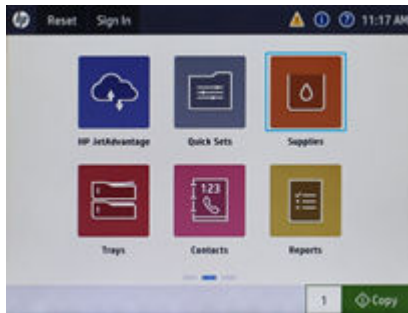

- b. Select **Document Feeder Kit**.

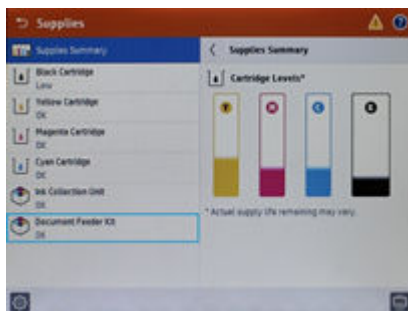

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

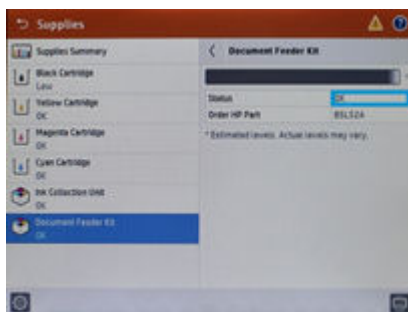

- d. If the status is **Low** or **Very Low**, recommend that the customer replace the Document Feeder Kit.


Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace the (ADF maintenance replacement roller kit) - W5U23-67901

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm

water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

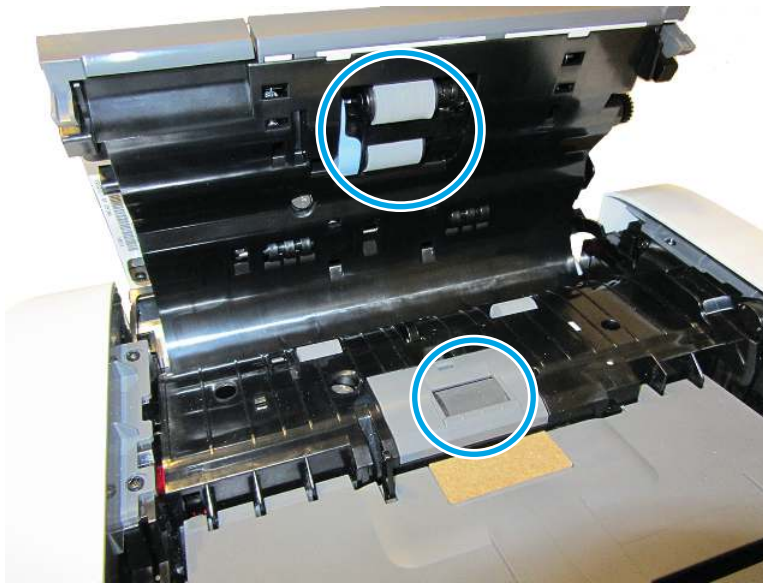

 **NOTE:** Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

ADF Roller Replacement Kit Part number: [W5U23-67901](#)

To order parts, go to <https://store.hp.com>


 **NOTE:** If a grinding noise is heard or reported in conjunction with the pick or feed of paper through the ADF, replace the document feeder (ADF) unit.

Document Feeder (ADF) whole unit part numbers for Non-Flow and Flow models:


- **NON-Flow models** part number: B5L47-67908
 - **Flow models** part number: B5L47-67909
9. If the ADF is physically picking up the media, and there is still a 31.13.01 error, the root cause can be a defective sensor. Follow the steps below to verify sensors functionality:

Depending on Printer Model, Inspect the following sensors:

- Standard MFP models: ADF paper path Deskew sensor, see callout.

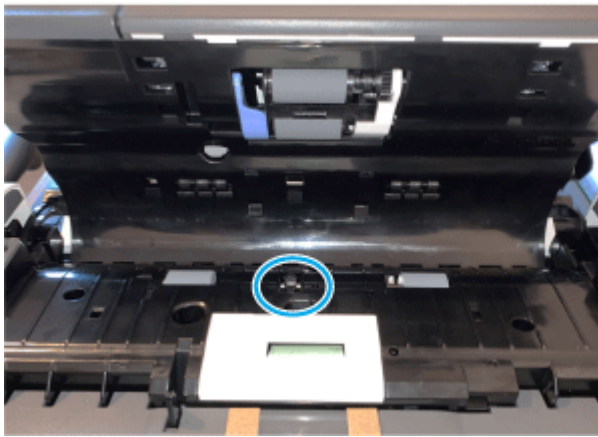


- FLOW MODELS ONLY: Pick Success Sensor, callouts 2 and 3)

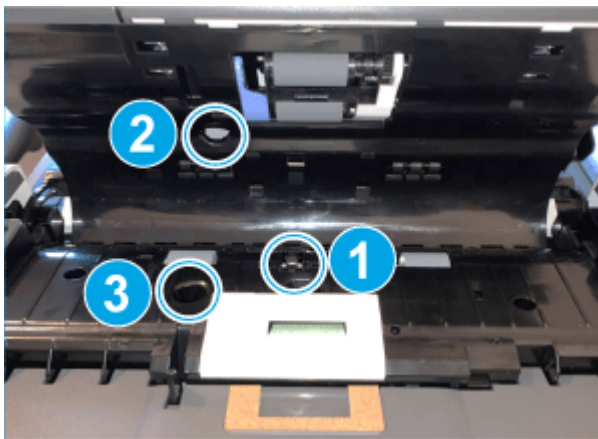


If there is any dust or fiber remnants, clean by using a can of compressed air to blow out and clean (receiver and emitter in FLOW MODELS).

10. Verify that the connections between the automatic document feeder and the SCB are correctly seated.

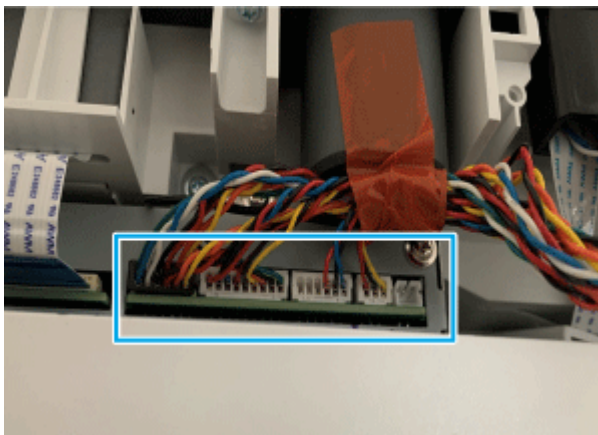


11. Using the Manual Scanner Sensor Test verify functionality of the ADF Paper Path Pick Success sensor.


- a. Navigate to and select **Support Tools**.

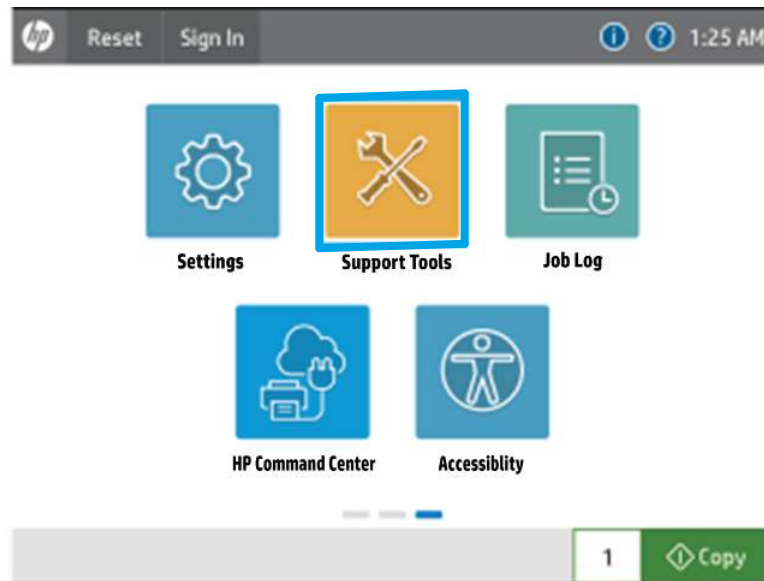


- b. Select **Troubleshooting**.

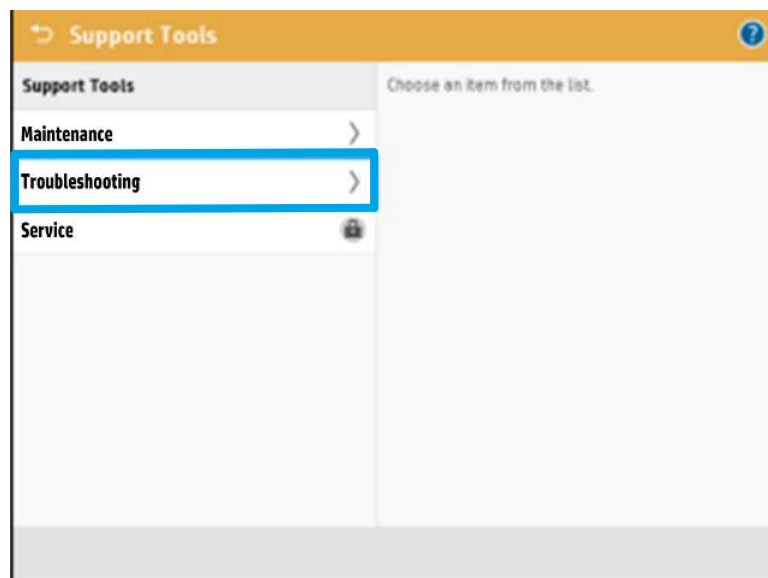


- c. Select **Diagnostic Tests**.

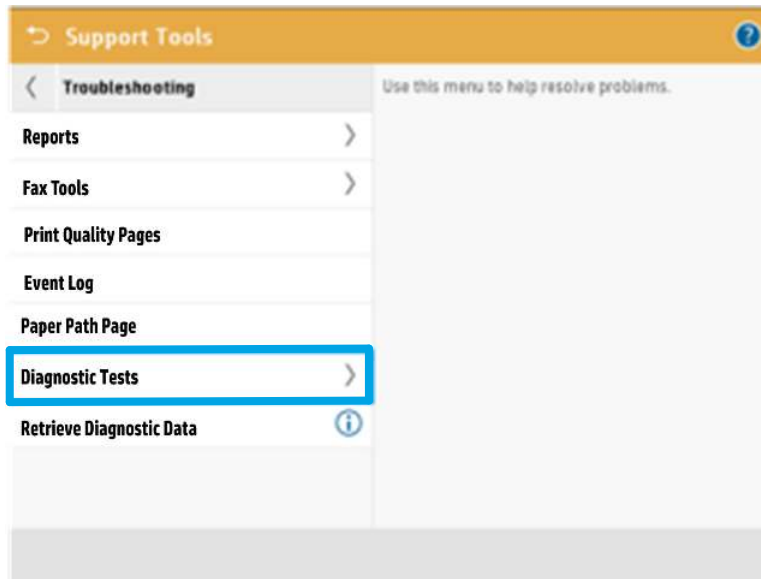


- d. Select **Continue**.

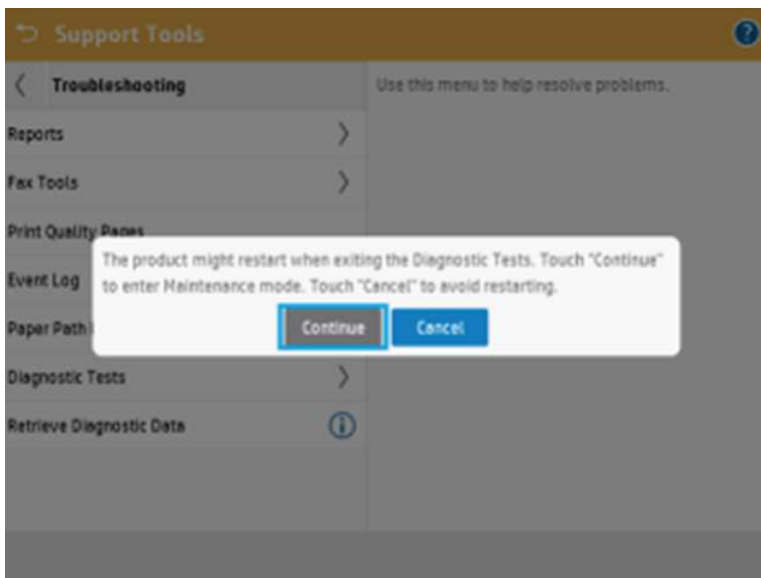

- e. Select **Manual Sensor Test**.

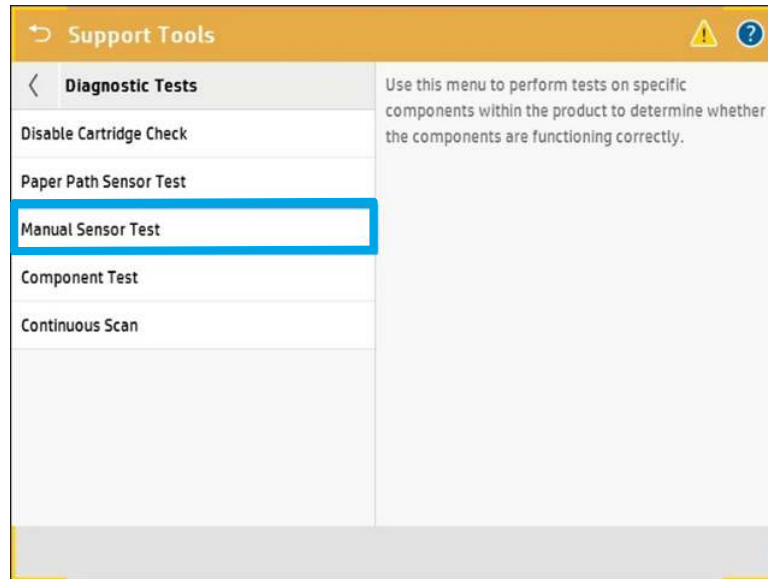

- f. Select **ADF Paper Path Deskew**.

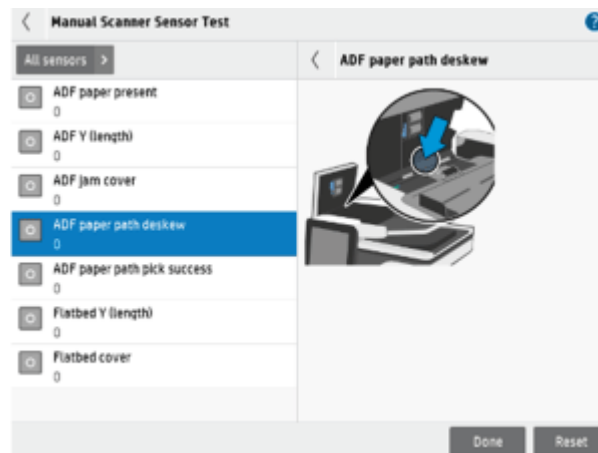

- g. Select **ADF Paper Path Pick Success**.

(Only in FLOW-MODELS)



NOTE: Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advancing.



h. Close the ADF cover and ensure that is secure and closed correctly.

12. If the ADF Deskew sensor test or ADF Paper Path Pick Success test fails, replace the document feeder.

NON-Flow models part number: B5L47-67908

Flow models part number: B5L47-67909

For instructions: See the Repair Service Manual for this product.

31.13.02

Document feeder job error pick error paper jam error.

The paper is jammed at ADF paper path deskew sensor (or ADF paper path success sensor in FLOW MODELS).



NOTE:

- ADF paper path deskew sensor: Detects the top of the page before feeding a page through the ADF and the end of the page after feeding/scanning is complete.
- ADF paper path success sensor: It is an ultrasonic sensor detecting multi picks.

Issue might be described as the following:



- ADF paper jam
- Automatic document feeder jam
- Jams in document feeder

Recommended action for customer


Follow these troubleshooting steps in the order presented.


For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

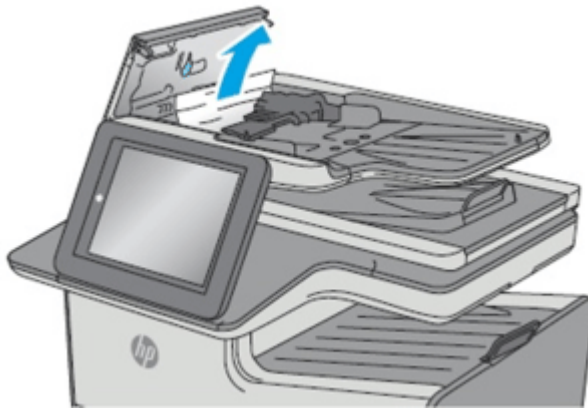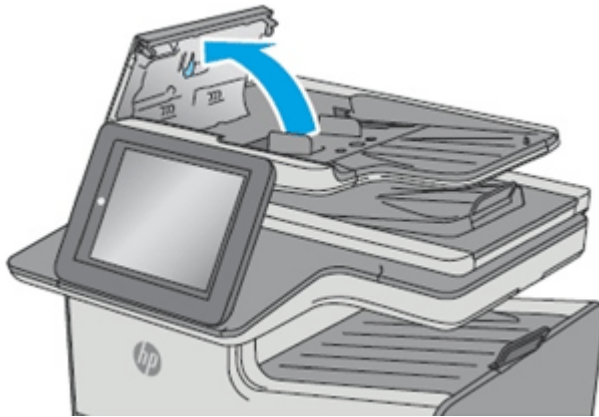

2. Lift the document-feeder input tray and remove any jammed paper.

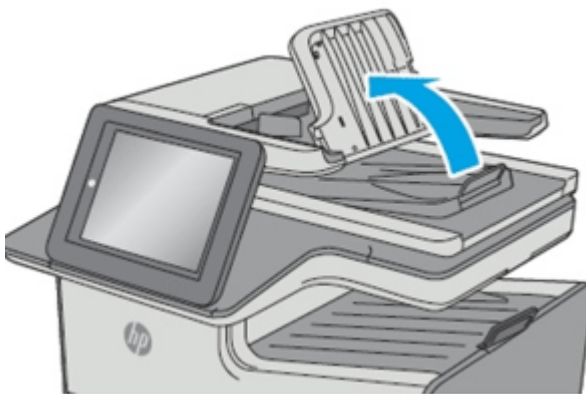

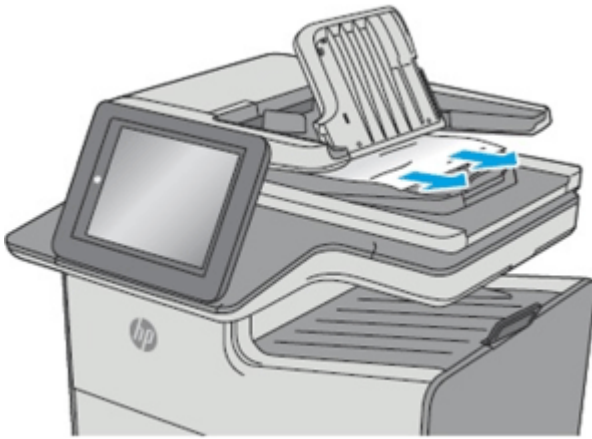

3. Lower the document-feeder input tray and then close the document feeder cover.



NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.


4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.

Figure 6-52 Set the ADF guides

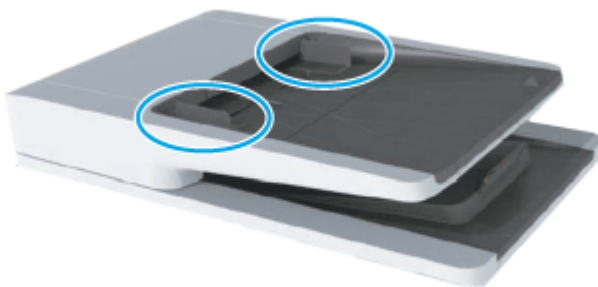


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.




NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

6. Check the Document Feeder Kit consumable status.


- a. Navigate to and select **Supplies** on the control panel.

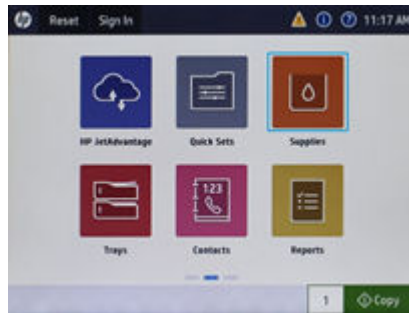

- b. Select **Document Feeder Kit**.

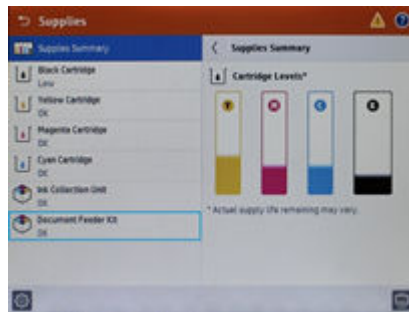

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

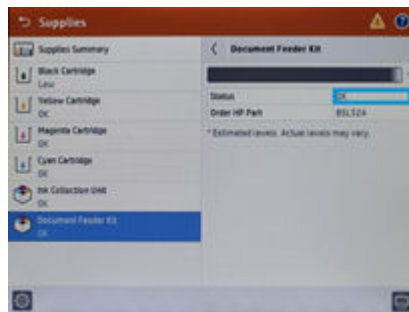


- d. Recommend that the customer replace the Document Feeder Kit if the status is **Low** or **Very Low**.

Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm

water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

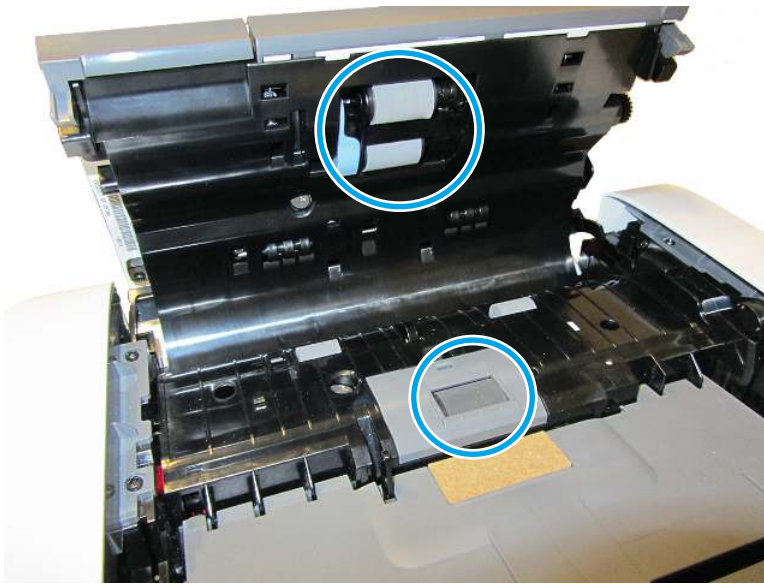

NOTE: Lift up the roller assembly to access and clean the second roller



8. If necessary, replace the Document Feeder Kit rollers and separation pad.
Part number: W5U23A/HP 200 ADF Roller Replacement Kit
To order parts, go to <https://store.hp.com>
9. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents


Follow these troubleshooting steps in the order presented.


For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

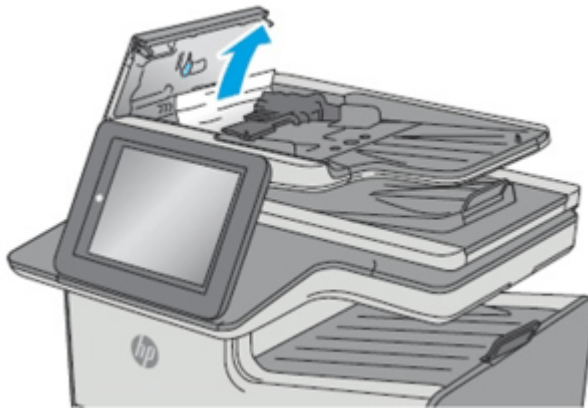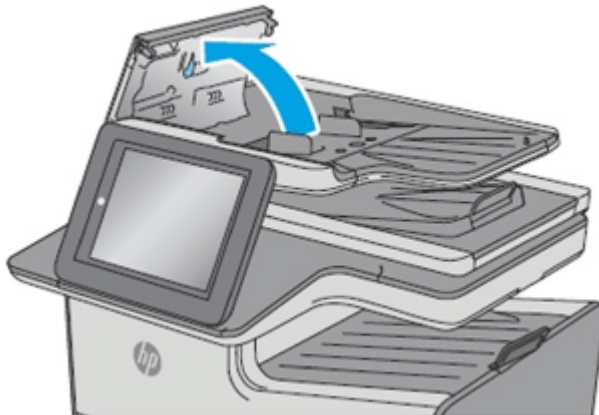

2. Lift the document-feeder input tray and remove any jammed paper.

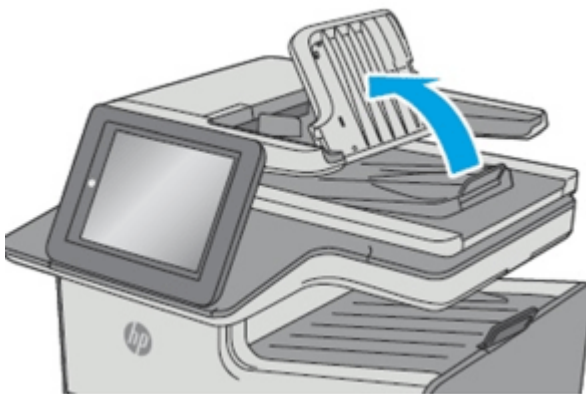

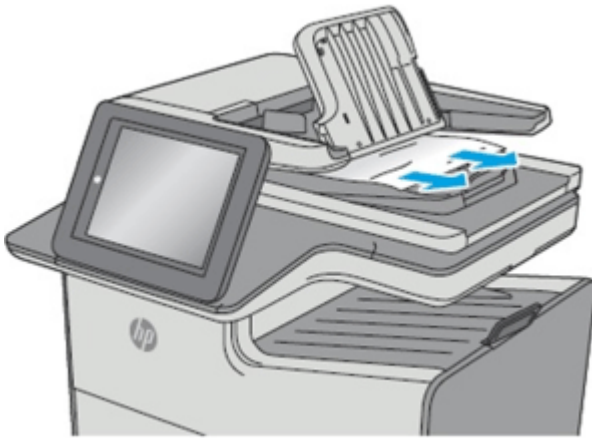

3. Lower the document-feeder input tray and then close the document feeder cover.



NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.


4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.

Figure 6-53 Set the ADF guides

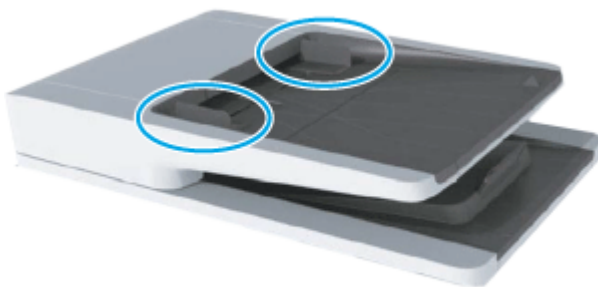


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.




NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

6. Check the Document Feeder Kit consumable status.


- a. Navigate to and select **Supplies** on the control panel.

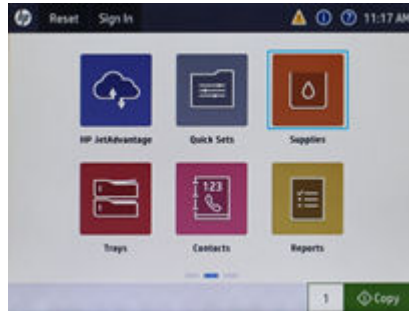

- b. Select **Document Feeder Kit**.

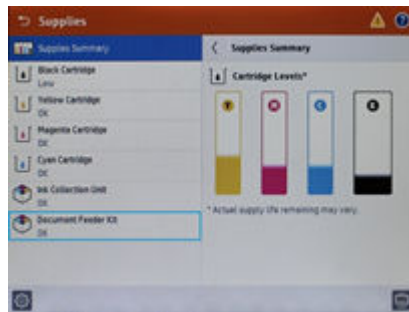

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

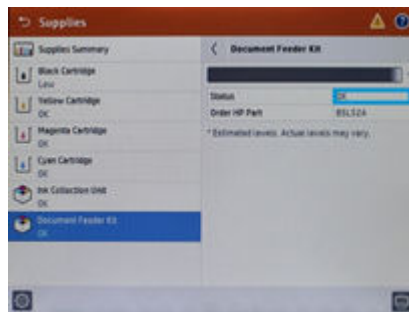

- d. If the status is **Low** or **Very Low**, recommend that the customer replace the Document Feeder Kit.


Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace the (ADF maintenance replacement roller kit) - W5U23-67901

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm

water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

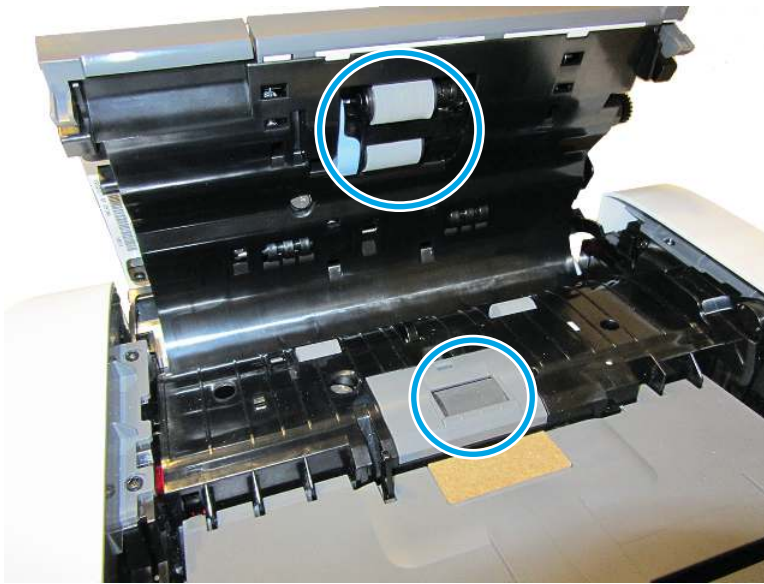

 **NOTE:** Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

ADF Roller Replacement Kit Part number: [W5U23-67901](#)

To order parts, go to <https://store.hp.com>

 **NOTE:** If a grinding noise is heard or reported in conjunction with the pick or feed of paper through the ADF, replace the document feeder (ADF) unit.

Document Feeder (ADF) whole unit part numbers for Non-Flow and Flow models:



- **NON-Flow models** part number: B5L47-67908
- **Flow models** part number: B5L47-67909

Recommended action for onsite technicians


Follow these troubleshooting steps in the order presented.


For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

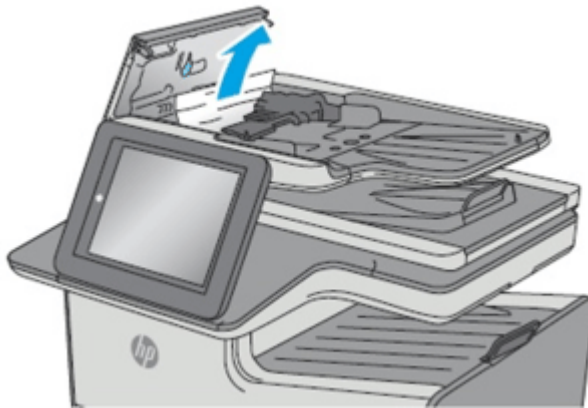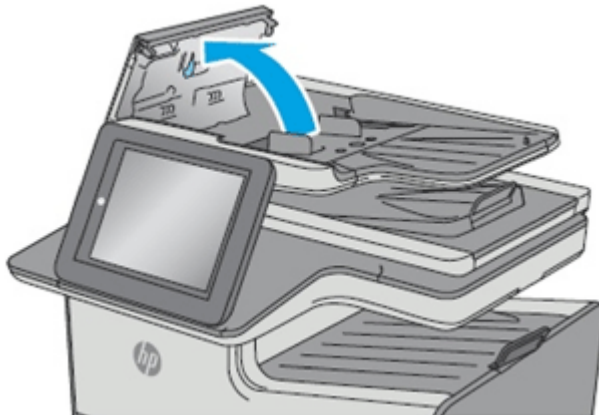

2. Lift the document-feeder input tray and remove any jammed paper.

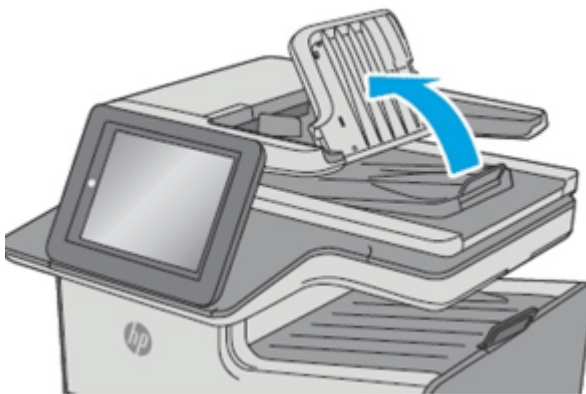

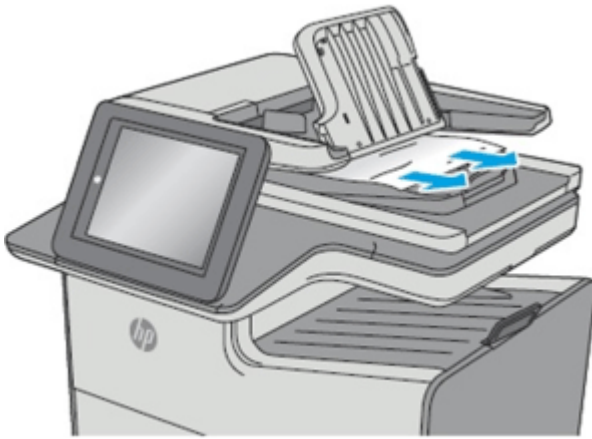

3. Lower the document-feeder input tray and then close the document feeder cover.



NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.


4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.

Figure 6-54 Set the ADF guides

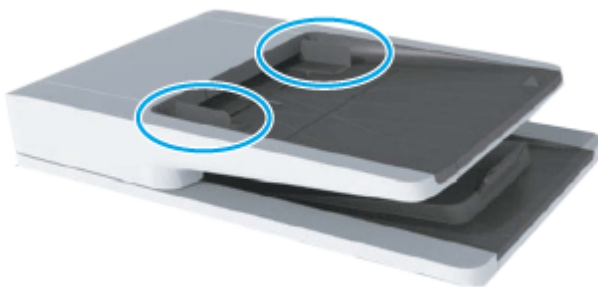


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.




NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

6. Check the Document Feeder Kit consumable status.


- a. Navigate to and select **Supplies** on the control panel.

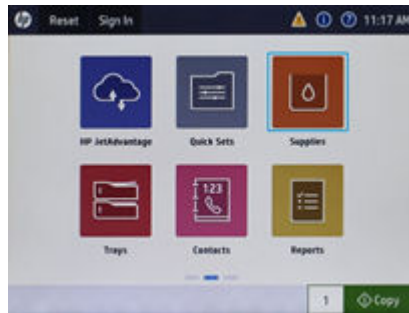

- b. Select **Document Feeder Kit**.

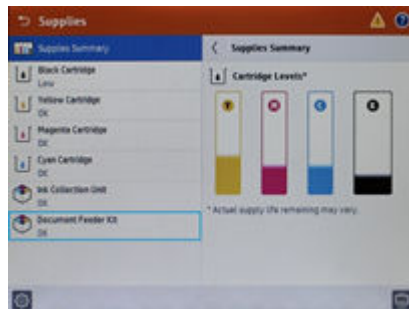

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

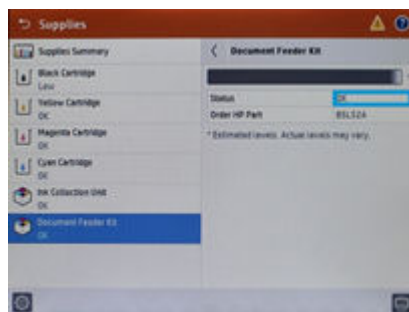

- d. If the status is **Low** or **Very Low**, recommend that the customer replace the Document Feeder Kit.


Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace the (ADF maintenance replacement roller kit) - W5U23-67901

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm

water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

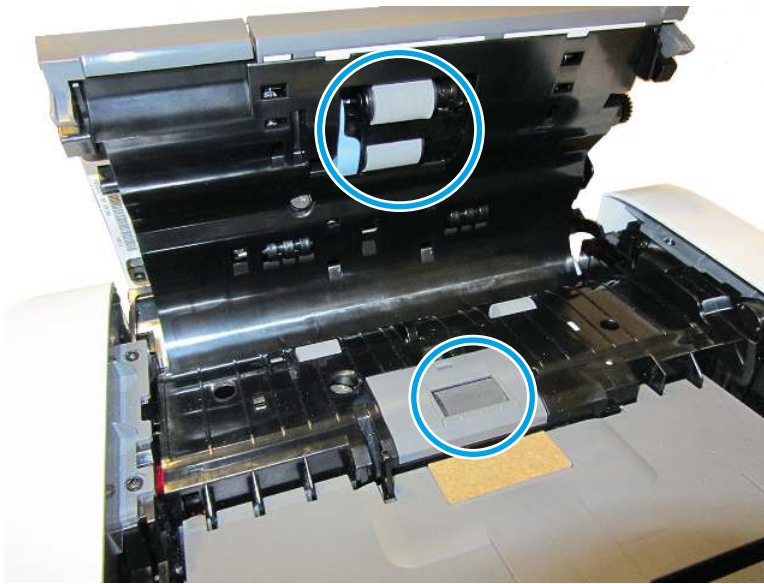

 **NOTE:** Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

ADF Roller Replacement Kit Part number: [W5U23-67901](#)

To order parts, go to <https://store.hp.com>


 **NOTE:** If a grinding noise is heard or reported in conjunction with the pick or feed of paper through the ADF, replace the document feeder (ADF) unit.

Document Feeder (ADF) whole unit part numbers for Non-Flow and Flow models:


- **NON-Flow models** part number: B5L47-67908
 - **Flow models** part number: B5L47-67909
9. If the ADF is physically picking up the media, and there is still a 31.13.01 error, the root cause can be a defective sensor. Follow the steps below to verify sensors functionality:

Depending on Printer Model, Inspect the following sensors:

- Standard MFP models: ADF paper path Deskew sensor, see callout.

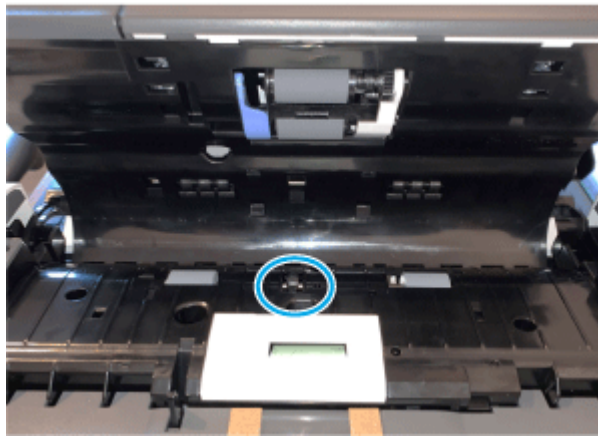


- FLOW MODELS ONLY: Pick Success Sensor, callouts 2 and 3)

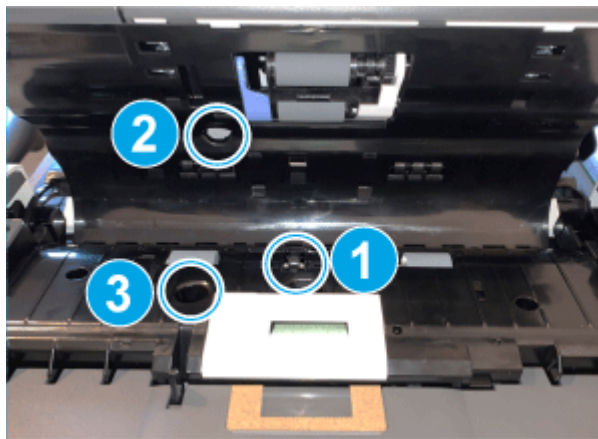


If there is any dust or fiber remnants, clean by using a can of compressed air to blow out and clean (receiver and emitter in FLOW MODELS).

10. Verify that the connections between the automatic document feeder and the SCB are correctly seated.

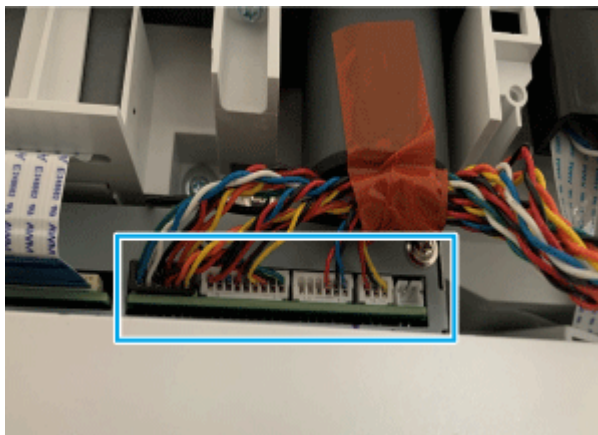


11. Using the Manual Scanner Sensor Test verify functionality of the ADF Paper Path Pick Success sensor.


- a. Navigate to and select **Support Tools**.

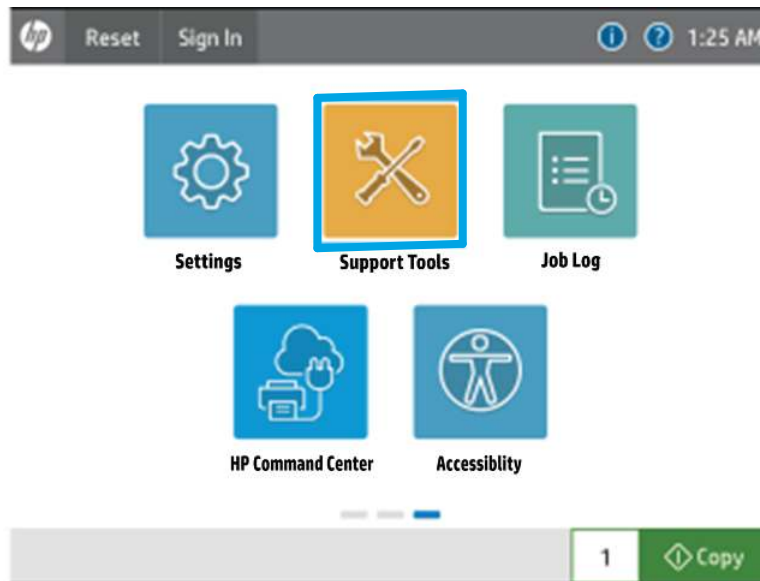


- b. Select **Troubleshooting**.

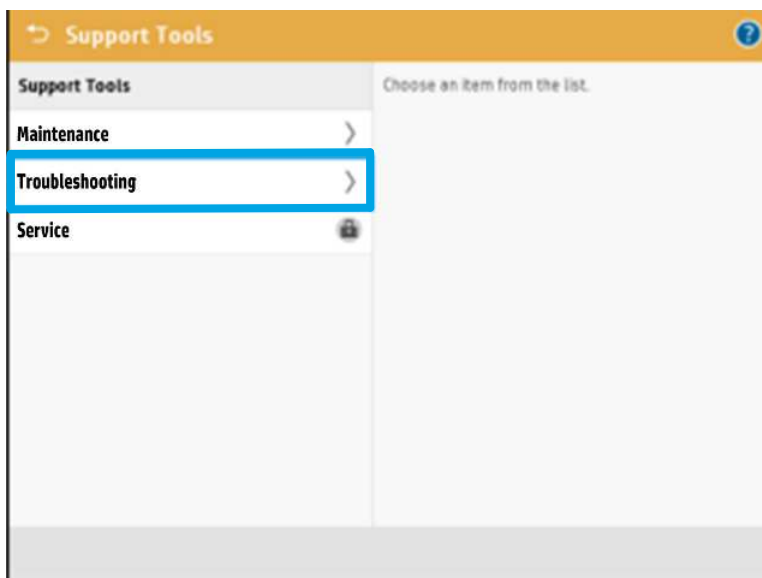


- c. Select **Diagnostic Tests**.

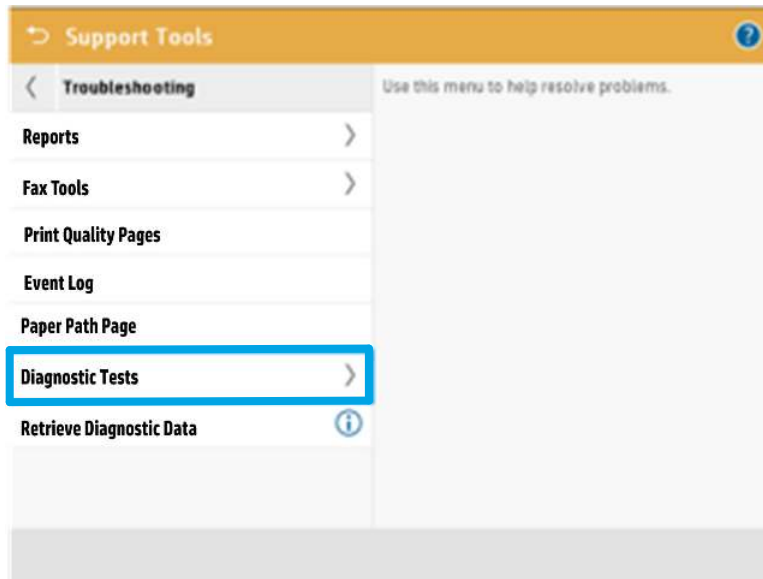

- d. Select **Continue**.

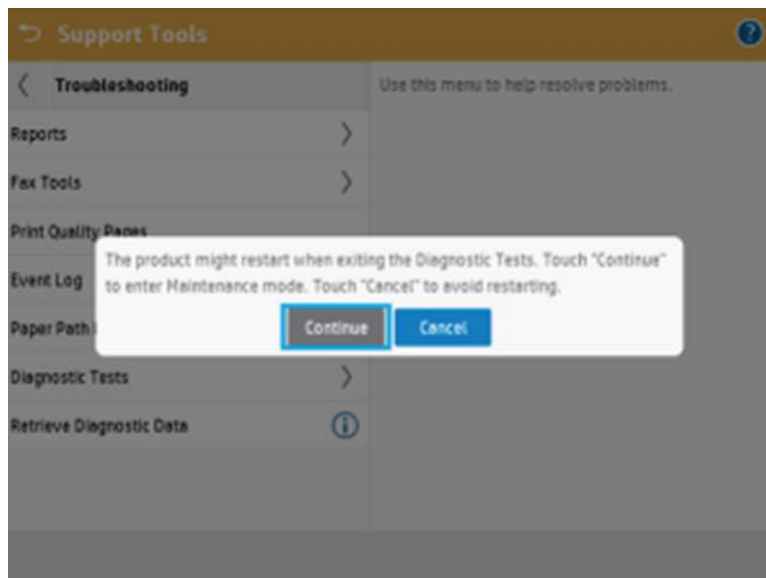

- e. Select **Manual Sensor Test**.

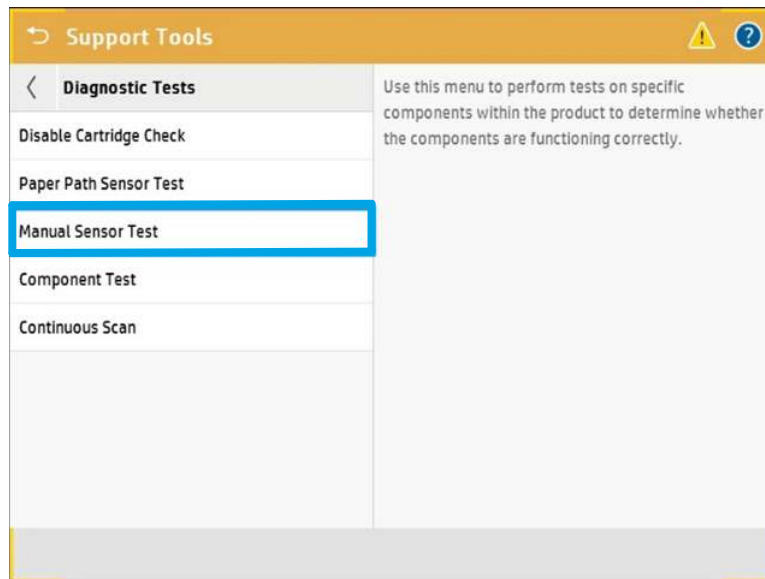

- f. Select **ADF Paper Path Deskew**.



- g. Select **ADF Paper Path Pick Success**.

(Only in FLOW-MODELS)



NOTE: Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advancing.



- h. Close the ADF cover and ensure that is secure and closed correctly.
- 12. If the ADF Deskew sensor test or ADF Paper Path Pick Success test fails, replace the document feeder.

NON-Flow models part number: B5L47-67908

Flow models part number: B5L47-67909


For instructions: See the Repair Service Manual for this product.

31.13.13

The document feeder jam access door is open.

Recommended action for customers

1. Verify that the jam access cover is closed.
2. Verify that the flag is not broken off.

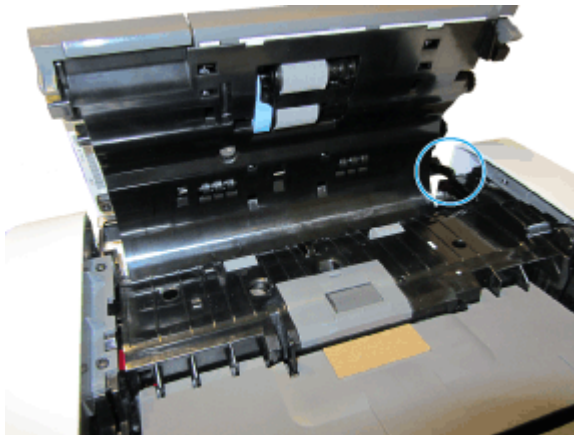


3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Verify that the jam access cover is closed.

2. Verify that the flag is not broken off.

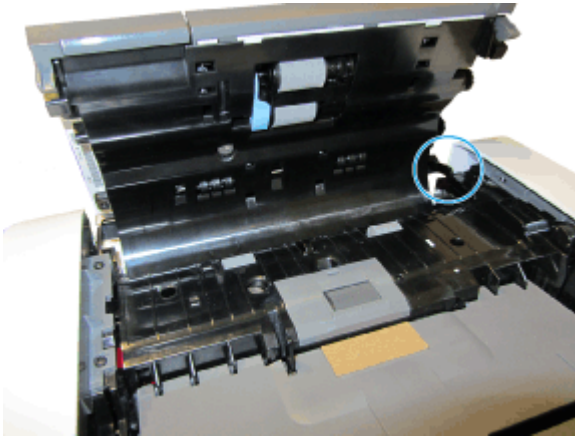


3. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Scanner Tests
4. Actuate the document feeder [Jam Cover Sensor](#). If the sensor does not show functionality when tested, replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number: G1W41-67908

 **IMPORTANT:** Before replacing the document feeder, technicians should verify that the connections between the document feeder and the product are fully seated. Check one flat cable (callout 1), one ground screw (callout 2), and five connectors (callout 3).

Figure 6-55 Check connectors and ground screw

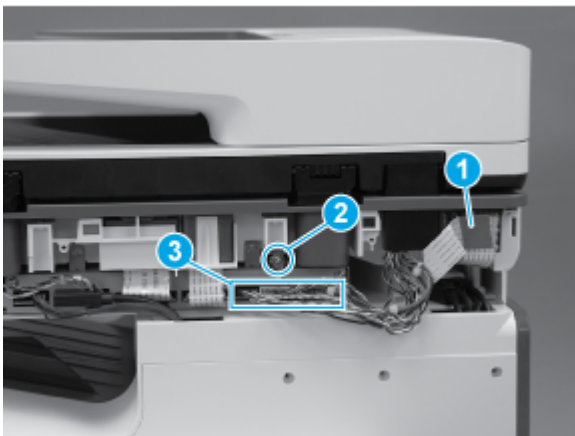

31.13.14

Document feeder job error, over current.

This is a feed jam in the document feeder, and the motor is not turning.


Recommended action for customers

1. Verify that the paper meets the product specifications.
2. Make sure that the document feeder input tray is not overloaded.
3. Check the event log for document feeder errors, and then resolve any errors first.
4. Open and close the top cover to see if the pick motor turns without posting this error. If there is no error, then the motor is good.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Verify that the paper meets the product specifications.
2. Make sure that the document feeder input tray is not overloaded.
3. Check the event log for document feeder errors, and then resolve any errors first.
4. Open and close the top cover to see if the pick motor turns without posting this error. If there is no error, then the motor is good.
5. Verify that the connections between the document feeder and the product are fully seated. Check one flat cable (callout 1), one ground screw (callout 2), and five connectors (callout 3).

Figure 6-56 Check connectors and ground screw

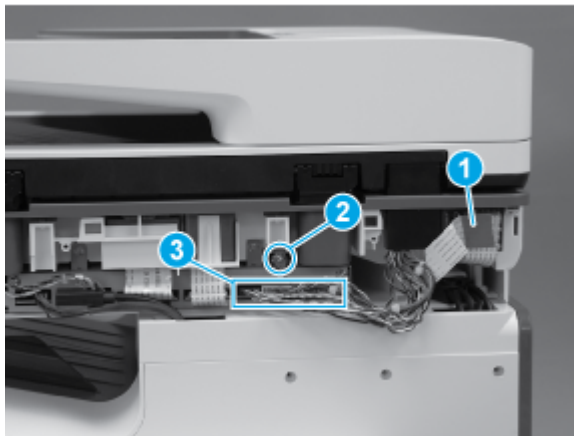

6. Re-seat the document feeder to the scanner control board (SCB).
7. Replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number: G1W41-67908

32.WX.YZ error messages

32.* errors

Errors in the 32.* family are related to either product start events or to backup and restore events.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. Retry the job.

32.08.A1, 32.08.A2, 32.08.A3

An event related to starting the printer.

[32.08.A1](#) (event code)

Shutdown event. Boot after abnormal shutdown.

[32.08.A2](#) (event code)

Boot from normal shutdown event.

[32.08.A3](#) (event code)

Regular boot event.

Recommended action

- No action necessary.

32.1C.05

The restore job ticket was submitted with invalid credentials.

Recommended action

1. Verify the credentials that were submitted.
2. Check the domain, user name, and password.

32.1C.06 (event code)

The backup job ticket was submitted with invalid credentials.

Recommended action

1. Verify the credentials that were submitted.
2. Check the domain, user name, and password.

32.1C.07 (event code)

Backup restore permissions error.

There was an error during the creation, read, or write of the restore file.

Recommended action

- Retry the job.

32.1C.08 (event code)

Not enough disk space to perform backup/restore, or a network share issue.

There was an error during the creation, read, or write of the backup file.

Recommended action

1. Retry the job.
2. Remove stored jobs and retry.
3. If the error persists, try using a larger capacity storage device for the share location and check the network share settings.
4. Check the network share or try setting up a new shared network drive or folder.

32.1C.09 (event code)

Tried to restore a backup file that was not valid for this printer.

The data in the backup file specified in the restore job ticket is no longer valid due to a corruption of the data, or the data is no longer present.

Recommended action

- Use a valid backup file.

32.1C.0A (event code)

Backup file is invalid.

The data in the backup file specified in the restore job ticket is no longer valid due to a corruption of the data, or the data is no longer present.

Recommended action

1. Use a valid backup file.
2. Reboot, and then observe the state of the printer.
3. If the error persists, perform a partition clean from the **Preboot** menu.

32.1C.0D (event code)

Backup/restore failed, auto-reboot failed, or the printer might be busy.

Recommended action

- Reboot, and then retry the backup/restore.

32.1C.11 (event code)

Backup/restore time-out while communicating with the engine.

The backup operation was aborted because the printer is busy.

Recommended action

- Wait until the printer is idle, and then try again.

32.1C.13, 32.1C.14

Not enough space exists to perform the backup.

The backup was aborted because the disk is at a critical level or full.

Scheduled backup failure.

Recommended action

- Free up disk space, and then try again.

32.1C.15

The restore operation was aborted because the backup file was created by a previous version of firmware no longer supported by the feature.

Recommended action

- Use the current backup file.

32.1C.2E

The restore operation was aborted because the printer is busy.

Recommended action

1. Wait until the printer is idle, and then retry.
2. Turn the printer off then on, and then retry.

32.1C.2F

Reset failure.

Recommended action

- Turn the printer off, and then on. Retry the job.

32.1C.40

The backup operation completed successfully (informational).

Recommended action

- No action necessary.

32.1C.41

The backup operation encountered an error (informational).

Recommended action

- No action necessary.

32.1C.42

The backup operation completed, but with a warning message (informational).

Recommended action

- No action necessary.

32.1C.43

A component in the backup file is not supported by the current version of firmware and will not be restored (informational).

Recommended action

- No action necessary.

32.1C.44

A component in the backup file is not transferable to another printer and will not be restored (informational).

Recommended action

- No action necessary.

32.1C.45

Some data was not included in the backup file (informational).

Recommended action

- No action necessary.

32.1C.46

An expected component could not be found and was thus not backed up. Because components should be known on backups, this code is a warning (informational).

Recommended action

- No action necessary.

32.1C.47

Some data was not restored from the backup file (informational).

Recommended action

- No action necessary.

32.1C.48

The backup job ticket was submitted using an invalid network path.

Recommended action

1. Check that a shared folder was provided as part of the network path and not left blank.
2. Check that the server and the shared folder exists.
3. Check that you (or the applicable user) has permission to access the shared folder on the provided server.

32.1C.49

The backup job ticket was submitted with a bad encryption.



NOTE: This would only apply to a web services call to perform a backup with a blank PIN

Recommended action

- Verify that the encryption personal identification number (PIN) meets the restrictions for the printer.

32.1C.4A

An error occurred when creating the temporary directories used to store the backup files in transition to and from the compressed (ZIP) file.

Recommended action

1. Retry the job.
2. If this does not resolve the issue, turn the printer off then on again and retry the job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

32.1C.56

Reset aborted. Backup/restore in progress (informational).

Recommended action

- No action necessary.

32.1C.57

Reset aborted (informational).

Recommended action

- No action necessary.

32.1C.58

Unknown reset error (informational).

Recommended action

- No action necessary.

32.1C.60

The restore operation completed successfully (informational).

Recommended action

- No action necessary.

32.1C.61

The restore operation encountered an error.

Recommended action

- Review the printer's event log to see specific details about the failure.

32.1C.62

The restore operation completed, but with a warning message.

Recommended action

- Review the error log to see specific details about the failure.

32.1C.68

The restore job ticket was submitted using an invalid network path.

Recommended action

1. Check that a shared folder was provided as part of the network path and not left blank.
2. Check that the server and the shared folder exist.
3. Check that you (or the applicable user) has permission to access the shared folder on the provided server.
4. Check that the path includes the compressed .ZIP file name as part of the path.

32.1C.69

The restore job ticket was submitted with a bad encryption personal identification number (PIN).

Recommended action

- Verify the encryption personal identification number (PIN) is the same PIN used to encrypt the backup file.

32.1C.6A

An error occurred when creating the temporary directories used to store the restore files in transition to and from the compressed (ZIP) file.

Recommended action

- Retry the job.

32.1C.6D

An unusual error occurred when running the restore operation.

Recommended action

- Retry the job.

33.XX.YZ error messages

33.* errors

Errors in the 33.* family are related to the printer's storage system or the formatter. The component might have been previously installed in another printer and is therefore locked to that other printer. Or, the component might be incorrect for this printer.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem.

- Install the correct component for this printer.

33.02.01 Used board/disk installed

Used board or disk installed.

An encrypted board or disk with existing data previously locked to a different printer has replaced the original. If you continue, data is permanently lost.



IMPORTANT: Do not install used formatter boards in HP LaserJet, HP PageWide Enterprise or Managed printers. Only replace the formatter when specifically directed to do so during troubleshooting using the Control Panel Message Document (CPMD). If you see the 33.02.01 event code, it means a used board has been installed, and the settings may be incorrect.

For more information go to, or search for: [HP LaserJet Enterprise, HP LaserJet Managed, HP PageWide Enterprise, HP PageWide Managed - 33.02.01 error or printer name and/or product number changes after replacing the formatter](#) (c06360930).

Recommended action

1. Reinstall the used board or disk back into its original printer.
2. To save the data on the board or disk, turn the product off. Replace the board or disk with another board or disk.
3. To delete the data on the board or disk and continue, touch the **OK** button.

33.03.xx

An error occurred while saving data.

- 33.03.01: Save recover engine storage ID unexpected length.
- 33.03.02: Data size mismatch unable to recover DCC MVRAM.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. If issue is not resolved, replace the ICB and return it to HP for evaluation.

Part number: CN598-67059

33.03.03 Incompatible formatter installed

This is an EFI BIOS event to prevent booting with the wrong formatter installed.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

- Turn off the printer and install the correct formatter.

For instructions: See the Repair Service Manual for this product.

Table 6-8 Part numbers

Part description	Part number
Formatter PCA (556)	G1W46-67911
Formatter PCA (586)	G1W39-67914

Table 6-8 Part numbers (continued)

Part description	Part number
Formatter PCA - China only (556)	G1W46-67912
Formatter PCA - China only (586)	G1W39-67939



NOTE: If it is believed that the formatter is the correct part number and model for this printer, replace the formatter again and return the formatter in question to HP for evaluation.

33.03.05 EFI Boot error

EFI BIOS event showing that a replacement formatter Recover attempt was unsuccessful.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information,Go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, replace the formatter.

M806 part number: CZ244-67901

M806 (China/India) part number: CZ244-67902

M830 part number: CF367-67915

M830 (China/India) part number: CF367-67916

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

This issue is caused by an unsuccessful formatter recovery after a formatter has been replaced.

1. Turn off the printer, and then turn on the printer.

2. If the error persists, perform a **Partial Clean** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

 **CAUTION:** A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

- a. Turn on the printer.
- b. Press the HP logo that displays in the middle of the screen when you see the "1/8" under the logo.
- c. Touch the down arrow button ▼ to highlight **Administrator**, and then press the **OK** button.
- d. Touch the down arrow button ▼ to highlight **Partial Clean**, and then press the **OK** button.
- e. Touch the **OK** button again.
- f. Touch the Home button  to highlight **Continue**, and then press the **OK** button.

The printer will automatically reboot and should return to a Ready state.

3. If the error persists, download and from the **Preboot** menu install the latest version of printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, Go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

4. If the issue persists, remove and reinstall the formatter board.
5. If the error persists, replace the formatter.

M806 part number: CZ244-67901

M806 (China/India) part number: CZ244-67902

M830 part number: CF367-67915

M830 (China/India) part number: CF367-67916

For instructions:

See the Repair Service Manual for this product.

6. If the error persists, elevate the case using the Standard Support Process.

33.04.01 Missing TPM

A Trusted Platform Module is missing from a printer that previously had a TPM installed.

TPM accessory (optional): This system is using a TPM module installed as an accessory to protect data and it is not present. The original TPM must be returned or you can select the **Stop Using** option in the preboot TPM sub-menu. All data will be cryptographically erased and a reload of firmware from USB might be required.

TPM Standard (Standard on product): This system is using a TPM module installed at the factory to protect data and it is not present. Verify that the TPM is seated firmly on the formatter, in case of shifting

during shipment. If the TPM has been removed for a formatter replacement, put the original TPM on the board. If the original TPM cannot be reinstalled or has become damaged, **DO NOT** replace any parts. Replace the printer.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Reinstall the missing TPM module into the printer.



NOTE: If the TPM accessory was installed, you can also go to the [Administration](#) menu and under TPM, select the [Stop Using](#) option if you no longer want to use the TPM accessory.

3. Restart the printer.

33.04.02 Missing TPM

The wrong TPM is installed on a printer that previously had a different TPM installed.

TPM Optional device: This system is using a TPM module to protect data and it is not present. The original TPM module must be returned or you may select the **Stop Using** option in the preboot TPM sub-menu.

Recommended action

1. Turn the printer off.
2. Reinstall the original TPM module into the printer.
3. Restart the printer.
4. Go to the [Administration](#) menu and under TPM and select the [Enable and Use](#) option.



NOTE: To no longer use the TPM device, go to the [Administration](#) menu and under TPM and select the [Stop Using](#) option.

33.04.03 Unknown TPM

A used TPM has been installed on a printer that has not previously had a TPM installed.

TPM Optional device: This system is using a TPM module to protect data and it is not present. The TPM module currently installed is used to protect data in another device. The original TPM module must be returned or you can start using this TPM module by selecting the [Enable and Use](#) option in the preboot TPM sub-menu. You can also stop using a TPM altogether.

Recommended action

1. Turn the printer off and remove the TPM module. The printer will not be protected.
2. If choosing to protect the printer with the used TPM, refer to the "Install a new or re-enable an existing TPM after disabling a previous TPM" section of the <http://h10032.www1.hp.com/ctg/Manual/c04499622> (c04499622).

33.04.04 or 33.04.05 Unknown TPM

A new Trusted Platform Module is installed in a printer that had previously been configured to a different TPM accessory or a TPM installed from the factory.

This system contains a TPM module that is used to protect data in another device. The original TPM module that was shipped in the device must be reinstalled.

For units with a TPM accessory: If the original is unavailable, install a new TPM accessory.

For units that shipped with a TPM on board standard: If the original TPM installed in the factory is unavailable or damaged, **DO NOT** replace any parts. Elevate using the standard support process.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

1. Turn the printer off, and then on.
2. If the error persists, dispatch an onsite technician.

Recommended action for call center agents and onsite technicians

1. Turn the printer off, and then on.
2. Turn the printer off, and then on. While the printer turns on, enter the Preboot menu.
3. From the Preboot menu, select **Administrator**, and then select **TPM Config**.
4. Select **Get status**, **Enabled** and then select **Disable TPM** and confirm. The printer will reboot.



NOTE: After a message states that the printer is restoring, wait for the printer to restart and to be in a **Ready** state.

5. Print a configuration page, the event log, and collect the JDP log to verify that the TPM is disabled.
6. Turn the printer off, and then turn it on.
7. Open the Preboot menu.
8. From the Preboot menu, select **Administrator**, and then select **TPM Config**.
9. Select **Get status**, **Disabled** and then select **Enable TPM** and confirm. The printer will reboot.



NOTE: Wait for the printer to restart and to be in a **Ready** state.

10. After the printer is initialized, print a **Configuration Page** to verify that the TPM is enabled.



NOTE: Never replace the TPM on a unit that shipped with one. The TPM that can be ordered is only available for adding a level of security on the device never had a TPM paired from the factory, a new one can not be installed for security reasons.

11. If the error persists, elevate the case using the Standard Support Process.

33.05.0z SureStart errors

A SureStart error has occurred.

The printer detected and recovered from a corrupted version of BIOS.

- **33.05.01** Boot code corrupt (event code)
- **33.05.02** Boot code corrupt (event code)
- **33.05.03** Boot code corrupt (event code)

The newly downloaded firmware failed to cryptographically validate the BIOS code.

- **33.05.04** Security alert
- **33.05.04** Upgrade corrupt (event code)
- **33.05.05** Security alert
- **33.05.05** Boot code corrupt (event code)
- **33.05.06** Security alert
- **33.05.06** Upgrade corrupt (event code)
- **33.05.07** Security alert
- **33.05.07** Upgrade corrupt (event code)
- **33.05.08** Invalid boot attempt (event code)
- **33.05.09** Downgrade attempted (event code)

Recommended action

1. For 33.05.01, 33.05.02, and 33.05.03: No action is necessary.
2. For all other errors: Download a firmware bundle to the printer from the [Preboot](#) menu.

Go to: [HP FutureSmart - Latest Firmware Versions](#)



NOTE: For more information on SureStart, go to: [HP SureStart Whitelisting and Intrusion Detection Troubleshooting Manual](#) (Doc ID: c04863614).

33.05.1x Whitelisting errors

An error occurred with a firmware file digital signature or an error with the certificate used to validate the firmware file certificate.

- **33.05.10** Security alert
- **33.05.10** Firmware verification Error: XX (Event code)
- **33.05.11** Security alert
- **33.05.11** Firmware verification Error: XX (Event code)

- **33.05.12** Security alert
- **33.05.12** Firmware verification Error: XX (Event code)

Recommended action

1. Perform a [Format Disk](#) procedure.
[HP Enterprise, HP Managed - Perform a Partial Clean or Format Disk to reset the printer](#)
2. If the device does not reboot to **Ready**, download a firmware bundle to the device from the **Preboot** menu.
Go to: [HP FutureSmart - Latest Firmware Versions](#)



NOTE: Performing a Format Disk procedure is required before downloading a firmware bundle.

For more information on SureStart, go to [HP SureStart Whitelisting and Intrusion Detection Troubleshooting Manual](#). Doc ID c04863614.

33.05.2x Intrusion detection errors

The intrusion detection system has encountered an error.

The intrusion detection memory process determined an unauthorized change in system memory.

- **33.05.21** Security alert
- **33.05.21** Potential intrusion (Event code)

The intrusion detection memory process heartbeat was not detected.

- **33.05.22** Security alert
- **33.05.22** Cannot scan for potential intrusions (Event code)

The intrusion detection memory process did not initialize.

- **33.05.23** Security alert
- **33.05.23** Intrusion detection not initialized (Event code)
- **33.05.24** Intrusion detection initialization error (Event code)

Recommended action for customers

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.

 **NOTE:** Selecting [Continue](#) from the [Preboot](#) menu will not resolve the error. The printer must be turned off, and then on to clear the error allowing the printer to reboot to a [Ready](#) state.

 **NOTE:** With firmware version 3.7, the following message “A disk or boot error has occurred. Clear Error. Press Any Key” is displayed when selecting [Continue](#) from the [Preboot](#) menu after encountering a 33.05.2z or 33.05.5z error. This message should be ignored.

For more information on the Intrusion Detection error, go to the following document: c04863614.

[HP SureStart Whitelisting and Intrusion Detection Troubleshooting Manual](#)

33.05.5z Intrusion detection errors

The intrusion detection system has encountered an error.

The intrusion detection memory process determined an unauthorized change in system memory.

- **33.05.51** Security alert
- **33.05.51** Potential intrusion (Event code)

The intrusion detection memory process heartbeat was not detected.

- **33.05.52** Security alert
- **33.05.52** Cannot scan for potential intrusions (Event code)

The intrusion detection memory process did not initialize.

- **33.05.53** Security alert
- **33.05.53** Intrusion detection not initialized (Event code)
- **33.05.54** Intrusion detection initialization error (Event code)

Recommended action for customers

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.

 **NOTE:** Selecting [Continue](#) from the [Preboot](#) menu will not resolve the error. The printer must be turned off, and then on to clear the error allowing the printer to reboot to a [Ready](#) state.

 **NOTE:** With firmware version 3.7, the following message “A disk or boot error has occurred. Clear Error. Press Any Key” is displayed when selecting [Continue](#) from the [Preboot](#) menu after encountering a 33.05.2z or 33.05.5z error. This message should be ignored.

For more information on the Intrusion Detection error, go to the following document: c04863614.

40.XX.YZ error messages

40.* errors

Errors in the 40.* family are related to input/output accessories, such as USB storage devices, Jetdirect cards, or EIO cards or on-board network functions.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Touch the **OK** button to clear the error.
2. Remove and then reinstall the accessory.

40 . 00 . 01 USB I/O buffer overflow To continue, touch “OK”

The USB buffer has overflowed.

Recommended action

1. Touch the **OK** button to print the transferred data (some data might be lost).
2. Check the host configuration.

40 . 00 . 02 Embedded I/O buffer overflow To continue, touch “OK”

The product has experienced a JetDirect buffer overflow.

Recommended action

1. Touch the **OK** button to print the transferred data (some data might be lost).
2. Check the host configuration.

40 . 00 . 03 EIO [x] buffer overflow To continue, touch “OK”

Too much data was sent to the EIO card in the specified slot (x). An incorrect communications protocol might be in use.

Recommended action

- Touch the **OK** button to print the transferred data (some data might be lost).

40 . 00 . 04 EIO [x] bad transmission To continue, touch “OK”

The connection between the product and the USB device has been broken.

Recommended action

1. Touch the **OK** button to clear the error message and continue printing.

2. Remove, and then reinstall the USB device.

40 . 00 . 05 Embedded I/O bad transmission To continue, touch OK

The USB device has been removed.

Recommended action

1. Touch the **OK** button to clear the error message (data will be lost).
2. Install the USB device.

40 . 08 . 0x USB storage accessory removed

The USB storage accessory has been removed.

x = 0 or 1; information code.

Secure file erase is enabled.

Recommended action

- No action necessary.

40 . 0x . 05 USB storage accessory removed

The USB storage accessory was removed.

x = 1, 2, 3, 5, or 6; information code.

Recommended action

- No action necessary.

41.XX.YZ error messages

41.* errors

Errors in the 41.* family are related to printing problems, such as a mismatch between the paper that is in the printer and the paper the printer is configured to use.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Verify the tray is loaded with the correct paper type, and that the guides are adjusted correctly.
2. Verify the paper type and size settings on the control panel match the paper in the tray.
3. Verify the paper type and size settings in the print driver match the paper in the tray.
4. Use the Tray/Bin manual sensor test to verify the media switch in the cassette is working correctly.
5. Turn the printer off and then on.
6. If the issue persists, replace the DC controller.

41 . 03 . yz Unexpected size in tray <X>

The printer detected a different paper size than expected.

Y = Type, Z = Tray

- Y = 0 Size mismatch. Detected media is longer or shorter than expected.
- Y = A Size mismatch. Detected media too long.
- Y = B Size mismatch. Detected media too short.
- Y = C Size mismatch. Inter-page gap error.
- Z = D Source is the duplexer.
- Z = 1 Source is Tray 1.
- Z = 2 Source is Tray 2.
- Z = 3 Source is Tray 3.

Recommended action

1. Touch **OK** to use another tray.
2. Make sure that the tray is loaded with the correct paper size and that the sliding paper guides are correctly adjusted.
3. Use the **Tray/Bin** manual sensor test to verify that the cassette media switch is correctly functioning.
4. If the issue persists, elevate the case using the Standard Support Process.

42.XX.YY error messages

42 . xx . yy Error Event Log message

Internal system failure.

Recommended action

1. Turn the product off, then on, and then retry.
2. If the error persists, clear the firmware image from the active partition by using the **Partial Clean** item in the **Preboot** menu.

44.XX.XX error messages - X586 only

44.* errors

Errors in the 44.* family are related to the digital send functionality: fax, email, send to SharePoint, or save to folder.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. In many cases, the error will automatically clear, and you can try the job again.
2. Verify the digital send feature has been correctly configured at the control panel and with the HP Embedded Web Server (EWS).



NOTE: To access the EWS, open a Web browser, and in the address line, enter the printer IP address.

3. Turn the printer off, and then on. Retry the job.
4. For fax errors, verify the fax card is correctly installed on the formatter.
5. For SharePoint or save-to-folder errors, verify the permissions are set correctly for access to the SharePoint or network folder.
6. For email errors, verify connectivity to the network, and verify the SMTP gateway is configured correctly. Also verify if there is a size limit on email attachments.
7. If the error persists, reset the printer to factory settings, and then upgrade the firmware to the latest version.

For the latest firmware versions, Go to: [HP FutureSmart - Latest Firmware Versions](#)

44 . 01 . xx Error Event log message (*Multifunction product only*)

A digital send error has occurred.

Recommended action

- Try to send the job again.

44 . 02 . xx Error Event log message (*Multifunction product only*)

Personal address book error has occurred.

Recommended action

1. Try to send the job again.
2. Check the digital send configuration and address book.

44 . 03 . xx Error Event log message (*Multifunction product only*)

A digital send error has occurred.

Recommended action

1. Try to send the job again.
2. Check the digital send configuration.

44 . 04 . xx Error Event log message (*Multifunction product only*)

A Digital Send Email error has occurred.

Recommended action

1. Try to send the job again.
2. Check the digital send configuration.

44 . 05 . xx Error Event log message (*Multifunction product only*)

A Digital Send Folder Job error has occurred.

Recommended action

1. Try to send the job again.
2. Check the digital send configuration.

44 . 07 . xx Error Event log message (*Multifunction product only*)

Digital Send Remote Printer Job Error has occurred.

Recommended action

1. Try to send the job again.
2. Check the digital send configuration.

44 . 08 . xx Error Event log message (*Multifunction product only*)

SharePoint Job Error has occurred.

Recommended action

1. If this is the first time the error has occurred, cancel and then restart the job.
2. If the error occurs repeatedly, reboot the engine and retry the job.
3. If error still persists, reset to factory settings. Upgrade to most current firmware.

44 . 10 . xx Error Event log message (*Multifunction product only*)

A send to email error has occurred.

Recommended action

1. Try to send the job again.
2. Check the digital send configuration.

For more information, Go to: [Or click here: HP LaserJet Enterprise MFP - Set up Scan to Email.](#)

44 . 11 . xx Error Event log message (*Multifunction product only*)

A digital send error has occurred.

Recommended action

Try to send the job again.

Check the digital send configuration.

44 . 11 . 0E Error Event log message (*Multifunction product only*)

The attachment filename already exists at the destination, and the fail-on-filename-collisions flag was set. This file will not be sent.

Recommended action

1. If this is the first time the error has occurred, use a different filename or verify that the filename is not already in use.
2. If the issue persists, use a unique filename or disable the fail-on-filename-collisions flag.

44 . 12 . xx Error Event log message (*Multifunction product only*)

A digital send error has occurred.

Recommended action

1. Try to send the job again.
2. Check the digital send configuration.

44 . 12 . 0E Error Event log message (*Multifunction product only*)

A digital send error has occurred.

The attachment filename already exists at the destination, and the fail-on-filename-collisions flag is set. This file will not be sent.

Recommended action

1. If this is the first time the error has occurred, use a different filename or verify that the filename is not already in use.
2. If the issue persists, use a unique filename or disable the fail-on-filename-collisions flag.

44 . 16 . 01 Error Event log message (*Multifunction product only*)

A digital send error has occurred while trying to create file type.

XX =

- 01 - RTF File
- 03 - CSV File
- 04 - HTML File
- 05 - XML File
- 06 - XPS File
- 07 - PDF File

Recommended action

1. Try to send the job again.
2. Check the digital send configuration.

44 . 16 . 02 Error Event log message (*Multifunction product only*)

The destination URL was found to be invalid or unreachable.

Recommended action

1. If this is the first time the error has occurred, cancel and then restart the job.
2. If the error persists, turn the product off and then on and retry the job.
3. If the error still persists, reset to factory settings. Upgrade to the current firmware version.

44 . 16 . 03 Error Event log message (*Multifunction product only*)

The destination URL is not a SharePoint site.

Recommended action

1. If this is the first time the error has occurred, verify settings in job configuration and then restart the job.
2. If the error persists:
 - Check network connection settings.
 - Verify access to the SharePoint site.

44 . 16 . 04 Error Event log message (*Multifunction product only*)

Credentials associated with the SharePoint destination were found to be invalid or missing.

Recommended action

1. If this is the first time the error has occurred, verify settings in job configuration and then restart the job.
2. If the error persists:
 - Check network connection settings.
 - Verify access to the SharePoint site.

44 . 16 . 05 Error Event log message (*Multifunction product only*)

Credentials do not have write access to the SharePoint destination.

Recommended action

1. If this is the first time the error has occurred, verify settings in job configuration and then restart the job.

2. If the error persists:
 - Check network connection settings.
 - Verify access to the SharePoint site.

44 . 1 6 . 06 Error Event log message (*Multifunction product only*)

Upload of image file failed. Reason unknown.

Recommended action

1. If this is the first time the error has occurred, verify settings in job configuration and then restart the job.
2. If the error persists, turn the product off then on again and retry the job.
3. If the error still persists, reset to factory settings. Upgrade to the current firmware version.

44 . 1 6 . 07 Error Event log message (*Multifunction product only*)

Upload of image file failed.

The file exceeded the maximum form submission length on the Web server.

Recommended action

1. If this is the first time the error has occurred, send fewer pages in the job, lower the DPI of the scanned pages, or select a file type that splits pages into separate files (for example, jpeg).
2. If the error occurs repeatedly, contact the SharePoint site administrator to increase the Web server's maximum form submission length.

44 . 1 6 . 08 Error Event log message (*Multifunction product only*)

Upload of image file failed. The SharePoint site storage quota limit was exceeded.

Recommended action

1. If this is the first time the error has occurred, make space on the SharePoint site by deleting some files, and then retry the job.
2. If the error occurs repeatedly, contact the SharePoint site administrator to increase the storage quota limit.

44 . 1 6 . 09 Error Event log message (*Multifunction product only*)

Upload of image file failed. A folder or filename length is too long.

Recommended action

1. If this is the first time the error has occurred, check the destination URL and filename in the SharePoint job configuration to verify no folder or filename exceeds the maximum of 128 characters.
2. If the error occurs repeatedly, try sending to a different folder on the SharePoint site or changing the filename (which could include prefix or suffix).

44 . 16 . 0A Error Event log message (*Multifunction product only*)

Upload of the image file failed.

The image file already exists on the server and is checked out for editing by another user.

Recommended action

1. If this is the first time the error has occurred, verify that the filename used by the job is not checked out on the SharePoint site.
2. If the error persists, use a different filename for the job.

44 . 16 . 0B Error Event log message (*Multifunction product only*)

Upload of the image file failed.

The image file already exists on the server and the job was set to not overwrite files.

Recommended action

1. If this is the first time the error has occurred, set the job to overwrite existing files.
2. If the error persists, use a different filename for the job.

44 . 16 . 0D Error Event log message (*Multifunction product only*)

Encountered an unexpected processing error while transferring attachments to the destination SharePoint.

Recommended action

1. If this is the first time the error has occurred, verify settings in job configuration and restart the job.
2. If the error persists, turn the product off, and then on and retry the job.
3. If the error persists, reset to factory settings. Upgrade to the current firmware version.

44 . 16 . 0E Error Event log message (*Multifunction product only*)

The attachment filename already exists at the destination, and the fail-on-filename-collisions flag was set. This file will not be sent.

Recommended action

1. If this is the first time the error has occurred, use a different filename or verify that the filename is not already in use.
2. If the error persists, use a unique filename or disable the fail-on-filename-collisions flag.

44 . 16 . 0F Error Event log message (*Multifunction product only*)

Not enough memory to process the current SharePoint Job.

Recommended action

1. If this is the first time the error has occurred, cancel and/or restart the job, breaking it up into small jobs.
2. Repeat this process if the error persists until job goes through.

44 . 1 6 . 10 Error Event log message (*Multifunction product only*)

The SharePoint server is using an invalid certificate.

Recommended action

1. If this is the first time the error has occurred, send the SharePoint job to a non-secure address, or send the job to a SharePoint server that has a valid certificate.
2. If the error occurs repeatedly, send the job to a different, trusted SharePoint server.

44 . 1 6 . FF Error Event log message (*Multifunction product only*)

An unexpected error occurred in the SharePoint resource device code.

Recommended action

1. If this is the first time the error has occurred, verify settings in job configuration and restart the job.
2. If error persists, turn the product off, and then on and retry the job.
3. If the error persists, reset to factory settings. Upgrade to the current firmware version.

44 . 3 4 . xx Error Event log message (*Multifunction product only*)

A fax error has occurred.

Recommended action

1. Try to send the job again.
2. Check the fax configuration

44 . 9 0 . xx, 44 . 9 1 . xx, 44 . 9 2 . xx Error Event log message (*Multifunction product only*)

A fax error has occurred.

Recommended action

1. Try to send the job again.
2. Check the fax configuration.

45.WX.YZ error messages

45 . 0 0 . YZ

OXPd/Webkit message

Event log entry only

All 45.00.YZ events are OXPd/Webkit informational log entries.

Recommended action

- No action necessary.

47.XX.XX error messages

47.* errors

Errors in the 47.* family indicate an internal error has occurred.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.00.xx

Back channel internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.01.xx

Image transformer internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the **Format Disk** item in the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.02.xx

Job parser internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.

2. Resend the print job.
3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.03.xx

Print job internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.04.xx

Print spooler 9100 internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.

3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.05.xx

Print spooler framework internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.06.xx

Print application internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.

3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47 . FC . yz Printer Calibration Failed To continue, touch "OK"

The device is unable to access or implement one of the image patterns files.

y = Calibration type, z = Event

- 47.FC.00 (event code) Color plane registration (CPR) Image not found at system initialization
- 47.FC.01 (event code) CPR Store Image failure
- 47.FC.02 (event code) CPR Image not found
- 47.FC.03 (event code) CPR Print engine execution failure
- 47.FC.10 (event code) Consecutive Dmax Dhalf Image not found at system initialization
- 47.FC.11 (event code) Consecutive Dmax Dhalf Store image failure
- 47.FC.12 (event code) Consecutive Dmax Dhalf Image not found
- 47.FC.13 (event code) Consecutive Dmax Dhalf Print engine execution failure
- 47.FC.20 (event code) Error Diffusion Image not found at system initialization
- 47.FC.21 (event code) Error Diffusion Store image failure
- 47.FC.22 (event code) Error Diffusion Image not found
- 47.FC.23 Error Diffusion Print engine execution failure
- 47.FC.30 0 (event code) Drum Speed Adjustment Image not found at system initialization
- 47.FC.31 (event code) Drum Speed Adjustment Store image failure
- 47.FC.32 (event code) Drum Speed Adjustment Image not found
- 47.FC.33 (event code) Drum Speed Adjustment Print engine execution failure
- 47.FC.40 (event code) Pulse Width Modulation Image not found at system initialization
- 47.FC.41 (event code) Pulse Width Modulation Store image failure
- 47.FC.42 (event code) Pulse Width Modulation Image not found
- 47.FC.43 (event code) Pulse Width Modulation Print engine execution failure

Recommended action for customers

1. Turn the product off, and then on again.
2. If the error persists, reload the firmware.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the product off, and then on again.
2. If the error persists over multiple power cycles, then do the following.
 - In the [Support Tools/Troubleshooting/Diagnostics](#) menu, run the hard disk tests to validate the health of the device. Fix any issue found with the mass storage device.
3. If the error persists, reload the firmware.
4. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the procedure to perform a Format Disk procedure, go to: [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#) (c03398779).

48.XX.YY error messages

48 . xx . yy

A job framework internal error has occurred.

Recommended action

1. No action should be necessary.
2. If the error persists, upgrade the product firmware.
3. If the issue persists, continue troubleshooting with the flowcharts for either Intermittent or Persistent 49 error troubleshooting (whichever is appropriate) in document c03122817, "HP LaserJet FutureSmart Devices - 49 Error Troubleshooting (Persistent and Intermittent)".

49.XX.YY error messages

49 . xx . yy Error To continue turn off then on

A firmware error occurred.

Possible causes:

- Corrupted print jobs
- Software application issues
- Non-product specific print drivers
- Poor quality USB or network cables
- Bad network connections or incorrect configurations
- Invalid firmware operations
- Unsupported accessories

A 49 error might happen at any time for multiple reasons. Although some types of 49 errors can be caused by hardware failures, it is more common for 49 errors to be caused by printing a specific document or performing some task on the printer.

49 errors most often occur when a printer is asked to perform an action that the printer firmware is not capable of and might not have been designed to comply with, such as:

- Printing files with unsupported programming commands
- A unique combination of user environment and user interactions with the printer
- Interfacing with a third-party solution that was not designed to work with the printer
- Specific timing, network traffic, or concurrent processing of jobs

Recommended action for customers



NOTE: LaserJet formatter PCAs are rarely the root cause of 49 service errors. Please do not replace the formatter unless troubleshooting has identified the formatter as the root cause.

1. Turn the printer off, and then on.
2. If the error persists, check the following:
 - The error might be caused by a network connectivity problem, such as a bad USB or network interface cable, a bad USB port, or an invalid network configuration setting.
 - The error might be caused by the print job, due to an invalid print driver, a problem with the software application, or a problem with the file being printed.
 - Upgrading the printer firmware might help resolve the error.

For the latest firmware versions, Go to: [HP FutureSmart - Latest Firmware Versions](#)
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians



NOTE: LaserJet formatter PCAs are rarely the root cause of 49 service errors. Please do not replace the formatter unless troubleshooting has identified the formatter as the root cause.

1. Turn the printer off, and then on.
2. If the error persists, check the following:
 - The error might be caused by a network connectivity problem, such as a bad interface cable, a bad USB port, or an invalid network configuration setting.
 - The error might be caused by the print job, due to an invalid print driver, a problem with the software application, or a problem with the file being printed.
 - Upgrading the printer firmware might help resolve the error.
3. If the error persists, continue troubleshooting with the flowcharts for either Intermittent or Persistent 49 error troubleshooting (whichever is appropriate) in document c03122817:

[HP LaserJet FutureSmart Devices - 49 Error Troubleshooting \(Persistent and Intermittent\)](#)

54.XX.YZ error messages

54.* errors

Errors in the 54.* family are related to the image-formation system.

- For HP LaserJet printers, they can indicate a problem with the toner cartridges or the transfer unit (color printers only), or they can indicate a problem with a sensor, such as with the laser/scanner.
- For HP PageWide printers, they can indicate a problem with the calibration process.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off and then unplug the power cord. Wait for at least 30 seconds, then reconnect the power cord and turn the printer on.
2. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agent and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off and then unplug the power cord. Wait for at least 30 seconds, then reconnect the power cord and turn the printer on.
2. Turn the printer off, and check all the connections on the formatter. Reseat them if necessary.

54.30.00 Calibration error

An engine calibration has failed.

Details of which calibration and failure reason can be found in the payload.

610000AC Sensor_Cms_Calibrate_Unknown_Sensor: Tried to start a page calibration scan with an unknown sensor ID. Only Zim and BDD sensors are recognized.

610000AD Sensor_Cms_Calibrate_Invalid_Sensor: A sensor other than Zim was specified for the pen calibration scan.

610000AE Sensor_Cms_Calibrate_Overshoot: The paper advanced too far during a page calibration such that the printed artifact could not be scanned. This error could happen if the mechanism wasn't able to stop the paper movement accurately.

Recommended action

1. Turn the power off on the product by pressing the power button and holding it for more than 3 seconds.
2. Unplug power cord from back of product and wait 30 seconds.
3. Reconnect the power cord.
4. Turn the product on.

5. If the error condition is cleared then the issue is resolved, if not continue to step 6.
6. Repeat steps 1 & 2.
7. Remove the formatter, check formatter thoroughly for any loose connections and reseal them, then reinstall the formatter.
8. Repeat steps 3 & 4.
9. If the issue persists, elevate the case using the Standard Support Process.



NOTE: It is critical to either print the event log after power cycle clears issue, or access the event log through EWS and capture the 8 character fail code value corresponding to the 61.00.0X and log it into the case. Look for the last 61.00.0X error that occurred which also has the 8 character value under the text description. This value is critical in HP understanding the failure and debugging potential field issues.

58.XX error messages

58.* errors

Errors in the 58.* family indicate an electrical problem inside the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off and then disconnect the power cord. Wait at least 30 seconds, and then reconnect the power cord and turn the printer on.
2. Make sure the printer is connected to a dedicated power outlet and not to a surge protector or other type of extension cord.
3. Check all connections on the formatter and reseal them if necessary.

58.10.02 Ink Sensor Failure

SHAID PCA electrical failure.

Recommended action

1. Turn the power off on the product by pressing the power button and holding it for more than 3 seconds.
2. Unplug power cord from back of product and wait 30 seconds.
3. Reconnect the power cord.

4. Turn the product on.
5. If the error condition is cleared then the issue is resolved, if not continue to step 6.
6. Repeat steps 1 & 2.
7. Remove the formatter, check formatter thoroughly for any loose connections and reseal them, then reinstall the formatter.
8. Repeat steps 3 & 4.
9. If the issue persists, elevate the case using the Standard Support Process.

61.00.0X Error Messages

61 .wx .yz

Errors in the 61.* family indicate a problem with the print engine.

Recommended action

 **IMPORTANT:** Print the event log **OR** access the event log through the EWS. Under the **Description or Personality** field, look for the 8 character fail code values corresponding to any 61 errors **and log them into the case notes**. These values are critical in helping the division understand the failure and in debugging potential field issues.

1. For steps to resolve Pagewide 61.xx errors, go to: [Fixing 61.XX.XX Errors](#).

2. Log into the case notes any 8 digit codes in the **Description or Personality** column for any 61 errors.

HP PageWide Color Flow MFP 586

HP Officejet Color Flow MFP X585 18.08.138.9

Welcome Sign In

Information

- Device Status
- Configuration Page
- Supplies Status Page
- Event Log Page**
- Usage Page
- Device Information
- Control Panel Snapshot
- Print

Other Links

- HP Instant Support
- Shop for Supplies
- Product Support

Event Log Page

Device Information

Device Serial Number: CN3C24Y0F4

Number	Date and Time	Cycles	Event	Firmware	Description or Personality	Consecutive Repeats
50	7/22/2014 12:16:20 PM	2901	17.03.70	2302787_433743	Printing past very low	0
49	7/21/2014 4:08:01 PM	2897	17.99.32	2302787_433743	Previously used HP supply installed	0
48	7/21/2014 4:08:00 PM	2897	17.03.60	2302787_433743	Yellow Cartridge low	0
47	7/21/2014 4:03:06 PM	2898	61.00.02	2302787_433743	General engine failure 02AA1DDE	0
46	7/21/2014 4:03:05 PM	2898	61.00.00	2302787_433743	Connection between formatter and engine lost	0
45	7/21/2014 1:51:18 PM	2894	17.99.32	2302787_433743	Previously used HP supply installed	0
44	7/21/2014 11:08:25 AM	2895	61.00.02	2302787_433743	General engine failure 02AA1DDE	0
43	7/21/2014 11:08:25 AM	2895	61.00.00	2302787_433743	Connection between formatter and engine lost	0
42	7/21/2014 10:59:23 AM	2893	17.99.32	2302787_433743	Previously used HP supply installed	0
41	7/21/2014 10:57:48 AM	2891	17.99.32	2302787_433743	Previously used HP supply installed	0
40	7/21/2014 10:13:23 AM	2891	17.99.40	2302787_433743	Genuine HP supplies installed	0
39	7/21/2014 10:13:23 AM	2891	17.03.65	2302787_433743	Yellow Cartridge low	0
38	7/18/2014 4:12:40 PM	2892	61.00.02	2302787_433743	General engine failure 02AA1DDE	0
37	7/18/2014 4:12:39 PM	2892	61.00.00	2302787_433743	Connection between formatter and engine lost	0
36	7/18/2014 4:05:22 PM	2889	17.99.32	2302787_433743	Previously used HP supply installed	0
35	7/18/2014 4:02:41 PM	2891	61.00.02	2302787_433743	General engine failure 02AA1DDE	0
34	7/18/2014 4:02:41 PM	2891	61.00.00	2302787_433743	Connection between formatter and engine lost	0
33	7/8/2014 9:51:14 AM	2720	17.99.32	2302787_433743	Previously used HP supply installed	0
32	7/8/2014 9:51:14 AM	2720	17.03.60	2302787_433743	Yellow Cartridge low	0

2720	17.03.60	2302787_433743	Yellow Cartridge low
2720	61.00.02	2302787_433743	General engine failure 02AA1DDE
2720	61.00.00	2302787_433743	Connection between formatter and engine lost
2632	17.03.65	2302787_433743	Install Supply
2344	31.13.01	2302787_433743	Original document mispick
1998	17.31.65	2302787_433743	Install Supply
1962	61.00.02	2302787_433743	General engine failure C8FD0002

3. Always collect the following information when escalating a case:
 - a. Event Log, and if the 8 digit payload data is available, please log that in case.
 - b. 8 digit payload data (if available).
 - c. Diagnostic Log:
 - i. Administration > Troubleshooting > Generate debug data
 - ii. Insert USB thumb drive
 - iii. Administration > Troubleshooting > Retrieve diagnostic data > Save to USB

61.00.00 Print Engine Error

The print engine and formatter have lost communication with each other.

Recommended action for customer


To view solutions when a 61 error displays on the control panel, go to the document [HP Officejet Enterprise, HP Officejet Managed - 61.00.0x Errors](#).

1. Turn the printer off, and then hold the power button for three seconds when you turn the printer on.
2. If the error persists, turn the printer power off. Disconnect the printer from the network and telephone line (fax).
3. Turn the printer on.
 - If the error does not persist (unit boots to READY), plug in a telephone line and test the fax.
 - If error is not present with the fax/phone line, plug in the network cable and test.



NOTE: If the error persists when either cable is plugged in, try performing the following tasks to troubleshoot the issue:

- New or different cable.
- New or different telephone and network ports.
- Clear Print Queue.
- Check/disable bidirectional support in driver.

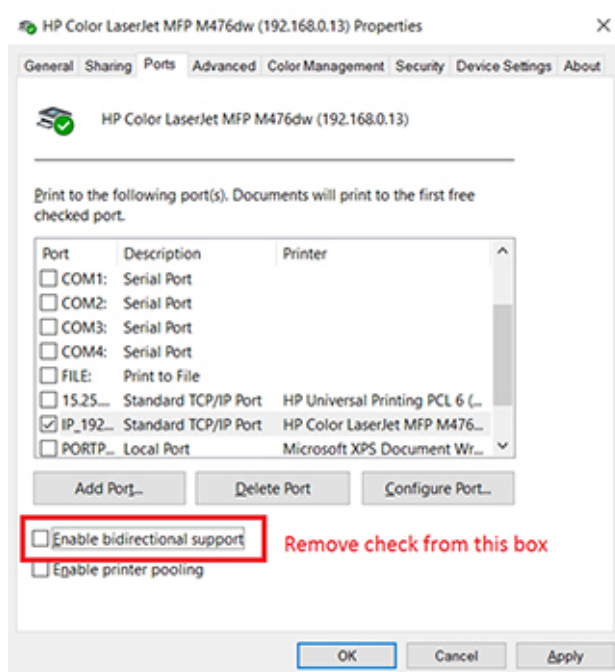

4. Update the printer firmware that matches the FutureSmart version on the printer.

A workaround has been included to address intermittent 61.00.00 errors.

- Firmware FutureSmart 3: Update the printer firmware to FutureSmart Bundle version 3.9.6 or newer.
- Firmware FutureSmart 4: Update the printer firmware to FutureSmart Bundle version 4.9.1 or newer.

For instructions on updating the printer firmware, go to the following document - [Update the firmware](#)

⚠ WARNING! The user interface on the control panel will change if the printer firmware is modified from FutureSmart 3 to FutureSmart 4 or FutureSmart 5.

5. If the error still occurs after updating the printer firmware, note the following information, and then contact HP Support.

Information required before contacting HP Support:

- Full Error code and/or Event Log
- LED Color of the Formatter Connection LED and Heartbeat LED (blinking green or solid red light, for example.) located usually on the back of the printer.



Recommended action for call-center agent


To view solutions when a 61 error displays on the control panel, go to: [HP OfficeJet Enterprise, HP OfficeJet Managed -61.00.0x Errors](#)

1. Turn the printer off, and then hold the power button for three seconds when you turn the printer on.
2. If the error persists, turn the printer power off. Disconnect the printer from the network cable and telephone line (fax).
3. Turn the printer on.

Depending if the error persists or does not display on the control panel, perform the following tasks:

- If the **error does not persist** and the printer control panel is in "Ready" mode, do the following:

- Plug in a telephone line and test the fax.
- If the error is not present with the fax/phone line, plug in the network cable and test.
- If the **error persists**, when either cable is plugged in, try performing the following tasks to troubleshoot the issue:
 - Use a new or different cable.
 - Connect the cable to a new or a different telephone and network ports.
 - Clear the Print Queue.
 - Clear the **Enable bidirectional support** check box to disable the bidirectional support in the driver.

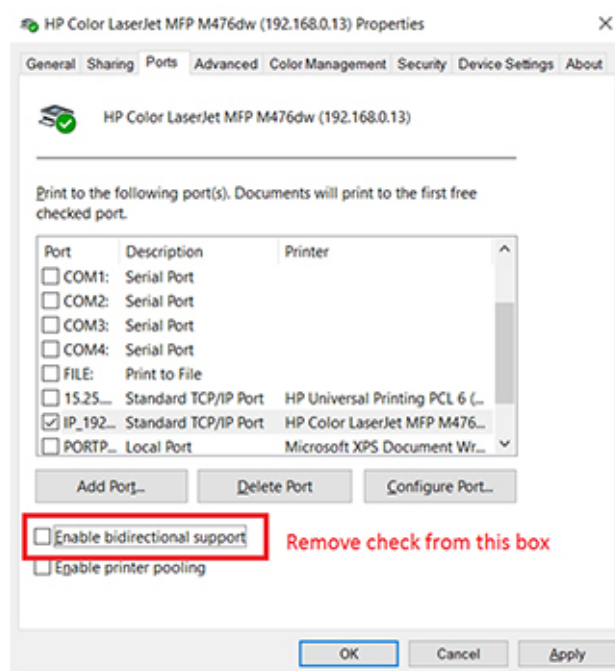

4. Update the printer firmware that matches the FutureSmart version on the printer.

A workaround has been included to address intermittent 61.00.00 errors.

- Firmware FutureSmart 3: Update the printer firmware to FutureSmart Bundle version 3.9.6 or newer.
- Firmware FutureSmart 4: Update the printer firmware to FutureSmart Bundle version 4.9.1 or newer.

For instructions on updating the printer firmware , go to the following document - [Update the firmware](#)

For instructions on accessing the Preboot menu, go to the following document - [Preboot menu options](#)

⚠ WARNING! The user interface on the control panel will change if the printer firmware is modified from FutureSmart 3 to FutureSmart 4 or FutureSmart 5.

5. If the error still occurs after updating the printer firmware , provide instructions to the customer to check the heartbeat LED on the formatter located usually on the back of the printer.



- If the formatter connection LED is **red**, send the formatter and the power supply with the onsite technician.

Table 6-9 Parts

HP Part Number	Description
G1W46-67911	Formatter (main logic) PC board assembly - For 556 models only
G1W39-67914	Formatter (main logic) PC board assembly - For 586 models only
G1W39-67912	Power supply for 110v and 220v

- If the formatter connection LED is **green**, see the next step. **Do not send the formatter.**
 - Indication of a solid green LED : Still in Preboot process, but is communicating.
 - Indication of a flashing Hearbeat LED: Formatter OS/FW is loaded and OK.

 **NOTE:** Before dispatching parts to the technician, make sure to collect the following information:

- Event Log from the HP EWS.
- Capture any other 61.00.XX errors listed, specifically 61.00.01, 61.00.02, 61.00.03.

Refer to the CPMD for troubleshooting these other errors. These errors will be accompanied with an 8-digit payload data code.

6. If the error persists and all troubleshooting has tested good, the connector on tray 3 might be damaged and causing damage to the power supply.

Dispatch a onsite technician with the following parts and add instructions for them to follow the troubleshooting for the onsite technician.

Tray 3 interconnect PCA: D3Q19-67003

Part number: G1W39-67956

Recommended action for onsite service technicians

View the following video to fix 61.XX.XX errors:



[Fixing 61.XX.XX Errors on HP PageWide Enterprise Printers](#)

If Tray 3 is installed, the following video demonstrates how to fix 3x500 tray errors: [Fixing 3x500 Tray Errors on HP PageWide Enterprise Printers](#)

1. Turn the printer off, and then hold the power button for three seconds when you turn the printer on.
2. Update the printer firmware that matches the FutureSmart version on the printer.

A workaround has been included to address intermittent 61.00.00 errors.

- Firmware FutureSmart 3: Update the printer firmware to FutureSmart Bundle version 3.9.6 or newer.
- Firmware FutureSmart 4: Update the printer firmware to FutureSmart Bundle version 4.9.1 or newer.


For instructions on updating the printer firmware, go to the following document - [Update the firmware](#)

For instructions on accessing the Preboot menu, go to the following document - [Preboot menu options](#)

 **WARNING!** The user interface on the control panel will change if the printer firmware is modified from FutureSmart 3 to FutureSmart 4 or FutureSmart 5.

3. If the error persists when a tray 3 accessory is installed, the connector on tray 3 might be damaged and causing damage to the power supply.
 - a. Turn the printer off.
 - b. Remove the Tray 3 accessory from the printer.
 - c. Turn the printer on.
 - d. If the error is not present, replace the tray 3 interconnect PCA.
Tray 3 interconnect PCA: D3Q19-67003
 - e. Reinstall the tray 3 accessory.
 - f. If the error persists, replace the Tray 3 accessory.
Part number: G1W39-67956
4. If the error persists when a Fax accessory is installed, turn the printer off, remove the fax card, and then turn the printer on.
 - a. If the error is not present, turn the printer off, reinstall the fax card, and then turn the printer on.
If the error persists, replace the fax card.
 - b. If the error does not go away with the fax card removed, reinstall the fax card and see the next step.

5. If the error still persists, check the formatter heartbeat LED. If the LED is **red**, troubleshoot the formatter.
 - a. Turn the printer off.
 - b. Remove the formatter, and then reseal the formatter.
 - c. Turn the printer on.
6. If the issue persists, inspect the formatter board contacts for contamination or damage.
 - a. Turn the printer off.
 - b. Remove the formatter cover from the printer.
 - c. Inspect the connections as highlighted in the image.

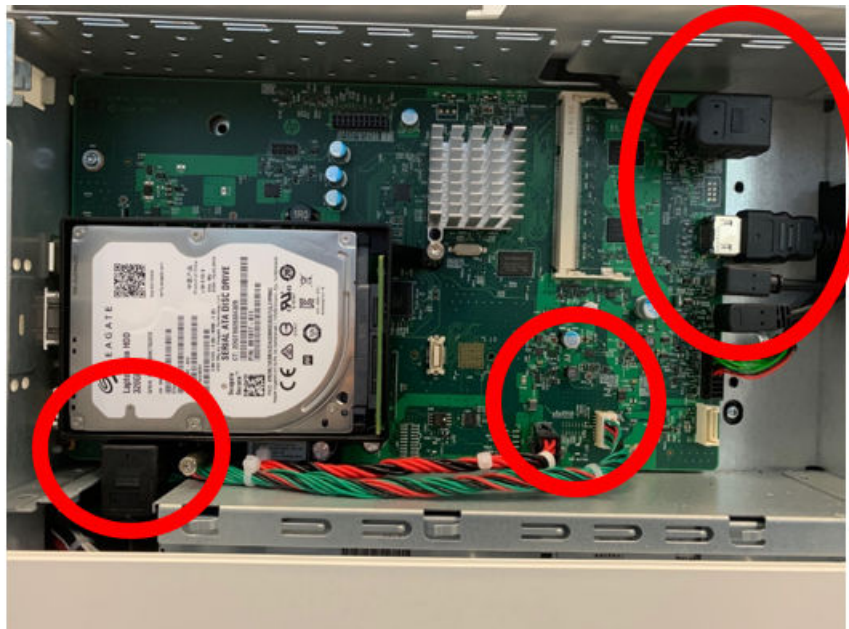

- d. Inspect the contacts for contamination or damage.
Clean the contacts with a damp, lint free cloth. Ensure the contacts are completely dry before reinstalling and retesting.
 - e. Reconnect all cables at the right side of the formatter board and at the bottom side.
7. If the contacts are damaged, replace the formatter board.

For instructions, go to [Removal and replacement: Formatter](#).

Formatter Part numbers:


Table 6-10 Parts

HP Part Number	Description
G1W46-67911	Formatter (main logic) PC board assembly - For 556 models only.
G1W46-67912	For China 556 models only -Formatter (main logic) PC board assembly.

Table 6-10 Parts (continued)

HP Part Number	Description
G1W39-67914	Formatter (main logic) PC board assembly - For 586 models only.
G1W39-67939	For China 586 models only - Formatter (main logic) PC board assembly.

8. Remove the back cover of the printer, and then verify that the green LED located on the Engine Controller Board (ECB) is blinking and the orange LEDs are on.

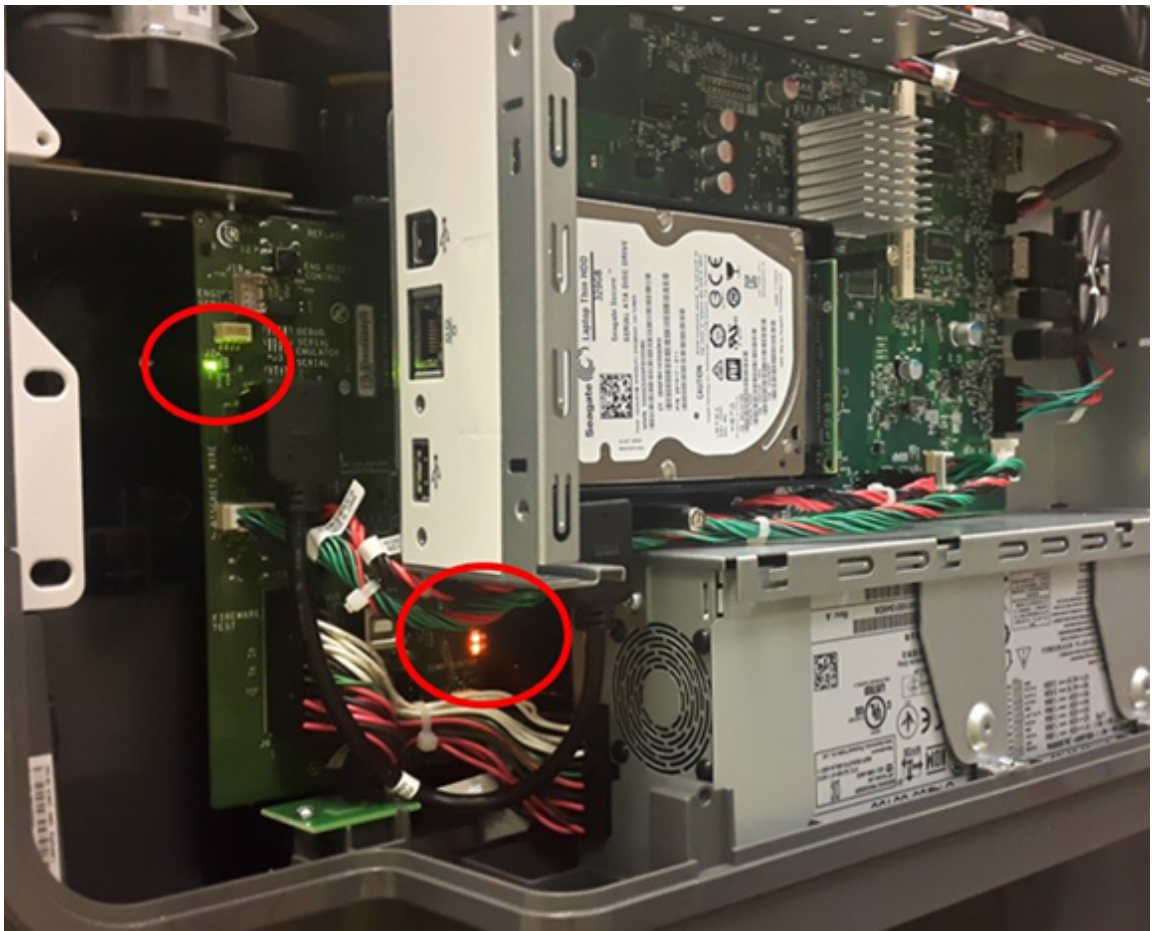

9. If the LED is off or does not illuminate, perform the following tasks to check the power supply is correctly seated and not damaged:
 - a. Check that the cable between the ECB and power supply is correctly seated.
 - b. If Tray 3 or additional trays are installed, make sure that Tray 3 is properly connected and aligned with the printer.

The connector on Tray 3 might be damaged and causing damage to the power supply.
10. If the error persists, replace the power supply.

For instructions, go to [Removal and replacement: Power supply](#).

Part number: G1W39-67912








11. If the error persists, elevate the case using the Standard Support Process.



NOTE: Before elevating the case (for additional technical advice, or WUR approval), collect the following information and capture it in the case notes:

- Full error code.
- Copy of the Event Log from the HP EWS preferred, so the 8-digit Payload code can be obtained.
- Capture any other 61.00.XX errors and corresponding 8-digit Payload codes.
- Note if this is a new unit/WUR, or if occurring after previous service.
- Full list of troubleshooting steps performed and their results.
- Gather Triage Logs in the Preboot Menu.

The below image illustrates how to obtain triage logs from HP PageWide Enterprise units:

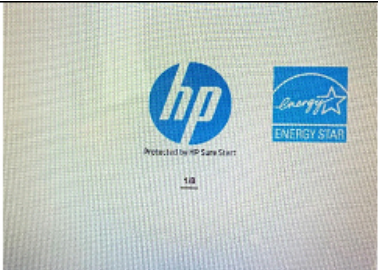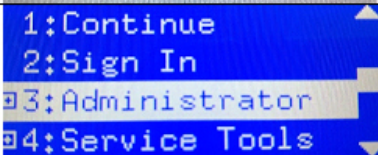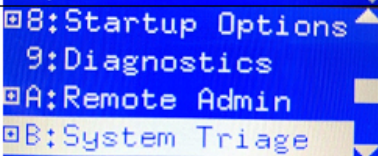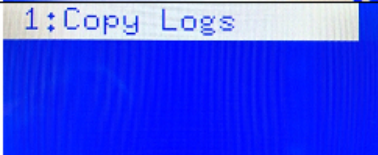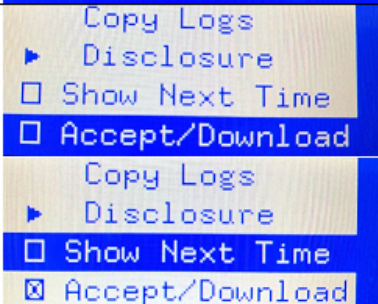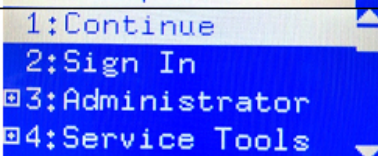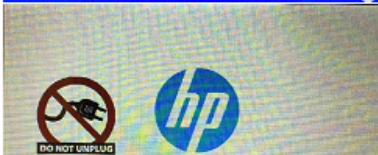1. Turn the printer ON. 2. Press the HP logo in the middle of the screen when you see a line under the "1/8" text.	
3. Once in the preboot menu, select Administrator.	
4. Scroll down to B. System Triage.	
5. Select Copy Logs	
6. Scroll to Accept/Download 7. Check it.	
8. Insert an USB stick (FAT 32 or exFAT) in the front or rear USB port. 9. Go back to home menu and select Continue. 10. Unit will check for USB and will start exporting the logs.	
11. Once done, reboot the unit.	

61.00.01, 61.00.02, and 61.00.03

A generic engine error has occurred.

- 61.00.01 - Print Engine Error
- 61.00.02 - Print Engine Error
- 61.00.03 - Print Head Error

Recommended action for customer

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Call-center agent recommended action

1. Turn the power off then on by pressing the power button and holding it in for more than 3 seconds.
2. Turn the power back on using power button.
3. If needed, dispatch a service technician to perform maintenance.

Recommended action for onsite technicians

1. Turn off the printer by pressing the Power button and holding it in for more than 3 seconds.
2. Press the Power button to turn the printer back on.
3. If the error persists, repeat steps 1 and 2.
4. For more troubleshooting steps, go to: [Fixing 61.XX.XX Errors](#).



NOTE: If Tray 3 is installed, use the following link: [Fixing 3x500 Tray 61.XX Errors](#).

5. If the error persists, check the installed firmware version and update the printer firmware as needed.



NOTE: Even with the printer in an error condition, you can still navigate the menus and install a new FW version.

6. If the issue persists, check the formatter board contacts:
 - a. Remove the formatter board from the printer.

- b. Inspect the contacts for contamination or damage.

Figure 6-57 Location of contacts on removed formatter



- c. Clean the contacts with a damp, lint free cloth. Ensure the contacts are completely dry before reinstalling and retesting.
- d. If the contacts are damaged, replace the formatter board.

Formatter PCA (556) part number: G1W46-67911

For instructions: See the Repair Service Manual for this product.

Formatter PCA (586) part number: G1W39-67914

For instructions: See the Repair Service Manual for this product.

Formatter PCA (556) China only part number: G1W46-67912

For instructions: See the Repair Service Manual for this product.

Formatter PCA (586) China only part number: G1W39-67939

For instructions: See the Repair Service Manual for this product.

- 7. If the error persists, elevate the case.

IMPORTANT: Print the event log OR access the event log through the EWS. Under the Description or Personality field, look for the 8 character fail code values corresponding to any 61.00.OX errors and log them into the case notes. These values are critical in helping the division understand the failure and in debugging potential field issues.

Information

Device Status
Configuration Page
Supplies Status Page
Event Log Page
Usage Page
Device Information
Control Panel Snapshot
Print

Other Links

HP Instant Support
Shop for Supplies
Product Support

Event Log Page

Device Information

Device Serial Number:

CN3C24Y0F4

Number	Date and Time	Cycles	Event	Firmware	Description or Personality	Consecutive Repeats
58	7/22/2014 12:16:26 PM	2901	17.03.70	2302787_433743	Printing past very low	0
49	7/21/2014 4:08:01 PM	2897	17.99.32	2302787_433743	Previously used HP supply installed	0
48	7/21/2014 4:08:00 PM	2897	17.03.60	2302787_433743	Yellow Cartridge low	0
47	7/21/2014 4:03:06 PM	2896	61.00.02	2302787_433743	General engine failure 02AA10DE	0
46	7/21/2014 4:03:05 PM	2896	61.00.00	2302787_433743	Connection between formatter and engine lost	0
45	7/21/2014 1:51:18 PM	2894	17.99.32	2302787_433743	Previously used HP supply installed	0
44	7/21/2014 11:08:25 AM	2895	61.00.02	2302787_433743	General engine failure 02AA10DE	0
43	7/21/2014 11:08:25 AM	2895	61.00.00	2302787_433743	Connection between formatter and engine lost	0
42	7/21/2014 10:59:23 AM	2893	17.99.32	2302787_433743	Previously used HP supply installed	0
41	7/21/2014 10:57:46 AM	2891	17.99.32	2302787_433743	Previously used HP supply installed	0
40	7/21/2014 10:13:23 AM	2891	17.99.40	2302787_433743	Genuine HP supplies installed	0
39	7/21/2014 10:13:23 AM	2891	17.03.65	2302787_433743	Yellow Cartridge low	0
38	7/18/2014 4:12:40 PM	2892	61.00.02	2302787_433743	General engine failure 02AA10DE	0
37	7/18/2014 4:12:39 PM	2892	61.00.00	2302787_433743	Connection between formatter and engine lost	0
36	7/18/2014 4:05:22 PM	2889	17.99.32	2302787_433743	Previously used HP supply installed	0
35	7/18/2014 4:02:41 PM	2891	61.00.02	2302787_433743	General engine failure 02AA10DE	0
34	7/18/2014 4:02:41 PM	2891	61.00.00	2302787_433743	Connection between formatter and engine lost	0
33	7/18/2014 9:51:14 AM	2720	17.99.32	2302787_433743	Previously used HP supply installed	0
32	7/18/2014 9:51:14 AM	2720	17.03.60	2302787_433743	Yellow Cartridge low	0

2720	17.03.60	2302787_433743	Yellow Cartridge low
2720	61.00.02	2302787_433743	General engine failure 02AA10DE
2720	61.00.00	2302787_433743	Connection between formatter and engine lost
2632	17.03.65	2302787_433743	Install Supply
2344	31.13.01	2302787_433743	Original document mispick
1998	17.31.65	2302787_433743	Install Supply
1982	61.00.02	2302787_433743	General engine failure C8FD0002



NOTE: There is additional error code information available from the Event Log of the device. The Event Log error description field will often contain additional failure data (8-digit payload data). When possible, collect this additional 8-digit number using the Embedded Web Server (EWS) and include it with the Service Repair document details. These codes will provide further detail about the cause of the error.

In all cases this 8-byte code should be included with all correspondence related to this service call. The information below provides more detail on several of the Secondary Error codes that can be used to help diagnose the issue and determine the proper resolution steps.

Table 6-11 Event Log error : 8-digit payload data

8-Digit Payload Data	Description	Action
6100000C 6100000D 6100000E	Service station error has occurred, physical blockage might be present	If no physical obstruction is seen, elevate the case.
61000011	Service station restricted movement	If no physical obstruction is seen, elevate the case.
61000012	Print bar assembly blocked	If no physical obstruction is seen, elevate the case.
61000013	Carriage motion blocked	If no physical obstruction is seen, elevate the case.
61000035	Print bar clutch slipping	Reboot. If the error persists, elevate the case.
6100004E	Print bar already purged	Elevate the case.
610000Cx	Service wipe issue (various)	Reboot. If the error persists, elevate the case.
610000D3	Print bar crash with Service Station	Reboot. If the error persists, elevate the case.
610000D4	Service Station under print bar	Reboot. If the error persists, elevate the case.
012xxxxx	Possible print data corruption delivered to print bar	Reboot. If the error persists, reseal the formatter and check connections.
007xxxxx	Device processing took too long	Reboot. If the error persists, elevate the case.
Bxxxxxxx	Firmware invalid memory access	Reboot. If the error persists, reseal the formatter and check connections.
C4xxxxxx	System interconnection issue with Tray 3	Turn off power, check both engine and tray connectors. Reseat Tray 3 and ensure alignment. Reboot. If the error persists, replace Tray 3. If the error persists after replacing Tray 3, elevate the case.
C6xxxxxx C8xxxxxx	Print bar malfunction	Elevate the case.

61.00.04, 61.00.05

The print head has detected a very cold temperature and is unable to operate until the temperature warms up.

The product may have been in a cold environment and now needs additional time to adjust before it can operate normally.

- **61.00.04** Temperature less than 5 degrees Celsius
- **61.00.05** Temperature is 5 to 10 degrees Celsius

Recommended action for customer

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Call-center agent recommended action

1. Turn the power off then on by pressing the power button and holding it in for more than 3 seconds.
2. Turn the power back on using power button.
3. If needed, dispatch a service technician to perform maintenance.

Recommended action for onsite technicians

1. Turn off the printer by pressing the Power button and holding it in for more than 3 seconds.
2. Press the Power button to turn the printer back on.
3. If the error persists, repeat steps 1 and 2.
4. For more troubleshooting steps, go to: [Fixing 61.XX.XX Errors](#).



NOTE: If Tray 3 is installed, use the following link: [Fixing 3x500 Tray 61.XX Errors](#).

5. If the error persists, check the installed firmware version and update the printer firmware as needed.



NOTE: Even with the printer in an error condition, you can still navigate the menus and install a new FW version.

6. If the issue persists, check the formatter board contacts:
 - a. Remove the formatter board from the printer.

- b. Inspect the contacts for contamination or damage.

Figure 6-58 Location of contacts on removed formatter



- c. Clean the contacts with a damp, lint free cloth. Ensure the contacts are completely dry before reinstalling and retesting.
- d. If the contacts are damaged, replace the formatter board.

Formatter PCA (556) part number: G1W46-67911

For instructions: See the Repair Service Manual for this product.

Formatter PCA (586) part number: G1W39-67914

For instructions: See the Repair Service Manual for this product.

Formatter PCA (556) China only part number: G1W46-67912

For instructions: See the Repair Service Manual for this product.

Formatter PCA (586) China only part number: G1W39-67939

For instructions: See the Repair Service Manual for this product.

- 7. If the error persists, elevate the case.

IMPORTANT: Print the event log OR access the event log through the EWS. Under the Description or Personality field, look for the 8 character fail code values corresponding to any 61.00.OX errors and log them into the case notes. These values are critical in helping the division understand the failure and in debugging potential field issues.

Information

Device Status
Configuration Page
Supplies Status Page
Event Log Page
Usage Page
Device Information
Control Panel Snapshot
Print

Other Links

HP Instant Support
Shop for Supplies
Product Support

Event Log Page

Device Information

Device Serial Number:

CN3C24Y0F4

Number	Date and Time	Cycles	Event	Firmware	Description or Personality	Consecutive Repeats
58	7/22/2014 12:16:26 PM	2901	17.03.70	2302787_433743	Printing past very low	0
49	7/21/2014 4:08:01 PM	2897	17.99.32	2302787_433743	Previously used HP supply installed	0
48	7/21/2014 4:08:00 PM	2897	17.03.60	2302787_433743	Yellow Cartridge low	0
47	7/21/2014 4:03:06 PM	2896	61.00.02	2302787_433743	General engine failure 02AA1DDE	0
46	7/21/2014 4:03:05 PM	2896	61.00.00	2302787_433743	Connection between formatter and engine lost	0
45	7/21/2014 1:51:18 PM	2894	17.99.32	2302787_433743	Previously used HP supply installed	0
44	7/21/2014 11:08:25 AM	2895	61.00.02	2302787_433743	General engine failure 02AA1DDE	0
43	7/21/2014 11:08:25 AM	2895	61.00.00	2302787_433743	Connection between formatter and engine lost	0
42	7/21/2014 10:59:23 AM	2893	17.99.32	2302787_433743	Previously used HP supply installed	0
41	7/21/2014 10:57:46 AM	2891	17.99.32	2302787_433743	Previously used HP supply installed	0
40	7/21/2014 10:13:23 AM	2891	17.99.40	2302787_433743	Genuine HP supplies installed	0
39	7/21/2014 10:13:23 AM	2891	17.03.65	2302787_433743	Yellow Cartridge low	0
38	7/18/2014 4:12:40 PM	2892	61.00.02	2302787_433743	General engine failure 02AA1DDE	0
37	7/18/2014 4:12:39 PM	2892	61.00.00	2302787_433743	Connection between formatter and engine lost	0
36	7/18/2014 4:05:22 PM	2889	17.99.32	2302787_433743	Previously used HP supply installed	0
35	7/18/2014 4:02:41 PM	2891	61.00.02	2302787_433743	General engine failure 02AA1DDE	0
34	7/18/2014 4:02:41 PM	2891	61.00.00	2302787_433743	Connection between formatter and engine lost	0
33	7/8/2014 9:51:14 AM	2720	17.99.32	2302787_433743	Previously used HP supply installed	0
32	7/8/2014 9:51:14 AM	2720	17.03.60	2302787_433743	Yellow Cartridge low	0

2720	17.03.60	2302787_433743	Yellow Cartridge low
2720	61.00.02	2302787_433743	General engine failure 02AA1DDE
2720	61.00.00	2302787_433743	Connection between formatter and engine lost
2632	17.03.65	2302787_433743	Install Supply
2344	31.13.01	2302787_433743	Original document mispick
1998	17.31.65	2302787_433743	Install Supply
1982	61.00.02	2302787_433743	General engine failure C8FD0002



NOTE: There is additional error code information available from the Event Log of the device. The Event Log error description field will often contain additional failure data (8-digit payload data). When possible, collect this additional 8-digit number using the Embedded Web Server (EWS) and include it with the Service Repair document details. These codes will provide further detail about the cause of the error.

In all cases this 8-byte code should be included with all correspondence related to this service call. The information below provides more detail on several of the Secondary Error codes that can be used to help diagnose the issue and determine the proper resolution steps.

Table 6-12 Event Log error : 8-digit payload data

8-Digit Payload Data	Description	Action
6100000C 6100000D 6100000E	Service station error has occurred, physical blockage might be present	If no physical obstruction is seen, elevate the case.
61000011	Service station restricted movement	If no physical obstruction is seen, elevate the case.
61000012	Print bar assembly blocked	If no physical obstruction is seen, elevate the case.
61000013	Carriage motion blocked	If no physical obstruction is seen, elevate the case.
61000035	Print bar clutch slipping	Reboot. If the error persists, elevate the case.
6100004E	Print bar already purged	Elevate the case.
610000Cx	Service wipe issue (various)	Reboot. If the error persists, elevate the case.
610000D3	Print bar crash with Service Station	Reboot. If the error persists, elevate the case.
610000D4	Service Station under print bar	Reboot. If the error persists, elevate the case.
012xxxxx	Possible print data corruption delivered to print bar	Reboot. If the error persists, reseal the formatter and check connections.
007xxxxx	Device processing took too long	Reboot. If the error persists, elevate the case.
Bxxxxxxx	Firmware invalid memory access	Reboot. If the error persists, reseal the formatter and check connections.
C4xxxxxx	System interconnection issue with Tray 3	Turn off power, check both engine and tray connectors. Reseat Tray 3 and ensure alignment. Reboot. If the error persists, replace Tray 3. If the error persists after replacing Tray 3, elevate the case.
C6xxxxxx C8xxxxxx	Print bar malfunction	Elevate the case.

61.00.06

Formatter/engine connection lost due to time out.

Recommended action for customer

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Call-center agent recommended action

1. Turn the power off then on by pressing the power button and holding it in for more than 3 seconds.
2. Turn the power back on using power button.
3. If needed, dispatch a service technician to perform maintenance.

Recommended action for onsite technicians

1. Turn off the printer by pressing the Power button and holding it in for more than 3 seconds.
2. Press the Power button to turn the printer back on.
3. If the error persists, repeat steps 1 and 2.
4. For more troubleshooting steps, go to: [Fixing 61.XX.XX Errors](#).



NOTE: If Tray 3 is installed, use the following link: [Fixing 3x500 Tray 61.XX Errors](#).

5. If the error persists, check the installed firmware version and update the printer firmware as needed.



NOTE: Even with the printer in an error condition, you can still navigate the menus and install a new FW version.

6. If the issue persists, check the formatter board contacts:
 - a. Remove the formatter board from the printer.

- b. Inspect the contacts for contamination or damage.

Figure 6-59 Location of contacts on removed formatter



- c. Clean the contacts with a damp, lint free cloth. Ensure the contacts are completely dry before reinstalling and retesting.
- d. If the contacts are damaged, replace the formatter board.

Formatter PCA (556) part number: G1W46-67911

For instructions: See the Repair Service Manual for this product.

Formatter PCA (586) part number: G1W39-67914

For instructions: See the Repair Service Manual for this product.

Formatter PCA (556) China only part number: G1W46-67912

For instructions: See the Repair Service Manual for this product.

Formatter PCA (586) China only part number: G1W39-67939

For instructions: See the Repair Service Manual for this product.

- 7. If the error persists, elevate the case.

IMPORTANT: Print the event log OR access the event log through the EWS. Under the Description or Personality field, look for the 8 character fail code values corresponding to any 61.00.0X errors and log them into the case notes. These values are critical in helping the division understand the failure and in debugging potential field issues.

Information

Device Status
Configuration Page
Supplies Status Page
Event Log Page
Usage Page
Device Information
Control Panel Snapshot
Print

Other Links

HP Instant Support
Shop for Supplies
Product Support

Event Log Page

Device Information

Device Serial Number:

CN3C24Y0F4

Number	Date and Time	Cycles	Event	Firmware	Description or Personality	Consecutive Repeats
58	7/22/2014 12:16:26 PM	2901	17.03.70	2302787_433743	Printing past very low	0
49	7/21/2014 4:08:01 PM	2897	17.99.32	2302787_433743	Previously used HP supply installed	0
48	7/21/2014 4:08:00 PM	2897	17.03.60	2302787_433743	Yellow Cartridge low	0
47	7/21/2014 4:03:06 PM	2896	61.00.02	2302787_433743	General engine failure 02AA1DDE	0
46	7/21/2014 4:03:05 PM	2896	61.00.00	2302787_433743	Connection between formatter and engine lost	0
45	7/21/2014 1:51:18 PM	2894	17.99.32	2302787_433743	Previously used HP supply installed	0
44	7/21/2014 11:08:25 AM	2895	61.00.02	2302787_433743	General engine failure 02AA1DDE	0
43	7/21/2014 11:08:25 AM	2895	61.00.00	2302787_433743	Connection between formatter and engine lost	0
42	7/21/2014 10:59:23 AM	2893	17.99.32	2302787_433743	Previously used HP supply installed	0
41	7/21/2014 10:57:46 AM	2891	17.99.32	2302787_433743	Previously used HP supply installed	0
40	7/21/2014 10:13:23 AM	2891	17.99.40	2302787_433743	Genuine HP supplies installed	0
39	7/21/2014 10:13:23 AM	2891	17.03.65	2302787_433743	Yellow Cartridge low	0
38	7/18/2014 4:12:46 PM	2892	61.00.02	2302787_433743	General engine failure 02AA1DDE	0
37	7/18/2014 4:12:39 PM	2892	61.00.00	2302787_433743	Connection between formatter and engine lost	0
36	7/18/2014 4:05:22 PM	2889	17.99.32	2302787_433743	Previously used HP supply installed	0
35	7/18/2014 4:02:41 PM	2891	61.00.02	2302787_433743	General engine failure 02AA1DDE	0
34	7/18/2014 4:02:41 PM	2891	61.00.00	2302787_433743	Connection between formatter and engine lost	0
33	7/8/2014 9:51:14 AM	2720	17.99.32	2302787_433743	Previously used HP supply installed	0
32	7/8/2014 9:51:14 AM	2720	17.03.60	2302787_433743	Yellow Cartridge low	0

2720	17.03.60	2302787_433743	Yellow Cartridge low
2720	61.00.02	2302787_433743	General engine failure 02AA1DDE
2720	61.00.00	2302787_433743	Connection between formatter and engine lost
2632	17.03.65	2302787_433743	Install Supply
2344	31.13.01	2302787_433743	Original document mispick
1998	17.31.65	2302787_433743	Install Supply
1982	61.00.02	2302787_433743	General engine failure C8FD0002



NOTE: There is additional error code information available from the Event Log of the device. The Event Log error description field will often contain additional failure data (8-digit payload data). When possible, collect this additional 8-digit number using the Embedded Web Server (EWS) and include it with the Service Repair document details. These codes will provide further detail about the cause of the error.

In all cases this 8-byte code should be included with all correspondence related to this service call. The information below provides more detail on several of the Secondary Error codes that can be used to help diagnose the issue and determine the proper resolution steps.

Table 6-13 Event Log error : 8-digit payload data

8-Digit Payload Data	Description	Action
6100000C 6100000D 6100000E	Service station error has occurred, physical blockage might be present	If no physical obstruction is seen, elevate the case.
61000011	Service station restricted movement	If no physical obstruction is seen, elevate the case.
61000012	Print bar assembly blocked	If no physical obstruction is seen, elevate the case.
61000013	Carriage motion blocked	If no physical obstruction is seen, elevate the case.
61000035	Print bar clutch slipping	Reboot. If the error persists, elevate the case.
6100004E	Print bar already purged	Elevate the case.
610000Cx	Service wipe issue (various)	Reboot. If the error persists, elevate the case.
610000D3	Print bar crash with Service Station	Reboot. If the error persists, elevate the case.
610000D4	Service Station under print bar	Reboot. If the error persists, elevate the case.
012xxxxx	Possible print data corruption delivered to print bar	Reboot. If the error persists, reseal the formatter and check connections.
007xxxxx	Device processing took too long	Reboot. If the error persists, elevate the case.
Bxxxxxxx	Firmware invalid memory access	Reboot. If the error persists, reseal the formatter and check connections.
C4xxxxxx	System interconnection issue with Tray 3	Turn off power, check both engine and tray connectors. Reseat Tray 3 and ensure alignment. Reboot. If the error persists, replace Tray 3. If the error persists after replacing Tray 3, elevate the case.
C6xxxxxx C8xxxxxx	Print bar malfunction	Elevate the case.

61.10.01

The printbar has encountered a movement error.

61.10.01 Printbar lift motor stall.

Possible causes for this error include:

- Swing arms are not engaged
- Lift motor or clutch failure
- Dirty or defective encoder disk/sensor

Recommended action for customers

Ask the customer to perform the following steps to check to see if the printbar restraint is installed.

1. Turn the printer off, and then hold the power button for three seconds when you turn the printer on.
2. If this is a replacement or new printer and the error persists, follow these steps to check to see if the printbar restraint is still installed:
 - a. Remove the yellow cartridge.

Figure 6-60 Removing the yellow cartridge




- b. Pull the inner door from the left and then pull it out to open the inner door.

Figure 6-61 Opening the inner door




- c. If the green printbar restraint is present, hold the blue handle from the right, and then move it to the left.

Figure 6-62 Pulling out the blue printbar restraint handle

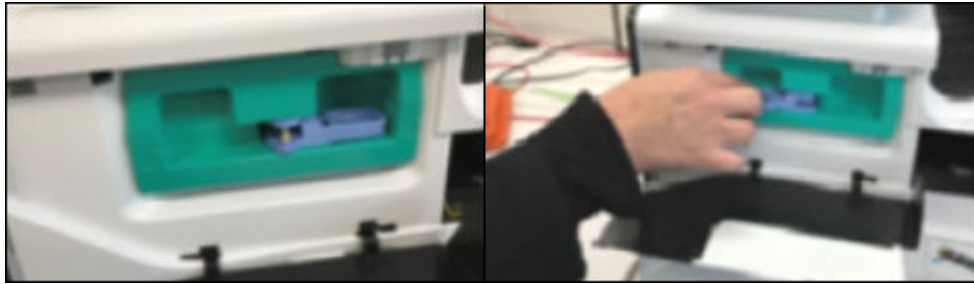

- d. Gently pull to remove the printbar restraint.

Figure 6-63 Removing the green printbar restraint

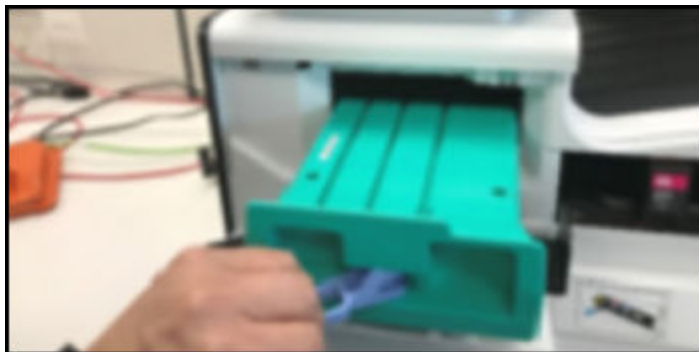

- e. Turn the printer OFF and then ON.
- f. If the printer boots to READY, try to print to see if the issue is resolved.
- g. If the error persists, contact customer support. Please have full error code ready to give to HP support.

Recommended action for call center agents

For detailed instructions on replacing the printbar lift motor clutch kit, please see [Removal and replacement: Printbar lift motor clutch kit](#) (c05294006).

View the following video for more information on replacing the lift clutch spring and printbar assembly:

[How To Replace the Lift Clutch Spring - HP OfficeJet Pro X and PageWide Pro Printers](#)

View the following video for more information on fixing 61.10.01, 61.C4.D3, and 62.12.35 printbar lift motor errors on HP PageWide printers:

 [Fixing 61.10.01, 61.C4.D3, and 62.12.35 Printbar Lift Motor Errors on HP PageWide Enterprise Printers](#)

Ask the customer to perform the following steps to check to see if the printbar restraint is installed.

1. Remove the yellow cartridge.

Figure 6-64 Removing the yellow cartridge



2. Pull the inner door from the left, and then pull it out to open the inner door.

Figure 6-65 Opening the inner door




3. If the green printbar restraint is present, hold the blue handle from the right, and then move it to the left.

Figure 6-66 Pulling out the blue printbar restraint handle



4. Gently pull to remove the printbar restraint.

Figure 6-67 Removing the green printbar restraint

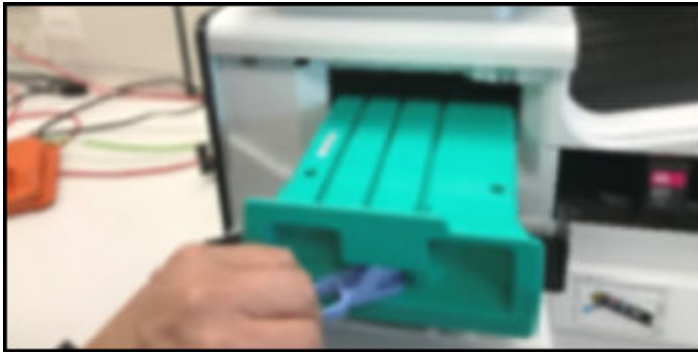

5. Ask the customer to turn the printer OFF and then back ON.
6. If the printer boots to **READY**, ask the customer to try to print to see if the issue is resolved.
7. If the printer boots and displays the error again, dispatch a technician. Please order a printbar Lift Mechanism Assembly.

Part number: D3Q24-67076

Recommended action for onsite technicians

View the following video for more information on fixing 61.10.01, 61.C4.D3, and 62.12.35 printbar lift motor errors on HP PageWide printers:

 [Fixing 61.10.01, 61.C4.D3, and 62.12.35 Printbar Lift Motor Errors on HP PageWide Enterprise Printers](#)

Because there is more than one possible cause for this error, the repair strategy will vary. Choose the appropriate strategy from the options in steps 3 and 4.

1. Pull out the paper tray and make sure that the tray is about half full.

Figure 6-68 A half-full tray



2. Close the paper tray and look at the media-level window 1, located on the bottom right front corner of the tray.

 **NOTE:** During normal operation, the indicator will move when the tray is closed.


Figure 6-69 The media-level window



3. Use the following strategy if the media-level window is showing all white. If the media-level window is showing black on top and white on the bottom, proceed to step 4.

Strategy One: Resolve transmission issues if the media-level window shows all white:

Figure 6-70 An all-white window indicates that the transmission swing arms are disengaged

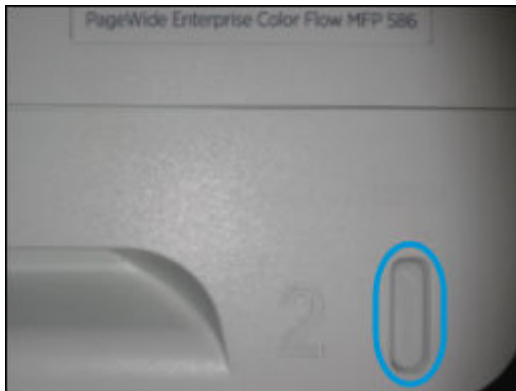

- a. Remove the main PCA and examine the swing arms to see if they are engaged.

Figure 6-71 An example of swing arms that are engaged


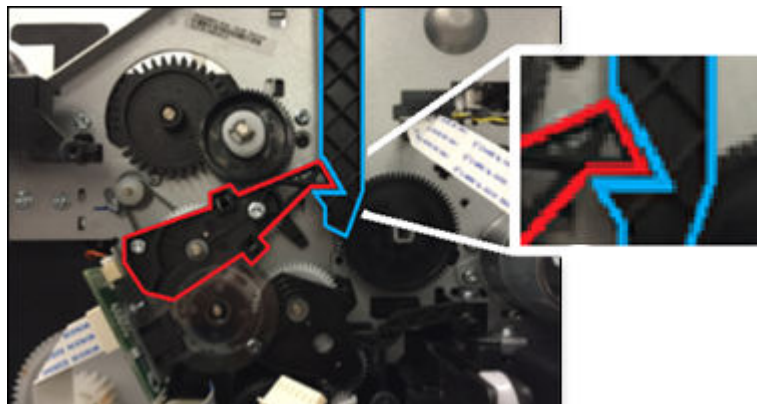


Figure 6-72 An example of swing arms that are NOT engaged

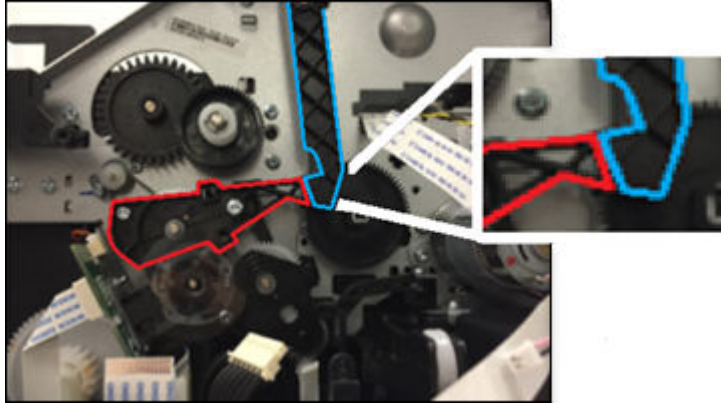

- b. If the swing arms are disengaged, re-engage them.
 - c. After re-engaging the swing arms, reinstall the main PCA and covers.
 - d. Turn the printer OFF and then ON.
 - e. If the printer boots to **READY**, try to print to see if the issue is resolved.
 - f. If the media-level window still does not move after re-engaging the swing arm, the motor is not the problem. Replace the printer.
4. Use the following strategy if the media-level window is black on top and white on the bottom.

Strategy Two: Resolve lift issues if the window shows black on top and some white on the bottom:


Figure 6-73 A media-level window showing white and black



If the window shows black on top and some white on the bottom, the cause might be a dirty or damaged print bar lift motor encoder disc and sensor, or the lift clutch might be failing.

- a. Inspect and clean the lift motor encoder disc.

Figure 6-74 The encoder disk and sensor

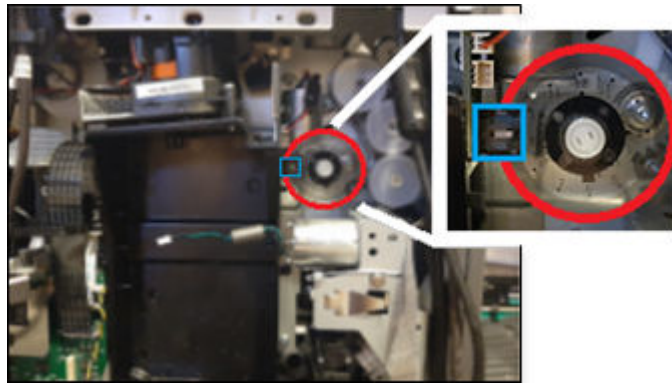

- b. After cleaning the encoder disc and sensor, reinstall the Main PCA and covers.
- c. Turn the printer OFF and then ON.
- d. If the printer boots to **READY**, try to print to see if the issue is resolved.
- e. If the printer boots to an error again, open the supply access door and see if the printbar tray is visible.
- f. If the printbar tray is NOT visible, the error is likely caused by a printbar lift assembly failure. Replace the printbar lift mechanism assembly.

Part number: D3Q24-67076

For a written procedure on replacing the printbar lift motor clutch kit, please see [Removal and replacement: Printbar lift motor clutch kit](#) (c05294006).

View the following video for more information on replacing the lift clutch spring and printbar assembly:

[How To Replace the Lift Clutch Spring - HP OfficeJet Pro X and PageWide Pro Printers](#)

61.30.00

Product maintenance message.

61.30.00 Scheduled maintenance complete.

Recommended action for customer

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Call-center agent recommended action

1. Turn the power off then on by pressing the power button and holding it in for more than 3 seconds.
2. Turn the power back on using power button.
3. If needed, dispatch a service technician to perform maintenance.

Recommended action for onsite technicians

1. Turn the power off then on by pressing the power button and holding it in for more than 3 seconds.
2. Turn the power back on using power button.

61.30.01

Product maintenance message.

61.30.01 Scheduled maintenance missed.

Recommended action for customer

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Call-center agent recommended action

1. Turn the power off then on by pressing the power button and holding it in for more than 3 seconds.
2. Turn the power back on using power button.
3. If needed, dispatch a service technician to perform maintenance.

Recommended action for onsite technicians

1. Perform the scheduled maintenance.
2. Turn the power off then on by pressing the power button and holding it in for more than 3 seconds.
3. Turn the printer back on using power button.

61.Ax.yz

The pick transmission has failed.

- **61.A2.2D** (Payload data: 6100002D)
PAPER_LOAD_TRAY1_PICK_MOTOR
- **61.A2.2E** (Payload data: 6100002E)
PAPER_LOAD_PICK_TIRE_INDEX_SENSOR

For instructions on resolving 6100002D or 6100002E errors, see the 6100002D or 6100002E error message section in this document.

Recommended action for customer

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Call-center agent recommended action

1. Turn the power off then on by pressing the power button and holding it in for more than 3 seconds.

2. Turn the power back on using power button.
3. If needed, dispatch a service technician to perform maintenance.

Recommended action

- A bearing may have been over-pressed at the factory. Please refer to this document for troubleshooting: [HP PageWide Enterprise Color 556 and MFP 586 - Printer hangs with these possible errors: Tray 2 Lifting, 15.A0.00, Initializing 53%, Load Tray 2 Plain Paper \(4K\) \(ID: emr_na-c05316324\)](#).

61.C0.YZ

Sensor Failure

Error Code	GPE Code	Description
61.C0.68	61000068	PRINT_ADD_SIZE_NOW_KNOWN_ZI M_POS
61.C0.A1	610000A1	SENSOR_SCAN_CALIBRATE_LED_IN VALID_SENSOR
61.C0.A2	610000A2	SENSOR_SCAN_ACQUIRE_SCAN_U NKNOWN_SENSOR
61.C0.A3	610000A3	SENSOR_SCAN_ACQUIRE_SCAN_ST ART_POS
61.C0.A4	610000A4	SENSOR_SCAN_ACQUIRE_SCAN_EN D_POS
61.C0.A5	610000A5	SENSOR_SCAN_ACQUIRE_SCAN_VE RT_UNKNOWN
61.C0.A6	610000A6	SENSOR_CMS_SCAN_X_INVALID_SE NSOR
61.C0.A7	610000A7	SENSOR_CMS_SCAN_X_OVERSHO OT
61.C0.A8	610000A8	SENSOR_CMS_SCAN_X_UNKNOWN _TYPE
61.C0.A9	610000A9	SENSOR_CMS_SCAN_Y_INVALID_SE NSOR
61.C0.AB	610000AB	SENSOR_CMS_SCAN_Y_UNKNOWN _TYPE
61.C0.AC	610000AC	SENSOR_CMS_CALIBRATE_UNKNO WN_SENSOR
61.C0.AD	610000AD	SENSOR_CMS_CALIBRATE_INVALID _SENSOR
61.C0.AE	610000AE	SENSOR_CMS_CALIBRATE_OVERSH OOT
61.C0.AF	610000AF	SENSOR_COMMAND_INVALID_SEN SOR
61.C0.B0	610000B0	SENSOR_RESULT_INVALID_SENSOR
61.C0.B1	610000B1	SENSOR_STATUS_INVALID_SENSOR
61.C0.B2	610000B2	SENSOR_SCAN_RESULT_INVALID_S ENSOR

Error Code	GPE Code	Description
61.C0.B3	610000B3	SENSOR_SETUP_INVALID_SENSOR
61.C0.B4	610000B4	SENSOR_COMPLETE_INVALID_SENSOR
61.C0.B5	610000B5	SENSOR_SCAN_SET_ARG_INVALID_SENSOR
61.C0.B7	610000B7	SENSOR_SCAN_START_EDGE_SCAN_BAD_TYPE

Recommended action for customer

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off by holding down the power button for 3 seconds or more.
2. Turn the printer back on.
3. If the error persists, elevate the case using the Standard Support Process.

61.C4.YZ

Service station pick transmission failed.

Service station pick transmission failed.

Error Code	GPE Code	Description
61.C4.0C	6100000C	SERVICE_STATION_HOME_FAILURE
61.C4.0D	6100000D	SERVICE_STATION_CAP_HOME_LONG
61.C4.0E	6100000E	SERVICE_STATION_CAP_HOME_SHORT
61.C4.13	61000013	CARRIAGE_RESTRICTED_MOVEMENT_SERVICE_ERROR
61.C4.C0	610000C0	SERVICE_UNCAP_TRANNNY_STATE
61.C4.C1	610000C1	SERVICE_STATION_HOME_TRANNNY_STATE
61.C4.C2	610000C2	SERVICE_WIPE_PENS_REVERSE_UNIDIRECTIONAL
61.C4.C3	610000C3	SERVICE_WIPE_PENS_AWAY_FROM_CAP_TRANNNY
61.C4.C4	610000C4	SERVICE_WIPE_PENS_AWAY_FROM_CAP_MOTOR
61.C4.C5	610000C5	SERVICE_WIPE_PENS_FORWARD_UNIDIRECTIONAL
61.C4.C7	610000C7	SERVICE_WIPE_PENS_TOWARD_CAP_MOTOR

Error Code	GPE Code	Description
61.C4.C8	610000C8	SERVICE_MOVE_TO_TRANNY_STATE
61.C4.C9	610000C9	SERVICE_CARRIAGE_HOME_INVALID
61.C4.D2	610000D2	DPU_SERVICE_STATION_UNLIMITED_MOVE
61.C4.D3	610000D3	DPU_PRINTBAR_CRASH_INTO_SERVICE_STATION
61.C4.D4	610000D4	DPU_SERVICE_STATION_UNDER_PRINT_BAR

Recommended action for customer

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians


For all errors except 61.C4.13: Elevate the case using the Standard Support Process.

For 61.C4.13:

1. Ask the customer to turn the printer off, then back on.
2. Verify that there is no debris blocking the carriage movement. Inspect for a paper jam blocking the carriage. Attempt to remove any media that is blocking the carriage.


3. Check that the sensor carriage flex cable (J31) is connected properly and not damaged.

Figure 6-75 Example of the sensor carriage flex cable (J31) connected properly

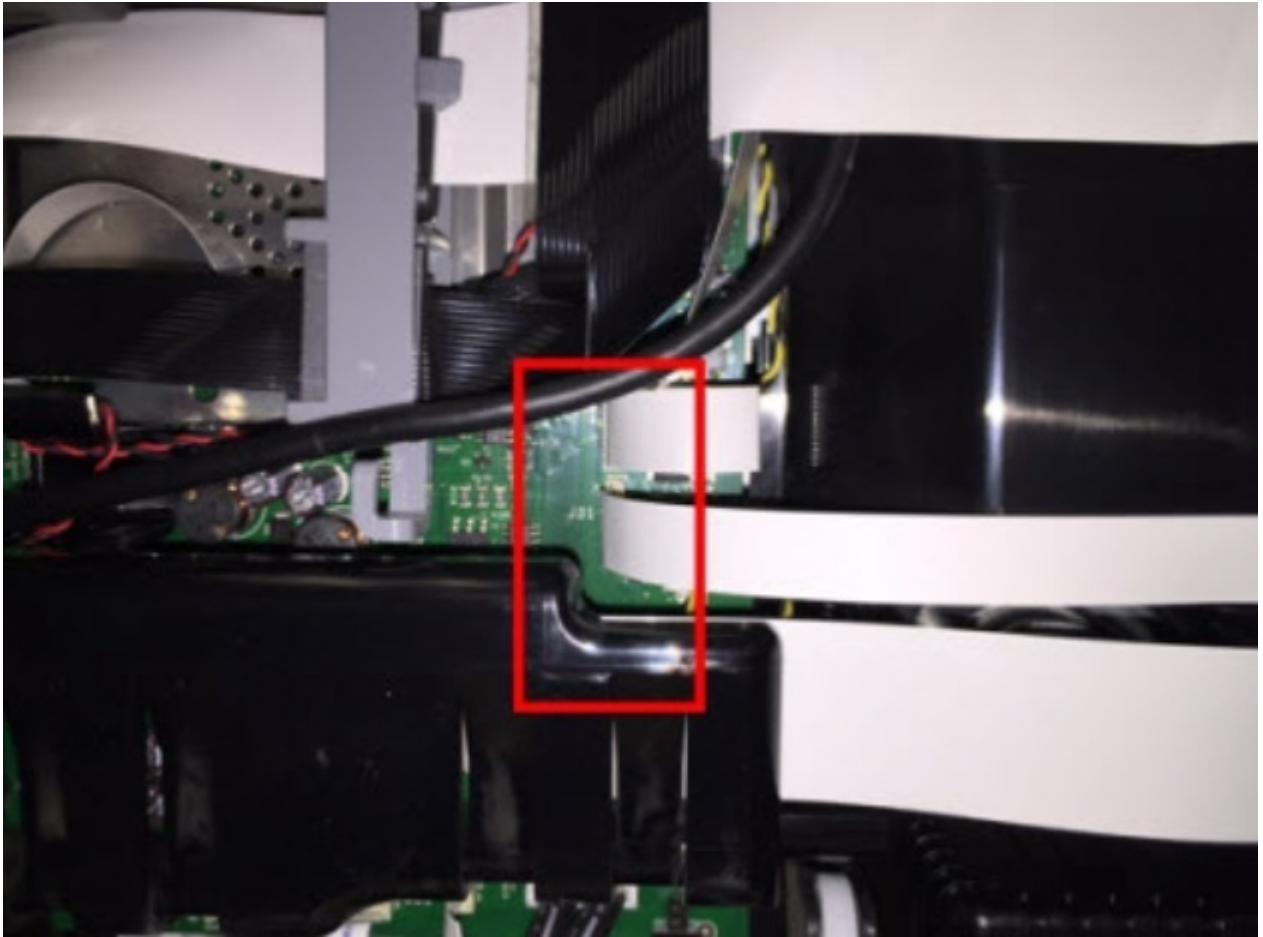

4. Verify that the green and black sensor carriage motor cable (next to the aerosol assembly) is connected.

Figure 6-76 Example of the sensor carriage motor cable connected

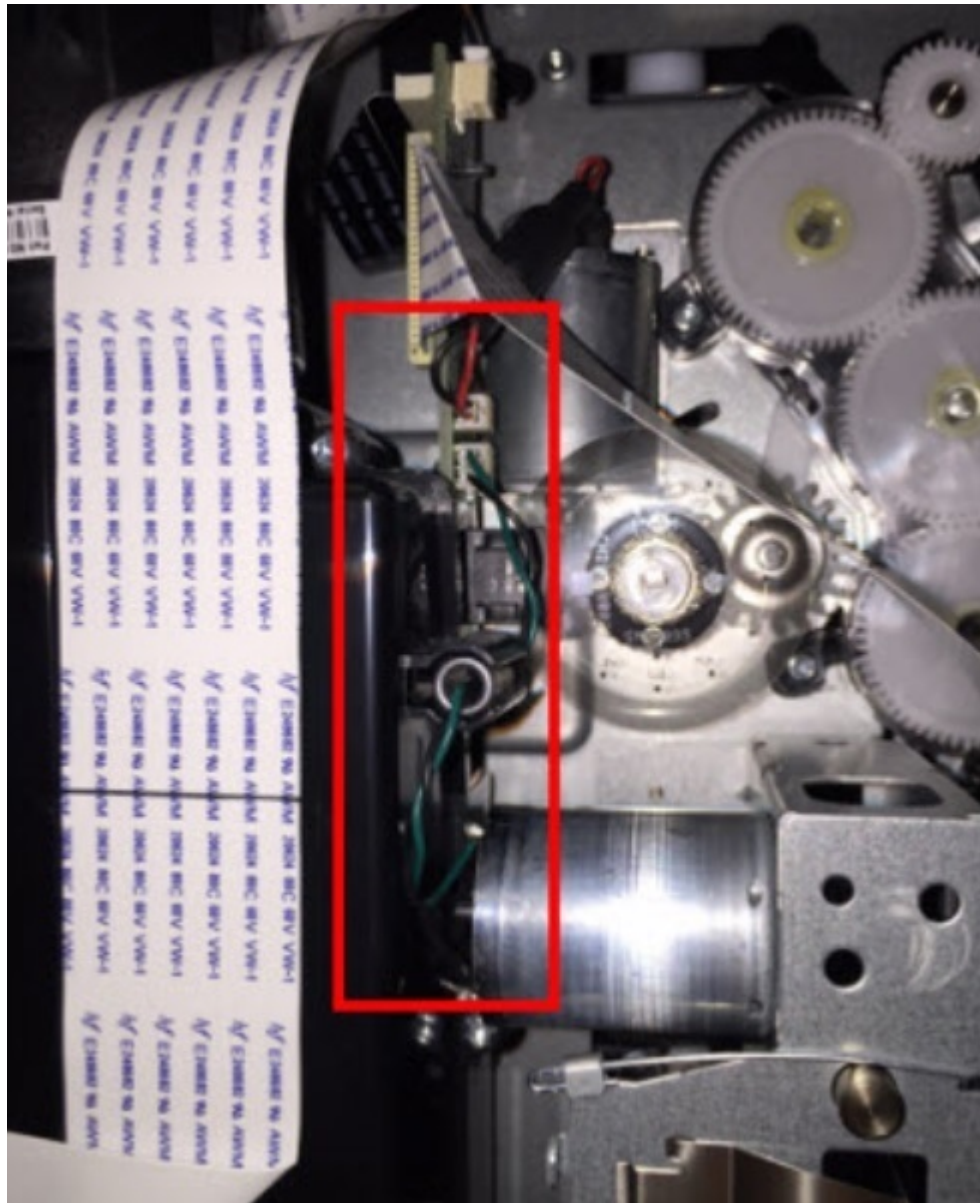

5. Ensure that the encoder strip is in place. It is possible to replace the encoder strip while only removing the rear case part. Slide the encoder strip in and move the carriage from the rear to the front with your hand. This will line-up the strip in the front. Use tweezers to hook the strip on the hook in the front, then slide the carriage back to the garage and hook the strip to the spring-loaded hook in the rear.
6. Ensure that the transmission is in the correct position.



NOTE: The carriage movement mechanisms are not field replaceable.

61.C4.D3

Service station pick transmission failed.

Error Code	GPE Code	Description
61.C4.D3	610000D3	DPU_PRINTBAR_CRASH_INTO_SERVICE_STATION

Possible causes for this error include:

- Swing arms are not engaged
- Lift motor or clutch failure
- Dirty or defective encoder disk/sensor

Recommended action for customers

Ask the customer to perform the following steps to check to see if the printbar restraint is installed.

1. Turn the printer off, and then hold the power button for three seconds when you turn the printer on.
2. If this is a replacement or new printer and the error persists, follow these steps to check to see if the printbar restraint is still installed:
 - a. Remove the yellow cartridge.

Figure 6-77 Removing the yellow cartridge




- b. Pull the inner door from the left and then pull it out to open the inner door.

Figure 6-78 Opening the inner door




- c. If the green printbar restraint is present, hold the blue handle from the right, and then move it to the left.

Figure 6-79 Pulling out the blue printbar restraint handle

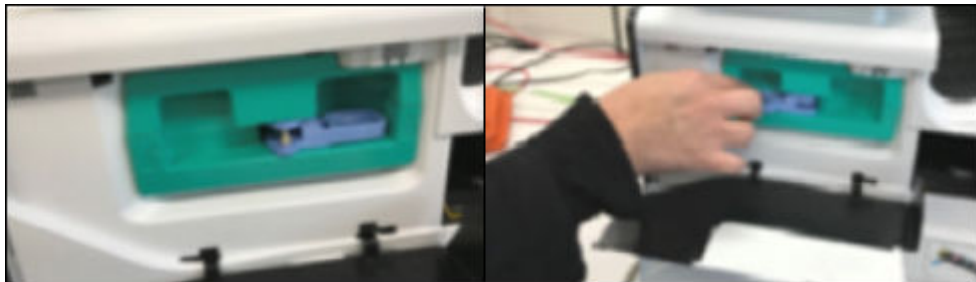

- d. Gently pull to remove the printbar restraint.

Figure 6-80 Removing the green printbar restraint

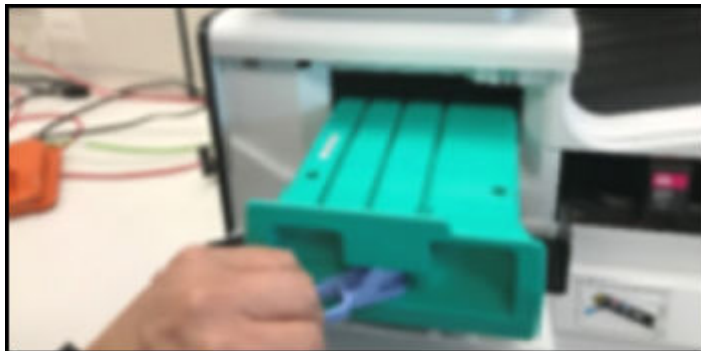

- e. Turn the printer OFF and then ON.
- f. If the printer boots to READY, try to print to see if the issue is resolved.
- g. If the error persists, contact customer support. Please have full error code ready to give to HP support.

Recommended action for call center agents

For detailed instructions on replacing the printbar lift motor clutch kit, please see [Removal and replacement: Printbar lift motor clutch kit](#) (c05294006).

View the following video for more information on replacing the lift clutch spring and printbar assembly:

[How To Replace the Lift Clutch Spring - HP OfficeJet Pro X and PageWide Pro Printers](#)

View the following video for more information on fixing 61.10.01, 61.C4.D3, and 62.12.35 printbar lift motor errors on HP PageWide printers:

 [Fixing 61.10.01, 61.C4.D3, and 62.12.35 Printbar Lift Motor Errors on HP PageWide Enterprise Printers](#)

Ask the customer to perform the following steps to check to see if the printbar restraint is installed.

1. Remove the yellow cartridge.

Figure 6-81 Removing the yellow cartridge




2. Pull the inner door from the left, and then pull it out to open the inner door.

Figure 6-82 Opening the inner door




3. If the green printbar restraint is present, hold the blue handle from the right, and then move it to the left.

Figure 6-83 Pulling out the blue printbar restraint handle

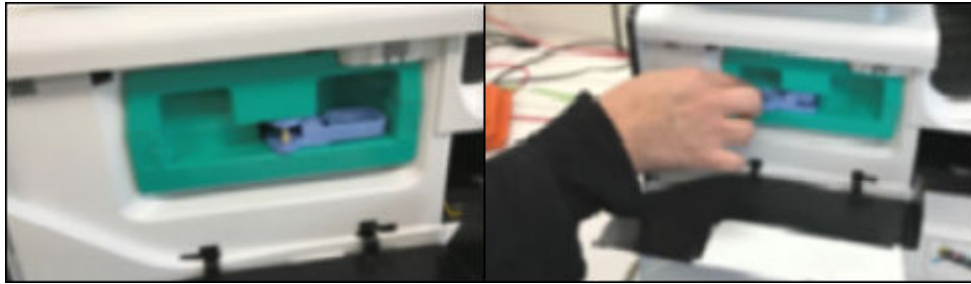

4. Gently pull to remove the printbar restraint.

Figure 6-84 Removing the green printbar restraint

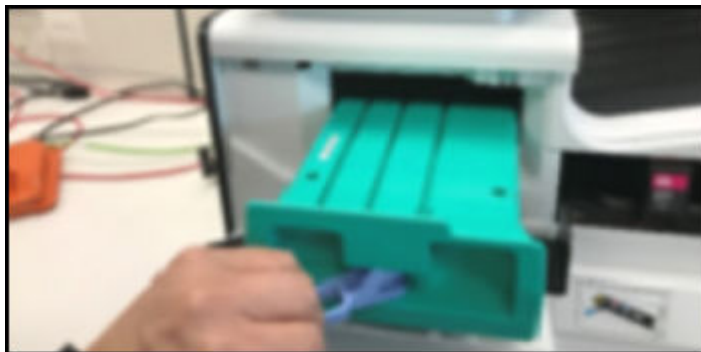

5. Ask the customer to turn the printer OFF and then back ON.
6. If the printer boots to **READY**, ask the customer to try to print to see if the issue is resolved.
7. If the printer boots and displays the error again, dispatch a technician. Please order a printbar Lift Mechanism Assembly.

Part number: D3Q24-67076

Recommended action for onsite technicians

View the following video for more information on fixing 61.10.01, 61.C4.D3, and 62.12.35 printbar lift motor errors on HP PageWide printers:



[Fixing 61.10.01, 61.C4.D3, and 62.12.35 Printbar Lift Motor Errors on HP PageWide Enterprise Printers](#)

Because there is more than one possible cause for this error, the repair strategy will vary. Choose the appropriate strategy from the options in steps 3 and 4.

1. Pull out the paper tray and make sure that the tray is about half full.

Figure 6-85 A half-full tray




2. Close the paper tray and look at the media-level window 1, located on the bottom right front corner of the tray.



NOTE: During normal operation, the indicator will move when the tray is closed.


Figure 6-86 The media-level window

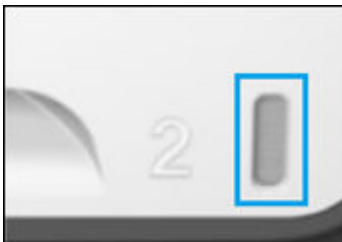

3. Use the following strategy if the media-level window is showing all white. If the media-level window is showing black on top and white on the bottom, proceed to step 4.

Strategy One: Resolve transmission issues if the media-level window shows all white:

Figure 6-87 An all-white window indicates that the transmission swing arms are disengaged

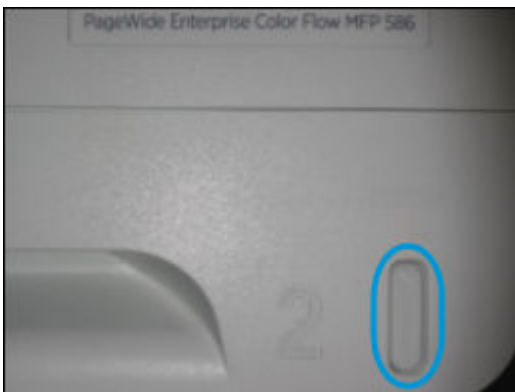

- a. Remove the main PCA and examine the swing arms to see if they are engaged.

Figure 6-88 An example of swing arms that are engaged


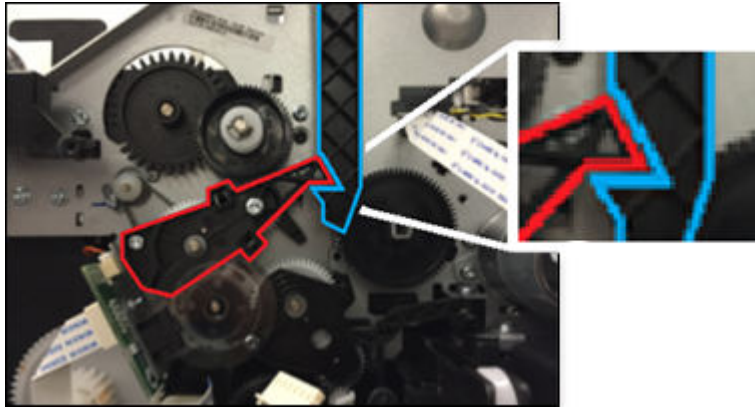



Figure 6-89 An example of swing arms that are NOT engaged

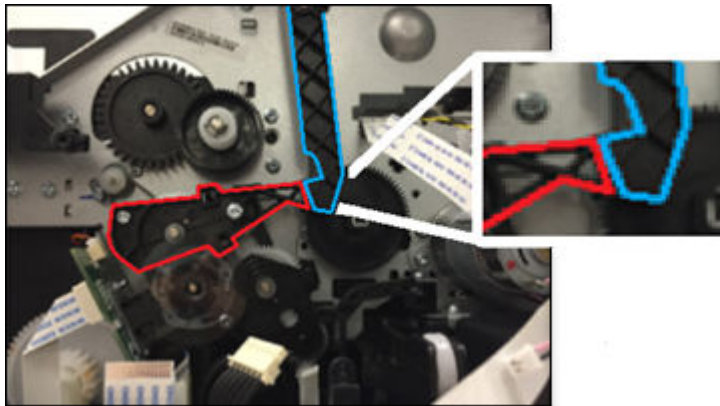

- b. If the swing arms are disengaged, re-engage them.
 - c. After re-engaging the swing arms, reinstall the main PCA and covers.
 - d. Turn the printer OFF and then ON.
 - e. If the printer boots to **READY**, try to print to see if the issue is resolved.
 - f. If the media-level window still does not move after re-engaging the swing arm, the motor is not the problem. Replace the printer.
4. Use the following strategy if the media-level window is black on top and white on the bottom.

Strategy Two: Resolve lift issues if the window shows black on top and some white on the bottom:


Figure 6-90 A media-level window showing white and black

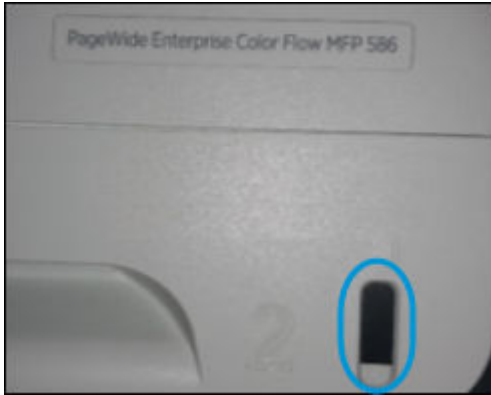

If the window shows black on top and some white on the bottom, the cause might be a dirty or damaged print bar lift motor encoder disc and sensor, or the lift clutch might be failing.

- a. Inspect and clean the lift motor encoder disc.

Figure 6-91 The encoder disk and sensor

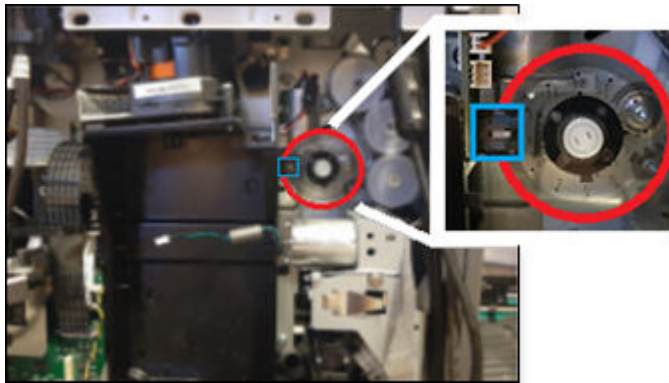

- b. After cleaning the encoder disc and sensor, reinstall the Main PCA and covers.
- c. Turn the printer OFF and then ON.
- d. If the printer boots to **READY**, try to print to see if the issue is resolved.
- e. If the printer boots to an error again, open the supply access door and see if the printbar tray is visible.
- f. If the printbar tray is NOT visible, the error is likely caused by a printbar lift assembly failure. Replace the printbar lift mechanism assembly.

Part number: D3Q24-67076

For a written procedure on replacing the printbar lift motor clutch kit, please see [Removal and replacement: Printbar lift motor clutch kit](#) (c05294006).

View the following video for more information on replacing the lift clutch spring and printbar assembly:

[How To Replace the Lift Clutch Spring - HP OfficeJet Pro X and PageWide Pro Printers](#)

62.wx.yz error messages

62.* errors

Errors in the 62.* family indicate a problem with the print engine.

Recommended action for customers

1. Turn the printer off, and then on.
2. Upgrade the firmware.
Go to [HP FutureSmart - Latest Firmware Versions](#).
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Check all connectors on the formatter. Reseat them if necessary.
3. Upgrade the printer firmware.
4. If the error persists print the event log from the control panel, or access it from the HP Embedded Web Server (EWS), then elevate the case using the Standard Support Process.



NOTE: To access the EWS, open a Web browser, and in the address line, enter the printer IP address.

62.0F.YZ, 62.0X.YZ, 62.11.YZ, 62.12.YZ

The print engine has encountered an error. Print head and Ink Delivery Errors.

- 62.0F.YZ Pick transmission failed
- 62.0X.YZ Printbar failed
- 62.11.YZ Printbar failed
- 62.12.YZ Printbar lift failed



NOTE: There is additional error code information available from the Event Log of the device.

Include this 8 digit payload code for all cases and with all correspondence related to this service call. The information below provides more detail on several of the secondary error codes that can be used to help diagnose the issue and determine the proper resolution steps.

Error code	GPE Code	Description
62.0F.0B	6100000B	SERVICE_STATION_PEN_TOO_COLD
62.0x.01	Indicates die number; between 0-9.	PEN_ERROR_GENERIC

Error code	GPE Code	Description
62.0x.02	Indicates die number; between 0-9.	PEN_NO_PEN_IO
62.0x.03	Indicates die number; between 0-9.	PEN_INCORRECT_PEN_IO
62.0x.04	Indicates die number; between 0-9.	PEN_WDOG_FAULT
62.0x.06	Indicates die number; between 0-9.	PEN_UNRECOGNIZED_PEN_TYPE
62.0x.07	Indicates die number; between 0-9.	PEN_LVDS_ERROR
62.0x.08	Indicates die number; between 0-9.	PEN_ID_INVALID
62.0x.09	Indicates die number; between 0-9.	PEN_ID_BIT_FLIPPED
62.0x.10	Indicates die number; between 0-9.	PEN_BAD_DTSR
62.0x.12	Indicates die number; between 0-9.	PEN_TSR_FAULT
62.0x.13	Indicates die number; between 0-9.	PEN_STUCK_COLD
62.0x.14	Indicates die number; between 0-9.	PEN_NOT_HEATING
62.0x.15	Indicates die number; between 0-9.	PEN_TOO_COLD
62.0x.20	Indicates die number; between 0-9.	PEN_VDD_SHORT_LOW
62.0x.21	Indicates die number; between 0-9.	PEN_VDD_SHORT_HIGH
62.0x.22	Indicates die number; between 0-9.	PEN_VDD_EXPECTED_ON
62.0x.23	Indicates die number; between 0-9.	PEN_VPP_INIT_SHORT_LOW
62.0x.24	Indicates die number; between 0-9.	PEN_VPP_SHORT_LOW
62.0x.25	Indicates die number; between 0-9.	PEN_VPP_INIT_SHORT_HIGH
62.0x.26	Indicates die number; between 0-9.	PEN_VPP_SHORT_HIGH
62.0x.27	Indicates die number; between 0-9.	PEN_VPP_SHORT_TEST_OUT_OF_RANGE_LOW
62.0x.28	Indicates die number; between 0-9.	PEN_VPP_SHORT_TEST_OUT_OF_RANGE_HIGH
62.11.50	61000050	PEN_PRIME_PUMP_NOT_PRESENT_FAILURE
62.11.51	61000051	PEN_PRIME_VALVE_ATM_NOT_PRESENT_FAILURE
62.11.52	61000052	PEN_PRIME_VALVE_REG_NOT_PRESENT_FAILURE
62.11.53	61000053	PEN_INK_PUMP_FAILURE
62.12.13	61000012	LIFT_RESTRICTED_MOVEMENT_SERVICE_ERROR
62.12.35	61000035	PRINTBAR_CLUTCH_SLIPPAGE

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the power off then on by pressing the power button and holding it in for more than 3 seconds.
2. Turn the power back on using the power button.
3. If the error remains, repeat steps 1 and 2, and then do the following:
 - a. Check the installed firmware version and update the printer firmware as needed.



NOTE: Even with the printer on error condition you can still navigate the menus and FW version.

- b. Turn the power off and remove the formatter, check the formatter thoroughly for any loose connections and reseal them, then reinstall the formatter.
4. If the error persists, use the Standard Support Process to elevate the case.

Before elevating the issue. Check the following specific troubleshooting steps.



IMPORTANT: Print the event log OR access the event log through the EWS. Under the **Description** or **Personality** field, look for the 8 character fail code values corresponding to any 62 errors and log them into the case notes. These values are critical in helping the division understand the failure and in debugging potential field issues.

Figure 6-92 Log into the case notes any 8 digit codes in the Description or Personality column for any 62 errors

Event ID	Time	Severity	Description	Personality	Fail Code
2720	01:00:02	Warning	General engine failure	00AA0000	
2720	01:00:00	Warning	Connection between formatter and engine lost		
2032	17:05:05	Warning	Initial Supply		
2344	21:10:01	Warning	Original document mispick		
1996	17:31:05	Warning	Initial Supply		
1902	01:00:02	Warning	General engine failure	00AA0000	

Before elevating the issue. Check the following specific troubleshooting steps.

5. For 62.0F.0B errors
 - a. Please make sure room is warm enough, and/or to leave printer in warm environments for 24 hours.
 - b. If the issue still existing, printbar temperature sensor could be wrong.

- c. Collect technical information page 12 when escalating to technical marketing. How to collect it: Administration – Troubleshooting - Advance Diagnostics Page - Technical Information Page (12)

6. For 62.0x1z or 2z errors

- a. Make sure all three FFC cables connecting the printbar to main ECB are correctly inserted fully.
- b. Check if the cables to the Ink Delivery System area are correctly connected.

7. For 62.12.yz error:

- a. Ensure that the printbar lift is not obstructed.
- b. Ensure that the printbar lift guide assembly and guide rods are not obstructed.
- c. Verify that the service sled transmission is in the correct position.
- d. Check that the printbar's position is not skewed or racked (i.e. off by one tooth on one side). If it is, remove and reinstall the printbar.

62.12.35

The print engine has encountered an error.

62.12.35 Printbar lift failed

Error code	GPE Code	Description	Description
62.12.35	61000035	PRINTBAR_CLUTCH_SLIPPAGE	PRINTBAR_CLUTCH_SLIPPAGE

Possible causes for this error include:

- Swing arms are not engaged
- Lift motor or clutch failure
- Dirty or defective encoder disk/sensor

Recommended action for customers

Ask the customer to perform the following steps to check to see if the printbar restraint is installed.

1. Turn the printer off, and then hold the power button for three seconds when you turn the printer on.
2. If this is a replacement or new printer and the error persists, follow these steps to check to see if the printbar restraint is still installed:

- a. Remove the yellow cartridge.

Figure 6-93 Removing the yellow cartridge



- b. Pull the inner door from the left and then pull it out to open the inner door.

Figure 6-94 Opening the inner door



- c. If the green printbar restraint is present, hold the blue handle from the right, and then move it to the left.

Figure 6-95 Pulling out the blue printbar restraint handle



- d. Gently pull to remove the printbar restraint.

Figure 6-96 Removing the green printbar restraint



- e. Turn the printer OFF and then ON.
- f. If the printer boots to READY, try to print to see if the issue is resolved.
- g. If the error persists, contact customer support. Please have full error code ready to give to HP support.

Recommended action for call center agents

For detailed instructions on replacing the printbar lift motor clutch kit, please see [Removal and replacement: Printbar lift motor clutch kit](#) (c05294006).

View the following video for more information on replacing the lift clutch spring and printbar assembly:

[How To Replace the Lift Clutch Spring - HP OfficeJet Pro X and PageWide Pro Printers](#)

View the following video for more information on fixing 61.10.01, 61.C4.D3, and 62.12.35 printbar lift motor errors on HP PageWide printers:

 [Fixing 61.10.01, 61.C4.D3, and 62.12.35 Printbar Lift Motor Errors on HP PageWide Enterprise Printers](#)

Ask the customer to perform the following steps to check to see if the printbar restraint is installed.

1. Remove the yellow cartridge.

Figure 6-97 Removing the yellow cartridge



2. Pull the inner door from the left, and then pull it out to open the inner door.

Figure 6-98 Opening the inner door




3. If the green printbar restraint is present, hold the blue handle from the right, and then move it to the left.

Figure 6-99 Pulling out the blue printbar restraint handle



4. Gently pull to remove the printbar restraint.

Figure 6-100 Removing the green printbar restraint

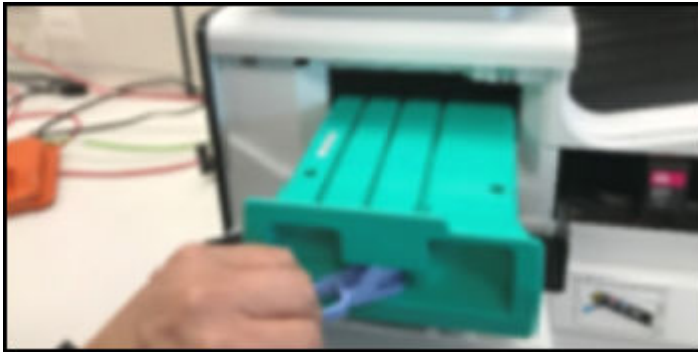

5. Ask the customer to turn the printer OFF and then back ON.
6. If the printer boots to **READY**, ask the customer to try to print to see if the issue is resolved.
7. If the printer boots and displays the error again, dispatch a technician. Please order a printbar Lift Mechanism Assembly.

Part number: D3Q24-67076

Recommended action for onsite technicians

View the following video for more information on fixing 61.10.01, 61.C4.D3, and 62.12.35 printbar lift motor errors on HP PageWide printers:

 [Fixing 61.10.01, 61.C4.D3, and 62.12.35 Printbar Lift Motor Errors on HP PageWide Enterprise Printers](#)

Because there is more than one possible cause for this error, the repair strategy will vary. Choose the appropriate strategy from the options in steps 3 and 4.

1. Pull out the paper tray and make sure that the tray is about half full.

Figure 6-101 A half-full tray



2. Close the paper tray and look at the media-level window 1, located on the bottom right front corner of the tray.



NOTE: During normal operation, the indicator will move when the tray is closed.


Figure 6-102 The media-level window



3. Use the following strategy if the media-level window is showing all white. If the media-level window is showing black on top and white on the bottom, proceed to step 4.

Strategy One: Resolve transmission issues if the media-level window shows all white:

Figure 6-103 An all-white window indicates that the transmission swing arms are disengaged

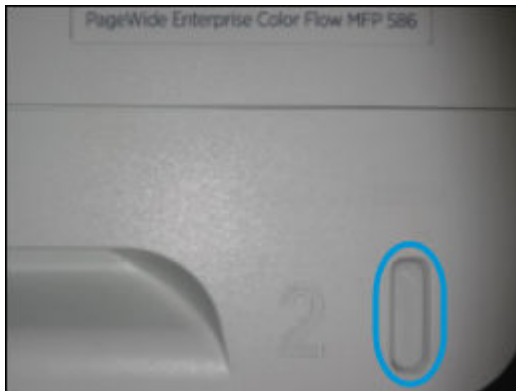

- a. Remove the main PCA and examine the swing arms to see if they are engaged.

Figure 6-104 An example of swing arms that are engaged


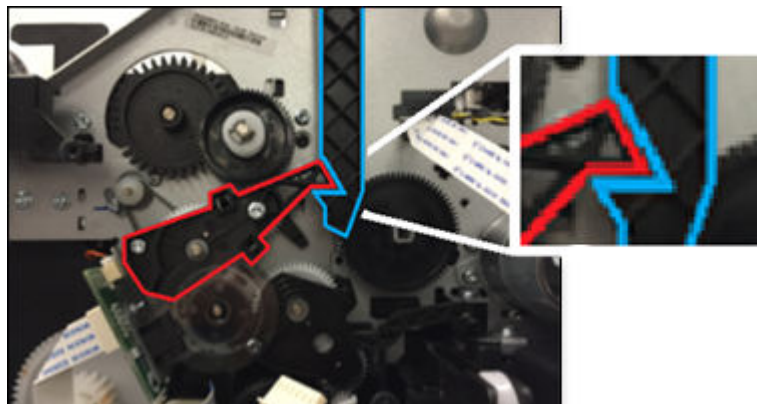



Figure 6-105 An example of swing arms that are NOT engaged

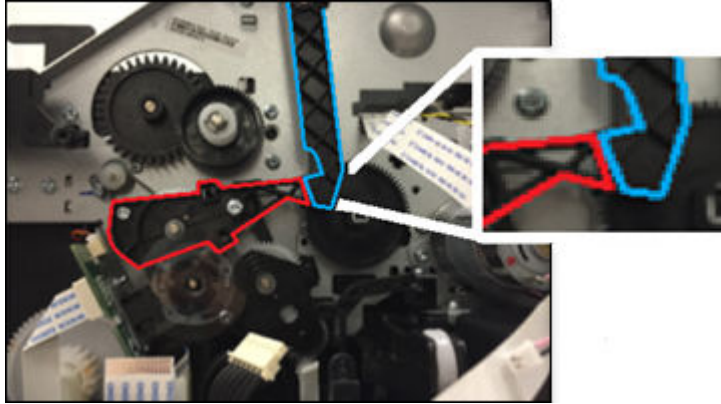

- b. If the swing arms are disengaged, re-engage them.
 - c. After re-engaging the swing arms, reinstall the main PCA and covers.
 - d. Turn the printer OFF and then ON.
 - e. If the printer boots to **READY**, try to print to see if the issue is resolved.
 - f. If the media-level window still does not move after re-engaging the swing arm, the motor is not the problem. Replace the printer.
4. Use the following strategy if the media-level window is black on top and white on the bottom.

Strategy Two: Resolve lift issues if the window shows black on top and some white on the bottom:


Figure 6-106 A media-level window showing white and black

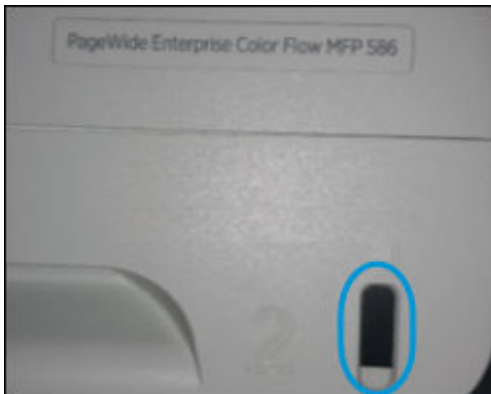

If the window shows black on top and some white on the bottom, the cause might be a dirty or damaged print bar lift motor encoder disc and sensor, or the lift clutch might be failing.

- a. Inspect and clean the lift motor encoder disc.

Figure 6-107 The encoder disk and sensor

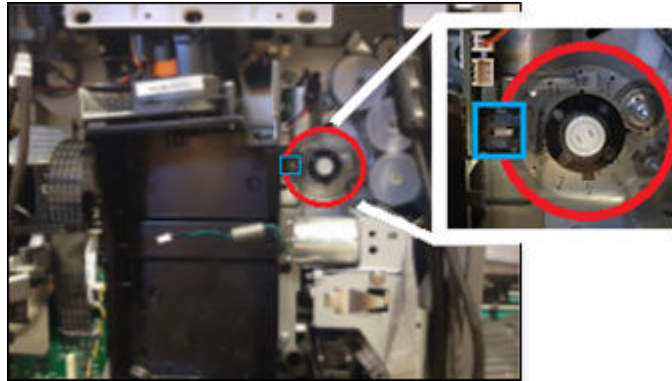

- b. After cleaning the encoder disc and sensor, reinstall the Main PCA and covers.
- c. Turn the printer OFF and then ON.
- d. If the printer boots to **READY**, try to print to see if the issue is resolved.
- e. If the printer boots to an error again, open the supply access door and see if the printbar tray is visible.
- f. If the printbar tray is NOT visible, the error is likely caused by a printbar lift assembly failure. Replace the printbar lift mechanism assembly.

Part number: D3Q24-67076

For a written procedure on replacing the printbar lift motor clutch kit, please see [Removal and replacement: Printbar lift motor clutch kit](#) (c05294006).

View the following video for more information on replacing the lift clutch spring and printbar assembly:

[How To Replace the Lift Clutch Spring - HP OfficeJet Pro X and PageWide Pro Printers](#)

81.XX.YY, 82.XX.YY error messages

82.* errors

Errors in the 82.* family indicate a problem with an external I/O device, such as a Jetdirect card, an EIO card, or an external hard disk.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. Reload the printer firmware.

For the latest firmware versions, Go to: [HP FutureSmart - Latest Firmware Versions](#)

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. For 82.* errors, reload the printer firmware.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

4. Replace the formatter.

81 . wx . yz Embedded Jetdirect Error To continue turn off then on

The product experienced an embedded HP Jetdirect print server critical error.

81 . 01 . 00 EIO Event

81 . 03 . 00 Access Point Wireless Network event

81 . 04 . 00 JetDirect inside Network event

81 . 06 . 00 Internal EIO Networking event

81 . 08 . 00 Internal Access Point Wireless Network event

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. Check all EIO connections
4. Replace the formatter.

Part number: Formatter (SFP) - G1W46-67911

Part number: Formatter (SFP India/China) - G1W46-67912

Part number: Formatter (MFP) - G1W39-67914

Part number: Formatter (MFP India/China) - G1W39-67939

For instructions: See the Repair Service Manual for this product.

81 . wx . 00 Wireless Network Error To continue turn off then on

A wireless network component on the product has failed.

81 . 02 . 00 Wireless network Event

81 . 07 . 00 Internal Wireless Networking event

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the product off then on.
2. Turn the product off, reseal the wireless network component and turn the product back on.
3. If error persists, replace the wireless network component.

Part number: J8030-61001

For instructions: See the Repair Service Manual for this product.

82 . 73 . 45 Disk Successfully cleaned

Event log only, disk successfully cleaned.

Recommended action

- No action necessary.

82 . 73 . 46, 82 . 73 . 47

A hard disk or compact flash disk cleaning failed.

This error is usually caused by a failure of the disk hardware.

Recommended action for customers

1. Turn the product off, and then on.
2. Reload the printer firmware.
Go to: [HP FutureSmart - Latest Firmware Versions](#)
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Use the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

3. Reload the firmware.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

98.0X.0Y error messages

98.* errors

Errors in the 98.* family are related to data corruption in the firmware.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, Go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Download and install the most current version of the firmware.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Use the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

4. Reload the firmware.

98.00.01 or 98.01.00 Corrupt data in firmware volume

Data corruption has occurred in the firmware volume.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, Go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Use the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

3. Reload the firmware.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

98 . 00 . 02 Corrupt data in the solutions volume

Data corruption has occurred in the solutions volume.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, Go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Use the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

3. Reload the firmware.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

98.00.03 Corrupt data in the configuration volume

Data corruption has occurred in the configuration volume.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, Go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Download the firmware again, and then attempt the upgrade again.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Use the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

4. Reload the firmware.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

98.00.04 Corrupt data in the job data volume

Data corruption has occurred in the job data volume.

Recommended action

1. Turn the printer off, and then on.
2. Make sure the printer is running the most current version of firmware.

For the latest firmware versions, Go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Rerun the file erase function.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

99.XX.YY error messages

99.* errors

Errors in the 99.* family are related to the firmware upgrade process.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Make sure the connection to the network is good, and then try the firmware upgrade again.
2. If the error persists, try using the USB upgrade method.

For the more information, Go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Make sure the connection to the network is good, and then try the upgrade again.
2. Try using the USB upgrade method.
3. If the error persists, run the [Format Disk](#) process from the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

4. If the error persists, replace the hard disk drive.



NOTE: Do NOT replace the formatter board, it will not resolve the issue.

99 . 00 . 01 Upgrade not performed file is corrupt

A remote firmware upgrade (RFU) was not performed.

This is a CRC error in the firmware image (bad image).

Recommended action

- Download the firmware upgrade file, and then attempt the upgrade again.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

99 . 00 . 02 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading the header number and size. It indicates a problem with the network environment, not the product.

Recommended action

The most common cause is an issue with the network environment.

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



NOTE: If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information,Go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)

99 . 00 . 03 Upgrade not performed error writing to disk

A remote firmware upgrade (RFU) was not performed.

This is a disk error. It might indicate a problem or a hard disk failure. It might be necessary to check the connection to the hard disk or replace the hard disk.

Recommended action

1. Download the RFU file, and then attempt the upgrade again.
2. If the error persists, run the [Clean Disk](#) process from the [Preboot](#) menu.
You will need to download the firmware from the [Preboot](#) menu.
3. If the error persists, replace the hard disk.

For instructions: *Removal and replacement: Hard disk drive (HDD)*

Part number: G1W41-67902

99 . 00 . 04 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading the header.

The most common cause is an issue with the network environment.

Recommended action

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



NOTE: If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information,Go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)

99 . 00 . 05 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading image data.

The most common cause is an issue with the network environment.

Recommended action

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



NOTE: If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information, Go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)

99 . 00 . 06 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

The issue is an unexpected read error when reading the header number and size.

Recommended action

1. Download the RFU file, and then attempt the upgrade again.
2. If the error persists, replace the hard disk.

For instructions: *Removal and replacement: Hard disk drive (HDD)*

Part number: G1W41-67902

99 . 00 . 07 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

The issue is an unexpected read error when reading the rest of the header.

Recommended action

1. Download the RFU file, and then attempt the upgrade again.
2. If the error persists, replace the hard disk.

For instructions: *Removal and replacement: Hard disk drive (HDD)*

Part number: G1W41-67902

99 . 00 . 08 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

The issue is an unexpected read error when reading image data.

Recommended action

1. Download the RFU file, and then attempt the upgrade again.

2. If the error persists, replace the hard disk.

For instructions: *Removal and replacement: Hard disk drive (HDD)*

Part number: G1W41-67902

99 . 00 . 09 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled.

Recommended action

- Resend the remote firmware upgrade (RFU).

99 . 00 . 10 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled when reading the header number and size.

Recommended action

- Resend the remote firmware upgrade (RFU).

99 . 00 . 11 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled when reading the rest of the header, after reading the header number and size.

Recommended action

- Resend the remote firmware upgrade (RFU).

99 . 00 . 12 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The header number is 1, but the header size does not match version 1 size.

Recommended action

1. Download the remote firmware upgrade (RFU) file again.
Make sure that you download the file for the correct printer model.
For the latest firmware versions, Go to: [HP FutureSmart - Latest Firmware Versions](#)
2. Resend the RFU.

99 . 00 . 13 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The header number is 2, but the header size does not match version 2 size.

Recommended action

1. Download the remote firmware upgrade (RFU) file again.
Make sure that you download the file for the correct printer model.
For the latest firmware versions, Go to: [HP FutureSmart - Latest Firmware Versions](#)
2. Resend the RFU.

99.00.14 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The file is invalid.

Recommended action

1. Download the remote firmware upgrade (RFU) file again.
Make sure that you download the file for the correct printer model.
For the latest firmware versions, Go to: [HP FutureSmart - Latest Firmware Versions](#)
2. Resend the RFU.

99.00.2x

There is a compatibility issue with the firmware.

The specific message varies depending on the cause, but the solution for each message is the same.

- 99.00.20 (event log)
The bundle is not for this product.
- 99.00.21 (event log)
The bundle is not signed with the correct signature, or the signature is invalid.
- 99.00.22 (event log)
The bundle header version is not supported by this firmware.
- 99.00.23 (event log)
The package header version is not supported by this firmware.
- 99.00.24 (event log)
The format of the bundle is invalid.
- 99.00.25 (event log)
The format of the package is invalid.
- 99.00.26 (event log)
A CRC32 check did not pass.
- 99.00.27 (event log)

An I/O error occurred while downloading the bundle.

Recommended action

1. **99.00.27 only:** Turn the product off, and then on.
2. Download the correct firmware file, and then resend the firmware upgrade.
Go to: [HP FutureSmart - Latest Firmware Versions](#)
3. If the error persists, try installing the upgrade by another method (USB or Embedded Web Server).

99.01.xx

A firmware install error has occurred.

The specific message varies depending on the cause, but the solution for each message is the same.

- 99.01.00
- 99.01.10
- 99.01.20
- 99.01.21

Recommended action

- Reload the firmware.

99.02.01

Firmware installation was successful.

Recommended action

- No action necessary.

99.02.09

Firmware upgrade cancelled by user.

Recommended action

- No action necessary.

99.09.60 Unsupported disk

The hard disk currently installed is not recognized or supported by the product.

This is a [Preboot](#) menu error.

Recommended action

- Install the correct hard disk for this product.
For instructions: *Removal and replacement: Hard disk drive (HDD)*

99.09.61 Unsupported disk

The hard disk drive installed is not support in this printer.

The hard disk drive (HDD) is not encrypted and the printer is configured for an encrypted HDD.

Recommended action



NOTE: Do NOT replace the formatter board, it will not resolve this error.

- Access the [Preboot](#) menu, and then select [Lock Disk](#) to lock the disk.
 - a. Access the [Preboot](#) menu
 - b. Turn the product on.
 - c. Touch the HP logo that displays in the center of the touchscreen until the [Preboot](#) menu item opens.
 - d. Use the arrow buttons on the touchscreen to navigate the [Preboot](#) menu.
 - e. Touch the [OK](#) button to select a menu item.

99.09.62 Unknown disk

This error indicates that there is an encryption mismatch between the HDD and the formatter.

This typically happens because an HDD was swapped into a device from another device.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action



NOTE: Do NOT replace the formatter board, it will not resolve this error.

1. Use the [Preboot](#) menu to unlock the disk.
 - a. Access the [Preboot](#) menu
 - b. Turn the product on.
 - c. Touch the HP logo that displays in the center of the touchscreen until the [Preboot](#) menu item opens.
 - d. Use the arrow buttons on the touchscreen to navigate the [Preboot](#) menu.
 - e. Touch the [OK](#) button to select a menu item.
2. If a disk is to be reused in a different product, execute the [Erase and Unlock](#) procedure from the [Preboot](#) menu, and then reload the firmware.

- From the [Preboot](#) menu, open the following menus:
 - [Administration](#) (select 3)
 - [Manage Disks](#) (select 6)
 - [Boot Device](#) (select 6)
 - [Erase / Unlock](#) (select 2)

3. If the previous steps did not resolve the issue, replace the hard disk drive.

99 . 09 . 63 Incorrect disk

This error indicates that the expected encrypted HDD is not present.

This is expected behavior when installing a new HDD in a device where the previous HDD was encrypted.

Recommended action

- Follow the procedure to load firmware on a new hard disk, and then lock the disk to this product.
For instructions: *Removal and replacement: Hard disk drive (HDD)*

99 . 09 . 64 Disk malfunction

A fatal hard disk failure has occurred.

Recommended action

- Replace the hard disk.
For instructions: *Removal and replacement: Hard disk drive (HDD)*
Part number: G1W41-67902

99 . 09 . 65 Disk data error

Disk data corruption has occurred.

Recommended action



NOTE: Do NOT replace the formatter board, it will not resolve this error.

- Use the [Format Disk](#) procedure from the [Preboot](#) menu, and then resend the remote firmware upgrade (RFU).

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

99 . 09 . 66 No disk installed

A disk drive is not installed in the product.

Recommended action

1. Install a compatible hard disk drive.

2. If a compatible hard disk is installed, reseal the hard disk to make sure that it is connected correctly.
3. If the error persists, replace the hard disk drive.

For instructions: *Removal and replacement: Hard disk drive (HDD)*

Part number: G1W41-67902

99 . 09 . 67 Disk is not bootable please download firmware

This is an error indicating that there is no firmware installed on the disk.

This is usually the result of installing a new disk or performing a [Clean Disk](#) operation from the [Preboot](#) menu.



NOTE: When installing a new hard drive or eMMC, the disk should be formatted through the Preboot menu, BEFORE loading firmware.

Recommended action for customers

To view solutions for a 99.09.67 errors, go to the following public document:

[HP LaserJet Enterprise, HP OfficeJet Enterprise, HP PageWide Enterprise - 99.09.67 Error](#) (c04482478).

For instructions on how to update the firmware, go to: [HP Enterprise - Update the firmware](#) (c03847902).




NOTE: Prior to loading the firmware, make sure to download the firmware from the [HP Support website](#), extract the files, and then copy the .bdl file to a portable USB flash drive.

1. Press any button to continue to the main [Preboot](#) menu.




2. Press the [Help](#) button to see the help text for the error.

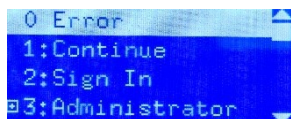

3. Select the [Administrator](#) menu.



NOTE: If there is a password assigned to the administrator, the printer displays the following prompt to enter the password. **Enter the password to proceed.**

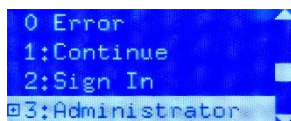


4. Select the [Format disk](#) option, select [OK](#).


5. Select the [Download](#) option, and then download the latest firmware.

Make sure that you download the file for the correct printer model.


For the latest firmware versions, Go to: [HP FutureSmart - Latest Firmware Versions](#)

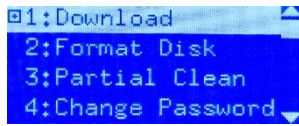


6. Select the [USB Thumbdrive](#) option, and then download the latest firmware.

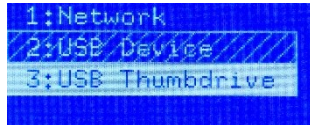


7. Select the .bdl file, and then press [OK](#). Wait for the update process to complete.

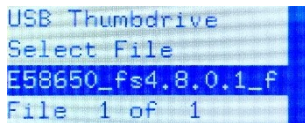


 **NOTE:** The following error message displays if the firmware is not recognized "**No USB Thumbdrive or Files found.**"

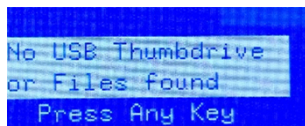


- If the firmware is not recognized when accessing the preboot menu "[USB Thumbdrive](#)" option, try doing the following tasks:
 - Formatting the USB to exFAT or Fat32.
 - Use a USB thumbdrive with less memory capacity.
 - If available on the printer, use another USB slot on the printer. (On formatter or on the front of the printer.)
- If the firmware is recognized, the control panel screen should display "[Copying files Transferring... x%](#)".

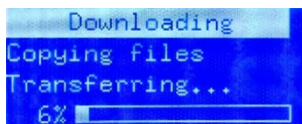

8. When [Complete](#) displays on the control panel, select the back arrow until [Continue](#) displays.

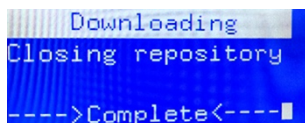

9. Select [Continue](#), and then wait for the printer to automatically reboot.

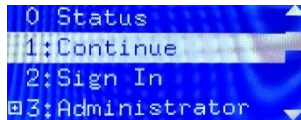

10. If you are still unable to boot the printer to a "Ready" state or if new error occurs (99.xx.xx typically), please contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agent


To view solutions for a 99.09.67 errors, go to the following public document:

[HP LaserJet Enterprise, HP OfficeJet Enterprise, HP PageWide Enterprise - 99.09.67 Error](#) (c04482478).


For instructions on how to update the firmware, go to: [HP Enterprise - Update the firmware](#) (c03847902).

 **NOTE:** Prior to loading the firmware, make sure to download the firmware from the [HP Support website](#), extract the files, and then copy the .bdl file to a portable USB flash drive.

1. Press any button to continue to the main [Preboot](#) menu.

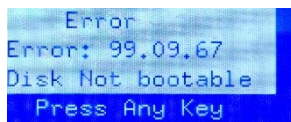


2. Press the [Help](#) button to see the help text for the error.

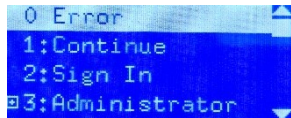

3. Select the [Administrator](#) menu.


 **NOTE:** If there is a password assigned to the administrator, the printer displays the following prompt to enter the password. **Enter the password to proceed.**

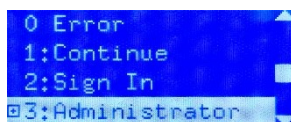

4. Select the [Format disk](#) option, select [OK](#).
5. Select the [Download](#) option, and then download the latest firmware.

Make sure that you download the file for the correct printer model.


For the latest firmware versions, Go to: [HP FutureSmart - Latest Firmware Versions](#)

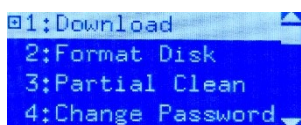


6. Select the **USB Thumbdrive** option, and then download the latest firmware.




7. Select the .bdl file, and then press **OK**. Wait for the update process to complete.

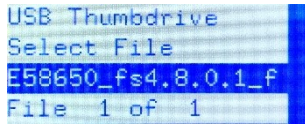


 **NOTE:** The following error message displays if the firmware is not recognized "**No USB Thumbdrive or Files found.**"

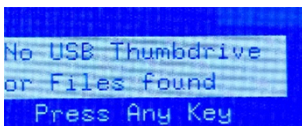


- If the firmware is not recognized when accessing the preboot menu "**USB Thumbdrive**" option, try doing the following tasks:
 - Formatting the USB to exFAT or Fat32.
 - Use a USB thumbdrive with less memory capacity.
 - If available on the printer, use another USB slot on the printer. (On formatter or on the front of the printer.)
- If the firmware is recognized, the control panel screen should display "**Copying files Transferring... x%**".

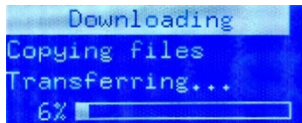

8. When **Complete** displays on the control panel, select the back arrow until **Continue** displays.

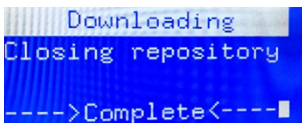

9. Select **Continue**, and then wait for the printer to automatically reboot.

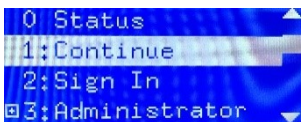


10. If the customer is still unable to boot the printer to a "Ready" state or if new error occurs (99.xx.xx typically), capture the new error and reference the CPMD for next steps.


11. If the same 99.09.67 error displays, dispatch a CE with a new Hard disk drive (HDD).
Part number: G1W41-67902

Recommended action for onsite technician

1. Press any button to continue to the main [Preboot](#) menu.

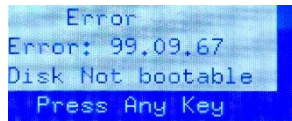


2. Press the [Help](#) button to see the help text for the error.

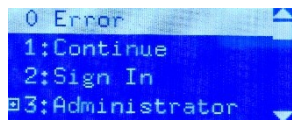

3. Select the [Administrator](#) menu.




NOTE: If there is a password assigned to the administrator, the printer displays the following prompt to enter the password. **Enter the password to proceed.**




4. Select the [Format disk](#) option, select [OK](#).
5. Select the [Download](#) option, and then download the latest firmware.

Make sure that you download the file for the correct printer model.


For the latest firmware versions, Go to: [HP FutureSmart - Latest Firmware Versions](#)

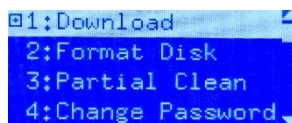

6. Select the [USB Thumbdrive](#) option, and then download the latest firmware.

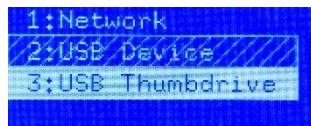


7. Select the .bdl file, and then press **OK**. Wait for the update process to complete.

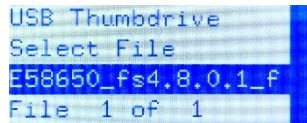


```
USB Thumbdrive
Select File
E58650_fs4.8.0.1_f
File 1 of 1
```

 **NOTE:** The following error message displays if the firmware is not recognized "**No USB Thumbdrive or Files found.**"

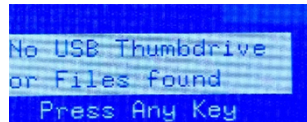


```
No USB Thumbdrive
or Files found
Press Any Key
```

- If the firmware is not recognized when accessing the Preboot menu "**USB Thumbdrive**" option, try doing the following tasks:
 - Formatting the USB to exFAT or Fat32.
 - Use a USB thumbdrive with less memory capacity.
 - If available on the printer, use another USB slot on the printer. (On formatter or on the front of the printer.)
- If the firmware is recognized, the control panel screen should display "**Copying files Transferring... x%**".

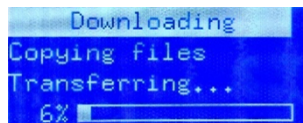


```
Downloading
Copying files
Transferring...
6%
```

8. When **Complete** displays on the control panel, select the back arrow until **Continue** displays.

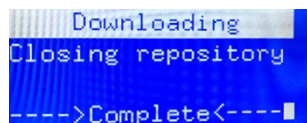

```
Downloading
Closing repository
---->Complete<----
```

9. Select **Continue**, and then wait for the printer to automatically reboot.

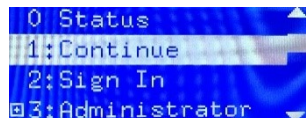

```
0: Status
1: Continue
2: Sign In
3: Administrator
```

10. If the customer is still unable to boot the printer to a "Ready" state or if a new error occurs (99.xx.xx typically), capture the new error and reference the CPMD for the next steps.
11. If the same 99.09.67 error displays, make sure to perform the the following tasks Before replacing the Hard disk drive (HDD):
- Remove the formatter cover, remove and reseal the HDD ensuring the connectors are aligned on the HDD and the connector slots on the formatter, and then install the formatter cover. Try reloading the firmware using a USB flash drive.

- Perform a Format Disk procedure using the Preboot menu (**Administrator > Format Disk**). Try reloading the firmware using a USB flash drive.



NOTE: A Format Disk erases the entire disk drive including the repository.

After performing a Format Disk procedure, the printer will boot to a **99.09.67** error. This is the expected behavior and the firmware must be reloaded to clear this error.

- Perform an [Erase / Unlock](#) procedure using the Preboot menu (**Administrator > Manage Disk > Boot Device > Erase/ Unlock**), and then try reloading the firmware using a USB flash drive.
- Perform an HDD Diagnostic procedure using the Preboot menu (**Administrator > Diagnostics > Disk > Short**). After selecting the "Short" option, navigate to [Run Selected](#), press **OK**, and then wait for the printer to complete the process.



NOTE: Make sure that only the [Short](#) option is selected on the [Disk](#) menu.

If no error displays, try selecting the [Long](#) option on the [Disk](#) menu.



NOTE: Only if any of the HDD Diagnostics fails (when the "Short" or "Long" option is selected), HDD can be replaced. Otherwise, please, elevate the case.

If HDD is deemed to be the root cause, replace the HDD, and then go back to step 1 to install the firmware on the new HDD.

For instructions to replace the HDD, go to [Removal and replacement: Hard disk drive](#)

Part number: G1W41-67902

12. If the error persists, elevate the issue using the Standard Support Process.

99.XX.YY

A message of this form indicates a firmware installation error.

Recommended action

- Reload the firmware.

7 Alphabetical control panel messages

Use the following alphabetical message to see further information on the message.

Alphabetical error messages

<binname> full Remove all paper from bin

The specified output bin is full.

Recommended action

- Empty the bin to continue printing.

<Supply> almost full

The ink collection unit is almost full.

Recommended action

- Replace the ink collection unit.

For instructions: *Removal and replacement: Ink collection unit*

Part number: B5L04-67906

<Supply> low OR Supplies low

The product indicates when a supply level, or more than one supply, is low. Actual ink cartridge life might vary. You do not need to replace the ink cartridge at this time unless print quality is no longer acceptable.

When multiple supplies are low, more than one event code is recorded.

Recommended action

HP recommends that the customer have a replacement supply available to install when print quality is no longer acceptable.



NOTE: When an HP supply has reached its approximate end of life, the HP Premium protection warranty ends.

- If print quality is no longer acceptable, replace the supply.

<Supply> very low OR Supplies very low

The product indicates when a supply level, or more than one supply, is low. Actual ink cartridge life might vary. You do not need to replace the ink cartridge at this time unless print quality is no longer acceptable.

When multiple supplies are low, more than one event code is recorded.

Recommended action

HP recommends that the customer have a replacement supply available to install when print quality is no longer acceptable.



NOTE: When an HP supply has reached its approximate end of life, the HP Premium protection warrant ends.

- If print quality is no longer acceptable, replace the supply.

<Tray X> lifting

The product is in the process of lifting paper in the indicated tray.

- **X = 2:** Tray 2
- **X = 3:** Tray 3

Recommended action

- No action necessary.

[File System] device failure To clear touch "OK"

The specified device has failed.

Recommended action

- Touch the **OK** button to clear the error.

[File System] file operation failure To clear touch "OK"

A PJP file system command attempted to perform an invalid operation.

Recommended action

- Touch the **OK** button to clear the error.

[File System] file system is full To clear touch "OK"

A PJP file system command could not store something on the file system because the file system is full.

Recommended action

- Touch the **OK** button to clear the error.

[File System] is not initialized

This file-storage component must be initialized before use.

Recommended action

- Use the HP Embedded Web Server or HP Web Jetadmin to initialize the file system.

[File System] is write protected

The file system device is protected and no new files can be written to it.

Recommended action

- Touch the **OK** button to clear the error.

Accept bad signature

The product is performing a remote firmware upgrade and the code signature is invalid.

Recommended action

- Download the correct firmware upgrade file for the product, and then reinstall the upgrade.

For the latest firmware versions, Go to: [HP FutureSmart - Latest Firmware Versions](#)

Document feeder not detected

The document feeder was not detected when the product initialized.

Recommended action

- Make sure that the document feeder cables are connected and fully seated.

Document feeder Misfeed

The product has detected a failure to feed paper through the document feeder.

Recommended action

1. Reload the paper and try the job again.
2. If the error persists, clean the document feeder pickup and feed rollers.

Automatic Document Feeder cover open

The document feeder cover is open.

Recommended action

- Close the document feeder cover.

Bad optional tray connection

The optional tray is not connected, not connected correctly, or a connection is not working correctly.

Recommended action

1. Turn the printer off.
2. Remove and then reinstall the optional tray.

3. Reconnect the connectors for the tray.
4. If the problem continues, replace the connector for the tray.

Calibration reset pending

A calibration reset occurs when all jobs are processed.

Recommended action

- To begin the reset sooner, cancel all jobs by pressing the Stop button.

Canceling

The printer is canceling the current job.

Recommended action

- No action necessary.

Canceling...<jobname>

The printer is canceling the current job <jobname>.

Recommended action

- No action necessary.

Cartridge Problem; Ink cartridge problem

The product has detected that a cartridge is missing or damaged.

Recommended action

- Replace the cartridge indicated in the error message.

Checking engine

The printer is conducting an internal test.

Recommended action

- No action necessary.

Checking paper path

The printer is checking for possible paper jams.

Recommended action

- No action necessary.

Chosen personality not available To continue touch "OK"

A print job requested a printer language (personality) that is not available for this printer. The job will not print and will be cleared from memory.

Recommended action

- Print the job by using a print driver for a different printer language, or add the requested language to the printer (if possible). To see a list of available personalities, print a configuration page.
 - a. From the Home screen on the printer control panel, go to the following menus: **Reports > Configuration/Status Pages**
 - b. Select [Configuration Page](#), then select the [Print](#) button to print the pages.

Clear Output Area

The product has detected a jam in the output area.

Recommended action

1. Remove any paper from the output flap area.
2. Make sure that the flap can open and close. If it cannot, replace the output flap.

Part number: D3Q24-67004

Clearing event log

This message is displayed while the event log is cleared. The printer exits the menus when the event log has been cleared.

Recommended action

- No action necessary.

Clearing paper path

The printer is attempting to eject jammed paper.

Recommended action

- Check the progress at the bottom of the display.

Close Ink Access Door

The product has detected that the ink cartridge door is open.

Recommended action

1. Close the door.
2. Run the test in the sensor monitor mode to verify that the ink supply door open sensor is functioning properly. If it is not, replace the front door open detection switch.
3. Check the sensor flag on the front door open detection sensor. If the flag is damaged, replace the front cover.

For instructions: *Removal and replacement: Front cover*

Part number: G1W39-67918

Close Left door

The product has detected that the left door is open.

Recommended action

1. Close the door.
2. Check the sensor flag on the left door. If the flag is damaged, replace the left door assembly.

For instructions: See the Repair Service Manual for this product.

Part number: G1W39-67926

Close upper Left door

The product has detected that the upper left door is open.

Recommended action

1. Close the door.
2. Check the sensor flag on the left door. If the flag is damaged, replace the left door assembly.

For instructions: See the Repair Service Manual for this product.

Part number: G1W39-67926

Cooling device

The printer is cooling.

Recommended action

- No action necessary.

Counterfeit Cartridge Advisory

The product has detected a possibly counterfeit cartridge.

This is a software message only.

Recommended action

- At the computer, click the hypertext link to report fraud, or click the **Continue** button to clear the message.

Data received To print last page press "OK"

The printer is waiting for the command to print the last page.

Recommended action

- Touch the "OK" button on the control panel to print the last page of the job.

Do not use startup cartridges

The startup cartridges that came with the product cannot be used after the product has been initialized.

Recommended action

- Remove those cartridges, and then install non-startup cartridges.

Empty Ink Cartridge

The product cannot detect ink in the indicated cartridge.

Recommended action

1. If ink is still present in the cartridge, touch the [OK](#) button to continue printing.
2. If the cartridge is empty, replace the cartridge.

Event log is empty

No printer events are in the log.

Recommended action

- No action necessary.

Expected drive missing

The printer cannot find the encrypted hard drive.

Recommended action

- Install the encrypted hard disk drive.

Fax is disabled – ignoring call

The product received a call, but the fax feature was not configured with the required settings (country/region, date/time, company name, fax number, etc.).

Recommended action

- Use the [Administration](#) menu to configure the required fax settings.

FIM Load Error Send full FIM on <X> port

The printer displays this message before the firmware is loaded at startup if an error has occurred during a firmware upgrade.

Recommended action

- Re-send the firmware upgrade.

Flatbed cover open or Close Flatbed cover

The platen glass cover is open or the open/closed sensor is not functioning correctly.

Recommended action

1. Close the flatbed cover.

2. If the error persists, perform a sensors diagnostic in the [Diagnostics](#) menu on the product control panel to test the flatbed open/closed sensor.
3. Clean, adjust, or replace the sensor as needed.

Gateways failed

There is an incorrect gateways configuration.

Recommended action

- Use the [EIO <X> Jetdirect](#) menu to configure the default gateway.

Gateways OK

The gateways are configured correctly.

Recommended action

- No action necessary.

Genuine HP cartridge installed

A new HP cartridge has been installed. The message appears for about 6 seconds before the product returns to the ready state.

Recommended action

- No action necessary.

Genuine HP supply installed

A new genuine HP supply has been installed.

Recommended action

- Touch the [Hide](#) button to remove this message.

HP Protected Cartridge Installed

The product has detected cartridges that were locked in another product using the HP Cartridge Protection feature.

- 17.00.57: (event code) Black cartridge
- 17.01.57: (event code) Cyan cartridge
- 17.02.57: (event code) Magenta cartridge
- 17.03.57: (event code) Yellow cartridge

Recommended action

Cartridges locked in another product will not work in this product.

- Replace the cartridge indicated in the error message.

HP Secure hard drive disabled

The hard disk drive has been encrypted for another printer.

Recommended action

- Remove the hard disk drive or use the Embedded Web Server for more information.

Incompatible ink cartridges

The product has detected a cartridge or cartridges that are not for use with the product.

- 17.00.35 : (event code) Black cartridge
- 17.01.35 : (event code) Cyan cartridge
- 17.02.35 : (event code) Magenta cartridge
- 17.03.35 : (event code) Yellow cartridge

Recommended action

- Replace the supply with one that is designed for this product.

Ink cartridges depleted

One or more of the ink cartridges is empty.

- 17.00.80 : (event code) Black cartridge
- 17.01.80 : (event code) Cyan cartridge
- 17.02.80 : (event code) Magenta cartridge
- 17.03.80 : (event code) Yellow cartridge

Recommended action

- Replace the empty cartridge or cartridges indicated in the error message.

Ink Sensor Failure

The product ink sensor has failed and the product no longer prints.

- 17.00.42 : (event code) Black cartridge
- 17.01.42 : (event code) Cyan cartridge
- 17.02.42 : (event code) Magenta cartridge
- 17.03.42 : (event code) Yellow cartridge

Recommended action

1. Turn the product off and then on.
2. Replace the cartridge.

3. If the issue persists, elevate the case using the Standard Support Process.

Low on ink

The ink level in the indicated cartridge has reached a low level.

- 17.00.60 : (event code) Black cartridge
- 17.01.60 : (event code) Cyan cartridge
- 17.02.60 : (event code) Magenta cartridge
- 17.03.60 : (event code) Yellow cartridge

Recommended action

HP recommends having a replacement cartridge ready for when the cartridge is empty.

- It is not necessary to replace the cartridge at this point.

Initializing...

The printer is starting.

Recommended action

- No action necessary.

Install <supply>

The indicated cartridge is not installed, missing or has a damaged acumen.

- 17.00.65 : (event code) Black cartridge
- 17.01.65 : (event code) Cyan cartridge
- 17.02.65 : (event code) Magenta cartridge
- 17.03.65 : (event code) Yellow cartridge

Recommended action

- Install the supply item or make sure that the installed supply item is fully seated.

Internal disk device failure To clear touch "OK"

The internal disk failed.

82.0X.YY (event code)

Recommended action

1. Touch the OK button to clear the error.
2. If the error persists, turn off the product, and then remove and reinstall the hard drive.
3. Turn on the product.
4. If the error persists, replace the internal hard drive.

Internal disk file operation failed

A PjL system command attempted to perform an illogical operation, such as downloading a file to a nonexistent directory.

Recommended action

- Touch the **OK** button to clear the error.

Internal disk file system is full

A PjL system command attempted to write data to the internal hard disk drive but was unsuccessful because the hard disk drive is full.

Recommended action

- Touch the **OK** button to clear the error.

Internal disk is write protected

The internal hard disk drive is write protected and no new files can be written to it.

Recommended action

- Touch the **OK** button to clear the error.

Internal disk not found

The internal hard disk drive was not found at start up.

Recommended action

- Turn the printer off, and then on.

Internal disk not functional

The internal hard drive is not functioning correctly.

82 . 0X . YY (event code)

Recommended action

1. Turn off the product, and then remove and reinstall the hard drive.
2. Turn on the product.
3. If the error persists, replace the internal hard drive.

For instructions: *Removal and replacement: Hard disk drive (HDD)*

Part number: G1W41-67902

Internal disk not initialized

The internal hard disk drive file system must be initialized before it can be used.

Recommended action

- Initialize the internal hard disk drive file system.

For information on performing various actions on the hard disk drive, go to:

[HP LaserJet, OfficeJet, PageWide, ScanJet - HP FutureSmart Firmware Device Hard Disk, SSD, and eMMC Security \(white paper\)](#)

Internal disk spinning up

The internal hard disk drive device is spinning up its platter. Jobs that require hard disk drive access must wait.

Recommended action

- No action necessary.

Jam in document feeder

A document feeder jam has occurred.

Recommended action


- Clear the jam.

Load Tray 1: [Type], [Size] To use another tray, press “OK”

This message is displayed when Tray 1 is selected as the paper input source and the tray is empty.

This message can also appear when Tray 1 is selected as the paper input source, but has a different size/type of media loaded than the print job is requesting.

Figure 7-1 Load Tray <1>: [Type], [Size] To use another tray, press “OK”

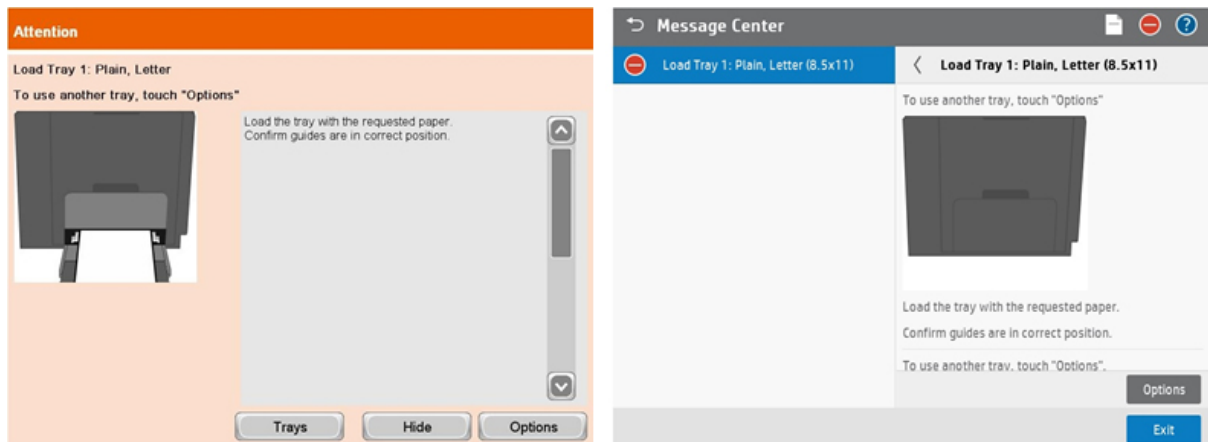

Recommended action for customers

1. Load the desired paper (Type and Size) into Tray 1.

To view a step-by-step “How-To” document with attached video, go to:

 **NOTE:** When loading paper into Tray 1, the control panel will NOT automatically prompt user to select paper type and size (as is the behavior with the cassette trays 2, 3, 4 or 5)

2. If the control panel continues to display “Load Tray 1” after media was physically loaded, use the following steps to verify if the media detection sensor for Tray 1 is operating successfully.


 **NOTE:** The following images are presented with both versions of firmware available for this printer.

- a. From the Home screen, select “Trays”

Figure 7-2 FutureSmart 3



Figure 7-3 FutureSmart 4

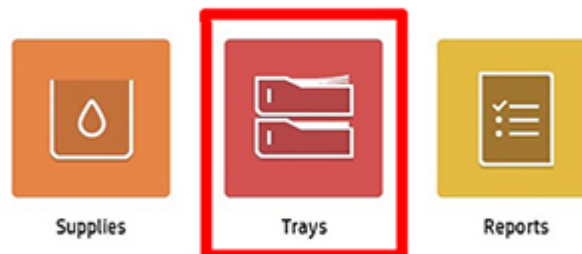

- b. On the “Trays” screen, note the value for “Status”. This should display one the following:

Figure 7-4 “OK” - The printer detects paper in Tray 1. (FutureSmart 3)

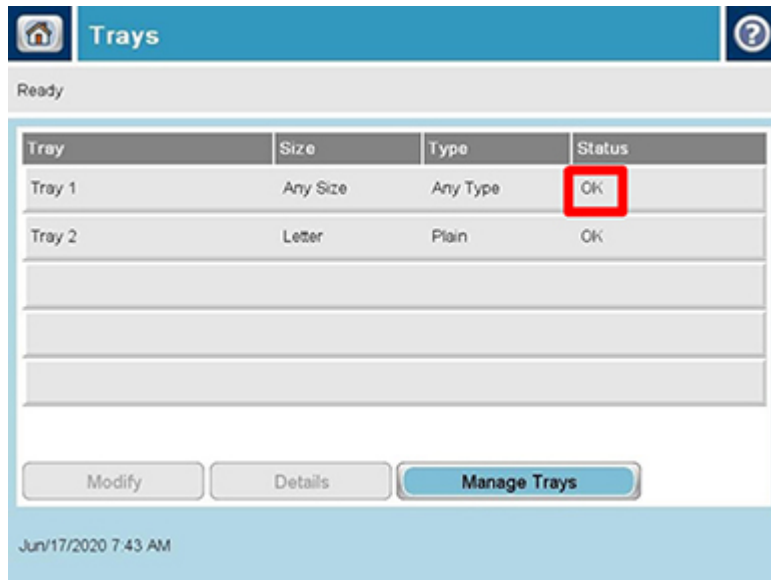


Figure 7-5 Any Size, Any Type - (FutureSmart 4)


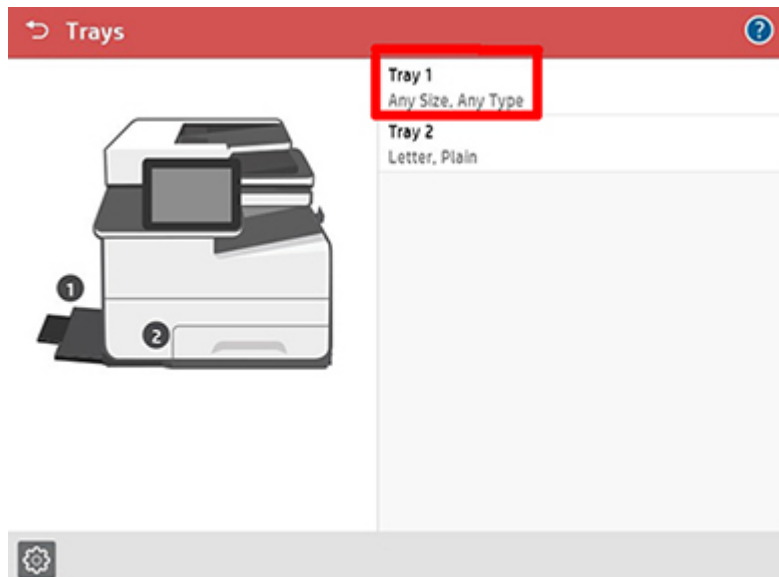


Figure 7-6 “OK” - The printer detects paper in Tray 1. (FutureSmart 4)

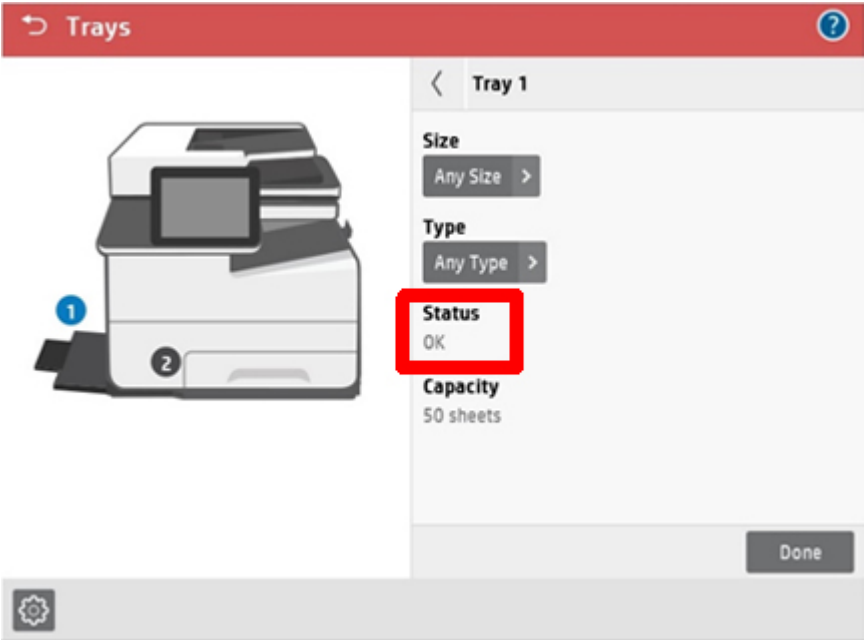

OR

Figure 7-7 “Empty” - The printer does NOT detect paper in Tray 1 (FutureSmart 3)


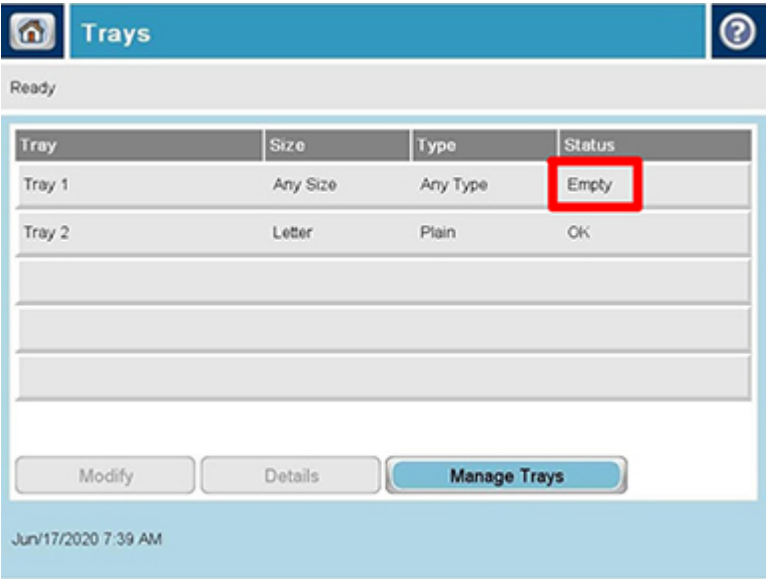


Figure 7-8 “Empty” - The printer does NOT detect paper in Tray 1 (FutureSmart 4)

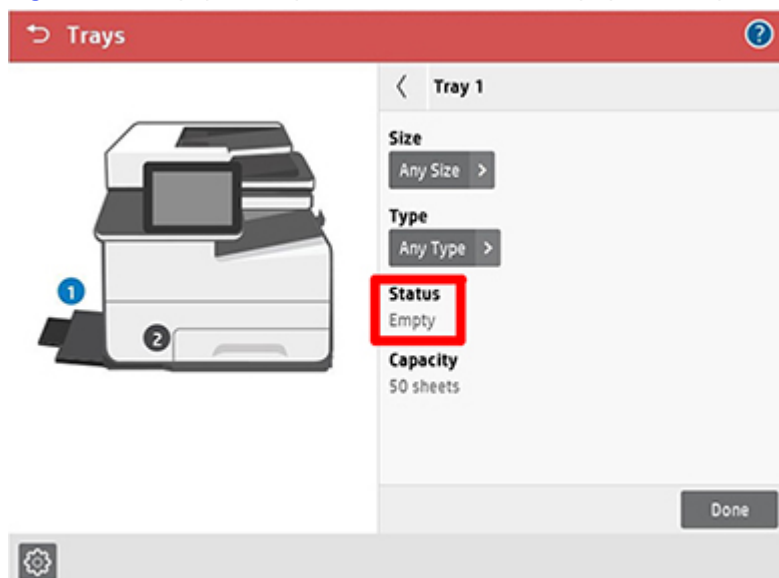

- c. If removing and reinserting paper into Tray 1 does NOT change this status, this can indicate a the media detection sensor for Tray 1 issue. Contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.
3. If the status DOES change when removing and reinserting paper into Tray 1. Set up the [Manual Feed Prompt](#) on the printer to indicate whether a prompt should appear when the type or size for a job does not match the specified tray and the printer pulls from the multipurpose tray (Tray 1) instead.

Figure 7-9 Manage Trays - Manually Feed Prompt (FutureSmart 3)


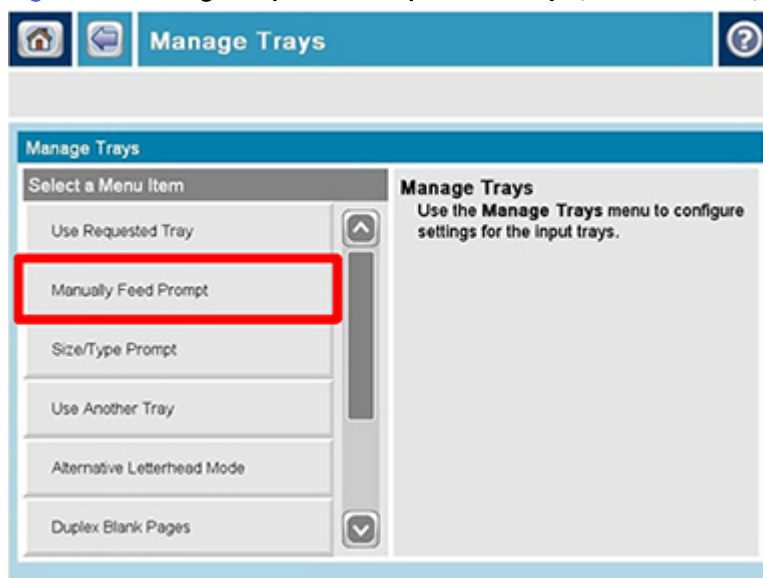


Figure 7-10 Manage Trays - Manually Feed Prompt (FutureSmart 4)

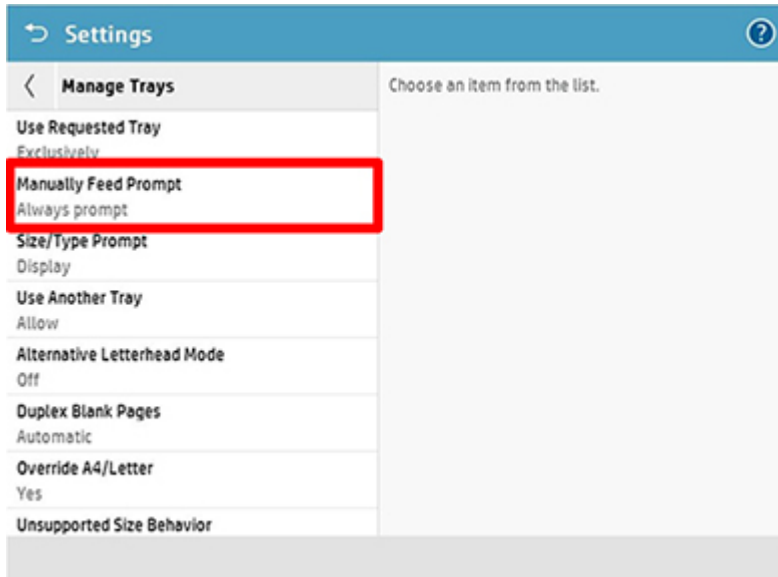

Two options are available.

- a. **Always:** A prompt always displays before using the multipurpose tray.

Figure 7-11 Set to Always (FutureSmart 3)


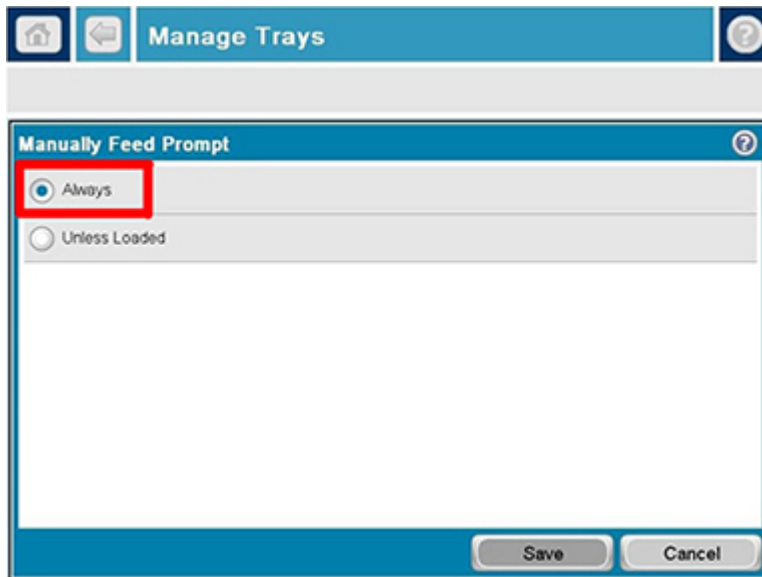


Figure 7-12 Set to Always (FutureSmart 4)

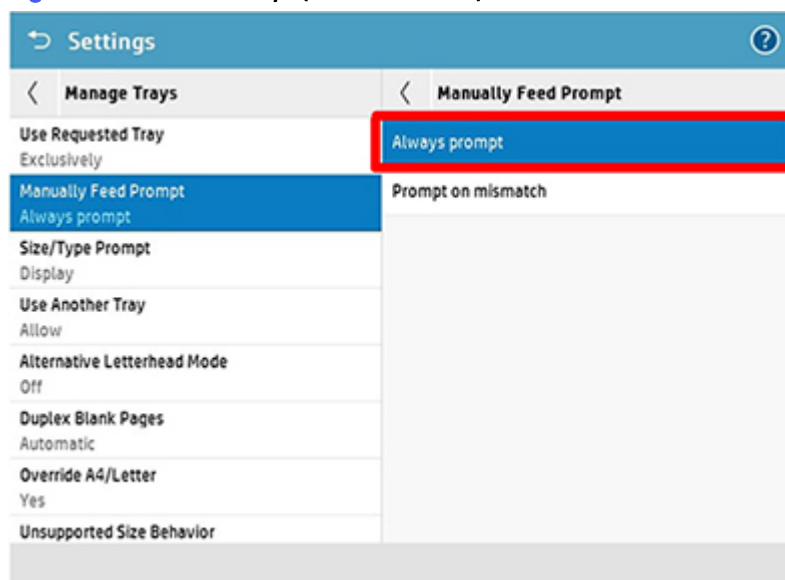

- b. **Unless loaded:** A message displays only if the multipurpose tray is empty.

Figure 7-13 Set to Unless Loaded (FutureSmart 3)


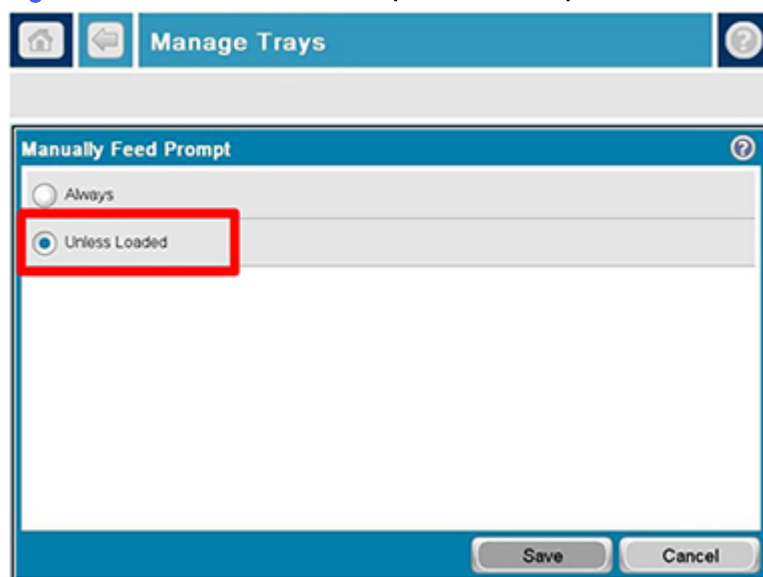


Figure 7-14 Set to Unless Loaded (FutureSmart 4)

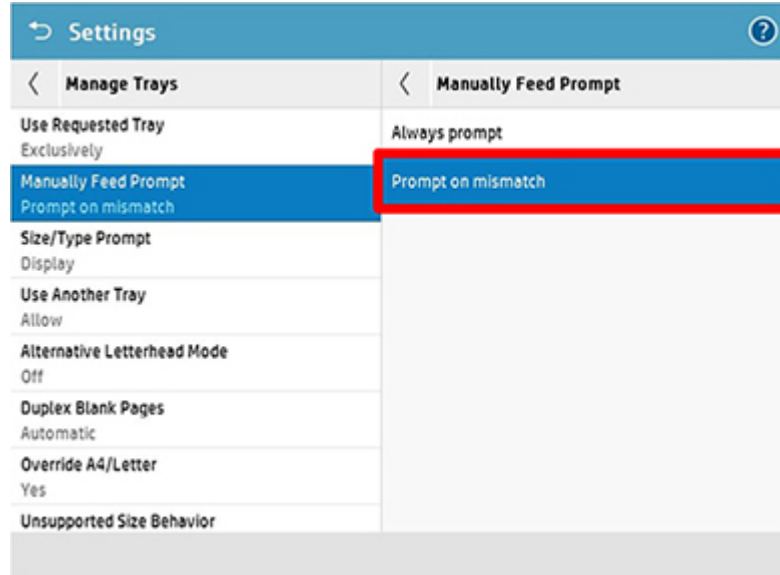

- c. For additional information about: How to: Check if Tray or paper settings mismatch go to:

[HP PageWide 300, 400, 500 series - Solve Tray or Paper Mismatch Errors](#)

4. If the issue persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

1. Load the desired paper (Type and Size) into Tray 1.

To view a step-by-step “How-To” document with attached video, go to:

[HP PageWide Enterprise Color 556, MFP 586 - Load paper to Tray 1 \(multi-purpose tray\)](#)



NOTE: When loading paper into Tray 1, the control panel will NOT automatically prompt user to select paper type and size (as is the behavior with the cassette trays 2, 3, 4 or 5)

2. If the control panel continues to display “Load Tray 1” after media was physically loaded, use the following steps to verify if the media detection sensor for Tray 1 is operating successfully.




NOTE: The following images are presented with both versions of firmware available for this printer.

- a. From the Home screen, select “Trays”

Figure 7-15 FutureSmart 3



Figure 7-16 FutureSmart 4

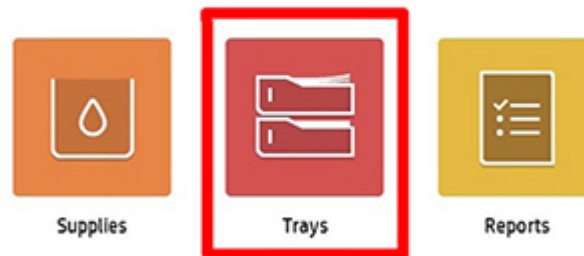

- b. On the “Trays” screen, note the value for “Status”. This should display one the following:

Figure 7-17 “OK” - The printer detects paper in Tray 1. (FutureSmart 3)

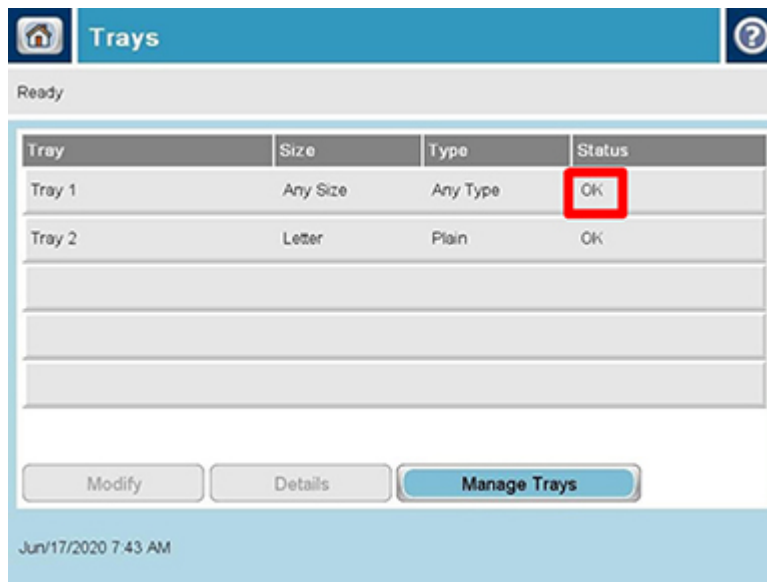


Figure 7-18 Any Size, Any Type (FutureSmart 4)


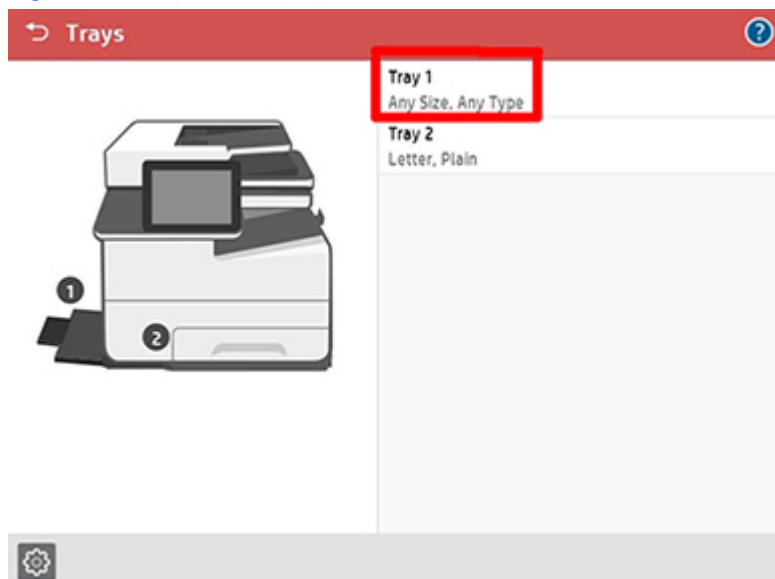


Figure 7-19 “OK” - The printer detects paper in Tray 1. (FutureSmart 4)

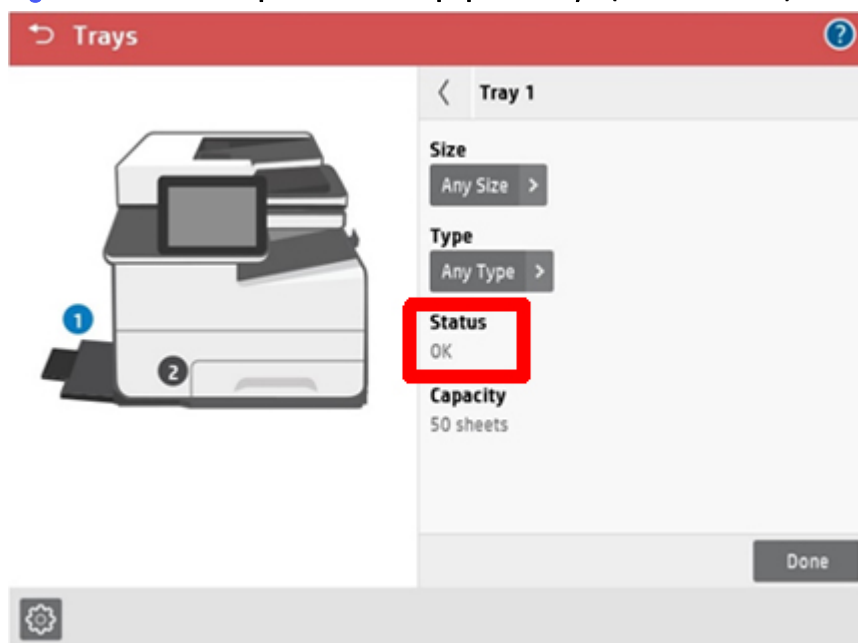

OR

Figure 7-20 “Empty” - The printer does NOT detect paper in Tray 1 (FutureSmart 3)


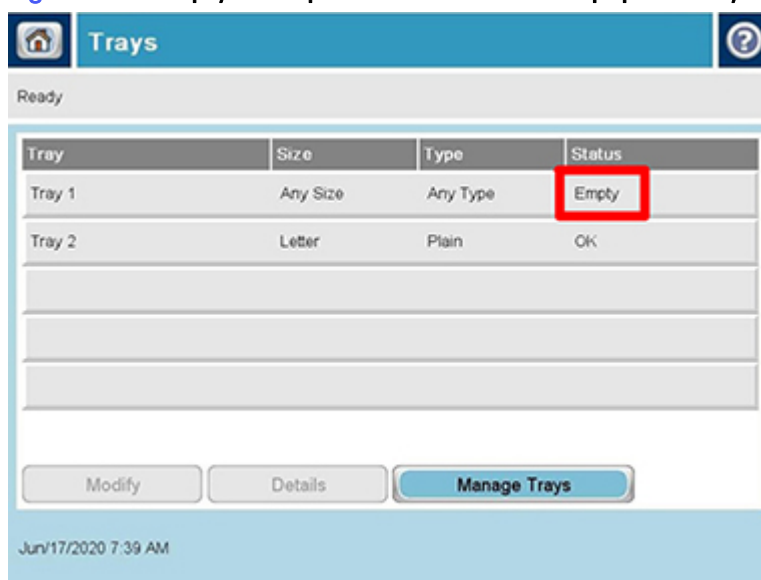


Figure 7-21 “Empty” – The printer does NOT detect paper in Tray 1 (FutureSmart 4)

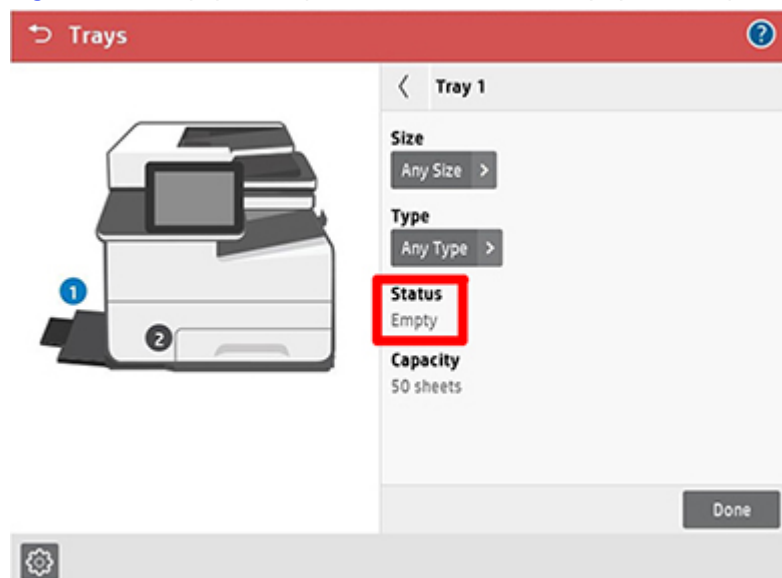

- c. If removing and reinserting paper into Tray 1 does NOT change this status, this can indicate a the media detection sensor for Tray 1 issue. The Media Detection Sensor for Tray 1 is NOT a replaceable part. A Mech Kit will be needed. Please follow your meckit/WUR policy when dispatching an Onsite Tech.
3. If the status DOES change when removing and reinserting paper into Tray 1. Set up the [Manual Feed Prompt](#) on the printer to indicate whether a prompt should appear when the type or size for a job does not match the specified tray and the printer pulls from the multipurpose tray (Tray 1) instead.

Figure 7-22 Manage Trays - Manually Feed Prompt (FutureSmart 3)


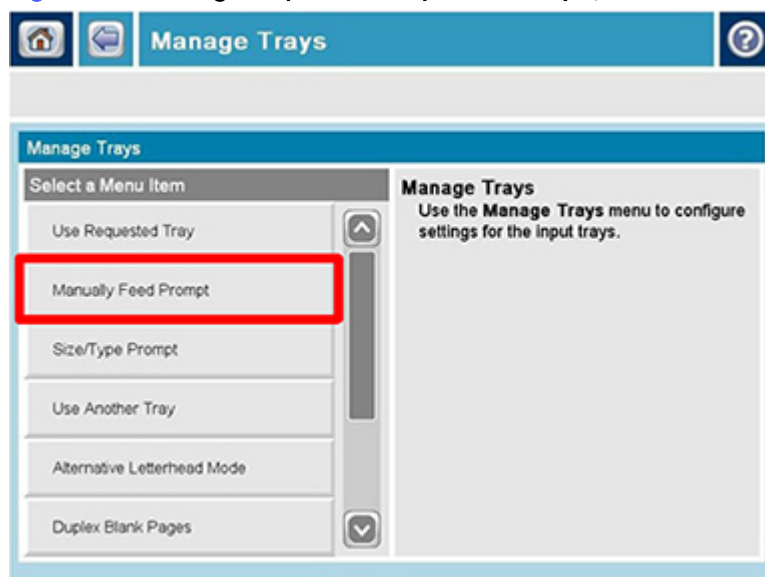


Figure 7-23 Manage Trays - Manually Feed Prompt (FutureSmart 4)

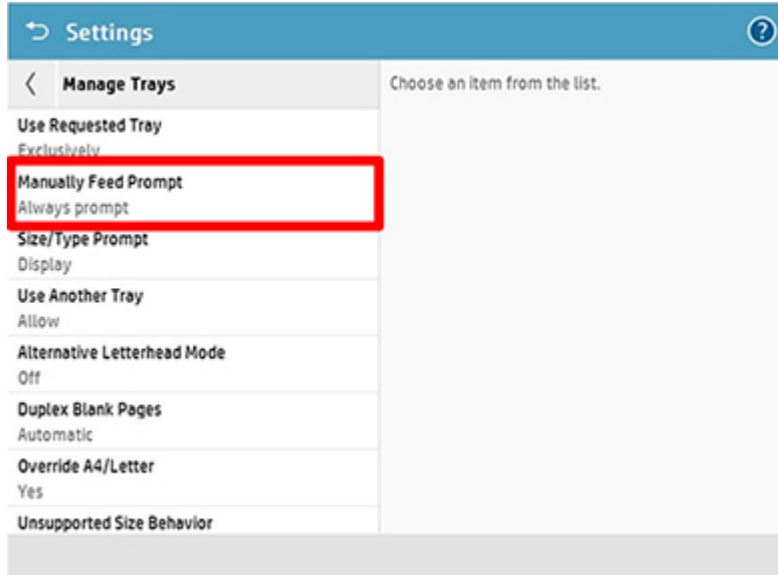

Two options are available.

- a. **Always:** A prompt always displays before using the multipurpose tray.

Figure 7-24 Set to Always (FutureSmart 3)


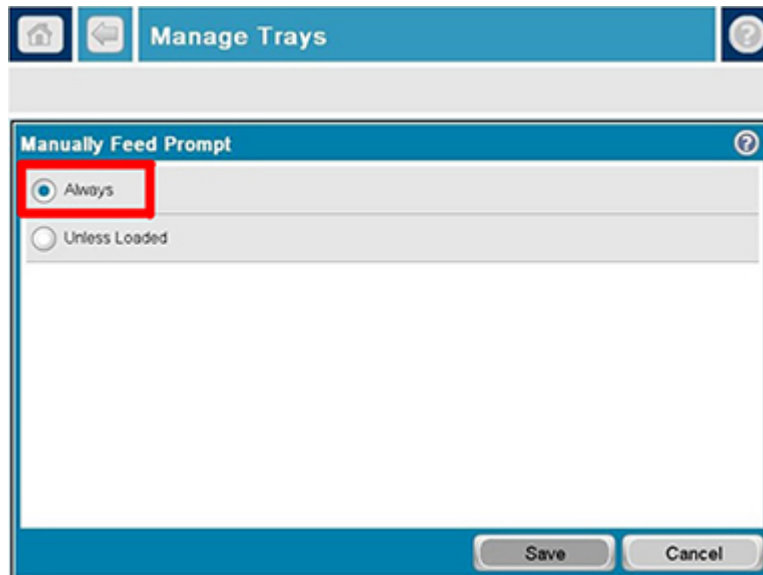


Figure 7-25 Set to Always (FutureSmart 4)

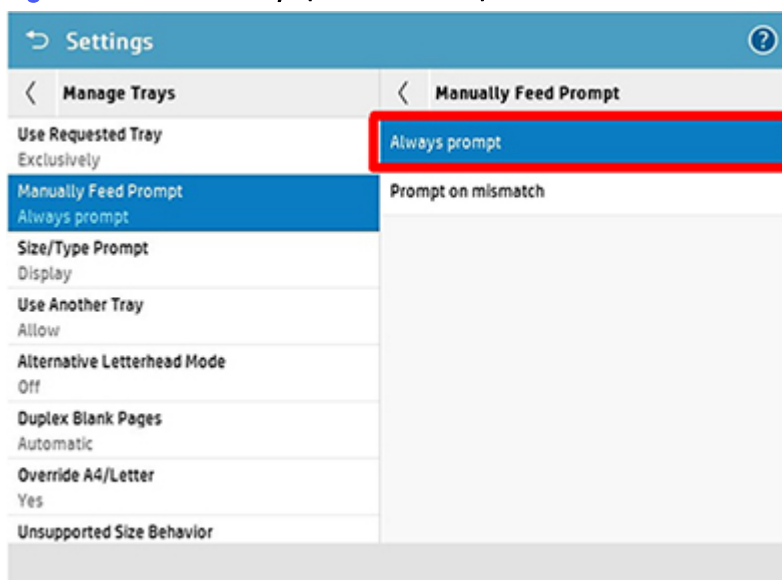

- b. **Unless loaded:** A message displays only if the multipurpose tray is empty.

Figure 7-26 Set to Unless Loaded (FutureSmart 3)


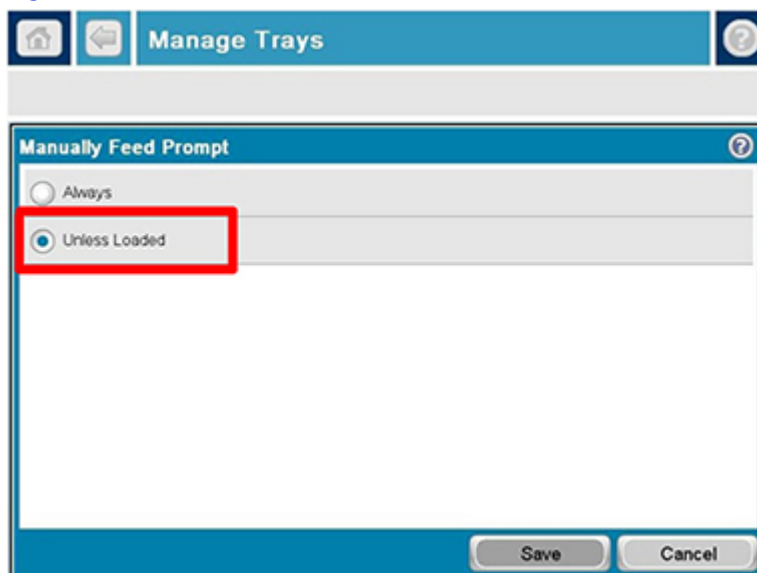


Figure 7-27 Set to Unless Loaded (FutureSmart 4)

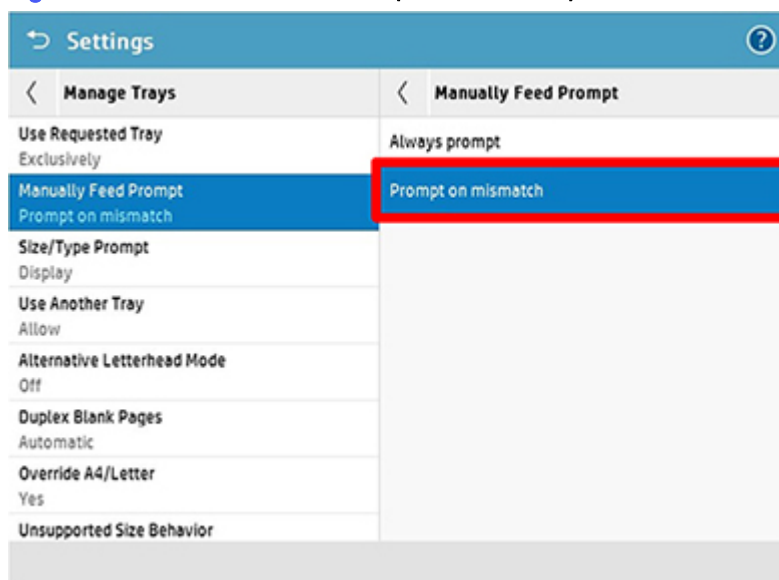

- c. For additional information about: How to: Check if Tray or paper settings mismatch go to:

[HP PageWide 300, 400, 500 series - Solve Tray or Paper Mismatch Errors](#)

Recommended action for onsite technician

1. Load the desired paper (Type and Size) into Tray 1.

To view a step-by-step “How-To” document with attached video, go to:

[HP PageWide Enterprise Color 556, MFP 586 - Load paper to Tray 1 \(multi-purpose tray\)](#)



NOTE: When loading paper into Tray 1, the control panel will NOT automatically prompt user to select paper type and size (as is the behavior with the cassette trays 2, 3, 4 or 5)

2. If the control panel continues to display “Load Tray 1” after media was physically loaded, use the following steps to verify if the media detection sensor for Tray 1 is operating successfully.




NOTE: The following images are presented with both versions of firmware available for this printer.

- a. From the Home screen, select “Trays”

Figure 7-28 FutureSmart 3



Figure 7-29 FutureSmart 4

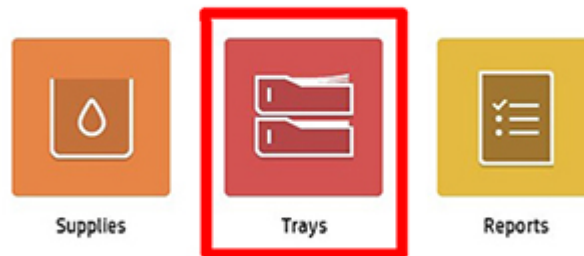

- b. On the “Trays” screen, note the value for “Status”. This should display one the following:

Figure 7-30 “OK” - The printer detects paper in Tray 1. (FutureSmart 3)

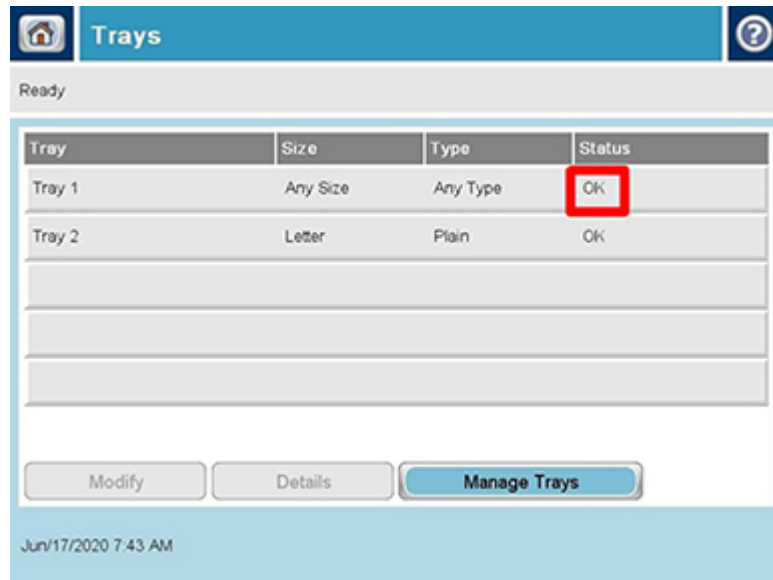


Figure 7-31 Any Size, Any Type (FutureSmart 4)


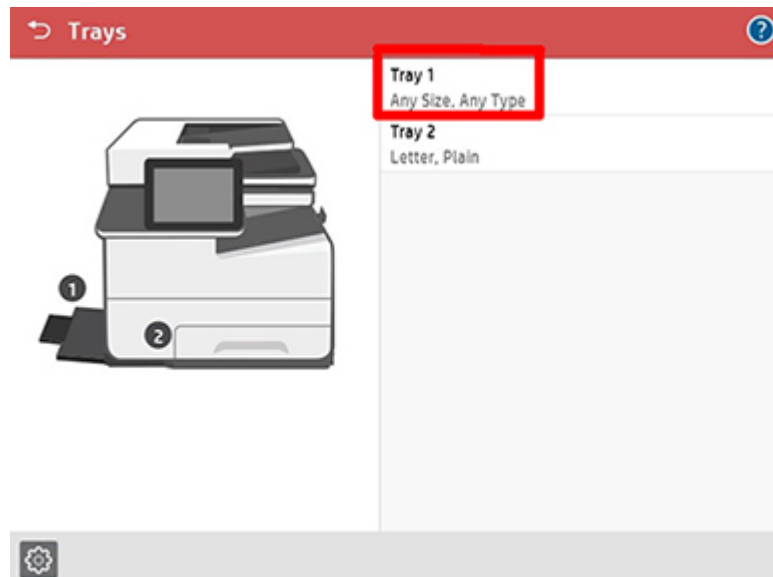


Figure 7-32 “OK” - The printer detects paper in Tray 1. (FutureSmart 4)

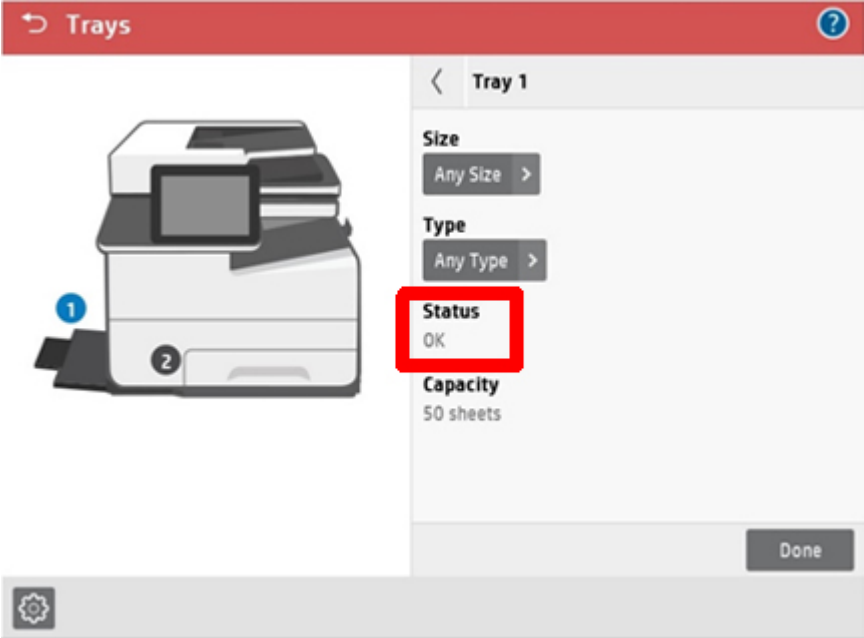

OR

Figure 7-33 “Empty” - The printer does NOT detect paper in Tray 1 (FutureSmart 3)


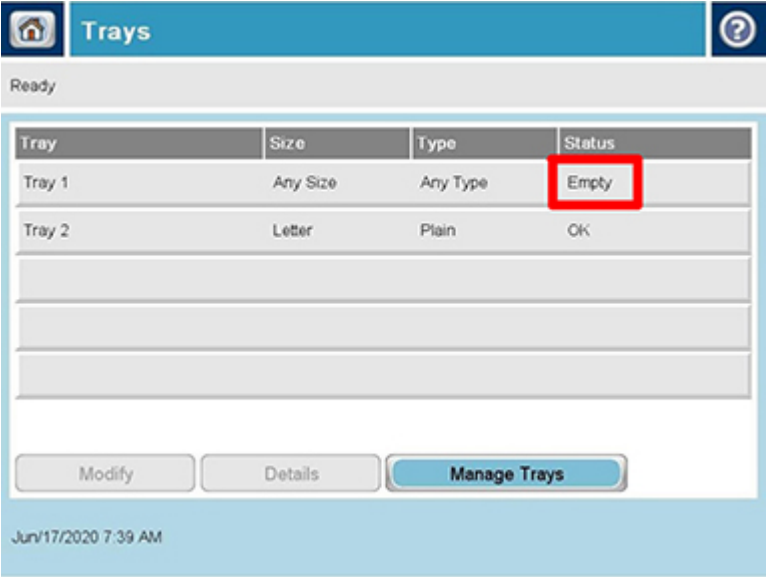


Figure 7-34 “Empty” – The printer does NOT detect paper in Tray 1 (FutureSmart 4)

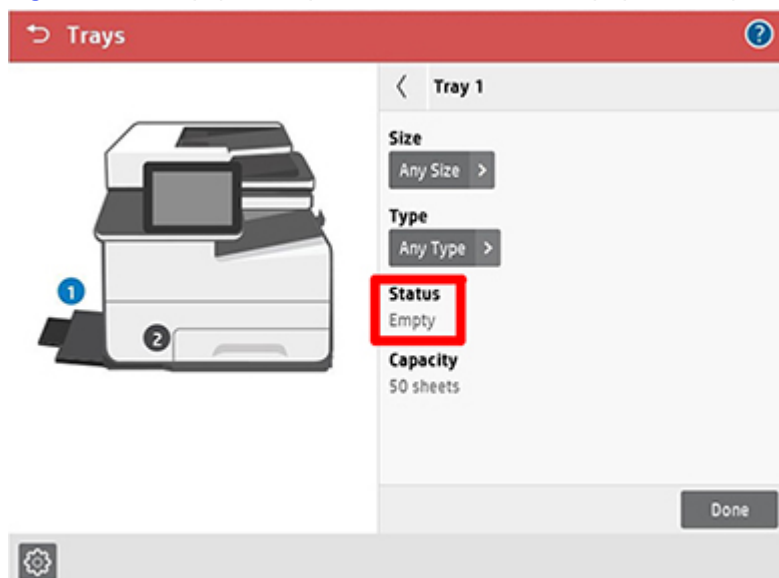

- c. If removing and reinserting paper into Tray 1 does NOT change this status, this can indicate a failure with the media detection sensor for Tray 1. Double check if the Tray 1 media detection sensor, is freely moving up and down (spring loaded), check with flashing light, if there is any blockage or paper jam. If sensor functionality can be restored, repeat the tests above, if not replace the mech Kit.
3. If the status DOES change when removing and reinserting paper into Tray 1. Set up the [Manual Feed Prompt](#) on the printer to indicate whether a prompt should appear when the type or size for a job does not match the specified tray and the printer pulls from the multipurpose tray (Tray 1) instead.

Figure 7-35 Manage Trays - Manually Feed Prompt (FutureSmart 3)


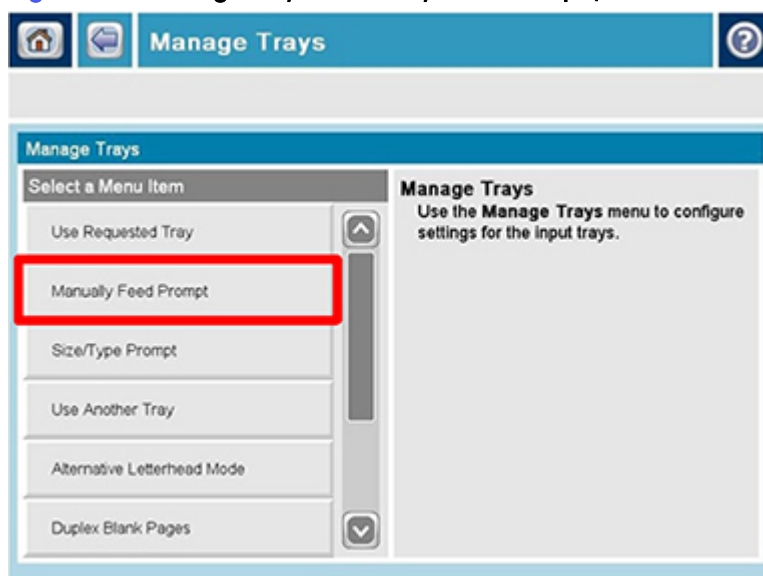


Figure 7-36 Manage Trays - Manually Feed Prompt (FutureSmart 4)

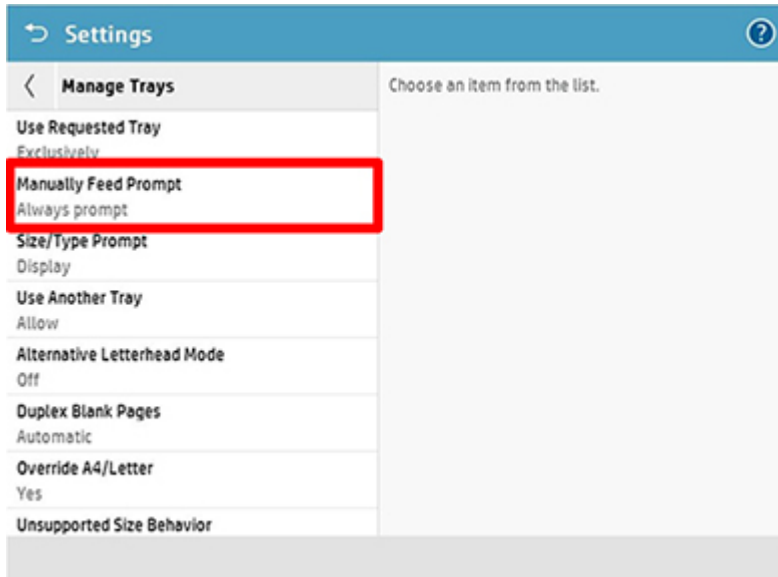

Two options are available.

- a. **Always:** A prompt always displays before using the multipurpose tray.

Figure 7-37 Set to Always (FutureSmart 3)


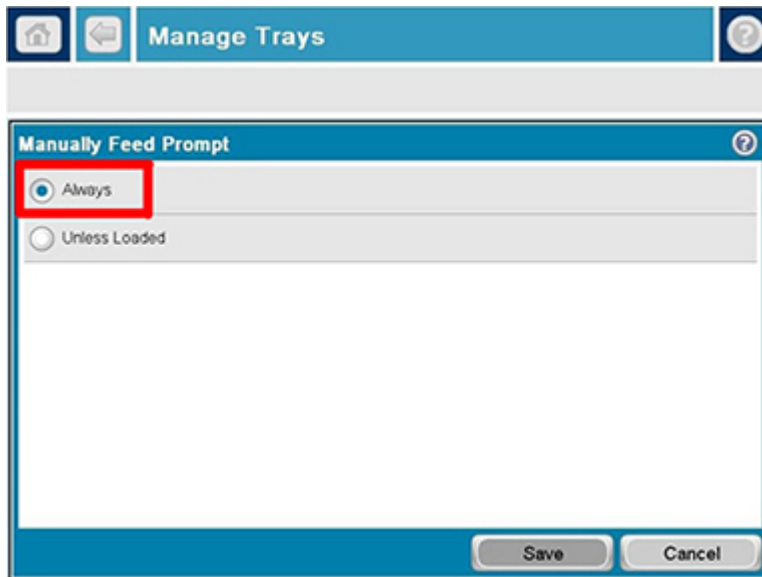


Figure 7-38 Set to Always (FutureSmart 4)

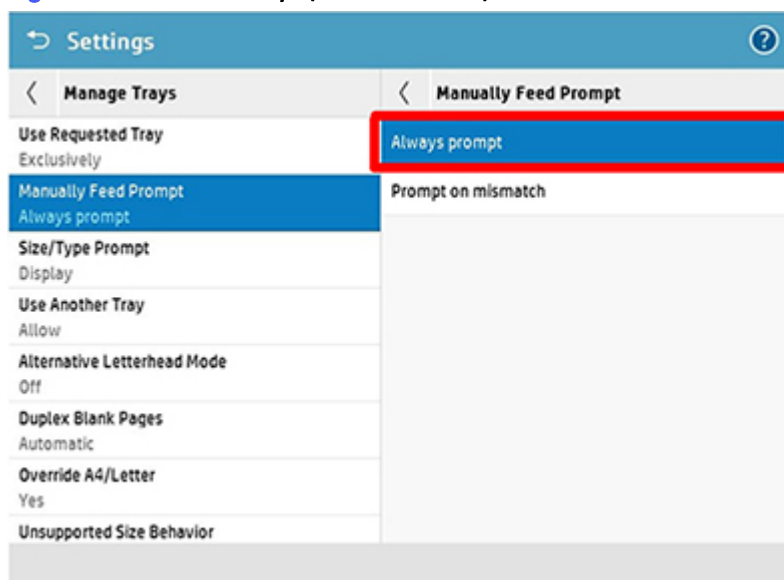

- b. **Unless loaded:** A message displays only if the multipurpose tray is empty.

Figure 7-39 Set to Unless Loaded (FutureSmart 3)


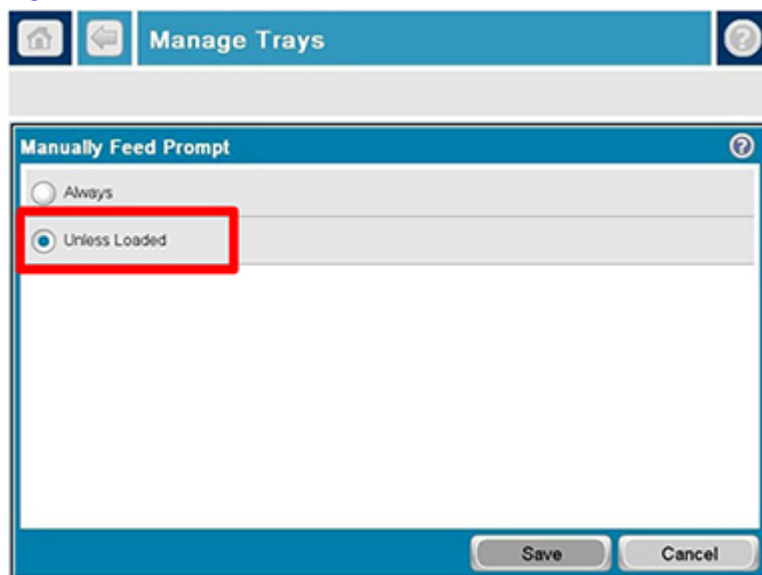


Figure 7-40 Set to Unless Loaded (FutureSmart 4)

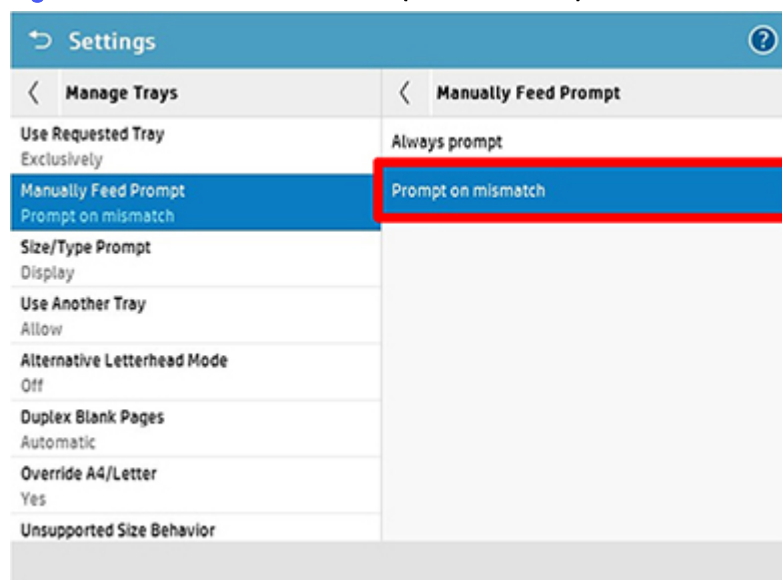

- c. For additional information about: How to: Check if Tray or paper settings mismatch go to:

[HP PageWide 300, 400, 500 series - Solve Tray or Paper Mismatch Errors](#)


Load Tray 2: [Type], [Size] To use another tray, press “OK”

This message displays when the Tray 2 is selected, but is not loaded, and other paper trays are available for use.

It also displays when the tray is configured for a different paper type or size than the print job requires.

Driver and Print Configuration – Media, paper size mismatch, and tray guides can cause this message to display.

Figure 7-41 Load Tray <2>: [Type], [Size] To use another tray, press “OK”

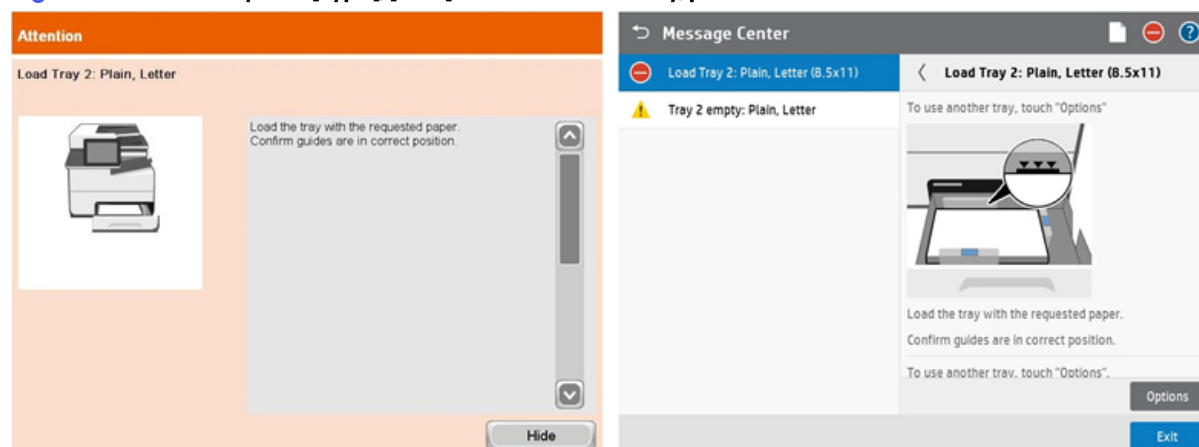

Recommended action for customers


1. Load the desired paper (Type and Size) into Tray 2.

To view a step-by-step “How-To” document with attached video, go to:

[HP PageWide Enterprise Color 556, MFP 586 - Load paper to Tray 2](#)

- a. Load about one-third of a ream of paper into Tray 2. Ensure the paper size tray guides are set correctly.
- b. Close the tray and then watch the small window on the front lower right of the tray to see if the paper level indicator changes.

Check Paper level indicator

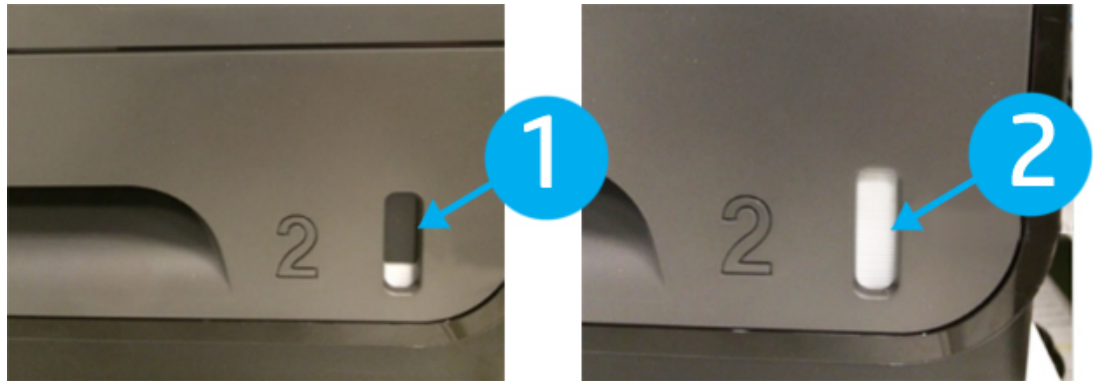

Callout 1: If the tray raises properly, the paper level will drop and the window will show black on top and some white at the bottom. Go to next step.


Callout 2: If the tray does not raise correctly, the paper level will not move, and the window will show all white. Contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

2. If the control panel continues to display “Load Tray 2” after media was physically loaded, use the following steps to verify if the media detection sensor for Tray 2 is operating successfully.
 - a. From the Home screen, select “Trays”

Figure 7-42 FutureSmart 3



Figure 7-43 FutureSmart 4

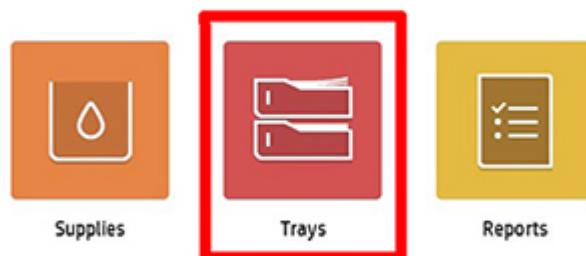

- b. On the “Trays” screen, note the value for “Status”. This should display one the following:

Figure 7-44 “OK” - The printer detects paper in Tray 2. (FutureSmart 3)


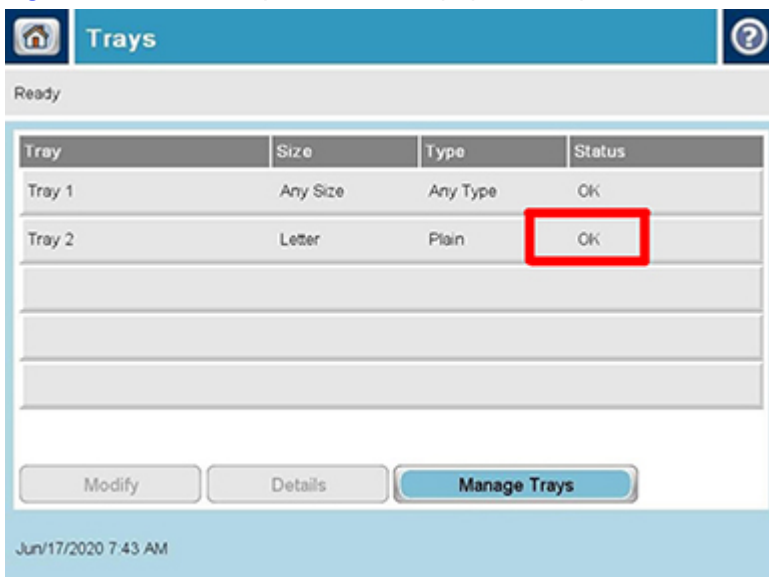


Figure 7-45 "OK" - The printer detects paper in Tray 2. (FutureSmart 4)

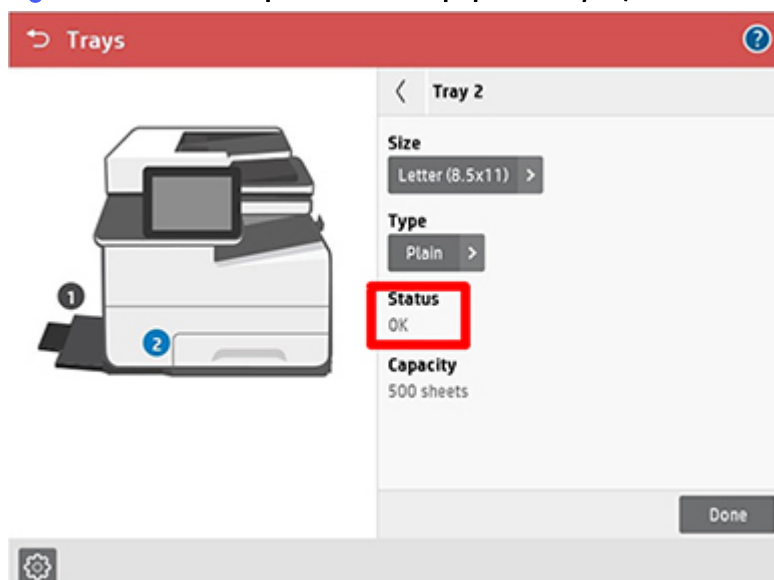

OR

Figure 7-46 "Empty" - The printer does NOT detect paper in Tray 2 (FutureSmart 3)



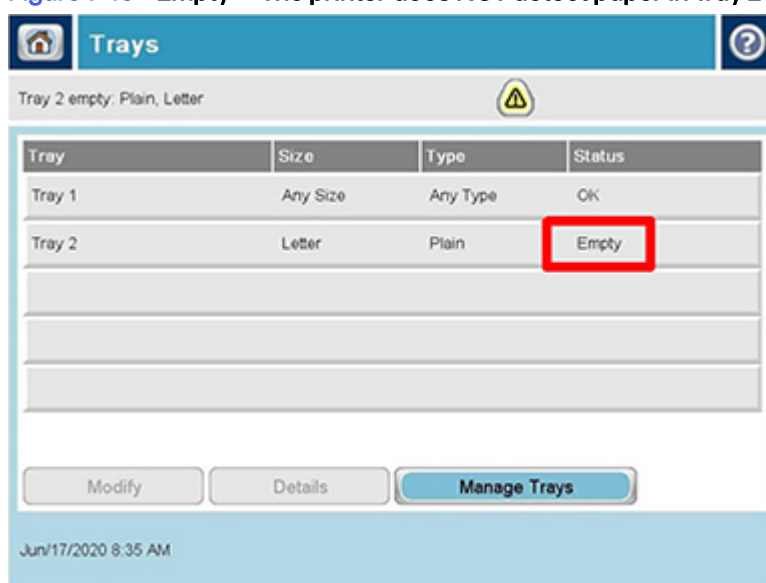



Figure 7-47 "Empty" – The printer does NOT detect paper in Tray 2 (FutureSmart 4)

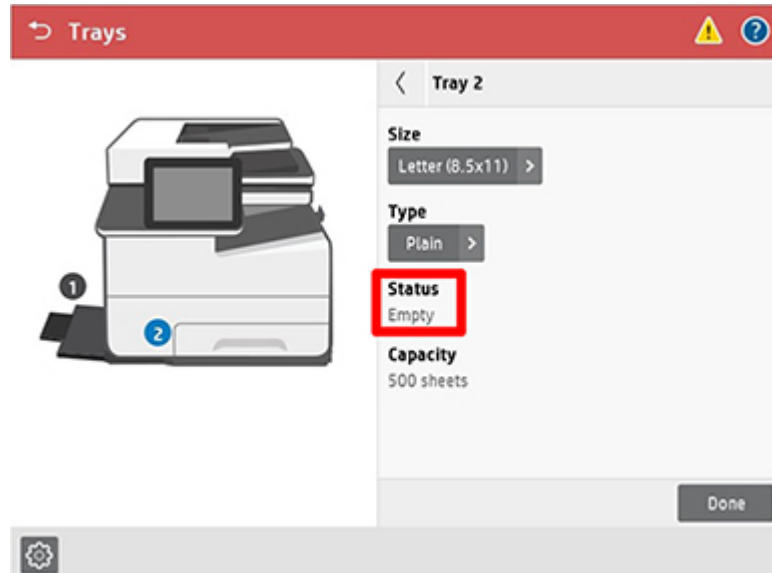

3. If Tray 2 Status, still indicates "Empty" ensure the flag for the "Media Presence Sensor" is not out of position or blocked.
 - a. Turn the printer off and disconnect the power cord from the printer.
 - b. Remove the tray 2 cassette from the printer.
 - c. With the paper cassette removed, there is access to "Media Presence Sensor". Check if the flag is in the incorrect or correct position.

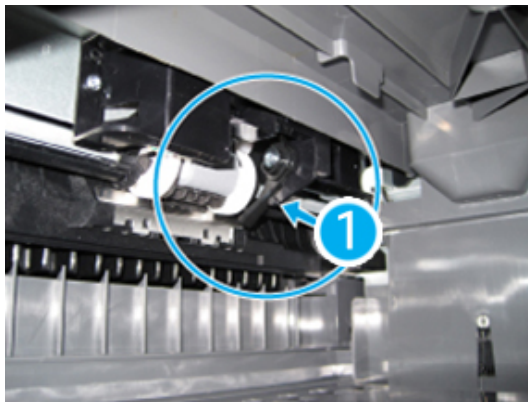

Callout 1: Media Presence Sensor in the INCORRECT position.

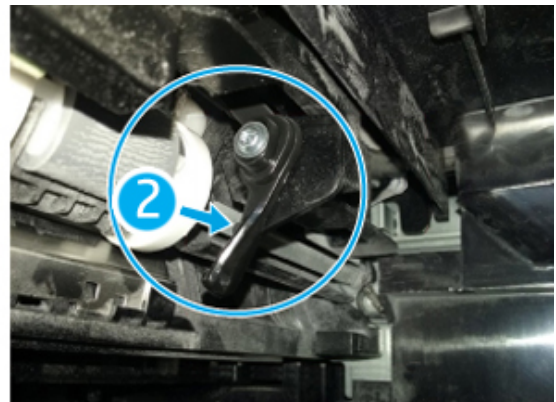

Callout 2: Media Presence Sensor in the CORRECT position.

- d. If the flag is in the incorrect position, gently move the lever to the correct position as seen in the image (Callout 2 CORRECT).
 - e. If the media present sensor goes back to the home position without issues, reinstall the cassette for tray 2 and try to print.
4. If the message persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents


1. Load the desired paper (Type and Size) into Tray 2.

To view a step-by-step "How-To" document with attached video, go to:

[HP PageWide Enterprise Color 556, MFP 586 - Load paper to Tray 2](#)

- a. Ask the customer to load about one-third of a ream of paper into Tray 2. Ensure the paper size tray guides are set correctly.
- b. Instruct the customer to close the tray and then watch the small window on the front lower right of the tray to see if the paper level indicator changes.

Check Paper level indicator

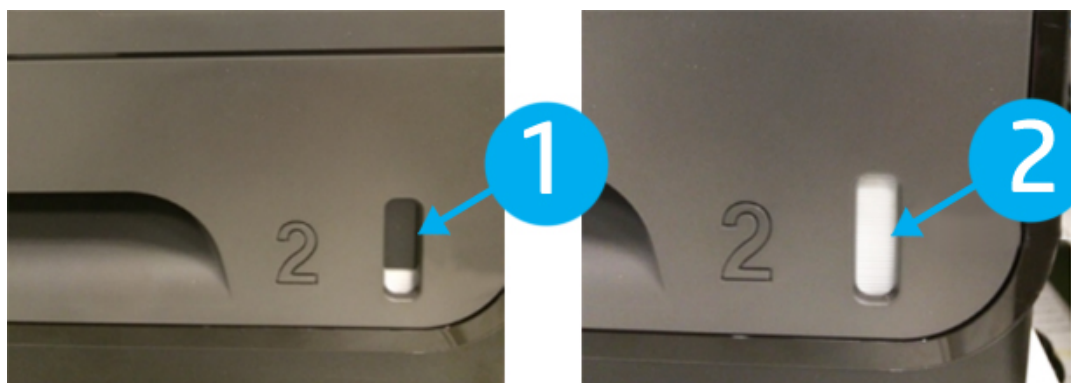

Callout 1: If the tray raises properly, the paper level will drop and the window will show black on top and some white at the bottom. Go to next step.

Callout 2: If the tray does not raise properly, the paper level will not move, and the window will show all white. Send a technician with Tray 2 and Tray 2 lifting mechanism.

Tray 2 part number: G1W39-67955

Tray lift transmission assembly, part number: CN598-67020


2. If the control panel continues to display "Load Tray 2" after media was physically loaded, use the following steps to verify if the media detection sensor for Tray 2 is operating successfully.

- a. From the Home screen, select “Trays”

Figure 7-48 FutureSmart 3



Figure 7-49 FutureSmart 4

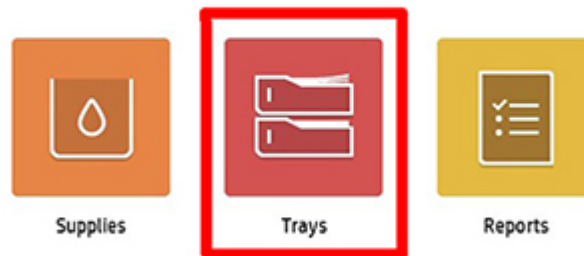

- b. On the “Trays” screen, note the value for “Status”. This should display one the following:

Figure 7-50 “OK” - The printer detects paper in Tray 2. (FutureSmart 3)


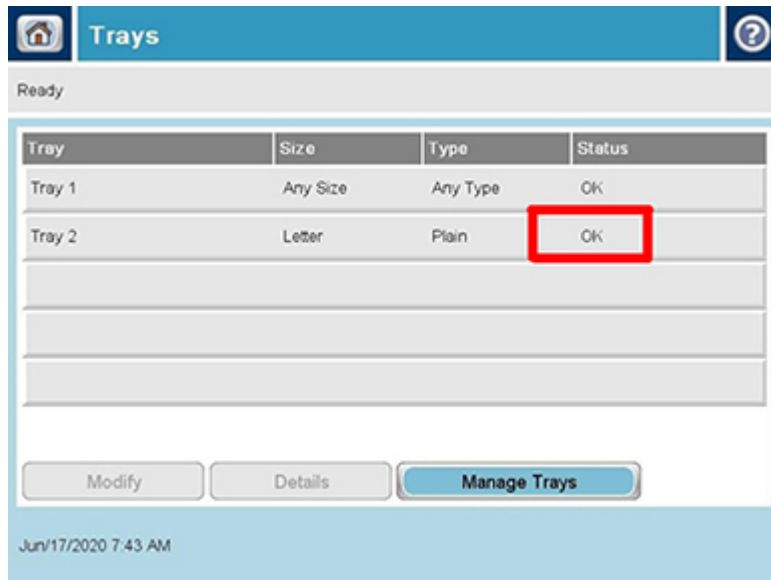


Figure 7-51 “OK” - The printer detects paper in Tray 2. (FutureSmart 4)

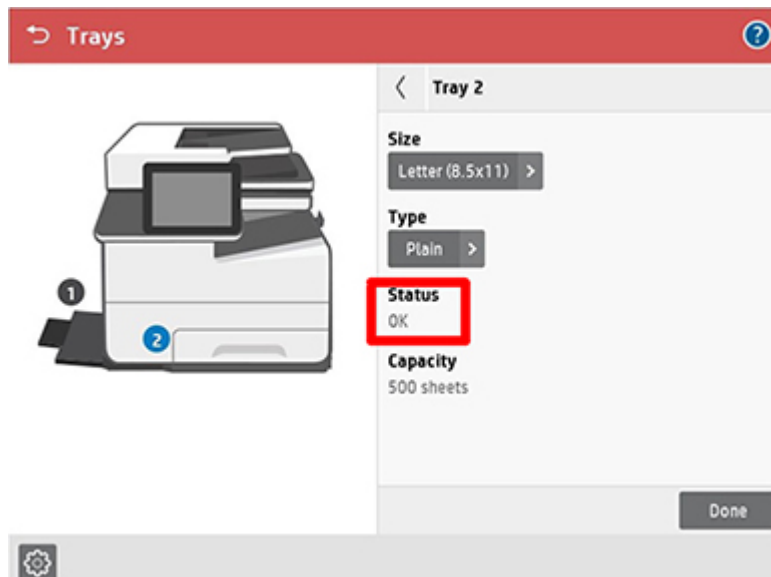

OR

Figure 7-52 “Empty” – The printer does NOT detect paper in Tray 2 (FutureSmart 3)



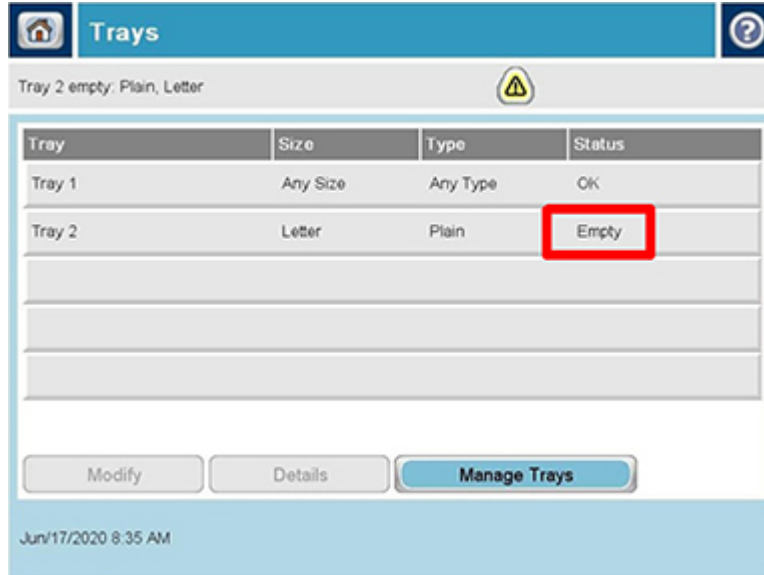


Figure 7-53 “Empty” – The printer does NOT detect paper in Tray 2 (FutureSmart 4)

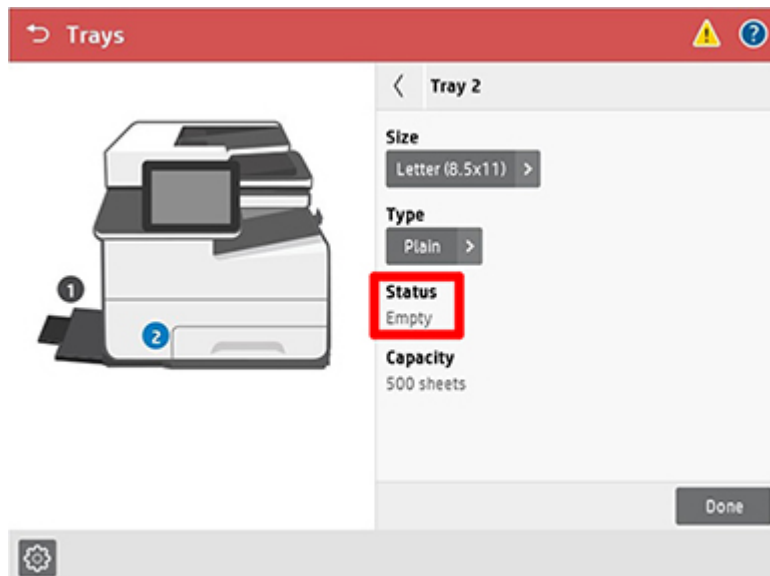

3. If Tray 2 Status, still indicates “Empty” ensure the flag for the “Media Presence Sensor” is not out of position or blocked.
 - a. Turn the printer off and disconnect the power cord from the printer.
 - b. Remove the tray 2 cassette from the printer.

- c. With the paper cassette removed, there is access to “Media Presence Sensor”. Check if the flag is in the incorrect or correct position.

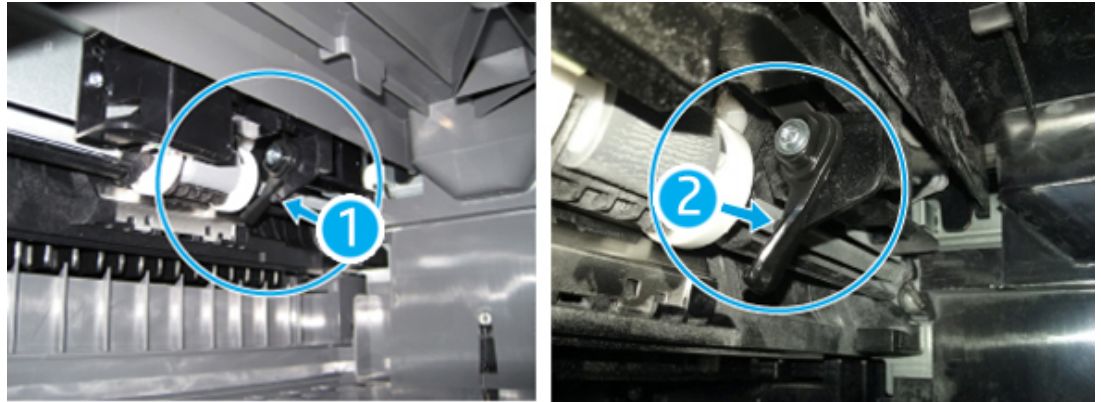

Callout 1: Media Presence Sensor in the INCORRECT position.

Callout 2: Media Presence Sensor in the CORRECT position.

- d. If the flag is in the incorrect position, gently move the lever to the correct position as seen in the image (Callout 2 CORRECT).
 - e. If the media present sensor goes back to the home position without issues, reinstall the cassette for tray 2 and try to print.
4. If error persists, dispatch an onsite CE with the media /flag / opto PCA kit.
- Media Flag / opto PCA kit, part number: D3Q24-67014

Recommended action for onsite technicians


1. Load the desired paper (Type and Size) into Tray 2.

To view a step-by-step “How-To” document with attached video, go to:

[HP PageWide Enterprise Color 556, MFP 586 - Load paper to Tray 2](#)

- a. Load about one-third of a ream of paper into Tray 2. Ensure the paper size tray guides are set correctly.
- b. Close the tray and then watch the small window on the front lower right of the tray to see if the paper level indicator changes.

Check Paper level indicator

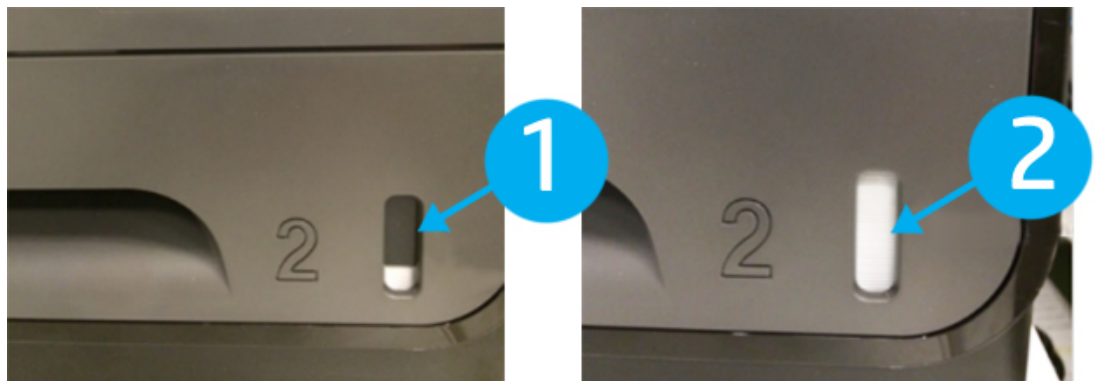

Callout 1: If the tray raises properly, the paper level will drop and the window will show black on top and some white at the bottom. Go to next step.

Callout 2: If the tray does not raise properly, the paper level will not move, and the window will show all white. Replace Tray 2 and Tray 2 lifting mechanism as needed.

Tray 2 part number: G1W39-67955

Tray lift transmission assembly, part number: CN598-67020

2. If the control panel continues to display “Load Tray 2” after media was physically loaded, use the following steps to verify if the media detection sensor for Tray 2 is operating successfully.
 - a. From the Home screen, select “Trays”

Figure 7-54 FutureSmart 3



Figure 7-55 FutureSmart 4



- b. On the “Trays” screen, note the value for “Status”. This should display one the following:

Figure 7-56 “OK” - The printer detects paper in Tray 2. (FutureSmart 3)


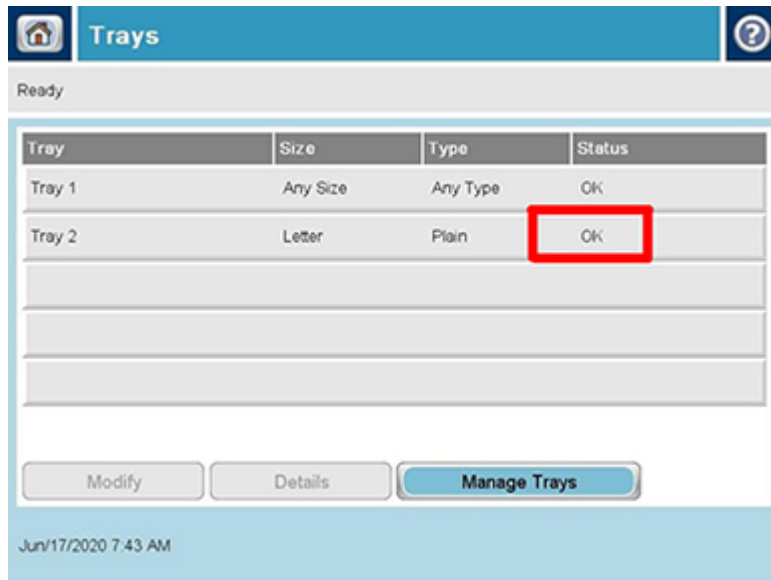


Figure 7-57 “OK” - The printer detects paper in Tray 2. (FutureSmart 4)

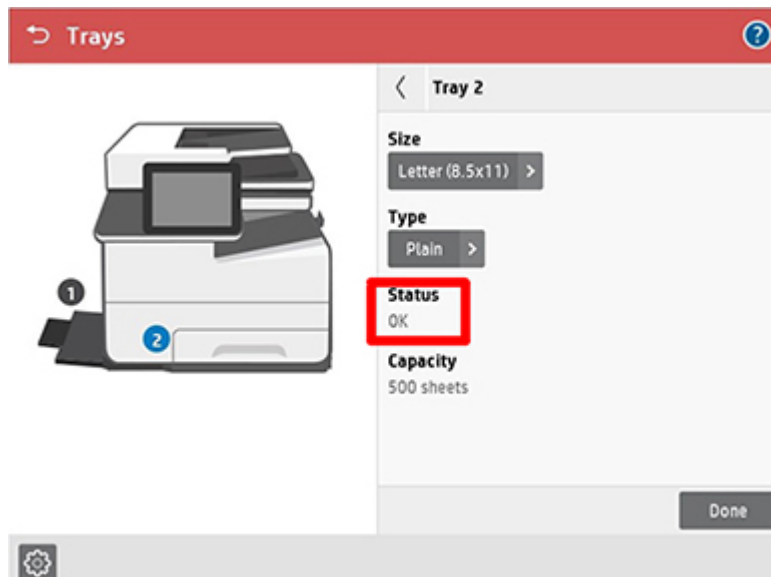

OR

Figure 7-58 “Empty” – The printer does NOT detect paper in Tray 2 (FutureSmart 3)



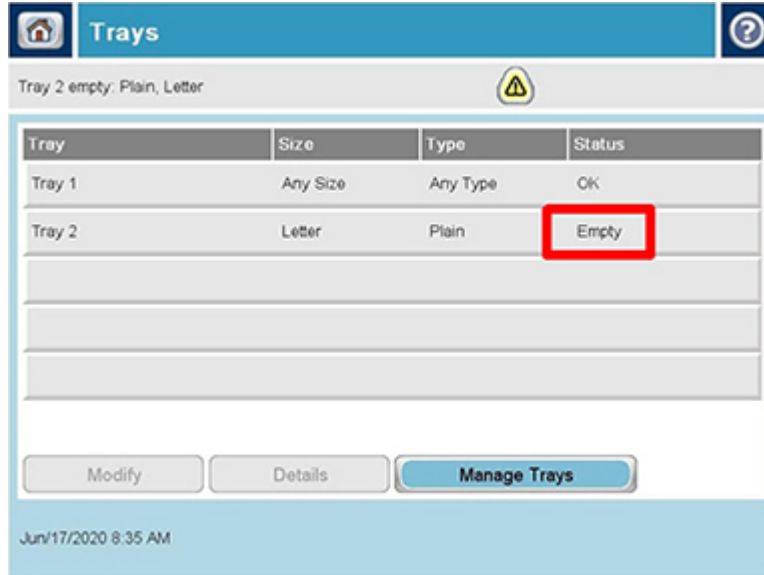


Figure 7-59 “Empty” – The printer does NOT detect paper in Tray 2 (FutureSmart 4)

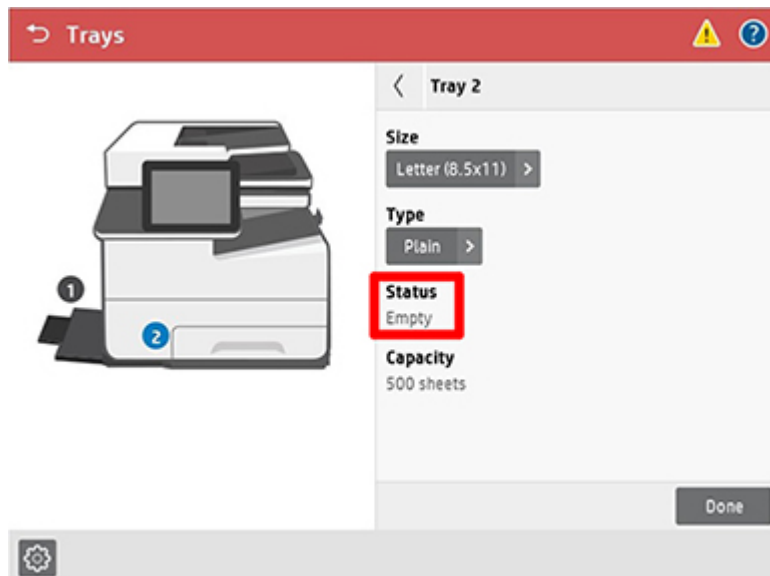

3. If Tray 2 Status, still indicates “Empty” ensure the flag for the “Media Presence Sensor” is not out of position or blocked.
 - a. Turn the printer off and disconnect the power cord from the printer.
 - b. Remove the tray 2 cassette from the printer.

- c. With the paper cassette removed, there is access to “Media Presence Sensor”. Check if the flag is in the incorrect or correct position.

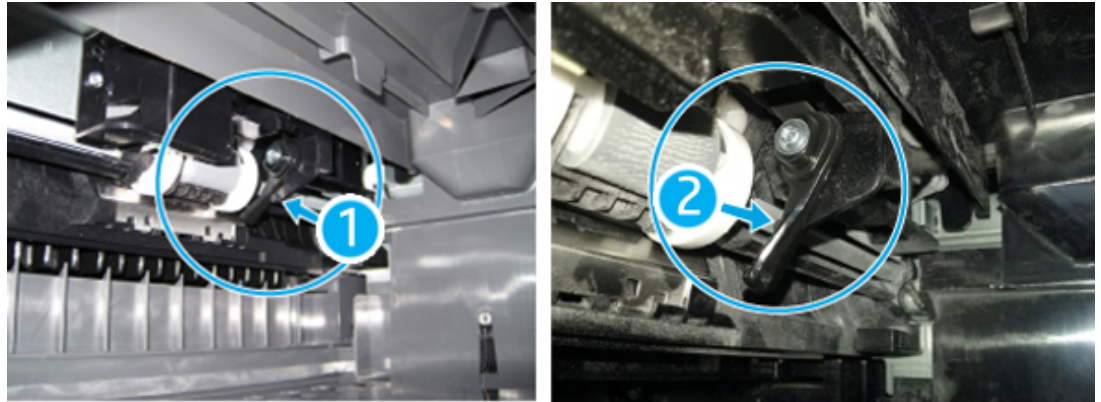

Callout 1: Media Presence Sensor in the INCORRECT position.

Callout 2: Media Presence Sensor in the CORRECT position.

- d. If the flag is in the incorrect position, gently move the lever to the correct position as seen in the image (Callout 2 CORRECT).
 - e. If the media present sensor goes back to the home position without issues, reinstall the cassette for tray 2 and try to print.
4. If error persists, replace the media /flag / opto PCA kit.

Media Flag / opto PCA kit, part number: D3Q24-67014

Load Tray 3: [Type], [Size] To use another tray, press “OK” -or- Load Tray 4: [Type], [Size] To use another tray, press “OK” -or- Load Tray 5: [Type], [Size] To use another tray, press “OK”

This message displays when the Tray 3, 4 or 5 is selected, but is not loaded, and other paper trays are available for use.

It also displays when the tray is configured for a different paper type or size than the print job requires.

Driver and Print Configuration – Media, paper size mismatch, and tray guides may cause this message to display.

Recommended action for customers


1. Load the desired paper (Type and Size) into Tray 3, 4, or 5.

To view a step-by-step “How-To” document with attached video, go to:

[HP PageWide Enterprise Color 556, MFP 586 - Load paper to Tray 2](#)

- a. Load about one-third of a ream of paper into Tray 3, 4, or 5. Ensure the paper size tray guides are set correctly.
- b. Close the tray and then watch the small window on the front lower right of the tray to see if the paper level indicator changes.

Check Paper level indicator

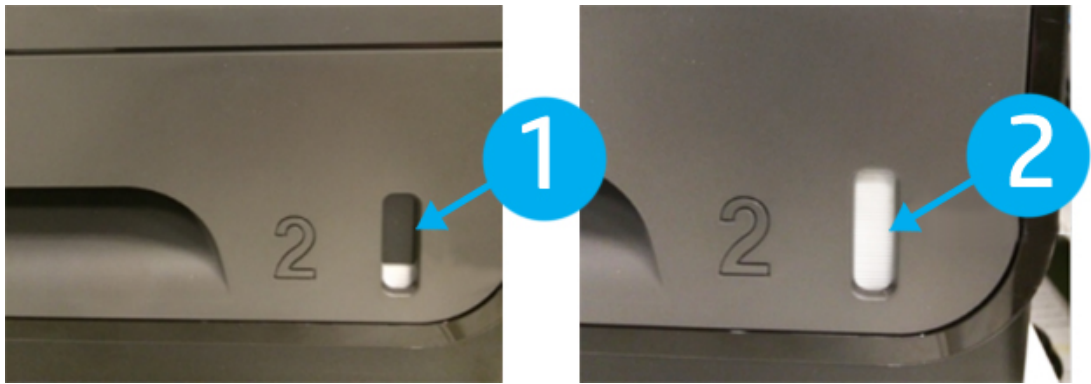

Callout 1: If the tray raises properly, the paper level will drop and the window will show black on top and some white at the bottom. Go to next step.


Callout 2: If the tray does not raise correctly, the paper level will not move, and the window will show all white. Contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

2. If the control panel continues to display “Load Tray 3, 4, or 5” after media was physically loaded, use the following steps to verify if the media detection sensor for Tray 3, 4, or 5 is operating successfully.
 - a. From the Home screen, select “Trays”

Figure 7-60 FutureSmart 3



Figure 7-61 FutureSmart 4

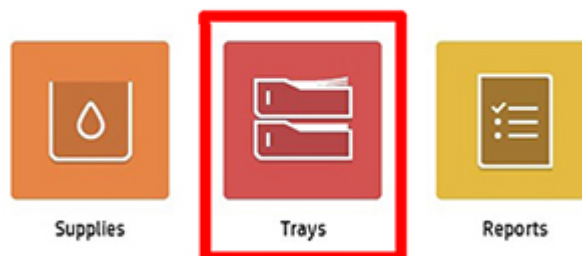

- b. On the “Trays” screen, note the value for “Status”. This should display one the following:

Figure 7-62 “OK” - The printer detects paper in Tray 2. (FutureSmart 3)


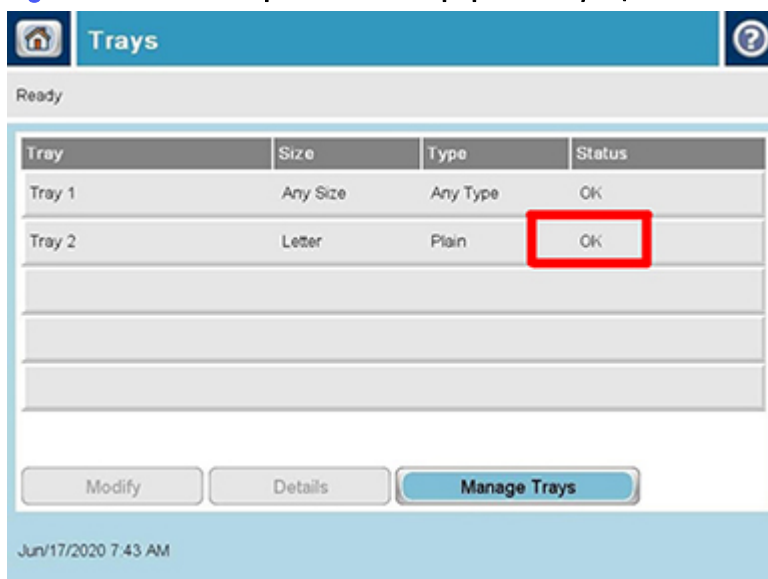


Figure 7-63 “OK” - The printer detects paper in Tray 2. (FutureSmart 4)

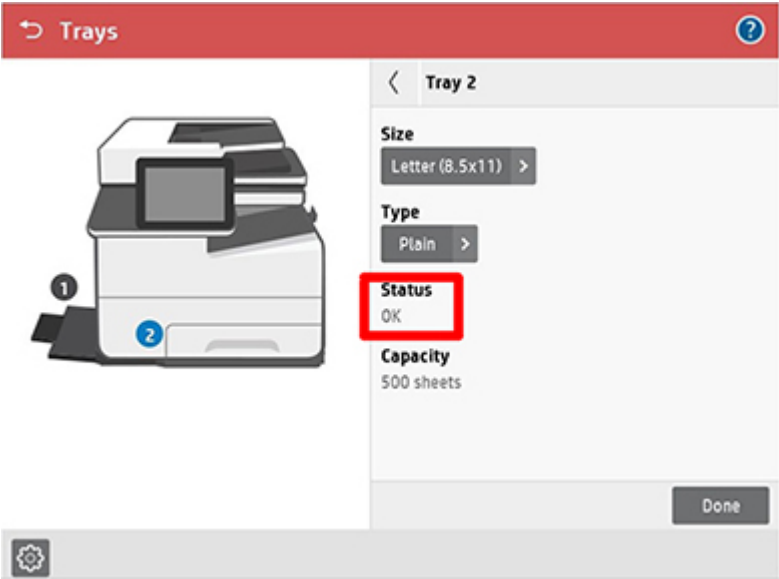

OR

Figure 7-64 “Empty” - The printer does NOT detect paper in Tray 2 (FutureSmart 3)



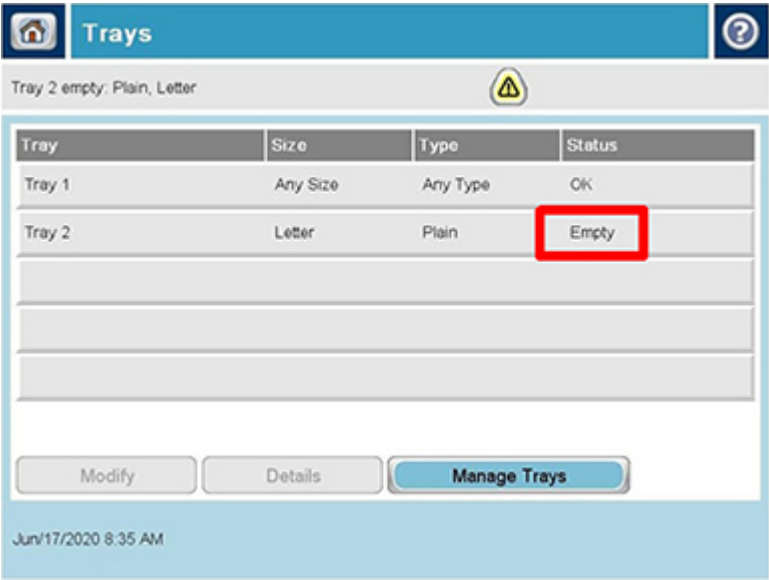



Figure 7-65 “Empty” – The printer does NOT detect paper in Tray 2 (FutureSmart 4)

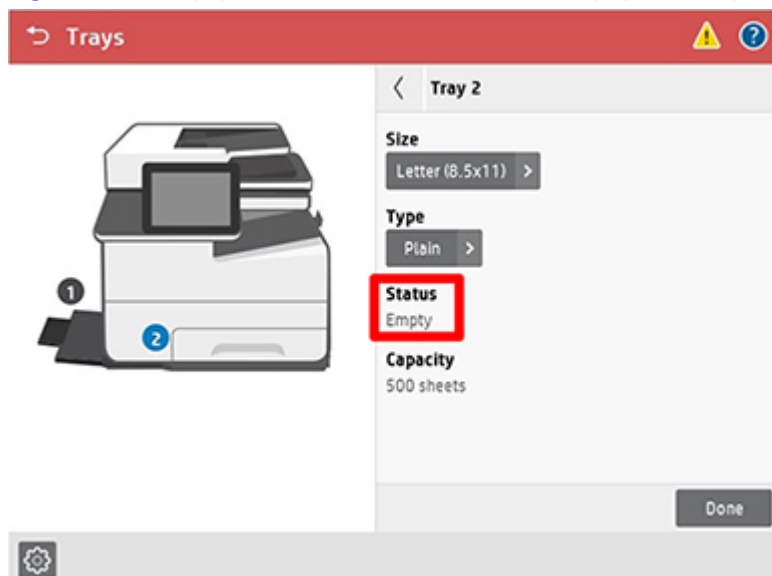

3. If Tray 3, 4, or 5 Status, still indicates “Empty” ensure the flag for the “Media Presence Sensor” is not out of position or blocked.
 - a. Turn the printer off and disconnect the power cord from the printer.
 - b. Remove the tray 3, 4, or 5 cassette from the printer.
 - c. With the paper cassette removed, there is access to “Media Presence Sensor”. Check if the flag is in the incorrect or correct position.

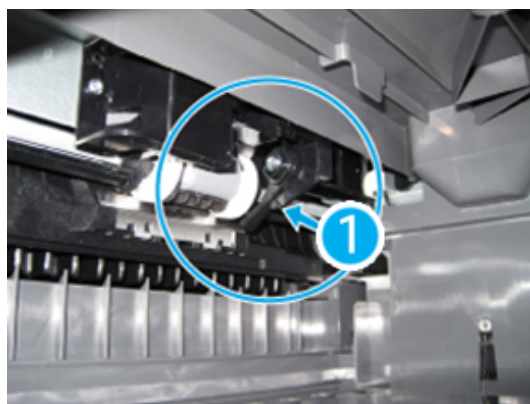

Callout 1: Media Presence Sensor in the INCORRECT position.

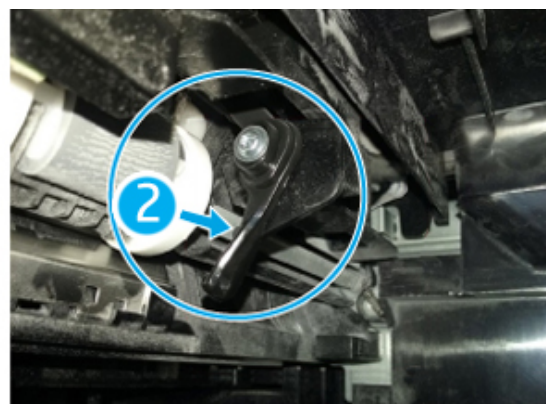

Callout 2: Media Presence Sensor in the CORRECT position.

- d. If the flag is in the incorrect position, gently move the lever to the correct position as seen in the image (Callout 2 CORRECT).
 - e. If the media present sensor goes back to the home position without issues, reinstall the cassette for tray 2 and try to print.
4. If the message persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents


1. Load the desired paper (Type and Size) into Tray 3, 4, or 5.

To view a step-by-step “How-To” document with attached video, go to:

[HP PageWide Enterprise Color 556, MFP 586 - Load paper to Tray 2](#)

- a. Ask the customer to load about one-third of a ream of paper into Tray 3, 4, or 5. Ensure the paper size tray guides are set correctly.
- b. Instruct the customer to close the tray and then watch the small window on the front lower right of the tray to see if the paper level indicator changes.

Check Paper level indicator

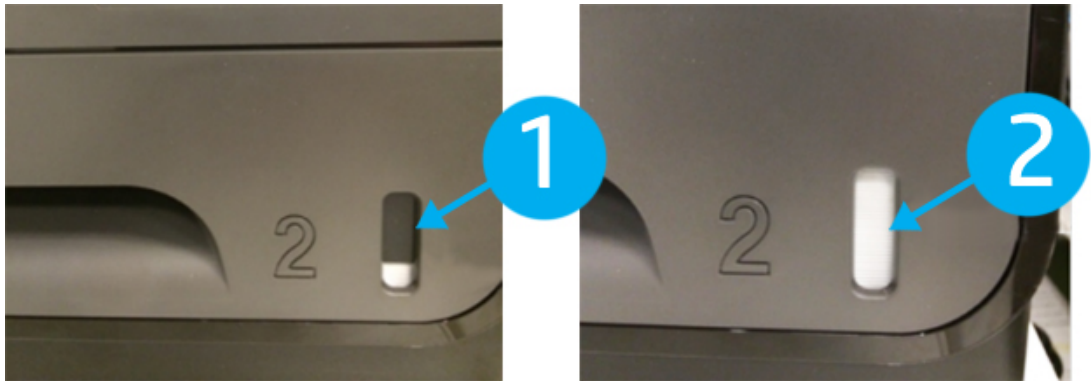

Callout 1: If the tray raises properly, the paper level will drop and the window will show black on top and some white at the bottom. Go to next step.

Callout 2: If the tray does not raise properly, the paper level will not move, and the window will show all white. Send a technician with Tray 3, 4, or 5 assembly and feeder kit.

Tray 3 assembly and feeder kit, part number: G1W39-67952

Tray 4 assembly and feeder kit, part number: G1W39-67953

2. If the control panel continues to display “Load Tray 3, 4, or 5” after media was physically loaded, use the following steps to verify if the media detection sensor for Tray 3, 4, or 5 is operating successfully.

- a. From the Home screen, select “Trays”

Figure 7-66 FutureSmart 3



Figure 7-67 FutureSmart 4



- b. On the “Trays” screen, note the value for “Status”. This should display one the following:

Figure 7-68 “OK” - The printer detects paper in Tray 2. (FutureSmart 3)


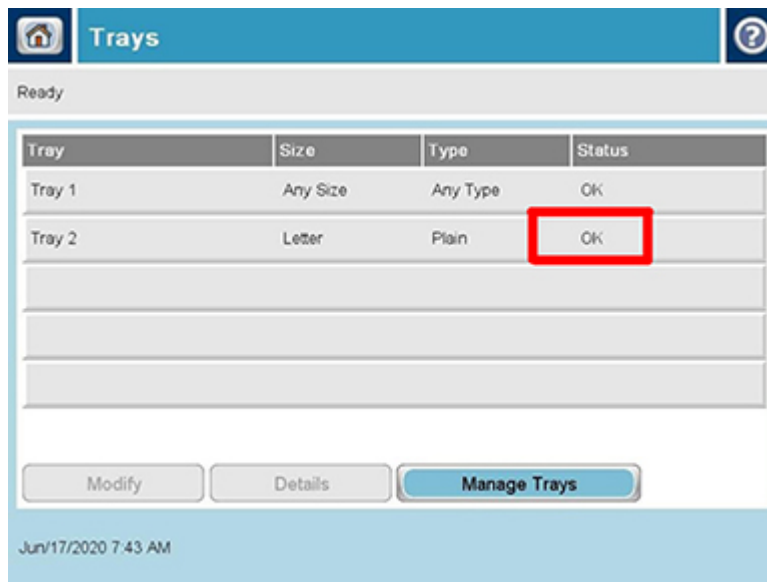


Figure 7-69 “OK” - The printer detects paper in Tray 2. (FutureSmart 4)

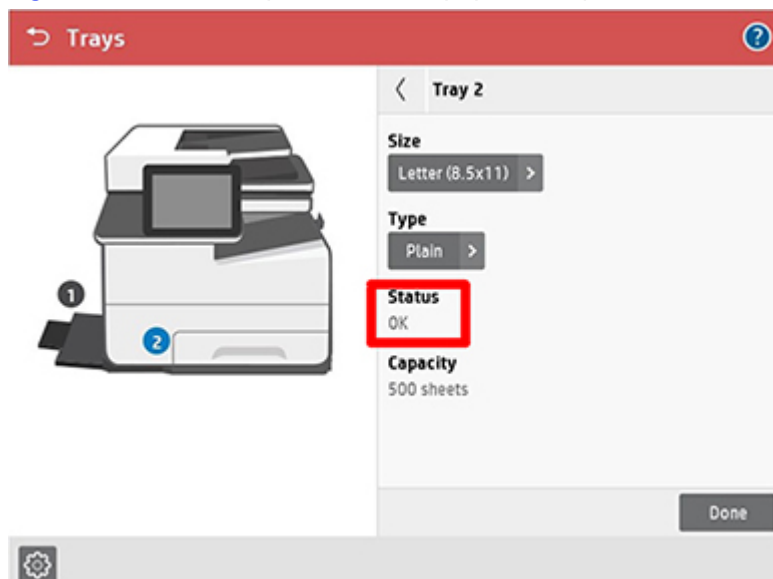

OR

Figure 7-70 “Empty” – The printer does NOT detect paper in Tray 2 (FutureSmart 3)



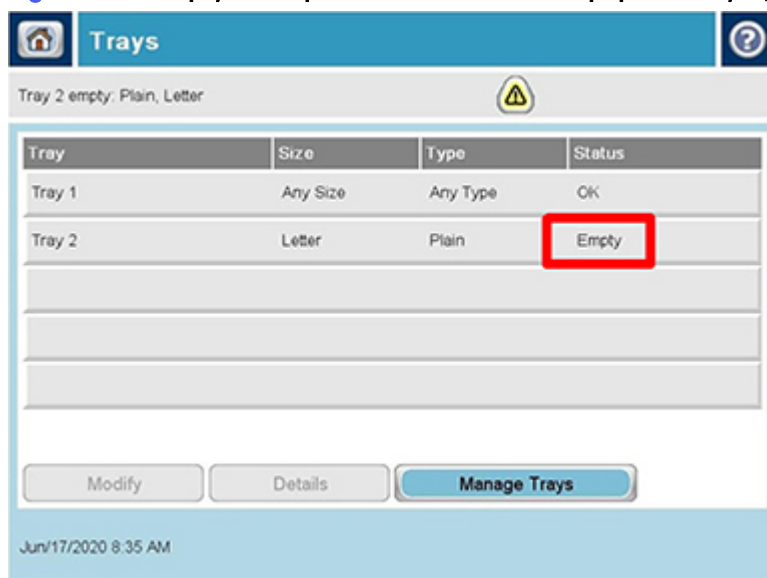


Figure 7-71 “Empty” – The printer does NOT detect paper in Tray 2 (FutureSmart 4)

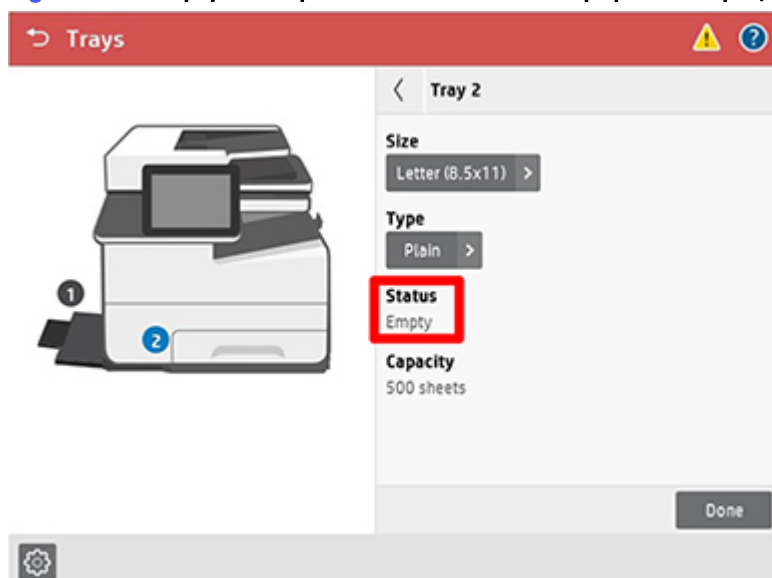

3. If Tray 3, 4, or 5 Status, still indicates “Empty” ensure the flag for the “Media Presence Sensor” is not out of position or blocked.
 - a. Turn the printer off and disconnect the power cord from the printer.
 - b. Remove the tray 3, 4, or 5 cassette from the printer.

- c. With the paper cassette removed, there is access to "Media Presence Sensor". Check if the flag is in the incorrect or correct position.

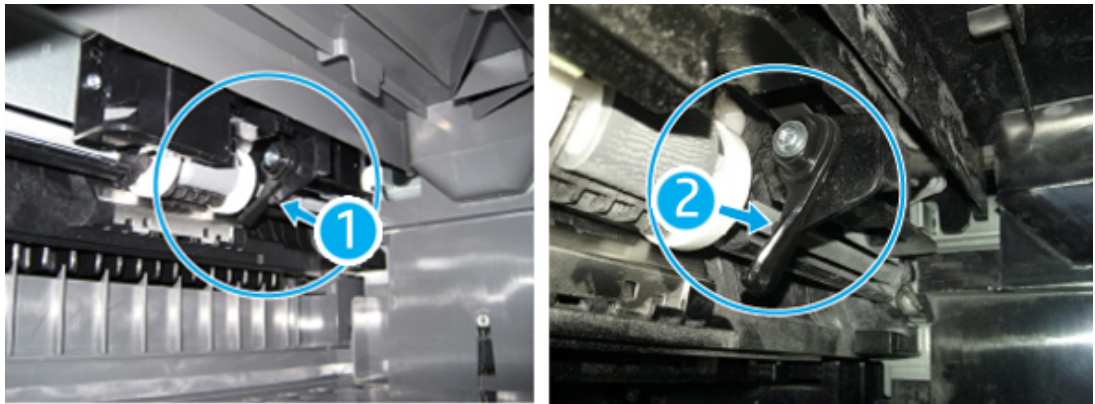

Callout 1: Media Presence Sensor in the INCORRECT position.

Callout 2: Media Presence Sensor in the CORRECT position.

- d. If the flag is in the incorrect position, gently move the lever to the correct position as seen in the image (Callot 2 CORRECT).
 - e. If the media present sensor goes back to the home position without issues, reinstall the cassette for tray 3, 4, or 5 and try to print.
4. If error persists, dispatch an onsite CE with the Media presence flag PC board assembly.

Media presence flag PC board assembly, part number: D3Q24-67014

Recommended action for onsite technicians


1. Load the desired paper (Type and Size) into Tray 3, 4, or 5.

To view a step-by-step "How-To" document with attached video, go to:

[HP PageWide Enterprise Color 556, MFP 586 - Load paper to Tray 2](#)

- a. Load about one-third of a ream of paper into Tray 3, 4, or 5. Ensure the paper size tray guides are set correctly.
- b. Close the tray and then watch the small window on the front lower right of the tray to see if the paper level indicator changes.

Check Paper level indicator

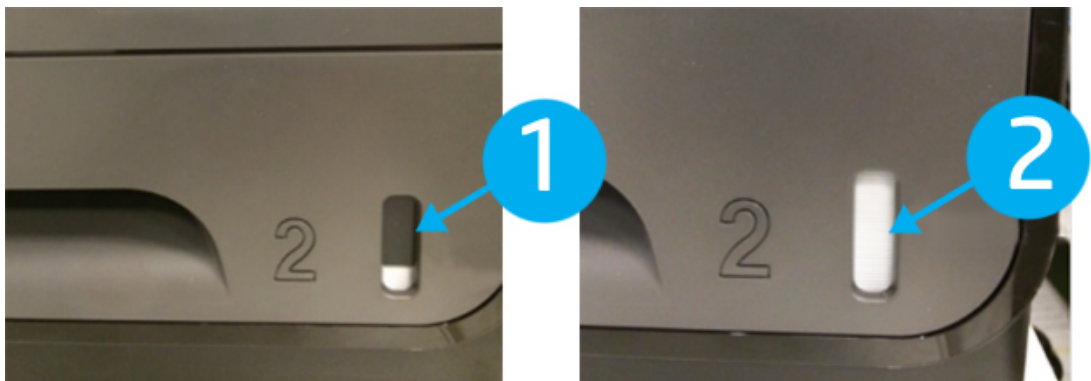

Callout 1: If the tray raises properly, the paper level will drop and the window will show black on top and some white at the bottom. Go to next step.

Callout 2: If the tray does not raise properly, the paper level will not move, and the window will show all white. Replace the Tray 3, 4, or 5 assembly and feeder kit.

Tray 3 assembly and feeder kit, part number: G1W39-67952

Tray 4 assembly and feeder kit, part number: G1W39-67953

2. If the control panel continues to display “Load Tray 3, 4, or 5” after media was physically loaded, use the following steps to verify if the media detection sensor for Tray 3, 4, or 5 is operating successfully.

- a. From the Home screen, select “Trays”

Figure 7-72 FutureSmart 3

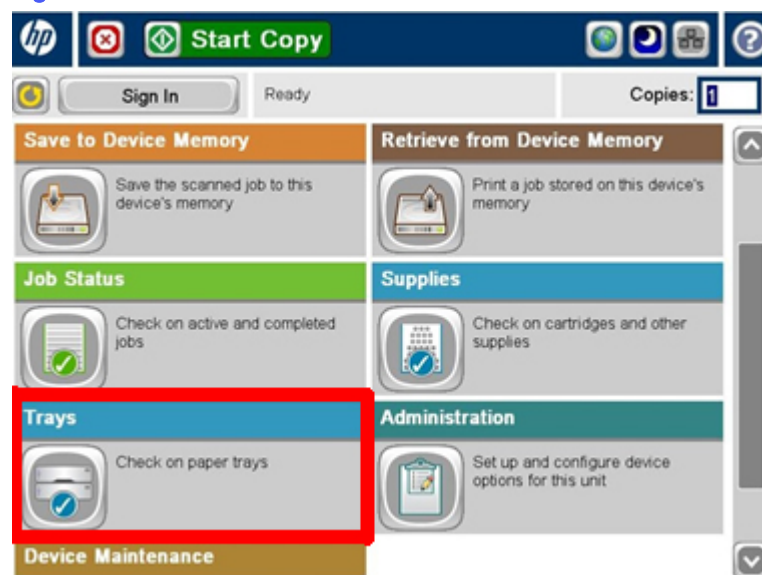


Figure 7-73 FutureSmart 4



- b. On the “Trays” screen, note the value for “Status”. This should display one the following:

Figure 7-74 “OK” - The printer detects paper in Tray 2. (FutureSmart 3)


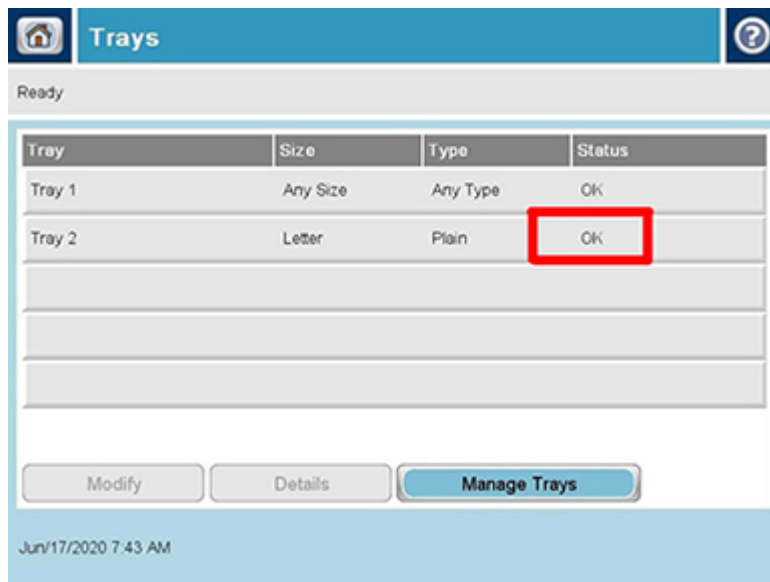


Figure 7-75 “OK” - The printer detects paper in Tray 2. (FutureSmart 4)

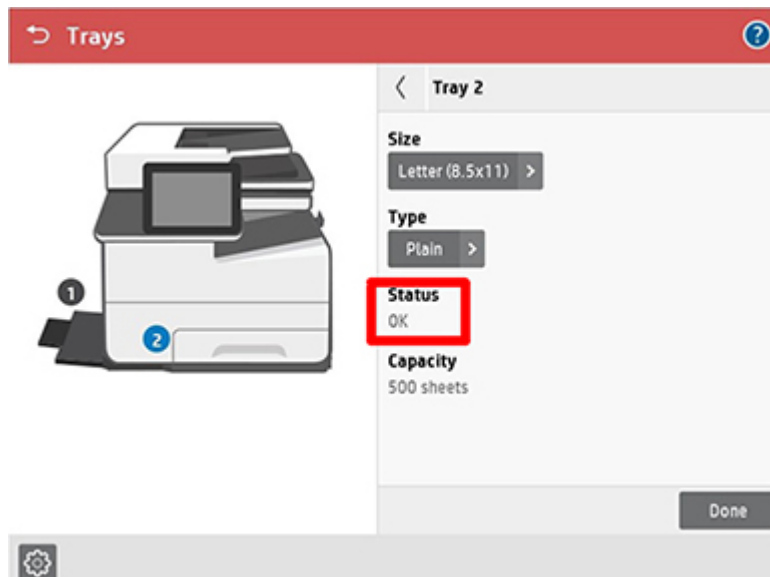

OR

Figure 7-76 “Empty” – The printer does NOT detect paper in Tray 2 (FutureSmart 3)



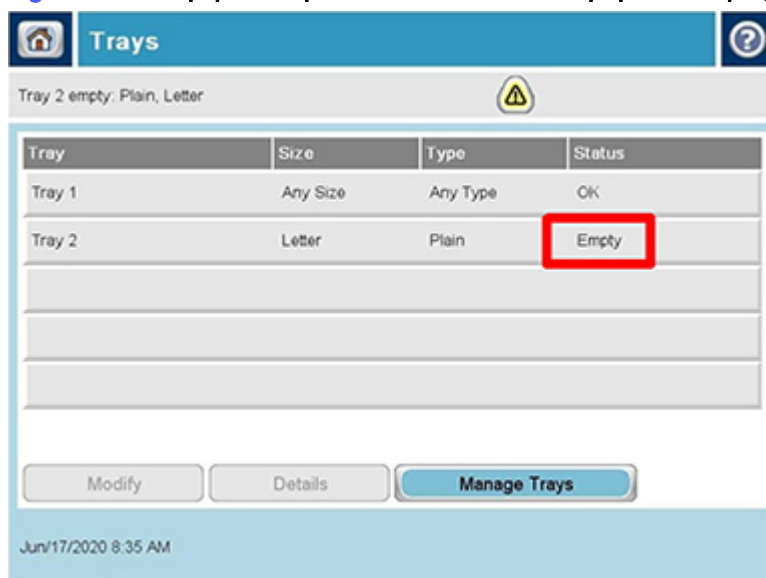


Figure 7-77 “Empty” – The printer does NOT detect paper in Tray 2 (FutureSmart 4)

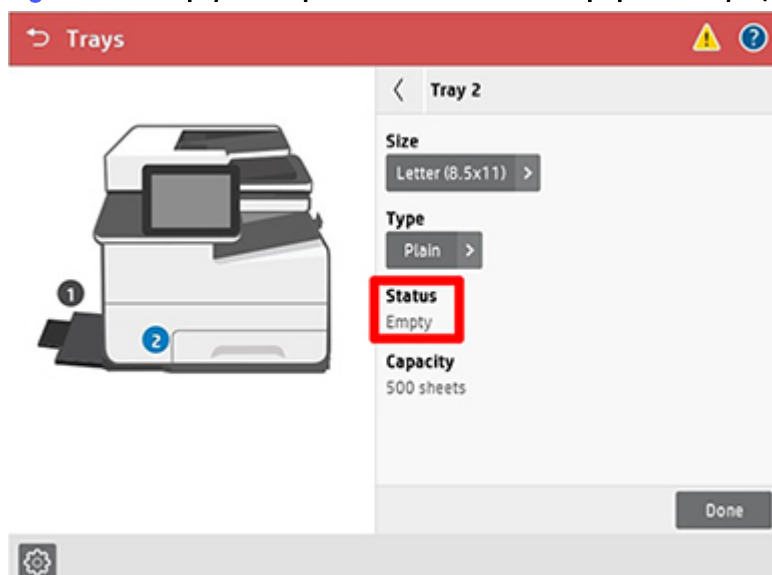


3. If Tray 3, 4, or 5 Status, still indicates “Empty” ensure the flag for the “Media Presence Sensor” is not out of position or blocked.
 - a. Turn the printer off and disconnect the power cord from the printer.
 - b. Remove the tray 3, 4, or 5 cassette from the printer.

- c. With the paper cassette removed, there is access to "Media Presence Sensor". Check if the flag is in the incorrect or correct position.

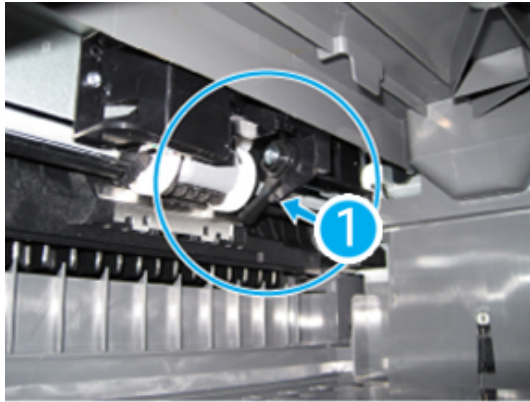

Callout 1: Media Presence Sensor in the INCORRECT position.

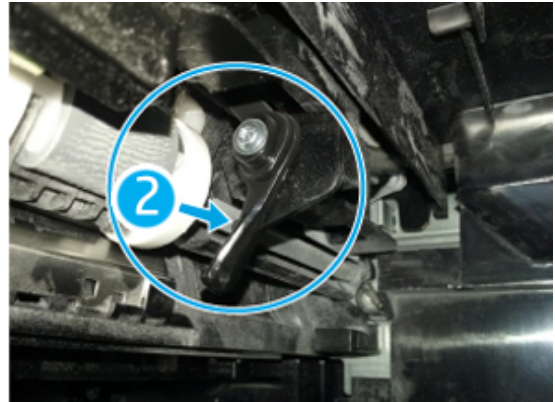

Callout 2: Media Presence Sensor in the CORRECT position.

- d. If the flag is in the incorrect position, gently move the lever to the correct position as seen in the image (Callout 2 CORRECT).
 - e. If the media present sensor goes back to the home position without issues, reinstall the cassette for tray 3, 4, or 5 and try to print.
4. If error persists, replace the Media presence flag PC board assembly.

Media presence flag PC board assembly, part number: D3Q24-67014

Loading program <XX> Do not power off

Programs and fonts can be stored on the printer's file system and are loaded into RAM when the printer is turned on. The number <XX> specifies a sequence number indicating the current program being loaded.

Recommended action

- No action necessary.

Main Tray 2 Missing or Open

The product cannot detect the tray.

Recommended action

- Install and close the tray.

Manually feed output stack Then touch "OK" to print second side

The printer has printed the first side of a manual duplex job and is waiting for you (or the applicable user) to insert the output stack to print the second side.

Recommended action

1. Maintaining the same orientation, remove the pages from the output bin.

2. Flip the document printed side up.
3. Load the document in Tray 1.
4. Touch the **OK** button to print the second side of the job.

Manually feed: <Type><Size>

This message appears when manual feed is selected, Tray 1 is not loaded, and other trays are empty.

Recommended action

1. Load the tray with requested paper.
2. If the paper is already in the tray, press the **Help** button to exit the message and then press the **OK** button to print.
3. To use another tray, clear paper from Tray 1, press the **Help** button to exit the message and then press the **OK** button.

No job to cancel

You have pressed the stop button but the printer is not actively processing any jobs.

Recommended action

- No action necessary.

Non-HP Cartridge(s) Non-HP ink cartridges installed

The product has detected a non-HP cartridge or cartridges.

- 17 . 00 . 34 : (event code) Black cartridge
- 17 . 01 . 34 : (event code) Cyan cartridge
- 17 . 02 . 34 : (event code) Magenta cartridge
- 17 . 03 . 34 : (event code) Yellow cartridge

Recommended action

HP cannot guarantee the quality or reliability of non-HP supplies.

Replace the cartridges with HP cartridges to ensure the best print quality.

If you believe you purchased a genuine HP supply, go to www.hp.com/go/anticounterfeit.

- Press **OK** to continue.

Output Bin Full

The output bin is full or this message displays even though the output bin is not full.

Recommended action

1. Clear all media from the output bin.

2. Check that the output bin media-full sensor flag to move smoothly. If the flag is damaged, replace the output bin.

Part number: G1W39-67944

3. Run the sensor test in the sensor monitor mode to verify that the output bin media-full sensor is functioning properly. If it is not, replace the output bin.

Removal and replacement: Output bin

Part number: G1W39-67944

Paused...

The printer is paused, and there are no error messages pending at the display. The I/O continues receiving data until the memory is full.

Recommended action

- Press the **Stop** button.

Paper Jam

The product has experienced a paper jam. Printing cannot continue until the jam has been cleared.

Recommended action

- Follow the instructions on the product control panel to clear the jam.

Paper Jam in Automatic Document Feeder

The product has detected a jam in the document feeder.

Recommended action

- Clear the jam and then touch the **OK** button.

Paper too short

The product cannot print on paper smaller than in length.

Recommended action

- Load paper that exceeds the product minimum supported size and re-send the print job.

Paper too short to autoduplex

The paper in the product does not meet the minimum size requirements for automatic two sided printing (duplexing).

Recommended action

- Load paper that meets specifications for automatic duplexing.

Paper type mismatch

The paper type detected by the product does not match the type selected in the software.

Recommended action

- Select the correct type in the software, load the type dictated by the software, or touch the **OK** button to continue the job with the size mismatch.

Performing Paper Path Test

A paper path test is being performed.

Recommended action

- No action necessary.

Please Wait...

The printer is in the process of clearing data.

Recommended action

- No action necessary.

Printer Failure

The product or ink system has experienced an error.

Recommended action

- Turn the product off and then on.

Printer Supply Upgrade

The indicated supply upgrade was detected.

- **17.00.52** – Black Cartridge
- **17.01.52** – Cyan Cartridge
- **17.02.52** – Magenta Cartridge
- **17.03.52** – Yellow Cartridge

Recommended action

- Press the **OK** button or touch the **Upgrade** button to install the upgrade cartridge, or replace the cartridge.

Printer Supply Upgrade Problem

The indicated supply encountered an upgrade problem.

- **17.00.54** – Black Cartridge
- **17.01.54** – Cyan Cartridge
- **17.02.54** – Magenta Cartridge
- **17.03.54** – Yellow Cartridge

Recommended action

- Replace the ink cartridge.

Print head Jam

The product has detected a jam that is blocking the print head.

Recommended action

- Follow the instructions on the product control panel to clear the jam.

Printing Configuration...

The printer is printing the Configuration page.

Recommended action

- No action necessary.

Printing Event Log...

The printer is printing the Event Log page.

Recommended action

- No action necessary.

Printing File Directory...

The printer is printing the File Directory pages.

Recommended action

- No action necessary.

Printing Font List...

The printer is printing the Font List pages.

Recommended action

- No action necessary.

Printing Help Page...

The printer is printing the Help page.

Recommended action

- No action necessary.

Printing Menu Map...

The printer is printing the Menu Map pages.

Recommended action

- No action necessary.

Printing stopped...

Time has expired on the Print/Stop test.

Recommended action

- No action necessary.

Printing Supplies Status Page...

The printer is printing the Supplies Status page.

Recommended action

- No action necessary.

Printing Usage Page...

The printer is printing the Usage page.

Recommended action

- No action necessary.

Printing engine test...

The printer is printing an engine test page.

Recommended action

- No action necessary.

Problem with Printer Preparation

The product has detected an error with the product clock. Print quality can be affected.

Recommended action

- Run a cleaning page through the product.

Problem with startup Cartridge(s)

The product has detected a problem with the startup cartridges, which prevents the product from completing the initialization process during initial installation.

Recommended action

- Replace the cartridges.

Processing job from tray <x>... Do not grab paper until job completes

The printer is actively processing a job from the designated tray.

Recommended action

- No action necessary.

Processing...

The printer is currently processing a job but is not yet picking pages. When paper motion begins, this message is replaced by a message that indicates the tray the job is using.

Recommended action

- No action necessary.

Processing... copy <x> of <y>

The printer is currently processing or printing collated copies. The message indicates that copy number <x> of total copies <y> is currently being processed.

Recommended action

- No action necessary.

RAM disk device failure To clear press "OK"

The specified device failed.

Recommended action

- Touch the **OK** button to clear the error.

RAM disk file operation failed To clear press "OK"

A PjL command was received that attempted to perform an illegal operation, such as downloading a file to a nonexistent directory.

Recommended action

- Touch the **OK** button to clear the error.

RAM disk file system is full To clear press "OK"

The RAM disk is full.

Recommended action

- Touch the **OK** button to clear the error.

RAM disk is write protected To clear press "OK"

The device is protected and no new files can be written to it.

Recommended action

- Touch the **OK** button to clear the error.

RAM disk not initialized

The RAM disk file system must be initialized before it can be used.

Recommended action

- Initialize the RAM disk file system.

Ready

The printer is online and ready for data. No status or printer attendance messages are pending at the display.

Recommended action

- No action necessary.

Ready <IP Address>

The printer is online and ready for data. No status or printer attendance messages are pending at the display. The printer IP address displays.

Recommended action

- No action necessary.

Receiving Upgrade

The printer is receiving a firmware upgrade.

Recommended action

- Do not turn the printer off until it reaches the [Ready](#) state.

Remove USB accessory

This message displays when an unsupported USB device is inserted into a host USB port on the printer.

Recommended action

- Remove the unsupported USB device.

Resend Upgrade

A firmware upgrade did not complete successfully.

Recommended action

- Upgrade the firmware again.

For the latest firmware versions, Go to: [HP FutureSmart - Latest Firmware Versions](#)

Restore Factory Settings

The printer is restoring factory settings.

Recommended action

- No action necessary.

ROM disk device failed To clear press “OK”

The specified device failed.

Recommended action

- Touch the [OK](#) button to clear the error.

ROM disk file operation failed To clear press “OK”

A PJL command was received that attempted to perform an illegal operation, such as downloading a file to a nonexistent directory.

Recommended action

- Touch the [OK](#) button to clear the error.

ROM disk file system is full To clear press “OK”

The specified device is full.

Recommended action

- Touch the [OK](#) button to clear the error.

ROM disk is write protected To clear press “OK”

The device is protected and no new files can be written to it.

Recommended action

- Touch the [OK](#) button to clear the error.

ROM disk not initialized To clear press “OK”

The ROM disk file system must be initialized before it can be used.

Recommended action

- Initialize the ROM disk file system.

Service Ink Capacity Warning

The waste ink container on the duplex module is full or almost full. This can cause print quality issues (smearing).

Recommended action

- Replace the duplex module, and then reset the service ink detection mechanism.
 - a. Open the [Administration](#) menu on control panel.
 - b. Select [Manage Supplies](#).

- c. Select [Reset Supplies](#).
- d. Select [New Ink Collection Unit](#) and then touch the [OK](#) button.

Size mismatch in Tray <x>

The paper in the listed tray does not match the size specified for that tray.

Recommended action

1. Load the correct paper.
2. Make sure that the paper is positioned correctly.
3. Close the tray, and then make sure that the control panel lists the correct size and type for the specified tray.
4. If necessary, use the control panel menus to reconfigure the size and type settings for the specified tray.
5. If error persists, use the tray/bin manual sensor test to test the switch.

Sleep mode on

The printer is in sleep mode. Pressing a control-panel button, receiving a print job, or occurrence of an error condition clears this message.

Recommended action

- No action necessary.

Standard bin full

The sensor on standard output bin has determined the bin is full.

Customers see the following message displayed on the control panel screen, but when they check the output bin, it is empty.

This message can appear as "Standard bin full" or "Clear output bin area".

If the output bin is not full, the issue can be caused by the following:

- Defective output flap.
- Defective output drive kit.

Recommended action for customers

1. Remove paper from the standard output bin.
2. If the message persists, please contact customer support.

Recommended action for call-center agents

1. Check the printer for paper jams.
 - Help the user thoroughly inspect the printer and remove all paper present or obstructions in the paper path.

2. Visual inspection of the output flap motion when printing.
 - a. Have the user check if the output flap barely opens and gets stuck while opening when printing.
 - b. If the flap has trouble opening, replace the output flap / sensor kit.



NOTE: Do not use a Mech kit!

Part number: D3Q24-67004

- c. If the output flap doesn't open at all when printing, replace the output drive kit.



NOTE: Do not use a Mech kit!

Part number: D3Q24-67003

3. Document the issue accordingly in the case notes and instruct the technician to follow the recommended action for onsite technician which contains the removal and replacement steps.
4. If the error persists, **do not** predict any additional parts. If another part is needed or the part to be sent is not available please elevate the case using the Standard Support Process.
- 5.


Recommended action for onsite technicians

1. Ensure the paper size and paper type being used meet the printer's specifications before replacing the parts.
2. Thoroughly check the printer for any paper jams and obstructions.
3. Order the output drive kit and the output flap/sensor kit.

Output drive kit part number: D3Q24-67003

Output flap/sensor kit part number: D3Q24-67004

Figure 7-78 Kit parts

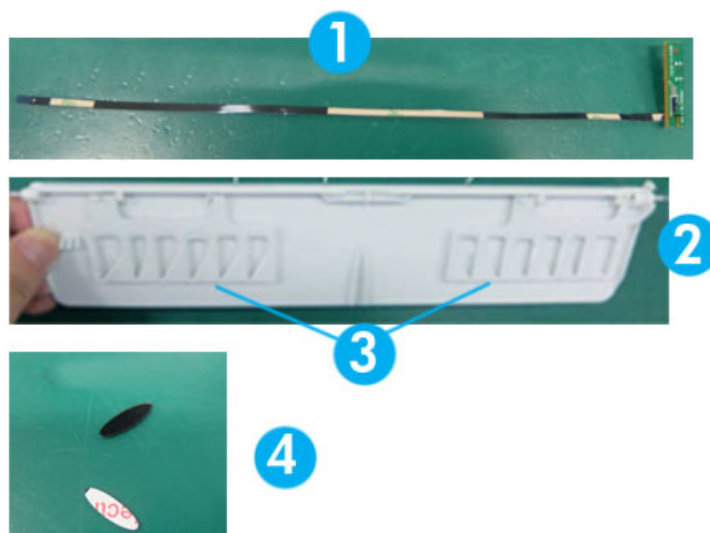

- 1- Optical sensor and PCA with FFC

- 2 - Output flap assembly
 - 3 - Mini-flaps
 - 4 - Shims
4. Visual inspect the output when printing.
 5. If the flap barely opens or gets stuck when opening, replace the output flap/sensor kit. If the output flap does not open at all, skip to the next main step.

For instructions: [Removal and replacement of output bin flap.](#)

Steps for replacing the output flap.

- a. The steps for replacing the output flap differ slightly for each product model. For certain models, you will need to remove the output bin and right cover before you can replace the output flap. Find the product model in the list below and follow the steps provided.
- b. Locate the scanner base cover.

Figure 7-79 Scanner base cover



- c. Remove scanner base cover using a flat screwdriver and push it down until released.

Figure 7-80 Remove cover



Figure 7-81 Cover lowered all the way



- d. Flex the middle of the eject flap, and remove the pin from the rear hinge opening.

Figure 7-82 Flex middle with finger



Figure 7-83 Flex middle with screw driver



- e. While continuing to pull out on the center of the flap, remove the right side of the flap by pressing in and sliding the retention pin out of its holder.




NOTE: Be sure to lift the right mini-flap (underneath the eject flap) to a 45° angle to avoid damaging the nearby opto-sensor.



Figure 7-84 Slide flap



Figure 7-85 Retention pin

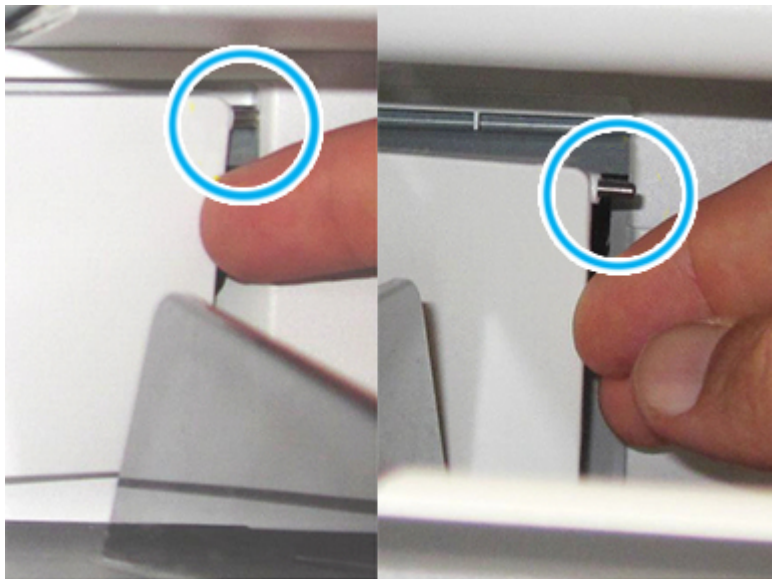

- f. After removing the output flap assembly, initiate a print job.
- g. If the "Clear Output Bin Area" or "Standard bin full" message does not display, skip to the next step to replace the output flap assembly. If the "Clear Output Bin Area" or "Standard bin full" message displays on the control panel, perform the following.
 - Verify that the eject flap optical sensor and PCA FFC cable is connected securely to the J5 connector on the RED1 distribution board see following image.

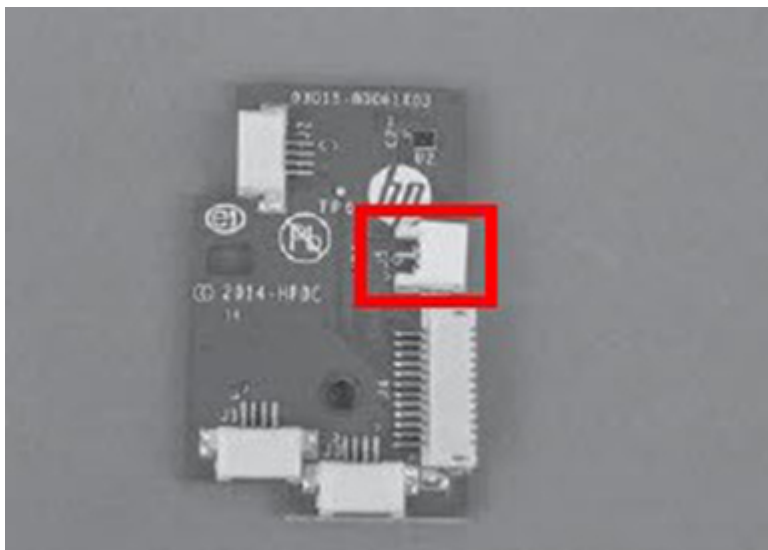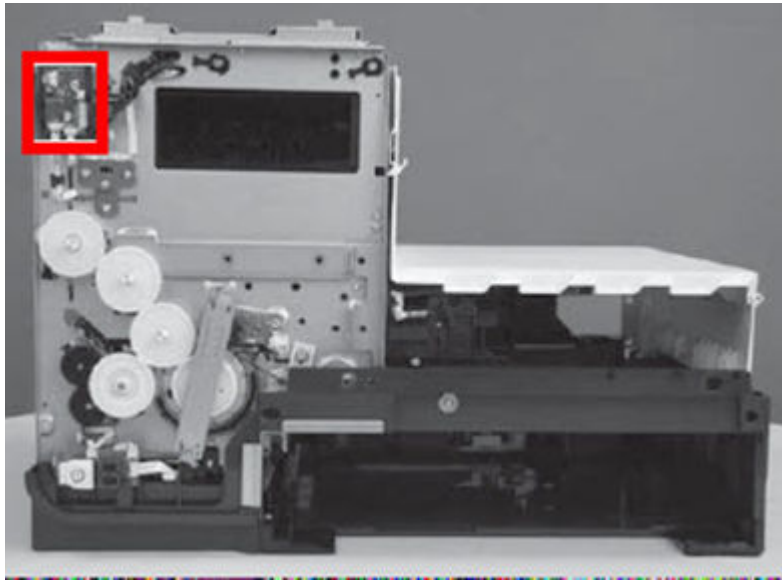



- If the FFC is securely in place, then replace the Eject Flap Optical PCA with FFC.
- Remove the ink collection unit/duplexer, left rear cover, left cover, scanner/ADF assembly and bracket (if needed), left front cover, top cover, front cover, and the top cap assembly.

Remove and replace the eject flap optical sensor and PCA with FFC.

 **NOTE:** Take special care when routing and connecting the cable on the distribution board. Routing the cable can be tricky since there are several bends and turns along the cable path.

- Re-assemble the unit.
- Test the unit by initiating a print job (start a copy job or print an internal report like the Printer Status Report).
- If the "Clear Output Bin Area" or "Standard bin full" message continues to display on the control panel, continue to the next step.

- Verify that the eject flap optical sensor and PCA FFC cable is connected securely to the J5 connector on the REDI distribution board see following image.

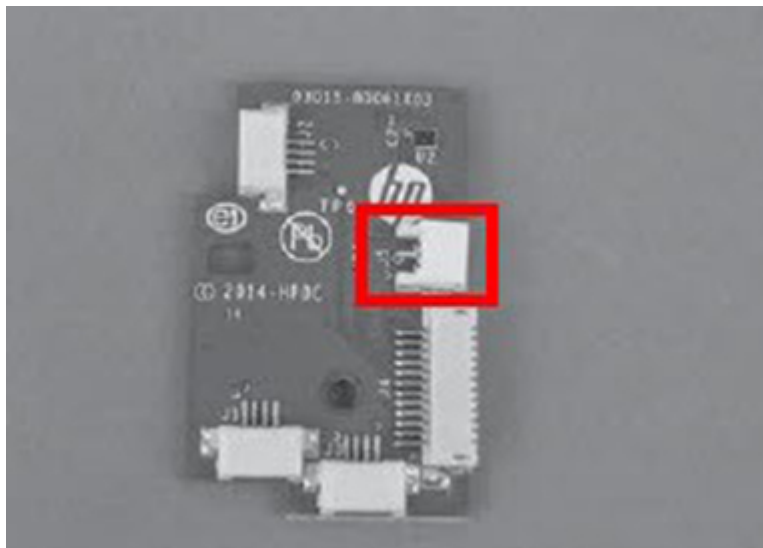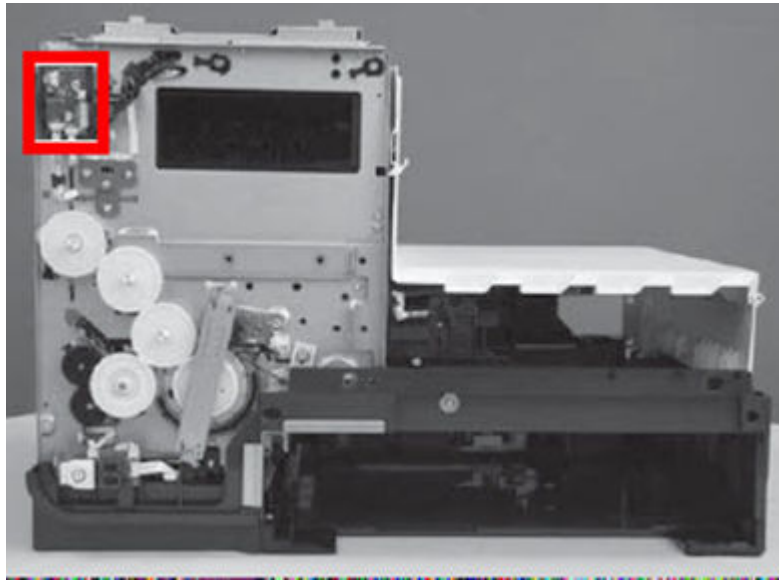

- If the FFC is securely in place, then replace the Eject Flap Optical PCA with FFC.
- Remove the ink collection unit/duplexer, left rear cover, left cover, scanner/ADF assembly and bracket (if needed), left front cover, top cover, front cover, and the top cap assembly.
- Remove and replace the eject flap optical sensor and PCA with FFC.



NOTE: Take special care when routing and connecting the cable on the distribution board. Routing the cable can be tricky since there are several bends and turns along the cable path.

- Re-assemble the unit.
- Test the unit by initiating a print job (start a copy job or print an internal report like the Printer Status Report).

- If the "Clear Output Bin Area" or "Standard bin full" message continues to display on the control panel, continue to the next step.
- h. If the unit's serial number is CN64 or earlier, remove the right mini-flap from the old eject flap, and use it to replace the right mini-flap on the new eject flap. See kit image.
- i. Install the new output flap assembly by inserting the flap-pin into the front hinge hole, gently bending the flap in the middle, and then insert the other flap-pin into the rear hinge. The pins must be in the hinge holes for the output flap to operate correctly.



NOTE: When inserting the flap assembly, be sure to lift the mini-flap (underneath the eject flap) to a 45° angle to avoid damaging the nearby opto-sensor.

- j. Verify that the flap moves freely, and then test the unit by initiating a print job (start a copy job or print an internal report like the Printer Status Report).
- k. If the error persists, remove the output flap assembly and install one shim
- l. Insert and rotate the tip of a flat blade screwdriver (about a quarter of a turn) to pry up the plastic cover approximately 2mm in the area as shown in the following images.




NOTE: Take care lifting the top case part with the screwdriver, to avoid damaging the plastic part. If you have electrical tape available, put a small piece on the tip of the screwdriver to protect the top case part.

Figure 7-86 Prying plastic



Figure 7-87 Close up

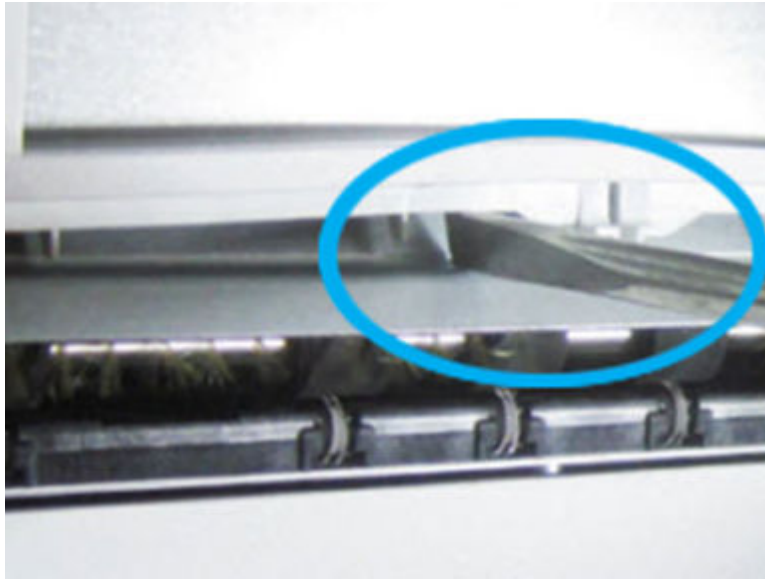

- m. Remove the adhesive backing on the shim. Grip the shim with a pair of tweezers and carefully place the shim directly below the plastic rib next to the screwdriver tip (see the following image).



NOTE: You can use tweezers or needle nose pliers to place the shim.

Figure 7-88 Inserting shim



- n. Untwist and remove the flat blade screwdriver and ensure that the plastic rib rests on the shim. Carefully, but firmly, use the screwdriver to press down and fully engage the adhesive on the shim on both sides of the rib.
 - o. Replace the output flap assembly.
6. Replace the output drive kit.

- a. Refer to the "Output eject drive kit" section in the Repair Manual for detailed instructions on replacing the output drive kit.

Go to: Service
Manual

<https://support.hp.com/wps/hp-skip-ports/document/manuals/attachments/443/c05031618.pdf>

- b. The basic steps for this procedure are as follows:
- c. Remove the ink collection unit, rear cover, left-rear cover, left-front cover, scanner/ADF assembly, and top cover.
- d. Replace the eject drive module.

Startup Routine Ink Alert

The cartridge indicated might not have enough ink to complete the product startup process.

- **17.00.36** – Black Cartridge
- **17.01.36** – Cyan Cartridge
- **17.02.36** – Magenta Cartridge
- **17.03.36** – Yellow Cartridge

Recommended action

- Replace the cartridge indicated in the error message.

The unit has corrupt data

Data corruption has occurred in the firmware volume.

- **98 . 00 . 01** : Corrupt data in the firmware volume
- **98 . 00 . 02** : Corrupt data in the solutions volume
- **98 . 00 . 03** : Corrupt data in the configuration volume
- **98 . 00 . 04** : Corrupt data in the job data volume

Recommended action for 98.00.01, 98.00.02, and 98.00.03

For **98 . 00 . 01** , **98 . 00 . 02** , and **98 . 00 . 03** , perform the following steps:

1. Turn the printer off, and then on.
2. Use the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

3. Reload the firmware.

Recommended action for 98.00.04

For **98 . 00 . 04** , perform the following steps:

1. Turn the printer off, and then on.
2. Run the file erase function.

For the steps to perform this procedure, go to [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#).

Tray <X> empty: [Type], [Size] / Tray X Out of Paper

The specified tray is empty and the current job does not need this tray to print.

- X = 1: Tray 1
- X = 2: Tray 2
- X = 3: Tray 3

Recommended action

1. Refill the tray at a convenient time.
2. This could be a false message. If the tray is loaded without removing the shipping lock, the product does not sense that the paper is loaded. Remove the shipping lock, and then load the tray

Tray <X> lifting

The product is in the process of lifting paper in the indicated tray.

- X = 2: Tray 2
- X = 3: Tray 3

Recommended action

- No action necessary.

Tray <X> open

The specified tray is open or not closed completely.

- X = 2: Tray 2
- X = 3: Tray 3

Recommended action

1. Close the tray.
2. If this message displays after the lifter drive assembly was removed or replaced, make sure that the connector of the assembly is connected correctly and fully seated.
3. If the error persists, use the media size switches in the tray/bin manual sensor test to test the switches.
4. If the switches do not respond, replace the associated lifter drive assembly.

Tray <X> [type] [size]

The paper in the specified tray is detected as the specified size and type.

The custom switch was not changed.

Recommended action

- If the paper is a custom size or type, change the custom switch accordingly.

Type mismatch Tray <x>

The specified tray contains a paper type that does not match the configured type.

Recommended action

The specified tray will not be used until this condition is addressed. Printing can continue from other trays.

1. Load the correct paper in the specified tray.
2. On the printer control panel, make sure the paper type loaded in the tray matches the specified setting for the tray.

Use startup cartridges

The product needs the startup ink cartridges that came with the product to perform the initial startup process.

Recommended action

- Replace the cartridges with the startup ink cartridges that came with the product.

Used HP Ink Cartridge(s) installed

The product has detected a used cartridge or cartridges.

Recommended action

- Press or touch the **OK** button to clear the message.

Used or Counterfeit Cartridge Detected

The supply being used is either a counterfeit or refilled cartridge.

- **17.00.34** – Black Cartridge
- **17.01.34** – Cyan Cartridge
- **17.02.34** – Magenta Cartridge
- **17.03.34** – Yellow Cartridge

Recommended action

1. At the computer, click **Yes** or **No** to clear the message.
2. If you believe you purchased a genuine HP supply, go to www.hp.com/go/anticounterfeit. Any print quality repair required as a result of using used cartridges is not covered under warranty. Supply status and features depending on supply status are not available.

Unsupported drive installed To continue, touch “OK”

A non-supported hard disk drive has been installed. The hard disk drive is unusable by this printer.

Recommended action

1. Turn the printer off.
2. Remove the hard drive.
3. Turn the printer on.

Unsupported supply in use OR Unsupported supply installed to continue touch OK

A non-supported supply has been installed or the ink cartridge is for a different product.

Recommended action

- Install the correct supplies for this product.

Unsupported USB accessory detected Remove USB accessory

A non-supported USB accessory has been installed.

Recommended action

- Turn the printer off, remove the USB accessory, and then turn the printer on.

Upgrade Error

SCB upgrade error has occurred.

Recommended action

1. Turn the product off, and then on.
2. Resend the upgrade.
3. If the error persists, replace the SCB.

For instructions: See the Repair Service Manual for this product.

Part number: G1W39-67935

USB accessory not functional

A parameter in the USB accessory is not correctly functioning.

Recommended action

1. Turn the printer off.
2. Remove the USB accessory.
3. Insert a replacement USB accessory.
4. Turn the printer on.

USB hubs are not fully supported Some operations may not work properly

Some USB hubs require more power than the printer has available.

Recommended action

- Remove the USB hub.

USB is write protected To clear press "OK"

The device is protected and no new files can be written to it.

Recommended action

- Touch the [OK](#) button to clear the error.

USB needs too much power Remove USB and then turn off and on

A USB accessory is drawing too much electrical current. Printing cannot continue.

Recommended action

1. Turn the printer off, remove the USB accessory, and then turn the printer on.
2. Use a USB accessory that uses less power or that contains its own power supply.

USB not initialized

The USB device file system must be initialized before it can be used.

Recommended action

1. Enable the USB port using the following steps:
 - **FutureSmart 3:**
 - a. From the Home screen on the printer control panel, open the following menus:
 - i. [Administration](#)
 - ii. [General Settings](#)
 - b. Select [Enable Device USB](#).
 - c. Select [Enabled](#), and then select [Save](#).
 - d. Touch the Back button  to return to the [General Settings](#) menu.
 - **FutureSmart 4:**
 - a. From the Home screen on the printer control panel, select [Settings](#).
 - b. Select [Copy/Print](#).
 - c. Select [Enable Device USB](#), and then select [Enabled](#).
 - d. Touch the Back button  to return to the [Settings](#) menu.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

USB storage accessory removed Clearing any associated data

This message displays for about 6 seconds after a USB device is removed.

Recommended action

- Touch the **OK** button to remove this message.

USB storage device failure To clear press “OK”

The specified device failed.

Recommended action

- Touch the **OK** button to clear the error.

USB storage file operation failed To clear press “OK”

A PJL file system command was received that attempted to perform an illegal operation, such as downloading a file to a nonexistent directory.

Recommended action

- Touch the **OK** button to clear the error.

USB storage file system is full To clear press “OK”

The file system on the installed USB device is full.

Recommended action

- Touch the **OK** button to clear the error.

Very Low on Ink

The ink level in the indicated cartridge has reached a very low level.

- **17.00.69** – Black Cartridge
- **17.01.69** – Cyan Cartridge
- **17.02.69** – Magenta Cartridge
- **17.03.69** – Yellow Cartridge

Recommended action

- It is not necessary to replace the cartridge at this point. HP recommends having a replacement cartridge ready for when the cartridge is empty.

Windows Login Required to Use this Feature

Windows login required.

Recommended action

- Enter your windows login.

Index

Symbols/Numerics

(c04581810) 295

B

backup error
 32.WX.YZ error 4
 reset error 4
 restore error 4

C

connector error
 65.WX.YZ error 5

D

DC controller communication error
 55.WX.YZ error 4
DC controller firmware error
 70.WX.YZ error 5
digital sending error (firmware)
 44.WX.YZ error 4
document feeder error
 31.WX.YZ error 4
duplexer error
 69.WX.YZ error 5

E

Embedded Jetdirect error
 80.WX.YZ error 5
engine error (LaserJet)
 46.WX.YZ error 4
 63.WX.YZ error 5
engine error (PageWide)
 61.WX.YZ error 5
event log error (firmware)
 42.WX.YZ error 4

F

fan error
 58.WX.YZ error 4

firmware communication error
 49.WX.YZ error 4
firmware install error
 99.WX.YZ error 5
hard disk error 5
remote firmware upgrade
 error 5
fuser error
 41.WX.YZ error 4
 laser scanner error 4
 paper path error 4
fuser error (LaserJet)
 50.WX.YZ error 4

H

hard disk partition error
 98.WX.YZ error 5

I

input accessory error
 67.WX.YZ error 5
input/output error
 40.WX.YZ error 4
internal diagnostics error
 90.WX.YZ error 5
video display error 5

J

jam error (LaserJet)
 13.WX.YZ error 4
jam error (PageWide)
 13.WX.YZ error 4
job accounting error (firmware)
 48.WX.YZ error 4
job management error
 (firmware) 4
job pipeline error (firmware) 4
job parser error (firmware)
 47.WX.YZ error 4
printer calibration error 4

L

laser scanner error (LaserJet)
 51.WX.YZ error 4
 52.WX.YZ error 4
last update 1

M

memory error
 82.WX.YZ error 5
 EMMC error 5
 hard disk error 5
motor error (LaserJet)
 59.WX.YZ error 5

N

Near Field Communication error
 81.WX.YZ error 5
Bluetooth error 5
external I/O card error 5
internal EIO error 5
wireless error 5

O

output accessory error
 66.WX.YZ error 5
OXPD/Web kit error
 45.WX.YZ error 4

P

page error
 21.WX.YZ error 4
paper handling error (LaserJet)
 56.WX.YZ error 4
print bar error (PageWide)
 62.WX.YZ error 5
printer memory error
 20.WX.YZ error 4

R

real-time clock error
11.WX.YZ error 4

S

scanner error
30.WX.YZ error 4
security error
33.WX.YZ error 4
sensor error
54.WX.YZ error 4
58.WX.YZ error 4
supplies error (LaserJet)
10.WX.YZ error 4
supplies error (PageWide)
17.WX.YZ error 4
system error (LaserJet)
62.WX.YZ error 5

T

tray motor error (LaserJet)
60.WX.YZ error 5