QUALITY INSPECTION REPORT

Stainless steel kitchenware, incoming batch QC-2026-114

Supplier: Meridian Metalworks Pvt. Ltd. Inspector: R. Iyer Date: 14 October 2026

1. Scope

This report records the visual and dimensional inspection of 240 units of SKU B-220 (mixing bowl, 24 cm) and 120 units of SKU L-410 (serving ladle, 32 cm) received on 12 October 2026. Inspection followed procedure QP-07 rev. 4: 100% visual check under 800 lux, rim deformation measured with a dial gauge, and a dye-penetrant check on 10% of welded joints. Each defect is photographed and annotated; the annotations in the figures are part of the inspection record.

2. Acceptance criteria

Rim deformation up to 1.0 mm is acceptable (grade A). Deformation between 1.0 mm and 2.5 mm is grade B and may be reworked. Deformation above 2.5 mm, any crack, or any weld porosity visible under dye penetrant is a reject. Surface scratches longer than 15 mm on a food-contact surface are grade B.

3. Findings

3.1 Rim deformation on SKU B-220. Seven of 240 bowls showed deformation of the rolled rim. The worst case is shown in Figure 1: the dent measured 2.1 mm at the deepest point and sits 35 mm from the seam weld. A 22 mm scratch on the inner wall of the same unit is also marked. The unit is graded B and sent for rework.

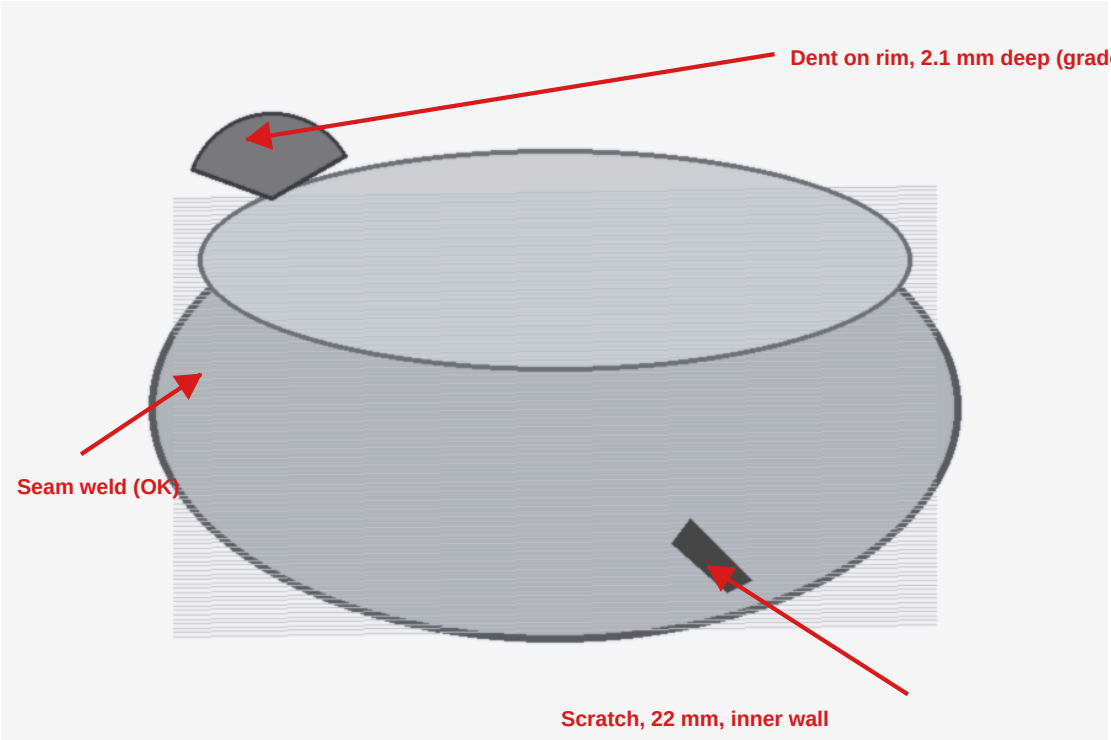


Figure 1. Mixing bowl SKU B-220, unit 117. Red arrows mark the rim dent (2.1 mm), a 22 mm scratch on the inner wall and the seam weld, which passed dye-penetrant inspection.

3.2 Surface finish. Brushed finish uniform on all units; no pitting observed. Nine units carried minor handling marks under 15 mm which are within specification. Compare the marked scratch in Figure 1, which exceeds the 15 mm limit.

3.3 Weld integrity on SKU L-410. Dye-penetrant testing of 12 ladles revealed one hairline crack at the handle-to-bowl weld, shown in Figure 2. Crack length 11 mm, oriented across the weld toe. This is a reject under clause 2. The remaining 11 sampled welds were sound.

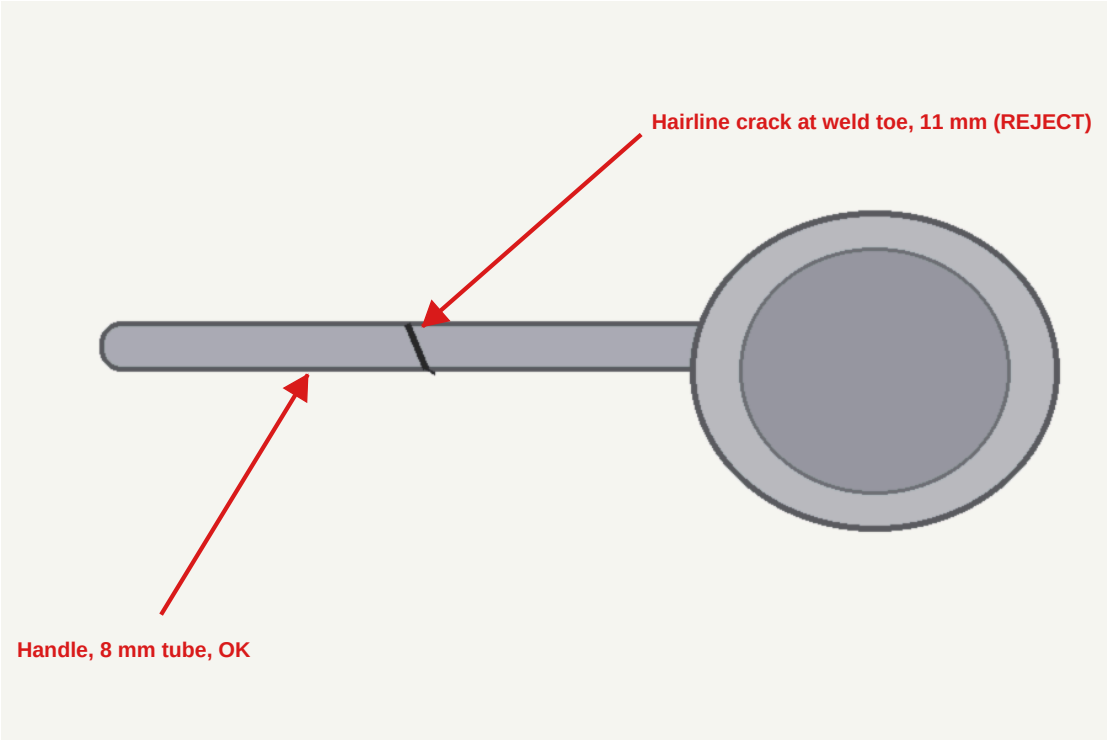


Figure 2. Serving ladle SKU L-410, unit 22, after dye-penetrant test. The arrow marks an 11 mm hairline crack at the handle-to-bowl weld toe. The unit is rejected.

4. Defect register

Table 1 lists every defect found in the batch with its disposition.

Unit	SKU	Defect	Location	Size	Grade	Action
117	B-220	Rim deformation	Rim, 35 mm from weld	2.1 mm	B	Rework
117	B-220	Scratch	Inner wall	22 mm	B	Rework
041	B-220	Rim deformation	Rim, opposite weld	1.4 mm	B	Rework
088	B-220	Rim deformation	Rim	0.8 mm	A	Accept
203	B-220	Rim deformation	Rim near weld	2.7 mm	Reject	Scrap
022	L-410	Hairline crack	Handle-to-bowl weld toe	11 mm	Reject	Scrap
067	L-410	Weld porosity	Weld root	2 pores	Reject	Scrap
105	L-410	Handling mark	Handle	9 mm	A	Accept

Table 1. Defect register for batch QC-2026-114.

5. Disposition

Three units are rejected and scrapped (B-220 unit 203, L-410 units 022 and 067). Four units go to rework. The batch is accepted conditionally; the supplier is asked for a corrective action report on the handle weld within 15 days.