

MIG/Flux-Cored Wire Welding



Read the **ENTIRE** IMPORTANT SAFETY INFORMATION section at the beginning of this manual including all text under subheadings therein before set up or use of this product.


WARNING

TO PREVENT SERIOUS INJURY FROM ACCIDENTAL OPERATION:
Turn the Power Switch off and unplug the Welder before setup.


Note: Remove the protective foam and cardboard from the Welder before setup.

Wire Spool Installation/Wire Setup


1. Turn the Power Switch OFF and unplug the Welder before proceeding.

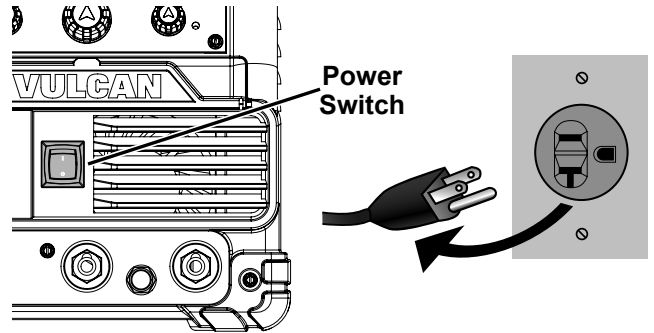

2. Pull up on the Door Latch, then open the Door.

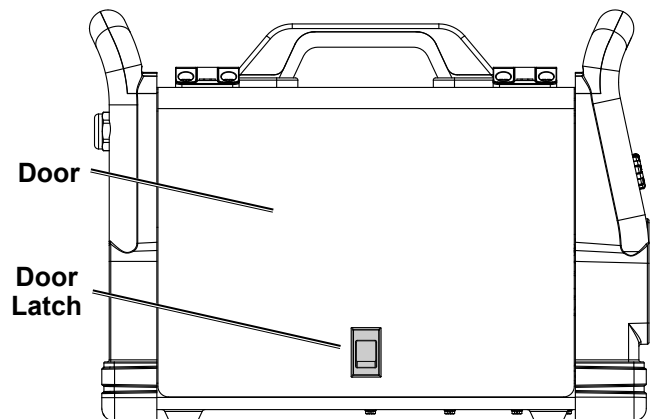

3. **1-2 Pound Wire Spool Installation:**
Remove the Wingnut and Spacer. If replacing a Spool, remove the old Spool and all remaining wire from the liners.
4. Place the new Wire Spool over the Spool Spindle and against the Spool Brake Pad as illustrated.
To prevent wire feed problems, set the Spool so that it will unwind clockwise.
5. Replace the Spacer over the Spool Spindle and secure Spool in place with the Wingnut.

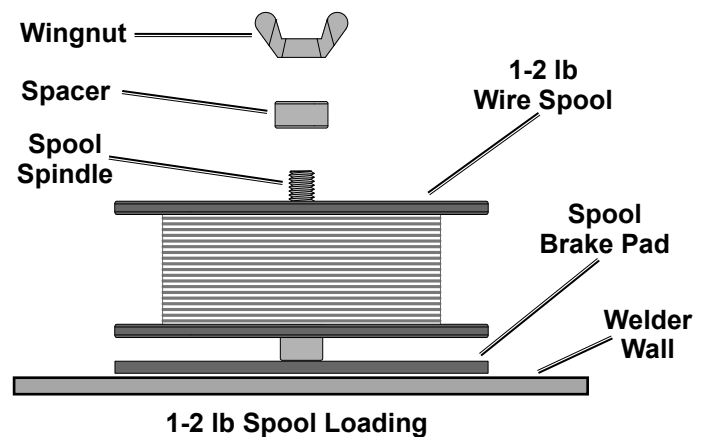

Notice: If Wire Spool can spin freely, Wingnut is too loose. This will cause the welding wire to unravel and unspool which can cause tangling and feeding problems.