



13. Loosen the Knob on the Wire Feed mechanism, then insert the Gun Cable Connector through the hole on the Welder front and into the socket on the Wire Feed.

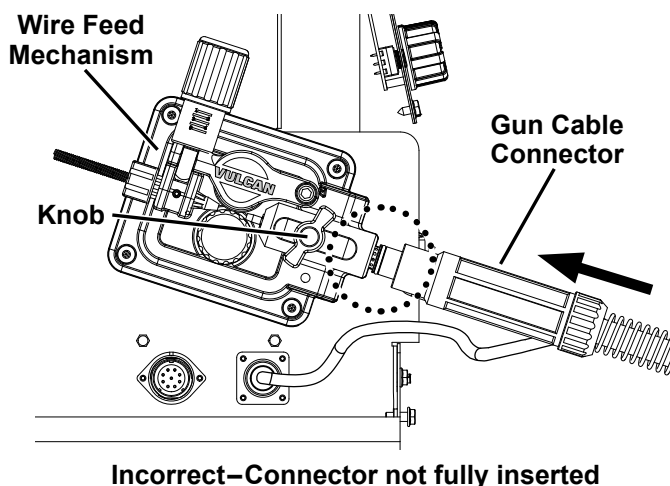

14. Ensure that the Gun Cable Connector is fully inserted into the socket on the Wire Feed mechanism as shown, then tighten the Knob securely. If Connector is not fully inserted, the gas connection will leak, preventing shielding gas from reaching the welding arc.

NOTICE: To prevent damage, do not overtighten the Knob.

15. Insert the Wire Feed Control Cable through the hole on the Welder front and connect it to the Wire Feed Control Socket inside the machine, then tighten the lock ring on the Cable plug. Note that the plug on the Cable fits into the Socket in one specific orientation only.

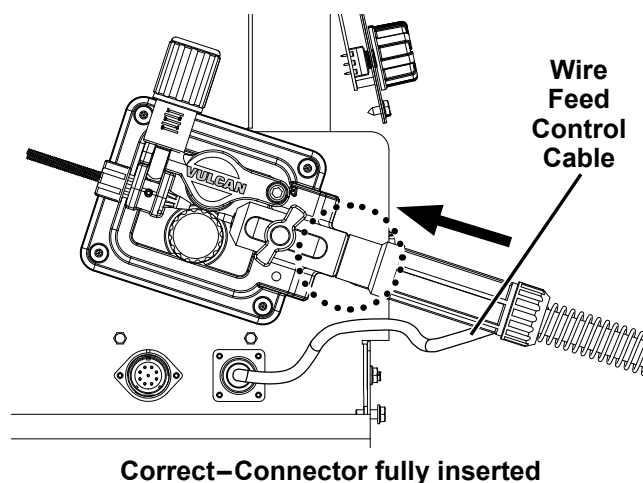

16. **DCEN Direct Current Electrode Negative Wire Setup for Flux-Cored (gasless) welding:** Plug Ground Clamp Cable into Positive (+) Socket. Plug Wire Feed Power Cable into Negative (-) Socket. Twist cables clockwise all the way to lock in place.

