


4. Turn the Power Switch to the OFF position, then plug the Power Cord into a properly grounded, GFCI protected 120VAC (20 amp rated) or 240VAC receptacle that matches the plug. The circuit must be equipped with delayed action-type circuit breaker or fuses.
5. Set MIG Gun down on nonconductive, nonflammable surface away from any grounded objects.
6. Turn the Power Switch ON.



Settings

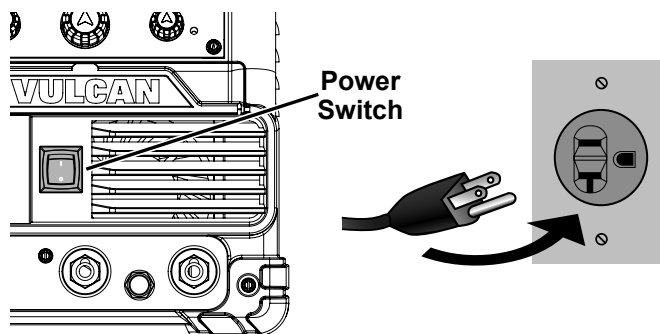

1. Press Home Button on Control Panel.
 2. Turn Main Control Knob until desired process appears on LCD display screen.
 3. Press Main Control Knob to select process.
- Note:** Press Main Control Knob to go to next screen. Press Back Button to return to the previous screen.

4. Adjust settings for the selected process.

a. Polarity and Gas Settings:

- Plug cables in according to screen.
- Connect gas according to screen.
- Set SCFH between 20-30.




b. Set Wire Diameter and Material Thickness:

- Turn Left Knob to set wire diameter.
- Turn Right Knob to set material thickness.



c. Auto Weld Settings:

- Turn Left Knob to adjust Wire Feed Speed (Amperage).
- Turn Right Knob to adjust Voltage.

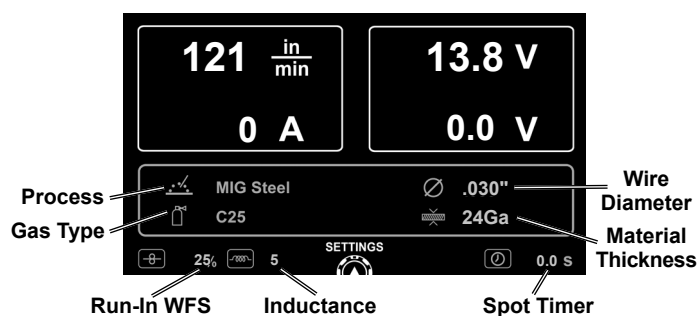

Note: If the Wire Feed Speed or Voltage settings are adjusted manually, the white mark on the line shows the recommended setting for your wire/electrode diameter and workpiece thickness.