


Note: If Welder is used too long, a warning screen appears in the LCD Display window and the unit automatically shuts down. The Welder automatically returns to service after cooling off. Should this occur, rest the MIG Gun on an electrically non-conductive, heat-proof surface, such as a concrete slab, away from the ground clamp.

Allow the Welder to cool with the Power Switch on, so that the internal Fan will help cool the Welder.

When normal operation resumes, use shorter welding periods and longer rest periods to help prevent needless wear.

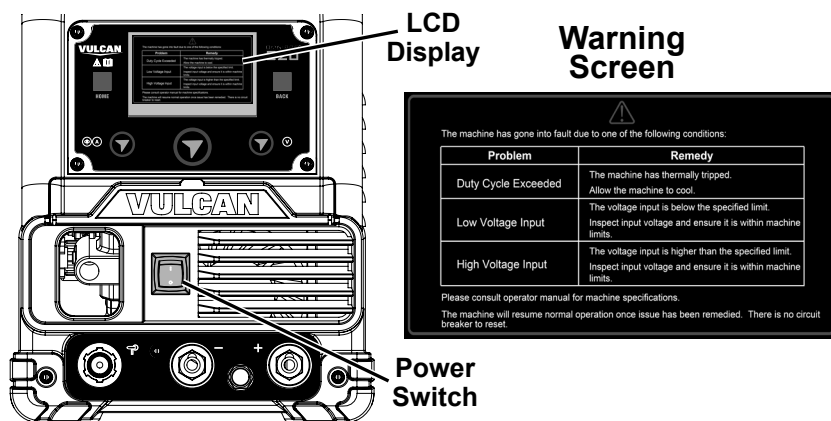


7. **After welding the test weld on a piece of scrap for a few seconds**, stop, and check your progress. Clean, then compare your weld's appearance with the diagrams and descriptions in the **Welding Tips** section starting on the next page. After making any necessary adjustments, continue to weld **while carefully following the DUTY CYCLE guidelines as explained on page 19.**

CAUTION! Weld will be hot, do not touch.

After practice welding for a few seconds, STOP and examine your weld using the guidelines starting on the next page.

FOLLOW DUTY CYCLE!

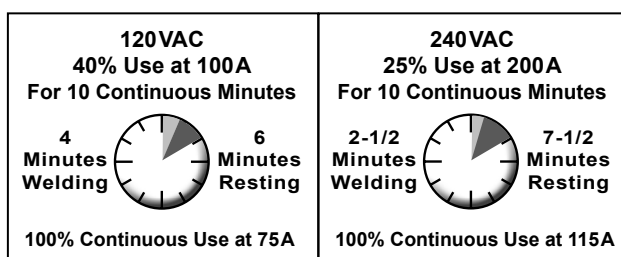

8. **When welding is complete, set the MIG Gun down on a heat-proof, electrically non-conductive surface.**
Turn the Power Switch OFF.
9. Allow Welder to cool down, then unplug the Power Cord.
10. Remove Ground Clamp from workpiece or table and disconnect MIG Gun.
11. Respool wire by clipping wire, removing gas nozzle/contact tip on MIG gun, releasing Idler Arm on Wire Feed mechanism, and rotating the Wire Spool counterclockwise. Be sure to securely hold wire as it is being respooled because the end of wire has a tendency to quickly unravel once it clears the wire feeder.
12. **MIG ONLY:**
Close shielding gas cylinder valve securely. Remove Regulator and replace cap. Disconnect Gas Hose from Welder. Store and secure gas cylinder.

