


Connect Shielding Gas

1. With assistance, place an 100% Argon cylinder (not included) onto a cabinet or cart near the Welder and secure the cylinder in place with two straps (not included) to prevent tipping.
2. Remove the cylinder's cap. Stand to the side of the valve opening, then open the valve briefly to blow dust and dirt from the valve opening. Close the cylinder valve.
3. Locate the Regulator (included) and close its valve until it is loose, then thread Regulator onto cylinder and wrench-tighten connection.
4. Connect Shielding Gas Hose on TIG Torch Cable Connector to the Regulator's Outlet and wrench-tighten connection.

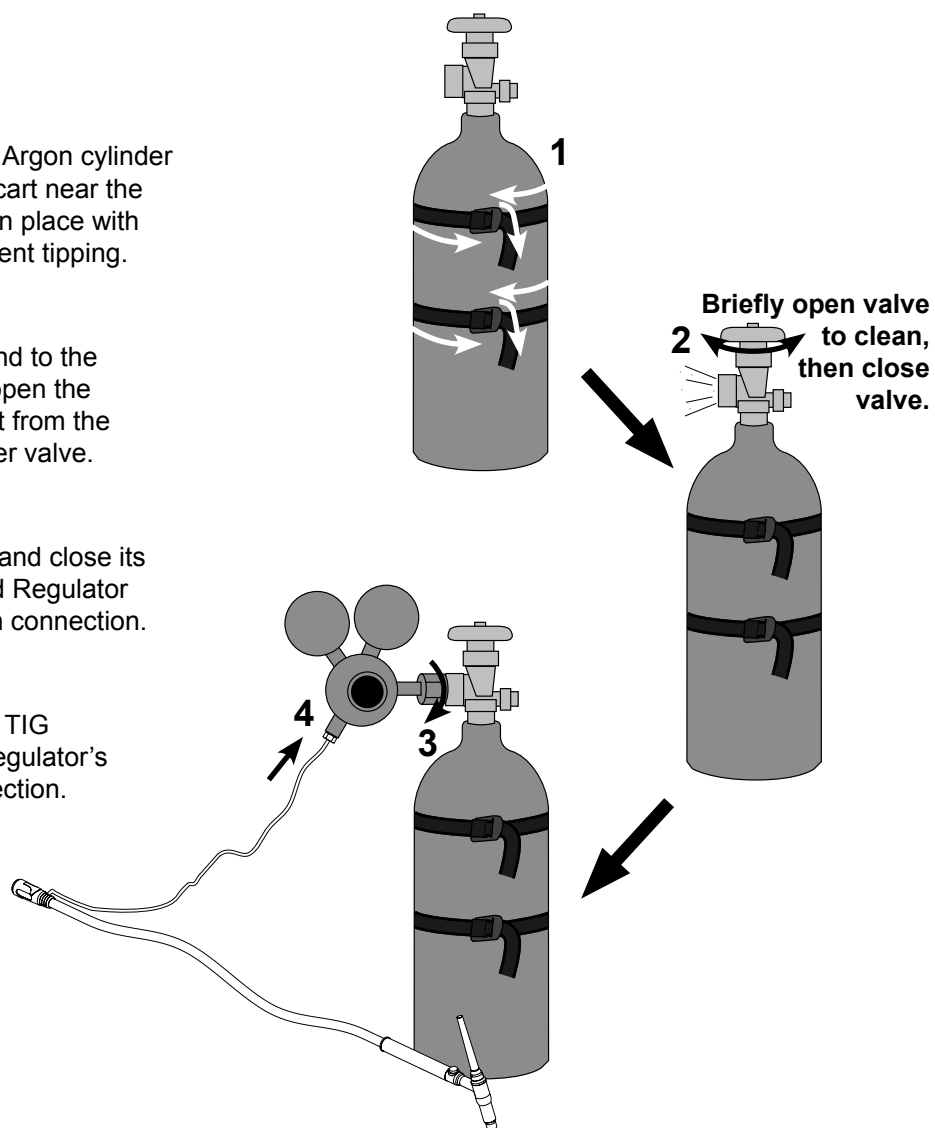


Connect Power Cord

Plug either 120VAC or 240VAC Power Cord into Power Input Socket.

Note: Plug will only fit one way.

WARNING! TO PREVENT SERIOUS INJURY FROM ACCIDENTAL OPERATION: Do not plug cord into wall outlet at this time.

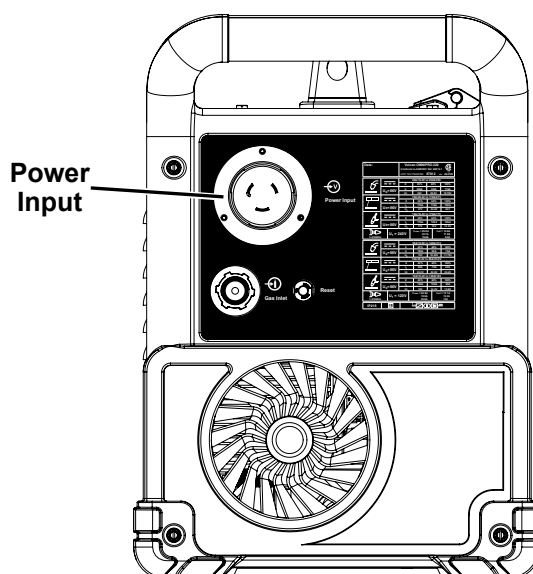

SAFETY

CONTROLS

WIRE

TIG / STICK

WELDING TIPS

MAINTENANCE