

Stick Welding

⚠ WARNING

TO PREVENT SERIOUS INJURY AND DEATH:

Do not weld without Grounding Clamp.


When the operator is not holding the Electrode Holder, it must be sitting on a nonconductive, nonflammable surface.

1. Turn the Power Switch to the OFF position, then plug the Welder into a properly grounded, GFCI protected, 120VAC (20 amp rated) outlet or 240V outlet. The circuit must be equipped with delayed action-type circuit breaker or fuses.
2. Set Electrode Holder down on nonconductive, nonflammable surface away from any grounded objects.
3. Turn the Power Switch ON.
4. Press Home Button on Control Panel.
5. Turn Main Control Knob until Stick process appears on LCD display screen.
6. Press Main Control Knob to select STICK process.

Note: Press Main Control Knob to go to next screen. Press Back Button to return to the previous screen.



- b. Set Electrode type:
 - Turn Main Control Knob to set electrode type.

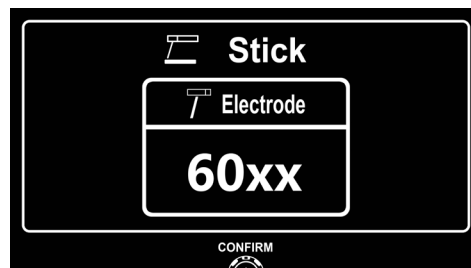

- c. Set Electrode Diameter and Material Thickness:
 - Turn Left Knob to set electrode diameter.
 - Turn Right Knob to set material thickness.



- d. Auto Weld Settings:
 - Turn Left Knob to adjust output amperage.
 - Turn Right Knob to ON to energize Electrode Holder.

WARNING! TO PREVENT SERIOUS INJURY: Welder is now energized and Open Circuit Voltage is present.

7. Adjust settings for the STICK process.
 - a. Polarity Setting:
 - Plug cables in according to screen.

