


Stick Weld Diagnosis–Workpiece Heat Control / Weld Penetration


SAFETY

CONTROLS


INADEQUATE PENETRATION

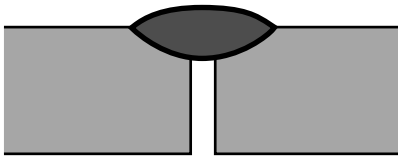

PROPER PENETRATION

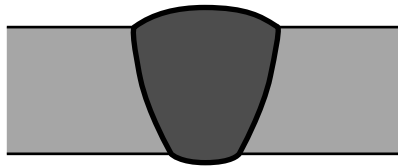

EXCESS PENETRATION OR BURN-THROUGH

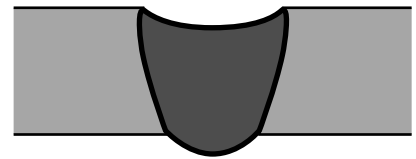

Not hot enough

Ideal heat

Too hot

How to increase workpiece heat and increase penetration:
(to weld **THICKER** workpieces properly)

a. Increase current. b. Weld more slowly.


How to reduce workpiece heat and limit penetration:
(to weld **THINNER** workpieces properly)

c. Decrease current. d. Weld more quickly.

Example Stick Weld Diagrams

CLEAN WELDS FIRST!

Stick welds will have a coat of slag over them until cleaned.

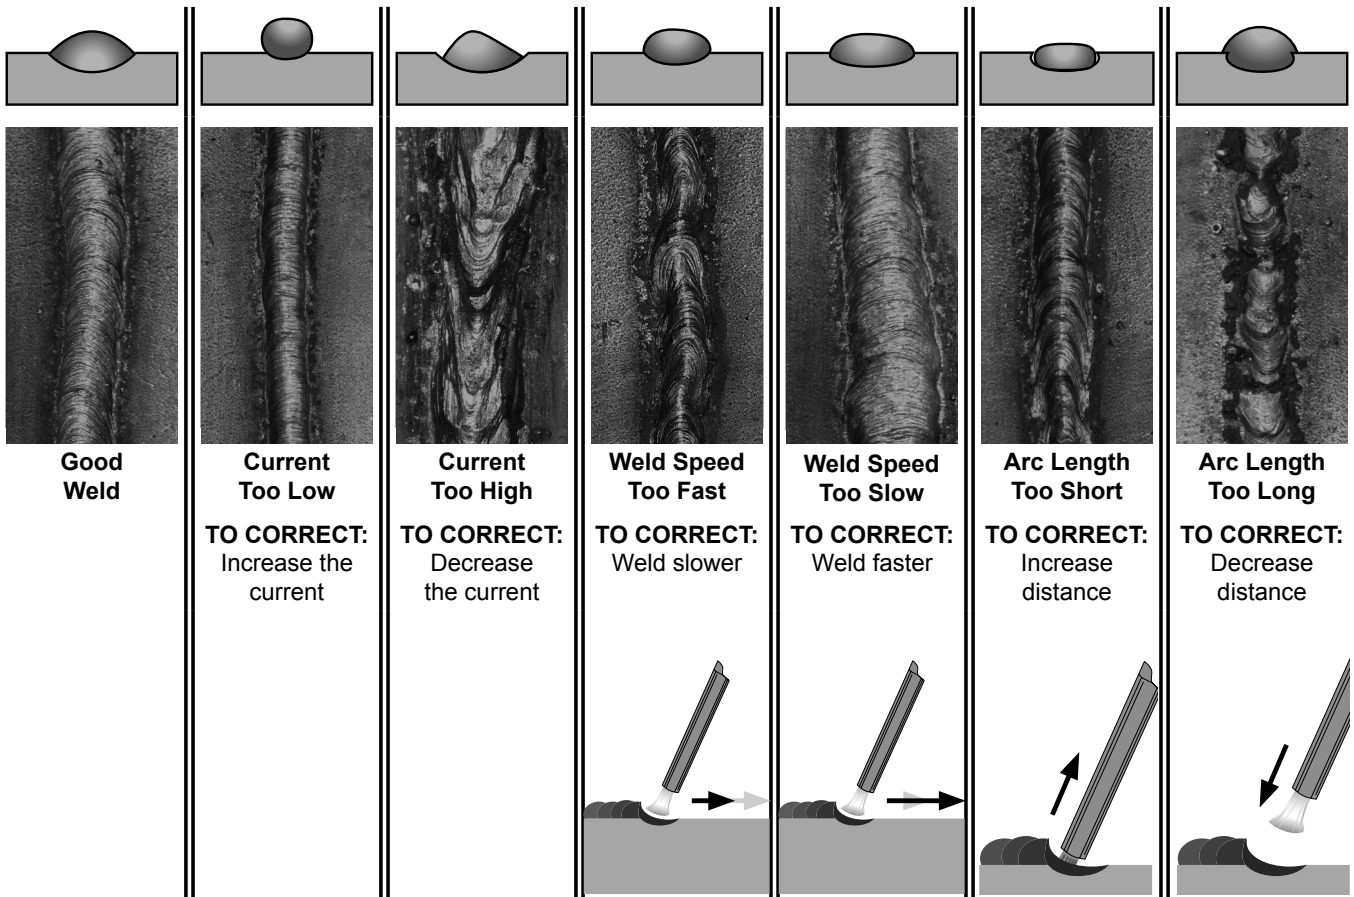

WIRE

TIG / STICK

WELDING TIPS

MAINTENANCE