


d. Optional Settings:

- Press Main Control Knob to enter Optional Settings.
- Turn Main Control Knob until desired setting appears on screen.
- Press Main Control Knob to select desired setting.
- Turn Main Control Knob to adjust setting.

Available Optional Settings:

- Run-In WFS—Adjust wire speed before it contacts workpiece. This setting represents a % of the pre-set wire feed speed (WFS).
- Inductance—Adjust length of arc. Increase for more fluid puddle and flatter bead. Decrease for colder puddle.
- Spot Timer—Set timer for spot welding.
- Recall Setting—Retrieve saved settings.
- Save Setting—Program up to 5 different configurations. Turn Main Control Knob to scroll between 5 available slots. Press Main Control Knob to access OVERWRITE MEMORY SETTING screen and turn Main Control Knob to choose YES selection. Press Main Control Knob to save current Welder settings.

Note: The initial settings may need to be adjusted after stopping and carefully inspecting the weld. Proper welding takes experience.

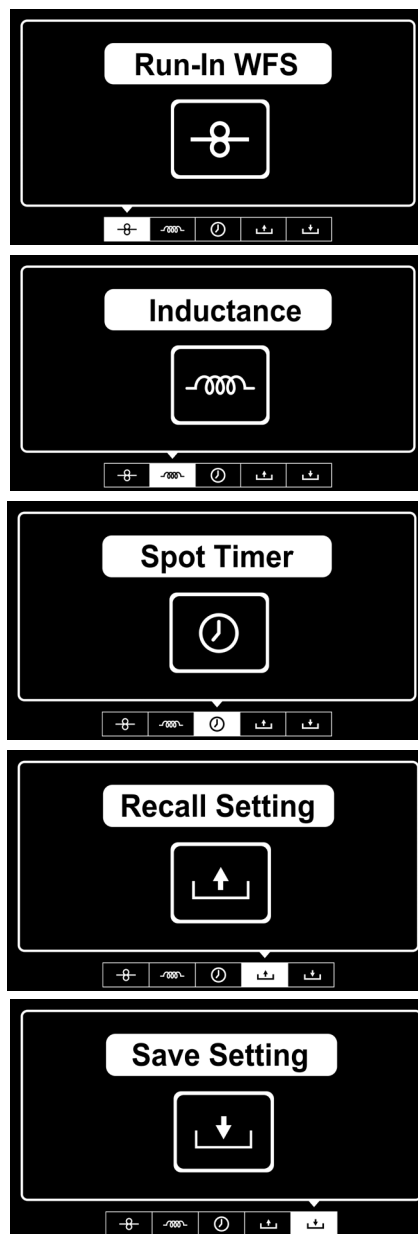

Gas Shielded, Solid-Core Wire Only

DANGER! TO PREVENT DEATH FROM ASPHYXIATION:

Do not open gas without proper ventilation. Fix gas leaks immediately.

Shielding gas can displace air and cause rapid loss of consciousness and death.

Shielding gas without carbon dioxide can be even more hazardous because asphyxiation can start without feeling shortness of breath.



1. Open gas cylinder valve all the way.
2. Set Flow Gauge to SCFH value indicated on Settings Chart.

