

TIG/Stick Welding



Read the **ENTIRE** IMPORTANT SAFETY INFORMATION section at the beginning of this manual including all text under subheadings therein before set up or use of this product.


WARNING

TO PREVENT SERIOUS INJURY FROM ACCIDENTAL OPERATION:
Turn the Power Switch off and unplug the Welder before setup.

Note: Remove the protective foam and cardboard from the Welder before setup. Place the Welder on a level surface that can bear its weight near the work area. Leave space around the Welder for proper air flow.

TIG Setup

Connect Cables

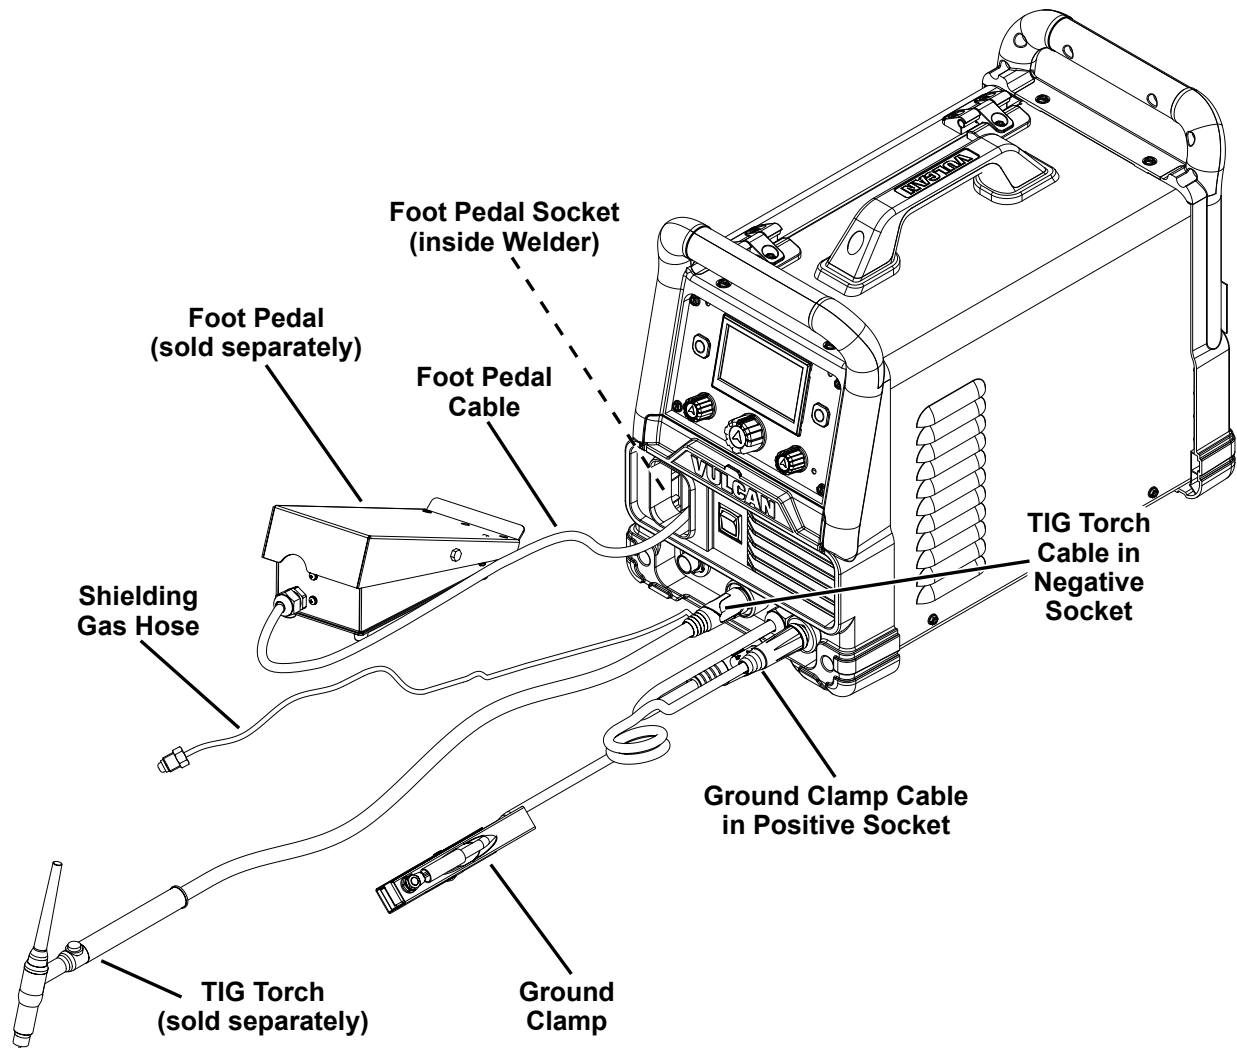

1. Plug Ground Clamp Cable into Positive Socket. Twist clockwise all the way to lock in place.
2. Plug TIG Torch Cable (TIG Torch sold separately) into Negative Socket. Twist clockwise all the way to lock in place.
3. Insert the Foot Pedal Cable (Foot Pedal sold separately) through hole on Welder front and connect to the Foot Pedal Socket inside the machine. Secure by turning collar clockwise until tight.
4. For connecting Shielding Gas Hose, refer to *Connect Shielding Gas* section on next page.