
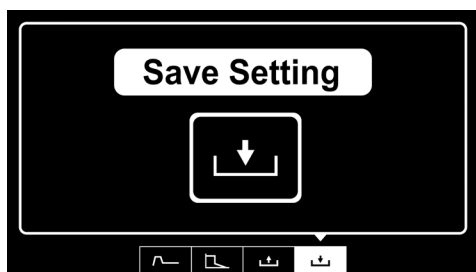
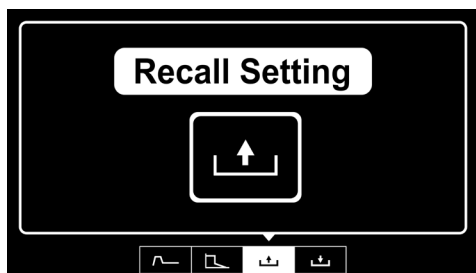


e. Optional Settings:

- Press Main Control Knob to enter Optional Settings.
- Turn Main Control Knob until desired setting appears on screen.
- Press Main Control Knob to select desired setting.
- Turn Main Control Knob to adjust setting.

Available Optional Settings:

- Hot Start—Adjust amperage at start of weld.
- Arc Force—Adjust weld penetration and smoothness.
- Recall Setting—Retrieve saved settings.
- Save Setting—Program up to 5 different configurations.

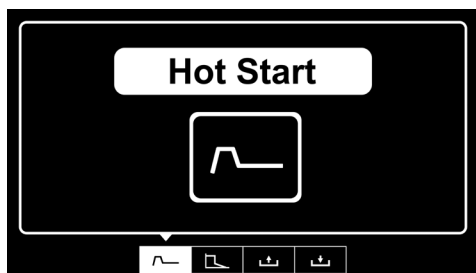

Note: The initial settings may need to be adjusted after stopping and carefully inspecting the weld. Proper welding takes experience.

WARNING! TO PREVENT SERIOUS INJURY: Protective gear must be worn when using the Welder; minimum shade number 10 full face shield (or welding mask), ear protection, welding gloves, sleeves and apron, NIOSH-approved respirator, and fire resistant work clothes without pockets should be worn when welding. Light from the arc can cause permanent damage to the eyes and skin. Do not breathe arc fumes.

After practice welding on scrap, stop, and check your progress. Perform Strike Test according to Strike Test on page 34. After making any necessary adjustments, continue to weld while carefully following the DUTY CYCLE guidelines as explained on page 29.

8. Place the bare metal end of the Stick Electrode (sold separately) inside the jaws of the Electrode Holder.
9. Stroke the workpiece lightly to ignite the arc.
Tips for igniting the arc:
 - a. Tap the surface with the Electrode.
 - b. Stroke the surface with the Electrode.
 - c. Strike the surface like a match with the Electrode.
10. After the arc ignites:
 - a. Lift the Electrode off workpiece the same distance as the diameter of the bare metal end.
 - b. Tilt Electrode back 10 to 20 degrees.
 - c. Drag Electrode to the back end of the weld puddle to deposit material as needed.
11. When finished welding; lift the Electrode from the workpiece, then set Electrode Holder down on nonconductive, nonflammable surface away from any grounded objects.
12. Turn the Power Switch OFF.
13. To prevent accidents, after use:
 - Allow Welder to cool down.
 - Unplug Welder's power cord from outlet.
 - Remove Ground Clamp.
 - Disconnect Electrode Holder and Ground Cables.
14. Clean, then store Welder and its accessories indoors out of children's reach.