

Stick Weld—Coat of Slag Over Weld

TOP
VIEW




PARTIALLY CHIPPED AWAY TO SHOW WELD

Slag is a necessary part of a stick weld. It shields the weld from impurities. Clean off the slag with the Chipping Hammer and Wire Brush after welding.

Stick Weld—Porosity — Small cavities or holes in the bead.

POSSIBLE CAUSES AND SOLUTIONS

TOP
VIEW

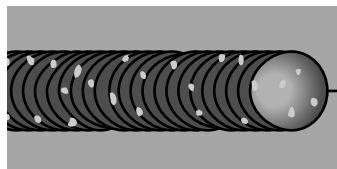


1. **Dirty workpiece or fill material:**
Clean workpiece down to bare metal.
Make certain that fill material and Electrode are clean and free from oil, coatings, and other residues.
2. **Inconsistent welding speed:**
Maintain steady weld speed.

Stick Weld—Crooked/Wavy Bead

POSSIBLE CAUSES AND SOLUTIONS

TOP
VIEW

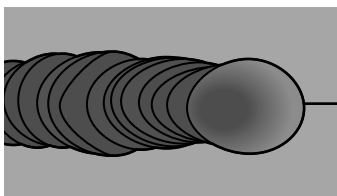


1. **Inaccurate welding:**
Use two hands or rest hand on steady surface.
2. **Inconsistent welding speed:**
Maintain steady weld speed.

Stick Weld—Excessive Spatter

POSSIBLE CAUSES AND SOLUTIONS

TOP
VIEW

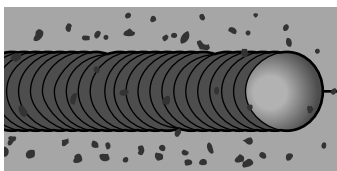


Fine spatter is normal. Spatter that is grainy and large is a problem.

Dirty workpiece or fill material:
Clean workpiece down to bare metal.
Make certain that fill material and Electrode are clean and free from oil, coatings, and other residues.

Stick Weld—Burn-Through — Base material melts away, leaving a hole in the weld.

POSSIBLE CAUSES AND SOLUTIONS

TOP
VIEW

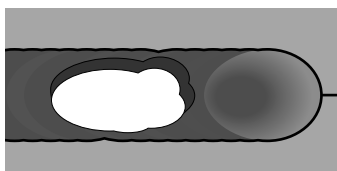

1. **Workpiece overheating:**
Reduce current.
2. **Welding speed too slow:**
Increase welding speed and ensure that welding speed is kept steady.
3. **Excessive material at weld:**
Reduce amount of fill material.