



1 Connect cables as needed for flux wire welding - see back of guide.

2 Install wire spool. Insert wire through both feed guides and clamp it into feed mechanism. See manual if changing wire size or using solid wire.

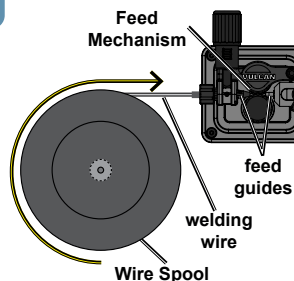

⚠ WARNING

To prevent serious injury, read manual warnings and instructions before use.

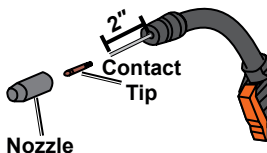


3 Take off nozzle and tip, plug selected cord into welder and into wall, turn welder on, and press cold wire feed switch until wire comes out.





⚠ WARNING

To prevent fire and serious injury, keep torch and wire clear of grounded objects while welder plugged in.

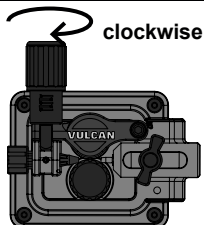

4 Incrementally tighten wire feed tension knob clockwise until wire will bend from feed tension at 2"-3".

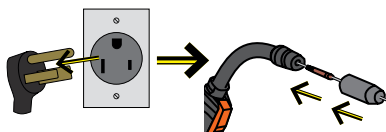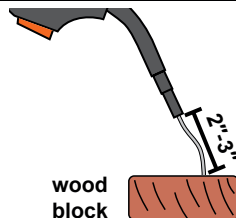

5 Unplug welder and replace nozzle and tip.

6 Hold gun clear of workpiece, then plug in welder, turn it on, and set weld thickness and other settings.

