

INCIDENT INVESTIGATION REPORT · ICAM

Injury

INC-2026-0001

Demo Mining Corp · North Pit Operations — Workshop Bay 2 — conveyor CR-047 drive end

• COMPLETED

ICAM METHODOLOGY

SEVERITY · HIGH

DOCUMENT CONTROL

Prepared by	Ian Investigator — Lead Investigator	Date	February 1, 2026
Reviewed by	Site Safety Manager	Date	—
Approved by	Site / Mine Manager	Date	February 27, 2026
Organisation	Demo Mining Corp	Methodology	ICAM
Distribution	Site Management · Health & Safety Committee · Group HSE · Regulator (as required)		
Classification	HIGH — for authorised distribution	Revision	1.0

Contents

1 · Executive Summary

2 · Incident Details & People Involved

3 · Sequence of Events

4 · Investigation Scope & Evidence Register

5 · PEEPO Data Collection

6 · ICAM Factor Analysis

7 · Causal Analysis & Root Causes

8 · Risk Assessment

9 · Corrective Actions

10 · Conclusions & Sign-off

1 Executive Summary

On 1 February 2026 at 10:34, a conveyor operator received a 3 cm laceration to the left forearm at the drive end of conveyor CR-047 in Workshop Bay 2, North Pit Operations. The wound was closed with four sutures at the site medical facility and classified as a medical treatment case with no lost time. The drive-end guard had been removed that morning for a belt replacement under WO-8842 and was not refitted. At 09:50 the fitter was sent to a primary crusher breakdown; he removed his personal locks as he left and no out-of-service tag was applied. CR-047 returned to the available list at 10:00. The operator began the standard pre-start inspection, which has no guarding item, and reached into the exposed nip point while clearing spillage from the walkway side.

The investigation traced five organisational root causes. The work-order template ends at the repair task, so releasing equipment does not require the guard to be refitted and signed for. The isolation procedure ends at "work complete", leaving the out-of-service tag to individual choice once personal locks come off. A breakdown takes precedence over finishing an open guarding job, and that call sits with whoever is nearest rather than with a named role. The conveyor was supplied with a bolted guard and no guard-position interlock. Pre-start sheets are built from the equipment manual rather than the conveyor's hazard register, so guarding was never a pre-start item. Task lighting at the drive end also measured 120 lux against the 200 lux site standard.

Eight corrective actions were raised. Seven are complete: a work-order template with a signed refit-and-verify step, an amended isolation procedure with a supervisor-cleared out-of-service tag, a task-interruption protocol, a structured shift handover record, pre-start sheets rebuilt from the hazard register, tamper-evident guard seals and upgraded drive-end lighting. The highest-

order control, a guard-position interlock that stops the drive starting with the guard off, is fitted to CR-047 and is being rolled out to every conveyor with the same guard by 30 November 2026.

RISK & REGULATORY EXPOSURE

The actual outcome of this event was **Medical Treatment**, and the event is rated **HIGH** severity. The investigation focuses on the systemic conditions identified in §5–§7; corrective actions are set out in §9. No single individual's action is treated as the cause, consistent with a systems-based, just-culture approach.

KEY FINDINGS

- 7 contributing factors identified across PEEPO categories
- ICAM analysis identified factors in 4 categories
- 5 root cause(s) reached, each a coded organisational factor
- 5 high-priority corrective actions raised

2 Incident Details & People Involved

Reference	INC-2026-0001	Actual severity	HIGH
Date & time	February 1, 2026, 10:34	Actual outcome	Medical Treatment
Location	North Pit Operations — Workshop Bay 2 — conveyor CR-047 drive end	Emergency services	No
Activity / type	Injury	Investigation status	Completed

DESCRIPTION

Operator J. Martinez sustained a 3cm laceration to left forearm during pre-start inspection of Conveyor CR-047. Conveyor guarding had been removed for maintenance and not replaced.

IMMEDIATE ACTIONS TAKEN

Emergency stop activated by the injured person; CR-047 shut down and isolated with personal locks. Pressure bandage applied at the scene by the shift first aider; bleeding controlled within five minutes. Transported to the site medical facility at 10:50; four sutures, medical treatment case. Area barricaded and the removed guard quarantined as evidence; scene photographed before anything was moved. All CR-047 work suspended and a plant-wide check run for other guards left off after maintenance.

PEOPLE INVOLVED

Person	Role	Injury / outcome	Body part	Classification	Days away
--------	------	------------------	-----------	----------------	-----------

J. Martinez	Conveyor Operator	Laceration	Left forearm	MTI	—
-------------	-------------------	------------	--------------	-----	---

Personal identifiers are limited in the distributed report and held in the controlled investigation file, consistent with just-culture and privacy obligations.

WITNESS ACCOUNTS

J. Martinez — I picked up CR-047 on the run list at about half ten and started the pre-start. There was spillage building under the tail drum so I went to clear it from the walkway side, the way we always do. I did not know the guard was off — nothing on the sheet asks you to check it and there was no tag on the isolator. I felt it catch my arm and pulled back.

R. Okafor — I had the belt in by quarter to ten and wrote on the work order that the guard still had to go back. Then the crusher went down and I was told to get on it. I took my locks off because I was leaving the area. There is no step on the work order for tagging it out if you have to walk away, and no one asked me whether CR-047 was finished before it went back on the run list.

3 Sequence of Events

1 Feb 2026, 06:00

Night shift hands over to day shift — The handover log for 1 February records no outstanding maintenance against CR-047. The belt replacement was raised after this handover.

1 Feb 2026, 07:30 — key event

Fixed guard removed from the CR-047 drive end — R. Okafor removed the bolted drive-end guard to replace the conveyor belt under WO-8842 and applied personal locks to the CR-047 isolator. The guard was placed on the adjacent walkway.

1 Feb 2026, 09:45 — key event

Belt replacement complete, guard still off — WO-8842 was annotated "belt replaced — guard reinstatement pending". The work order remained open.

1 Feb 2026, 09:50 — key event

Fitter redirected to a primary crusher breakdown — R. Okafor removed his personal locks and left the area to attend an urgent breakdown on the primary crusher. No out-of-service tag was placed on CR-047 and the guard stayed on the walkway.

1 Feb 2026, 10:00

CR-047 shows as available in the control room — The plant SCADA event log records CR-047 returning to the available list with no hold flag against it.

1 Feb 2026, 10:30

Pre-start inspection of CR-047 begins — J. Martinez started the standard CR-047 pre-start inspection sheet. The sheet has no guarding item.

1 Feb 2026, 10:34 — key event

Contact with the exposed drive-end nip point — While clearing spillage from the tail drum area from the walkway side, J. Martinez reached into the unguarded drive end and sustained a 3 cm laceration to the left forearm.

1 Feb 2026, 10:36

Emergency stop and first aid — Emergency stop activated. Pressure bandage applied by the shift first aider; bleeding controlled within five minutes.

1 Feb 2026, 10:50

Transported to the site medical facility — Four sutures applied. Classified as a medical treatment case; no lost time.

1 Feb 2026, 11:15

Scene secured and evidence preserved — CR-047 isolated and the area barricaded. The removed guard was quarantined and the drive end photographed before anything was moved.

4 Investigation Scope & Evidence Register

Lead investigator	Ian Investigator
Methodology	ICAM (Incident Cause Analysis Method)
Period	Commenced February 1, 2026 · completed February 27, 2026
Status	Completed

EVIDENCE REGISTER

Ref	Type	Description
Witness_Statement_R_Okafor_Maintenance.pdf	document	Witness statement from maintenance fitter R. Okafor, who removed the guard for the belt replacement.
PreStart_Inspection_CR-047_2026-02-01.pdf	document	Completed pre-start inspection checklist for Conveyor CR-047 on the day of the incident.
Guard_Mounting_Points.jpg	image	Guard mounting points / fixing bolts left disconnected after maintenance.
LOTO_Isolation_Procedure_Conveyors.pdf	document	Lockout/Tagout isolation procedure for conveyor maintenance (controlling document).
First_Aid_Injury_Report.pdf	document	First-aid register entry: 3 cm laceration, left forearm; treated on site.

CR-047_Guard_Removed_Scene.jpg	image	Scene photograph: Conveyor CR-047 with the fixed guard removed.
Removed_Guard_On_Walkway.jpg	image	The removed guard panel left on the adjacent walkway.
CR-047_Nip_Point_Closeup.jpg	image	Close-up of the exposed nip point at the drive pulley.
Forearm_Laceration_FirstAid.jpg	image	Left-forearm laceration recorded during first-aid treatment.
Witness_Statement_J_Martinez.pdf	document	Signed witness statement from the injured operator, J. Martinez.
Maintenance_WorkOrder_WO-8842.pdf	document	Work order WO-8842 authorising the belt replacement on CR-047 (includes the guard-removal step).

5 PEEPO Data Collection

PEOPLE

Statement from fitter R. Okafor on the interrupted job. R. Okafor had the new belt fitted by 09:45 and wrote "belt replaced — guard reinstatement pending" on WO-8842. At 09:50 he was sent to the primary crusher breakdown and removed his personal locks because he was leaving the area. He understood SP-LOTO-014 to apply while he was working on the machine, not once he had left it, and the work order gave him no step for tagging out an unfinished job. No one asked whether CR-047 was finished before it went back on the run list.

Statement from operator J. Martinez on what he knew at the start of the pre-start. CR-047 came to J. Martinez on the run list at about 10:30 with no note of outstanding work. He started the standard pre-start sheet, which has no guarding item, and went to clear spillage under the tail drum from the walkway side, the usual method. There was no tag on the isolator. He did not know the guard was off until the belt caught his forearm.

Control-room account of CR-047 returning to the run list. The control-room operator confirmed that CR-047 showed as available on SCADA from 10:00 with no hold flag, and that the availability list has no field for a removed guard or a job left open. The 09:50 breakdown call went out by radio to the nearest available fitter; no one checked the state of the job he was leaving. The control room had no information that CR-047 was unfinished.

ENVIRONMENT

Visibility of the missing guard from the operator's approach. Scene photographs and a walk-through of the approach path show that the open guard aperture cannot be seen from the walkway until the operator is level with the tail drum, by which point the drive end is already within reach. The removed guard lay flat on the walkway beside the stringer and did not obstruct the approach. Lighting at the drive end is covered in the access and lighting item.

Access and lighting at the CR-047 drive end. The drive end sits between the walkway and the stringer, and spillage under the tail drum is cleared by hand from the walkway side — the same reach that brought J. Martinez into the nip point. Task lighting measured 120 lux at the drive end against the 200 lux the site standard sets for inspection tasks. **Contributing**

EQUIPMENT

Design of the CR-047 drive-end guard. The drive-end guard is a single bolted steel panel on six fasteners, refitted by one fitter with hand tools in about 15 minutes. It cannot sit in place unsecured, so a partly refitted guard is not a credible failure here: the guard was either on or off. CR-047 has no guard-position switch or interlock, so the drive can start with the panel removed. **Contributing**

State of CR-047 isolation at the time of contact. The isolation register shows R. Okafor's personal locks removed at 09:50 with no out-of-service tag recorded. The SCADA event log shows CR-047 back on the available list at 10:00 and the drive running from 10:32. The local isolator was found in the ON position when the scene was secured at 11:15. CR-047 was energised and running when contact occurred at 10:34. **Contributing**

CR-047 pre-start inspection sheet used on 1 February 2026. The CR-047 pre-start sheet covers belt tracking, scrapers, spillage and emergency stops. None of its items covers guarding. The sheet was built from the equipment manual's operating checks, not from the conveyor's hazard register, so the operator was never prompted to confirm the guard was in place before approaching the drive end. **Contributing**

PROCEDURES

Content of work order WO-8842. WO-8842 lists isolation, removal of the drive-end guard and replacement of the belt, followed by a free-text completion field. There is no step to refit and sign for the guard, no field for a job that cannot be finished in one go, and release back to operations is a status change on the work order with no supervisor sign-off. R. Okafor's note "belt replaced — guard reinstatement pending" was written in the free-text field. **Contributing**

Shift handover log for the night-to-day handover on 1 February 2026. The 06:00 handover log records no issues with conveyor CR-047. That was accurate at the time, because the belt replacement started after the handover. The log form has fields for production, delays and safety incidents, but none for equipment with a guard removed or a job left open, so a change in plant state during the shift has nowhere to be recorded.

ORGANISATION

How R. Okafor was redirected to the crusher breakdown. The primary crusher tripped at 09:48. The control-room operator radioed for the nearest available fitter and R. Okafor, the closest, was sent. No named role decides between an open job and a breakdown, and the call carried no check on the state of the job being left. Site practice treats a crusher stoppage as the priority, and there is no task-interruption protocol for safety-critical maintenance. **Contributing**

How maintenance work orders are written and approved. Planners build maintenance work orders from a generic template, and there is no hazard review before a work order is approved. A review of the current conveyor work orders found the same omission on every order with a guard-removal step: no matching step to refit and verify the guard. The WO-8842 gap is a template gap, not a one-off authoring error.

Contributing

6 ICAM Factor Analysis

All four ICAM levels are reported. Where no factor was identified at a level, this is stated explicitly to evidence full application of the method.

ABSENT FAILED DEFENCE

No interlock prevented start-up with the guard removed: CR-047 has no guard-position switch or interlock, so once the personal locks came off the drive could be started with the nip point exposed. An interlock would have turned the missing guard into a self-announcing failure, because the conveyor would not run, instead of relying on isolation, handover and the pre-start check all working in sequence.

No out-of-service tag or continuing isolation when the job was left unfinished: SP-LOTO-014 requires equipment to stay isolated and tagged out of service when a task cannot be completed in one shift, but the procedure closes at "work complete" and does not cover a job interrupted part-way. When R. Okafor removed his personal locks at 09:50 no tag was applied, so nothing at the machine or in the control room showed that CR-047 was unsafe.

INDIVIDUAL TEAM ACTION

R. Okafor left the CR-047 drive end at 09:50 with the belt replaced, the guard off and his personal locks removed, to attend the primary crusher breakdown.

TASK ENVIRONMENTAL CONDITION

Competing production demand displaced the close-out of a safety-critical job: at 09:50 R. Okafor had an urgent crusher breakdown and an unfinished guarding job on CR-047. No supervisor check, work-order gate or interruption protocol required CR-047 to be left in a safe state first. With the production need visible and the unfinished job invisible, leaving to attend the breakdown was the expected response, not an unusual one.

ORGANISATIONAL FACTOR

Work order lacked a guard-refit step and an unfinished-job step: WO-8842 included a guard-removal step but no step to refit and sign for the guard before release, and no field for a job that could not be finished. The same omission appears on every current conveyor work order with a guard-removal step, because orders are built from a generic template with no hazard review before approval. Nothing in the written work required the guard to go back on before CR-047 was released.

No protocol for interrupting safety-critical maintenance: when the primary crusher tripped at 09:48, the control room radioed for the nearest available fitter and R. Okafor was sent. No named role weighs an open job against a breakdown, and no check was made on the state of the job he was leaving. A breakdown carries an immediate, visible production cost; an unfinished guarding job carries none until someone is hurt. The site's task system left that trade-off to the individual fitter.

Handover and control-room records had no place for open work or removed guards: the 06:00 handover correctly recorded no issues with CR-047, because the belt job had not yet started. Neither the handover form nor the SCADA availability list has a field for equipment with a guard removed or a job left open, so when the job was interrupted mid-shift nothing carried that state to the control room or to the operator who picked up CR-047 at 10:30.

7 Causal Analysis & Root Causes

A 3 cm laceration to the left forearm of an operator during the pre-start inspection of conveyor CR-047, at 10:34 on 1 February 2026 in Workshop Bay 2, North Pit Operations.

ANALYSIS
INTEGRITY

83/100

CAUSES

12

LINKS NECESSITY-
TESTED


11/11

EVIDENCE
CITATIONS

24

STATUS

Signed off

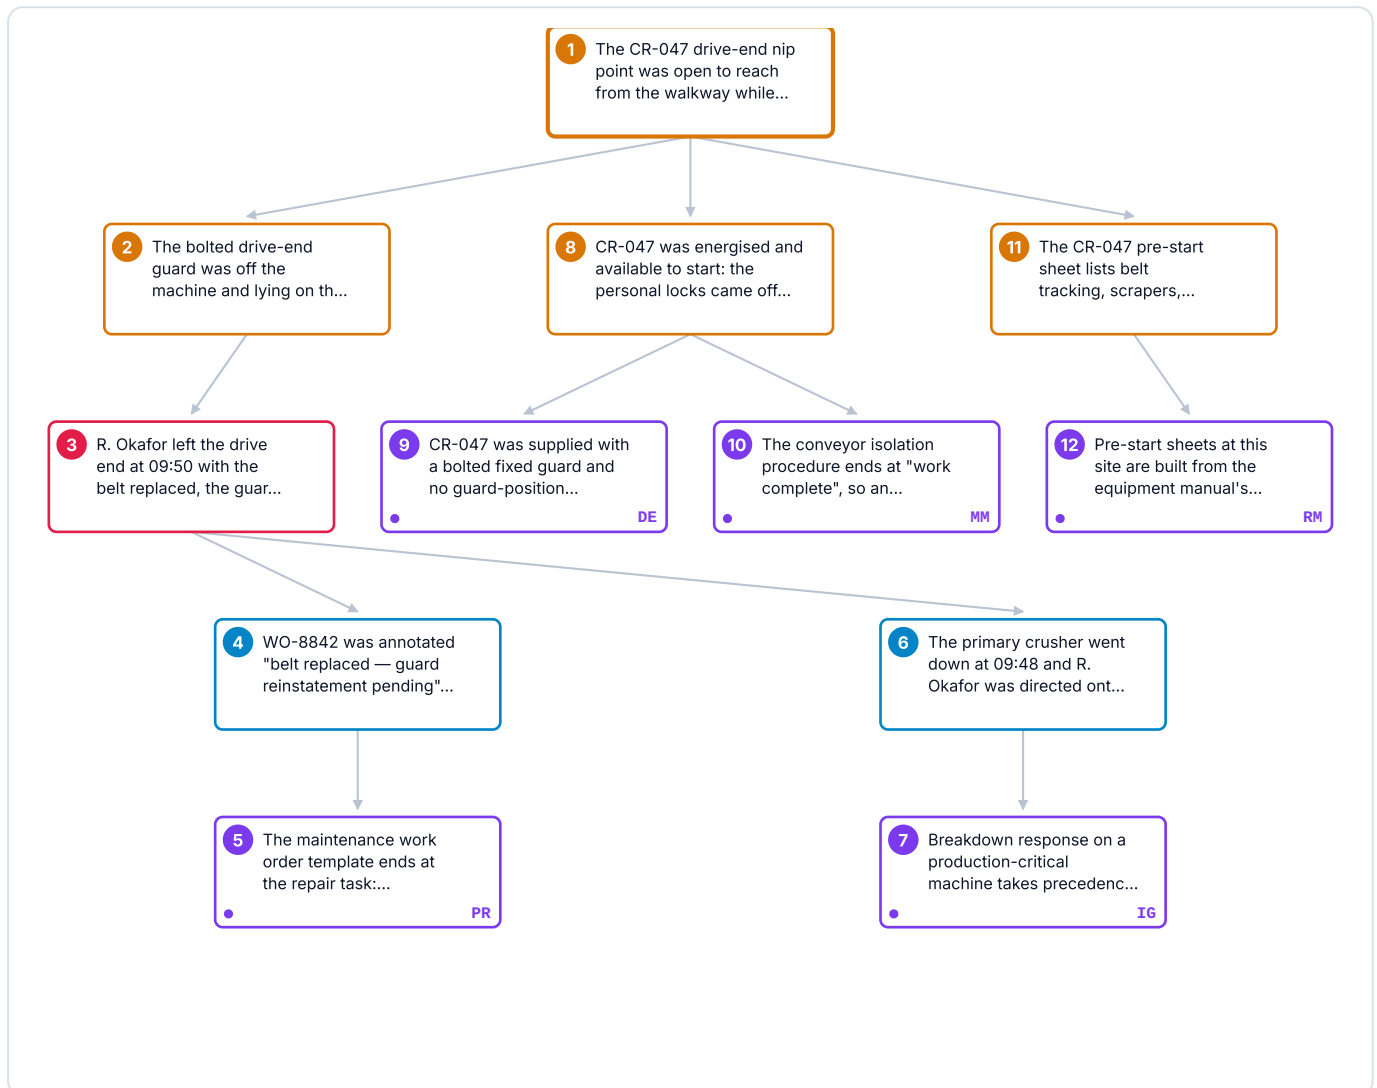

■ Absent / failed defence
 ■ Individual / team action
 ■ Task / environmental condition
 ■ Organisational factor

Dashed border — claim not yet established · dashed line — link not yet necessity-tested · dot — path stops here

#	CAUSE	ICAM LEVEL	BASIS
1	The CR-047 drive-end nip point was open to reach from the walkway while the conveyor was live	Absent / failed defence	Established evidence file — Close-up of the exposed nip point at the drive pulley. evidence file — Scene photograph: Conveyor CR-047 with the fixed guard removed.

#	CAUSE	ICAM LEVEL	BASIS
2	The bolted drive-end guard was off the machine and lying on the walkway when CR-047 went back on the run list at 10:00 Necessary for 1 — necessary — remove it and the effect does not happen	Absent / failed defence	Established evidence file — The removed guard panel left on the adjacent walkway. evidence file — Guard mounting points / fixing bolts left disconnected after maintenance.
3	R. Okafor left the drive end at 09:50 with the belt replaced, the guard on the walkway and his personal locks taken off the isolator Necessary for 2 — necessary — remove it and the effect does not happen	Individual / team action	Established evidence file — Witness statement from maintenance fitter R. Okafor, who removed the guard for the belt replacement. evidence file — Work order WO-8842 authorising the belt replacement on CR-047 (includes the guard-removal step).
4	WO-8842 was annotated "belt replaced — guard reinstatement pending" and left open, which is a valid state for a work order at this site Necessary for 3 — necessary — remove it and the effect is less likely	Task / environmental condition	Established evidence file — Work order WO-8842 authorising the belt replacement on CR-047 (includes the guard-removal step). peepo item
5	The maintenance work order template ends at the repair task: releasing equipment back to operations is a status change on the work order rather than a step that requires guarding to be refitted and signed for Necessary for 4 — necessary — remove it and the effect does not happen Path stops here — as deep as it goes	Organisational factor PR · Procedures	Established evidence file — Work order WO-8842 authorising the belt replacement on CR-047 (includes the guard-removal step). peepo item
6	The primary crusher went down at 09:48 and R. Okafor was directed onto it while CR-047 was still open Necessary for 3 — necessary — remove it and the effect does not happen	Task / environmental condition	Established evidence file — Witness statement from maintenance fitter R. Okafor, who removed the guard for the belt replacement. peepo item

#	CAUSE	ICAM LEVEL	BASIS
7	Breakdown response on a production-critical machine takes precedence over finishing an open guarding job, and that call sits with whoever is nearest rather than with a named role that holds both jobs Necessary for 6 — necessary — remove it and the effect does not happen Path stops here — as deep as it goes	Organisational factor IG · Incompatible Goals	Established peepo item evidence file — Witness statement from maintenance fitter R. Okafor, who removed the guard for the belt replacement.
8	CR-047 was energised and available to start: the personal locks came off at 09:50, the isolator carried no out-of-service tag, and the plant event log shows the conveyor on the available list at 10:00 Necessary for 1 — necessary — remove it and the effect does not happen	Absent / failed defence	Established evidence file — Lockout/Tagout isolation procedure for conveyor maintenance (controlling document). timeline event — Plant SCADA event log 01/02/2026
9	CR-047 was supplied with a bolted fixed guard and no guard-position interlock, so the drive can be started with the guard off the machine Necessary for 8 — necessary — remove it and the effect does not happen Path stops here — as deep as it goes	Organisational factor DE · Design	Established evidence file — Guard mounting points / fixing bolts left disconnected after maintenance. evidence file — Close-up of the exposed nip point at the drive pulley.
10	The conveyor isolation procedure ends at "work complete", so an out-of-service tag is a personal choice once a fitter's own locks come off rather than something the equipment carries until guarding is signed back on Necessary for 8 — necessary — remove it and the effect does not happen Path stops here — as deep as it goes	Organisational factor MM · Maintenance Management	Established peepo item evidence file — Lockout/Tagout isolation procedure for conveyor maintenance (controlling document).
11	The CR-047 pre-start sheet lists belt tracking, scrapers, spillage and emergency stops and stops there, so guarding is not an item the operator signs for Necessary for 1 — necessary — remove it and the effect is less likely	Absent / failed defence	Established evidence file — Completed pre-start inspection checklist for Conveyor CR-047 on the day of the incident. peepo item
12	Pre-start sheets at this site are built from the equipment manual's operating checks rather than from the machine's own hazard register, so mechanical guarding never became a pre-start item Necessary for 11 — necessary — remove it and the effect does not happen Path stops here — as deep as it goes	Organisational factor RM · Risk Management	Established evidence file — Completed pre-start inspection checklist for Conveyor CR-047 on the day of the incident. peepo item

Root causes — where each path stopped

- 1. [PR] The maintenance work order template ends at the repair task: releasing equipment back to operations is a status change on the work order rather than a step that requires guarding to be refitted and signed for
- 2. [IG] Breakdown response on a production-critical machine takes precedence over finishing an open guarding job, and that call sits with whoever is nearest rather than with a named role that holds both jobs
- 3. [DE] CR-047 was supplied with a bolted fixed guard and no guard-position interlock, so the drive can be started with the guard off the machine
- 4. [MM] The conveyor isolation procedure ends at "work complete", so an out-of-service tag is a personal choice once a fitter's own locks come off rather than something the equipment carries until guarding is signed back on
- 5. [RM] Pre-start sheets at this site are built from the equipment manual's operating checks rather than from the machine's own hazard register, so mechanical guarding never became a pre-start item

8 Risk Assessment

ACTUAL OUTCOME

Medical Treatment

SEVERITY RATING

HIGH

The **actual outcome** records what happened to the people involved. The **severity rating** is the rating assigned to the event and sets the priority of the corrective actions in §9.

9 Corrective Actions

CA-1

ENGINEERING

Completed

MEDIUM

Raise task lighting at the CR-047 drive and tail ends to at least the 200 lux site standard for inspection tasks, and survey lighting at the drive ends of all conveyors.

Owner: Electrical Superintendent Due: Mar 15, 2026 Control: engineering

CA-2

ADMINISTRATIVE

⚠ lower-order control

Completed

MEDIUM

Introduce a structured shift handover record with mandatory fields for equipment with a guard removed, isolations in place and jobs left open, briefed verbally at every handover.

Owner: Operations Manager Due: Feb 28, 2026 Control: administrative

CA-3

ADMINISTRATIVE

⚠ lower-order control

Completed

MEDIUM

Rebuild the pre-start sheets for all conveyors from each conveyor's hazard register, with guard condition as a signed physical check completed before the operator approaches the drive or tail end.

Owner: Safety Manager Due: Apr 15, 2026 Control: administrative

CA-4

ADMINISTRATIVE

⚠ lower-order control

Completed

HIGH

Amend SP-LOTO-014 so that removing personal locks from equipment with an open guarding job requires an out-of-service tag that only the maintenance supervisor can clear; retrain the maintenance crew on the changed step and add the tag check to the equipment release form.

Owner: Maintenance Manager **Due:** Apr 30, 2026 **Control:** administrative

CA-5

ENGINEERING

Completed

HIGH

Fit tamper-evident seals to all conveyor drive-end guards so that a removed guard is visible at a glance; a guard cannot be refitted without a new seal issued against the work order.

Owner: Engineering Manager **Due:** Mar 15, 2026 **Control:** engineering

CA-6

ADMINISTRATIVE

⚠ lower-order control

Completed

HIGH

Introduce a task-interruption protocol for safety-critical maintenance: before a fitter is redirected, the job must be left isolated and tagged, and the redirect must be authorised by the shift maintenance supervisor, who records the open job on the handover record.

Owner: Operations Manager **Due:** Jun 23, 2026 **Control:** administrative

CA-7

ADMINISTRATIVE

⚠ lower-order control

Completed

HIGH

Revise the conveyor work-order template: every work order with a guard-removal step must carry a matching step to refit and verify the guard, signed by the fitter and checked by the maintenance supervisor with photo evidence, before the equipment can be released.

Owner: Maintenance Manager **Due:** Mar 31, 2026 **Control:** administrative

CA-8

ENGINEERING

In Progress

CRITICAL

Install a guard-position interlock on the CR-047 drive-end guard, and on every conveyor with the same bolted guard, that prevents the drive from starting unless the guard is fully fitted. CR-047 is complete; the remaining conveyors are scheduled during planned shutdowns.

Owner: Engineering Manager **Due:** Nov 30, 2026 **Control:** engineering

10 Conclusions & Sign-off

IDENTIFIED ROOT CAUSES

- [PR] The maintenance work order template ends at the repair task: releasing equipment back to operations is a status change on the work order rather than a step that requires guarding to be refitted and signed for
- [IG] Breakdown response on a production-critical machine takes precedence over finishing an open guarding job, and that call sits with whoever is nearest rather than with a named role that holds both jobs

- [DE] CR-047 was supplied with a bolted fixed guard and no guard-position interlock, so the drive can be started with the guard off the machine
- [MM] The conveyor isolation procedure ends at "work complete", so an out-of-service tag is a personal choice once a fitter's own locks come off rather than something the equipment carries until guarding is signed back on
- [RM] Pre-start sheets at this site are built from the equipment manual's operating checks rather than from the machine's own hazard register, so mechanical guarding never became a pre-start item

This investigation was conducted under the ICAM methodology. The corrective actions in §9 address the systemic conditions identified and are owned, dated and tracked to completion. This report is issued for authorised distribution and review by the parties listed in the document control block.

Lead Investigator

Ian Investigator

Reviewed — Safety Manager

Approved — Site Manager