
blip / soldering map

Feather RP2040 to 2.4-inch TFT FeatherWing V2 | 9 direct wires | Keep the existing Feather headers

POWER OFF: unplug USB and any battery. Follow pin labels; the drawings below are not to scale.


FEATHER: component face

USB-C at TOP; usual male-header solder side

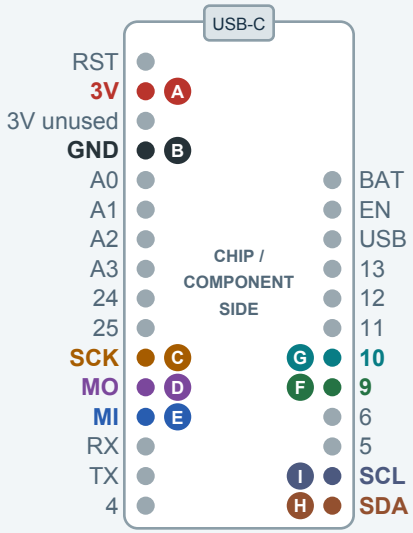


FEATHER: reverse face

USB-C at TOP; mirrored underside view

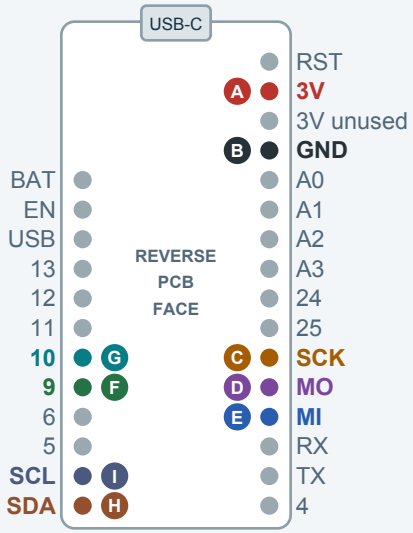

SCREEN: header / pad map

Connector side facing you; RST end at TOP

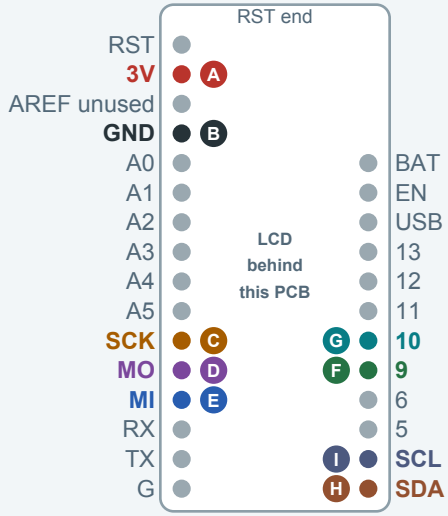

IMPORTANT: Feather A (3V) goes to screen A (3V). The next screen position is AREF - leave it unused.

Wire	Feather pin	Screen pad / socket	What it does
A	**3V / 3.3V**	**3V / 3.3V**	3.3 V power - use the second position from RST
B	**GND**	**GND**	Ground / power return
C	**SCK**	**SCK / SCLK**	SPI clock: timing for screen commands and pixels
D	**MO / MOSI**	**MO / MOSI**	SPI data from Feather to screen
E	**MI / MISO**	**MI / MISO**	SPI return data: LCD state readback (new ninth wire)
F	**9 / D9**	**9 / D9 (TFTCS)**	Screen chip select
G	**10 / D10**	**10 / D10 (TFTDC)**	Selects command bytes versus pixel/data bytes
H	**SDA**	**SDA**	I2C data: touchscreen on the screen board
I	**SCL**	**SCL**	I2C clock: touchscreen on the screen board

Letters/colors are wire IDs, not pin numbers. Gray pins stay unconnected. Knob: keep its QT cable plugged into the Feather.
Male-header solder joints are usually on the component face. Match the drawing to the face you are looking at; inspect for bridges.
Sources: Adafruit Feather RP2040 PCB + TFT FeatherWing V2 PCB / pinout guides. Layout is a reference; verify board labels.