
DTC P2091:00 [SKYACTIV-G 1.3, SKYACTIV-G 1.5]


id0102q1010000

DTC P2091:00	OCV circuit high input
DETECTION CONDITION	• The OCV control voltage relative to the PCM control is too high. **Diagnostic support note** • This is a continuous monitor (CCM). • The check engine light illuminates if the PCM detects the above malfunction condition during the first drive cycle. • FREEZE FRAME DATA/Snapshot data is available. • DTC is stored in the PCM memory.
FAIL-SAFE FUNCTION	• Set the exhaust variable valve timing control to the maximum advanced position.
POSSIBLE CAUSE	• OCV connector or terminals malfunction • PCM connector or terminals malfunction • Short to power supply in wiring harness between OCV terminal A and PCM terminal 1AN • OCV malfunction • PCM malfunction

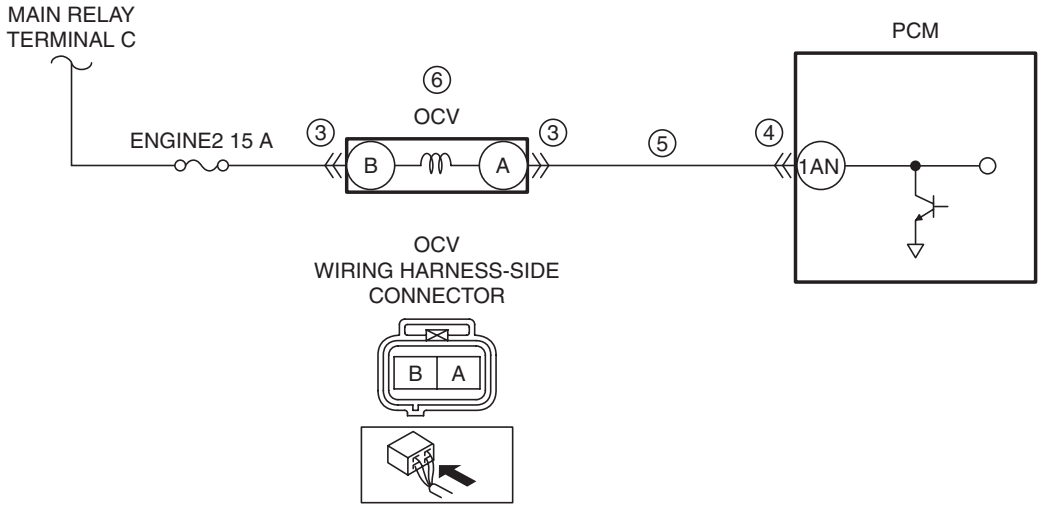

OCV WIRING HARNESS-SIDE CONNECTOR

PCM WIRING HARNESS-SIDE CONNECTOR

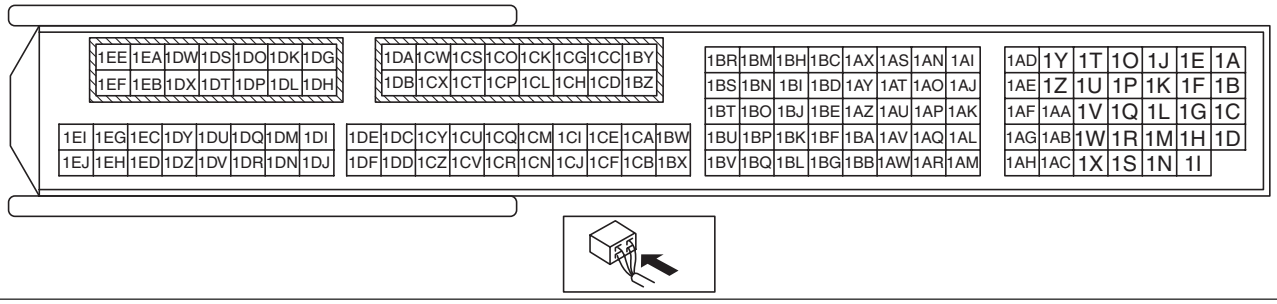

Diagnostic Procedure

STEP	INSPECTION		ACTION
1	**RECORD VEHICLE STATUS AT TIME OF DTC DETECTION TO UTILIZE WITH REPEATABILITY VERIFICATION** **Note** • Recording can be facilitated using the screen capture function of the PC. • Record the FREEZE FRAME DATA/snapshot data on the repair order.	—	Go to the next step.
2	**VERIFY RELATED SERVICE INFORMATION AVAILABILITY** • Verify related Service Information availability. • Is any related Service Information available?	Yes	Perform repair or diagnosis according to the available Service Information. • If the vehicle is not repaired, go to the next step.
		No	Go to the next step.

STEP	INSPECTION		ACTION
3	**INSPECT OCV CONNECTOR CONDITION** • Switch the ignition off. • Disconnect the OCV connector. • Inspect for poor connection (such as damaged/ pulled-out pins, corrosion). • Is there any malfunction?	Yes	Repair or replace the connector and/or terminals, then go to Step 7.
		No	Go to the next step.
4	**INSPECT PCM CONNECTOR CONDITION** • Disconnect the PCM connector. • Inspect for poor connection (such as damaged/ pulled-out pins, corrosion). • Is there any malfunction?	Yes	Repair or replace the connector and/or terminals, then go to Step 7.
		No	Go to the next step.
5	**INSPECT OCV CONTROL CIRCUIT FOR SHORT TO POWER SUPPLY** • Verify that the OCV and PCM connectors are disconnected. • Switch the ignition ON (engine off). **Note** • Another DTC may be stored by the PCM detecting an open circuit. • Measure the voltage at the OCV terminal A (wiring harness-side). • Is the voltage **0 V**?	Yes	Go to the next step.
		No	Refer to the wiring diagram and verify whether or not there is a common connector between OCV terminal A and PCM terminal 1AN. **If there is a common connector:** • Determine the malfunctioning part by inspecting the common connector and the terminal for corrosion, damage, or pin disconnection, and the common wiring harness for a short to power supply. • Repair or replace the malfunctioning part. **If there is no common connector:** • Repair or replace the wiring harness which has a short to power supply. Go to Step 7.
6	**INSPECT OCV** • Inspect the OCV. (See OIL CONTROL VALVE (OCV) INSPECTION [SKYACTIV-G 1.3, SKYACTIV-G 1.5].) • Is there any malfunction?	Yes	Replace the OCV, then go to the next step. (See OIL CONTROL VALVE (OCV) REMOVAL/ INSTALLATION [SKYACTIV-G 1.3, SKYACTIV-G 1.5].)
		No	Go to the next step.
7	**VERIFY DTC TROUBLESHOOTING COMPLETED** • Always reconnect all disconnected connectors. • Clear the DTC from the PCM memory using the M-MDS. (See AFTER REPAIR PROCEDURE [SKYACTIV-G 1.3, SKYACTIV-G 1.5].) • Perform the KOER self test. (See KOEO/KOER SELF TEST [SKYACTIV-G 1.3, SKYACTIV-G 1.5].) • Is the same DTC present?	Yes	Repeat the inspection from Step 1. • If the malfunction recurs, replace the PCM. (See PCM REMOVAL/INSTALLATION [SKYACTIV-G 1.3, SKYACTIV-G 1.5].) Go to the next step.
		No	Go to the next step.
8	**VERIFY AFTER REPAIR PROCEDURE** • Perform the “AFTER REPAIR PROCEDURE”. (See AFTER REPAIR PROCEDURE [SKYACTIV-G 1.3, SKYACTIV-G 1.5].) • Are any DTCs present?	Yes	Go to the applicable DTC inspection. (See DTC TABLE [SKYACTIV-G 1.3, SKYACTIV-G 1.5].)
		No	DTC troubleshooting completed.