
DTC P0122:00 [SKYACTIV-G 1.3, SKYACTIV-G 1.5]

id0102q1701800

DTC P0122:00	TP sensor No.1 circuit low input
DETECTION CONDITION	• If the PCM detects that the TP sensor No.1 voltage at the PCM terminal 1BP is **below 0.1 V**, the PCM determines that the TP sensor No.1 circuit has a malfunction. **Diagnostic support note** • This is a continuous monitor (CCM). • The check engine light illuminates if the PCM detects the above malfunction condition during the first drive cycle. • FREEZE FRAME DATA/Snapshot data is available. • DTC is stored in the PCM memory.
FAIL-SAFE FUNCTION	• Restricts the upper limit of the engine speed.
POSSIBLE CAUSE	• Throttle body connector or terminals malfunction • PCM connector or terminals malfunction • Short to ground in wiring harness between the following terminals: — Throttle body terminal B—PCM terminal 1BS — Throttle body terminal A—PCM terminal 1BP • TP sensor No.1 signal circuit and ground circuit are shorted to each other • TP sensor No.1 malfunction • PCM malfunction

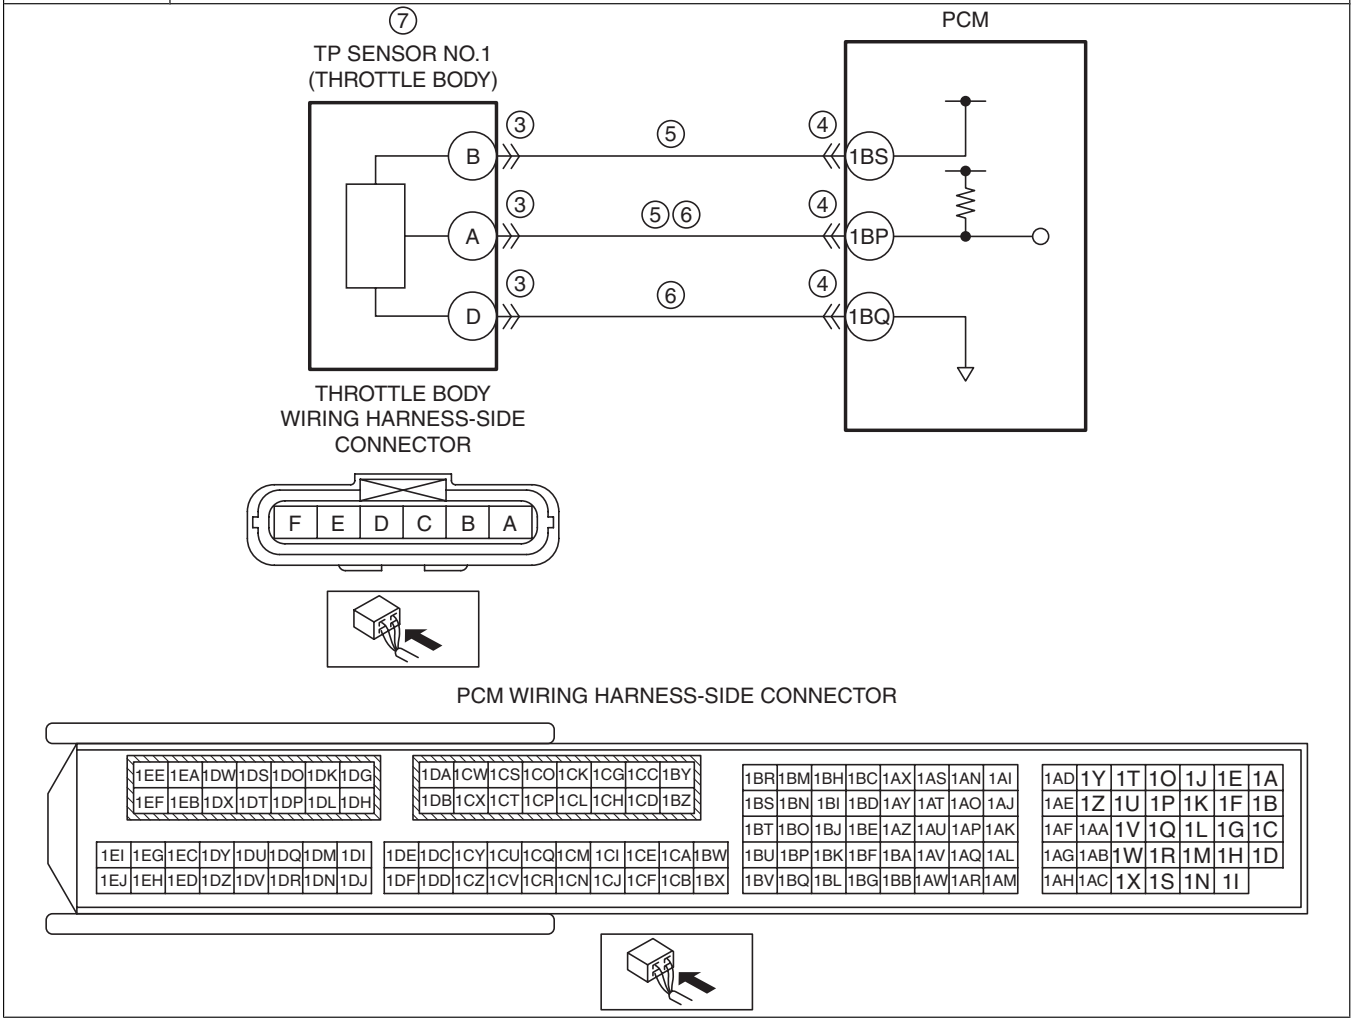

Diagnostic Procedure

STEP	INSPECTION		ACTION
1	**RECORD VEHICLE STATUS AT TIME OF DTC DETECTION TO UTILIZE WITH REPEATABILITY VERIFICATION** **Note** • Recording can be facilitated using the screen capture function of the PC. • Record the FREEZE FRAME DATA/snapshot data on the repair order.	—	Go to the next step.
2	**VERIFY RELATED SERVICE INFORMATION AVAILABILITY** • Verify related Service Information availability. • Is any related Service Information available?	Yes	Perform repair or diagnosis according to the available Service Information. • If the vehicle is not repaired, go to the next step.
		No	Go to the next step.
3	**INSPECT THROTTLE BODY CONNECTOR CONDITION** • Switch the ignition off. • Disconnect the throttle body connector. • Inspect for poor connection (such as damaged/ pulled-out pins, corrosion). • Is there any malfunction?	Yes	Repair or replace the connector and/or terminals, then go to Step 8.
		No	Go to the next step.
4	**INSPECT PCM CONNECTOR CONDITION** • Disconnect the PCM connector. • Inspect for poor connection (such as damaged/ pulled-out pins, corrosion). • Is there any malfunction?	Yes	Repair or replace the connector and/or terminals, then go to Step 8.
		No	Go to the next step.
5	**INSPECT TP SENSOR NO.1 CIRCUIT FOR SHORT TO GROUND** • Verify that the throttle body and PCM connectors are disconnected. • Inspect for continuity between the following terminals (wiring harness-side) and body ground: — Throttle body terminal B — Throttle body terminal A • Is there continuity?	Yes	Refer to the wiring diagram and verify whether or not there is a common connector between the following terminals: • Throttle body terminal B—PCM terminal 1BS • Throttle body terminal A—PCM terminal 1BP **If there is a common connector:** • Determine the malfunctioning part by inspecting the common connector and the terminal for corrosion, damage, or pin disconnection, and the common wiring harness for a short to ground. • Repair or replace the malfunctioning part. **If there is no common connector:** • Repair or replace the wiring harness which has a short to ground. Go to Step 8.
		No	Go to the next step.
6	**INSPECT TP SENSOR NO.1 SIGNAL CIRCUIT AND GROUND CIRCUIT FOR SHORT TO EACH OTHER** • Verify that the throttle body and PCM connectors are disconnected. • Inspect for continuity between throttle body terminals A and D (wiring harness-side). • Is there continuity?	Yes	Refer to the wiring diagram and verify whether or not there is a common connector between the following terminals: • Throttle body terminal A—PCM terminal 1BP • Throttle body terminal D—PCM terminal 1BQ **If there is a common connector:** • Determine the malfunctioning part by inspecting the common connector and the terminal for corrosion, damage, or pin disconnection, and the common wiring harness for a short to each other. • Repair or replace the malfunctioning part. **If there is no common connector:** • Repair or replace the wiring harness which has a short to each other. Go to Step 8.
		No	Go to the next step.
7	**INSPECT TP SENSOR NO.1** • Reconnect all disconnected connectors. • Inspect the TP sensor No.1. (See THROTTLE POSITION (TP) SENSOR INSPECTION [SKYACTIV-G 1.3, SKYACTIV-G 1.5].) • Is there any malfunction?	Yes	Replace the throttle body, then go to the next step. (See INTAKE-AIR SYSTEM REMOVAL/INSTALLATION [SKYACTIV-G 1.3, SKYACTIV-G 1.5].)
		No	Go to the next step.

STEP	INSPECTION		ACTION
8	**VERIFY DTC TROUBLESHOOTING COMPLETED** • Always reconnect all disconnected connectors. • Clear the DTC from the PCM memory using the M-MDS. (See AFTER REPAIR PROCEDURE [SKYACTIV-G 1.3, SKYACTIV-G 1.5].) • Perform the KOEO or KOER self test. (See KOEO/KOER SELF TEST [SKYACTIV-G 1.3, SKYACTIV-G 1.5].) • Is the same DTC present?	Yes	Repeat the inspection from Step 1. • If the malfunction recurs, replace the PCM. (See PCM REMOVAL/INSTALLATION [SKYACTIV-G 1.3, SKYACTIV-G 1.5].) Go to the next step.
		No	Go to the next step.
9	**VERIFY AFTER REPAIR PROCEDURE** • Perform the “AFTER REPAIR PROCEDURE”. (See AFTER REPAIR PROCEDURE [SKYACTIV-G 1.3, SKYACTIV-G 1.5].) • Are any DTCs present?	Yes	Go to the applicable DTC inspection. (See DTC TABLE [SKYACTIV-G 1.3, SKYACTIV-G 1.5].)
		No	DTC troubleshooting completed.