

DTC U0074:00 [SKYACTIV-D 1.5]

id0102q2339600


DTC U0074:00	CAN system communication error (local CAN between PCM and TCM)
DETECTION CONDITION	• With the following conditions met, a CAN bus communication line error is continued for **1 s or more**. **MONITORING CONDITIONS** — Battery voltage: **10 V or more** — **1.5 s** have elapsed after the ignition was switched ON (engine off or on) **Diagnostic support note** • This is an intermittent monitor (other). • The check engine light does not illuminate. • FREEZE FRAME DATA/Snapshot data is not available. • DTC is not stored in the PCM memory.
FAIL-SAFE FUNCTION	Not applicable
POSSIBLE CAUSE	• CAN communication line malfunction between PCM and TCM (local CAN between PCM and TCM) — TCM terminal G—PCM terminal 1G — TCM terminal H—PCM terminal 1C • TCM DTC is stored. • PCM malfunction • TCM malfunction

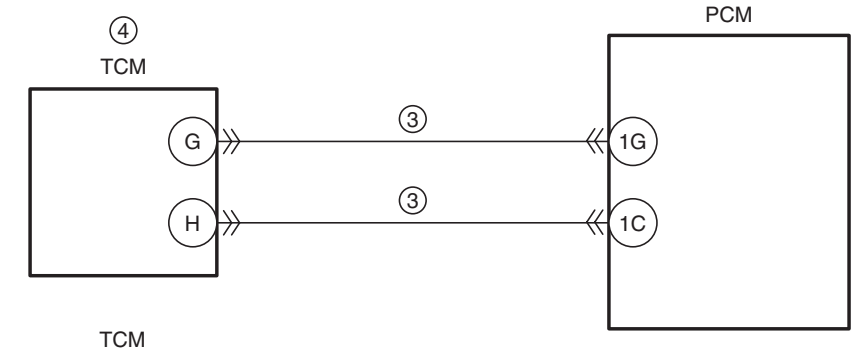

TCM
WIRING HARNESS-SIDE
CONNECTOR

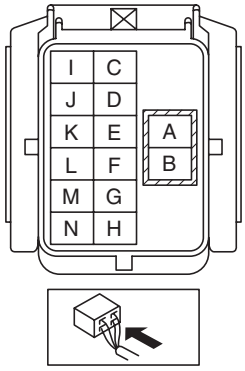

PCM WIRING HARNESS-SIDE CONNECTOR

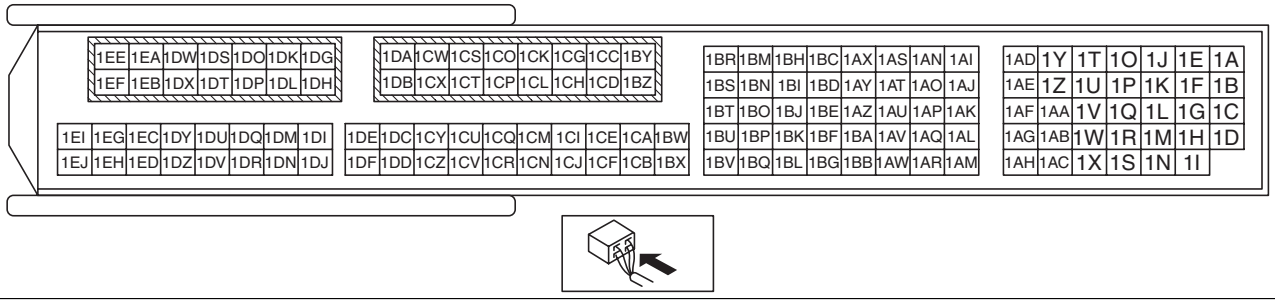

Diagnostic Procedure

STEP	INSPECTION		ACTION
1	**VERIFY RELATED SERVICE INFORMATION AVAILABILITY** • Verify related Service Information availability. • Is any related Service Information available?	Yes	Perform repair or diagnosis according to the available Service Information. • If the vehicle is not repaired, go to the next step.
		No	Go to the next step.
2	**VERIFY RELATED PENDING CODE AND/OR DTC** • Switch the ignition off, then ON (engine off). • Perform the Pending Trouble Code Access Procedure and DTC Reading Procedure. (See ON-BOARD DIAGNOSTIC TEST [SKYACTIV-D 1.5].) • Are any other PENDING CODEs and/or DTCs present?	Yes	Go to the applicable PENDING CODE or DTC inspection. (See DTC TABLE [SKYACTIV-D 1.5].)
		No	Go to the next step.
3	**CONFIRM TCM DTC** • Perform the TCM DTC inspection using the M-MDS. (See ON-BOARD DIAGNOSTIC SYSTEM DTC INSPECTION [TCM (EW6A-EL)].) • Are any DTCs present?	Yes	DTC U0074:00 or U0115:00 is displayed: • CAN communication line can be considered the cause. — Refer to the wiring diagram and verify whether or not there is a common connector between the following terminals: • TCM terminal G—PCM terminal 1G • TCM terminal H—PCM terminal 1C **If there is a common connector:** • Determine the malfunctioning part by inspecting the common connector and the terminal for corrosion, damage, or pin disconnection, and the common wiring harness for a malfunction. • Repair or replace the malfunctioning part. **If there is no common connector:** • Repair or replace the wiring harness. • Go to the next step. DTC other than U0074:00 and U0115:00 is displayed: • Go to the applicable DTC inspection. (See ON-BOARD DIAGNOSTIC SYSTEM DTC TABLE [TCM (EW6A-EL)].)
		No	PCM can be considered the cause. • Replace the PCM, then go to the next step. (See PCM REMOVAL/INSTALLATION [SKYACTIV-D 1.5].)
4	**VERIFY DTC TROUBLESHOOTING COMPLETED** • Clear the DTC from the PCM memory using the M-MDS. (See AFTER REPAIR PROCEDURE [SKYACTIV-D 1.5].) • Perform the DTC Reading Procedure. (See ON-BOARD DIAGNOSTIC TEST [SKYACTIV-D 1.5].) • Is the same DTC present?	Yes	Repeat the inspection from Step 1. • If the malfunction recurs, replace the control valve body. (See CONTROL VALVE BODY REMOVAL/ INSTALLATION [EW6A-EL].) Go to the next step.
		No	Go to the next step.
5	**VERIFY AFTER REPAIR PROCEDURE** • Perform the “AFTER REPAIR PROCEDURE”. (See AFTER REPAIR PROCEDURE [SKYACTIV-D 1.5].) • Are any DTCs present?	Yes	Go to the applicable DTC inspection. (See DTC TABLE [SKYACTIV-D 1.5].)
		No	DTC troubleshooting completed.