
DTC: 26:Er85 [AUDIO]

id0902f6037500

Description	Steering switch circuit malfunction
Detection condition	• Steering switch input signal is detected continuously for **2 min or more**.
Fail-safe	Not applicable
Possible cause	• Clock spring connector or terminal malfunction • Bluetooth® unit connector or terminal malfunction • Clock spring malfunction • Short to ground in wiring harness between Bluetooth® unit terminal F and clock spring terminal 1B • Steering switch malfunction • Bluetooth® unit malfunction

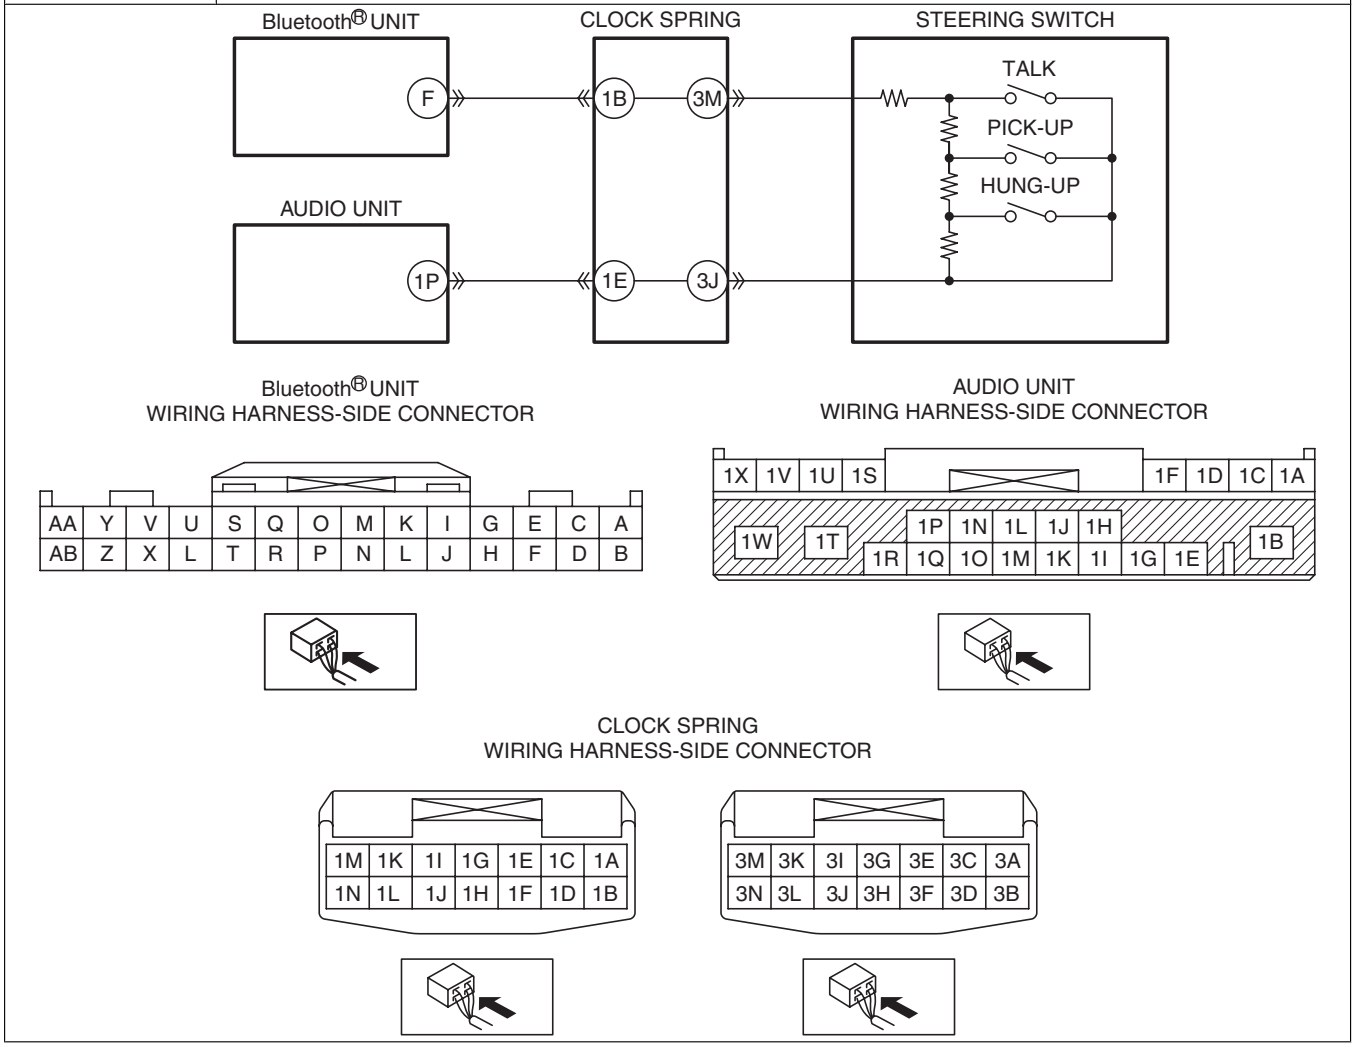

Diagnostic Procedure

Step	Inspection		Action
1	**INSPECT CLOCK SPRING CONNECTOR CONDITION** • Switch the ignition off. • Disconnect the negative battery cable. (See NEGATIVE BATTERY CABLE DISCONNECTION/CONNECTION.) • Disconnect the clock spring connector. • Inspect the connector engagement and connection condition and inspect the terminals for damage, deformation, corrosion, or disconnection. • Is the connector normal?	Yes	Go to the next step.
		No	Repair or replace the connector, then go to Step 6.

Step	Inspection		Action
2	**INSPECT Bluetooth® UNIT CONNECTOR CONDITION** • Disconnect the Bluetooth® unit connector. • Inspect the connector engagement and connection condition and inspect the terminals for damage, deformation, corrosion, or disconnection. • Is the connector normal?	Yes	Go to the next step.
		No	Repair or replace the connector, then go to Step 6.
3	**INSPECT CLOCK SPRING** • Inspect the clock spring. (See CLOCK SPRING INSPECTION [STANDARD DEPLOYMENT CONTROL SYSTEM].) (See CLOCK SPRING INSPECTION [TWO-STEP DEPLOYMENT CONTROL SYSTEM].) • Is the clock spring normal?	Yes	Go to the next step.
		No	Replace the clock spring, then go to Step 6. (See CLOCK SPRING REMOVAL/INSTALLATION [STANDARD DEPLOYMENT CONTROL SYSTEM].) (See CLOCK SPRING REMOVAL/INSTALLATION [TWO-STEP DEPLOYMENT CONTROL SYSTEM].)
4	**INSPECT STEERING SWITCH CIRCUIT FOR SHORT TO GROUND** • Verify that the clock spring and Bluetooth® unit connectors are disconnected. • Inspect for continuity between clock spring terminal 1B (wiring harness-side) and body ground. • Is there continuity?	Yes	Refer to the wiring diagram and verify if there is a common connector between Bluetooth® unit terminal F and clock spring terminal 1B. **If there is a common connector:** • Inspect the common connector and terminals for corrosion, damage, or disconnection and the common wiring harnesses for short to ground to determine the malfunctioning location. • Repair or replace the malfunctioning location. **If there is no common connector:** • Repair or replace the wiring harness which is shorted to ground. Go to Step 6.
		No	Go to the next step.
5	**INSPECT STEERING SWITCH** • Inspect the steering switch. (See STEERING SWITCH INSPECTION.) • Is the steering switch normal?	Yes	Go to the next step.
		No	Replace the steering switch, then go to the next step. (See STEERING SWITCH REMOVAL/INSTALLATION.)
6	**VERIFY THAT REPAIRS HAVE BEEN COMPLETED** • Always reconnect all disconnected connectors. • Connect the negative battery cable. (See NEGATIVE BATTERY CABLE DISCONNECTION/CONNECTION.) • Clear the DTC for the Bluetooth® unit. (See CLEARING DTC [AUDIO].) • Switch the ignition ON (engine off or on) and wait for **2 min or more**. • Perform the DTC inspection for the Bluetooth® unit. (See DTC INSPECTION [AUDIO].) • Is the same DTC displayed?	Yes	Repeat the inspection from Step 1. • If the malfunction recurs, replace the Bluetooth® unit. (See Bluetooth® UNIT REMOVAL/INSTALLATION.) Go to the next step.
		No	Go to the next step.
7	**VERIFY IF OTHER DTCs DISPLAYED** • Are any other DTCs displayed?	Yes	Repair the malfunctioning location according to the applicable DTC troubleshooting. (See DTC TABLE [AUDIO].)
		No	DTC troubleshooting completed.