
FOREWORD [ENTERTAINMENT SYSTEM [WITH CENTER DISPLAY]]

id0903I8059700

Troubleshooting Procedure

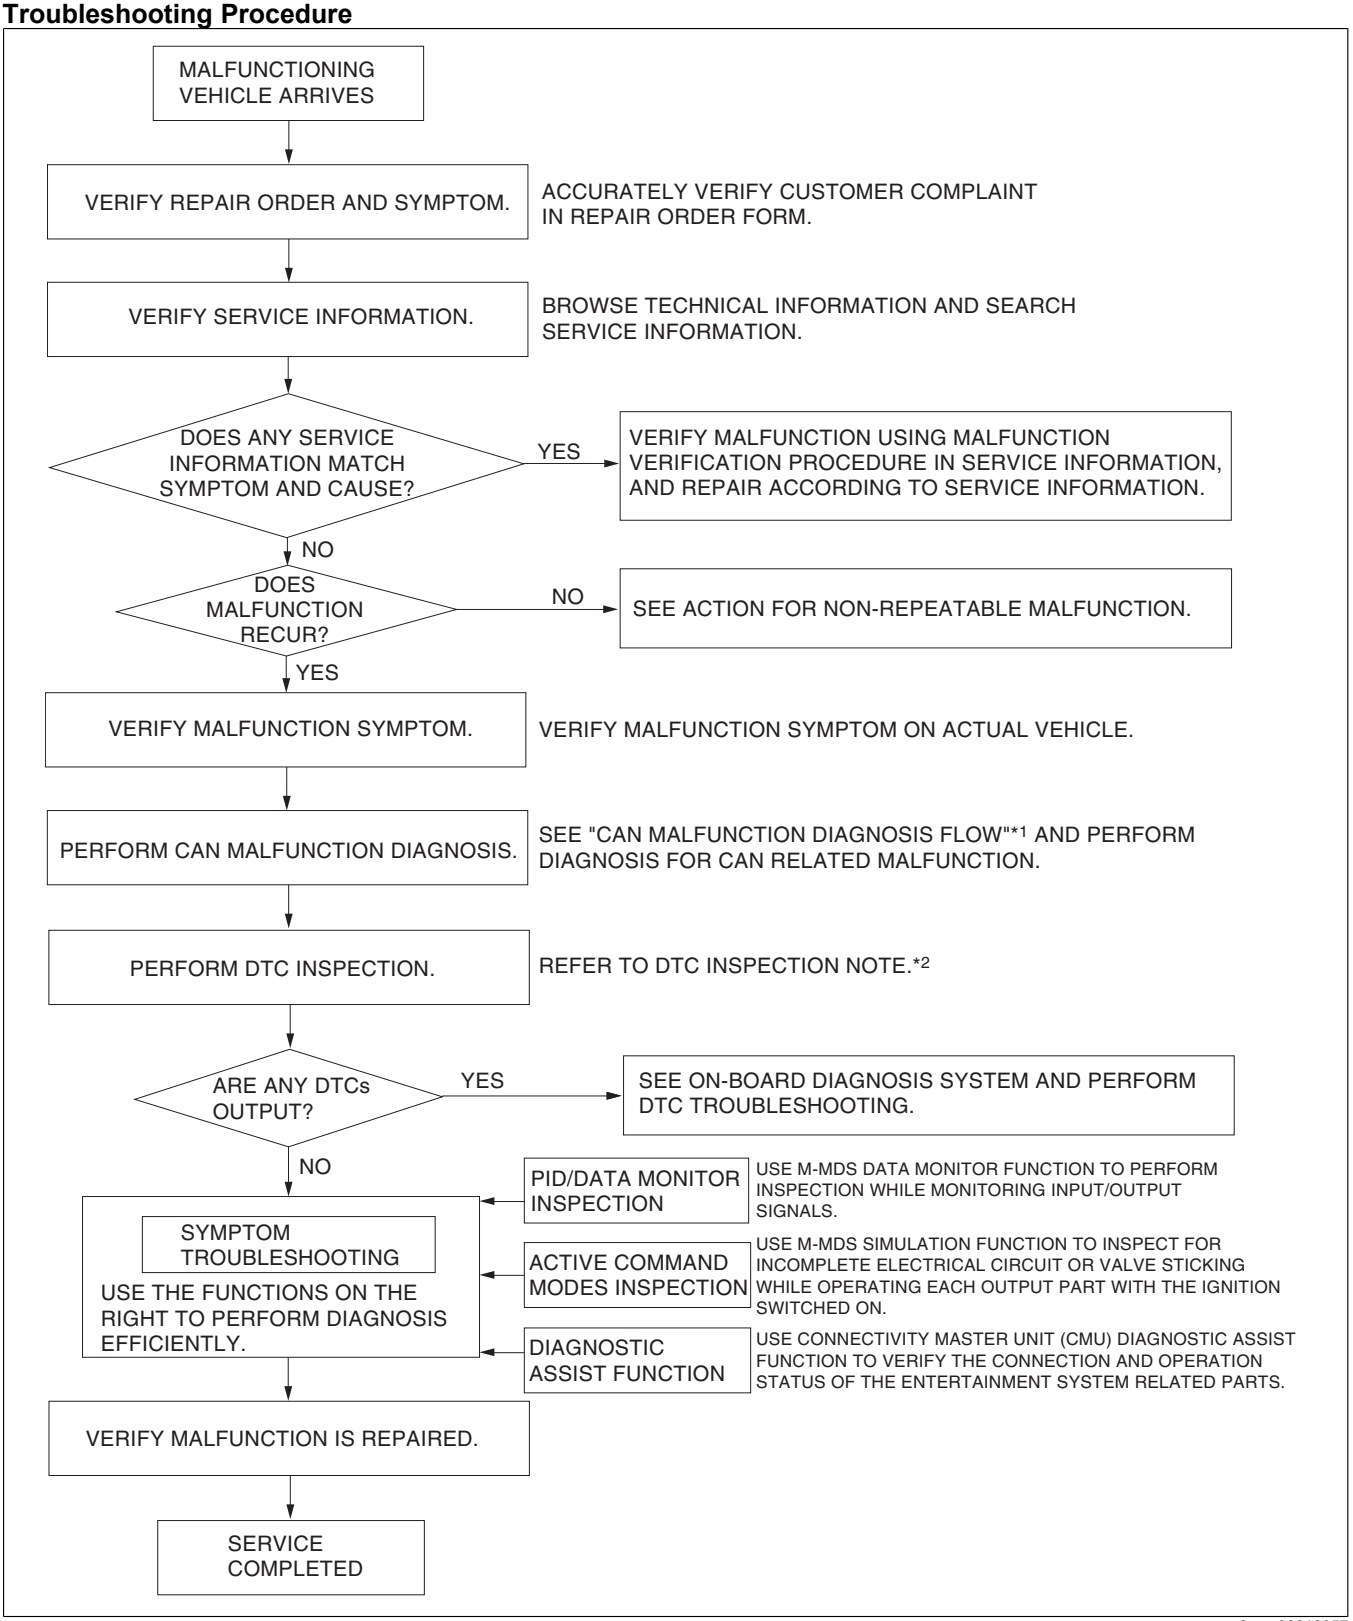


am3uuw00012057

*1 : (See CONTROLLER AREA NETWORK (CAN) MALFUNCTION DIAGNOSIS FLOW [SKYACTIV-D 1.5].) (See CONTROLLER AREA NETWORK (CAN) MALFUNCTION DIAGNOSIS FLOW [SKYACTIV-G 1.5 (L.H.D.)].) (See CONTROLLER AREA NETWORK (CAN) MALFUNCTION DIAGNOSIS FLOW [SKYACTIV-G 1.3, SKYACTIV-G 1.5 (R.H.D.)].)

*2 : (See DTC Inspection Note.)


Action for non-repeatable malfunction

- If the malfunction does not recur, verify the malfunction cause by performing the following actions:
  - — Verify that a DTC has been recorded in the memory. (See DTC INSPECTION [CONNECTIVITY MASTER UNIT].) (See DIAGNOSTIC ASSIST FUNCTION [CONNECTIVITY MASTER UNIT].)
  - — Based on the repair order form, attempt to drive the vehicle or perform tests to replicate the malfunction, record the data at that time, and detect the malfunction cause.
  - — Shake the wiring harness or connector of the electrical component which is suspected to be the cause of the malfunction, and inspect for malfunction or occurrence of any DTCs.

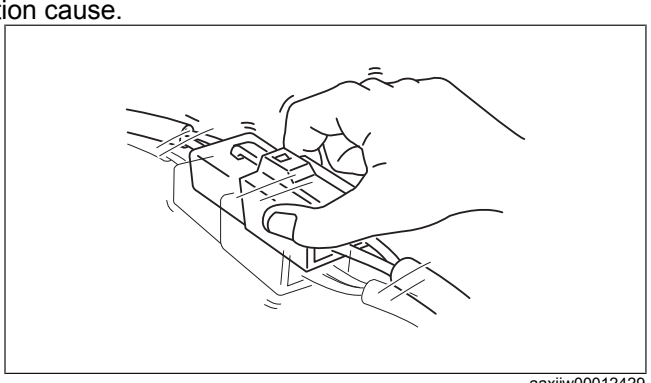

aaxjjw00012429

  - — Refer to [Determining Open Circuit Location] based on the recorded DTC, shake the wiring harness or connector of the electrical component which is suspected to be the cause of the malfunction, and inspect for any changes in CAN system voltage or occurrence of any DTCs.

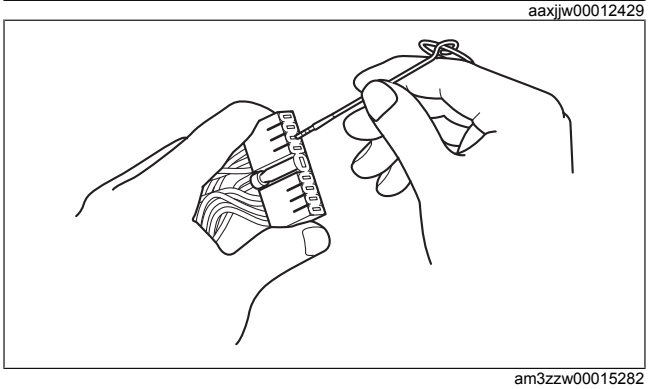

am3zzw00015282

DTC Inspection Note

- DTCs for the entertainment system [with center display] can be verified using the M-MDS or the on-board diagnostic test mode in which the on-board diagnostic function can be launched by operating the commander switch or the center display. (See DTC INSPECTION [CONNECTIVITY MASTER UNIT].) (See DIAGNOSTIC ASSIST FUNCTION [CONNECTIVITY MASTER UNIT].)

Effects of Non-Genuine, After-market Electrical Components

- A malfunction may occur due to noise interference from a non-genuine, after-market electrical component.
- If a non-genuine, after-market electrical component is installed, disconnect the connector or unplug from the **12 V** accessory socket and verify that the malfunction recurs. If the malfunction does not recur, it is highly possible that the malfunction is caused by the non-genuine, after-market electrical component.