COWL SIDE REINFORCEMENT (FRONT) COMPONENT INSTALLATION [PANEL REPLACEMENT]

id098008950100


Symbol Marks

SYMBOL MARK	MEANING
●	SPOT WELDING
■	PLUG WELDING (ARC WELDING)

am2zzb00000446

Installation Procedure

1. When installing new parts, measure and adjust the body as necessary to conform with standard dimensions.
2. Drill holes for the plug welding before installing the new parts.
3. After temporarily installing new parts, make sure the related parts fit properly.
4. Spot weld the 19 locations indicated by (A) shown in the figure.
5. Plug weld the 18 locations indicated by (B) shown in the figure, then install the cowl side reinforcement.

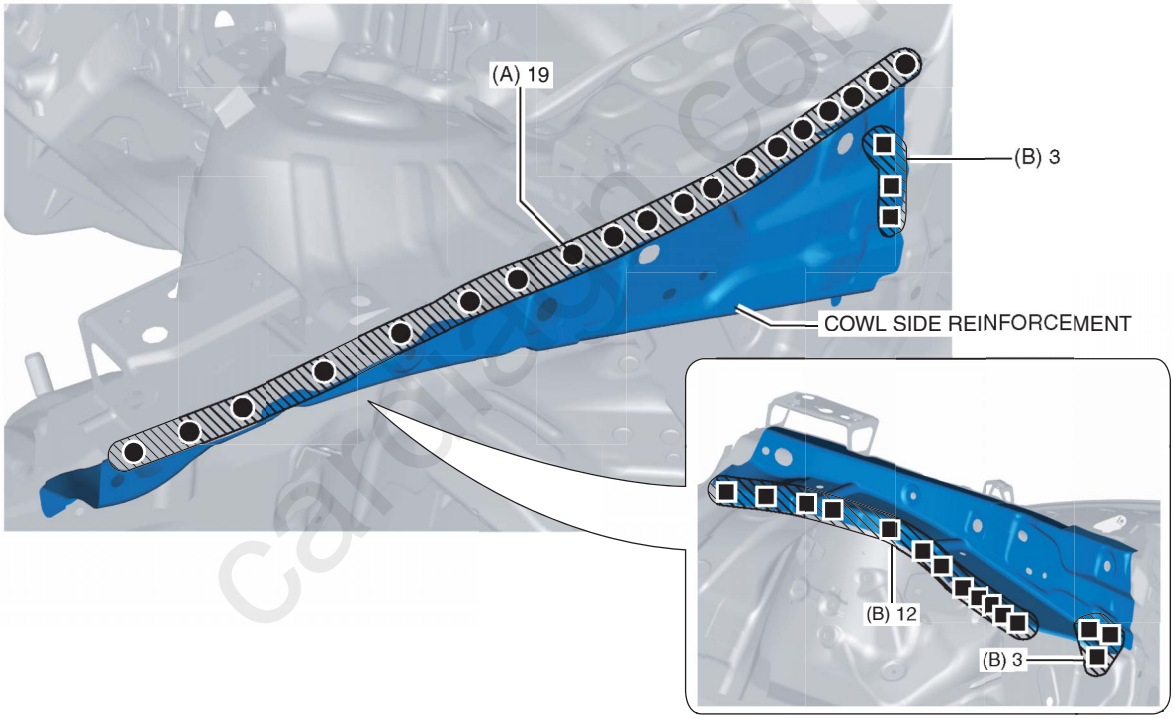

am2zzb00000447