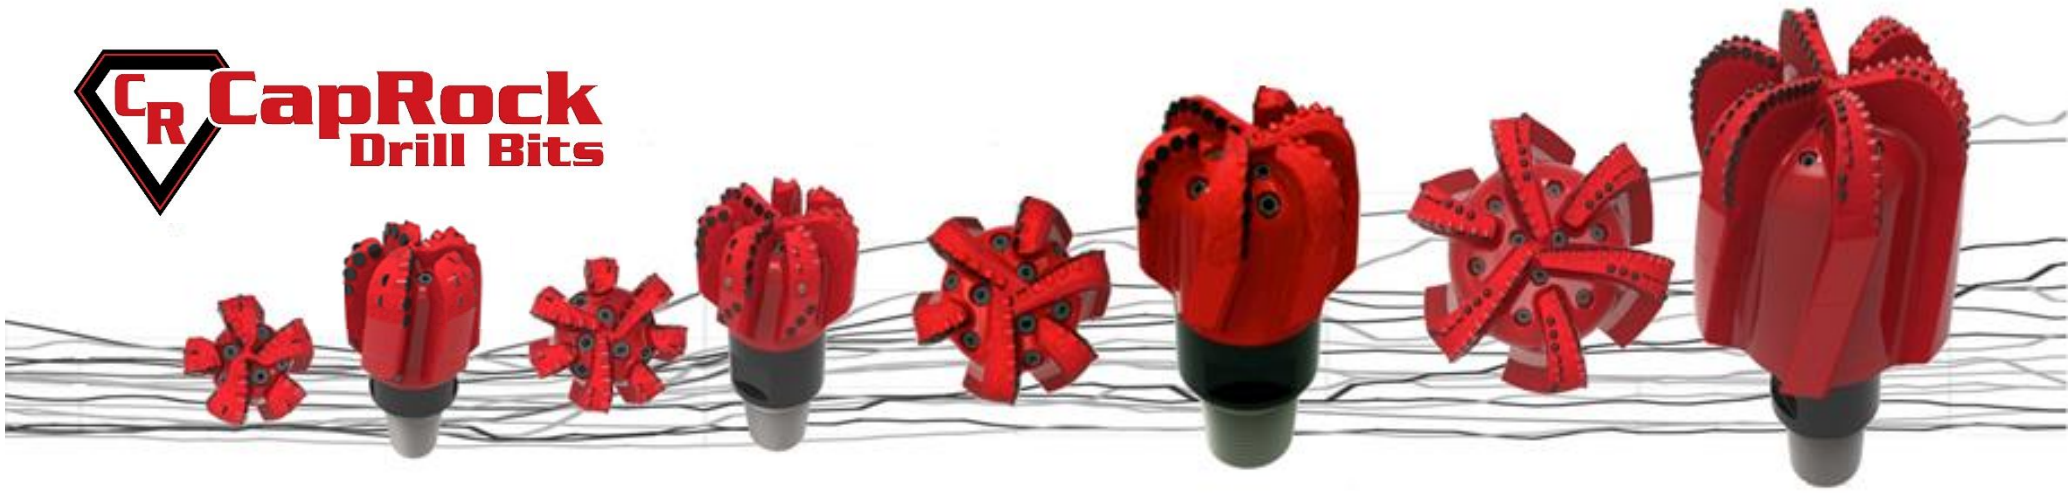

Lithological Tops	Formation Remarks & Depth of Cut Control (DOCC) Recommendations	Drilling Parameters	
Fasken & Trinidad 433 **Andrews County, TX**	**FEE BQ TBD**	**.09 rv/gal @ 720 GPM**	
Rustler (1,920') Salt/Anhydrite/Dolomite UCS: 10 – 15 kpsi	•Maintain stable WOB and RPM. Increase WOB up to 40K as needed after BHA is buried.	RPM Total 110-120	WOB (klbs) 35-40
Yates (3,079') Shale/Dolomite/Red Sands UCS: 15 – 20 kpsi	•Fast Drilling - Maintain a stable WOB and RPM.	RPM Total 110-120	WOB (klbs) 40
Queen (3,768') Dolomite/Sandstone UCS: 20-22 kpsi	•Consistent lithology •Monitor transition into the Grayburg as rock strength increases, low WOB can induce impact damage. Increase WOB in this section to keep cutters buried.	RPM Total 110-120	WOB (klbs) 40-45
Grayburg (4,854') Dolomite/Anhydrate UCS: 20 – 25 kpsi	•25kpsi stringers •@**4,800'** Implement DOCC Transition Parameters. •Set total RPM at 110 and Control Drill @ 90ft/hr. •@**4,900'** Release DOCC Transition Parameters and resume with 110 RPM and 40-55K WOB.	RPM Total DOCC Set @ 110 Non-DOCC @ 110-120	WOB (klbs) DOCC Min = N/A DOCC Max @60K Other = 45-50
San Andres (5,415') to TD Dolomite/Limestone UCS: 20 – 25 kpsi	•@**5,370'** Implement DOCC Transition Parameters. •Set total RPM at 110 and Control Drill @ 90ft/hr.	RPM Total DOCC Set @ 170 Non-DOCC @ 180	WOB (klbs) DOCC Min = N/A DOCC Max @60K Other = 45-50

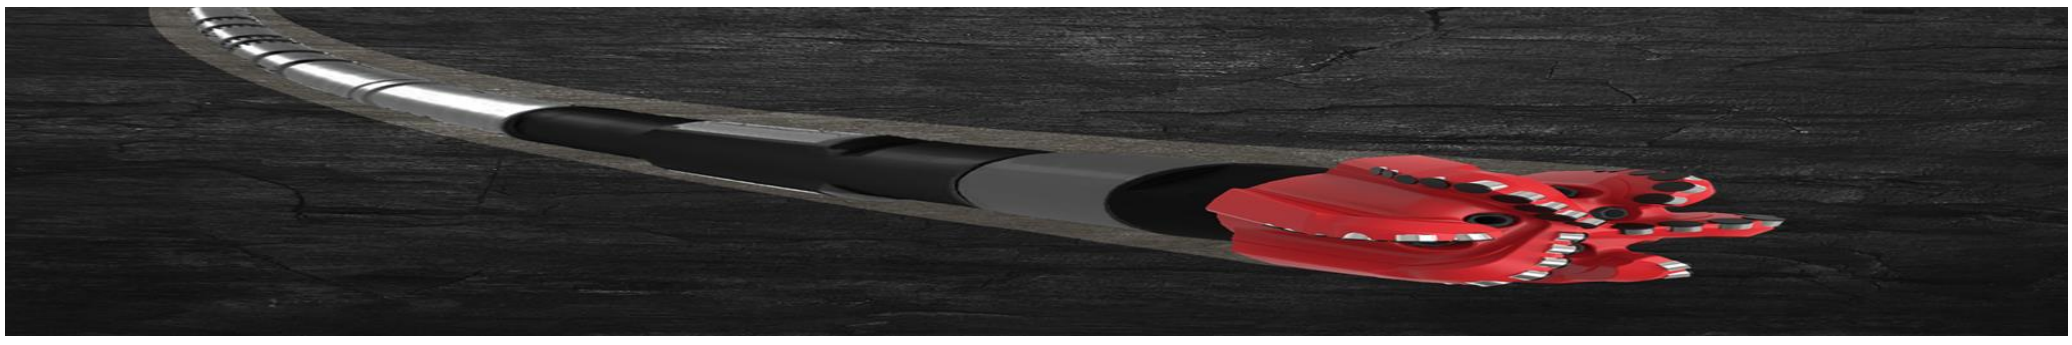

- **NOTES**
- **On all formations, except DOCC transition points, remove ROP set points on Auto Driller or set to 800FPH. In these non controlled intervals, use WOB set points.**
- **In all DOCC Transitions enable the ROP set point on auto driller. Remove WOB set points through transition zones or set max of 65K.**
- **Set max differential set point on Auto Driller to max differential pressure from motor spec sheet. Keep this set point for entire intermediate section.**