

STEP 5

SHEET CAM SET UP

1. Double Click This PC.
2. Click EZ-Router.
3. Double click 20xx EZ-USB Folder.
4. Double Click Sheet Cam Folder.
5. Double Click SheetCam TNG Set up.
6. Click Yes to Allow App To make changes.
7. Click Next to SheetCam Setup Wizard.
8. Click Install for file location.
9. Select Create a Desktop Shortcut.

a. If having to install multiple Sheet Cam for OXY Fuel.

b. Set up for OXY Fuel first.

10. Click Next on Installation complete.
11. Click Finish on Completing SheetCam set Wizard.
12. Drop USB Pop up.
13. Select English on preferred Language.
14. "OK" on Software License Agreement
15. "Set Wizard" will appear, click "Next"

- a. Linear Units "in"
- b. Angular Units "Degrees"
- c. Feed Rate "IPM"
- d. Thread Pitch "TPI"
- e. Time "S"
- f. Click "Next"
- g. Deselect "Rotary cutting"
- h. Select "Jet Cutting"
- i. Click "Next"
- j. Choose Post Processor for Machine
 - i. Output file Units "Inches"
 - ii. Output Folder "Remember Last"
 - iii. Z-zero "Top of Work"
 - iv. Click "Import Post"

Linear units

Angular units

Feed rate

Thread pitch


Time

1. Go to 2018 EZ-USB or Intelitek USB, "SheetCam" folder

- a. Click on "Post Processor Folder"

i. If loading OXY Fuel load LSCS-Flame.

1. If not Click "LSCS Plasma THC with Scribe and Backlash Compensation R1:00"
 - a. Click open.
 - b. Click ok.

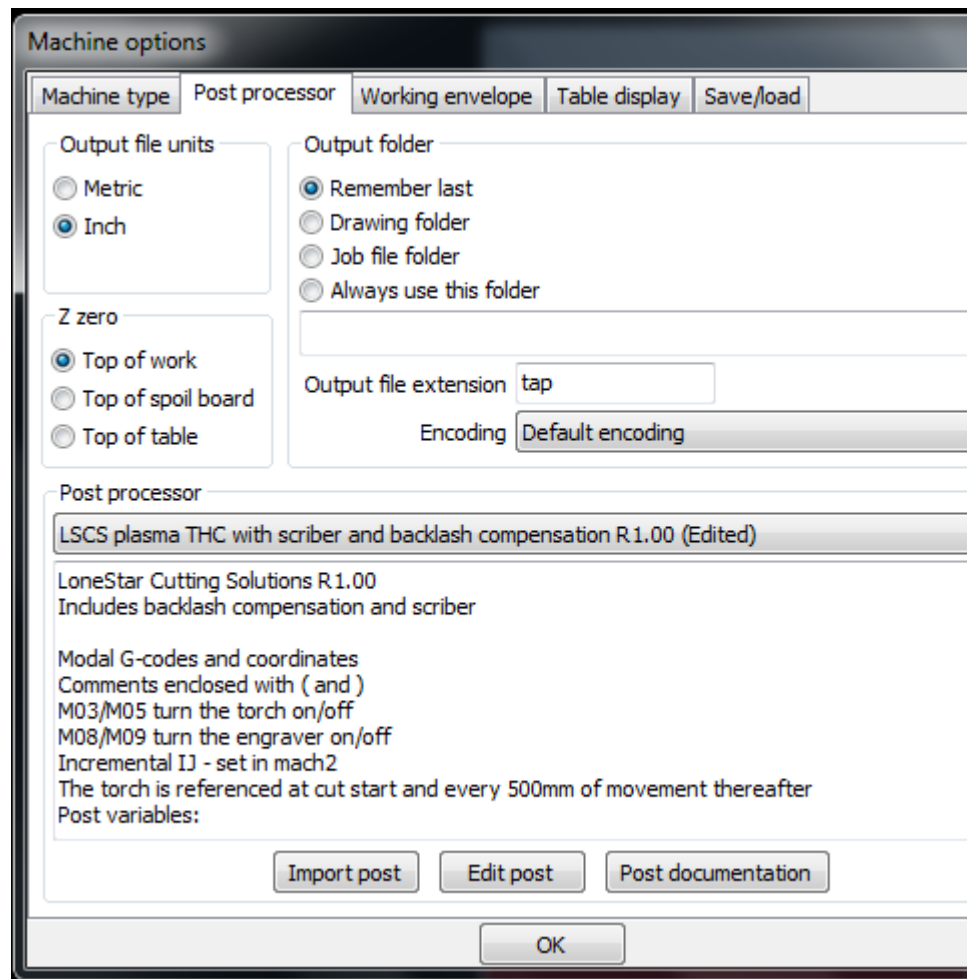

ii.

k. Click "Next".


l. Then Click "Finish"

16. Click on "Tools" on left side of screen.

a. If setting up OXY there will be no tools to select (the customer makes their own tools).

b. Click on "Tool Table"

i. Uncheck mark "automatically generate names"

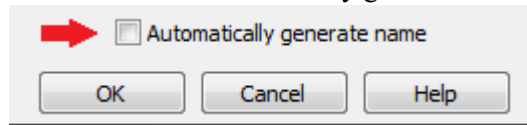

ii.

iii. Click Ok

c. Click on "Zoom"


i. Click "Grid Options"

1. Grid Size X: 0.0625 Y: 0.0625

2. Bump Increments X: 0.0625 Y: 0.0625

3. Angle 11.25

4. Click Ok.

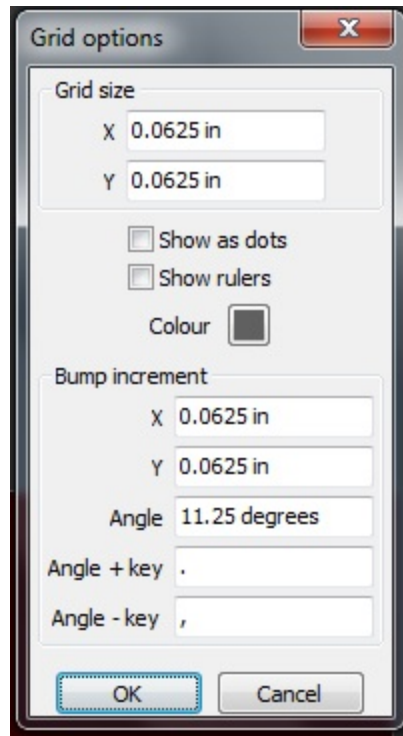

- 5.
 - d. Click "File"
 - i. "Open Toolset"
 1. EZ-USB.
 - a. SheetCam Folder
 - i. "Plasma Tools"
 1. Select Applicable Tool Folder.
 - a. Applicable Tool File.
 - i. Click "do not ask again", Click Ok.
 - ii. Click File.
 - iii. "Save as Default"
- e. Options
 - i. "Job Options"
 1. Material
 - a. Size – Enter size of the machine ex. 48" x 48"
 - b. Origin, Bottom Left Corner
 - c. Thickness ".25"
 - d. Rapid Clearance "1.5"
 - e. Height of bottom of material above table "0"
 - f. Plunge safety clearance ".5"

Job options

Material Parking Nesting Path rules Remnant cutoff Tool change View

☐ Use drawing

Part New part

Layer

Size

X 48 in

Y 48 in

Origin

☒ ☐ Enter coordinates

X 0 in

Y 0 in

Thickness of material 0 in

Rapid clearance 1.5 in


Height of bottom of material above table 0 in

Plunge safety clearance .5

Save material Load material

OK Cancel Help

- g.
2. Nesting
 - a. Check "Keep parts together"
 - b. Drag the bar in cut direction to the middle of the V and H.

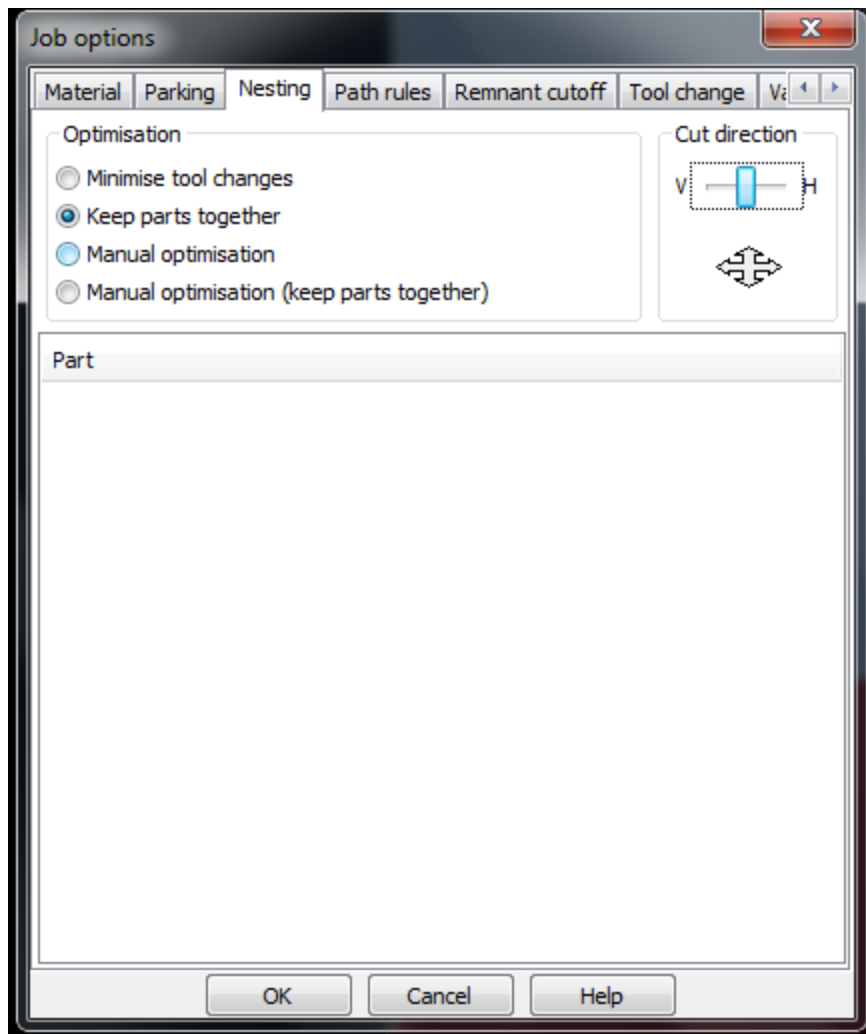


- c.
- d. Click “Ok”


ii. Machine

1. Post Processor


- a. Output file units check “Inches”
- b. Z-Zero check “Top of work”
- c. Output folder check “Remember Last”
- d. Output file extension “tap”
- e. Encoding “Default encoding”
- f. Post Processor “LSCS plasma THC.....”
 - i. Proper one for machine set up.

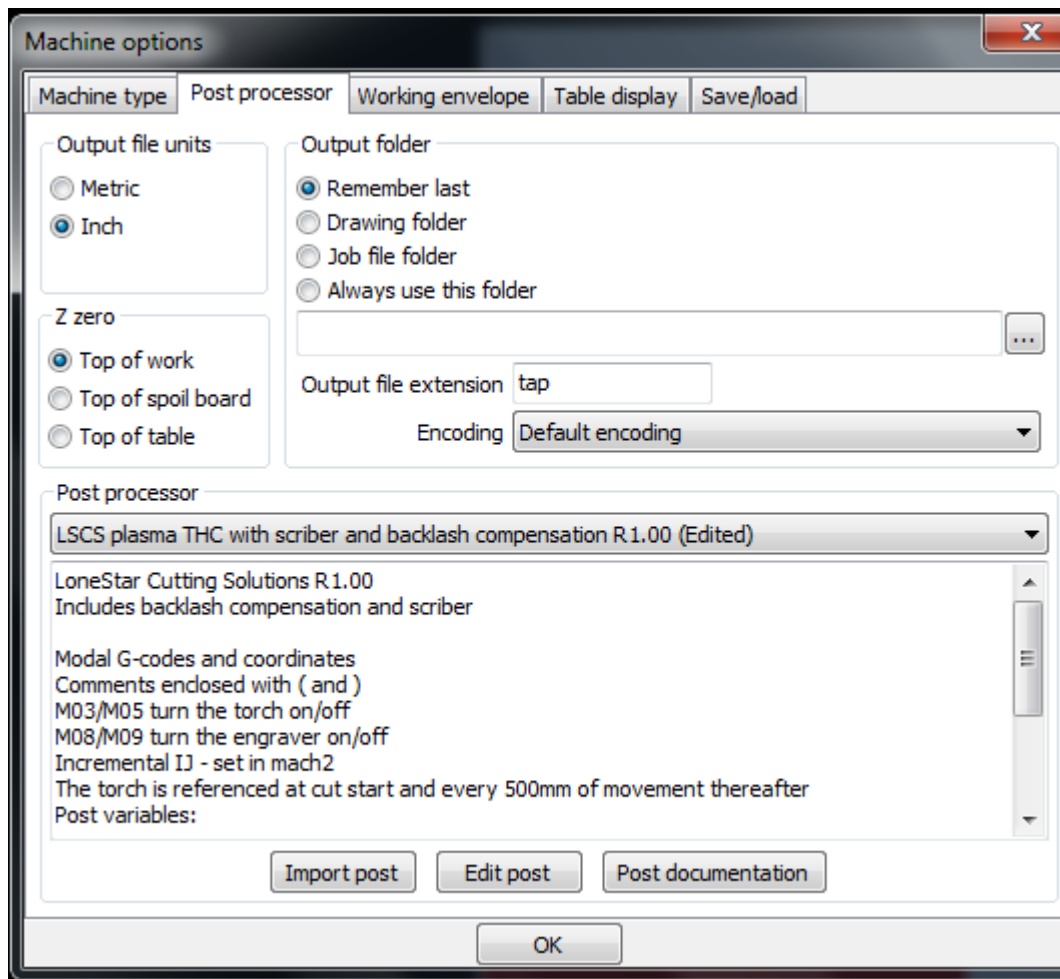


- g.
2. Work Envelope
 - a. Size – Enter size of the machine ex. 48” x 48”

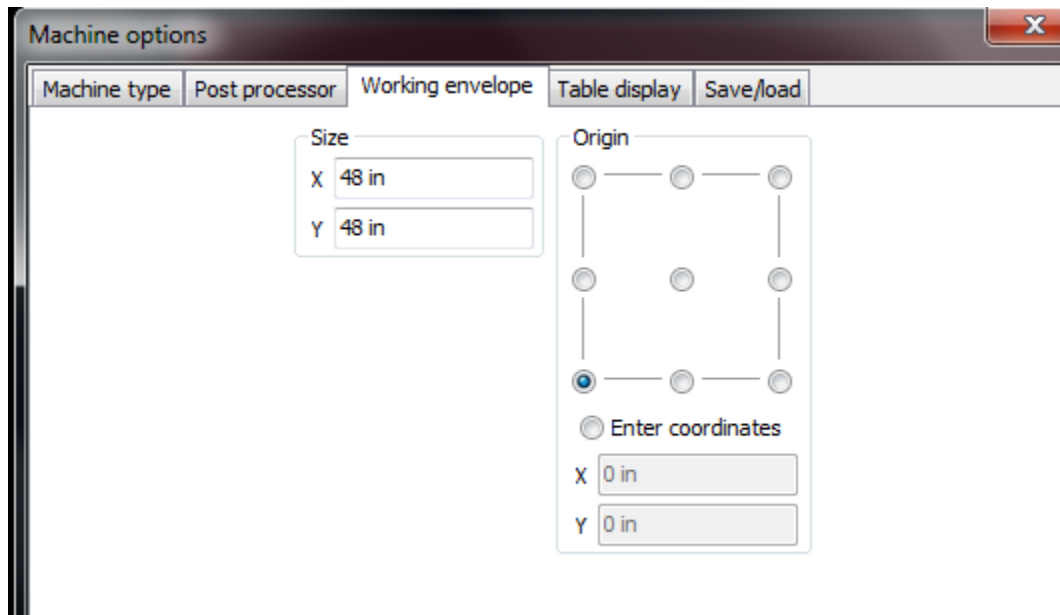

- b.
3. Table Display
 - a. Size – Enter size of the machine ex. 48” x 48”

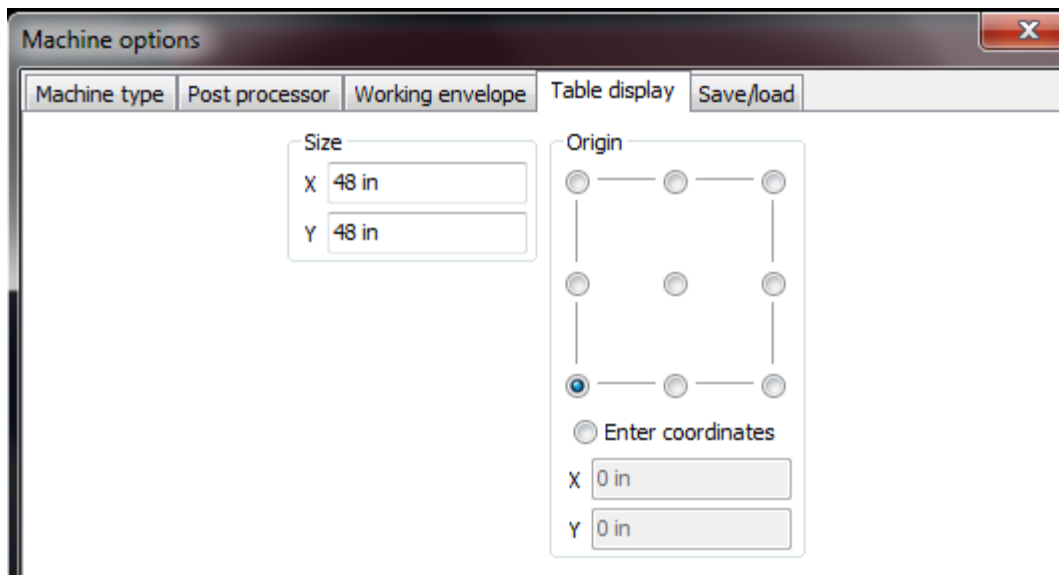


- b.
 - c. Click ok.
- iii. Application Options
1. Display
 - a. Leave all current settings
 - b. Check "Reverse mouse wheel"

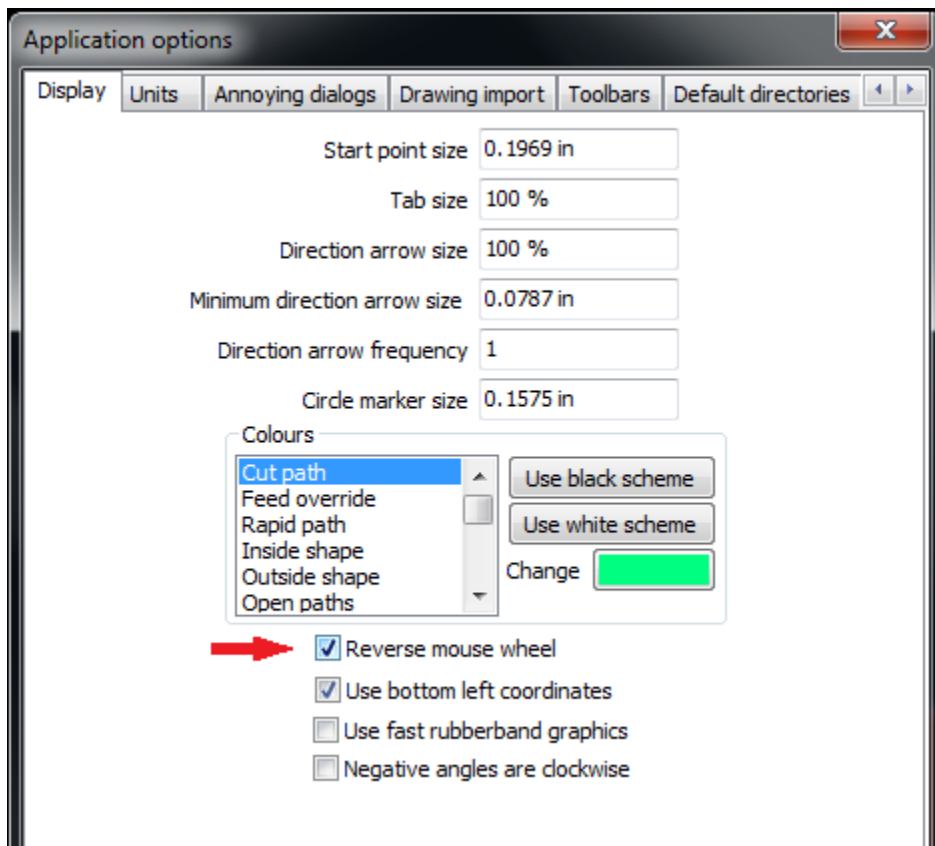

- c.
2. Drawing Import
 - a. Import link tolerance - .01
 - b. Max. detail reduction error - .01
 - c. Circle recognition limit - .01
 - d. Arc fitting tolerance - .01
 - e. Min. Seg. For arc fitting - 8

- f. Make sure Remove duplicate lines is checked.

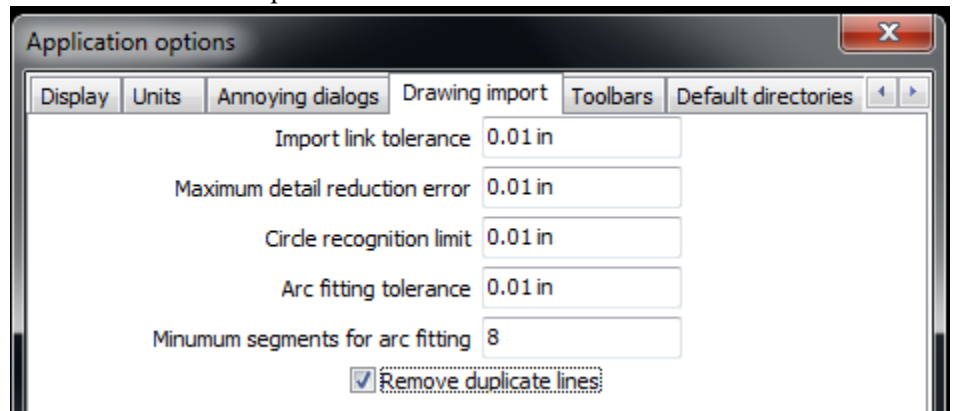

- g.
- h. Click ok.

17. File

- a. Import Drawing
 - i. EZ-Router
 1. Select EZ-USB
 2. Change file type to DXF.
 - a. Open 4.75 square.
 3. Drawing Options
 - a. Scaling "Inch"
 - b. Drawing Position check bottom left
 - c. UNCHECK "Use point for drilling"
 - d. "Ok"

18. Operation

- a. "Plasma Cut" or double click "Magic wand" looking icon in Operations window
 - i. Basic
 1. Contour method "outside Offset"
 - a. unless doing open lines like the thc up down test.
 - i. Then set to no offset.
 2. Layer 1 for layer tab.
 3. Tool 5 or Appropriate for consumables and material thickness.
 - a. Unless doing something with a scribe or oxy.
 - i. Then follow the instruction under their tabs in the Powered checklist.
 4. Check "Reverse cut direction"
 5. Path Rules "THC Hold"
 6. Loop sharp corners- arc and about 0.125
 7. Lead in- arc 0.2
 8. Lead out- arc 0.2
 - ii. Cut Path
 1. Optimization "Auto"
 2. Start Position check bottom left corner box
 3. Cutting Rules check "Keep parts together"
 4. Cut Direction, center bar between "V" and "H"
 5. Click ok.
 - iii. Click post processor or the P in upper left corner below file.
 1. Select destop.
 2. Click save.
 3. Click ok.
- b. Repeat steps 17 and 18 for THC UP DOWN TEST and any other

Click Help Tab.

Click Install License.

Select EZ-Router USB.

Open 2018 EZ-USB Plasma folder.

Select Software License folder.

Select SheetCam License.

Click Open.

Click ok.

Exit Sheet Cam.

Click no.

Check don't ask again.

Click yes.

Open Sheet Cam.

Click Help Tab.

Click About.

Check To make sure the Proper license is loaded and click OK.

Exit Sheet Cam.

If having to set up another Sheet Cam (For when using both OXY Fuel and Plasma)

Copy Desktop icon.

Right click desktop icon select properties.

On target under shortcut tab.

After exe" input

-c Plasma with a space between exe" and -.

Click apply.

Click OK.

Then go through and set up plasma sheet cam.

BEGIN STEP 6.