
10. Pins for lap and lead lever and valve stem crosshead, (obsolete design) tracing F-96770, are blanked out on automatic screw machines and the two ends forming the bearing surfaces in the valve stem crosshead are case hardened, while the central portion fitting the lap and lead lever is left soft. The two end bearing surfaces are ground exactly to 1½" in diameter, as one size of pin is suitable for repairs to all levers and valve crossheads using this style of connection between lap and lead lever and valve stem crosshead. The central portion is left 3/64" larger than standard in order that it may be finished at time of application for a light drive fit in the 1½" reamed or ground hole in the lap and lead lever.

11. Special attention is called to the fact that tapered holes for pins in jaws and straight holes for bushings should be reamed or redressed, increasing the diameter by only a sufficient amount to true the hole. After this has been done, the pin or bushing must be carefully finished to fit in place properly.

LOCATION OF JAW BOLTS, PINS AND BUSHINGS.

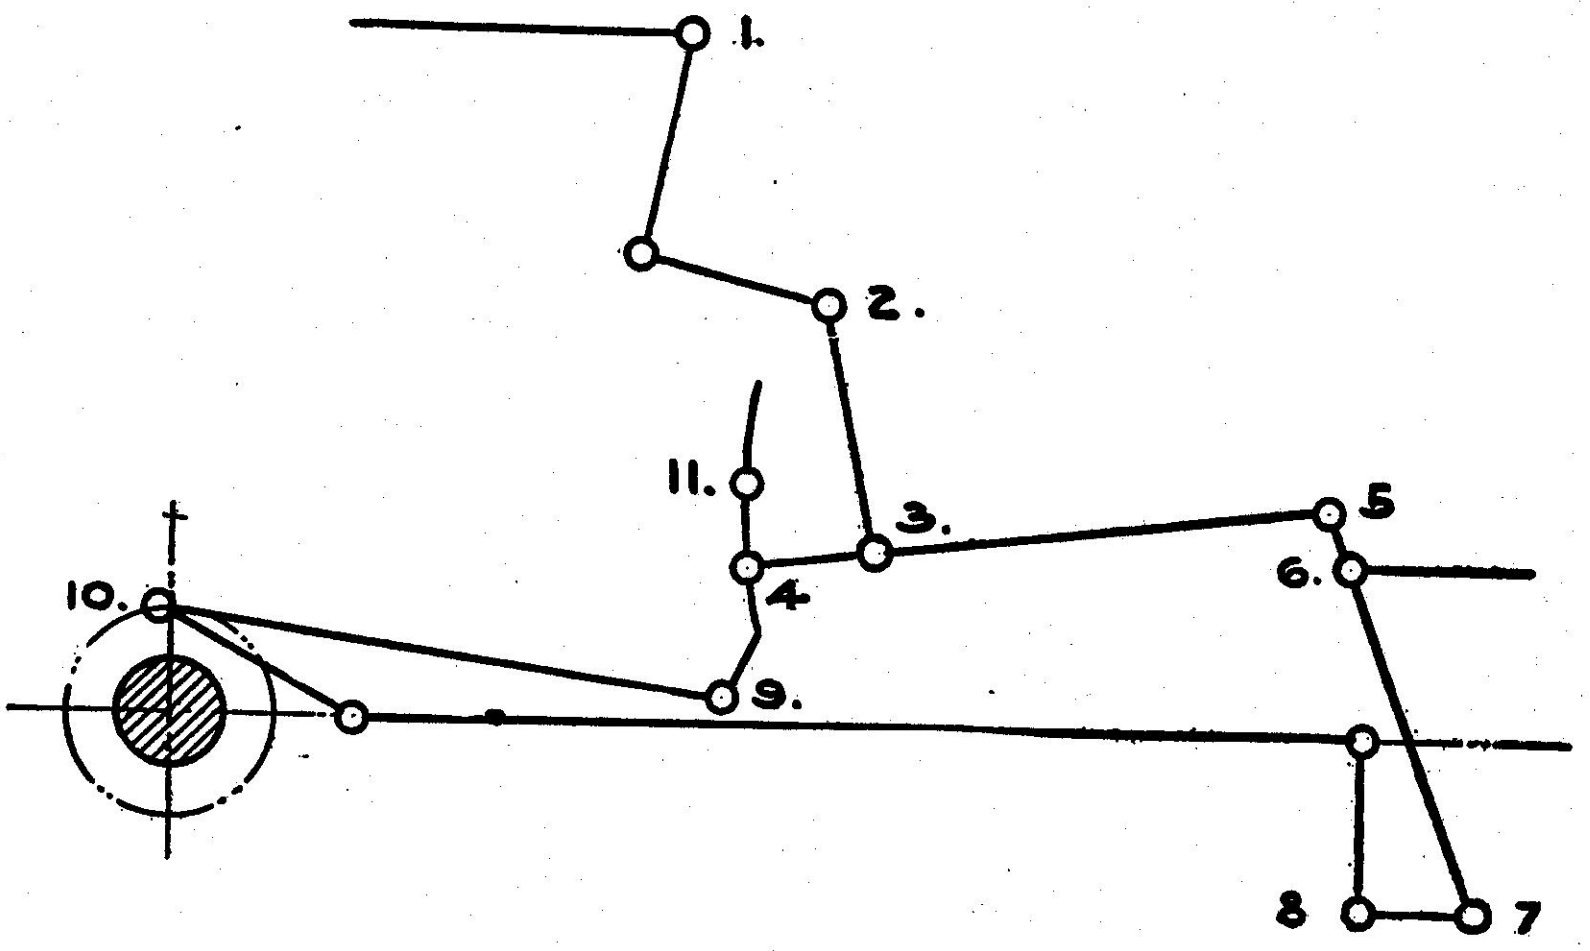

(Fig. 1)

1. Reach rod and lift shaft arm.
2. Lift shaft arm and radius rod hanger, or lift shaft arm and radius rod sliding block where round or square radius rod stub end is used.
3. Radius rod hanger and radius rod.
4. Radius rod and link block.
5. Radius rod and lap and lead lever.
6. Lap and lead lever and valve stem crosshead.
7. Lap and lead lever and lap and lead lever connector.
8. Lap and lead lever connector and crosshead arm. (Crosshead where crosshead arm is omitted.)
9. Eccentric rod and link foot.
10. Eccentric rod and eccentric crank.
11. Link bridle and link hanger bracket.