



REPORT

ROOF LEAKAGE REMEDIAL WORKS — IKEJA CITY MALL

REPORT REFERENCE

RPT-2026-ICM-ROOF-001

DATE

21 August 2026

PREPARED BY

DOVA Futures Limited

DEPARTMENT

Design Team

01. EXECUTIVE SUMMARY

This report summarises the visible inspection findings and the proposed remedial approach for Broll Properties at Ikeja City Mall. The roof-edge coping, adjacent blockwork, fixing penetrations and associated cracked wall are the leading visible indicators of a possible water-entry route. Measure 1 therefore leads the proposed works. Measure 2 is retained as a precautionary localised treatment at the slab-to-wall perimeter. The exact entry point and path of water remain subject to opening-up and investigation when the works begin.

02. BACKGROUND

Visible water damage and cracking were observed at a roof-edge wall beneath the existing metal cap/coping, with previous fixing points and service penetrations present. The current assessment is based solely on visible inspection. The working proposal is to address the likely coping/blockwork leakage route first, then provide localised rescreeding and refelting at the slab-to-wall junction as a precaution. The attached wall image records the observed condition and is not, by itself, a definitive diagnosis.

03. FINDINGS

- 01 The wall shows extensive cracking, local surface failure, staining and damp-related deterioration beneath the roof-edge cap.
- 02 The coping/blockwork interface, existing penetrations and defective roof-cap details are the leading visible indicators of a possible water-entry route.
- 03 The exact leakage path and the mechanism behind the wall cracking remain unconfirmed until the affected areas are opened, cleaned and investigated during the works.

ATTACHED SITE IMAGE

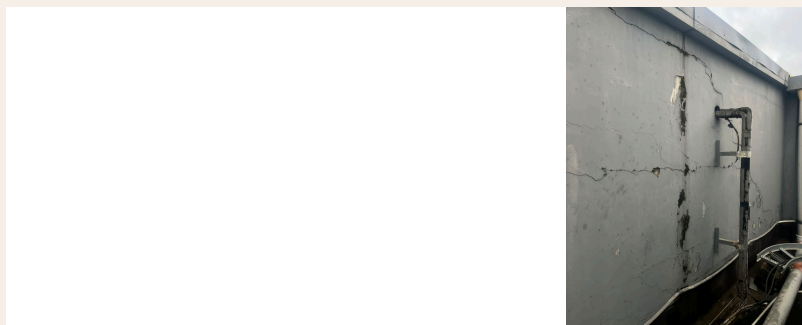


Figure 1. Defective wall observed during visible inspection. This image records visible condition only and does not establish the definitive leakage path or structural cause.

04. RECOMMENDATIONS

1. **Repair and waterproof the affected roof-edge wall and metal coping.** Based on the visible inspection, rainwater flowing across the flat roof appears to be reaching the wall and entering through openings around old bolts, screws and other penetrations in the metal coping. The existing felt beneath this area also appears to have failed or does not extend far enough to provide adequate protection. The metal coping should therefore be carefully opened where necessary, all holes and penetrations sealed, the damaged wall repaired, and a new layer of bituminous felt installed with sufficient coverage and properly sealed laps. The coping should then be reinstated and sealed to prevent rainwater from entering through the top of the wall.
2. Treat Measure 2 as a precautionary perimeter intervention limited to approximately 1 metre up the wall and 1 metre onto the slab. Rescreed and refelt this slab-to-wall junction and lapping side only; the main slab area is excluded because its existing felt appeared satisfactory during visible inspection.
3. During opening-up, trace the active water route and revise the repair sequence if the observed conditions identify a different cause.
4. Monitor the roof after completion. If investigation shows that a wider slab treatment is required, record the finding and inform Broll Properties before any additional work proceeds.

05. CONCLUSION

The findings and proposed measures are based on visible evidence only. Roof leakage can follow concealed or secondary paths, and opening-up may reveal another route by which water is penetrating. If that occurs, DOVA Futures will record the finding, inform Broll Properties and agree any necessary change to the repair sequence and scope before proceeding. Quantities, method and cost remain subject to site measurement and principal approval.

AUTHORISATION

PREPARED BY

DOVA Futures Limited — Design Team

DATE: 21 August 2026

APPROVED BY

Broll Properties

NAME / DATE: _____ / _____