
1 Control panel message document (CPMD)

Printer service information

Last Update: January 2017

Service Mode PIN numbers:

HP PageWide Pro 750 - 05075017

HP PageWide Pro MFP 772, 777 - 05075017



NOTE: When possible, always update the printer firmware to the latest available version at HP.com as part of the troubleshooting performed for any of the following errors.

Control-panel error codes

15.11.Fz

Description

The right side vertical sensor detected a paper jam in the turn path area of the print path.

- **15.11.F0** Paper was detected at the right side vertical sensor in the turn path area while the printer was turning on.
- **15.11.FF** Paper was detected at the right side vertical sensor in the turn path area after the printer attempted to clear a jam.

Recommended action

Recommended action for customers

1. Clear the jam.
 - a. Open the right door.
 - b. Remove any paper or paper remnants.
 - c. Close the right door.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Clear the jam.
 - a. Open the right door.
 - b. Remove any paper or paper remnants.
 - c. Close the right door.
2. If the error persists, send an onsite technician to perform the following steps.
3. Using the [Component Tests](#) in the control panel, test the [Accessory Jam Sensor](#). The sensor should show [Not Tripped](#) when the right door is closed and [Tripped](#) when the door is open.
4. If the sensor fails the test, clean the accessory jam sensor using a dry lint-free cloth.
5. Check that the right side vertical sensor reflector is not missing, dirty, misaligned, not flat, or off-center.
 - a. If the reflector is missing, replace it.
Part number: CM752-80001
 - b. Clean the reflector with a dry lint-free cloth.
 - c. If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.

6. If the error persists, check for damaged connectors while reseating the FFC between the right side vertical sensor and the RRL PCA (J3).
7. If the error persists, replace the right side vertical sensor (REDI sensor).

Part number: A7W93-67076

15.12.Fz

Description

The turn path sensor detected a paper jam in the turn path area of the print path.

- **15.12.F0** Paper was detected at the turn path sensor in the turn path area while the printer was turning on.
- **15.12.FF** Paper was detected at the turn path sensor in the turn path area after the printer attempted to clear a jam.

Recommended action

Recommended action for customers

1. Clear the jam.
 - a. Open the right door.
 - b. Remove any paper or paper remnants.
 - c. Close the right door.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Clear the jam.
 - a. Open the right door.
 - b. Remove any paper or paper remnants.
 - c. Close the right door.
2. If the error persists, send an onsite technician to perform the following steps.
3. Using the [Component Tests](#) in the control panel, test the [Turn Path Sensor](#). The sensor should show [Not Tripped](#) when the right door is closed and [Tripped](#) when the door is open.
4. If the sensor fails the test, clean the turn path sensor using a dry lint-free cloth.
5. Check that the turn path sensor reflector is not missing, dirty, misaligned, not flat, or off-center.
 - a. If the reflector is missing, replace it.
Part number: CM752-80001
 - b. Clean the reflector with a dry lint-free cloth.
 - c. If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.

6. If the error persists, check for damaged connectors while reseating the FFC between the turn path sensor and the RRL PCA (J3).
7. If the error persists, replace the turn path sensor (REDI sensor).

Part number: A7W93-67076

15.21.Fz

Description

The rear deskew sensor detected a paper jam in the deskew area of the print path.

- **15.21.F0** Paper was detected at the rear deskew sensor in the deskew area while the printer was turning on.
- **15.21.FF** Paper was detected at the rear deskew sensor in the deskew area after the printer attempted to clear a paper jam.

Recommended action

Recommended action for customers

1. Clear the jam.
 - a. Open the right door.
 - b. Remove the right duplexer cassette.
 - c. Remove any paper or paper remnants.
 - d. Reinsert the right duplexer cassette.
 - e. Close the right door.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Clear the jam.
 - a. Open the right door.
 - b. Remove the right duplexer cassette.
 - c. Remove any paper or paper remnants.
 - d. Reinsert the right duplexer cassette.
 - e. Close the right door.
2. If the error persists, send an onsite technician to perform the following steps.
3. Using the [Component Tests](#) in the control panel, test the [Rear Deskew Sensor](#). The sensor should show [Not Tripped](#) when the right duplexer cassette is fully inserted and [Tripped](#) when the right duplexer cassette is pulled out.
4. If the sensor fails the test, clean the surface of the rear deskew sensor using a dry lint-free cloth.

5. Check that the right duplexer cassette reflector is not missing, dirty, misaligned, not flat, or off-center.
 - a. If the reflector is missing, replace it.
Part number: CM752-80001
 - b. Clean the reflector with a dry lint-free cloth.
 - c. If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.
6. If the error persists, check for damaged connectors while reseating the FFC between the rear deskew sensor and the RRL PCA (J2).
7. If the error persists, from the [Service Menu](#), run the [Calibrate Paper Path Sensors](#) routine.
 - a. If the calibration fails, check the event log. If same error code was logged, replace the rear deskew sensor (REDI sensor).
Part number: A7W93-67076
 - b. If the calibration passes, test the [Rear Deskew Sensor](#) again. If the status is [OK](#), exit service mode and print some pages to confirm the fix. If status is [Clean now](#), clean the surface of the sensor and the corresponding reflector using a dry lint-free cloth. Run the [Calibrate Paper Path Sensors](#) routine one more time to optimize sensor performance.
8. If the error persists, replace the rear deskew sensor (REDI sensor).
Part number: A7W93-67076

15.22.Fz

Description

The front deskew sensor detected a paper jam in the deskew area of the print path.

- **15.22.F0** Paper was detected at the front deskew sensor in the deskew area while the printer was turning on.
- **15.22.FF** Paper was detected at the front deskew sensor in the deskew area after the printer attempted to clear a paper jam.

Recommended action

Recommended action for customers

1. Clear the jam.
 - a. Open the right door.
 - b. Remove the right duplexer cassette.
 - c. Remove any paper or paper remnants.
 - d. Reinsert the right duplexer cassette.
 - e. Close the right door.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Clear the jam.
 - a. Open the right door.
 - b. Remove the right duplexer cassette.
 - c. Remove any paper or paper remnants.
 - d. Reinsert the right duplexer cassette.
 - e. Close the right door.
2. If the error persists, send an onsite technician to perform the following steps.
3. Using the [Component Tests](#) in the control panel, test the [Front Deskew Sensor](#). The sensor should show [Not Tripped](#) when the right duplexer cassette is fully inserted and [Tripped](#) when the right duplexer cassette is pulled out.
4. If the sensor fails the test, clean the surface of the front deskew sensor using a dry lint-free cloth.
5. Check that the right duplexer cassette reflector is not missing, dirty, misaligned, not flat, or off-center.
 - a. If the reflector is missing, replace it.
Part number: CM752-80001
 - b. Clean the reflector with a dry lint-free cloth.
 - c. If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.
6. If the error persists, check for damaged connectors while reseating the FFC between the front deskew sensor and the RRL PCA (J2).
7. If the error persists, from the [Service Menu](#), run the [Calibrate Paper Path Sensors](#) routine.
 - a. If the calibration fails, check the event log. If same error code was logged, replace the front deskew sensor (REDI sensor).
Part number: A7W93-67076
 - b. If the calibration passes, test the [Front Deskew Sensor](#) again. If the status is [OK](#), exit service mode and print some pages to confirm the fix. If status is [Clean now](#), clean the surface of the sensor and the corresponding reflector using a dry lint-free cloth. Run the [Calibrate Paper Path Sensors](#) routine one more time to optimize sensor performance.
8. If the error persists, replace the front deskew sensor (REDI sensor).
Part number: A7W93-67076

15.37.Fz

Description

The A3 accessory (middle tray) right side vertical sensor detected a paper jam in the multi-tray vertical path area of the print path.

- **15.37.F0** Paper was detected at the A3 accessory (middle tray) right side vertical sensor in the multi-tray vertical path area while the printer was turning on.
- **15.37.FF** Paper was detected at the A3 accessory (middle tray) right side vertical sensor in the multi-tray vertical path area after the printer attempted to clear a paper jam.

Recommended action

Recommended action for customers

1. Clear the jam.
 - a. Open the accessory tray right door.
 - b. Remove any paper or paper remnants.
 - c. Close the accessory tray right door.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Clear the jam.
 - a. Open the accessory tray right door.
 - b. Remove any paper or paper remnants.
 - c. Close the accessory tray right door.
2. If the error persists, send an onsite technician to perform the following steps.
3. Using the [Component Tests](#) in the control panel, test the [Middle Tray Vertical Jam Sensor](#). The sensor should show [Not Tripped](#) when the right accessory door is closed and [Tripped](#) when the door is open.
4. If the sensor fails the test, clean the surface of the middle tray vertical sensor using a dry lint-free cloth.
5. Check that the middle tray vertical sensor reflector (on the accessory right path) is not missing, dirty, misaligned, not flat, or off-center.
 - a. If the reflector is missing, replace it.
Part number: CM752-80001
 - b. Clean the reflector with a dry lint-free cloth.
 - c. If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.
6. If the error persists, check for damaged connectors while reseating the FFC between the middle tray vertical sensor and the middle tray distribution PCA (J4).
7. If the error persists, replace the middle tray vertical sensor (REDI sensor).
Part number: A7W93-67076

15.38.Fz

Description

The A3 accessory (upper tray) right side vertical sensor detected a paper jam in the multi-tray vertical path area of the print path.

- **15.38.F0** Paper was detected at the A3 accessory (upper tray) right side vertical sensor in the multi-tray vertical path area while the printer was turning on.
- **15.38.FF** Paper was detected at the A3 accessory (upper tray) right side vertical sensor in the multi-tray vertical path area after the printer attempted to clear a paper jam.

Recommended action

Recommended action for customers

1. Clear the jam.
 - a. Open the accessory tray right door.
 - b. Remove any paper or paper remnants.
 - c. Close the accessory tray right door.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Clear the jam.
 - a. Open the accessory tray right door.
 - b. Remove any paper or paper remnants.
 - c. Close the accessory tray right door.
2. If the error persists, send an onsite technician to perform the following steps.
3. Using the [Component Tests](#) in the control panel, test the [Upper Tray Vertical Jam Sensor](#). The sensor should show [Not Tripped](#) when the right accessory door is closed and [Tripped](#) when the door is open.
4. If the sensor fails the test, clean the surface of the upper tray vertical sensor using a dry lint-free cloth.
5. Check that the upper tray vertical sensor reflector (on the accessory right path) is not missing, dirty, misaligned, not flat, or off-center.
 - a. If the reflector is missing, replace it.
Part number: CM752-80001
 - b. Clean the reflector with a dry lint-free cloth.
 - c. If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.
6. If the error persists, check for damaged connectors while reseating the FFC between the upper tray vertical sensor and the upper tray distribution PCA (J4).
7. If the error persists, replace the upper tray vertical sensor (REDI sensor).

15.48.Fz

Description

The high capacity input (HCI) left tray jam sensor detected a paper jam in the hi-cap tunnel path area of the print path.

- **15.48.F0** Paper was detected at the HCI left tray jam sensor in the hi-cap tunnel path area while the printer was turning on.
- **15.48.FF** Paper was detected at the HCI left tray jam sensor in the hi-cap tunnel path area after the printer attempted to clear a paper jam.

Recommended action

Recommended action for customers

1. Clear the jam.
 - a. Open the HCI accessory right door.
 - b. Remove the cleanout module.
 - c. Remove any paper or paper remnants.
 - d. Reinsert the cleanout module.
 - e. Close the HCI accessory right door.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Clear the jam.
 - a. Open the HCI accessory right door.
 - b. Remove the cleanout module.
 - c. Remove any paper or paper remnants.
 - d. Reinsert the cleanout module.
 - e. Close the HCI accessory right door.
2. If the error persists, send an onsite technician to perform the following steps.
3. Using the [Component Tests](#) in the control panel, test the [HCI Tunnel Jam Sensor](#). The sensor should show [Not Tripped](#) when the HCI cleanout module is inserted and [Tripped](#) when the HCI cleanout module is pulled out.
4. If the sensor fails the test, clean the surface of the HCI tunnel jam sensor using a dry lint-free cloth.
5. Check that the HCI tunnel jam sensor reflector (on the accessory right path) is not missing, dirty, misaligned, not flat, or off-center.

- a. If the reflector is missing, replace it.
Part number: CM752-80001
 - b. Clean the reflector with a dry lint-free cloth.
 - c. If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.
6. If the error persists, check for damaged connectors while reseating the FFC between the HCI tunnel sensor and the tray distribution PCA (J5).
 7. If the error persists, replace the HCI tunnel jam sensor (REDI sensor).
Part number: A7W93-67076

15.A2.Fz

Description

The tray 2 multi-pick sensor detected a paper jam in the input tray area of the print path.

- **15.A2.F0** Paper was detected at the tray 2 multi-pick sensor in the input tray area while the printer was turning on.
- **15.A2.FF** Paper was detected at the tray 2 multi-pick sensor in the input tray area after the printer attempted to clear a paper jam.

Recommended action

Recommended action for customers

1. Clear the jam.
 - a. Remove tray 2.
 - b. Remove any paper or paper remnants.
 - c. Reinsert tray 2.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Clear the jam.
 - a. Remove tray 2.
 - b. Remove any paper or paper remnants.
 - c. Reinsert tray 2.
2. If the error persists, send an onsite technician to perform the following steps.
3. Using the [Component Tests](#) in the control panel, test the [Tray 2 Multi-pick Sensor](#). The sensor should show [Not Tripped](#) when no paper is blocking it and [Tripped](#) when paper is blocking it.
4. If the sensor fails the test, clean the surface of the tray 2 multi-pick sensor using a dry lint-free cloth.

5. Check that the tray 2 multi-pick sensor reflector (on the accessory right path) is not missing, dirty, misaligned, not flat, or off-center.
 - a. If the reflector is missing, replace it.
Part number: CM752-80001
 - b. Clean the reflector with a dry lint-free cloth.
 - c. If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.
6. If the error persists, check for damaged connectors while reseating the FFC between the tray 2 multi-pick sensor and the separation module PCA.
7. If the error persists, replace the tray 2 multi-pick sensor (separation module).



NOTE: The tray 2 multi-pick sensor cannot be replaced by itself; it is part of the separation module.

Part number: A7W93-67031

15.A3.D3

Description

Input jam from tray 3. The paper did not reach the tray 3 multi-pick sensor in the input tray area

.

Recommended action

Recommended action for customers

1. Follow the instructions on the control panel to remove any paper left in the printer.
2. Close all the doors. Confirm the control panel does not report any doors open then press **Ok**. Wait for the printer to resume printing.
3. If the error persists, clear the jam.
 - a. Open the left door.
 - b. Remove the left duplexer cassette.
 - c. Remove any paper or paper remnants.
 - d. Reinsert the left duplexer cassette.
 - e. Close the left door.
4. Open the source tray and that the check paper size guides are set correctly.
5. Check the paper stack for sheets with bent corners or other media damage. If needed, try a fresh ream of paper.
6. Remove tray 3 cassette and check that the tray rollers are installed correctly. Gently pull each of the three rollers to confirm they are locked in. If any roller are loose or dislodged, push it in until it clicks.
7. From the **Maintenance** menu, check the remaining life for the **Tray Roller Kit**. Replace the kit if the remaining life status is **Low**, **Very Low** or **Empty**. Reset the **Tray Roller Kit** life counter after installation..

Part number: W1B45A

8. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Follow the instructions on the control panel to remove any paper left in the printer.
2. Close all the doors. Confirm the control panel does not report any doors open then press **Ok**. Wait for the printer to resume printing.
3. Open the source tray and that the check paper size guides are set correctly.
4. Check the paper stack for sheets with bent corners or other media damage. If needed, try a fresh ream of paper.
5. Remove tray 3 cassette and check that the tray rollers are installed correctly. Gently pull each of the three rollers to confirm they are locked in. If any roller are loose or dislodged, push it in until it clicks.
6. From the **Maintenance** menu, check the remaining life for the **Tray Roller Kit**. Replace the kit if the remaining life status is **Low**, **Very Low** or **Empty**. Reset the **Tray Roller Kit** life counter after installation..

Part number: W1B45A

7. If the error persists, send an onsite technician to perform the following steps.
8. Remove tray 3 cassette and check that the pick and separation rollers are correctly installed. Remove them and check the roller surface for wear or damage. Replace as needed.

Part number: A7W93-67031

9. Check that the pick arm is installed correctly.
10. Check for a damage

d connector while reseating the cable that goes to the tray pick clutch. If damage is found, replace the pick drive clutch.

Part number: A7W93-67078

11. From the **Service Menu**, run the **Multi-Pick Sensor** test for tray 3. The sensor should show **Not Tripped** when no paper is blocking it and **Tripped** when paper is blocking it. If the sensor is not working correctly, replace the pick and separation kit.

Part number: A7W93-67031

12. From the **Service Menu**, run the **Tray Lift** test for tray 3. Confirm the control panel reports that tray 3 is not empty when paper is loaded.
13. From the **Service Menu**, run the **Separation Motor** test. Run the motor in both directions and check for unusual noise.
14. Check the drive belt in the separation motor. If the belt is broken or the drive train is damaged, replace the pick and separation kit.

Part number: A7W93-67031 Ready

15. Check for a damaged cable and connectors while reseating the cable between the tray 3 pick clutch drive and the tray 3 (tandem A4 right) separation distribution PCA (J3).

- a. If the cable is damage, replace the pick drive clutch.

Part number: A7W93-67078

- b. If the PCA connector is damaged, replace the pick and separation kit.

Part number: A7W93-67031

15.A3.Fz

Description

The tray 3 multi-pick sensor detected a paper jam in the input tray area of the print path.

- **15.A3.F0** Paper was detected at the tray 3 multi-pick sensor in the input tray area while the printer was turning on.
- **15.A3.FF** Paper was detected at the tray 3 multi-pick sensor in the input tray area after the printer attempted to clear a paper jam.

Recommended action

Recommended action for customers

1. Clear the jam.
 - a. Remove tray 3.
 - b. Remove any paper or paper remnants.
 - c. Reinsert tray 3.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Clear the jam.
 - a. Remove tray 3.
 - b. Remove any paper or paper remnants.
 - c. Reinsert tray 3
2. If the error persists, send an onsite technician to perform the following steps.
3. Using the [Component Tests](#) in the control panel, test the [Tray 3 Multi-pick Sensor](#). The sensor should show [Not Tripped](#) when no paper is blocking it and [Tripped](#) when paper is blocking it.
4. If the sensor fails the test, clean the surface of the tray 3 multi-pick sensor using a dry lint-free cloth.
5. Check that the tray 3 multi-pick sensor reflector (on the accessory right path) is not missing, dirty, misaligned, not flat, or off-center.

- a. If the reflector is missing, replace it.
Part number: CM752-80001
 - b. Clean the reflector with a dry lint-free cloth.
 - c. If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.
6. If the error persists, check for damaged connectors while reseating the FFC between the tray 3 multi-pick sensor and the separation module PCA.
 7. If the error persists, replace the tray 3 multi-pick sensor (separation module).



NOTE: The tray 3 multi-pick sensor cannot be replaced by itself; it is part of the separation module.

Part number: A7W93-67031

15.A4.Fz

Description

The A3 accessory upper tray multi-pick sensor detected a paper jam in the input tray area of the print path.

- **15.A4.F0** Paper was detected at the A3 accessory upper tray multi-pick sensor in the input tray area while the printer was turning on.
- **15.A4.FF** Paper was detected at the A3 accessory upper tray multi-pick sensor in the input tray area after the printer attempted to clear a paper jam.

Recommended action

Recommended action for customers

1. Clear the jam.
 - a. Remove the A3 accessory upper tray.
 - b. Remove any paper or paper remnants.
 - c. Reinsert the A3 accessory upper tray.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians



CAUTION: Disconnect the printer's power source before reseating any cables or connectors.

1. Clear the jam.
 - a. Remove the A3 accessory upper tray.
 - b. Remove any paper or paper remnants.
 - c. Reinsert the A3 accessory upper tray.
2. If the error persists, send an onsite technician to perform the following steps.
3. Using the [Component Tests](#) in the control panel, test the [A3 Accessory Upper Tray Multi-pick Sensor](#). The sensor should show [Not Tripped](#) when no paper is blocking it and [Tripped](#) when paper is blocking it.

4. If the sensor fails the test, clean the surface of the A3 accessory upper tray multi-pick sensor using a dry lint-free cloth.
5. Check that the A3 accessory upper tray multi-pick sensor reflector (on the accessory right path) is not missing, dirty, misaligned, not flat, or off-center.
 - a. If the reflector is missing, replace it.
Part number: CM752-80001
 - b. Clean the reflector with a dry lint-free cloth.
 - c. If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.
6. If the error persists, check for damaged connectors while reseating the FFC between the A3 accessory upper tray multi-pick sensor and the separation module PCA.
7. If the error persists, replace the A3 accessory upper tray multi-pick sensor (separation module).



NOTE: The A3 accessory upper tray multi-pick sensor cannot be replaced by itself; it is part of the separation module.

Part number: A7W93-67031

15.A5.Fz

Description

The A3 accessory middle tray multi-pick sensor detected a paper jam in the input tray area of the print path.

- **15.A5.F0** Paper was detected at the A3 accessory middle tray multi-pick sensor in the input tray area while the printer was turning on.
- **15.A5.FF** Paper was detected at the A3 accessory middle tray multi-pick sensor in the input tray area after the printer attempted to clear a paper jam.

Recommended action

Recommended action for customers

1. Clear the jam.
 - a. Remove the A3 accessory middle tray.
 - b. Remove any paper or paper remnants.
 - c. Reinsert the A3 accessory middle tray.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians



CAUTION: Disconnect the printer's power source before reseating any cables or connectors.

1. Clear the jam.

- a. Remove the A3 accessory middle tray.
 - b. Remove any paper or paper remnants.
 - c. Reinsert the A3 accessory middle tray.
2. If the error persists, send an onsite technician to perform the following steps.
3. Using the [Component Tests](#) in the control panel, test the [A3 Accessory Middle Tray Multi-pick Sensor](#). The sensor should show [Not Tripped](#) when no paper is blocking it and [Tripped](#) when paper is blocking it.
4. If the sensor fails the test, clean the surface of the A3 accessory middle tray multi-pick sensor using a dry lint-free cloth.
5. Check that the A3 accessory middle tray multi-pick sensor reflector (on the accessory right path) is not missing, dirty, misaligned, not flat, or off-center.
 - a. If the reflector is missing, replace it.
Part number: CM752-80001
 - b. Clean the reflector with a dry lint-free cloth.
 - c. If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.
6. If the error persists, check for damaged connectors while reseating the FFC between the A3 accessory middle tray multi-pick sensor and the separation module PCA.
7. If the error persists, replace the A3 accessory middle tray multi-pick sensor (separation module).



NOTE: The A3 accessory middle tray multi-pick sensor cannot be replaced by itself; it is part of the separation module.

Part number: A7W93-67031

15.A6.Fz

Description

The A3 accessory lower tray multi-pick sensor detected a paper jam in the input tray area of the print path.

- **15.A6.F0** Paper was detected at the A3 accessory lower tray multi-pick sensor in the input tray area while the printer was turning on.
- **15.A6.FF** Paper was detected at the A3 accessory lower tray multi-pick sensor in the input tray area after the printer attempted to clear a paper jam.

Recommended action

Recommended action for customers

1. Clear the jam.
 - a. Remove the A3 accessory lower tray.
 - b. Remove any paper or paper remnants.
 - c. Reinsert the A3 accessory lower tray.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Clear the jam.
 - a. Remove the A3 accessory lower tray.
 - b. Remove any paper or paper remnants.
 - c. Reinsert the A3 accessory lower tray.
2. If the error persists, send an onsite technician to perform the following steps.
3. Using the [Component Tests](#) in the control panel, test the [A3 Accessory Lower Tray Multi-pick Sensor](#). The sensor should show [Not Tripped](#) when no paper is blocking it and [Tripped](#) when paper is blocking it.
4. If the sensor fails the test, clean the surface of the A3 accessory lower tray multi-pick sensor using a dry lint-free cloth.
5. Check that the A3 accessory lower tray multi-pick sensor reflector (on the accessory right path) is not missing, dirty, misaligned, not flat, or off-center.
 - a. If the reflector is missing, replace it.
Part number: CM752-80001
 - b. Clean the reflector with a dry lint-free cloth.
 - c. If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.
6. If the error persists, check for damaged connectors while reseating the FFC between the A3 accessory lower tray multi-pick sensor and the separation module PCA.
7. If the error persists, replace the A3 accessory lower tray multi-pick sensor (separation module).

 **NOTE:** The A3 accessory lower tray multi-pick sensor cannot be replaced by itself; it is part of the separation module.

Part number: A7W93-67031

15.A7.Fz

Description

The high capacity input (HCI) left tray multi-pick sensor detected a paper jam in the input tray area of the print path.

- **15.A7.F0** Paper was detected at the HCI left tray multi-pick sensor in the input tray area while the printer was turning on.
- **15.A7.FF** Paper was detected at the HCI left tray multi-pick sensor in the input tray area after the printer attempted to clear a paper jam.

Recommended action

Recommended action for customers

1. Clear the jam.

- a. Remove the HCI left tray.
 - b. Remove any paper or paper remnants.
 - c. Reinsert the HCI left tray.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Clear the jam.
 - a. Remove the HCI left tray.
 - b. Remove any paper or paper remnants.
 - c. Reinsert the HCI left tray.
2. If the error persists, send an onsite technician to perform the following steps.
3. Using the [Component Tests](#) in the control panel, test the [HCI Left Tray Multi-pick Sensor](#). The sensor should show [Not Tripped](#) when no paper is blocking it and [Tripped](#) when paper is blocking it.
4. If the sensor fails the test, clean the surface of the HCI left tray multi-pick sensor using a dry lint-free cloth.
5. Check that the HCI left tray multi-pick sensor reflector (on the accessory right path) is not missing, dirty, misaligned, not flat, or off-center.
 - a. If the reflector is missing, replace it.
Part number: CM752-80001
 - b. Clean the reflector with a dry lint-free cloth.
 - c. If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.
6. If the error persists, check for damaged connectors while reseating the FFC between the HCI left tray multi-pick sensor and the separation module PCA.
7. If the error persists, replace the HCI left tray multi-pick sensor (separation module).

 **NOTE:** The HCI left tray multi-pick sensor cannot be replaced by itself; it is part of the separation module.

Part number: A7W93-67031

15.A8.Fz

Description

The high capacity input (HCI) right tray multi-pick sensor detected a paper jam in the input tray area of the print path.

- **15.A8.F0** Paper was detected at the HCI right tray multi-pick sensor in the input tray area while the printer was turning on.
- **15.A8.FF** Paper was detected at the HCI right tray multi-pick sensor in the input tray area after the printer attempted to clear a paper jam.

Recommended action

Recommended action for customers

1. Clear the jam.
 - a. Remove the HCI right tray.
 - b. Remove any paper or paper remnants.
 - c. Reinsert the HCI right tray.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Clear the jam.
 - a. Remove the HCI right tray.
 - b. Remove any paper or paper remnants.
 - c. Reinsert the HCI right tray.
2. If the error persists, send an onsite technician to perform the following steps.
3. Using the [Component Tests](#) in the control panel, test the [HCI Right Tray Multi-pick Sensor](#). The sensor should show [Not Tripped](#) when no paper is blocking it and [Tripped](#) when paper is blocking it.
4. If the sensor fails the test, clean the surface of the HCI right tray multi-pick sensor using a dry lint-free cloth.
5. Check that the HCI right tray multi-pick sensor reflector (on the accessory right path) is not missing, dirty, misaligned, not flat, or off-center.
 - a. If the reflector is missing, replace it.
Part number: CM752-80001
 - b. Clean the reflector with a dry lint-free cloth.
 - c. If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.
6. If the error persists, check for damaged connectors while reseating the FFC between the HCI right tray multi-pick sensor and the separation module PCA.
7. If the error persists, replace the HCI right tray multi-pick sensor (separation module).

 **NOTE:** The HCI right tray multi-pick sensor cannot be replaced by itself; it is part of the separation module.

Part number: A7W93-67031

15.A9.Fz

Description

The A3 accessory tray multi-pick sensor detected a paper jam in the input tray area of the print path.

- **15.A9.F0** Paper was detected at the A3 accessory tray multi-pick sensor in the input tray area while the printer was turning on.
- **15.A9.FF** Paper was detected at the A3 accessory tray multi-pick sensor in the input tray area after the printer attempted to clear a paper jam.

Recommended action

Recommended action for customers

1. Clear the jam.
 - a. Remove the A3 accessory tray.
 - b. Remove any paper or paper remnants.
 - c. Reinsert the A3 accessory tray.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Clear the jam.
 - a. Remove the A3 accessory tray.
 - b. Remove any paper or paper remnants.
 - c. Reinsert the A3 accessory tray.
2. If the error persists, send an onsite technician to perform the following steps.
3. Using the [Component Tests](#) in the control panel, test the [A3 Accessory Tray Multi-pick Sensor](#). The sensor should show [Not Tripped](#) when no paper is blocking it and [Tripped](#) when paper is blocking it.
4. If the sensor fails the test, clean the surface of the A3 accessory tray multi-pick sensor using a dry lint-free cloth.
5. Check that the A3 accessory tray multi-pick sensor reflector (on the accessory right path) is not missing, dirty, misaligned, not flat, or off-center.
 - a. If the reflector is missing, replace it.
Part number: CM752-80001
 - b. Clean the reflector with a dry lint-free cloth.
 - c. If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.
6. If the error persists, check for damaged connectors while reseating the FFC between the A3 accessory tray multi-pick sensor and the separation module PCA.
7. If the error persists, replace the A3 accessory tray multi-pick sensor (separation module).



NOTE: The A3 accessory tray multi-pick sensor cannot be replaced by itself; it is part of the separation module.

Part number: A7W93-67031

15.B1.Fz

Description

The top of form sensor detected a paper jam in the print zone area of the print path.

- **15.B1.F0** Paper was detected at the top of form sensor in the print zone area while the printer was turning on.
- **15.B1.FF** Paper was detected at the top of form sensor in the print zone area after the printer attempted to clear a paper jam.

Recommended action

Recommended action for customers

1. Clear the jam.
 - a. Open the right and left doors.
 - b. Remove the right and left duplexer cassettes.
 - c. Remove any paper or paper remnants.
 - d. Reinsert the right and left duplexer cassettes.
 - e. Close the right and left doors.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians



CAUTION: Disconnect the printer's power source before reseating any cables or connectors.

1. Clear the jam.
 - a. Open the right and left doors.
 - b. Remove the right and left duplexer cassettes.
 - c. Remove any paper or paper remnants.
 - d. Reinsert the right and left duplexer cassettes.
 - e. Close the right and left doors.
2. If the error persists, send an onsite technician to perform the following steps.
3. Using the [Component Tests](#) in the control panel, test the [Top Of Form Sensor](#). The sensor should show [Not Tripped](#) when the right duplexer cassette is fully inserted and [Tripped](#) when the right duplexer cassette is pulled out.
4. If the sensor fails the test, clean the surface of the top of form sensor using a dry lint-free cloth.

5. Check that the reflector on the right duplexer cassette is not missing, dirty, misaligned, not flat, or off-center.
 - a. If the reflector is missing, replace it.
Part number: CM752-80001
 - b. Clean the reflector with a dry lint-free cloth.
 - c. If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.
6. If the error persists, check for damaged connectors while reseating the FFC between the top of form sensor and the feed motor distribution PCA (J2).
7. If the error persists, from the [Service Menu](#), run the [Calibrate Paper Path Sensors](#) routine.
 - a. If the calibration fails, check the event log. If same error code was logged, replace the top of form sensor (upper paper guide assembly).
Part number: A7W93-67053
 - b. If the calibration passes, test the [Top Of Form Sensor](#) again. If the status is [OK](#), exit service mode and print some pages to confirm the fix. If status is [Clean now](#), clean the surface of the sensor and the corresponding reflector using a dry lint-free cloth. Run the [Calibrate Paper Path Sensors](#) routine one more time to optimize sensor performance.
8. If the error persists, replace the top of form sensor (upper paper guide assembly).



NOTE: The top of form sensor cannot be replaced by itself; it is part of the upper paper guide assembly.

Part number: A7W93-67053

15.B2.Fz

Description

The print zone sensor detected a paper jam in the print zone area of the print path.

- **15.B2.F0** Paper was detected at the print zone sensor in the print zone area while the printer was turning on.
- **15.B2.FF** Paper was detected at the print zone sensor in the print zone area after the printer attempted to clear a paper jam.

Recommended action

Recommended action for customers

1. Clear the jam.
 - a. Open the left door.
 - b. Remove the left duplexer cassette.
 - c. Remove any paper or paper remnants.

- d. Reinsert the left duplexer cassette.
 - e. Close the left door.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Clear the jam.
 - a. Open the left door.
 - b. Remove the left duplexer cassette.
 - c. Remove any paper or paper remnants.
 - d. Reinsert the left duplexer cassette.
 - e. Close the left door.
2. If the error persists, send an onsite technician to perform the following steps.
3. Using the [Component Tests](#) in the control panel, test the [Print Zone Sensor](#). The sensor should show [Not Tripped](#) when the left duplexer cassette is fully inserted and [Tripped](#) when the left duplexer cassette is pulled out.
4. If the sensor fails the test, clean the surface of the print zone sensor using a dry lint-free cloth.
5. Check that the reflector on the left duplexer cassette is not missing, dirty, misaligned, not flat, or off-center.
 - a. If the reflector is missing, replace it.
Part number: CM752-80001
 - b. Clean the reflector with a dry lint-free cloth.
 - c. If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.
6. If the error persists, check for damaged connectors while reseating the FFC between the print zone sensor and the airflow distribution PCA (J2).
7. If the error persists, from the [Service Menu](#), run the [Calibrate Paper Path Sensors](#) routine.
 - a. If the calibration fails, check the event log. If same error code was logged, replace the print zone sensor (airflow repair kit).



NOTE: The print zone sensor cannot be replaced by itself; it is part of the airflow repair kit.

Part number: A7W93-67027

- b. If the calibration passes, test the [Print Zone Sensor](#) again. If the status is [OK](#), exit service mode and print some pages to confirm the fix. If status is [Clean now](#), clean the surface of the sensor and the corresponding reflector using a dry lint-free cloth. Run the [Calibrate Paper Path Sensors](#) routine one more time to optimize sensor performance.
8. If the error persists, replace the print zone sensor (airflow repair kit).



NOTE: The print zone sensor cannot be replaced by itself; it is part of the airflow repair kit.

Part number: A7W93-67027

15.C1.6z

Description

The left side vertical sensor detected a paper jam in the left door area of the print path.

z = Source tray

- **15.C1.60** Unknown source tray
- **15.C1.61** Tray 1
- **15.C1.62** Tray 2
- **15.C1.63** Tray 3
- **15.C1.64** A3 Accessory upper tray
- **15.C1.65** A3 Accessory middle tray
- **15.C1.66** A3 Accessory lower tray
- **15.C1.67** HCI Left
- **15.C1.68** HCI Right
- **15.C1.69** A3 Accessory tray

Recommended action

Recommended action for customers

1. Follow the instructions on the control panel to remove any paper left in the printer.
2. Close all the doors. Confirm the control panel does not report any doors open then press **Ok**. Wait for the printer to resume printing.
3. If the error persists, clear the jam.
 - a. Open the left door.
 - b. Remove the left duplexer cassette.
 - c. Remove any paper or paper remnants.
 - d. Reinsert the left duplexer cassette.
 - e. Close the left door.
4. Open the source tray and that the check paper size guides are set correctly.
5. Check the paper stack for sheets with bent corners or other media damage. If needed, try a fresh ream of paper.
6. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Follow the instructions on the control panel to remove any paper left in the printer.
2. Close all the doors. Confirm the control panel does not report any doors open then press **Ok**. Wait for the printer to resume printing.
3. If the error persists, clear the jam.
 - a. Open the left door.
 - b. Remove the left duplexer cassette.
 - c. Remove any paper or paper remnants.
 - d. Reinsert the left duplexer cassette.
 - e. Close the left door.
4. Open the source tray and that the check paper size guides are set correctly.
5. Check the paper stack for sheets with bent corners or other media damage. If needed, try a fresh ream of paper.
6. If the error persists, send an onsite technician to perform the following steps.
7. Using a dry lint-free cloth, clean the surface of the vertical jam sensor and the reflector on the airflow assembly side.
8. From the **Service Menu**, test the **Vertical Jam Sensor**. The sensor should show **Not Tripped** when the left door is closed and **Tripped** when the door is open.
9. From the **Service Menu**, run the **Calibrate Paper Path Sensors**.
 - a. If the calibration fails, check the event log. If same error code was logged, replace the left side vertical sensor (left door assembly).



NOTE: The left side vertical sensor cannot be replaced by itself; it is part of the left door assembly.

Part number: A7W93-67027

- b. If the calibration passes, test the **Left Side Vertical Sensor** again. If the status is **Ok**, exit service mode and print some pages to confirm the fix. If status is **Clean now**, clean the surface of the sensor and the corresponding reflector using a dry lint-free cloth. Run the **Calibrate Paper Path Sensors** routine one more time to optimize sensor performance.
10. Check for damaged connectors while reseating the FFC between the vertical jam sensor and the left door distribution PCA (J8).
11. Check if the vertical jam sensor reflector is missing, misaligned, not flat or off-center.
 - a. If the reflector is missing, replace it.

Part number: CM752-80001
 - b. Clean the reflector with a dry lint-free cloth.
 - c. If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.

12. From the [Service Menu](#), run the [Duplex Entry Motor](#) test. Before running the motor, open left door then install a magnet to override the left door open sensor. Run the test and confirm the gear located on the front wall close to the front side of the duplexer module is turning. If the gear is not turning, then the entry motor belt is missing or broken. Replace the duplex entry motor assembly.

Part number: A7W93-67030

13. From the [Service Menu](#), run the [Duplex Diverter Motor](#) test. Run the motor in [Toggle Mode](#) while left door is closed. Observe the encoder counts in the simplex and duplex positions. The count difference between simplex and duplex should be 1000 +/- 200 counts. If difference is smaller, power cycle with all doors closed to initialize the duplex diverter, then test again.

14. From the [Service Menu](#), run the [Duplex Diverter Motor](#) in [Cycle Mode](#) with left door open. Confirm the diverter guide moves away from the left door and back. If movement is not consistent (same distance) check the duplex diverter drive system. Replace duplex diverter assembly if damaged.

Part Number: A7W93-67056

15. Inspect the tray 1 separation assembly for correct installation. Incorrect installation of this module will block the duplex paper path.

15.C1.Fz

Description

The left side vertical sensor detected a paper jam in the output area of the print path.

- **15.C1.F0** Paper was detected at the left side vertical sensor in the output area while the printer was turning on.
- **15.C1.FF** Paper was detected at the left side vertical sensor in the output area after the printer attempted to clear a paper jam.

Recommended action

Recommended action for customers

1. Clear the jam.
 - a. Open the left door.
 - b. Remove the left duplexer cassette.
 - c. Remove any paper or paper remnants.
 - d. Reinsert the left duplexer cassette.
 - e. Close the left door.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Clear the jam.
 - a. Open the left door.
 - b. Remove the left duplexer cassette.

- c. Remove any paper or paper remnants.
 - d. Reinsert the left duplexer cassette.
 - e. Close the left door.
2. If the error persists, send an onsite technician to perform the following steps.
 3. Using the [Component Tests](#) in the control panel, test the [Left Side Vertical Sensor](#). The sensor should show [Not Tripped](#) when the left door is open and [Tripped](#) when the left door is closed.
 4. If the sensor fails the test, clean the surface of the left side vertical sensor using a dry lint-free cloth.
 5. Check that the reflector on the left duplexer cassette is not missing, dirty, misaligned, not flat, or off-center.
 - a. If the reflector is missing, replace it.
Part number: CM752-80001
 - b. Clean the reflector with a dry lint-free cloth.
 - c. If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.
 6. If the error persists, check for damaged connectors while reseating the FFC between the left side vertical sensor and the left door distribution PCA (J8).
 7. If the error persists, from the [Service Menu](#), run the [Calibrate Paper Path Sensors](#) routine.
 - a. If the calibration fails, check the event log. If same error code was logged, replace the left side vertical sensor (left door assembly).



NOTE: The left side vertical sensor cannot be replaced by itself; it is part of the left door assembly.

Part number: A7W93-67027

- b. If the calibration passes, test the [Left Side Vertical Sensor](#) again. If the status is [OK](#), exit service mode and print some pages to confirm the fix. If status is [Clean now](#), clean the surface of the sensor and the corresponding reflector using a dry lint-free cloth. Run the [Calibrate Paper Path Sensors](#) routine one more time to optimize sensor performance.
8. If the error persists, replace the left side vertical sensor (left door assembly).



NOTE: The left side vertical sensor cannot be replaced by itself; it is part of the left door assembly.

Part number: A7W93-67027

15.D1.Fz

Description

The duplex entry sensor detected a paper jam in the duplex area of the print path.

- **15.D1.F0** Paper was detected at the duplex entry sensor in the duplex area while the printer was turning on.
- **15.D1.FF** Paper was detected at the duplex entry sensor in the duplex area after the printer attempted to clear a paper jam.

Recommended action

Recommended action for customers

1. Clear the jam.
 - a. Open the left door.
 - b. Remove the left duplexer cassette.
 - c. Remove any paper or paper remnants.
 - d. Reinsert the left duplexer cassette.
 - e. Close the left door.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Clear the jam.
 - a. Open the left door.
 - b. Remove the left duplexer cassette.
 - c. Remove any paper or paper remnants.
 - d. Reinsert the left duplexer cassette.
 - e. Close the left door.
2. If the error persists, send an onsite technician to perform the following steps.
3. Using the [Component Tests](#) in the control panel, test the [Duplex Entry Sensor](#). The sensor should show [Not Tripped](#) when the left duplexer cassette is fully inserted and [Tripped](#) when the left duplexer cassette is pulled out.
4. If the sensor fails the test, clean the surface of the duplex entry sensor using a dry lint-free cloth.
5. Check that the reflector on the left duplexer cassette is not missing, dirty, misaligned, not flat, or off-center.
 - a. If the reflector is missing, replace it.
Part number: CM752-80001
 - b. Clean the reflector with a dry lint-free cloth.
 - c. If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.
6. If the error persists, check for damaged connectors while reseating the FFC between the duplex entry sensor and the LRL PCA (J1).
7. If the error persists, replace the duplex entry sensor (REDI sensor).
Part number: A7W93-67076

15.D2.Fz

Description

The duplex exit sensor detected a paper jam in the duplex area of the print path.

- **15.D2.F0** Paper was detected at the duplex exit sensor in the duplex area while the printer was turning on.
- **15.D2.FF** Paper was detected at the duplex exit sensor in the duplex area after the printer attempted to clear a paper jam.

Recommended action

Recommended action for customers

1. Clear the jam.
 - a. Open the left door.
 - b. Remove the left duplexer cassette.
 - c. Remove any paper or paper remnants.
 - d. Reinsert the left duplexer cassette.
 - e. Close the left door.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Clear the jam.
 - a. Open the left door.
 - b. Remove the left duplexer cassette.
 - c. Remove any paper or paper remnants.
 - d. Reinsert the left duplexer cassette.
 - e. Close the left door.
2. If the error persists, send an onsite technician to perform the following steps.
3. Using the [Component Tests](#) in the control panel, test the [Duplex Exit Sensor](#). The sensor should show [Not Tripped](#) when the left duplexer cassette is fully inserted and [Tripped](#) when the left duplexer cassette is pulled out.
4. If the sensor fails the test, clean the surface of the duplex exit sensor using a dry lint-free cloth.
5. Check that the reflector on the left duplexer cassette is not missing, dirty, misaligned, not flat, or off-center.
 - a. If the reflector is missing, replace it.

Part number: CM752-80001

- b.** Clean the reflector with a dry lint-free cloth.
 - c.** If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.
- 6.** If the error persists, check for damaged connectors while reseating the FFC between the duplex exit sensor and the CRL PCA (J3).
- 7.** If the error persists, replace the duplex exit sensor (REDI sensor).

Part number: A7W93-67076

15.E1.Fz

Description

The ejection sensor detected a paper jam in the ejection area of the print path.

- **15.E1.F0** Paper was detected at the ejection sensor in the ejection area while the printer was turning on.
- **15.E12.FF** Paper was detected at the ejection sensor in the ejection area after the printer attempted to clear a paper jam.

Recommended action

Recommended action for customers

- 1.** Clear the jam.
 - a.** Open the left door.
 - b.** Remove the left duplexer cassette.
 - c.** Remove any paper or paper remnants.
 - d.** Reinsert the left duplexer cassette.
 - e.** Close the left door.
- 2.** If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

- 1.** Clear the jam.
 - a.** Open the left door.
 - b.** Remove the left duplexer cassette.
 - c.** Remove any paper or paper remnants.
 - d.** Reinsert the left duplexer cassette.
 - e.** Close the left door.
- 2.** If the error persists, send an onsite technician to perform the following steps.

3. Using the [Component Tests](#), test the [Ejection Sensor](#). The sensor should show [Not Tripped](#) when paper is not blocking the sensor and [Tripped](#) when paper blocking the sensor.
4. If the sensor fails the test, clean the surface of the ejection sensor using a dry lint-free cloth.
5. Check that the reflector on the left duplexer cassette is not missing, dirty, misaligned, not flat, or off-center.
 - a. If the reflector is missing, replace it.
Part number: CM752-80001
 - b. Clean the reflector with a dry lint-free cloth.
 - c. If the reflector is not flat or is misaligned, carefully remove and reinstall the reflector.
6. If the error persists, check for damaged connectors while reseating the FFC between the ejection sensor and the URL PCA (J4).
7. If the error persists, from the [Service Menu](#), run the [Calibrate Paper Path Sensors](#) routine.
 - a. If the calibration fails, check the event log. If same error code was logged, replace the ejection sensor (REDI sensor).
Part number: A7W93-67076
 - b. If the calibration passes, test the [Ejection Sensor](#) again. If the status is [OK](#), exit service mode and print some pages to confirm the fix. If status is [Clean now](#), clean the surface of the sensor and the corresponding reflector using a dry lint-free cloth. Run the [Calibrate Paper Path Sensors](#) routine one more time to optimize sensor performance.
8. If the error persists, replace the ejection sensor (REDI sensor).
Part number: A7W93-67076

15.F1.E0

Description

The right door was open during printing.

Recommended action

Recommended action for customers

1. Follow the instructions on the control panel to remove any paper left in the printer.
2. Close all the doors and confirm that the control panel does not report any doors open, then press [Ok](#).
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Follow the instructions on the control panel to remove any paper left in the printer.
2. Close all the doors and confirm that the control panel does not report any doors open, then press [Ok](#).
3. If the error persists, send an onsite technician to perform the following steps.

4. Inspect the right door alignment by looking at the front pin and making sure it aligns with the center of the hole in the right side of the frame.
5. Confirm the right door latch is not damaged and that it keeps the right door securely latched when door is closed. If the latch is damaged or the right door shows deformation that prevents the door from closing, replace the right door assembly.

Part number: A7W93-67024

6. From the [Service Menu](#), run the [Right Door Sensor](#) test. The sensor should show [Closed](#) when right door is closed and [Open](#) when the right door is open. If the sensor is not functioning correctly, replace the tray/door sensor.

Part number: A7W93-67040

7. On the right side vertical path guide, towards the lower front corner of the printer, check that the magnet is in its holder. Put the magnet back in its holder if needed. If the magnet cannot be found,, replace the right side vertical path.

Part number: A7W93-67062

8. Check for a damaged cable and connectors while reseating the FFC between the right door sensor and the right rear lower PCA (J1). If the cable is damaged, replace the FFC.



NOTE: The required FFC is part of the RRL FFC kit.

Part number: A7W93-67006

9. Check for a damaged cable and connectors while reseating the FFC between the in right rear lower PCA (J1) and main PCA (J5). If the cable is damaged, replace the FFC.



NOTE: The required FFC is part of the RRL FFC kit.

Part number: A7W93-67006

10. If the error persists, replace the right door assembly.

Part number: A7W93-67024

15.Fx.E0

Description

The left door was open during printing.

- **15.F2.E0** The left door sensor was activated during printing.
- **15.F3.E0** The left door safety sensor was activated during printing.

Recommended action

Recommended action for customers

1. Follow the instructions on the control panel to remove any paper left in the printer.
2. Close all the doors and confirm that the control panel does not report any doors open, then press [Ok](#).
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Follow the instructions on the control panel to remove any paper left in the printer.
2. Close all the doors and confirm that the control panel does not report any doors open, then press **Ok**.
3. If the error persists, send an onsite technician to perform the following steps.
4. Confirm the left door latch is not damaged and that it keeps the left door securely latched when door is closed. If the latch is damaged or the left door shows deformation that prevents the door from closing, replace the left door assembly.

Part number: A7W93-67033

5. From the **Service Menu**, run the **Left Door** and **Left Door Safety** sensor tests. Both sensors should show **Closed** when the left door is closed and **Open** when the left door is closed. If either of the sensors are not functioning correctly, replace the left door hall effect sensor PCA.

Part number: A7W93-67096

6. On the front side of the left door assembly, below the latch, check that the magnet is in its holder. Put the magnet back in its holder if needed. If the magnet cannot be found, replace the left door assembly.

Part number: A7W93-67033

7. Check for a damaged cable and connectors while reseating the FFC between the left door hall effect sensor PCA and the left front upper PCA (J6). If the cable is damaged, replace the FFC.

 **NOTE:** The required FFC is part of the LFU FFC kit.

Part number: A7W93-67014

8. Check for a damaged cable and connectors while reseating the FFC between the left front upper PCA (J1) and the main PCA (J22). If the cable is damaged, replace the FFC.

 **NOTE:** The required FFC is part of the LFU FFC kit.

Part number: A7W93-67014

9. If the error persists, replace the left door assembly.

Part number: A7W93-67033

17.0x.00

Description

The indicated supply cartridge memory chip has failed.

- **17.00.00** The black cartridge memory chip has failed.
- **17.01.00** The cyan cartridge memory chip has failed.
- **17.02.00** The magenta cartridge memory chip has failed.
- **17.03.00** The yellow cartridge memory chip has failed.

Recommended action**Recommended action for customers**

1. Remove, then reinstall the supply cartridge.
2. If the error persists, replace the appropriate supply cartridge.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Remove, then reinstall the supply cartridge.
2. If the error persists, replace the appropriate supply cartridge.

17.0x.29

Description

An unauthorized supply cartridge has been installed. The Administrator has set the [HP only](#) policy on the printer and the indicated cartridge is non-HP.

- **17.00.29** An unauthorized black cartridge has been installed.
- **17.01.29** An unauthorized cyan cartridge has been installed.
- **17.02.29** An unauthorized magenta cartridge has been installed.
- **17.03.29** An unauthorized yellow cartridge has been installed.

Recommended action**Recommended action for customers**

1. Disable the [HP only](#) policy or install a genuine HP supply cartridge.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

- ▲ Disable the [HP only](#) policy or install a genuine HP supply cartridge.

17.0x.35

Description

The indicated supply cartridge is not compatible with this printer.

- **17.00.35** The black cartridge is not compatible with this printer.
- **17.01.35** The cyan cartridge is not compatible with this printer.
- **17.02.35** The magenta cartridge is not compatible with this printer.
- **17.03.35** The yellow cartridge is not compatible with this printer.

Recommended action**Recommended action for customers**

1. Replace the supply cartridge with one compatible for this printer.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

- ▲ Replace the supply cartridge with one compatible for this printer.

17.0x.36

Description

The indicated supply cartridge is not a set-up cartridge. The set-up cartridges that shipped with the printer must be used during the initial setup of the printer.

- **17.00.36** The black cartridge is not a set-up cartridge.
- **17.01.36** The cyan cartridge is not a set-up cartridge.
- **17.02.36** The magenta cartridge is not a set-up cartridge.
- **17.03.36** The yellow cartridge is not a set-up cartridge.

Recommended action

Recommended action for customers

1. Install the set-up cartridges that shipped with the printer.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Install the set-up cartridges that shipped with the printer.
2. If the set-up cartridges are not available or are damaged, use the following process to override the requirement for setup cartridges:

From the control panel, while it displays the **User Setup** error message, press the following buttons in sequence: [Home](#), [Back](#), [Back](#), [Home](#) and then open the IDS door. Wait for the control panel to display **Supplies Door Open** (about 2 seconds) then close the IDS door. Normal trade supplies will now be accepted.

17.0x.37

Description

The indicated supply cartridge is a set-up supply cartridge and can't be used after the printer setup is complete.

- **17.00.37** The black cartridge is a set-up cartridge and cannot be used.
- **17.01.37** The cyan cartridge is a set-up cartridge and cannot be used.
- **17.02.37** The magenta cartridge is a set-up cartridge and cannot be used.
- **17.03.37** The yellow cartridge is a set-up cartridge and cannot be used.

Recommended action**Recommended action for customers**

1. Install non-setup cartridges.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

- ▲ Install non-setup cartridges.

17.0x.38**Description**

The capacity level of the indicated supply cartridge is temporarily unavailable. The cartridge memory chip cannot be read.

- **17.00.38** The black cartridge capacity level is temporarily unavailable.
- **17.01.38** The cyan cartridge capacity level is temporarily unavailable.
- **17.02.38** The magenta cartridge capacity level is temporarily unavailable.
- **17.03.38** The yellow cartridge capacity level is temporarily unavailable.

Recommended action**Recommended action for customers**

1. Remove, then re-install the supply cartridge.
2. If the error persists, either continue printing till print quality is no longer acceptable or replace the supply cartridge.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Remove, then re-install the supply cartridge.
2. If the error persists, either continue printing till print quality is no longer acceptable or replace the supply cartridge.

17.0x.39**Description**

Set-up cartridge override was enabled, but the installed cartridge does not have enough fluid to complete the initialization process.

- **17.00.39** The installed black cartridge does not have enough fluid to complete the initialization process.
- **17.01.39** The installed cyan cartridge does not have enough fluid to complete the initialization process.

- **17.02.39** The installed magenta cartridge does not have enough fluid to complete the initialization process.
- **17.03.39** The installed yellow cartridge does not have enough fluid to complete the initialization process.

Recommended action

Recommended action for customers

1. If the set-up cartridges are available, install them. Otherwise install a new supply cartridge so the setup process can complete.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

- ▲ If the set-up cartridges are available, install them. Otherwise install a new supply cartridge so the setup process can complete.

17.0x.42

Description

The indicated supply cartridge memory chip has failed.

- **17.00.42** The black cartridge memory chip has failed.
- **17.01.42** The cyan cartridge memory chip has failed.
- **17.02.42** The magenta cartridge memory chip has failed.
- **17.03.42** The yellow cartridge memory chip has failed.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, replace the supply cartridge.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Remove, then re-install the supply cartridge.
2. If the error persists, either continue printing till print quality is no longer acceptable or replace the supply cartridge.

17.0x.43

Description

The indicated supply cartridge is not compatible with this printer. The installed cartridge may be intended for a different region.

- **17.00.43** The black cartridge is not compatible with this printer.
- **17.01.43** The cyan cartridge is not compatible with this printer.
- **17.02.43** The magenta cartridge is not compatible with this printer.
- **17.03.43** The yellow cartridge is not compatible with this printer.

Recommended action

Recommended action for customers

1. Replace the supply cartridge with the correct cartridge for the printer and its region.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

- ▲ Replace the supply cartridge with the correct cartridge for the printer and its region.

17.0x.44

Description

The indicated supply cartridge is intended for a different region and is not compatible with this printer.

- **17.00.44** The black cartridge is intended for a different region and is not compatible with this printer.
- **17.01.44** The cyan cartridge is intended for a different region and is not compatible with this printer.
- **17.02.44** The magenta cartridge is intended for a different region and is not compatible with this printer.
- **17.03.44** The yellow cartridge is intended for a different region and is not compatible with this printer.

Recommended action

Recommended action for customers

1. Replace the supply cartridge with the correct cartridge for the printer's region.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

- ▲ Replace the supply cartridge with the correct cartridge for the printer's region.

17.0x.52

Description

The printer has detected that the indicated supply cartridge has been upgraded.

- **17.00.52** A black cartridge upgrade has been detected.
- **17.01.52** A cyan cartridge upgrade has been detected.
- **17.02.52** A magenta cartridge upgrade has been detected.
- **17.03.52** A yellow cartridge upgrade has been detected.

Recommended action**Recommended action for customers**

- ▲ No action necessary.

Recommended action for call-center agents and onsite technicians

- ▲ No action necessary.

17.0x.53

Description

The indicated supply cartridge was upgraded successfully.

- **17.00.53** The black cartridge was upgraded successfully.
- **17.01.53** The cyan cartridge was upgraded successfully.
- **17.02.53** The magenta cartridge was upgraded successfully.
- **17.03.53** The yellow cartridge was upgraded successfully.

Recommended action**Recommended action for customers**

- ▲ No action necessary.

Recommended action for call-center agents and onsite technicians

- ▲ No action necessary.

17.0x.54

Description

There was a problem upgrading the indicated supply cartridge.

- **17.00.54** The black cartridge was not successfully upgraded.
- **17.01.54** The cyan cartridge was not successfully upgraded.
- **17.02.54** The magenta cartridge was not successfully upgraded.
- **17.03.54** The yellow cartridge was not successfully upgraded.

Recommended action**Recommended action for customers**

1. Remove, then reinstall the supply cartridge.
2. If the error persists, replace the supply cartridge.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Remove, then reinstall the supply cartridge.
2. If the error persists, replace the supply cartridge.

17.0x.55

Description

There was a problem upgrading the indicated set-up supply cartridge.

- **17.00.55** The set-up black cartridge was not successfully upgraded.
- **17.01.55** The set-up cyan cartridge was not successfully upgraded.
- **17.02.55** The set-up magenta cartridge was not successfully upgraded.
- **17.03.55** The set-up yellow cartridge was not successfully upgraded.

Recommended action

Recommended action for customers

1. Remove, then reinstall the set-up supply cartridge.
2. If the error persists, replace the set-up supply cartridge.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Remove, then reinstall the set-up supply cartridge.
2. If the error persists, replace the set-up supply cartridge.

17.0x.56

Description

The indicated supply cartridge capacity level sensor has failed.

- **17.00.56** The black cartridge capacity level sensor has failed.
- **17.01.56** The cyan cartridge capacity level sensor has failed.
- **17.02.56** The magenta cartridge capacity level sensor has failed.
- **17.03.56** The yellow cartridge capacity level sensor has failed.

Recommended action

Recommended action for customers

1. Remove, then reinstall the supply cartridge.
2. If the error persists, either continue printing till print quality is no longer acceptable or replace the supply cartridge.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Remove, then reinstall the supply cartridge.
2. If the error persists, either continue printing till print quality is no longer acceptable or replace the supply cartridge.

17.0x.57

Description

The indicated supply cartridge is protected and cannot be used in this printer. The cartridge was possibly marked as protected in a different printer then moved to this printer.

- **17.00.57** The black cartridge is protected and cannot be used in this printer.
- **17.01.57** The cyan cartridge is protected and cannot be used in this printer.
- **17.02.57** The magenta cartridge is protected and cannot be used in this printer.
- **17.03.57** The yellow cartridge is protected and cannot be used in this printer.

Recommended action

Recommended action for customers

1. Install a new supply cartridge.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

- ▲ Install a new supply cartridge.

17.0x.60

Description

The indicated supply cartridge is low.

- **17.00.60** The black cartridge is low.
- **17.01.60** The cyan cartridge is low.
- **17.02.60** The magenta cartridge is low.
- **17.03.60** The yellow cartridge is low.

Recommended action

Recommended action for customers

- ▲ No action necessary.



NOTE: HP recommends that a replacement supply cartridge is available to install when the print quality is no longer acceptable.

Recommended action for call-center agents and onsite technicians

- ▲ No action necessary.



NOTE: HP recommends that a replacement supply cartridge is available to install when the print quality is no longer acceptable.

17.0x.61

Description

The indicated supply cartridge is low.

- **17.00.61** The black cartridge is low.
- **17.01.61** The cyan cartridge is low.
- **17.02.61** The magenta cartridge is low.
- **17.03.61** The yellow cartridge is low.

Recommended action

Recommended action for customers

- ▲ No action necessary.



NOTE: HP recommends that a replacement supply cartridge is available to install when the print quality is no longer acceptable.

Recommended action for call-center agents and onsite technicians

- ▲ No action necessary.



NOTE: HP recommends that a replacement supply cartridge is available to install when the print quality is no longer acceptable.

17.0x.65

Description

The indicated supply cartridge is not detected or not installed.

- **17.00.65** The black cartridge is not detected or not installed.
- **17.01.65** The cyan cartridge is not detected or not installed.
- **17.02.65** The magenta cartridge is not detected or not installed.
- **17.03.65** The yellow cartridge is not detected or not installed.

Recommended action

Recommended action for customers

1. Install a supply cartridge or remove, then reinstall the supply cartridge.
2. If the error persists, replace the supply cartridge.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Install a supply cartridge or remove, then reinstall the supply cartridge.
2. If the error persists, replace the supply cartridge.

17.0x.69

Description

The indicated supply cartridge is very low.

- **17.00.69** The black cartridge is very low.
- **17.01.69** The cyan cartridge is very low.
- **17.02.69** The magenta cartridge is very low.
- **17.03.69** The yellow cartridge is very low.

Recommended action

Recommended action for customers

- ▲ No action necessary.



NOTE: HP recommends that a replacement supply cartridge is available to install when the print quality is no longer acceptable.

Recommended action for call-center agents and onsite technicians

- ▲ No action necessary.



NOTE: HP recommends that a replacement supply cartridge is available to install when the print quality is no longer acceptable.

17.0x.70

Description

The indicated supply cartridge is printing past very low. Printing can continue but print quality may soon become unacceptable.

- **17.00.70** The black cartridge is printing past very low.
- **17.01.70** The cyan cartridge is printing past very low.
- **17.02.70** The magenta cartridge is printing past very low.
- **17.03.70** The yellow cartridge is printing past very low.

Recommended action

Recommended action for customers

- ▲ No action necessary.



NOTE: HP recommends that a replacement supply cartridge is available to install when the print quality is no longer acceptable.

Recommended action for call-center agents and onsite technicians

- ▲ No action necessary.



NOTE: HP recommends that a replacement supply cartridge is available to install when the print quality is no longer acceptable.

17.0x.80

Description

The indicated supply cartridge is empty. Printing cannot continue.

- **17.00.80** The black cartridge is empty.
- **17.01.80** The cyan cartridge is empty.
- **17.02.80** The magenta cartridge is empty.
- **17.03.80** The yellow cartridge is empty.

Recommended action

Recommended action for customers

1. Replace the supply cartridge.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

- ▲ Replace the supply cartridge.

17.0x.82

Description

The indicated supply cartridge is empty due to air gain. Printing cannot continue.

- **17.00.82** The black cartridge is empty due to air gain.
- **17.01.82** The cyan cartridge is empty due to air gain.
- **17.02.82** The magenta cartridge is empty due to air gain.
- **17.03.82** The yellow cartridge is empty due to air gain.

Recommended action

Recommended action for customers

1. Replace the supply cartridge.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

- ▲ Replace the supply cartridge.

17.0x.83

Description

The indicated supply cartridge is too low to prime. Printing cannot continue.

- **17.00.83** The black cartridge is too low to prime.
- **17.01.83** The cyan cartridge is too low to prime.
- **17.02.83** The magenta cartridge is too low to prime.
- **17.03.83** The yellow cartridge is too low to prime.

Recommended action

Recommended action for customers

1. Replace the supply cartridge.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

- ▲ Replace the supply cartridge.

17.0x.84

Description

The indicated supply cartridge is not compatible with this printer. Printing cannot continue.

- **17.00.84** The black cartridge is not compatible with this printer.
- **17.01.84** The cyan cartridge is not compatible with this printer.
- **17.02.84** The magenta cartridge is not compatible with this printer.
- **17.03.84** The yellow cartridge is not compatible with this printer.

Recommended action

Recommended action for customers

1. Replace the supply cartridge.



NOTE: A re-filled supply cartridge will cause this error if the cartridge ran empty and then the same refilled cartridge was the next cartridge to be installed. To avoid this error, install any different cartridge first before re-using the same refilled cartridge.

2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

- ▲ Replace the supply cartridge.

17.0x.85

Description

The indicated supply cartridge has been installed in too many printers. Printing cannot continue.

- **17.00.85** The black cartridge has been installed in too many printers.
- **17.01.85** The cyan cartridge has been installed in too many printers.
- **17.02.85** The magenta cartridge has been installed in too many printers.
- **17.03.85** The yellow cartridge has been installed in too many printers.

Recommended action

Recommended action for customers

1. Replace the supply cartridge.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

- ▲ Replace the supply cartridge.

17.31.58

Description

A new service fluid container kit was installed. The life counter was reset.

Recommended action

Recommended action for customers

- ▲ No action necessary.

Recommended action for call-center agents and onsite technicians

- ▲ No action necessary.

17.31.59

Description

A previously used service fluid container kit was installed. The life counter was updated accordingly.

Recommended action

Recommended action for customers

- ▲ No action necessary.

Recommended action for call-center agents and onsite technicians

- ▲ No action necessary.

17.31.yz

Description

The service fluid container is not installed, nearing capacity, or is full.

- **17.31.60** The service fluid container has low capacity.
- **17.31.63** The service fluid container has insufficient capacity for a printhead start-up.
- **17.31.64** A second printhead start-up has been attempted while the service fluid container has insufficient capacity.
- **17.31.65** The service fluid container is not installed.
- **17.31.69** The service fluid container is almost full.
- **17.31.80** The service fluid container is full.

Recommended action

Recommended action for customers

1. If the fluid service container is not installed, install it to continue printing.
2. If the service fluid container is full, replace it to continue printing.
Part number: W1B44A
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. If the fluid service container is not installed, install it to continue printing.
2. If the service fluid container is full, replace it to continue printing.
Part number: W1B44A
3. If after replacing the fluid service container, the error persists, send an onsite technician to perform the following step.
4. Check for damaged connectors while reseating the FCC between the service fluid container and the LFU PCA (J4).
5. If the error persists, replace the FCC between the service fluid container and the LFU PCA.
Part number: A7W93–67014

17.39.6z

Description

The document feeder roller kit (pick and separation rollers) life is low or very low.

- **17.39.60** The document feeder roller kit life is low.
- **17.39.69** The document feeder roller kit life is very low.

Recommended action

Recommended action for customers

1. Printing can continue until the document feeder is unable to successfully pick and feed paper.



NOTE: HP recommends that a replacement document feeder roller kit is available to install when performance is no longer acceptable.

Part number: A7W93-67083

2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

- ▲ Printing can continue until the document feeder is unable to successfully pick and feed paper.



NOTE: HP recommends that a replacement document feeder roller kit is available to install when performance is no longer acceptable.

Part number: A7W93-67083

17.41.yz

Description

The printhead wiper kit is low, very low, empty.

- **17.41.60** The printhead wiper kit is low.
- **17.41.69** The printhead wiper kit is very low.
- **17.41.80** The printhead wiper kit is empty.

Recommended action

Recommended action for customers

1. Printing can continue until the printhead wiper kit reaches empty.



NOTE: HP recommends that a replacement printhead wiper kit is available to install.

Part number: A7W93-67080

2. When the printhead wiper kit reaches empty, replace it to continue printing.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

- ▲ Printing can continue until the document feeder is unable to successfully pick and feed paper.



NOTE: HP recommends that a replacement document feeder roller kit is available to install when performance is no longer acceptable.

Part number: A7W93-67083

17.A1.6z

Description

The tray 1 roller kit life is low or very low. The printer has determined continued jamming when printing from tray 1.

- **17.A1.60** The tray 1 roller kit life is low.
- **17.A1.69** The tray 1 roller kit life is very low.

Recommended action

Recommended action for customers

1. Ensure the paper being used meets the specifications for the printer.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Ensure the paper being used meets the specifications for the printer.
2. If the error persists, send an onsite technician to perform the following step.
3. Replace the tray 1 roller kit and reset the tray 1 roller kit life counter ([Support Tools / Maintenance / Tray \[X\] Rollers](#))

Part number: A7W93-67039

17.A2.6z

Description

The tray 2 roller kit (pickup and separation rollers) life is low or very low.

- **17.A2.60** The tray 2 roller kit life is low.
- **17.A2.69** The tray 2 roller kit life is very low.

Recommended action

Recommended action for customers

1. Printing can continue unless the Administrator has configured the printer to stop printing at the very low threshold ([Support Tools / Maintenance / Tray \[X\] Rollers / Settings](#)).



NOTE: HP recommends that a replacement tray roller kit is available to install when performance is no longer acceptable.

Part number: W1B45A

2. Either configure the printer to continue printing or replace the tray 2 roller kit.
3. Reset the tray 2 roller kit life counter once the kit has been replaced ([Support Tools / Maintenance / Tray \[X\] Rollers](#)).
4. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Printing can continue unless the Administrator has configured the printer to stop printing at the very low threshold ([Support Tools / Maintenance / Tray \[X\] Rollers / Settings](#)).



NOTE: HP recommends that a replacement tray roller kit is available to install when performance is no longer acceptable.

Part number: W1B45A

2. Either configure the printer to continue printing or replace the tray 2 roller kit.
3. Reset the tray 2 roller kit life counter once the kit has been replaced ([Support Tools / Maintenance / Tray \[X\] Rollers](#)).

17.A3.6z

Description

The tray 3 roller kit (pickup and separation rollers) life is low or very low.

- **17.A3.60** The tray 2 roller kit life is low.
- **17.A3.69** The tray 2 roller kit life is very low.

Recommended action

Recommended action for customers

1. Printing can continue unless the Administrator has configured the printer to stop printing at the very low threshold ([Support Tools / Maintenance / Tray \[X\] Rollers / Settings](#)).



NOTE: HP recommends that a replacement tray roller kit is available to install when performance is no longer acceptable.

Part number: W1B45A

2. Either configure the printer to continue printing or replace the tray 3 roller kit.
3. Reset the tray 3 roller kit life counter once the kit has been replaced ([Support Tools / Maintenance / Tray \[X\] Rollers](#)).
4. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Printing can continue unless the Administrator has configured the printer to stop printing at the very low threshold ([Support Tools / Maintenance / Tray \[X\] Rollers / Settings](#)).



NOTE: HP recommends that a replacement tray roller kit is available to install when performance is no longer acceptable.

Part number: W1B45A

2. Either configure the printer to continue printing or replace the tray 3 roller kit.
3. Reset the tray 3 roller kit life counter once the kit has been replaced ([Support Tools / Maintenance / Tray \[X\] Rollers](#)).

17.A4.6z

Description

The A3 accessory upper tray roller kit (pickup and separation rollers) life is low or very low.

- **17.A4.60** The A3 accessory upper tray roller kit life is low.
- **17.A4.69** The A3 accessory upper tray roller kit life is very low.

Recommended action

Recommended action for customers

1. Printing can continue unless the Administrator has configured the printer to stop printing at the very low threshold ([Support Tools / Maintenance / Tray \[X\] Rollers / Settings](#)).



NOTE: HP recommends that a replacement tray roller kit is available to install when performance is no longer acceptable.

Part number: W1B45A

2. Either configure the printer to continue printing or replace the A3 accessory upper tray roller kit.
3. Reset the A3 accessory upper tray roller kit life counter once the kit has been replaced ([Support Tools / Maintenance / Tray \[X\] Rollers](#)).
4. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Printing can continue unless the Administrator has configured the printer to stop printing at the very low threshold ([Support Tools / Maintenance / Tray \[X\] Rollers / Settings](#)).



NOTE: HP recommends that a replacement tray roller kit is available to install when performance is no longer acceptable.

Part number: W1B45A

2. Either configure the printer to continue printing or replace the A3 accessory upper tray roller kit.
3. Reset the A3 accessory upper tray roller kit life counter once the kit has been replaced ([Support Tools / Maintenance / Tray \[X\] Rollers](#)).

17.A5.6z

Description

The A3 accessory middle tray roller kit (pickup and separation rollers) life is low or very low.

- **17.A5.60** The A3 accessory middle tray roller kit life is low.
- **17.A5.69** The A3 accessory middle tray roller kit life is very low.

Recommended action

Recommended action for customers

1. Printing can continue unless the Administrator has configured the printer to stop printing at the very low threshold ([Support Tools / Maintenance / Tray \[X\] Rollers / Settings](#)).



NOTE: HP recommends that a replacement tray roller kit is available to install when performance is no longer acceptable.

Part number: W1B45A

2. Either configure the printer to continue printing or replace the A3 accessory middle tray roller kit.
3. Reset the A3 accessory middle tray roller kit life counter once the kit has been replaced ([Support Tools / Maintenance / Tray \[X\] Rollers](#)).
4. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Printing can continue unless the Administrator has configured the printer to stop printing at the very low threshold ([Support Tools / Maintenance / Tray \[X\] Rollers / Settings](#)).



NOTE: HP recommends that a replacement tray roller kit is available to install when performance is no longer acceptable.

Part number: W1B45A

2. Either configure the printer to continue printing or replace the A3 accessory middle tray roller kit.
3. Reset the A3 accessory middle tray roller kit life counter once the kit has been replaced ([Support Tools / Maintenance / Tray \[X\] Rollers](#)).

17.A6.6z

Description

The A3 accessory lower tray roller kit (pickup and separation rollers) life is low or very low.

- **17.A6.60** The A3 accessory lower tray roller kit life is low.
- **17.A6.69** The A3 accessory lower tray roller kit life is very low.

Recommended action

Recommended action for customers

1. Printing can continue unless the Administrator has configured the printer to stop printing at the very low threshold ([Support Tools / Maintenance / Tray \[X\] Rollers / Settings](#)).



NOTE: HP recommends that a replacement tray roller kit is available to install when performance is no longer acceptable.

Part number: W1B45A

2. Either configure the printer to continue printing or replace the A3 accessory lower tray roller kit.
3. Reset the A3 accessory lower tray roller kit life counter once the kit has been replaced ([Support Tools / Maintenance / Tray \[X\] Rollers](#)).
4. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Printing can continue unless the Administrator has configured the printer to stop printing at the very low threshold ([Support Tools / Maintenance / Tray \[X\] Rollers / Settings](#)).



NOTE: HP recommends that a replacement tray roller kit is available to install when performance is no longer acceptable.

Part number: W1B45A

2. Either configure the printer to continue printing or replace the A3 accessory lower tray roller kit.
3. Reset the A3 accessory lower tray roller kit life counter once the kit has been replaced ([Support Tools / Maintenance / Tray \[X\] Rollers](#)).

17.A7.6z

Description

The high capacity input (HCI) left tray roller kit (pickup and separation rollers) life is low or very low.

- **17.A7.60** The HCI left tray roller kit life is low.
- **17.A7.69** The HCI left tray roller kit life is very low.

Recommended action

Recommended action for customers

1. Printing can continue unless the Administrator has configured the printer to stop printing at the very low threshold ([Support Tools / Maintenance / Tray \[X\] Rollers / Settings](#)).



NOTE: HP recommends that a replacement tray roller kit is available to install when performance is no longer acceptable.

Part number: W1B45A

2. Either configure the printer to continue printing or replace the HCI left tray roller kit.
3. Reset the HCI left tray roller kit life counter once the kit has been replaced ([Support Tools / Maintenance / Tray \[X\] Rollers](#)).
4. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Printing can continue unless the Administrator has configured the printer to stop printing at the very low threshold ([Support Tools / Maintenance / Tray \[X\] Rollers / Settings](#)).



NOTE: HP recommends that a replacement tray roller kit is available to install when performance is no longer acceptable.

Part number: W1B45A

2. Either configure the printer to continue printing or replace the HCI left tray roller kit.
3. Reset the HCI left tray roller kit life counter once the kit has been replaced ([Support Tools / Maintenance / Tray \[X\] Rollers](#)).

17.A8.6z

Description

The high capacity input (HCI) right tray roller kit (pickup and separation rollers) life is low or very low.

- **17.A8.60** The HCI right tray roller kit life is low.
- **17.A8.69** The HCI right tray roller kit life is very low.

Recommended action

Recommended action for customers

1. Printing can continue unless the Administrator has configured the printer to stop printing at the very low threshold ([Support Tools / Maintenance / Tray \[X\] Rollers / Settings](#)).



NOTE: HP recommends that a replacement tray roller kit is available to install when performance is no longer acceptable.

Part number: W1B45A

2. Either configure the printer to continue printing or replace the HCI right tray roller kit.
3. Reset the HCI right tray roller kit life counter once the kit has been replaced ([Support Tools / Maintenance / Tray \[X\] Rollers](#)).
4. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Printing can continue unless the Administrator has configured the printer to stop printing at the very low threshold ([Support Tools / Maintenance / Tray \[X\] Rollers / Settings](#)).



NOTE: HP recommends that a replacement tray roller kit is available to install when performance is no longer acceptable.

Part number: W1B45A

2. Either configure the printer to continue printing or replace the HCI right tray roller kit.
3. Reset the HCI right tray roller kit life counter once the kit has been replaced ([Support Tools / Maintenance / Tray \[X\] Rollers](#)).

17.A9.6z

Description

The A3 accessory single universal tray roller kit (pickup and separation rollers) life is low or very low.

- **17.A9.60** The A3 accessory single universal tray roller kit life is low.
- **17.A9.69** The A3 accessory single universal tray roller kit life is very low.

Recommended action

Recommended action for customers

1. Printing can continue unless the Administrator has configured the printer to stop printing at the very low threshold ([Support Tools / Maintenance / Tray \[X\] Rollers / Settings](#)).



NOTE: HP recommends that a replacement tray roller kit is available to install when performance is no longer acceptable.

Part number: W1B45A

2. Either configure the printer to continue printing or replace the A3 accessory single universal tray roller kit.
3. Reset the A3 accessory single universal tray roller kit life counter once the kit has been replaced ([Support Tools / Maintenance / Tray \[X\] Rollers](#)).



NOTE: Actual tray numbers listed in the control panel will depend on the installed optional trays.

4. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Printing can continue unless the Administrator has configured the printer to stop printing at the very low threshold ([Support Tools / Maintenance / Tray \[X\] Rollers / Settings](#)).



NOTE: HP recommends that a replacement tray roller kit is available to install when performance is no longer acceptable.

Part number: W1B45A

2. Either configure the printer to continue printing or replace the A3 accessory single universal tray roller kit.
3. Reset the A3 accessory single universal tray roller kit life counter once the kit has been replaced ([Support Tools / Maintenance / Tray \[X\] Rollers](#)).

30.03.08

Description

The flatbed carriage failed to find the home position.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. Attempt to copy or scan.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians



CAUTION: Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. Attempt to copy or scan.
3. If the error persists, send an onsite technician to perform the following steps.
4. From the [Service Menu](#), run the [Scanner Motor](#) test to confirm the error condition.

5. From the [Service Menu](#), go to [Scanning System](#) and check the status of the [Flatbed Scan Interface Cable](#).
6. If the status shows [Disconnected](#), check for damaged cables and connectors while reseating the FFCs between the flatbed scanner assembly and the main PCA (J17) (J14). If the cables or connectors are damaged, replace the flatbed scanner FFCs that comes with the MPCA FFC kit.

Part number: A7W93-67011

7. If the error persists after reseating or replacing the connections, replace the flatbed scanner assembly.



NOTE: Flatbed scanner assemblies for tabletop and floor standing printers have different part numbers. Order the correct part number.

Part number: A7W94-67004 (Flatbed scanner assembly for tabletop model (no control panel))

Part number: A7W95-67018 (Flatbed scanner assembly for floor model (has control panel))

30.03.14

Description

There was an error with the front side scanner EEPROM (NVM).

Recommended action

Recommended action for customers

- ▲ No action necessary.

Recommended action for call-center agents and onsite technicians

- ▲ No action necessary.

30.03.20

Description

The front side scanner was not detected.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. Attempt to copy or scan.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians



CAUTION: Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. Attempt to copy or scan.
3. If the error persists, send an onsite technician to perform the following steps.
4. From the [Service Menu](#), go to [Scanning System](#) and check the status of the [Flatbed Scan Interface Cable](#).

5. If the status shows **Disconnected**, check for damaged cables and connectors while reseating the FFCs between the flatbed scanner assembly and the main PCA (J17) (J14). If the cables or connectors are damaged, replace the flatbed scanner FFCs that comes with the MPCA FFC kit.

Part number: A7W93-67011

6. If the error persists after reseating or replacing the FFCs, replace the flatbed scanner assembly.



NOTE: Flatbed scanner assemblies for tabletop and floor standing printers have different part numbers. Order the correct part number.

Part number: A7W94-67004 (Flatbed scanner assembly for tabletop model (no control panel))

Part number: A7W95-67018 (Flatbed scanner assembly for floor model (has control panel))

30.03.22

Description

The front side illumination calibration failed.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. Attempt to copy or scan.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians



CAUTION: Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. Attempt to copy or scan.
3. If the error persists, send an onsite technician to perform the following steps.
4. From the **Service Menu**, run the **Scanner Module** test. If the test completes without an error, attempt a scan or copy job to confirm functionality.
5. If the error persists, check for damaged cables and connectors while reseating the FFCs between the flatbed scanner assembly and the main PCA (J17) (J14). If the cables or connectors are damaged, replace the flatbed scanner FFCs that comes with the MPCA FFC kit.

Part number: A7W93-67011

6. If the error persists after reseating or replacing the FFCs, replace the flatbed scanner assembly.



NOTE: Flatbed scanner assemblies for tabletop and floor standing printers have different part numbers. Order the correct part number.

Part number: A7W94-67004 (Flatbed scanner assembly for tabletop model (no control panel))

Part number: A7W95-67018 (Flatbed scanner assembly for floor model (has control panel))

30.03.30

Description

The flatbed motor has shutdown.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. Attempt to copy or scan.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. Attempt to copy or scan.
3. If the error persists, send an onsite technician to perform the following steps.
4. From the [Service Menu](#), run the [Scanner Motor](#) test to confirm the error condition.
5. From the [Service Menu](#), go to [Scanning System](#) and check the status of the [Flatbed Scan Interface Cable](#).
6. If the status shows [Disconnected](#), check for damaged cables and connectors while reseating the FFCs between the flatbed scanner assembly and the main PCA (J17) (J14). If the cables or connectors are damaged, replace the flatbed scanner FFCs that comes with the MPCA FFC kit.

Part number: A7W93-67011
7. If the error persists after reseating or replacing the FFCs, replace the flatbed scanner assembly.



NOTE: Flatbed scanner assemblies for tabletop and floor standing printers have different part numbers. Order the correct part number.

Part number: A7W94-67004 (Flatbed scanner assembly for tabletop model (no control panel))

Part number: A7W95-67018 (Flatbed scanner assembly for floor model (has control panel))

31.01.47

Description

The document feeder was not detected. The document feeder might not be connected. The flatbed glass is still available for scanning.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. Attempt to copy or scan a doubled sided original using the document feeder.



NOTE: Ensure the copy options are set to copy both sides of the original.

3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians



CAUTION: Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. Attempt to copy or scan a doubled sided original using the document feeder.



NOTE: Ensure the copy options are set to copy both sides of the original.

3. If the error persists, send an onsite technician to perform the following steps.
4. Check for damaged cables and connectors while reseating the FFCs between the document feeder and the main PCA (J6) (J7). If the cables or connectors are damaged, replace the document feeder assembly.

Part number: A7W94-67003

5. If the error persists after reseating the FFCs, replace the document feeder assembly.

Part number: A7W94-67003

31.03.14

Description

There was an error with the back side scanner EEPROM (NVM).

Recommended action

Recommended action for customers

- ▲ No action necessary.

Recommended action for call-center agents and onsite technicians

- ▲ No action necessary.

31.03.20

Description

The back side scanner was not detected.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. Attempt to copy or scan a doubled sided original using the document feeder.



NOTE: Ensure the copy options are set to copy both sides of the original.

3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians



CAUTION: Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. Attempt to copy or scan a doubled sided original using the document feeder.



NOTE: Ensure the copy options are set to copy both sides of the original.

3. If the error persists, send an onsite technician to perform the following steps.
4. Check for damaged cables and connectors while reseating the FFCs between the document feeder and the main PCA (J6) (J7). If the cables or connectors are damaged, replace the document feeder assembly.

Part number: A7W94-67003

5. If the error persists after reseating the FFCs, replace the document feeder assembly.

Part number: A7W94-67003

31.03.22

Description

The back side illumination calibration failed.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. Attempt to copy or scan a doubled sided original using the document feeder.



NOTE: Ensure the copy options are set to copy both sides of the original.

3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians



CAUTION: Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. Attempt to copy or scan a doubled sided original using the document feeder.



NOTE: Ensure the copy options are set to copy both sides of the original.

3. If the error persists, send an onsite technician to perform the following steps.

4. From the [Service Menu](#), go to [Scanning System](#) and check the status of the [ADF Scan Interface Cable](#).
5. If the status shows [Disconnected](#), check for damaged cables and connectors while reseating the FFCs between the document feeder and the main PCA (J6) (J7). If the cables or connectors are damaged, replace the document feeder assembly.

Part number: A7W94-67003

6. If the error persists after reseating the FFCs, replace the document feeder assembly.

Part number: A7W94-67003

31.03.31

Description

The document feeder motor stalled.

Recommended action

Recommended action for customers

1. Remove the paper from the document feeder paper path, reload the originals, and try again.
2. If the error persists, ensure the paper meets specifications.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Remove the paper from the document feeder paper path, reload the originals, and try again.
2. If the error persists, ensure the paper meets specifications.
3. If the error persists, send an onsite technician to perform the following steps.
4. From the [Service Menu](#), run the [Continuous ADF Pick Test](#) to confirm the error condition.
5. Check for damaged cables and connectors while reseating the FCC between the document feeder and main PCA (J6) (J7). If the cables or connectors are damaged, replace the document feeder assembly.

Part number: A7W94-67003

6. If the error persists after reseating the connections, replace the document feeder.

Part number: A7W94-67003

31.13.01

Description

A paper pick was initiated from the document feeder, but the page did not make it to the scan area.

Recommended action

Recommended action for customers

1. Remove the originals from document feeder paper path.

- ▲ Lift the document feeder and remove any originals on the platen glass.
2. Inspect the originals for staples, paper clips or attached sticky notes and remove them if found.
3. Check the paper guides and make sure that they are set to the correct paper width.
4. Do not overload the document feeder input tray.
5. Verify that the paper meets the printer specifications.
6. From the [Maintenance](#) menu, check the remaining life for the document feeder roller. Replace the document feeder roller kit if the remaining life status is [Low](#), [Very Low](#) or [Empty](#).

Part number: A7W93-67083

7. Reload the originals in to the document feeder and attempt to scan or copy again.
8. If the printer does not detect the paper in the document feeder, or the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Remove the originals from document feeder paper path.
 - ▲ Lift the document feeder and remove any originals on the platen glass.
2. Inspect the originals for staples, paper clips or attached sticky notes and remove them if found.
3. Check the paper guides and make sure that they are set to the correct paper width.
4. Do not overload the document feeder input tray.
5. Verify that the paper meets the printer specifications.
6. From the [Maintenance](#) menu, check the remaining life for the document feeder roller. Replace the document feeder roller kit if the remaining life status is [Low](#), [Very Low](#) or [Empty](#).

Part number: A7W93-67083

7. Reload the originals in to the document feeder and attempt to scan or copy again.
8. If the printer does not detect the paper in the document feeder, or the error persists, send an onsite technician to perform the following steps.
9. From the [Service Menu](#), run the [Continuous Document Feeder Pick](#) test to confirm the error condition.
10. Check for damaged cables and connectors while reseating the FCC between the document feeder and main PCA (J6) (J7). If the cables or connectors are damaged, replace the document feeder assembly.

Part number: A7W94-67003

11. If the error persists after reseating the connections, replace the document feeder.

Part number: A7W94-67003

31.13.13

Description

The document feeder hatch was detected open during a copy or scan job from the document feeder.

Recommended action

Recommended action for customers

1. Remove the originals from document feeder paper path.
 - ▲ Lift the document feeder and remove any originals on the platen glass.
2. Slowly open and close the document feeder hatch while watching the control panel. If the control panel does not correctly report when the hatch is open, contact customer support.
3. Inspect the originals for staples, paper clips or attached sticky notes and remove them if found.
4. Check the paper guides and make sure that they are set to the correct paper width.
5. Do not overload the document feeder input tray.
6. Verify that the paper meets the printer specifications.
7. Reload the originals in to the document feeder and attempt to scan or copy again.
8. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Remove the originals from document feeder paper path.
 - ▲ Lift the document feeder and remove any originals on the platen glass.
2. Slowly open and close the document feeder hatch while watching the control panel. If the control panel does not correctly report when the hatch is open, contact customer support.
3. Inspect the originals for staples, paper clips or attached sticky notes and remove them if found.
4. Check the paper guides and make sure that they are set to the correct paper width.
5. Do not overload the document feeder input tray.
6. Verify that the paper meets the printer specifications.
7. Reload the originals in to the document feeder and attempt to scan or copy again.
8. If the error persists, send an onsite technician to perform the following steps.
9. From the [Service Menu](#), run the [ADF Hatch](#) sensor test to confirm the error condition.
10. Check for damaged cables and connectors while reseating the FCCs between the document feeder and main PCA (J6) (J7). If the cables or connectors are damaged, replace the document feeder assembly.

Part number: A7W94-67003
11. If the error persists after reseating the connections, replace the document feeder.

61.2C.yB

Description

An internal communication error has occurred.

- **61.2C.1B** The left front upper PCA is disconnected.
- **61.2C.2B** The left rear lower PCA is disconnected.
- **61.2C.3B** The center rear lower PCA is disconnected.
- **61.2C.4B** The right rear lower PCA is disconnected.
- **61.2C.5B** The airflow assembly PCA is disconnected.
- **61.2C.6B** The tray 2 separation PCA FFC is disconnected
- **61.2C.8B** The feed motor encoder PCA FFC is disconnected.
- **61.2C.9B** The scanner Interface FFC is disconnected.
- **61.2C.AB** The ADF interface FFC is disconnected.
- **61.2C.BB** The 4.3" dashboard PCA FFC is disconnected.
- **61.2C.CB** The 8" dashboard PCA FFC is disconnected.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. If the error persists, send an onsite technician to perform the following steps.
3. Check for damaged connectors while reseating the indicated FCC.

Error code	Action
61.2C.1B	Check the connection between the main PCA (J22) and the left front upper PCA (J1).
61.2C.2B	Check the connection between the main PCA (J21) and the left rear lower PCA (J1).
61.2C.3B	Check the connection between the main PCA (J26) and the center rear lower PCA (J1).
61.2C.4B	Check the connection between the main PCA (J5) and the right rear lower PCA (J1).

61.2C.5B	Check the connection between the main PCA (J8) and the dryer distribution PCA (J1).
61.2C.6B	Check the connection between the main PCA (J36) and the tray 2 separation PCA (J1).
61.2C.8B	Check the connection between the main PCA (J33) and the feed motor encoder PCA (J4).
61.2C.9B	Check the connection between the main PCA (J17) and the flatbed scan interface (J1).
61.2C.AB	Check the connection between the main PCA (J7) and the ADF interface (J1).
61.2C.BB	Check the connection between the main PCA (J42) and the 4.3" dashboard PCA (J2).
61.2C.CB	Check the connection between the main PCA (J46) and the 8" dashboard PCA (J1).

4. If damaged connectors are found, or the error persists after reseating the connections, replace the indicated part.

Error code	Part description	Part number
61.2C.1B	Left front upper PCA	A7W93-67019
61.2C.2B	LRL FFC kit	A7W93-67009
61.2C.3B	CRL FFC kit	A7W93-67005
61.2C.4B	RRL FFC kit	A7W93-67006
61.2C.5B	MPCA FFC kit	A7W93-67011
61.2C.6B	Singulation FFC kit	A7W93-67015
61.2C.8B	Feed motor FFC kit	A7W93-67007
61.2C.9B	MPCA FFC kit	A7W93-67011
61.2C.AB	MPCA FFC kit	A7W93-67011
61.2C.BB	MPCA FFC kit	A7W93-67011
61.2C.CB	MPCA FFC kit	A7W93-67011

61.51.21

Description

The printer has been exposed to an ambient temperature below –4 degrees Celsius (24.8 degrees Fahrenheit).

Recommended action

Recommended action for customers

1. Turn the printer off, and wait a few hours until it comes to room temperature before use.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and wait a few hours until it comes to room temperature before use.
2. If the error persists, send an onsite technician to perform the following steps.
3. From the [Service Menu](#), run the [Pick](#) motor test for tray 1.
 - a. Check the [Ambient Temperature](#) reading.
 - b. If it is showing a negative number, check the connectors for damage while reseating the FCC between the temperature/humidity PCA and the RRL PCA (J2).
4. If damaged connectors are found, or the error persists after reseating the connections, replace the temperature/humidity PCA.

Part number: A7W93-67070

61.A1.F1

Description

The tray 1 lower separation roller is not installed correctly.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. Send another print job from tray 1.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. Send another print job from tray 1.
3. If the error persists, send an onsite technician to perform the following steps.
4. Remove the lower pick roller. Make sure the pin mounted in the lower separation shaft is inserted in the clutch groove.
5. Install the lower pick roller and make sure the one-way clutch did not move out of the pin while installing the roller.
6. Attempt to manually rotate the roller in both directions. If the roller is installed correctly, it will only rotate in one direction.
7. From the [Service Menu](#), run the [Pick Motor](#) test for tray 1. Run the motor test in both directions. If no error is reported, print from tray 1 to confirm functionality.
8. If the error persists, replace all the parts that come with the tray 1 roller kit.



NOTE: This kit contains a new one-way clutch.

Part number: A7W93-67039

9. If the error persists, replace the tray 1 assembly.

Part number: A7W93-67057

61.A2.DB

Description

The tray 2 pick clutch has become disconnected.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. If the error persists, send an onsite technician to perform the following steps.
3. Check for a damaged cable and connectors while reseating the cable between the tray 2 pick clutch and the tray 2 (tandent A4 left) separation distribution PCA (J3).
4. If the cable is damaged replace the pick drive clutch.

Part number: A7W93-67078

5. If the connector is damaged, replace the pick and separation kit.

Part number: A7W93-670318

61.Ax.2A

Description

The indicated tray is overfilled.

x = Tray

- **61.A2.2A** Tray 2 is overfilled.
- **61.A3.2A** Tray 3 is overfilled.
- **61.A4.2A** The A3 accessory upper tray is overfilled.
- **61.A5.2A** The A3 accessory middle tray is overfilled.
- **61.A6.2A** The A3 accessory lower tray is overfilled.
- **61.A7.2A** The HCI left tray is overfilled.

- **61.A8.2A** The HCI right tray is overfilled.
- **61.A9.2A** The A3 accessory tray is overfilled

Recommended action

Recommended action for customers

1. Open the tray and verify that the paper stack is below the maximum limit as indicated by the mark on the cassette tray. Remove sheets of paper if needed, then close the tray.
2. If the error persists, remove the cassette tray completely and inspect inside the printer for any jammed sheets of paper or paper remnants. Remove any paper found before re-installing the cassette tray.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Open the tray and verify that the paper stack is below the maximum limit as indicated by the mark on the cassette tray. Remove sheets of paper if needed, then close the tray.
2. If the error persists, remove the cassette tray completely and inspect inside the printer for any jammed sheets of paper or paper remnants. Remove any paper found before re-installing the cassette tray.
3. If the error persists, send an onsite technician to perform the following steps.
4. Remove the cassette tray completely and inspect inside the printer for any jammed sheets of paper or paper remnants. Remove any paper found and keep the tray removed for the next step.
5. From the [Service Menu](#), run the [Lift Plate Up](#) sensor test for the indicated tray. The sensor should show [Down](#) when tray cassette is removed.
6. If the sensor shows [Up](#), manually toggle the lift plate up sensor and check that the control panel displays the corresponding position.



NOTE: There are two plastic sensor actuators. The actuator for the lift plate up sensor is closest to the rear of the printer and is the smaller of the two.

7. If the sensor is not functioning correctly, replace the pick and separation kit.

Part number: A7W93-67031

61.Ax.39

Description

The tray empty sensor for the indicated tray has malfunctioned. The paper presence sensor stayed tripped even after the tray was opened.

x = Tray

- **61.A2.39** The tray 2 empty sensor malfunctioned.
- **61.A3.39** The tray 3 empty sensor malfunctioned.
- **61.A4.39** The A3 accessory upper tray empty sensor malfunctioned.
- **61.A5.39** The A3 accessory middle tray empty sensor malfunctioned.

- **61.A6.39** The A3 accessory lower tray empty sensor malfunctioned.
- **61.A7.39** The HCI left tray empty sensor malfunctioned.
- **61.A8.39** The HCI right tray empty sensor malfunctioned.
- **61.A9.39** The A3 accessory tray empty sensor malfunctioned

Recommended action

Recommended action for customers

1. Open the tray and verify that the paper stack is below the maximum limit as indicated by the mark on the cassette tray. Remove sheets of paper if needed, then close the tray.
2. If the error persists, remove the cassette tray completely and inspect inside the printer for any jammed sheets of paper or paper remnants. Remove any paper found before re-installing the cassette tray.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Open the tray and verify that the paper stack is below the maximum limit as indicated by the mark on the cassette tray. Remove sheets of paper if needed, then close the tray.
2. If the error persists, remove the cassette tray completely and inspect inside the printer for any jammed sheets of paper or paper remnants. Remove any paper found before re-installing the cassette tray.
3. If the error persists, send an onsite technician to perform the following steps.
4. Remove the cassette tray completely and inspect inside the printer for any jammed sheets of paper or paper remnants. Remove any paper found and keep the tray removed for the next step.
5. From the [Service Menu](#), run the [Tray Empty](#) sensor test for the indicated tray. The sensor should show [Empty](#) when tray cassette is removed.
6. If the sensor shows [Not Empty](#), manually toggle the tray empty sensor flag and check that the control panel displays the corresponding position.



NOTE: There are two plastic sensor actuators. The actuator for the tray empty sensor is closest to the front of the printer and the larger of the two.

7. If the sensor is not functioning correctly, replace the pick and separation kit.

Part number: A7W93-67031

61.Ax.5D

Description

The reported paper size for the indicated tray is out of range. The paper size sensor is not connected or is defective.

- **61.A2.5D** The reported paper size for tray 2 is out of range.
- **61.A3.5D** The reported paper size for tray 3 is out of range.

Recommended action

Recommended action for customers

1. Open the indicated tray and confirm the paper size guides are set correctly.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Open the indicated tray and confirm the paper size guides are set correctly.
2. If the error persists, send an onsite technician to perform the following steps.
3. Check for a damaged cable and connectors while reseating the cable between the applicable detection sensor and the separation distribution PCA (J5).
4. If the cable is damaged replace the paper size sensor FFC that comes in the singulation FCC kit.
Part number: A7W93-67015
5. Remove the cassette tray and inspect the paper guides for damage. Check the size detect sensor barrel actuator rotates as the paper width guides moves to different positions. If the guides are broken or the barrel is missing or damaged, replace the A4 tray cassette.
Part number: A7W93-670068
6. If the error persists, replace the tray size detect sensor.
Part number: A7W93-67023

61.Ax.y1

Description

An internal motor error has occurred. A jam or obstruction can cause these errors.

x= Input tray

y= Motor type (Pick, Separation, or Lift)

- **61.A1.B1** The tray 1 separation motor stalled.
- **61.A1.D1** The tray 1 pick motor stalled.
- **61.A2.A1** The tray 2 lift motor stalled. The lift plate may be jammed.
- **61.A2.B1** The tray 2 separation motor stalled.
- **61.A3.A1** The tray 3 lift motor stalled. The lift plate may be jammed.
- **61.A3.B1** The tray 3 separation motor stalled
- **61.A4.A1** The A3 accessory upper tray lift motor stalled. The lift plate may be jammed.
- **61.A4.B1** The A3 accessory upper tray separation motor stalled.
- **61.A5.A1** The A3 accessory middle tray lift motor stalled. The lift plate may be jammed.

- **61.A5.B1** The A3 accessory middle tray separation motor stalled.
- **61.A6.A1** The A3 accessory lower tray lift motor stalled. The lift plate may be jammed.
- **61.A6.B1** The A3 accessory lower tray separation motor stalled.
- **61.A7.A1** The HCI left tray lift motor stalled. The lift plate may be jammed.
- **61.A7.B1** The HCI left tray separation motor stalled.
- **61.A8.A1** The HCI right tray lift motor stalled. The lift plate may be jammed.
- **61.A8.B1** The HCI right tray separation motor stalled.
- **61.A9.A1** The A3 accessory tray lift motor stalled. The lift plate may be jammed.
- **61.A9.B1** The A3 accessory tray separation motor stalled.

Recommended action

Recommended action for customers

1. Clear any paper or obstructions from the paper path and then press **OK**.
2. Make sure that paper loaded in the indicated tray is supported.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear any paper or obstructions from paper path and then press **OK**.
2. Make sure that paper loaded in the indicated tray is supported.
3. **When y=A (lift motor stalled):**
 - a. Open the indicated tray and check if the shipping card box is still in place. Remove it if necessary.
 - b. Remove all the paper from the tray and pull the tray completely out. Check that the lift plate can be raised manually without obstruction.
4. **When y=B (separation motor stalled):**
 - a. For the indicated tray, check that the pick arm is installed correctly. Reinstall it if necessary.
 - b. For the indicated tray, check the pick and separation rollers for wear and/or damage. If necessary, replace the tray roller kit.

Part number: W1B45A

5. If the error persists, send an onsite technician to perform the following steps.
6. From the Service Menu, run the indicated motor test forwards and backwards (if applicable) for the indicated input tray. If the error persists, replace the indicated motor assembly.

Error code	Service Menu motor test name (for input tray)	Part description	Part number
61.A1.B1	Separation (tray 1)	Tray 1 assembly	A7W93-67057
61.A1.D1	Pick (tray 1)	Tray 1 assembly	A7W93-67057

61.A2.A1	Lift (tray 2)	Tray lift assembly	A7W93-67022
61.A2.B1	Separation (tray 2)	Pick and separation kit	A7W93-67031
61.A3.A1	Lift (tray 3)	Tray lift assembly	A7W93-67022
61.A3.B1	Separation (tray 3)	Pick and separation kit	A7W93-67031
61.A4.A1	Lift (tray 4)	Tray lift assembly	A7W93-67022
61.A4.B1	Separation (If the printer has an A3 universal tray, go to tray 3 motors, if the printer has two A4 tandem trays, then go to tray 4 motors.)	Pick and separation kit	A7W93-67031
61.A5.A1	Lift (If the printer has an A3 universal tray, go to tray 4, if the printer has two A4 tandem trays, then go to tray 5.)	Tray lift assembly	A7W93-67022
61.A5.B1	Separation (If the printer has an A3 universal tray, go to tray 4 motors, if the printer has two A4 tandem trays, then go to tray 5 motors.)	Pick and separation kit	A7W93-67031
61.A6.A1	Lift (If the printer has an A3 universal tray, go to tray 5, if the printer has two A4 tandem trays, then go to tray 6.)	Tray lift assembly	A7W93-67022
61.A6.B1	Separation (If the printer has an A3 universal tray, go to tray 5 motors, if printer the has two A4 tandem trays, then go to tray 6 motors.)	Pick and separation kit	A7W93-67031
61.A7.A1	Lift (If the printer has an A3 universal tray, go to tray 3, if the printer has two A4 tandem trays, then go to tray 4.)	HCI tray lift assembly	A7W97-67006
61.A7.B1	Separation (**CHECK** If the printer has an A3 universal tray, go to tray 3 motors, if the printer has two A4 tandem trays, then go to tray 4 motors.)	Pick and separation kit	A7W93-67031
61.A8.A1	Lift (If the printer has an A3 universal tray, go to tray 4, if the printer has two A4 tandem trays, then go to tray 5.)	HCI tray lift assembly	A7W97-67006
61.A8.B1	Separation (If the printer has an A3 universal tray, go to tray 4 motors, if the printer has two A4 tandem trays, then go to tray 5 motors.)	Pick and separation kit	A7W93-67031

61.A9.A1	Lift (If the printer configuration has an A3 universal tray, go to tray 3 motors, if the printer has two A4 tandem trays, then go to tray 4 motors.)	Tray lift assembly	A7W93-67022
61.A9.B1	Separation (If the printer has an A3 universal tray, go to tray 3 motors, if the printer has two A4 tandem trays, then go to tray 4 motors.)	Pick and separation kit	A7W93-67031

61.Ax.y2

Description

An internal motor error has occurred.

x = Input tray

y = Motor type (Pick, Separation, or Lift)

- **61.A1.B2** The tray 1 separation motor stalled.
- **61.A1.D2** The tray 1 pick motor stalled.
- **61.A2.A2** The tray 2 lift motor stalled.
- **61.A2.B2** The tray 2 separation motor stalled.
- **61.A3.A2** The tray 3 lift motor stalled.
- **61.A3.B2** The tray 3 separation motor stalled
- **61.A4.A2** The A3 accessory upper tray lift motor stalled.
- **61.A4.B2** The A3 accessory upper tray separation motor stalled.
- **61.A5.A2** The A3 accessory middle tray lift motor stalled.
- **61.A5.B2** The A3 accessory middle tray separation motor stalled.
- **61.A6.A2** The A3 accessory lower tray lift motor stalled.
- **61.A6.B2** The A3 accessory lower tray separation motor stalled.
- **61.A7.A2** The HCI left tray lift motor stalled.
- **61.A7.B2** The HCI left tray separation motor stalled.
- **61.A8.A2** The HCI right tray lift motor stalled.
- **61.A8.B2** The HCI right tray separation motor stalled.
- **61.A9.A2** The A3 accessory tray lift motor stalled.
- **61.A9.B2** The A3 accessory tray separation motor stalled.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. If the error persists, send an onsite technician to perform the following steps.
3. From the Service Menu, run the appropriate motor test ([Pick](#), [Separation](#) or [Lift](#)) forwards and backwards (if applicable) for the indicated input tray to confirm the error condition.
4. Check for damaged connectors while reseating the indicated FCC.

Error code	Action
61.A1.B2	Check the connection between the tray 1 separation motor and the left door distribution PCA (J2).
61.A1.D2	Check the connection between the tray 1 pick motor and the left door distribution PCA (J5).
61.A2.A2	Check the connection between the tray 2 lift motor and the separation distribution PCA (J6).
61.A2.B2	Check the connection between the tray 2 separation motor and the separation distribution PCA (J4).
61.A3.A2	Check the connection between the tray 3 lift motor and the separation distribution PCA (J6).
61.A3.B2	Check the connection between the tray 3 separation motor and the separation distribution PCA (J4).
61.A4.A2	Check the connection between the A3 accessory upper tray lift motor and the separation distribution PCA (J6).
61.A4.B2	Check the connection between the A3 accessory upper tray separation motor and the separation distribution PCA (J4).
61.A5.A2	Check the connection between the A3 accessory middle tray lift motor and the separation distribution PCA (J6).
61.A5.B2	Check the connection between the A3 accessory middle tray separation motor and the separation distribution PCA (J4).
61.A6.A2	Check the connection between the A3 accessory lower tray lift motor and the separation distribution PCA (J6).
61.A6.B2	Check the connection between the A3 accessory lower tray separation motor and the separation distribution PCA (J4).
61.A7.A2	Check the connection between the HCI left tray lift motor and the separation distribution PCA (J6).
61.A7.B2	Check the connection between the HCI left tray separation motor and the separation distribution PCA (J4).

61.A8.A2	Check the connection between the HCI right tray lift motor and the separation distribution PCA (J6).
61.A8.B2	Check the connection between the HCI right tray separation motor and the separation distribution PCA (J4).
61.A9.A2	Check the connection between the A3 accessory tray lift motor and the separation distribution PCA (J6).
61.A9.B2	Check the connection between the A3 accessory tray separation motor and the separation distribution PCA (J4).

5. If damaged connectors are found, or the error persists after reseating the connections, replace the indicated motor assembly.

Error code	Part description	Part number
61.A1.B2	Tray 1 assembly	A7W93-67057
61.A1.D2	Tray 1 assembly	A7W93-67057
61.A2.A2	Tray lift assembly	A7W93-67022
61.A2.B2	Pick and separation kit	A7W93-67031
61.A3.A2	Tray lift assembly	A7W93-67022
61.A3.B2	Pick and separation kit	A7W93-67031
61.A4.A2	Tray lift assembly	A7W93-67022
61.A4.B2	Pick and separation kit	A7W93-67031
61.A5.A2	Tray lift assembly	A7W93-67022
61.A5.B2	Pick and separation kit	A7W93-67031
61.A6.A2	Tray lift assembly	A7W93-67022
61.A6.B2	Pick and separation kit	A7W93-67031
61.A7.A2	Tray lift assembly	A7W93-67022
61.A7.B2	Pick and separation kit	A7W93-67031
61.A8.A2	Tray lift assembly	A7W93-67022
61.A8.B2	Pick and separation kit	A7W93-67031
61.A9.A2	Tray lift assembly	A7W93-67022
61.A9.B2	Pick and separation kit	A7W93-67031

6. From the Service Menu, run the appropriate motor test ([Pick](#), [Separation](#) or [Lift](#)) forwards and backwards (if applicable) for the indicated input tray to confirm functionality.
7. For the following errors, if the error persists, replace the indicated part.

Error code	Part description	Part number
61.A9.B2	Tray PCA	A7X02-67005

61.Ax.yE

Description

A higher than normal current drawn from the motor controller on the main PCA caused the indicated motor to stall.

x = Input tray

y = Motor type (Pick, Separation, or Lift)

- **61.A1.BE** The tray 1 separation motor stalled.
- **61.A1.DE** The tray 1 pick motor stalled.
- **61.A2.AE** The tray 2 lift motor stalled.
- **61.A2.BE** The tray 2 separation motor stalled.
- **61.A3.AE** The tray 3 lift motor stalled.
- **61.A3.BE** The tray 3 separation motor stalled.
- **61.A4.AE** The A3 accessory upper tray lift motor stalled.
- **61.A4.BE** The A3 accessory upper tray separation motor stalled.
- **61.A5.AE** The A3 accessory middle tray lift motor stalled.
- **61.A5.BE** The A3 accessory middle tray separation motor stalled.
- **61.A6.AE** The A3 accessory lower tray lift motor stalled.
- **61.A6.BE** The A3 accessory lower tray separation motor stalled.
- **61.A7.AE** The HCI left tray lift motor stalled.
- **61.A7.BE** The HCI left tray separation motor stalled.
- **61.A8.AE** The HCI right tray lift motor stalled.
- **61.A8.BE** The HCI right tray separation motor stalled.
- **61.A9.AE** The A3 accessory tray lift motor stalled.
- **61.A9.BE** The A3 accessory tray separation motor stalled.

Recommended action

Recommended action for customers

1. Clear any paper or obstructions from the paper path and then press [Ok](#).
2. Make sure that paper loaded in the indicated tray is supported.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear any paper or obstructions from paper path and then press [Ok](#).
2. Make sure that paper loaded in the indicated tray is supported.

3. When y=A (lift motor stalled):

- a. Open the indicated tray and check if the shipping card box is still in place. Remove it if necessary.
- b. Remove all the paper from the tray and pull the tray completely out. Check that the lift plate can be raised manually without obstruction.

4. When y=B (separation motor stalled):

- a. For the indicated tray, check that the pick arm is installed correctly. Reinstall it if necessary.
- b. For the indicated tray, check the pick and separation rollers for wear and/or damage. If necessary, replace the tray roller kit.

Part number: W1B45A

5. If the error persists, send an onsite technician to perform the following steps.

6. From the Service Menu, run the indicated motor test forwards and backwards (if applicable) for the indicated input tray. If the error persists, replace the indicated motor assembly.

Error code	Service Menu motor test name (for input tray)	Part description	Part number
61.A1.BE	Separation (tray 1)	Tray 1 assembly	A7W93-67057
61.A1.DE	Pick (tray 1)	Tray 1 assembly	A7W93-67057
61.A2.AE	Lift (tray 2)	Tray lift assembly	A7W93-67022
61.A2.BE	Separation (tray 2)	Pick and separation kit	A7W93-67031
61.A3.AE	Lift (tray 3)	Tray lift assembly	A7W93-67022
61.A3.BE	Separation (tray 3)	Pick and separation kit	A7W93-67031
61.A4.AE	Lift (tray 4)	Tray lift assembly	A7W93-67022
61.A4.BE	Separation (If the printer has an A3 universal tray, go to tray 3 motors, if the printer has two A4 tandem trays, then go to tray 4 motors.)	Pick and separation kit	A7W93-67031
61.A5.AE	Lift (If the printer has an A3 universal tray, go to tray 4, if the printer has two A4 tandem trays, then go to tray 5.)	Tray lift assembly	A7W93-67022
61.A5.BE	Separation (If the printer has an A3 universal tray, go to tray 4 motors, if the printer has two A4 tandem trays, then go to tray 5 motors.)	Pick and separation kit	A7W93-67031
61.A6.AE	Lift (If the printer has an A3 universal tray, go to tray 5, if the printer has two A4 tandem trays, then go to tray 6.)	Tray lift assembly	A7W93-67022

61.A6.BE	Separation (If the printer has an A3 universal tray, go to tray 5 motors, if printer the has two A4 tandem trays, then go to tray 6 motors.)	Pick and separation kit	A7W93-67031
61.A7.AE	Lift (If the printer has an A3 universal tray, go to tray 3, if the printer has two A4 tandem trays, then go to tray 4.)	HCI tray lift assembly	A7W97-67006
61.A7.BE	Separation (If the printer has an A3 universal tray, go to tray 3 motors, if the printer has two A4 tandem trays, then go to tray 4 motors.)	Pick and separation kit	A7W93-67031
61.A8.AE	Lift (If the printer has an A3 universal tray, go to tray 4, if the printer has two A4 tandem trays, then go to tray 5.)	HCI tray lift assembly	A7W97-67006
61.A8.BE	Separation (If the printer has an A3 universal tray, go to tray 4 motors, if the printer has two A4 tandem trays, then go to tray 5 motors.)	Pick and separation kit	A7W93-67031
61.A9.AE	Lift (If the printer configuration has an A3 universal tray, go to tray 3 motors, if the printer has two A4 tandem trays, then go to tray 4 motors.)	Tray lift assembly	A7W93-67022
61.A9.BE	Separation (If the printer has an A3 universal tray, go to tray 3 motors, if the printer has two A4 tandem trays, then go to tray 4 motors.)	Pick and separation kit	A7W93-67031

61.Bx.y1

Description

An internal motor error has occurred. A jam or obstruction can cause these errors.

- **61.B2.31** The deskew rear motor stalled.
- **61.B2.41** The deskew front motor stalled.
- **61.B3.41** The feed motor stalled.
- **61.B4.21** The left side vertical motor stalled.
- **61.B5.11** The duplex diverter motor stalled.
- **61.B6.21** The duplex entry motor stalled.
- **61.B7.31** The duplex exit motor stalled.

- **61.B8.21** The ejection motor stalled.
- **61.B9.21** The stack control motor stalled.

Recommended action

Recommended action for customers

1. Clear any paper or obstructions from the paper path and then press **OK**.
2. Make sure that paper loaded in the indicated tray is supported.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear any paper or obstructions from the paper path and then press **OK**.
2. Make sure that paper loaded in the indicated tray is supported.
3. If the error persists, send an onsite technician to perform the following steps.
4. From the **Service Menu**, run the indicated motor test forwards and backwards (if applicable). If the error persists, replace the indicated motor assembly.

Error code	Service Menu motor test name	Part description	Part number
61.B2.31	Deskew Rear	Deskew rear drive assembly	A7W93-67051
61.B2.41	Deskew Front	Deskew front drive assembly	A7W93-67050
61.B3.41	Feed	Feed motor kit	A7W93-67071
61.B4.21	Vertical	Left side vertical drive assembly	A7W93-67055
61.B5.11	Duplex Diverter (run in Cycle Mode)	Duplex diverter assembly	A7W93-67056
61.B6.21	Duplex Entry	Duplex entry drive assembly	A7W93-67030
61.B7.31	Duplex Exit	Duplex exit drive assembly	A7W93-67038
61.B8.21	Ejection	Ejection drive assembly	A7W93-67054
61.B9.21	Stack Control (run in Cycle Mode)	Ejection flap drive assembly	A7W93-67049

5. For the following errors, if the error persists, replace the indicated part.

NOTICE: DO NOT send these parts for the onsite technician's first visit. Only send these parts if the initial visit and repairs did not resolve the issue.

Error code	Part description	Part number
61.B2.41	Deskew gear module assembly	A7W93-60418
61.B3.41	Feed shaft	A7W93-67035
61.B4.21	Left door assembly	A7W93-67033

61.B5.11	Left door assembly	A7W93-67033
61.B9.21	Standard bin	A7W93-67048

- If the error persists after all the applicable listed parts have been replaced, check for physical damage on the connecting assemblies that may prevent the motor from turning (shaft, belt, gears, bearings, etc.). Replace the damaged part(s) if available, otherwise escalate the issue using the Standard Support Process.

61.Bx.y2

Description

An internal motor error has occurred.

- **61.B2.32** The deskew rear motor stalled.
- **61.B2.42** The deskew front motor stalled.
- **61.B3.42** The feed motor stalled.
- **61.B4.22** The left side vertical motor stalled.
- **61.B5.12** The duplex diverter motor stalled.
- **61.B6.22** The duplex entry motor stalled.
- **61.B7.32** The duplex exit motor stalled.
- **61.B8.22** The ejection motor stalled.
- **61.B9.22** The stack control motor stalled.

Recommended action

Recommended action for customers

- Turn the printer off, and then on.
- If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

- Turn the printer off, and then on.
- If the error persists, send an onsite technician to perform the following steps.
- From the [Service Menu](#), run the appropriate motor test forwards and backwards (if applicable) to confirm the error condition.
- Check for damaged connectors while reseating the indicated FCC.

Error code	Service Menu motor test name	Action
61.B2.32	Deskew Rear	Check the connection between the deskew rear motor and the main PCA (J23).

61.B2.42	Deskew Front	Check the connection between the deskew front motor and the feed motor encoder PCA (J1).
61.B3.42	Feed	Check the connection between the feed motor and the feed motor encoder PCA (J3).
61.B4.22	Vertical	Check the connection between the left side vertical motor and left door distribution PCA (J6).
61.B5.12	Duplex Diverter (run in Cycle Mode)	Check the connection between the duplex diverter motor and left door distribution PCA (J7).
61.B6.22	Duplex Entry	Check the connection between the duplex entry motor and the left rear lower PCA (J2).
61.B7.32	Duplex Exit	Check the connection between the duplex exit motor and the main PCA (J48).
61.B8.22	Ejection	Check the connection between the ejection motor and the left rear upper PCA (J5).
61.B9.22	Stack Control (run in Cycle Mode)	Check the connection between the stack control motor and the main PCA (J30).

5. If damaged connectors are found, or the error persists after reseating the connections, replace the indicated motor assembly.

Error code	Part description	Part number
61.B2.32	Deskew rear drive assembly	A7W93-67051
61.B2.42	Deskew front drive assembly	A7W93-67050
61.B3.42	Feed motor kit	A7W93-67071
61.B4.22	Left side vertical drive assembly	A7W93-67055
61.B5.12	Duplex diverter assembly	A7W93-67056
61.B6.22	Duplex entry drive assembly	A7W93-67030
61.B7.32	Duplex exit drive assembly	A7W93-67038
61.B8.22	Ejection drive assembly	A7W93-67054
61.B9.22	Ejection flap drive assembly	A7W93-67049

6. From the [Service Menu](#), run the appropriate motor test forwards and backwards (if applicable) to confirm functionality.

61.Bx.yE

Description

A higher than normal current drawn from the motor controller on the main PCA has caused the indicated motor to stall.

- **61.B2.3E** The deskew rear motor stalled.
- **61.B2.4E** The deskew front motor stalled.
- **61.B3.4E** The feed motor stalled.
- **61.B4.2E** The left side vertical motor stalled.
- **61.B5.1E** The duplex diverter motor stalled.
- **61.B6.2E** The duplex entry motor stalled.
- **61.B7.3E** The duplex exit motor stalled.
- **61.B8.2E** The ejection motor stalled.
- **61.B9.2E** The stack control motor stalled.

Recommended action

Recommended action for customers

1. Clear any paper or obstructions from the paper path and then press **OK**.
2. Make sure that paper loaded in the indicated tray is supported.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear any paper or obstructions from the paper path and then press **OK**.
2. Make sure that paper loaded in the indicated tray is supported.
3. If the error persists, send an onsite technician to perform the following steps.
4. From the Service Menu, run the indicated motor test forwards and backwards (if applicable). If the error persists, replace the indicated motor assembly.

Error code	Service Menu motor test name	Part description	Part number
61.B2.3E	Deskew Rear	Deskew rear drive assembly	A7W93-67051
61.B2.4E	Deskew Front	Deskew front drive assembly	A7W93-67050
61.B3.4E	Feed	Feed motor kit	A7W93-67071
61.B4.2E	Vertical	Left side vertical drive assembly	A7W93-67055
61.B5.1E	Duplex Diverter (run in Cycle Mode)	Duplex diverter assembly	A7W93-67056
61.B6.2E	Duplex Entry	Duplex entry drive assembly	A7W93-67030
61.B7.3E	Duplex Exit	Duplex exit drive assembly	A7W93-67038
61.B8.2E	Ejection	Ejection drive assembly	A7W93-67054
61.B9.2E	Stack Control (run in Cycle Mode)	Ejection flap drive assembly	A7W93-67049

5. For the following errors, if the error persists, replace the indicated part.

NOTICE: DO NOT send these parts for the onsite technician's first visit. Only send these parts if the initial visit and repairs did not resolve the issue.

Error code	Part description	Part number
61.B2.4E	Deskew gear module assembly	A7W93-60418
61.B3.4E	Feed shaft	A7W93-67035
61.B4.2E	Left door assembly	A7W93-67033
61.B5.1E	Left door assembly	A7W93-67033
61.B9.2E	Standard bin	A7W93-67048

6. If the error persists after all the applicable listed parts have been replaced, check for physical damage on the connecting assemblies that may prevent the motor from turning (shaft, belt, gears, bearings, etc.). Replace the damaged part(s) if available, otherwise escalate the issue using the Standard Support Process.

61.C1.11

Description

The drop detect carriage motor has stalled.

Recommended action

Recommended action for customers

1. Turn the printer off.
2. Check for paper or paper remnants in the print zone.
 - a. Open the left and right doors.
 - b. Pull out (but do not remove) both the left and right duplexer modules.
 - c. Remove any paper or paper remnants from under the printhead.
 - d. Reinsert the left and right duplexer modules.
 - e. Close the left and right doors.
3. Turn the printer on.
4. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off.
2. Check for paper or paper remnants in the print zone.

- a. Open the left and right doors.
 - b. Pull out (but do not remove) both the left and right duplexer modules.
 - c. Remove any paper or paper remnants from under the printhead.
 - d. Reinsert the left and right duplexer modules.
 - e. Close the left and right doors.
3. Turn the printer on.
4. If the error persists, send an onsite technician to perform the following steps.
5. From the [Service Menu](#), run the [Home Print Zone Motors](#) test to confirm the error condition.
6. Check for damaged connectors while reseating the FFC between the main PCA (J31) and the drop detect encoder. If damaged connectors are found, replace the drop detect carriage assembly.
Part number: A7W93-67060
7. Check for damaged connectors while reseating the FFC between the LRU PCA (J6) and the drop detect motor. If damaged connectors are found, replace the drop detect carriage assembly.
Part number: A7W93-67060
8. If the error persists, manually reset the print zone motors.
 - a. Remove the output bin assembly to gain access to the printhead lift mechanism.
 - b. Locate the printhead lift gear with a spring on the side.
 - c. With the left hand, hold the shaft to manually lift the print head, then with the right hand, pull the lift gear towards the front of the unit to release it from the worm gear and lift the print head till it stops.
 - d. Release the spring loaded gear and engage it back to the lift gear to keep the printhead in the up position.
 - e. Using a Torx 20 screwdriver, manually move the printhead wiper towards the right door, away from under the printhead.
 - f. From the back of the unit, check if the drop detect carriage is at the home position. If it is not, use a Torx 8 screwdriver to manually bring it back to home position.
9. Inspect the drop detect belt, encoder strip, belt tensioner, motor worm gear, and gear train for any damage. Replace the drop detect carriage assembly if any damage is found..
Part number: A7W93-67060
10. Turn the printer on and wait about three minutes for the boot– up process to complete. The printhead should be capped at the end of the boot–up process.
11. From the [Service Menu](#), run the [Drop Detect Carriage Test](#) to confirm functionality.
 - a. If no error is reported while the test is running, the problem has been solved. Turn the printer off, install the output bin and all the covers, and send a print job to further confirm functionality.
 - b. If the error persists, replace the drop detect carriage assembly.
Part number: A7W93-67060

61.C1.1E

Description

A higher than normal current drawn from the motor controller on the main PCA caused the drop detect carriage motor to stall.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. Send a print job or print an internal page to confirm functionality.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Send a print job or print an internal page to confirm functionality.
3. If the error persists, send an onsite technician to perform the following steps.
4. Replace the drop detect carriage assembly.

Part number: A7W93-67060

61.C2.11

Description

The image sensor carriage motor stalled for an unknown reason.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. Send a print job or print an internal page to confirm functionality.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. Send a print job or print an internal page to confirm functionality.
3. If the error persists, send an onsite technician to perform the following steps.
4. Check for damaged connectors while reseating the FCC between the image sensor carriage motor and the main PCA (J50). If damaged connectors are found, replace the image sensor repair kit.

Part number: A7W93-67063

5. Check for excessive clearance between the worm gear post and the image sensor cover (this allows the gear to ride up and disengage).
 - a. Adjust the clearance if possible. From the [Service Menu](#), run the [Image Sensor Test](#) to confirm functionality.
 - b. If the parts show excessive wear or damage, replace all the parts in the image sensor repair kit. From the [Service Menu](#), run the [Image Sensor Test](#) to confirm functionality.

Part number: A7W93-67063
6. After replacing the image sensor repair kit, from the [Service Menu](#), run the following calibrations in order:
 - a. [Calibrate the Image Sensor](#)
 - b. [Calibrate the Print Margin](#)
 - c. Print a [Streak Test](#) internal page. If there are no visible missing nozzles, skip to step 'e.'
 - d. [Clean the Printhead](#)
 - e. [Align the Printhead](#)
 - f. [Calibrate the Color Density](#)

61.C2.1E

Description

A higher than normal current drawn from the motor controller on the main PCA caused the image sensor carriage motor to stall.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. Send a print job or print an internal page to confirm functionality.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
 2. Send a print job or print an internal page to confirm functionality.
 3. If the error persists, send an onsite technician to perform the following steps.
 4. Check for damaged connectors while reseating the FCC between the image sensor carriage motor and the main PCA (J50). If damaged connectors are found, replace the image sensor repair kit.
- Part number: A7W93-67063
5. Check for excessive clearance between the worm gear post and the image sensor cover (this allows the gear to ride up and disengage).

- a. Adjust the clearance if possible. From the [Service Menu](#), run the [Image Sensor Test](#) to confirm functionality.
- b. If the parts show excessive wear or damage, replace all the parts in the image sensor repair kit. From the [Service Menu](#), run the [Image Sensor Test](#) to confirm functionality.

Part number: A7W93-67063

6. After replacing the image sensor repair kit, from the [Service Menu](#), run the following calibrations in order:
 - a. [Calibrate the Image Sensor](#)
 - b. [Calibrate the Print Margin](#)
 - c. Print a [Streak Test](#) internal page. If there are no visible missing nozzles, skip to step 'e.'
 - d. [Clean the Printhead](#)
 - e. [Align the Printhead](#)
 - f. [Calibrate the Color Density](#)

61.Cx.21

Description

The printhead wiper motor stalled for an unknown reason.

- **61.C4.21** The printhead wiper motor stalled during normal operation.
- **61.C5.21** The printhead wiper motor stalled during the printhead wiper replacement procedure.

Recommended action

Recommended action for customers

1. Press [Continue](#). The printer should auto-recover from this error.
2. If the auto-recover fails, turn the printer off, then on.
3. If the error persists, from the [Maintenance](#) menu, run [Eject Printhead Wiper](#) then [Install Printhead Wiper](#).
4. If the error persists, replace the printhead wiper kit.

Part number: A7W93-67080

5. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Press [Continue](#). The printer should auto-recover from this error.
2. If the auto-recover fails, turn the printer off, then on.
3. If the error persists, from the [Maintenance](#) menu, run [Eject Printhead Wiper](#) then [Install Printhead Wiper](#).
4. If the error persists, replace the printhead wiper kit.

Part number: A7W93-67080

5. If the error persists, send an onsite technician to perform the following steps.
6. From the [Service Menu](#), run the [Home Print Zone Motors](#) test. If the same error is displayed, press [Ok](#) to clear the error, then from the Service Menu, run [Eject Printhead Wiper](#).
 - a. If no error occurs, from the [Service Menu](#), run [Install Printhead Wiper](#).
 - b. If no error occurs, from the [Service Menu](#), run the [Web Advance Check](#). If no error is displayed, the problem is solved.
7. If the error persists, manually reset the print zone motors.
 - a. Remove the output bin assembly to gain access to the printhead lift mechanism.
 - b. Locate the printhead lift gear with a spring on the side.
 - c. With the left hand, hold the shaft to manually lift the print head, then with the right hand, pull the lift gear towards the front of the unit to release it from the worm gear and lift the print head till it stops.
 - d. Release the spring loaded gear and engage it back to the lift gear to keep the printhead in the up position.
 - e. Using a Torx 20 screwdriver, manually move the printhead wiper towards the right door, away from under the printhead.
 - f. From the back of the unit, check if the drop detect carriage is at the home position. If it is not, use a Torx 8 screwdriver to manually bring it back to home position.
8. Turn the printer on and wait about three minutes for the boot– up process to complete. The printhead should be capped at the end of the boot–up process.
9. From the [Service Menu](#), run the [Home Print Zone Motors](#) test to confirm functionality.
 - a. If no error is reported while the test is running, the problem has been solved. Turn the printer off, install the output bin and all the covers, and send a print job to further confirm functionality.
 - b. If the error persists, replace the printhead wiper motor.

Part number: A7W93-67045

61.Cx.25

Description

The printhead wiper is missing or the printhead wiper drive is damaged.

- **61.C4.25** The printhead error was detected during normal operation.
- **61.C5.25** The printhead error was detected during the printhead wiper replacement procedure.

Recommended action

Recommended action for customers

1. Press [Continue](#). The printer should auto– recover from this error.
2. If the auto–recover fails, turn the printer off, then on.
3. If the error persists, from the [Maintenance](#) menu, run [Eject Printhead Wiper](#) then [Install Printhead Wiper](#).

4. If the error persists, replace the printhead wiper kit.

Part number: A7W93-67080

5. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Press [Continue](#). The printer should auto-recover from this error.
2. If the auto-recover fails, turn the printer off, then on.
3. If the error persists, from the [Maintenance](#) menu, run [Eject Printhead Wiper](#) then [Install Printhead Wiper](#).
4. If the error persists, replace the printhead wiper kit.

Part number: A7W93-67080

5. If the error persists, send an onsite technician to perform the following steps.
6. From the [Service Menu](#), run the [Home Print Zone Motors](#) test. If the same error is displayed, press [Ok](#) to clear the error, then from the Service Menu, run [Eject Printhead Wiper](#).
 - a. If no error occurs, from the [Service Menu](#), run [Install Printhead Wiper](#).
 - b. If no error occurs, from the [Service Menu](#), run the [Web Advance Check](#). If no error is displayed, the problem is solved.
7. If the error persists, replace the printhead wiper motor.

Part number: A7W93-67045

61.Cx.26

Description

The printhead wiper is missing or the printhead wiper drive is damaged.

- **61.C4.26** The printhead error was detected while the printer was turning on or during normal operation.
- **61.C5.26** The printhead error was detected during the printhead wiper replacement procedure.

Recommended action

Recommended action for customers

1. Follow the messages on the control panel to install the printhead wiper kit.

Part number: A7W93-67080
2. If the printhead wiper is already installed, from the [Maintenance](#) menu, run [Eject Printhead Wiper](#) then [Install Printhead Wiper](#).

3. If the error persists, replace the printhead wiper kit.

Part number: A7W93-67080

4. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Follow the messages on the control panel to install the printhead wiper kit.
Part number: A7W93-67080
2. If the printhead wiper is already installed, from the [Maintenance](#) menu, run [Eject Printhead Wiper](#) then [Install Printhead Wiper](#).
3. If the error persists, replace the printhead wiper kit.
Part number: A7W93-67080
4. If the error persists, send an onsite technician to perform the following steps.
5. From the [Service Menu](#), run the [Home Print Zone Motors](#) test. If the same error is displayed, press [Ok](#) to clear the error, then from the Service Menu, run [Eject Printhead Wiper](#).
 - a. If no error occurs, from the [Service Menu](#), run [Install Printhead Wiper](#).
 - b. If no error occurs, from the [Service Menu](#), run the [Web Advance Check](#). If no error is displayed, the problem is solved.
6. If the error persists, replace the printhead wiper motor.
Part number: A7W93-67045

61.Cx.2E

Description

A higher than normal current drawn from the motor controller on the main PCA caused the printhead wiper motor to stall.

- **61.C4.2E** The printhead wiper motor stalled during normal operation.
- **61.C5.2E** The printhead wiper motor stalled during the printhead wiper replacement procedure.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. Send a print job or print an internal page to confirm functionality.
3. If the error persists, from the [Maintenance](#) menu, run [Eject Printhead Wiper](#) then [Install Printhead Wiper](#).
4. Send another print job. If the error persists, replace the printhead wiper kit.
Part number: A7W93-67080
5. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Send a print job or print an internal page to confirm functionality.
3. If the error persists, from the [Maintenance](#) menu, run [Eject Printhead Wiper](#) then [Install Printhead Wiper](#).
4. Send another print job. If the error persists, replace the printhead wiper kit.

Part number: A7W93-67080

5. If the error persists, send an onsite technician to perform the following steps.
6. From the [Service Menu](#), run the [Home Print Zone Motors](#) test. If the same error is displayed, press [Ok](#) to clear the error, then from the Service Menu, run [Eject Printhead Wiper](#).
 - a. If no error occurs, from the [Service Menu](#), run [Install Printhead Wiper](#).
 - b. If no error occurs, from the [Service Menu](#), run the [Web Advance Check](#). If no error is displayed, the problem is solved.
7. If the error persists, manually reset the print zone motors.
 - a. Remove the output bin assembly to gain access to the printhead lift mechanism.
 - b. Locate the printhead lift gear with a spring on the side.
 - c. With the left hand, hold the shaft to manually lift the print head, then with the right hand, pull the lift gear towards the front of the unit to release it from the worm gear and lift the print head till it stops.
 - d. Release the spring loaded gear and engage it back to the lift gear to keep the printhead in the up position.
 - e. Using a Torx 20 screwdriver, manually move the printhead wiper towards the right door, away from under the printhead.
 - f. From the back of the unit, check if the drop detect carriage is at the home position. If it is not, use a Torx 8 screwdriver to manually bring it back to home position.
8. Turn the printer on and wait about three minutes for the boot– up process to complete. The printhead should be capped at the end of the boot–up process.
9. From the [Service Menu](#), run the [Home Print Zone Motors](#) test to confirm functionality.
 - a. If no error is reported while the test is running, the problem has been solved. Turn the printer off, install the output bin and all the covers, and send a print job to further confirm functionality.
 - b. If the error persists, replace the printhead wiper motor.

Part number: A7W93-67045

61.Cx.2z

Description

The printhead wiper motor stalled.

- **61.C4.23** The printhead wiper motor stalled while moving towards the right door during normal operation.
- **61.C4.24** The printhead wiper motor stalled while moving towards the cap position during normal operation.
- **61.C5.23** The printhead wiper motor stalled while moving towards the right door during the printhead replacement procedure.
- **61.C5.24** The printhead wiper motor stalled while moving towards the cap position during the printhead replacement procedure.

Recommended action

Recommended action for customers

1. Press [Continue](#). The printer should auto– recover from this error.
2. If the auto–recover fails, turn the printer off, then on.
3. **For 61.C4.23, 61.C5.23:** Open the right door, check for and remove any obstructions between the printhead wiper and the right door.
4. If the error persists, from the [Maintenance](#) menu, run [Eject Printhead Wiper](#) then [Install Printhead Wiper](#).
5. If the error persists, replace the printhead wiper kit.

Part number: A7W93-67080

6. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Press [Continue](#). The printer should auto– recover from this error.
2. If the auto–recover fails, turn the printer off, then on.
3. **For 61.C4.23, 61.C5.23:** Open the right door, check for and remove any obstructions between the printhead wiper and the right door.
4. If the error persists, from the [Maintenance](#) menu, run [Eject Printhead Wiper](#) then [Install Printhead Wiper](#).
5. If the error persists, replace the printhead wiper kit.

Part number: A7W93-67080

6. If the error persists, send an onsite technician to perform the following steps.
7. From the [Service Menu](#), run the [Home Print Zone Motors](#) test. If the same error is displayed, press [Ok](#) to clear the error, then from the [Service Menu](#), run [Eject Printhead Wiper](#).
 - a. If no error occurs, from the [Service Menu](#), run [Install Printhead Wiper](#).
 - b. If no error occurs, from the [Service Menu](#), run the [Web Advance Check](#). If no error is displayed, the problem is solved.
8. If the error persists, manually reset the print zone motors.
 - a. Remove the output bin assembly to gain access to the printhead lift mechanism.
 - b. Locate the printhead lift gear with a spring on the side.
 - c. With the left hand, hold the shaft to manually lift the print head, then with the right hand, pull the lift gear towards the front of the unit to release it from the worm gear and lift the print head till it stops.
 - d. Release the spring loaded gear and engage it back to the lift gear to keep the printhead in the up position.

- e. Using a Torx 20 screwdriver, manually move the printhead wiper towards the right door, away from under the printhead.
 - f. From the back of the unit, check if the drop detect carriage is at the home position. If it is not, use a Torx 8 screwdriver to manually bring it back to home position.
9. Turn the printer on and wait about three minutes for the boot– up process to complete. The printhead should be capped at the end of the boot–up process.
 10. From the [Service Menu](#), run the [Home Print Zone Motors](#) test to confirm functionality.
 - a. If no error is reported while the test is running, the problem has been solved. Turn the printer off, install the output bin and all the covers, and send a print job to further confirm functionality.
 - b. If the error persists, replace the printhead wiper motor.

Part number: A7W93-67045

61.Cx.y2

Description

An internal motor error has occurred.

- **61.C2.12** The image sensor carriage motor stalled.
- **61.C4.22** The printhead wiper motor stalled.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. If the error persists, send an onsite technician to perform the following steps.
3. From the Service Menu, run the indicated motor test to confirm the error condition.

Error code	Service Menu motor test name
61.C2.12	Image Sensor Test
61.C4.22	Home Print Zone Motors

4. Check for damaged connectors while reseating the indicated FCC.

Error code	Action
------------	--------

61.C2.12	Check the connection between the image sensor carriage motor and the main PCA (J50).
61.C4.22	Check the connection between the printhead wiper motor and the left rear upper PCA (J3).

5. If damaged connectors are found, or the error persists after reseating the connections, replace the indicated part.

Error code	Part description	Part number
61.C2.12	Image sensor repair kit	A7W93-67063
61.C4.22	Printhead wiper motor	A7W93-67045

6. From the Service Menu, run the appropriate motor test to confirm functionality.

61.D1.y2

Description

An internal fan error has occurred.

- **61.D1.12** The airflow assembly fan stalled.
- **61.D1.22** The aerosol fan stalled.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. If the error persists, send an onsite technician to perform the following steps.
3. From the [Service Menu](#), run the indicated fan motor test to confirm the error condition.

Error code	Service Menu motor test name
61.D1.12	Airflow Assembly Fan
61.D1.22	Aerosol Fan

4. Check for damaged connectors while reseating the indicated FCC.

Error code	Action
------------	--------

61.D1.12	Check the connection between airflow assembly fan and the airflow distribution PCA (J5).
61.D1.22	Check the connection between the aerosol fan and the airflow distribution PCA (J4).

5. If damaged connectors are found, or the error persists after reseating the connections, replace the indicated part.

Error code	Part description	Part number
61.D1.12	Airflow repair kit	A7W93-67027
61.D1.22	Airflow repair kit	A7W93-67027

6. From the [Service Menu](#), run the appropriate fan motor test to confirm functionality.



NOTE: Run the [Airflow Assembly Fan](#) test at all 3 speeds.

61.D1.yz

Description

An internal fan error has occurred for an unknown reason.

- **61.D1.10** The airflow assembly fan is running with a smaller than expected load.
- **61.D1.11** The airflow assembly fan stalled for an unknown reason.
- **61.D1.21** The aerosol fan stalled for an unknown reason.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. Send a print job or print an internal page to confirm functionality.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians



CAUTION: Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. Send a print job or print an internal page to confirm functionality.
3. If the error persists, send an onsite technician to perform the following steps.
4. From the [Service Menu](#), run the indicated fan motor test to confirm the error condition.

Error code	Service Menu motor test name
61.D1.10	Airflow Assembly Fan

61.D1.11	Airflow Assembly Fan
61.D1.21	Aerosol Fan

5. Check for damaged connectors while reseating the indicated FCC.

Error code	Action
61.D1.10	Check the connection between airflow assembly fan and the airflow distribution PCA (J5).
61.D1.11	Check the connection between airflow assembly fan and the airflow distribution PCA (J5).
61.D1.21	Check the connection between the aerosol fan and the airflow distribution PCA (J4).

6. If damaged connectors are found, or the error persists after reseating the connections, replace the indicated part.

Error code	Part description	Part number
61.D1.10	Airflow repair kit	A7W93-67027
61.D1.11	Airflow repair kit	A7W93-67027
61.D1.21	Airflow repair kit	A7W93-67027

7. From the [Service Menu](#), run the appropriate fan motor test to confirm functionality.



NOTE: Run the [Airflow Assembly Fan](#) test at all 3 speeds.

61.D2.3E

Description

The airflow assembly is reporting a higher than expected temperature.

Recommended action

Recommended action for customers

1. Turn the printer off.
 - a. Let the printer cool down for five minutes.
 - b. Ensure the printer is not directly being affected by an external heat source, such as a vent or direct sunlight.
 - c. Turn the printer on.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off.

- a. Let the printer cool down for five minutes.
 - b. Ensure the printer is not directly being affected by an external heat source, such as a vent or direct sunlight.
 - c. Turn the printer on.
2. If the error persists, send an onsite technician to perform the following steps.
3. From the [Service Menu](#), run the [Airflow Diagnostics Test](#) to confirm the error condition.
4. If the error persists, replace the airflow repair kit.

Part number: A7W93-67027

61.D3.61

Description

The AC control module is not detecting AC power.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. Attempt to print a multiple-page print job with some heavy color density content to cause the airflow system to turn on while printing,



NOTE: The airflow system may not turn on when print text only print jobs regardless of the number of pages.

3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians



CAUTION: Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. Attempt to print a multiple-page print job with some heavy color density content to cause the airflow system to turn on while printing,



NOTE: The airflow system may not turn on when print text only print jobs regardless of the number of pages.

3. If the error persists, send an onsite technician to perform the following steps.
4. Check for damaged connectors while reseating the cable between the power supply and the AC control module. If the cable is damaged, replace the AC power kit.

Part number: A7W93-67012

5. Check for damaged connectors while reseating the FCC between the AC control module and the main PCA (J28). If the FCC is damaged replace the MPCA FCC kit.



NOTE: The control module FCC is part of the the MPCA FCC Kit.

Part number: A7W93-67011

6. From the [Service Menu](#), check [Airflow System](#) information. If the [Line Voltage Configuration](#) = 240 VAC but the printer is plugged to a 120 VAC outlet, replace the power supply assembly.

Part number: A7W93-67036

7. Check the LEDs on the AC control module.

- a. If the 3.3 VDC LED is the only LED on, and the printer is connected to a 240 VAC outlet, replace the power supply assembly.

Part number: A7W93-67036

- b. If none of the LEDs in the AC control module are on, replace all the parts that come with the airflow system repair kit.

Part number: A7W93-67027

62.0x.yz

Description

One of the dies in the printhead has experienced an electrical failure.

x = Printhead die number

- 0: Printhead die number (1)
- 1: Printhead die number (2)
- 2: Printhead die number (3)
- 3: Printhead die number (4)
- 4: Printhead die number (5)
- 5: Printhead die number (6)
- 6: Printhead die number (7)
- 7: Printhead die number (8)
- 8: Printhead die number (9)
- 9: Printhead die number (10)
- A: Printhead die number (11)
- B: Printhead die number (12)
- C: Printhead die number (13)
- D: Printhead die number (14)

Error codes

- **62.0x.01** Printhead assembly reported die (x) electrical failure: Generic Error.
- **62.0x.02** Printhead assembly reported die (x) electrical failure: No Printhead In/Out signal.

- **62.0x.03** Printhead assembly reported die (x) electrical failure: No Printhead In/Out signal.
- **62.0x.04** Printhead assembly reported die (x) electrical failure: Watchdog Fault.
- **62.0x.06** Printhead assembly reported die (x) electrical failure: Unrecognized Printhead Type.
- **62.0x.07** Printhead assembly reported die (x) electrical failure: LVDS Error.
- **62.0x.08** Printhead assembly reported die (x) electrical failure: ID Invalid.
- **62.0x.09** Printhead assembly reported die (x) electrical failure: ID Bit Flipped.
- **62.0x.10** Printhead assembly reported die (x) electrical failure: Bad DTSR.
- **62.0x.13** Printhead assembly reported die (x) electrical failure: Temp Sensing Resistor Fault.
- **62.0x.14** Printhead assembly reported die (x) electrical failure: Stuck Cold.
- **62.0x.15** Printhead assembly reported die (x) electrical failure: Not Heating.
- **62.0x.20** Printhead assembly reported die (x) electrical failure: VDD Short Low.
- **62.0x.44** Printhead assembly reported die (x) electrical failure: Last Short Error.
- **62.0x.8D** Printhead assembly reported die (x) electrical failure: Unexpected Null Pointer.
- **62.00.21** Printhead assembly reported electrical failure: VDD Short High.
- **62.00.22** Printhead assembly reported electrical failure: VDD Expected On.
- **62.00.23** Printhead assembly reported electrical failure: VPP Initialization Short Low.
- **62.00.24** Printhead assembly reported electrical failure: VPP Short Low.
- **62.00.25** Printhead assembly reported electrical failure: VPP Initialization Short High.
- **62.00.26** Printhead assembly reported electrical failure: VPP Short High.
- **62.00.27** Printhead assembly reported electrical failure: VPP Short Test Out Of Range Low.
- **62.00.28** Printhead assembly reported electrical failure: VPP Short Test Out Of Range High.
- **62.00.29** Printhead assembly reported electrical failure: VPP Expected Off.
- **62.00.2A** Printhead assembly reported electrical failure: VPP Powering On Out Of Range Low.
- **62.00.2B** Printhead assembly reported electrical failure: VPP Powering On Out Of Range High.
- **62.00.2C** Printhead assembly reported electrical failure: VPP On Out Of Range Low.
- **62.00.2D** Printhead assembly reported electrical failure: VPP On Out Of Range High.
- **62.00.2E** Printhead assembly reported electrical failure: VPP Cal Out Of Range Low.
- **62.00.2F** Printhead assembly reported electrical failure: VPP Cal Out Of Range High.
- **62.00.30** Printhead assembly reported electrical failure: VPP Bleed Failed.
- **62.00.31** Printhead assembly reported electrical failure: VDD Check Timeout.
- **62.00.32** Printhead assembly reported electrical failure: VPP Check Timeout.

- **62.00.33** Printhead assembly reported an electrical failure.
- **62.00.34** Printhead assembly reported electrical failure: VPP Power On Failure.
- **62.00.35** Printhead assembly reported electrical failure: VDD Too Many Ignored.
- **62.00.36** Printhead assembly reported electrical failure: VPP Too Many Ignored.
- **62.00.37** Printhead assembly reported electrical failure: VPP Initialization Too Many Ignored.
- **62.00.38** Printhead assembly reported electrical failure: VDD Check Timeout VPP Powering On.
- **62.00.39** Printhead assembly reported electrical failure: VPP Check Timeout VPP Powering On.
- **62.00.3A** Printhead assembly reported electrical failure: VDD Check Timeout Ink Short Pause.
- **62.00.3B** Printhead assembly reported electrical failure: VPP Check Timeout Ink Short Pause.
- **62.00.3C** Printhead assembly reported electrical failure: VDD On At Start-up.
- **62.00.3D** Printhead assembly reported electrical failure: VPP On At Start-up.
- **62.00.3E** Printhead assembly reported electrical failure: VPP Set point Failed Low.
- **62.00.3F** Printhead assembly reported electrical failure: VPP Set point Failed High.
- **62.00.40** Printhead assembly reported electrical failure: VPP Bleed K Failed.
- **62.00.41** Printhead assembly reported electrical failure: VPP Bleed Color 1 Failed.
- **62.00.42** Printhead assembly reported electrical failure: VPP Bleed Color 2 Failed.
- **62.00.43** Printhead assembly reported electrical failure: VPP Cal Out Of Range.

Recommended action

Recommended action for customers


1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. If the error persists, send an onsite technician to perform the following steps.
3. Reseat the three flat flexible cables (FFC) from the main PCA to the printhead assembly. The three FFCs are:
 - (J25) SIM FFC
 - (J11) Printhead Power FFC
 - (J13) Data FFC

For (J11) and (J25), the blue portions of the FFC will be parallel with the connectors when fully seated.

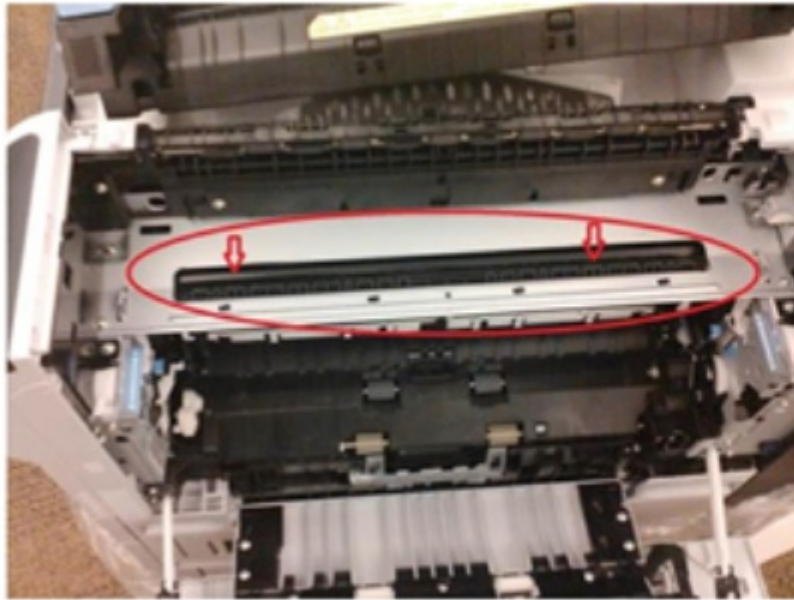


Location of Guide



Guide Removal

(J13) is a Zero Insertion Force (ZIF) FFC. Unlatch the connector by carefully rotating the tab away from the PCA pulling it from the top, there are two tiny tabs at each side of the cable, those are alignment features.

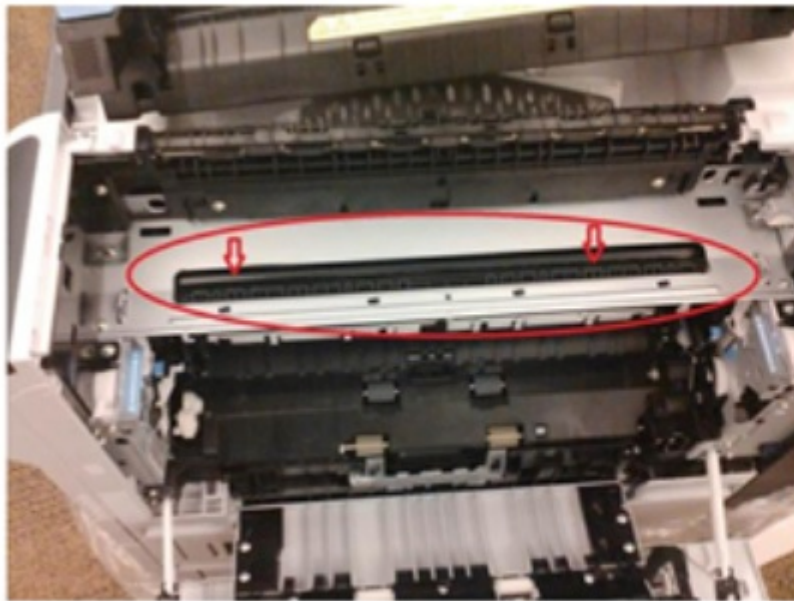

Location of Guide



Guide Removal

4. If the error persists, turn the printer off, disconnect the three FFCs and carefully inspect the contacts for wear, scratches, or conductor material peeled off. If any damage is seen, replace the 3 FFCs.

Part number: A7W93-67010

5. If the error persists, replace the printhead assembly.

Part number: A7W93-67069.

62.11.2x

Description

An error with the fluid pump motor has occurred.

- **62.11.21** The fluid pump motor stalled for an unknown reason.
- **62.11.22** The fluid pump motor may have become disconnected.
- **62.11.2E** The fluid pump motor caused a thermal event in the motor controller.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. If the error persists, send an onsite technician to perform the following steps.
3. From the [Service Menu](#), run the [Cycle Fluid Pump](#) motor test to confirm the error condition.
4. Check for damaged connectors while reseating the FCC between the fluid pump and the SIM PCA (J1).
5. Check for damaged connectors while reseating the FCCs between the printhead assembly and the main PCA (J11), (J13), and (J25).

 **NOTE:** Check that the line in the blue tab for (J11) and (J25) FFCs are parallel to the connector.

6. If damaged connectors are found, replace the printhead assembly FCC assembly kit.
Part number: A7W93-67010
7. If the error persists after reseating the connections or replacing the cables, replace the printhead assembly with service module.
Part number: A7W93-67069
8. From the [Service Menu](#), run the [Cycle Fluid Pump](#) motor test to confirm functionality.

62.11.3B

Description

The air pump inside the printhead assembly has become disconnected.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. If the error persists, send an onsite technician to perform the following steps.
3. From the [Service Menu](#), run the [Cycle Fluid Pump](#) test to confirm the error condition.
4. Check for damaged connectors while reseating the FCCs between the printhead assembly and the main PCA (J11), (J13), and (J25).

 **NOTE:** Check that the line in the blue tab for (J11) and (J25) FFCs are parallel to the connector.

 **NOTE:** (J25) is a ZIF (zero insertion force) FFC. Unlatch the connector by carefully rotating the tab away from the PCA, pulling it from the top. There are two small tabs at each side of the cable that keep the connector aligned.

5. If damaged connectors are found, replace the printhead assembly FCC assembly kit.
Part number: A7W93-67010
6. If the error persists after reseating the connections or replacing the cables, replace the printhead assembly with service module.
Part number: A7W93-67069
7. From the [Service Menu](#), run the [Cycle Fluid Pump](#) motor test to confirm functionality.

62.11.4B

Description

The vent solenoid has become disconnected.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. If the error persists, send an onsite technician to perform the following steps.
3. From the [Service Menu](#), run the [Cycle Vent Valve](#) test to confirm the error condition.
4. Check for damaged connectors while reseating the FCCs between the printhead assembly and the main PCA (J11), (J13), and (J25).

 **NOTE:** Check that the line in the blue tab for (J11) and (J25) FFCs are parallel to the connector.

 **NOTE:** (J25) is a ZIF (zero insertion force) FFC. Unlatch the connector by carefully rotating the tab away from the PCA, pulling it from the top. There are two small tabs at each side of the cable that keep the connector aligned.

5. If damaged connectors are found, replace the printhead assembly FCC cable kit.
Part number: A7W93-67010
6. If the error persists after reseating the connections or replacing the cables, replace the printhead assembly with printhead wiper.
Part number: A7W93-67069
7. From the [Service Menu](#), run the [Cycle Vent Valve](#) test to confirm functionality.

62.12.51

Description

The printhead lift motor stalled for an unknown reason.

Recommended action

Recommended action for customers

1. Turn the printer off.
2. Check for paper or paper remnants in the print zone.
 - a. Open the left and right doors.
 - b. Remove both the left and right duplexer modules.
 - c. Remove any paper or paper remnants from under the printhead.
 - d. Reinsert the left and right duplexer modules.
 - e. Close the left and right doors.
3. Turn the printer on.
4. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off.
2. Check for paper or paper remnants in the print zone.
 - a. Open the left and right doors.
 - b. Remove both the left and right duplexer modules.
 - c. Remove any paper or paper remnants from under the printhead.
 - d. Reinsert the left and right duplexer modules.
 - e. Close the left and right doors.
3. Turn the printer on.
4. If the error persists, send an onsite technician to perform the following steps.
5. From the Service Menu, run the [Home Print Zone Motors](#) test to confirm the error condition.



NOTE: If these additional error codes are displayed during the motor test, continue troubleshooting below: (61.C1.11, 61.C4.2Z or 62.12.5Z).

6. Check for damaged connectors while reseating the FCC between the printhead assembly and the main PCA (J13).



NOTE: Check that the line in the blue tab for (J11) and (J25) FFCs are parallel to the connector.



NOTE: (J25) is a ZIF (zero insertion force) FFC. Unlatch the connector by carefully rotating the tab away from the PCA, pulling it from the top. There are two small tabs at each side of the cable that keep the connector aligned.

7. If damaged connectors are found, replace the printhead assembly FCC cable kit.
Part number: A7W93-67010
8. If the error persists, manually reset the print zone motors.
 - a. Remove the output bin assembly to gain access to the printhead lift mechanism.
 - b. Locate the printhead lift gear with a spring on the side.
 - c. With the left hand, hold the shaft to manually lift the print head, then with the right hand, pull the lift gear towards the front of the unit to release it from the worm gear and lift the print head till it stops.
 - d. Release the spring loaded gear and engage it back to the lift gear to keep the printhead in the up position.
 - e. Using a Torx 20 screwdriver, manually move the printhead wiper towards the right door, away from under the printhead.
 - f. From the back of the unit, check if the drop detect carriage is at the home position. If it is not, use a Torx 8 screwdriver to manually bring it back to home position.
9. Turn the printer on and wait about three minutes for the boot– up process to complete. The printhead should be capped at the end of the boot–up process.
10. From the [Service Menu](#), run the [Home Print Zone Motors](#) test to confirm functionality.

- a. If no error is reported while the test is running, the problem has been solved. Turn the printer off, install the output bin and all the covers, and send a print job to further confirm functionality.
- b. If the error persists, replace the printhead assembly with printhead wiper.

Part number: A7W93-67069

62.12.54

Description

The printhead lift motor stalled.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. If the error persists, send an onsite technician to perform the following steps.
3. From the Service Menu, run the [Home Print Zone Motors](#) test to confirm the error condition.
4. Check for damaged connectors while reseating the FCC between the printhead assembly and the main PCA (J13).

 **NOTE:** Check that the line in the blue tab for (J11) and (J25) FFCs are parallel to the connector.

 **NOTE:** (J25) is a ZIF (zero insertion force) FFC. Unlatch the connector by carefully rotating the tab away from the PCA, pulling it from the top. There are two small tabs at each side of the cable that keep the connector aligned.

5. If damaged connectors are found, replace the printhead assembly FCC cable kit.

Part number: A7W93-67010

6. If the error persists, replace the printhead assembly with printhead wiper.

Part number: A7W93-67069

62.12.5E

Description

The lift motor in the printhead assembly caused a thermal event in the motor controller.

Recommended action

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

 **CAUTION:** Disconnect the printer's power source before reseating any cables or connectors.

1. Turn the printer off, and then on.
2. If the error persists, send an onsite technician to perform the following steps.
3. From the [Service Menu](#), run the Home Print Zone Motors test to confirm the error condition.
4. Check for damaged connectors while reseating the FCC between the printhead assembly and the main PCA (J13).

 **NOTE:** Check that the line in the blue tab for (J11) and (J25) FFCs are parallel to the connector.

 **NOTE:** (J25) is a ZIF (zero insertion force) FFC. Unlatch the connector by carefully rotating the tab away from the PCA, pulling it from the top. There are two small tabs at each side of the cable that keep the connector aligned.

5. If damaged connectors are found, replace the printhead assembly FCC cable kit.
Part number: A7W93-67010
6. If the error persists after reseating the connections or replacing the cables, replace the printhead assembly with printhead wiper.
Part number: A7W93-67069
7. From the [Service Menu](#), run the Home Print Zone Motors test to confirm functionality.