




# HP Color LaserJet Enterprise M750

## Control Panel Message Document (CPMD)

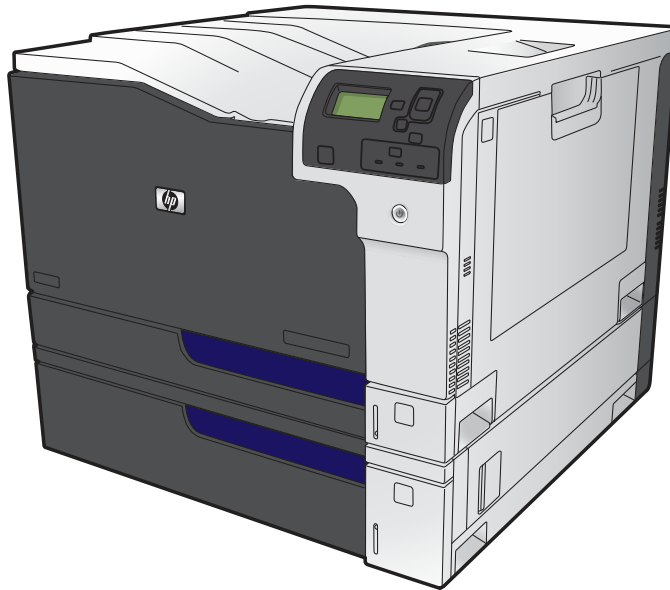

[www.hp.com/support/](http://www.hp.com/support/)



# HP Color LaserJet Enterprise M750 - Control Panel Message Document (CPMD)

## SUMMARY

This document provides error-code troubleshooting information

## Legal information

### Copyright and License

© Copyright 2021 HP Development Company, L.P.

Reproduction, adaptation, or translation without prior written permission is prohibited, except as allowed under the copyright laws.

The information contained herein is subject to change without notice.

The only warranties for HP products and services are set forth in the express warranty statements accompanying such products and services. Nothing herein should be construed as constituting an additional warranty. HP shall not be liable for technical or editorial errors or omissions contained herein.

Edition 3, 3/2024

### Trademark Credits

Adobe®, Adobe Photoshop®, Acrobat®, and PostScript® are trademarks of Adobe Systems Incorporated.

Apple and the Apple logo are trademarks of Apple Inc., registered in the U.S. and other countries.

macOS is a trademark of Apple Inc., registered in the U.S. and other countries.

AirPrint is a trademark of Apple Inc., registered in the U.S. and other countries.

Google™ is a trademark of Google Inc.

Microsoft®, Windows®, and Windows Server® are U.S. registered trademarks of Microsoft Corporation.

UNIX® is a registered trademark of The Open Group.

---

# Table of contents

|                                                                     |           |
|---------------------------------------------------------------------|-----------|
| <b>1 Document last updated .....</b>                                | <b>1</b>  |
| <b>2 About this document .....</b>                                  | <b>2</b>  |
| <b>3 Control-panel message types .....</b>                          | <b>3</b>  |
| Error-code and control-panel-message troubleshooting overview ..... | 3         |
| Error codes (types and structure) .....                             | 3         |
| <b>4 How to search for printer documentation .....</b>              | <b>6</b>  |
| WISE - How to access and use .....                                  | 6         |
| Accessing WISE .....                                                | 6         |
| Using WISE to search for error codes .....                          | 10        |
| Using WISE to access repair and replace videos for FRUs .....       | 12        |
| <b>5 Printer service information .....</b>                          | <b>17</b> |
| <b>6 Numerical control panel messages .....</b>                     | <b>18</b> |
| 10.wx.yz Error Messages .....                                       | 18        |
| 10.wx.yz error messages .....                                       | 18        |
| 10.OX.Y0 Supply memory error .....                                  | 19        |
| 10.22.50 .....                                                      | 20        |
| 10.22.51 .....                                                      | 20        |
| 10.22.52 .....                                                      | 20        |
| 10.23.50 .....                                                      | 21        |
| 10.23.51 .....                                                      | 21        |
| 10.23.52 .....                                                      | 21        |
| 10.23.70 Printing past very low .....                               | 21        |
| 10.XX.34 Used supply in use .....                                   | 22        |
| 10.XX.40 Genuine HP supplies installed .....                        | 22        |
| 10.XX.41 Unsupported supply in use .....                            | 22        |
| 10.wx.70 Printing past very low .....                               | 23        |
| 10.YY.15 Install <supply> .....                                     | 24        |
| 10.YY.25 Wrong cartridge in <color> slot .....                      | 24        |
| 10.YY.35 Incompatible <supply> .....                                | 25        |
| 11.wx.yz Error Messages .....                                       | 26        |
| 11.* errors .....                                                   | 26        |
| 11.00.YY Internal clock error .....                                 | 26        |
| 13.wx.yz Error Messages .....                                       | 27        |

|                                                                      |    |
|----------------------------------------------------------------------|----|
| 13.* errors.....                                                     | 27 |
| 13.00.00 .....                                                       | 33 |
| 13.A3.D3 .....                                                       | 33 |
| 13.A3.D4 .....                                                       | 35 |
| 13.A3.D5 .....                                                       | 36 |
| 13.A3.D6 .....                                                       | 37 |
| 13.A3.FF .....                                                       | 38 |
| 13.A4.D4 .....                                                       | 38 |
| 13.A4.D5 .....                                                       | 40 |
| 13.A4.D6 .....                                                       | 41 |
| 13.A4.FF .....                                                       | 42 |
| 13.A5.A5 or 13.A5.D5 .....                                           | 42 |
| 13.A5.D6 .....                                                       | 43 |
| 13.A5.FF .....                                                       | 44 |
| 13.A6.D6 .....                                                       | 44 |
| 13.A6.FF .....                                                       | 45 |
| 13.AA.EE .....                                                       | 46 |
| 13.AB.EE .....                                                       | 46 |
| 13.B2.Az .....                                                       | 47 |
| 13.B2.Dz .....                                                       | 48 |
| 13.B2.FF .....                                                       | 50 |
| 13.B4.FF .....                                                       | 50 |
| 13.B9.Az .....                                                       | 51 |
| 13.B9.CZ .....                                                       | 54 |
| 13.B9.DZ .....                                                       | 57 |
| 13.B9.FF .....                                                       | 59 |
| 13.BA.EE .....                                                       | 59 |
| 13.BB.EE .....                                                       | 60 |
| 13.E1.DZ .....                                                       | 60 |
| 13.FF.FF .....                                                       | 62 |
| 20.00.00, 21.00.00 Error Messages .....                              | 63 |
| 20.* errors .....                                                    | 63 |
| 20.00.00 Insufficient memory: <Device> To continue, touch “OK” ..... | 63 |
| 21.* errors .....                                                    | 63 |
| 21.00.00 Page Too Complex .....                                      | 64 |
| 21.00.00 Page too complex To continue, touch “OK” .....              | 64 |
| 32.wx.yz Error Messages .....                                        | 64 |
| 32.* errors .....                                                    | 64 |
| 32.08.A1, 32.08.A2, 32.08.A3 .....                                   | 64 |
| 32.1C.05 .....                                                       | 65 |
| 32.1C.06 (event code).....                                           | 65 |
| 32.1C.07 (event code) .....                                          | 65 |
| 32.1C.08 (event code).....                                           | 65 |
| 32.1C.09 (event code).....                                           | 65 |
| 32.1C.0A (event code) .....                                          | 66 |
| 32.1C.0D (event code).....                                           | 66 |
| 32.1C.11 (event code) .....                                          | 66 |
| 32.1C.13, 32.1C.14 .....                                             | 66 |

|                                                                     |    |
|---------------------------------------------------------------------|----|
| 32.1C.15 .....                                                      | 66 |
| 32.1C.2E .....                                                      | 66 |
| 32.1C.2F .....                                                      | 67 |
| 32.1C.40 .....                                                      | 67 |
| 32.1C.41 .....                                                      | 67 |
| 32.1C.42 .....                                                      | 67 |
| 32.1C.43 .....                                                      | 67 |
| 32.1C.44 .....                                                      | 68 |
| 32.1C.45 .....                                                      | 68 |
| 32.1C.46 .....                                                      | 68 |
| 32.1C.47 .....                                                      | 68 |
| 32.1C.48 .....                                                      | 68 |
| 32.1C.49 .....                                                      | 68 |
| 32.1C.4A .....                                                      | 69 |
| 32.1C.56 .....                                                      | 69 |
| 32.1C.57 .....                                                      | 69 |
| 32.1C.58 .....                                                      | 69 |
| 32.1C.60 .....                                                      | 69 |
| 32.1C.61 .....                                                      | 70 |
| 32.1C.62 .....                                                      | 70 |
| 32.1C.68 .....                                                      | 70 |
| 32.1C.69 .....                                                      | 70 |
| 32.1C.6A .....                                                      | 70 |
| 32.1C.6D .....                                                      | 71 |
| 33.wx.yz Error Messages.....                                        | 71 |
| 33.* errors.....                                                    | 71 |
| 33.01.xx .....                                                      | 72 |
| 33.02.01 .....                                                      | 73 |
| 33.02.02 .....                                                      | 73 |
| 33.02.03 .....                                                      | 74 |
| 33.03.01 .....                                                      | 74 |
| 33.03.02 .....                                                      | 74 |
| 33.03.05 EFI Boot error .....                                       | 75 |
| 33.03.06 .....                                                      | 76 |
| 33.05.0z SureStart errors .....                                     | 77 |
| 33.05.1x Whitelisting errors .....                                  | 78 |
| 33.05.2x Intrusion detection errors .....                           | 78 |
| 33.05.5z Intrusion detection errors .....                           | 79 |
| 40.wx.yz Error Messages.....                                        | 80 |
| 40.* errors.....                                                    | 80 |
| 40.00.01 USB I/O buffer overflow To continue, touch "OK" .....      | 80 |
| 40.00.02 Embedded I/O buffer overflow To continue, touch "OK" ..... | 81 |
| 40.00.03 EIO [x] buffer overflow To continue, touch "OK" .....      | 81 |
| 40.00.04 EIO [x] bad transmission To continue, touch "OK" .....     | 81 |
| 40.00.05 Embedded I/O bad transmission To continue, touch OK .....  | 81 |
| 40.08.0x USB storage accessory removed .....                        | 81 |
| 40.0x.05 USB storage accessory removed .....                        | 81 |
| 41.wx.yz Error Messages .....                                       | 82 |

|                                                                                 |     |
|---------------------------------------------------------------------------------|-----|
| 41.WX.YZ Error To use another tray, touch "Options" .....                       | 82  |
| 41.01.YZ .....                                                                  | 83  |
| 41.02.00 Error .....                                                            | 84  |
| 41.02.0Z Error .....                                                            | 85  |
| 41.03.YZ Unexpected size in Tray <X> To use another tray, touch "Options" ..... | 85  |
| 41.04.YZ .....                                                                  | 86  |
| 41.05.YZ Unexpected type in Tray <X> To use another tray, touch "Options" ..... | 88  |
| 41.07.YZ Error To continue, touch "OK" .....                                    | 89  |
| 42.wx.yz Error Messages.....                                                    | 90  |
| 42.* errors .....                                                               | 90  |
| 46.wx.yz Error Messages.....                                                    | 91  |
| 46.* error messages .....                                                       | 91  |
| 47.wx.yz Error Messages.....                                                    | 92  |
| 47.* errors.....                                                                | 92  |
| 47.00.xx .....                                                                  | 92  |
| 47.01.xx .....                                                                  | 93  |
| 47.02.xx .....                                                                  | 93  |
| 47.03.xx .....                                                                  | 94  |
| 47.04.xx .....                                                                  | 94  |
| 47.05.xx .....                                                                  | 95  |
| 47.06.xx .....                                                                  | 95  |
| 47.FC.yz Printer Calibration Failed To continue, touch "OK" .....               | 96  |
| 48.wx.yz, 49.wx.yz Error Messages.....                                          | 97  |
| 48.* errors.....                                                                | 97  |
| 48.01.XX Error .....                                                            | 98  |
| 49.XX.YY Error To continue turn off then on .....                               | 98  |
| 49.38.07 Error To continue turn off then on .....                               | 99  |
| 49.38.14 Error To continue turn off then on .....                               | 100 |
| 50.wx.yz Error Messages.....                                                    | 100 |
| 50.1x.yz or 50.2x.yz Fuser error To continue turn off then on .....             | 100 |
| 50.3x.yz Fuser error To continue turn off then on .....                         | 102 |
| 50.4x.yz Fuser error To continue turn off then on .....                         | 104 |
| 50.7x.yz Fuser error To continue turn off then on .....                         | 106 |
| 50.8x.yz Fuser error To continue turn off then on .....                         | 108 |
| 50.9x.yz Fuser error To continue turn off then on .....                         | 110 |
| 50.Ax.yz Fuser error To continue turn off then on .....                         | 111 |
| 50.Bx.yz Fuser error To continue turn off then on .....                         | 113 |
| 51.wx.yz, 52.wx.yz Error Messages .....                                         | 115 |
| 51.* errors.....                                                                | 115 |
| 51.00.yz Error To continue turn off then on .....                               | 116 |
| 52.* errors.....                                                                | 116 |
| 52.wx.00 To continue turn off then on .....                                     | 117 |
| 54.wx.yz Error Messages.....                                                    | 118 |
| 54.* errors.....                                                                | 118 |
| 54.00.03 .....                                                                  | 119 |
| 54.00.06 , 54.00.14 , or 54.00.19 .....                                         | 119 |
| 54.01.05 .....                                                                  | 120 |

|                                                                         |     |
|-------------------------------------------------------------------------|-----|
| 54.06.21 .....                                                          | 120 |
| 54.0X.07 .....                                                          | 120 |
| 54.0X.0B or 54.0X.0C .....                                              | 121 |
| 54.0X.0D or 54.0X.0E .....                                              | 122 |
| 54.11.05 .....                                                          | 123 |
| 54.12.05 .....                                                          | 124 |
| 55.wx.yz, 56.wx.yz Error Messages .....                                 | 124 |
| 55.wx.yz DC controller error To continue turn off then on .....         | 124 |
| 56.* errors .....                                                       | 125 |
| 56.00.01 Illegal Input Printer Error To continue turn off then on ..... | 125 |
| 56.00.02 Selected media output bin unavailable .....                    | 126 |
| 56.00.03 Media input path operation error .....                         | 126 |
| 57.wx.yz Error Messages .....                                           | 126 |
| 57.* errors .....                                                       | 126 |
| 57.00.01 .....                                                          | 127 |
| 57.00.02 .....                                                          | 128 |
| 57.00.03 .....                                                          | 128 |
| 58.wx.yz Error Messages .....                                           | 128 |
| 58.* errors .....                                                       | 128 |
| 58.00.02 environmental sensor malfunction .....                         | 129 |
| 58.00.04 Error To continue turn off then on .....                       | 129 |
| 59.wx.yz Error Messages .....                                           | 130 |
| 59.* errors .....                                                       | 130 |
| 59.00.30 or 59.00.40 .....                                              | 130 |
| 59.00.90 or 59.00.A0 .....                                              | 131 |
| 59.00.C0 .....                                                          | 131 |
| 59.00.F0 .....                                                          | 132 |
| 59.05.50 Error To continue turn off then on .....                       | 144 |
| 59.0x.50 Error To continue turn off then on .....                       | 145 |
| 59.05.60 Error To continue turn off then on .....                       | 145 |
| 59.0x.60 Error To continue turn off then on .....                       | 146 |
| 59.05.70 Error To continue turn off then on .....                       | 146 |
| 59.0x.70 Error To continue turn off then on .....                       | 147 |
| 59.05.80 Error To continue turn off then on .....                       | 147 |
| 59.0x.80 Error To continue turn off then on .....                       | 147 |
| 60.wx.yz, 61.wx.yz, 62.wx.yz Error Messages .....                       | 148 |
| 60.* errors .....                                                       | 148 |
| 60.00.02 .....                                                          | 149 |
| 60.00.03 or 60.00.04 .....                                              | 149 |
| 60.00.05 or 60.00.06 .....                                              | 150 |
| 60.10.0z Media input source <z> pickup mechanism malfunction .....      | 151 |
| 61.00.01 .....                                                          | 151 |
| 62.* errors .....                                                       | 152 |
| 62.00.00 No system To continue turn off then on .....                   | 152 |
| 69.wx.yz, 70.wx.yz Error Messages .....                                 | 153 |
| 69.11.yz Error To continue, touch "OK" .....                            | 153 |
| 70.* errors .....                                                       | 153 |



|                                                                      |     |
|----------------------------------------------------------------------|-----|
| 70.00.00 Error To continue turn off then on .....                    | 153 |
| 80.wx.yz, 81.wx.yz Error Messages.....                               | 154 |
| 80.* errors.....                                                     | 154 |
| 80.0x.yz Embedded Jetdirect Error .....                              | 156 |
| 81.WX.00 Wireless Network Error To continue turn off then on .....   | 157 |
| 81.wx.yz Embedded Jetdirect Error To continue turn off then on ..... | 158 |
| 82.wx.yz Error Messages.....                                         | 158 |
| 82.* errors.....                                                     | 158 |
| 82.73.45 Disk Successfully cleaned .....                             | 161 |
| 82.73.46, 82.73.47 .....                                             | 161 |
| 98.wx.yz Error Messages.....                                         | 161 |
| 98.* errors.....                                                     | 161 |
| 98.00.01 or 98.01.00 Corrupt data in firmware volume .....           | 162 |
| 98.00.02 Corrupt data in the solutions volume .....                  | 163 |
| 98.00.03 Corrupt data in the configuration volume .....              | 163 |
| 98.00.04 Corrupt data in the job data volume .....                   | 164 |
| 98.01.yz .....                                                       | 164 |
| 98.02.yz .....                                                       | 165 |
| 98.03.yz .....                                                       | 165 |
| 99.wx.yz Error Messages.....                                         | 165 |
| 99.* errors.....                                                     | 165 |
| 99.00.01 Upgrade not performed file is corrupt .....                 | 166 |
| 99.00.02 Upgrade not performed timeout during receive .....          | 166 |
| 99.00.03 Upgrade not performed error writing to disk .....           | 166 |
| 99.00.04 Upgrade not performed timeout during receive .....          | 167 |
| 99.00.05 Upgrade not performed timeout during receive .....          | 167 |
| 99.00.06 Upgrade not performed error reading upgrade .....           | 168 |
| 99.00.07 Upgrade not performed error reading upgrade .....           | 168 |
| 99.00.08 Upgrade not performed error reading upgrade .....           | 168 |
| 99.00.09 Upgrade canceled by user .....                              | 169 |
| 99.00.10 Upgrade canceled by user .....                              | 169 |
| 99.00.11 Upgrade canceled by user .....                              | 169 |
| 99.00.12 Upgrade not performed the file is invalid .....             | 169 |
| 99.00.13 Upgrade not performed the file is invalid .....             | 169 |
| 99.00.14 Upgrade not performed the file is invalid .....             | 170 |
| 99.01.xx .....                                                       | 170 |
| 99.00.2x .....                                                       | 170 |
| 99.02.01 .....                                                       | 171 |
| 99.02.09 .....                                                       | 171 |
| 99.05.56 .....                                                       | 171 |
| 99.09.60 Unsupported disk .....                                      | 172 |
| 99.09.61 Unsupported disk .....                                      | 172 |
| 99.09.62 Unknown disk .....                                          | 173 |
| 99.09.63 Incorrect disk .....                                        | 173 |
| 99.09.64 Disk malfunction .....                                      | 174 |
| 99.09.65 Disk data error .....                                       | 174 |
| 99.09.66 No disk installed .....                                     | 174 |
| 99.09.67 Disk is not bootable please download firmware .....         | 175 |

|                                                                       |            |
|-----------------------------------------------------------------------|------------|
| 99.09.68 .....                                                        | 175        |
| <b>7 Alphabetical control panel messages.....</b>                     | <b>176</b> |
| Alphabetical messages .....                                           | 176        |
| Accept bad signature.....                                             | 176        |
| Bad optional tray connection .....                                    | 176        |
| <binname> full Remove all paper from bin .....                        | 176        |
| Calibration reset pending .....                                       | 176        |
| Canceling .....                                                       | 177        |
| Canceling...<jobname> .....                                           | 177        |
| Checking engine .....                                                 | 177        |
| Checking paper path .....                                             | 177        |
| Chosen personality not available To continue touch "OK" .....         | 177        |
| Cleaning .....                                                        | 178        |
| Cleaning do not grab paper .....                                      | 178        |
| Clearing event log .....                                              | 178        |
| Clearing paper path .....                                             | 178        |
| Close front door .....                                                | 178        |
| Close lower right door .....                                          | 179        |
| Close right door .....                                                | 179        |
| Close middle right door .....                                         | 179        |
| Close upper right door For help press ? .....                         | 180        |
| Cooling device .....                                                  | 180        |
| Communication lost .....                                              | 180        |
| Data received To print last page press "OK" .....                     | 180        |
| Event log is empty .....                                              | 180        |
| Expected drive missing .....                                          | 181        |
| [File System] device failure To clear press OK .....                  | 181        |
| [File System] file operation failed To clear press OK .....           | 181        |
| [File System] file system is full To clear press OK .....             | 181        |
| [File System] is not initialized .....                                | 181        |
| [File System] is write protected .....                                | 181        |
| HP Secure hard drive disabled .....                                   | 181        |
| Incompatible <supply> .....                                           | 182        |
| Incompatible supplies .....                                           | 182        |
| Initializing... .....                                                 | 183        |
| Install Fuser Unit .....                                              | 183        |
| Install <supply> .....                                                | 183        |
| Install <supply> Close rear door .....                                | 183        |
| Install supplies .....                                                | 184        |
| Install Transfer Unit .....                                           | 184        |
| Internal disk not functional .....                                    | 184        |
| Internal disk spinning up .....                                       | 185        |
| Load Tray <X>: [Type], [Size] .....                                   | 185        |
| Loading program <XX> Do not power off .....                           | 185        |
| Manually feed output stack Then touch "OK" to print second side ..... | 186        |
| Manually feed: <Type><Size> .....                                     | 186        |
| Moving solenoid .....                                                 | 186        |
| Moving solenoid and motor .....                                       | 186        |

|                                                                             |     |
|-----------------------------------------------------------------------------|-----|
| No job to cancel .....                                                      | 186 |
| No USB drive or files found.....                                            | 186 |
| Paused... ..                                                                | 188 |
| Performing Color Band Test... ..                                            | 188 |
| Performing Paper Path Test .....                                            | 188 |
| Please Wait... ..                                                           | 189 |
| Printing CMYK samples... ..                                                 | 189 |
| Printing Color Usage Log... ..                                              | 189 |
| Printing Configuration... ..                                                | 189 |
| Printing Demo Page... ..                                                    | 189 |
| Printing Diagnostics Page... ..                                             | 189 |
| Printing engine test... ..                                                  | 189 |
| Printing Event Log... ..                                                    | 190 |
| Printing File Directory... ..                                               | 190 |
| Printing Font List... ..                                                    | 190 |
| Printing Help Page... ..                                                    | 190 |
| Printing Menu Map... ..                                                     | 190 |
| Printing PQ Troubleshooting... ..                                           | 190 |
| Printing Registration Page .....                                            | 191 |
| Printing RGB Samples... ..                                                  | 191 |
| Printing stopped... ..                                                      | 191 |
| Printing Supplies Status Page... ..                                         | 191 |
| Printing Usage Page... ..                                                   | 191 |
| Processing duplex job Do not grab paper until job completes .....           | 191 |
| Processing job from tray <x>... Do not grab paper until job completes ..... | 192 |
| Processing... ..                                                            | 192 |
| Processing... copy <x> of <y> .....                                         | 192 |
| Ready .....                                                                 | 192 |
| Ready <IP Address> .....                                                    | 192 |
| Remove all toner cartridges .....                                           | 192 |
| Remove at least one toner cartridge .....                                   | 193 |
| Remove shipping lock from Tray 2 .....                                      | 193 |
| Replace <supply> .....                                                      | 193 |
| Restore Factory Settings .....                                              | 194 |
| Restricted from printing in color .....                                     | 194 |
| Rotating <color> motor .....                                                | 194 |
| Rotating Motor .....                                                        | 195 |
| Size mismatch in Tray <x> .....                                             | 195 |
| <Supply> almost full .....                                                  | 195 |
| <Supply> low OR Supplies low .....                                          | 195 |
| <Supply> very low OR Supplies very low .....                                | 196 |
| Supplies in wrong positions .....                                           | 196 |
| Tray <X> empty: [Type], [Size] .....                                        | 197 |
| <Tray X> lifting .....                                                      | 197 |
| Tray <X> open .....                                                         | 197 |
| Tray <X> overfilled .....                                                   | 198 |
| Troubleshooting .....                                                       | 198 |
| Type mismatch Tray <x> .....                                                | 198 |
| Unsupported drive installed To continue, touch "OK" .....                   | 199 |

|                                                                                         |     |
|-----------------------------------------------------------------------------------------|-----|
| Unsupported supply in use OR Unsupported supply installed To continue, touch “OK” ..... | 199 |
| Unsupported tray configuration .....                                                    | 199 |
| Unsupported USB accessory detected Remove USB accessory .....                           | 199 |
| USB accessory needs too much power Remove USB and turn off then on .....                | 200 |
| USB accessory not functional .....                                                      | 200 |
| Used supply installed To continue, touch “OK”ORUsed supply in use .....                 | 200 |
| Wrong cartridge in <color> slot .....                                                   | 200 |

|            |     |
|------------|-----|
| Index..... | 202 |
|------------|-----|

---

# 1 Document last updated

The following is the last time this document was updated:

Last update: March 12, 2024

## 2 About this document

This document provides error-code troubleshooting information.



**IMPORTANT:** Procedures and part numbers change. For current information, use the browser-based format.

Verify PDF is the most current before use. PDF part numbers must be verified with web-based error code information or parts look-up before parts are ordered.

Choose the format that best meets your needs.

**Table 2-1** Content format types

| Format    | Document title example                                           | Recommended use                                                                                                                                                                                                                                                                                                                             |
|-----------|------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Web-based | Go to: Product Detail page > Error Code Look-up                  | <ul style="list-style-type: none"><li>Quick access to individual web-based error code troubleshooting</li></ul> <p><b>TIP:</b> Save Product Detail page URL location in favorites</p>                                                                                                                                                       |
| Web-Base  | Go To: WISE default Search page > Enter [Product] and error code | <ul style="list-style-type: none"><li>Access to individual web-based error code troubleshooting</li><li>Web-based: Most up-to-date information available</li></ul>                                                                                                                                                                          |
| PDF       | [Product] - Control Panel Message Document (CPMD) PDF            | <ul style="list-style-type: none"><li>Use when support portals are NOT accessible at time of service</li><li>Use when a printable document is needed</li></ul> <p><b>NOTE:</b> Always refer to the printer service manual for removal and replacement procedures</p> <p><b>NOTE:</b> For current information, use the Web-based format.</p> |

---

## 3 Control-panel message types

The control-panel messages and event code entries indicate the current printer status or situations that might require action.



**NOTE:** Event log errors do not appear on the control-panel display. Open the event log to view or print the event log errors.

A control-panel message displays temporarily and might require you (or the applicable user) to acknowledge the message by touching the **OK** button to resume printing or by touching the **Stop** button to cancel the job.

With certain messages, the job might not finish printing, or the print quality might be affected. If the message is related to printing and the auto-continue feature is on, the printer will attempt to resume printing after the message has appeared for 10 seconds without acknowledgement.

For some messages, restarting the printer might fix the problem. If a critical error persists, the printer might require service.

## Error-code and control-panel-message troubleshooting overview

This section provides information on error codes and searching for information.

### Error codes (types and structure)

Error codes and control-panel messages display on the printer control panel to indicate the current printer status or situations that might require action. Error codes are numerical, or alphanumerical, and have a set structure with six characters (example: 13.WX.YZ).

- The first two characters are numeric and represent the system component that is causing the error. For example, in error code 10 . 22 . 15, **10** = **Supplies** for HP LaserJets.
- The remaining four characters (W, X, Y, and Z values) further define the error.

HP LaserJet and HP PageWide Enterprise error codes are documented in the control panel message document (CPMD) for each printer.

The CPMD is a comprehensive list of error codes, diagnostic and troubleshooting steps to clear or resolve the error, and other helpful information such as service mode pins and part numbers.

The CPMD is continually updated and republished with the latest information for the following error codes.

**Table 3-1 ERROR CODES: The first two characters**

| Error code | System Component                    | System Error Description                                                                                                                                        |
|------------|-------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 10.WX.YZ   | Supplies (LaserJet)                 | Supply error or supply memory error.                                                                                                                            |
| 11.WX.YZ   | Real-time clock                     | Internal error with the clock on the formatter.                                                                                                                 |
| 13.WX.YZ   | Jam (LaserJet)                      | Paper jam or open door jam error.                                                                                                                               |
| 15.WX.YZ   | Jam (PageWide)                      | Paper jam or open door jam error.                                                                                                                               |
| 17.WX.YZ   | Supplies (PageWide)                 | Supply error or supply memory error.                                                                                                                            |
| 20.WX.YZ   | Printer memory                      | Insufficient memory or buffering error.                                                                                                                         |
| 21.WX.YZ   | Page                                | Page complexity causing a decompression error when trying to process job.                                                                                       |
| 30.WX.YZ   | Scanner                             | Flatbed scanner error occurring inside the unit.                                                                                                                |
| 31.WX.YZ   | Document feeder                     | Document feeder, scanner, or jam error.                                                                                                                         |
| 32.WX.YZ   | Backup, restore, or reset           | Backup, restore, or reset notification or error.                                                                                                                |
| 33.WX.YZ   | Security                            | Backup, Disk, EFI BIOS, Firmware integrity (SureStart), or Trusted Platform Module (TPM) notification or error.                                                 |
| 40.WX.YZ   | Input/Output (I/O)                  | Partition manager, secure erase, or USB accessory error.                                                                                                        |
| 41.WX.YZ   | Fuser, Laser scanner, or Paper path | Miscellaneous error including general and misprint or mismatch errors typically involving (but not limited to) the fuser, the laser scanner, or the paper path. |
| 42.WX.YZ   | Firmware                            | Firmware failure involving the Event Log, Shell, System Manager, or other component.                                                                            |
| 44.WX.YZ   | Firmware                            | Firmware failure involving a digital sending component.                                                                                                         |
| 45.WX.YZ   | OXPd/Web Kit (PageWide)             | Informational notifications involving the OXPd Web Kit (communications log).                                                                                    |
| 46.WX.YZ   | Engine (LaserJet)                   | Engine communication error.                                                                                                                                     |
| 47.WX.YZ   | Firmware                            | Job parser or printer calibration error.                                                                                                                        |
| 48.WX.YZ   | Firmware                            | PJA job accounting, job management, or job pipeline error.                                                                                                      |
| 49.WX.YZ   | Firmware                            | Firmware communication error.                                                                                                                                   |
| 50.WX.YZ   | Fuser (LaserJet)                    | Fuser error.                                                                                                                                                    |
| 51.WX.YZ   | Laser scanner (LaserJet)            | Laser scanner beam error.                                                                                                                                       |
| 52.WX.YZ   | Laser scanner (LaserJet)            | Laser scanner startup error.                                                                                                                                    |
| 54.WX.YZ   | Sensor                              | Sensor error (not jam related).                                                                                                                                 |
| 55.WX.YZ   | DC controller (LaserJet)            | DC controller communication error.                                                                                                                              |
| 56.WX.YZ   | Paper handling (LaserJet)           | Paper input/output or accessory error.                                                                                                                          |
| 57.WX.YZ   | Fan                                 | Fan error.                                                                                                                                                      |
| 58.WX.YZ   | Sensor                              | Engine sensor failure.                                                                                                                                          |



**Table 3-1 ERROR CODES: The first two characters (continued)**

| Error code      | System Component               | System Error Description                                                                                                        |
|-----------------|--------------------------------|---------------------------------------------------------------------------------------------------------------------------------|
| <b>59.WX.YZ</b> | Motor (LaserJet)               | Motor error.                                                                                                                    |
| <b>60.WX.YZ</b> | Tray motor error (LaserJet)    | Tray lifting or pick up error.                                                                                                  |
| <b>61.WX.YZ</b> | Engine (PageWide)              | Print engine error with the 8-bit data package.                                                                                 |
| <b>62.WX.YZ</b> | System (LaserJet)              | LaserJet internal system error.                                                                                                 |
|                 | Print bar (PageWide)           | PageWide print system error.                                                                                                    |
| <b>63.WX.YZ</b> | Engine (LaserJet)              | General engine error (electrical, communication, etc.).                                                                         |
| <b>65.WX.YZ</b> | Connector                      | Output accessory connection error.                                                                                              |
| <b>66.WX.YZ</b> | Output accessory               | Output accessory error.                                                                                                         |
| <b>67.WX.YZ</b> | Input accessory                | Input accessory connection error                                                                                                |
| <b>69.WX.YZ</b> | Duplexer                       | Duplexer error.                                                                                                                 |
| <b>70.WX.YZ</b> | DC controller (LaserJet)       | DC controller firmware error.                                                                                                   |
| <b>76.WX.YZ</b> | DC controller (LaserJet)       | Power supply fluctuations causes formatter and DC controller communication issue and results them not to be in synchronization. |
| <b>80.WX.YZ</b> | Managed device                 | Embedded Jetdirect error.                                                                                                       |
| <b>81.WX.YZ</b> | Near Field Communication (NFC) | Wireless, Bluetooth or internal EIO error.                                                                                      |
| <b>82.WX.YZ</b> | Memory (hard disk, EMMC, etc.) | Disk hardware error.                                                                                                            |
| <b>90.WX.YZ</b> | Internal diagnostics           | Internal test of systems (i.e. disk, CPB, display) or interconnection error.                                                    |
| <b>98.WX.YZ</b> | Hard disk                      | Hard disk partition error.                                                                                                      |
| <b>99.WX.YZ</b> | Firmware installer             | Remote Firmware Upgrade (RFU), firmware install (engine or accessory), or disk error.                                           |

---

## 4 How to search for printer documentation

The CPMD, error codes, and other support documentation for each printer is available on the HP portals.

For HP internal access to WISE, go to [WISE](#).

For HP channel partners access WISE, see [Accessing WISE for HP channel partners \(HP Partner Portal\) on page 6](#) or [Accessing WISE for HP channel partners \(CSDP\)](#).

WISE is available to call agents, service technicians, and HP internal users. The level of detail available depends on your access credentials. To learn how to find support content in WISE, [watch the video here](#).

### WISE - How to access and use

Learn how to access and use Web-based Interactive Search Engines (WISE) to locate available support information. WISE is a repository of technical support documentation including service manuals, user guides, videos, and general support information.

### Accessing WISE

Learn how to access Web-based Interactive Search Engines (WISE) if you are an HP channel partner or an internal HP user.

#### Accessing WISE for HP channel partners (HP Partner Portal)

Learn how to access WISE by accessing the HP Partner Portal if you are an HP Channel Partner.

---

 **NOTE:** If this is your first visit to the HP Partner Portal, you will be asked to create an account. Follow the setup directions using your HP Partner credentials.


---



[View a video of how to access WISE for HP channel partners](#)


1. Sign-in to the HP Partner Portal (click <https://partner.hp.com> to access the sign-in page).

**Figure 4-1 HP Partner Portal sign-in page**

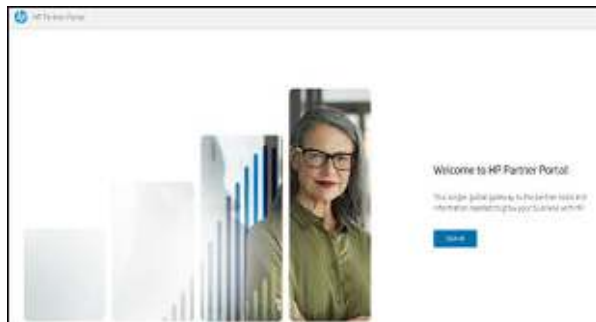


2. On the HP Partner Portal home page, click the **Services & Support** item.

**Figure 4-2 HP Partner Portal home page**

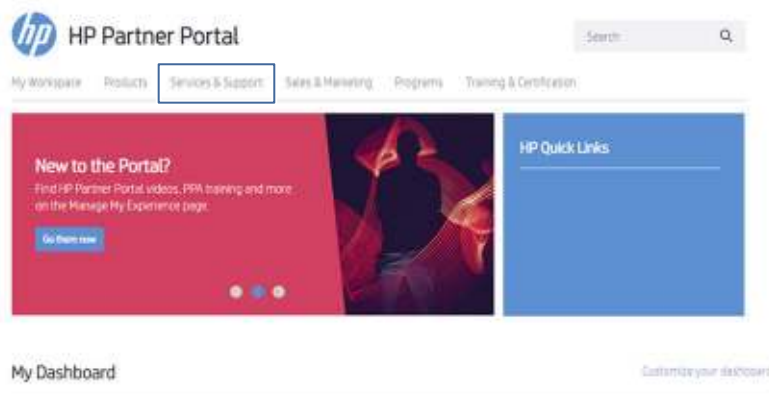


3. Select the **Technical Support (WISE)** item.

**Figure 4-3 HP Partner Portal Service & Support page**

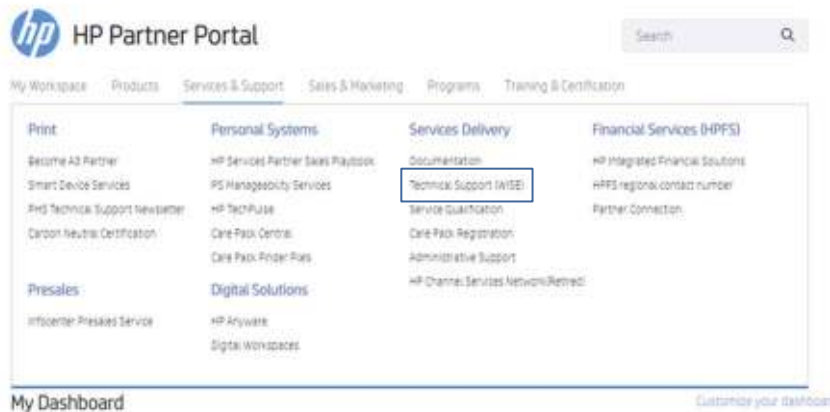

4. Select the **Technical Documentation** item.

**Figure 4-4 HP Partner Portal Technical Support (WISE)page**

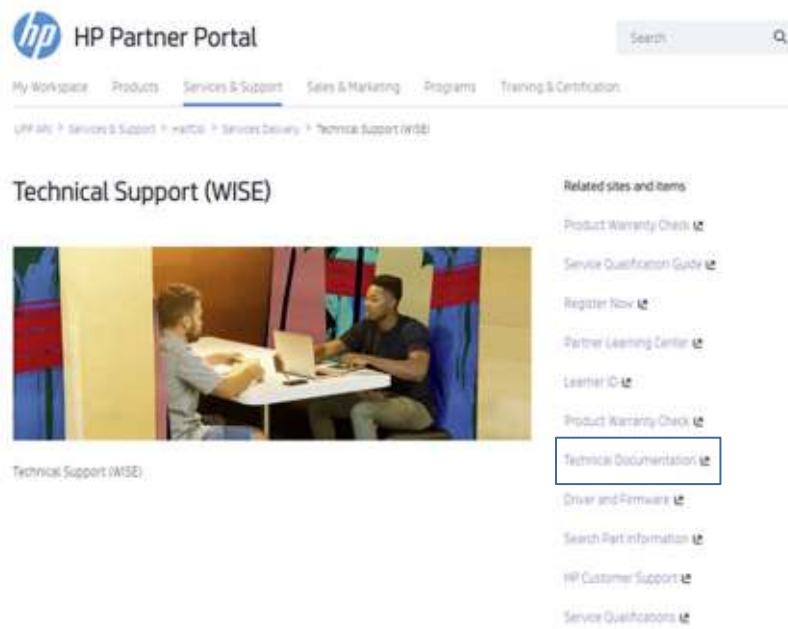

5. Use the WISE portal to search for printer information.

**Figure 4-5 WISE portal home page**



## Accessing WISE for internal HP users

Learn how to access WISE if you are an internal HP user.

1. Open one of the Web-based Interactive Search Engines (WISE) URLs listed below.

### Americas (AMS)

- [WISE - English](#)
- [WISE - Spanish](#)
- [WISE - Portuguese](#)
- [WISE - French](#)

## Asia Pacific / Japan (APJ)


- [WISE - English](#)
- [WISE - Japanese](#)
- [WISE - Korean](#)
- [WISE - Chinese \(simplified\)](#)
- [WISE - Chinese \(traditional\)](#)
- [WISE - Thai](#)

## Europe / Middle East / Africa (EMEA)

- [WISE - English](#)

2. Select **Commercial** from the drop-down menu.

**Figure 4-6 Choose an experience**

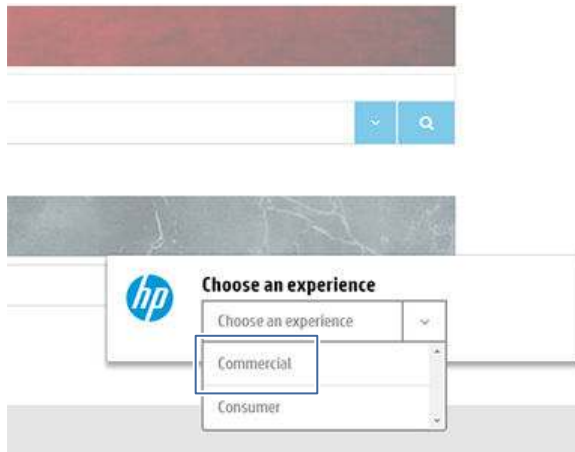

3. The WISE home page appears.



**Play the video:**



[View a video of how access WISE \(internal HP users\)](#)

## Using WISE to search for error codes

Learn how to use WISE to look up error codes.

 **NOTE:** The model used in the instructional videos is an example. The same steps apply to all printer models.


You will need the printer type (e.g. HP LaserJet), model number (e.g. M607), and bundle option (e.g. dn, dh, z).

### Search for error codes using the lookup widget

Learn how to search for a specific error code using the WISE Error Code Lookup widget.


1. Enter a printer model number (for example, M606) in the **Go to a Product Detail page** dialog box.

 **TIP:** To find a Product Detail Page (PDP) from a list of products by product type, select the **...or select your product from a list** item just below the dialog box.

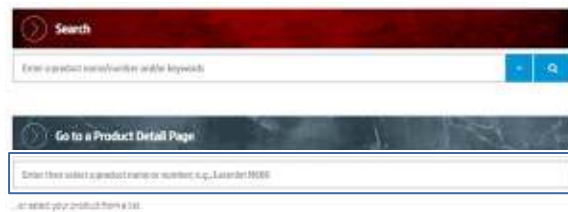


2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.

 **NOTE:** Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

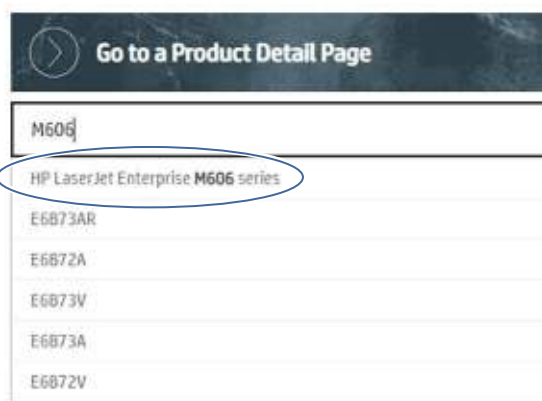

3. Type the error code (for example, 13.E1.D3) in the **Error Code Lookup** field, and then select the search icon.

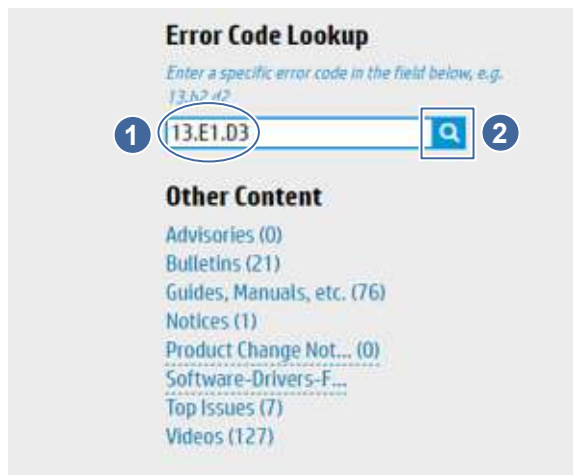

4. The error code troubleshooting content displays in the **All Search Results** area.



Play the video:



[View a video of how to search for error codes using the Product Detail Page \(PDP\) or the Error Code Lookup tool.](#)

## Search for error codes from the WISE home page

Learn how to search for a specific error code from the WISE home page.


1. On the WISE home page, enter a printer model number (for example, M606) in the **Search** dialog box.



2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.



**NOTE:** Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

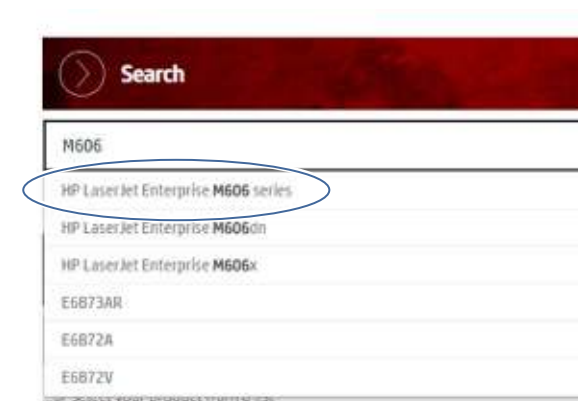

3. Type the error code (for example, 13.E1.D3) in the **Search** keyword field, and then select the search icon.



4. The error code troubleshooting content displays in the **All Search Results** area.



## Using WISE to access repair and replace videos for FRUs

Learn how to use WISE to access repair and replace videos for FRUs.



**NOTE:** The model used in the instructional videos is an example. The same steps apply to all printer models.



You will need the printer type (e.g. HP LaserJet), model number (e.g. M607), and bundle option (e.g. dn, dh, z).

## Search for videos using the Product Detail Page (PDP)

Learn how to search WISE for product specific information. Quickly review the steps and then play the video.

1. Enter a printer model number (for example, M606) in the **Go to a Product Detail page** dialog box.




**TIP:** To find a Product Detail Page (PDP) from a list of products by product type, select the **...or select your product from a list** item just below the dialog box.



2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.



**NOTE:** Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

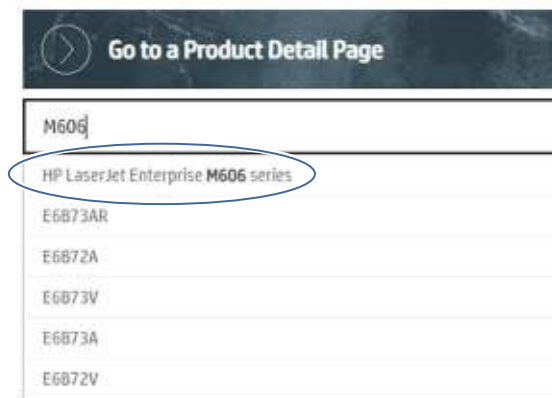


3. Select the link to **Videos** in the **Other Content** menu at the bottom-right of the screen.



4. Select the desired video from the list of videos.



**TIP:** Select the **Add Or Remove Hardware & Customer Self Repair** filter under **Troubleshooting** to limit the search results to repair and replace videos.

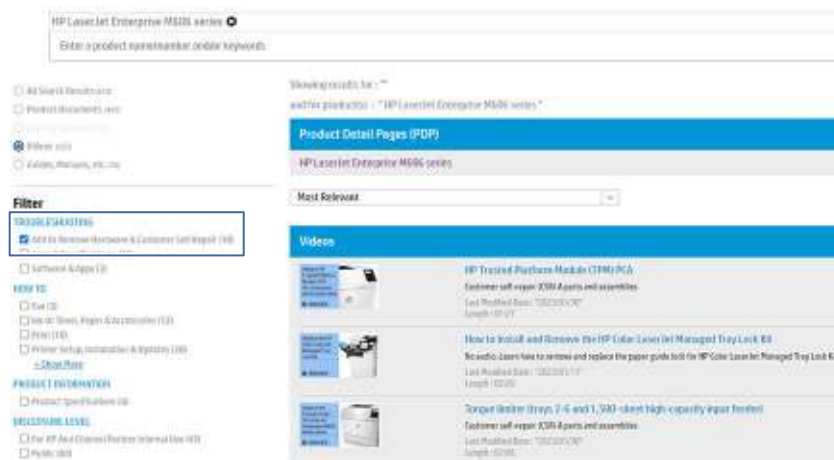

**Play the video:**




[View a video of how to search for the printer's Product Detail Page \(PDP\)](#)

## Search for videos using the WISE search function


Learn how to search WISE using the model number. Quickly review the steps and then play the video.

1. On the WISE home page, enter a printer model number (for example, M606) in the **Search** dialog box.

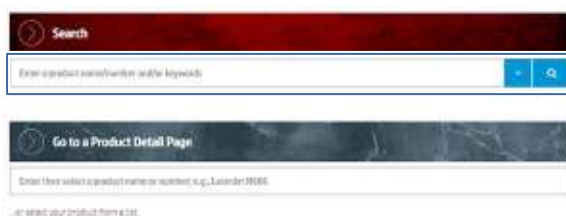

2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.


 **NOTE:** Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

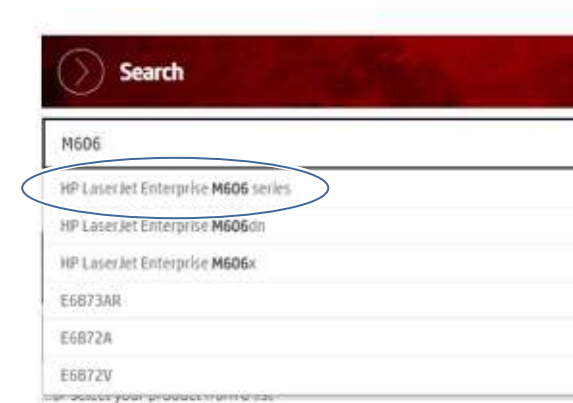

3. Select the search icon.



4. To refine the search results, select the radio button labeled **Videos** in the upper-right portion of the screen.

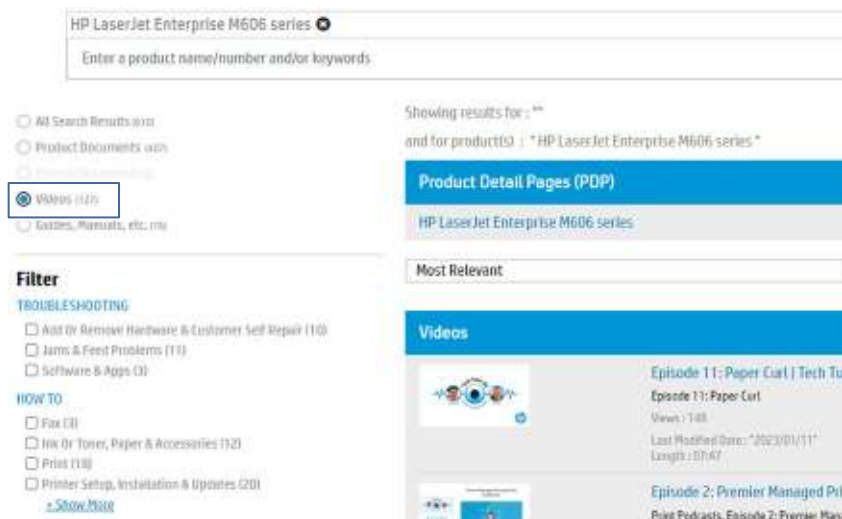

 **TIP:** To refine video search results, type a part name in the keyword search bar, and then select the search icon. For example, entering the word **fuser** to the keyword search bar returns videos related to repair and replacement of the fuser.

HP LaserJet Enterprise M605 series

Fuser

☐ All Search Results (0)

☐ Product Documents (0)

☒ Videos (0)

☐ Guides, Manuals, PDFs (0)

**Filter**

**TROUBLESHOOTING**

☐ Add Or Remove Hardware & Customer Self Repair (1)

☐ Toner & Print Problems (1)

**DISCLOSURE LEVEL**

☐ Public Use

Showing results for: "Fuser"  
and for product(s): "HP LaserJet Enterprise M605 series"

**Product Detail Pages (PDP)**

HP LaserJet Enterprise M605 series

Most Relevant

**Videos**

 **Clear paper jams in the fuser area**  
Clear paper jams  
Last Modified Date: "2022/08/02"  
Length: 01:51

 **Fuser**  
No audio. Customer self-repair (CSR) & parts and assemblies.  
Last Modified Date: "2022/08/02"  
Length: 01:54

Play the video:



[View a video of how to perform a model number search](#)

---

## 5 Printer service information

Last update: March 12, 2024

Service mode PIN number:

M750: 11075013



**NOTE:** When possible, always update the printer firmware to the latest available version at [HP.com](https://www.hp.com) as part of the troubleshooting performed for any of the following errors.

---

---

## 6 Numerical control panel messages

Use the following numerical error message troubleshooting to resolve your issue.

### 10.wx.yz Error Messages

#### 10.wx.yz error messages

Errors in the 10.\* family are related to toner cartridges and other supply items that require regular replacement as part of routine printer maintenance.

Order replacement supplies and install them as necessary. To order parts, go to <https://www.hp.com/buy/parts>.

Use the following list to identify the supply item affected:



---

**NOTE:** Not all printers have all of these supplies.

---

- 10.00.XX = Black toner cartridge
- 10.01.XX = Cyan toner cartridge
- 10.02.XX = Magenta toner cartridge
- 10.03.XX = Yellow toner cartridge
- 10.10.XX = Transfer roller
- 10.22.XX = Transfer Belt
- 10.23.XX = Fuser kit
- 10.31.XX = Toner collection unit
- 10.39.XX = Document feeder kit
- 10.99.XX = One or more supply items have been installed

#### Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at [www.hp.com/go/contactHP](https://www.hp.com/go/contactHP).

To order parts, go to <https://www.hp.com/buy/parts>.

1. For toner cartridges:
  - a. Remove and reinstall the cartridge.
  - b. Check the electronic chip on the cartridge if it is visible. If the chip is damaged, replace the toner cartridge.
  - c. If print quality is unacceptable, or if printing cannot continue, replace the toner cartridge.
2. For the transfer kit:
  - a. Remove and then reinstall the transfer unit.
  - b. If print quality is unacceptable, or if printing cannot continue, replace the transfer kit.
3. For the fuser kit:
  - a. Remove and then reinstall the fuser.

---

 **CAUTION:** The fuser might be hot.

---

  - b. If print quality is unacceptable, or if printing cannot continue, replace the fuser kit.
4. For the toner collection unit:
  - a. Remove the toner collection unit and reinstall it.
  - b. If the toner collection unit is nearly full, replace it with a new one. Using a toner collection unit until it is overfilled can damage the printer.
5. For the document feeder kit:
  - a. Open the document feeder top cover and inspect the rollers for obvious dirt or wear. Clean the rollers if necessary.
  - b. Install a new roller kit.

## 10 . 0x . y0 Supply memory error

The printer cannot read or write to at least one print cartridge memory tag or a memory tag is missing from a print cartridge.

### Memory error

- **10.00.00** (event code)  
Black print cartridge
- **10.01.00** (event code)  
Cyan print cartridge
- **10.02.00** (event code)  
Magenta print cartridge
- **10.03.00** (event code)  
Yellow print cartridge

#### E-label missing

- **10.00.10** (event code)  
Black print cartridge
- **10.01.10** (event code)  
Cyan print cartridge
- **10.02.10** (event code)  
Magenta print cartridge
- **10.03.10** (event code)  
Yellow print cartridge

#### Recommended action

1. Remove, and then reinstall the indicated print cartridge.
2. If the error reappears, turn the power off, and then on.
3. Check the cartridge e-label. If it is damaged, replace the cartridge.
4. If the error persists, replace the indicated print cartridge.

#### 10 . 22 . 50

The transfer kit life was reset above the order threshold.

A new ITB was installed.

#### Recommended action

- No action is necessary.

#### 10 . 22 . 51

The transfer kit life was reset above the replace threshold.

A new ITB was installed.

#### Recommended action

- No action is necessary.

#### 10 . 22 . 52

The transfer kit life was reset above the reset threshold.

A new ITB was installed.

#### Recommended action

- No action is necessary.



### 10.23.50

The fuser kit life was reset above the order threshold.

A new fuser was installed.

#### Recommended action

- No action is necessary.

### 10.23.51

The fuser kit life was reset above the replace threshold.

A new fuser was installed.

#### Recommended action

- No action is necessary.

### 10.23.52

The fuser kit life was reset above the reset threshold.

A new ITB was installed.

#### Recommended action

- No action is necessary.

### 10.23.70 Printing past very low

The fuser kit is very low. The actual remaining fuser kit life may vary.

10.23.70 (event code) Fuser Kit

#### Recommended action

- If print quality is no longer acceptable, the customer must order and pay for a replacement fusing assembly (fuser kit).



**IMPORTANT:** When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

Fuser kit (110V) part number: CE707-67912

Fuser kit (220V) part number: CE707-67913



**NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.



**NOTE:** Advise the customer that HP recommends that they have replacement supplies available to install when the print quality is no longer acceptable.

## 10 .xx . 34 Used supply in use

The indicated cartridge is used.

- 10 . 00 . 34 (event code)  
Black print cartridge
- 10 . 01 . 34 (event code)  
Cyan print cartridge
- 10 . 02 . 34 (event code)  
Magenta print cartridge
- 10 . 03 . 34 (event code)  
Yellow print cartridge

### Recommended action

- Make sure this is a genuine HP supply.



**NOTE:** Removing a cartridge from one printer and then installing it in a different printer (for testing functionality) will cause this event code.

## 10 .xx . 40 Genuine HP supplies installed

More than one genuine HP print cartridge has been installed.

- 10 . 00 . 40 (event code)  
Black print cartridge
- 10 . 01 . 40 (event code)  
Cyan print cartridge
- 10 . 02 . 40 (event code)  
Magenta print cartridge
- 10 . 03 . 40 (event code)  
Yellow print cartridge

### Recommended action

- No action is necessary.

## 10 .xx . 41 Unsupported supply in use

The indicated print cartridge is for a different printer.

- 10 . 00 . 41 (event code)  
Black print cartridge

- 10 . 01 . 41 (event code)  
Cyan print cartridge
- 10 . 02 . 41 (event code)  
Magenta print cartridge
- 10 . 03 . 41 (event code)  
Yellow print cartridge

### Recommended action

- Remove the indicated print cartridge, and then install the correct cartridge for this printer.  
Black print cartridge part number: CE270-67901  
Cyan print cartridge part number: CE271-67901  
Yellow print cartridge part number: CE272-67901  
Magenta print cartridge part number: CE273-67901

## 10 . wx . 70 Printing past very low

The printer indicates when one of the consumables is very low. The actual remaining consumable life might vary.

You do not need to replace the consumable at this time unless print quality is no longer acceptable.

- 10 . 00 . 70 (event code)  
Black print cartridge
- 10 . 01 . 70 (event code)  
Cyan print cartridge
- 10 . 02 . 70 (event code)  
Magenta print cartridge
- 10 . 03 . 70 (event code)  
Yellow print cartridge

### Recommended action

- If print quality is no longer acceptable, replace the indicated print cartridge or fuser kit.  
Black print cartridge part number: CE270A  
Cyan print cartridge part number: CE271A  
Yellow print cartridge part number: CE272A  
Magenta print cartridge part number: CE273A



**TIP:** HP recommends that customers have replacement supplies available to install when the print quality is no longer acceptable.

## 10 . YY . 15 Install <supply>

The indicated supply has been removed or installed incorrectly.

- 10 . 00 . 15 (event code)  
Black print cartridge
- 10 . 01 . 15 (event code)  
Cyan print cartridge
- 10 . 02 . 15 (event code)  
Magenta print cartridge
- 10 . 03 . 15 (event code)  
Yellow print cartridge
- 10 . 23 . 15  
Fuser
- 10 . 31 . 15  
Toner collection unit (TCU)

### Recommended action

- Replace or install the indicated supply.  
Black print cartridge part number: CE270-67901  
Cyan print cartridge part number: CE271-67901  
Yellow print cartridge part number: CE272-67901  
Magenta print cartridge part number: CE273-67901  
Fuser kit (110V) part number: CE707-67912  
Fuser kit (220V) part number: CE707-67913  
Toner collection unit kit part number: CE980-67901



**NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

## 10 . YY . 25 Wrong cartridge in <color> slot

The indicated cartridge is installed in the wrong position.

- 10 . 00 . 25 (event code)  
Black print cartridge
- 10 . 01 . 25 (event code)  
Cyan print cartridge
- 10 . 02 . 25 (event code)

Magenta print cartridge

- 10 . 03 . 25 (event code)

Yellow print cartridge

### Recommended action

- Install the indicated cartridge in the correct position. From left to right, the correct cartridge order follows:
  - Yellow
  - Magenta
  - Cyan
  - Black

### 10 . YY . 35 Incompatible <supply>

The indicated cartridge is not compatible with this printer.

- 10 . 00 . 35 (event code)

Black print cartridge

- 10 . 01 . 35 (event code)

Cyan print cartridge

- 10 . 02 . 35 (event code)

Magenta print cartridge

- 10 . 03 . 35 (event code)

Yellow print cartridge

- 10 . 23 . 35 (event code)

Fuser

---

 **CAUTION:** The fuser might be hot. Be careful when removing the fuser.

---

### Recommended action

- Install a supply that is designed for this printer.
  - Black print cartridge part number: CE270-67901
  - Cyan print cartridge part number: CE271-67901
  - Yellow print cartridge part number: CE272-67901
  - Magenta print cartridge part number: CE273-67901
  - Fuser kit (110V) part number: CE707-67912

Fuser kit (220V) part number: CE707-67913



**NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

See the parts chapter in the printer repair manual for the correct supply part number.

## 11.wx.yz Error Messages

### 11.\* errors

Errors in the 11.\* family are related to the printer real-time clock.

#### Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Set the time and date on the printer control panel.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Set the time and date on the printer control panel.
2. If the error persists, remove and reinstall the formatter. Make sure it is fully seated.
3. If the error still persists, replace the formatter.

### 11.00.yy Internal clock error

The printer real-time clock has experienced an error.

- 11.00.01 : Internal clock battery has zero voltage.
- 11.00.02 : Real-time clock has failed.

#### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on. Set the time and date at the control panel.

2. If the error persists, replace the formatter.

Part number: D3L08-67901

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

## 13.wx.yz Error Messages

### 13.\* errors

Errors in the 13.\* family are related to jams.

More than 1000 unique error codes are possible. Use the following information to understand the jam code. Not all codes apply to all printers.

Message format: 13.WX.YZ

- W represents the jam location.
- X represents the sensor or door that triggered the jam.
- Y represents the jam condition (delay, stay, wrap, etc.)
- Z represents the paper source, fuser mode, or destination

**Table 6-1** Potential values for W and X

| W | Jam location | X | Sensor or door                                              |
|---|--------------|---|-------------------------------------------------------------|
| A | Input area   | 0 | Envelope feeder                                             |
| A | Input area   | 1 | Tray 1 feed (unless Tray 1 feed is the registration sensor) |
| A | Input area   | 2 | Tray 2 feed (unless Tray 2 feed is the registration sensor) |
| A | Input area   | 3 | Tray 3 feed                                                 |
| A | Input area   | 4 | Tray 4 feed                                                 |
| A | Input area   | 5 | Tray 5 feed                                                 |
| A | Input area   | 6 | Tray 6 feed                                                 |
| A | Input area   | 7 | Optional tray exit sensor                                   |
| A | Input area   | A | Door 1                                                      |
| A | Input area   | B | Door 2                                                      |
| A | Input area   | C | Door 3                                                      |
| A | Input area   | D | Door 4                                                      |
| A | Input area   | E | Door 5                                                      |
| A | Input area   | F | Multiple sensors or doors                                   |
| B | Image area   | 0 | Media sensor for forbidden transparencies                   |
| B | Image area   | 2 | Registration/top of page                                    |
| B | Image area   | 3 | Top of page                                                 |

**Table 6-1 Potential values for W and X (continued)**

| W | Jam location                                                      | X | Sensor or door                              |
|---|-------------------------------------------------------------------|---|---------------------------------------------|
| B | Image area                                                        | 4 | Loop                                        |
| B | Image area                                                        | 5 | Fuser input                                 |
| B | Image area                                                        | 9 | Fuser output                                |
| B | Image area                                                        | A | Door 1                                      |
| B | Image area                                                        | B | Door 2                                      |
| B | Image area                                                        | F | Multiple sensors or doors                   |
| C | Switchback area (between the fuser and the output bin)            | 1 | Intermediate switchback sensor              |
| C | Switchback area (between the fuser and the output bin)            | 2 | Switchback media stay sensor                |
| C | Switchback area (between the fuser and the output bin)            | 3 | Paper delivery sensor                       |
| D | Duplex area                                                       | 1 | Duplex switchback                           |
| D | Duplex area                                                       | 2 | Duplex delivery                             |
| D | Duplex area                                                       | 3 | Duplex refeed                               |
| D | Duplex area                                                       | A | Door 1 (if different than the imaging area) |
| D | Duplex area                                                       | B | Door 2 (if different than the imaging area) |
| D | Duplex area                                                       | F | Multiple sensors or doors                   |
| E | Output or intermediate paper transport unit (IPTU) area           | 1 | Output bin full sensor                      |
| E | Output or intermediate paper transport unit (IPTU) area           | 2 | IPTU feed sensor 1                          |
| E | Output or intermediate paper transport unit (IPTU) area           | 3 | IPTU sensor 2                               |
| E | Output or intermediate paper transport unit (IPTU) area           | 4 | IPTU sensor 3                               |
| E | Output or intermediate paper transport unit (IPTU) area           | 5 | IPTU bin full sensor 4                      |
| E | Output or intermediate paper transport unit (IPTU) area           | 6 | Output sensor                               |
| E | Output or intermediate paper transport unit (IPTU) area           | A | Door 1                                      |
| E | Output or intermediate paper transport unit (IPTU) area           | F | Multiple sensors or doors                   |
| F | Multiple subsystems (occurs when paper is stuck in several areas) | F | Multiple sensors or doors                   |
| 1 | Jetlink input device                                              | 4 | Tray 4 feed sensor                          |
| 1 | Jetlink Input device                                              | 5 | Tray 5 feed sensor                          |
| 1 | Jetlink Input device                                              | 6 | Tray 6 feed sensor                          |
| 1 | Jetlink Input device                                              | 7 | Tray 7 feed sensor                          |



**Table 6-1** Potential values for W and X (continued)

| W | Jam location                 | X | Sensor or door                         |
|---|------------------------------|---|----------------------------------------|
| 1 | Jetlink Input device         | 8 | Tray 8 feed sensor                     |
| 1 | Jetlink Input device         | 9 | Tray 9 feed sensor                     |
| 1 | Jetlink Input device         | A | Door 1                                 |
| 1 | Jetlink Input device         | B | Door 2                                 |
| 1 | Jetlink Input device         | F | Multiple sensors or doors              |
| 2 | Buffer pass unit             | 0 | Buffer pass inlet sensor               |
| 2 | Buffer pass unit             | 9 | Buffer pass exit sensor                |
| 2 | Buffer pass unit             | A | Door 1                                 |
| 3 | Page insert unit             | 0 | Page insertion inlet sensor            |
| 3 | Page insert unit             | 1 | Page insertion tray 1 feed sensor      |
| 3 | Page insert unit             | 2 | Page insertion tray 2 feed sensor      |
| 3 | Page insert unit             | 3 | Page insertion tray 3 feed sensor      |
| 3 | Page insert unit             | 4 | Page insertion tray 4 feed sensor      |
| 3 | Page insert unit             | 7 | Output path feed sensor                |
| 3 | Page insert unit             | 9 | Page insertion exit sensor             |
| 3 | Page insert unit             | A | Door 1                                 |
| 4 | Punch unit                   | 0 | Puncher inlet sensor                   |
| 4 | Punch unit                   | 1 | Puncher jam sensor                     |
| 4 | Punch unit                   | 9 | Puncher exit sensor                    |
| 4 | Punch unit                   | A | Door 1                                 |
| 5 | Folding unit                 | 0 | Folder inlet sensor                    |
| 5 | Folding unit                 | 1 | Folder sensor                          |
| 5 | Folding unit                 | 9 | Folder exit sensor                     |
| 5 | Folding unit                 | A | Door 1                                 |
| 6 | Stacker unit                 | 0 | Stacker inlet sensor                   |
| 6 | Stacker unit                 | 4 | Stacker outlet sensor                  |
| 6 | Stacker unit                 | 7 | Stacker switchback entrance sensor     |
| 6 | Stacker unit                 | 8 | Stacker switchback registration sensor |
| 6 | Stacker unit                 | 9 | Stacker switchback lower sensor        |
| 7 | Multi-bin mailbox (MBM) unit | 0 | MBM inlet sensor                       |
| 7 | Multi-bin mailbox (MBM) unit | 1 | MBM middle sensor                      |
| 7 | Multi-bin mailbox (MBM) unit | 9 | Stapler sensor                         |
| 7 | Multi-bin mailbox (MBM) unit | A | Door 1                                 |
| 7 | Multi-bin mailbox (MBM) unit | B | Door 2                                 |

**Table 6-1** Potential values for W and X (continued)

| W | Jam location                 | X | Sensor or door                           |
|---|------------------------------|---|------------------------------------------|
| 7 | Multi-bin mailbox (MBM) unit | C | Door 3                                   |
| 7 | Multi-bin mailbox (MBM) unit | F | Multiple sensors or doors                |
| 8 | Stapler/stacker (SS) unit    | 0 | SS inlet sensor                          |
| 8 | Stapler/stacker (SS) unit    | 1 | SS Bin Z                                 |
| 8 | Stapler/stacker (SS) unit    | 3 | SS unit middle sensor                    |
| 8 | Stapler/stacker (SS) unit    | 4 | SS unit outlet sensor 1                  |
| 8 | Stapler/stacker (SS) unit    | 5 | SS unit outlet sensor 2                  |
| 8 | Stapler/stacker (SS) unit    | 9 | Stapler sensor                           |
| 8 | Stapler/stacker (SS) unit    | A | Door 1                                   |
| 8 | Stapler/stacker (SS) unit    | B | Door 2                                   |
| 9 | Booklet maker unit           | 0 | Booklet maker input sensor               |
| 9 | Booklet maker unit           | 2 | Booklet maker feed sensor 2              |
| 9 | Booklet maker unit           | 2 | Booklet maker feed sensor 3              |
| 9 | Booklet maker unit           | 4 | Booklet maker delivery sensor            |
| 9 | Booklet maker unit           | 5 | Booklet maker vertical paper path sensor |
| 9 | Booklet maker unit           | 6 | Booklet unit front staple sensor         |
| 9 | Booklet maker unit           | 7 | Booklet unit rear staple sensor          |
| 9 | Booklet maker unit           | 8 | Booklet unit outlet sensor               |
| 9 | Booklet maker unit           | A | Door 1                                   |
| 9 | Booklet maker unit           | B | Door 2                                   |
| 9 | Booklet maker unit           | C | Door 3                                   |
| 9 | Booklet maker unit           | F | Multiple sensors or doors                |
| 0 | Unknown                      | 0 | Unknown                                  |

**Table 6-2** Potential values for Y (jam condition)

| Y | Jam condition                                     |
|---|---------------------------------------------------|
| 0 | Unknown                                           |
| 1 | Unexpected sheet (duplex)                         |
| 2 | Staple jam                                        |
| 3 | Jam caused by an open door (duplex)               |
| 4 | Stay jam (the page never left the tray - duplex)  |
| A | Stay jam (the page never left the tray - simplex) |
| B | Multifeed                                         |
| C | Wrap                                              |

**Table 6-2 Potential values for Y (jam condition) (continued)**

| Y | Jam condition                                                                |
|---|------------------------------------------------------------------------------|
| D | Delay (the page did not reach the sensor within the expected time – simplex) |
| E | Door open                                                                    |
| F | Residual (paper is detected in the paper path when it should not be there)   |

The information represented by the value for Z depends on where the paper is in the paper path.

**Table 6-3 Potential values for Z (source, fuser mode, or destination)**

| Paper location                                                                                                                                                                                                          | Z | Source, fuser mode, or destination                                                         |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---|--------------------------------------------------------------------------------------------|
| <b>When paper has not reached the fuser, Z represents the paper source.</b>                                                                                                                                             | 1 | Tray 1                                                                                     |
| Z represents the paper source.                                                                                                                                                                                          | 2 | Tray 2                                                                                     |
| Z represents the paper source.                                                                                                                                                                                          | 3 | Tray 3                                                                                     |
| Z represents the paper source.                                                                                                                                                                                          | 4 | Tray 4                                                                                     |
| Z represents the paper source.                                                                                                                                                                                          | 5 | Tray 5                                                                                     |
| Z represents the paper source.                                                                                                                                                                                          | 6 | Tray 6                                                                                     |
| Z represents the paper source.                                                                                                                                                                                          | D | Duplexer                                                                                   |
| Z represents the paper source.                                                                                                                                                                                          | E | Envelope feeder                                                                            |
| <b>When paper has reached the fuser, is in the duplex path, or in the output path, Z represents the fuser mode.</b><br><br>Jams can occur when there is a mismatch between the actual paper and the fuser mode setting. | 0 | Photo 1, 2, or 3<br><br>Designated 2 or 3                                                  |
| Z represents the fuser mode.                                                                                                                                                                                            | 1 | Normal (automatically sensed rather than based on the paper type set at the control panel) |
| Z represents the fuser mode.                                                                                                                                                                                            | 2 | Normal (based on the paper type set at the control panel)                                  |
| Z represents the fuser mode.                                                                                                                                                                                            | 3 | Light 1, 2, or 3                                                                           |
| Z represents the fuser mode.                                                                                                                                                                                            | 4 | Heavy 1                                                                                    |
| Z represents the fuser mode.                                                                                                                                                                                            | 5 | Heavy 2                                                                                    |
| Z represents the fuser mode.                                                                                                                                                                                            | 6 | Heavy 3                                                                                    |
| Z represents the fuser mode.                                                                                                                                                                                            | 7 | Glossy 1                                                                                   |
| Z represents the fuser mode.                                                                                                                                                                                            | 8 | Glossy 2                                                                                   |
| Z represents the fuser mode.                                                                                                                                                                                            | 9 | Glossy 3                                                                                   |
| Z represents the fuser mode.                                                                                                                                                                                            | A | Glossy Film                                                                                |
| Z represents the fuser mode.                                                                                                                                                                                            | B | Transparency                                                                               |
| Z represents the fuser mode.                                                                                                                                                                                            | C | Label                                                                                      |
| Z represents the fuser mode.                                                                                                                                                                                            | D | Envelope 1, 2, or 3                                                                        |

**Table 6-3 Potential values for Z (source, fuser mode, or destination) (continued)**

| Paper location                                                                                   | Z | Source, fuser mode, or destination |
|--------------------------------------------------------------------------------------------------|---|------------------------------------|
| Z represents the fuser mode.                                                                     | E | Rough                              |
| When paper has entered the output bin, Z represents the output bin, numbered from top to bottom. | 0 | Unknown bin                        |
| Z represents the output bin                                                                      | 1 | Bin 1                              |
| Z represents the output bin                                                                      | 2 | Bin 2                              |
| Z represents the output bin                                                                      | 3 | Bin 3                              |
| Z represents the output bin                                                                      | 4 | Bin 4                              |
| Z represents the output bin                                                                      | 5 | Bin 5                              |
| Z represents the output bin                                                                      | 6 | Bin 6                              |
| Z represents the output bin                                                                      | 7 | Bin 7                              |
| Z represents the output bin                                                                      | 8 | Bin 8                              |
| Z represents the output bin                                                                      | 9 | Bin 9                              |
| All paper locations                                                                              | E | Door open jam                      |
| All paper locations                                                                              | F | Residual jam                       |
| All paper locations                                                                              | 0 | Forbidden OHT jam (when Y=2)       |

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size, and the tray should not be filled above the maximum fill marks or tabs.
4. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
5. Use a damp, lint-free cloth to clean the rollers in the appropriate tray. Replace rollers that are worn.
6. Open all doors and covers and ensure the paper path is completely clear of paper or obstructions.
7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

To prevent future paper jams in the printer, follow these recommendations:

- Use only paper that meets HP specifications for this printer.

For more information, refer to the printer User Guide or search for the "HP LaserJet Printers - Print Media Guide" (c06117757) [Or click here: HP LaserJet Print Media Guide](#).

- Make sure the printing environment is within recommended specifications.
- Do not use paper that is wrinkled, folded, or damaged.
- Do not overload the tray with paper.
- Make sure that the paper guides in the tray are adjusted correctly for the size of paper.
- Make sure that the tray is fully inserted in the printer.
- If printing on heavy, embossed, or perforated paper, use the manual feed feature and feed sheets one at a time.
- Open the [Trays](#) menu on the printer control panel. Verify that the tray is configured correctly for the paper type and size.

### Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size, and the tray should not be filled above the maximum fill marks or tabs.
4. Verify that the paper meets specifications for this printer.
5. Use a damp, lint-free cloth to clean the rollers in the appropriate tray. Replace rollers that are worn.
6. If the issue persists, open the [Administration > Troubleshooting > Diagnostic Tests > Component Test](#) menu, and perform the appropriate pickup/feed motor drive test. Replace the pickup assembly if the test fails.
7. Verify the sensors are functioning correctly. If the sensors fail the test, first verify that all connections on the DC controller are correctly seated. If possible, replace the sensor or assembly it is associated with.
8. If the sensors pass the test, look for blockage or damaged parts and replace any damaged parts.
9. If the error persists, elevate the case using the Standard Support Process.

## 13.00.00

Generic jam event code.

### Recommended action

- Check the printer for a jam. See the Clear jams section in the service manual for more information.

## 13.A3.D3

Misfeed jam from tray 3. No-pick jam from tray 3. The leading edge of paper fed from Tray 3 is stopped before SR1 HCI Tray 3 media feed sensor PS3302 (sensor does not detect the leading edge of paper

within a specified period), including a two time retry, after the HCI right cassette pickup solenoid is turned on.

### Recommended action for customer

1. Open Tray 3, remove any jammed paper, and then close the tray.
2. Open the lower right side door and remove any paper stopped in the paper path.
3. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
4. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
5. Inspect the Tray 3 pick, feed, and separation rollers. Clean or replace the rollers, if necessary.



---

**NOTE:** Use a dampened lint free cloth to clean the rollers.

---

Roller Part number: CC522-67909

6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Open Tray 3, remove any jammed paper, and then close the tray.
2. Open the lower right side door and remove any paper stopped in the paper path.
3. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
4. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
5. Inspect the Tray 3 pick, feed, and separation rollers. Clean or replace the rollers, if necessary.



---

**NOTE:** Use a dampened lint free cloth to clean the rollers.

---

Roller Part number: CC522-67909

6. Check the connectors at the feed sensor, solenoid, feed motor, and the controller PCA.
7. Use the **Tray/bin manual sensor tests** to toggle the Tray 3 feed sensor. If the sensor or lever is not properly functioning, replace the Tray 3 paper pickup assembly.

Part number: RM1-6944-000CN

8. Use the **Component tests** to activate the Tray 3 solenoid. Listen for the solenoid to activate. If the solenoid is not properly functioning, replace the Tray 3 paper pickup assembly.

Part number: RM1-6944-000CN

9. Use the **Component tests** to activate the Tray 3 motor. Listen for the motor to activate. If the motor is not properly functioning, replace the Tray 3 pickup motor.

Part number: RK2-1331-000CN

### 13.A3.D4

Late to tray 3 feed sensor jam from tray 4. Late to path jam from Tray 4. This jam occurs when the paper does not reach the Tray 3 feed sensor SR1 in a designated amount of time after the Tray 4 feed sensor SR1 sensed the leading edge.

#### 500-sheet trays

- The leading edge of paper fed from Tray 4 is stopped before Tray 3 SR1 after passing Tray 4 SR1.

#### High capacity input feeder

- The HCI media feed sensor PS3301 does not detect the leading edge of paper within a specified period after the Tray 4 cassette media feed sensor PS3305 detects the leading edge of paper.

### Recommended action for customers

1. Open the lower-right door, remove any jammed paper, and then close the door.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
4. Inspect the Tray 4 pick, feed, and separation rollers. Clean or replace the rollers, if necessary.



---

**NOTE:** Use a dampened lint free cloth to clean the rollers.

---

Roller Part number: CC522-67909

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Open the lower-right door, remove any jammed paper, and then close the door.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
4. Inspect the Tray 4 pick, feed, and separation rollers. Clean or replace the rollers, if necessary.



---

**NOTE:** Use a dampened lint free cloth to clean the rollers.

---

Roller Part number: CC522-67909

5. Check the connectors at the feed sensor, solenoid, feed motor, and the controller PCA.
6. Use the **Tray/bin manual sensor tests** to toggle the Tray 4 feed sensor. If the sensor or lever is not properly functioning, replace the Tray 4 paper pickup assembly.

Part number: RM1-6944-000CN

7. Use the **Component tests** to activate the Tray 4 solenoid. Listen for the solenoid to activate. If the solenoid is not properly functioning, replace the Tray 4 paper pickup assembly.  
Part number: RM1-6944-000CN
8. Use the **Component tests** to activate the Tray 4 motor. Listen for the motor to activate. If the motor is not properly functioning, replace the Tray 4 pickup motor.  
Part number: RK2-1331-000CN
9. Use the **Tray/bin manual sensor tests** to toggle the Tray 3 feed sensor. If the sensor or lever is not properly functioning, replace the Tray 3 paper pickup assembly.  
Part number: RM1-6944-000CN

### 13.A3.D5

Late to tray 3 feed sensor jam from tray 5. Late to path jam from Tray 5. This jam occurs when the paper does not reach the Tray 3 feed sensor SR1 in a specified amount of time after the Tray 5 feed sensor SR81 sensed the leading edge.

#### Recommended action for customers

1. Open the lower-right door, remove any jammed paper, and then close the door.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
4. Inspect the Tray 5 pick, feed, and separation rollers. Clean or replace the rollers, if necessary.  
Part number: CC522-67909
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action for call-center agents and onsite technicians

1. Open the lower-right door, remove any jammed paper, and then close the door.
2. Inspect the Tray 5 pick, feed, and separation rollers. Clean or replace the rollers, if necessary.  
Part number: CC522-67909
3. Check the connectors at the feed sensor, solenoid, feed motor, and the controller PCA.
4. Use the **Tray/bin manual sensor tests** to toggle the Tray 5 feed sensor. If the sensor or lever is not properly functioning, replace the Tray 5 paper pickup assembly.  
Part number: RM1-6944-000CN
5. Use the **Component tests** to activate the Tray 5 solenoid. Listen for the solenoid to activate. If the solenoid is not properly functioning, replace the Tray 5 paper pickup assembly.  
Part number: RM1-6944-000CN



6. Use the **Component tests** to activate the Tray 5 motor. Listen for the motor to activate. If the motor is not properly functioning, replace the Tray 5 pickup motor.

Part number: RK2-1331-000CN

7. Use the **Tray/bin manual sensor tests** to toggle the Tray 3 feed sensor. If the sensor or lever is not properly functioning, replace the Tray 3 paper pickup assembly.

Part number: RM1-6944-000CN

### 13.A3.D6

Late to Tray 3 feed sensor jam, from Tray 6. Late to path jam from Tray 6. The leading edge of paper fed from Tray 6 is stopped before Tray 3 SR1 after passing Tray 6 SR91.

#### Recommended action for customers

1. Open the lower-right door, remove any jammed paper, and then close the door.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
4. Check the connectors at the feed sensor, solenoid, feed motor, and the controller PCA.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action for call-center agents and onsite technicians

1. Open the lower-right door, remove any jammed paper, and then close the door.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

4. Inspect the Tray 6 pick, feed, and separation rollers. Clean or replace the rollers, if necessary.

Part number: CC522-67909

5. Check the connectors at the feed sensor, solenoid, feed motor, and the controller PCA.
6. Use the **Tray/bin manual sensor tests** to toggle the Tray 6 feed sensor. If the sensor or lever is not properly functioning, replace the Tray 6 paper pickup assembly.

Part number: RM1-6944-000CN

7. Use the **Component tests** to activate the Tray 6 solenoid. Listen for the solenoid to activate. If the solenoid is not properly functioning, replace the Tray 6 paper pickup assembly.

Part number: RM1-6944-000CN

8. Use the **Component tests** to activate the Tray 6 motor. Listen for the motor to activate. If the motor is not properly functioning, replace the Tray 6 pickup motor.

Part number: RK2-1331-000CN

9. Use the **Tray/bin manual sensor tests** to toggle the Tray 3 feed sensor. If the sensor or lever is not properly functioning, replace the Tray 3 paper pickup assembly.

Part number: RM1-6944-000CN

### 13.A3.FF

Power on jam, tray 3 feed sensor. Power on residual paper jam.

This jam occurs when the paper exists at SR1 at power on or door close. Due to the current firmware timing requirements, the displayed jam code is always 13.FF.FF (the event log will have 13.WX.FF).

#### Recommended action for customers

1. Open the lower-right door, clear any jammed paper, and then close the door.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action for call-center agents and onsite technicians

1. Open the lower-right door, clear any jammed paper, and then close the door.
2. Use the **Tray/bin manual sensor tests** to toggle the Tray 3 feed sensor. If the sensor or lever is not properly functioning, check the connectors to the sensor. If the error persists, replace the Tray 3 paper pickup assembly.

Part number: RM1-6944-000CN

### 13.A4.D4

Late to tray 4 feed sensor jam, from Tray 4. No-pick jam from Tray 4.

#### 500-sheet trays

- The leading edge of paper fed from Tray 4 does not reach Tray 4 SR1 in specified amount of time.

#### High capacity input feeder

- Tray 4 media feed sensor PS3305 does not detect the leading edge of paper within a specified period, including two times retry, after the HCI left cassette pickup solenoid is turned on.

#### Recommended action for customers

1. **500-sheet trays**
  - a. Open Tray 4, clear any jammed paper, and then close the tray.
  - b. Open the lower-right door, clear any jammed paper, and then close the door.
  - c. Ensure the type and quality of the paper being used meets the HP specifications for the printer.

- d. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
- 2. **High capacity input feeder**
  - a. Open Tray 4, clear any jammed paper, and then close the tray.
  - b. Open the lower-right door, clear any jammed paper, and then close the door.
  - c. Open Tray 3, release the jam access tray and clear any jammed paper, and then close the tray.
  - d. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
  - e. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
- 3. **500-sheet trays and high capacity input feeder**
  - Inspect the Tray 4 pick, feed, and separation rollers. Clean or replace the rollers, if necessary.  
Part number: CC522-67909
- 4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

- 1. **500-sheet trays**
  - a. Open Tray 4, clear any jammed paper, and then close the tray.
  - b. Open the lower-right door, clear any jammed paper, and then close the door.
  - c. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
  - d. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
- 2. **High capacity input feeder**
  - a. Open Tray 4, clear any jammed paper, and then close the tray.
  - b. Open the lower-right door, clear any jammed paper, and then close the door.
  - c. Open Tray 3, release the jam access tray and clear any jammed paper, and then close the tray.
  - d. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
  - e. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

### 3. 500-sheet trays and high capacity input feeder

- a. Inspect the Tray 4 pick, feed, and separation rollers. Clean or replace the rollers, if necessary.

Part number: CC522-67909

- b. Check the connectors at the feed sensor, solenoid, feed motor, and the controller PCA.

- c. Use the **Tray/bin manual sensor tests** to toggle the Tray 4 feed sensor. If the sensor or lever is not properly functioning, replace the Tray 4 paper pickup assembly.

Part number: RM1-6944-000CN

- d. Use the **Component tests** to activate the Tray 4 solenoid. Listen for the solenoid to activate. If the solenoid is not properly functioning, replace the Tray 4 paper pickup assembly.

Part number: RM1-6944-000CN

- e. Use the **Component tests** to activate the Tray 4 motor. Listen for the motor to activate. If the motor is not properly functioning, replace the Tray 4 pickup motor.

Part number: RK2-1331-000CN

## 13.A4.D5

Late to path jam from Tray 5. This jam occurs when the paper does not reach the Tray 4 feed sensor SR1 in a designated amount of time after the Tray 5 feed sensor SR81 sensed the leading edge.

### Recommended action for customers

1. Open the lower-right door, remove any jammed paper, and then close the door.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
4. Inspect the Tray 5 pick, feed, and separation rollers. Clean or replace the rollers, if necessary.  
Part number: CC522-67909
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Open the lower-right door, remove any jammed paper, and then close the door.
2. Inspect the Tray 5 pick, feed, and separation rollers. Clean or replace the rollers, if necessary.  
Part number: CC522-67909
3. Check the connectors at the feed sensor, solenoid, feed motor, and the controller PCA.
4. Use the **Tray/bin manual sensor tests** to toggle the Tray 5 feed sensor. If the sensor or lever is not properly functioning, replace the Tray 5 paper pickup assembly.  
Part number: RM1-6944-000CN

5. Use the **Component tests** to activate the Tray 5 solenoid. Listen for the solenoid to activate. If the solenoid is not properly functioning, replace the Tray 5 paper pickup assembly.

Part number: RM1-6944-000CN

6. Use the **Component tests** to activate the Tray 5 motor. Listen for the motor to activate. If the motor is not properly functioning, replace the Tray 5 pickup motor.

Part number: RK2-1331-000CN

## 13.A4.D6

Late to path jam from Tray 6. This jam occurs when the paper does not reach the Tray 4 feed sensor SR1 in a designated amount of time after the Tray 6 feed sensor SR91 sensed the leading edge.

### Recommended action for customers

1. Open the lower-right door, remove any jammed paper, and then close the door.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

4. Inspect the Tray 6 pick, feed, and separation rollers. Clean or replace the rollers, if necessary.

Part number: CC522-67909

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Open the lower-right door, remove any jammed paper, and then close the door.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

4. Inspect the Tray 6 pick, feed, and separation rollers. Clean or replace the rollers, if necessary.

Part number: CC522-67909

5. Check the connectors at the feed sensor, solenoid, feed motor, and the controller PCA.
6. Use the **Tray/bin manual sensor tests** to toggle the Tray 6 feed sensor. If the sensor or lever is not properly functioning, replace the Tray 6 paper pickup assembly.
7. Use the **Component tests** to activate the Tray 6 solenoid. Listen for the solenoid to activate. If the solenoid is not properly functioning, replace the Tray 6 paper pickup assembly.

Part number: RM1-6944-000CN

8. Use the **Component tests** to activate the Tray 6 motor. Listen for the motor to activate. If the motor is not properly functioning, replace the Tray 6 pickup motor.

Part number: RK2-1331-000CN

9. Use the **Tray/bin manual sensor tests** to toggle the Tray 4 feed sensor. If the sensor or lever is not properly functioning, replace the Tray 4 paper pickup assembly.

Part number: RM1-6944-000CN

### 13.A4.FF

Power on jam, tray 4 feed sensor. Power on residual paper jam. This jam occurs when the paper exists at SR1 at power on or door close. Due to the current firmware timing requirements, the displayed jam code is always 13.FF.FF (the event log will have 13.WX.FF).

#### Recommended action for customers

1. Open the lower-right door, clear any jammed paper, and then close the door.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action for call-center agents and onsite technicians

1. Open the lower-right door, remove any jammed paper, and then close the door.
2. Use the **Tray/bin manual sensor tests** to toggle the Tray 4 feed sensor. If the sensor or lever is not properly functioning, check the connectors to the sensor. If the error persists, replace the Tray 4 paper pickup assembly.

Part number: RM1-6944-000CN

### 13.A5.A5 or 13.A5.D5

Misfeed jam from tray 5. Stopped at tray path jam from Tray 5.

Leading edge of paper fed from Tray 5 is stopped before Tray 5 SR81.

#### Recommended action for customers

1. Open Tray 4, clear any jammed paper, and then close the tray.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
4. Inspect the Tray 5 pick, feed, and separation rollers. Clean or replace the rollers, if necessary.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action for call-center agents and onsite technicians

1. Open Tray 4, clear any jammed paper, and then close the tray.

2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
4. Inspect the Tray 5 pick, feed, and separation rollers. Clean or replace the rollers, if necessary.
5. Check the connectors at the feed sensor, solenoid, feed motor, and the controller PCA.
6. Use the **Tray/bin manual sensor tests** to toggle the Tray 5 feed sensor. If the sensor or lever is not properly functioning, replace the Tray 5 paper pickup assembly.

Part number: RM1-6944-000CN

7. Use the **Component tests** to activate the Tray 5 solenoid. Listen for the solenoid to activate. If the solenoid is not properly functioning, replace the Tray 5 paper pickup assembly.

Part number: RM1-6944-000CN

8. Use the **Component tests** to activate the Tray 5 motor. Listen for the motor to activate. If the motor is not properly functioning, replace the Tray 5 pickup motor.

Part number: RK2-1331-000CN

## 13.A5.D6

Late to path jam from Tray 6. This jam occurs when the paper does not reach the Tray 5 feed sensor SR81 in a designated amount of time after the Tray 6 feed sensor SR91 sensed the leading edge.

### Recommended action

1. Open the lower-right door, clear any jammed paper, and then close the door.
2. Inspect the Tray 6 pick, feed, and separation rollers. Clean or replace the rollers, if necessary.

Part number: CC522-67909

3. Check the connectors at the feed sensor, solenoid, feed motor, and the controller PCA.
4. Use the **Tray/bin manual sensor tests** to toggle the Tray 6 feed sensor. If the sensor or lever is not properly functioning, replace the Tray 6 paper pickup assembly.

Part number: RM1-6944-000CN

5. Use the **Component tests** to activate the Tray 6 solenoid. Listen for the solenoid to activate. If the solenoid is not properly functioning, replace the Tray 6 paper pickup assembly.

Part number: RM1-6944-000CN

6. Use the **Component tests** to activate the Tray 6 motor. Listen for the motor to activate. If the motor is not properly functioning, replace the Tray 6 pickup motor.

Part number: RK2-1331-000CN

7. Use the **Tray/bin manual sensor tests** to toggle the Tray 5 feed sensor. If the sensor or lever is not properly functioning, replace the Tray 5 paper pickup assembly.

Part number: RM1-6944-000CN

## Recommended action

1. Open the lower-right door, clear any jammed paper, and then close the door.
2. Inspect the Tray 6 pick, feed, and separation rollers. Clean or replace the rollers, if necessary.  
Part number: CC522-67909
3. Check the connectors at the feed sensor, solenoid, feed motor, and the controller PCA.
4. Use the **Tray/bin manual sensor tests** to toggle the Tray 6 feed sensor. If the sensor or lever is not properly functioning, replace the Tray 6 paper pickup assembly.  
Part number: RM1-6944-000CN
5. Use the **Component tests** to activate the Tray 6 solenoid. Listen for the solenoid to activate. If the solenoid is not properly functioning, replace the Tray 6 paper pickup assembly.  
Part number: RM1-6944-000CN
6. Use the **Component tests** to activate the Tray 6 motor. Listen for the motor to activate. If the motor is not properly functioning, replace the Tray 6 pickup motor.  
Part number: RK2-1331-000CN
7. Use the **Tray/bin manual sensor tests** to toggle the Tray 5 feed sensor. If the sensor or lever is not properly functioning, replace the Tray 5 paper pickup assembly.  
Part number: RM1-6944-000CN

## 13.A5.FF

Power on jam, tray 5 feed sensor. Power on residual paper jam.

This jam occurs when the paper exists at SR81 at power on or door close. Due to the current firmware timing requirements, the displayed jam code is always 13.FF.FF (the event log will have 13.WX.FF).

## Recommended action for customers

1. Open the lower-right door, clear any jammed paper, and then close the door.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Open the lower-right door, clear any jammed paper, and then close the door.
2. Use the **Tray/bin manual sensor tests** to toggle the Tray 5 feed sensor. If the sensor or lever is not properly functioning, check the connectors to the sensor. If the error persists, replace the Tray 5 paper pickup assembly.  
Part number: RM1-6944-000CN

## 13.A6.D6

Misfeed jam from tray 6. No-pick jam from tray 6.

The leading edge of paper fed from Tray 6 is stopped before SR91.



## Recommended action for customers

1. Open Tray 6, clear any jammed paper, and then close the tray.
2. Open the lower-right door, clear any jammed paper, and then close the door.
3. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
4. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
5. Inspect the Tray 6 pick, feed, and separation rollers. Clean or replace the rollers, if necessary.

Part number: CC522-67909

6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Open Tray 6, clear any jammed paper, and then close the tray.
2. Open the lower-right door, clear any jammed paper, and then close the door.
3. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
4. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
5. Inspect the Tray 6 pick, feed, and separation rollers. Clean or replace the rollers, if necessary.

Part number: CC522-67909

6. Check the connectors at the feed sensor, solenoid, feed motor, and the controller PCA.
7. Use the **Tray/bin manual sensor tests** to toggle the Tray 6 feed sensor. If the sensor or lever is not properly functioning, replace the Tray 6 paper pickup assembly.

Part number: RM1-6944-000CN

8. Use the **Component tests** to activate the Tray 6 solenoid. Listen for the solenoid to activate. If the solenoid is not properly functioning, replace the Tray 6 paper pickup assembly.

Part number: RM1-6944-000CN

9. Use the **Component tests** to activate the Tray 6 motor. Listen for the motor to activate. If the motor is not properly functioning, replace the Tray 6 pickup motor.

Part number: RK2-1331-000CN

## 13.A6.FF

Power on jam, tray 6 feed sensor. Power on residual paper jam.

This jam occurs when the paper exists at SR91 at power on or door close. Due to the current firmware timing requirements, the displayed jam code is always 13.FF.FF (the event log will have 13.WX.FF).

### Recommended action for customers

1. Open the lower-right door, clear any jammed paper, and then close the door.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Open the lower-right door, clear any jammed paper, and then close the door.
2. Use the **Tray/bin manual sensor tests** to toggle the Tray 6 feed sensor. If the sensor or lever is not properly functioning, check the connectors to the sensor. If the error persists, replace the Tray 6 paper pickup assembly.

Part number: RM1-6944-000CN

## 13 . AA . EE

Door open jam. Tray 3, 4, or 5 right tray access door was opened during a print job.

### Recommended action for customers

1. Close the lower right door.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Close the lower right door.
2. Check the tab of the lower right door that engages the right door sensor. If it is damaged, replace the right door assembly.

Part number: RM1-6953-000CN

3. Use the manual sensor tests to toggle the lower right door sensor (SW1 or SW3301). If a sensor is not properly functioning, replace the sensor.

Part number: WC2-5512-000CN

4. Check the connectors (J192S) on the DC controller PCA and the connector (J751 or J905) on the right door sensor.

## 13 . AB . EE

Door open jam. Tray 4, 5, or 6 right tray access door was opened during print job.

### Recommended action for customers

1. Close the door.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Close the door.
2. Depending on input tray configuration, check the appropriate tab of the lower right door that engages the right door sensor. If it is damaged, replace the right door assembly.  
  
Part number: RM1-6953-000CN
3. Use the **Manual sensor tests** to toggle the middle right door sensors. If a sensor is not properly functioning, replace the sensor.  
  
Part number: WC2-5512-000CN
4. Do one of the following:
  - **500-sheet paper feeder:** check the connectors (J2003) on the PF controller PCA and the connector (J751) on the PF right door open detection switch SW1.
  - **3x500-sheet paper deck:** check the connectors (J2005) on the PD controller PCA and the connector (J705) on the PD right door open detection switch.
  - **High capacity input feeder:** check the connectors (J3006) on the HCI controller PCA and the connector (J905) on the HCI right door open detection switch.

## 13.B2.Az

Media stay jam at registration sensor PS5.

- **13.B2.A1** (event code)  
  
Media input stay jam at the registration sensor paper from tray 1. Paper stays at PS5 – media longer than allowed from Tray 1.
- **13.B2.A2** (event code)  
  
Media input stay jam 1 at the registration sensor paper from tray 2. Paper stays at PS5 – media longer than allowed from Tray 2.
- **13.B2.A3** (event code)  
  
Media input stay jam 1 at the registration sensor paper from tray 3. Paper stays at PS5 – media longer than allowed from Tray 3.
- **13.B2.A4** (event code)  
  
Media input stay jam 1 at the registration sensor paper from tray 4. Paper stays at PS5 – media longer than allowed from Tray 4.
- **13.B2.A5** (event code)  
  
Media input stay jam 1 at the registration sensor paper from tray 5. Paper stays at PS5 – media longer than allowed from Tray 5.
- **13.B2.A6** (event code)  
  
Media input stay jam 1 at the registration sensor paper from tray 6. Paper stays at PS5 – media longer than allowed from Tray 6.

- **13 . B2 . AD** (event code)

Media stay jam at registration sensor PS5. Paper stays at PS5 – media longer than allowed from duplexer.

### Recommended action for customers

1. Open the right door, clear any jammed paper, and then close the door.
2. Check for obstructions in the paper path.
3. Verify that the secondary transfer roller is seated properly and not worn or deformed. Replace it if necessary.

Part number: CC522-67912

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Open the right door, clear any jammed paper, and then close the door.
2. Check for obstructions in the paper path.
3. Verify that the secondary transfer roller is seated properly and not worn or deformed. Replace it if necessary.

Part number: CC522-67912

4. Verify that the registration assembly shutter is properly functioning. Replace it if it is damaged.

Part number: RM1-7922-000CN

5. Use the **Manual sensor tests** to toggle the TOP sensor (PS5). If the sensor is not properly functioning, replace the registration sensor assembly.

Part number: RM1-7922-000CN

6. Check the connectors (J122S) on the DC controller and (J537) on the PS5 sensor.

## 13 . B2 . Dz

- **13 . B2 . D1** (event code)

Late to registration jam, from Tray 1. This may be a misfeed jam from Tray 1.

The leading edge of paper fed from Tray 1 is stopped before PS5.

- **13 . B2 . D2** (event code)

Late to registration jam, from Tray 2. This may be a misfeed jam from Tray 2.

The leading edge of paper fed from Tray 2 is stopped before PS5.

- **13 . B2 . D3** (event code)

Late to registration jam from tray 3.

The leading edge of paper fed from Tray 3 is stopped before PS5 after passing SR1.

- **13 . B2 . D4** (event code)

Late to registration jam, from Tray 4.

The leading edge of paper fed from Tray 4 is stopped before PS5 after passing SR1.

- **13 . B2 . D5** (event code)

Late to registration jam, from Tray 5.

Leading edge of paper fed from Tray 5 is stopped before PS5 after passing SR1.

- **13 . B2 . D6** (event code)

Late to registration jam, from Tray 6.

The leading edge of paper fed from Tray 6 is stopped before PS5 after passing SR1.

- **13 . B2 . DD** (event code)

This jam occurs when the paper does not reach the registration sensor in a designated amount of time after it is reversed from the switchback position during duplex printing. The media either did not reverse (it was either ejected to the output bin or the user grabbed the exposed page during duplex reverse), or is jammed in the duplex reversing path in the printer's right door.

Duplex re-feed paper is stopped between PS6 and PS5.

## Recommended action for customers

1. Open the right door, clear any jammed paper, and then close the door.
2. Check for obstructions in the paper path.
3. Verify that the secondary transfer roller is seated properly and not worn or deformed. Replace it if necessary.  
  
Part number: CC522-67912
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Open the right door, clear any jammed paper, and then close the door.
2. Check for obstructions in the paper path.
3. Verify that the second transfer roller is seated properly and not worn or deformed. Replace it if necessary.  
  
Part number: CC522-67912
4. Check the pickup, feed, and separation rollers from the source tray. Replace them if they are worn or defective.  
  
Part number: CC522-67909
5. Verify that the registration assembly shutter is properly functioning. Replace it if it is damaged.  
  
Part number: RM1-7922-000CN

6. Use the manual sensor tests to toggle the TOP sensor (PS5). If the sensor is not properly functioning, replace the registration sensor assembly.

Part number: RM1-7922-000CN

7. Check the connectors (J122S) on the DC controller and (J537) on the PS5 sensor.
8. Use the **Component tests** to activate the pickup motor and pickup solenoid/clutch for the source tray. If the motor or solenoid/clutch is not properly functioning for Tray 2, replace the Tray 2 paper pickup assembly. If the motor is not properly functioning for Trays 3–5, replace the pick up motor. If the solenoid/clutch is not properly functioning for Trays 3–5, replace the paper pick up assembly for Trays 3–5.

Tray 2 paper pickup assembly part number: CE707-67903

Trays 3–5 pickup motor part number: RK2-1331-000CN

Trays 3–5 pickup assembly part number: RM1-6944-000CN

### 13.B2.FF

At power on, door close, or auto-flushing: paper stays at PS5.

Power on residual paper jam. This jam occurs when the paper exists at PS5 at power on or door close. Due to the current FW timing requirements, the displayed jam code is always 13.FF.FF, only the event log will have 13.WX.FF.

#### Recommended action for customers

1. Open the right door, clear any jammed paper, and then close the door.
2. Check for obstructions in the paper path.
3. Verify that the secondary transfer roller is seated properly and not worn or deformed. Replace it if necessary.

Part number: CC522-67912

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action for call-center agents and onsite technicians

1. Open the right door, clear any jammed paper, and then close the door.
2. Use the manual sensor tests to toggle the TOP sensor (PS5). If the sensor is not properly functioning, replace the registration sensor assembly.

Part number: RM1-7922-000CN

### 13.B4.FF

At power on, door close, or auto-flushing: paper stays at PS7/PS8 (loop sensors).

Power on residual paper jam. This jam occurs when the paper exists at PS7/8 at power on or door close. Due to the current FW timing requirements, the displayed jam code is always 13.FF.FF, only the event log will have 13.WX.FF.

## Recommended action

1. Open the right door, clear any jammed paper, and then close the door.
2. Use the manual sensor tests to toggle the Loop sensors (PS7/PS8). If the sensors or levers are not properly functioning, replace the fuser assembly.

Fuser kit (110V) part number: CE707-67912

Fuser kit (220V) part number: CE707-67913



**NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

## 13.B9.Az

Stopped at fuser jam.

This jam occurs when the paper stays at the fuser output sensor PS6 for a designated amount of time after it has reached the fuser output sensor PS6.

Z = Fuser mode.

- 13.B9.A1 (event code)

Stopped at fuser jam, Auto Sense (Normal)--special case distinguished from typed Normal.

- 13.B9.A2 (event code)

Stopped at fuser jam, Normal (typed not from Auto Sense).

- 13.B9.A3 (event code)

Stopped at fuser jam, Light media 1 (either typed or from Auto Sense).

- 13.B9.A4 (event code)

Stopped at fuser jam, Heavy media 1 (either typed or from Auto Sense).

- 13.B9.A5 (event code)

Stopped at fuser jam, Heavy media 2 (either typed or from Auto Sense).

- 13.B9.A6 (event code)

Stopped at fuser jam, Heavy media 3 (either typed or from Auto Sense).

- 13.B9.A7 (event code)

Stopped at fuser jam, Glossy media 1 (either typed or from Auto Sense).

- 13.B9.A8 (event code)

Stopped at fuser jam, Glossy media 2 (either typed or from Auto Sense).

- 13.B9.A9 (event code)

Stopped at fuser jam, Glossy media 3 (either typed or from Auto Sense).

- **13.B9.AA** (event code)  
Stopped at fuser jam, Glossy film (either typed or from Auto Sense).
- **13.B9.AB** (event code)  
Stopped at fuser jam, OHT (either typed or from Auto Sense).
- **13.B9.AC** (event code)  
Stopped at fuser jam, Label.
- **13.B9.AD** (event code)  
Stopped at fuser jam, Envelope 1.
- **13.B9.AE** (event code)  
Stopped at fuser jam (engine fuser mode).
- **13.B9.AF** (event code)  
Stopped at fuser jam (unknown fuser mode).

### Recommended action for customers

1. Open the right door, and then clear any jammed paper.
2. Make sure that the paper meets HP specifications.
3. Remove the fuser, and then clear any jammed paper.

---

 **CAUTION:** The fuser might be hot.

---

4. Replace the fuser, and then close the door.
5. Check for obstructions in the paper path.
6. Verify that the secondary transfer roller is seated properly and not worn or deformed. Replace it if necessary.  
  
Part number: CC522-67912
7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Open the right door, and then clear any jammed paper.
2. Make sure that the paper meets HP specifications.
3. Remove the fuser, and then clear any jammed paper.

---

 **CAUTION:** The fuser might be hot.

---

4. Replace the fuser, and then close the door.
5. Check for obstructions in the paper path.




6. Verify that the secondary transfer roller is seated properly and not worn or deformed. Replace it if necessary.

Part number: CC522-67912

7. For *reoccurring* 13 . B9 . yz paper jams in the fuser area, inspect the fuser guide. If the guide is broken, replace it. The guide can be easily installed as a CSR-A

Part number: RC2-6551-010CN

**Figure 6-1 Fuser guide location**

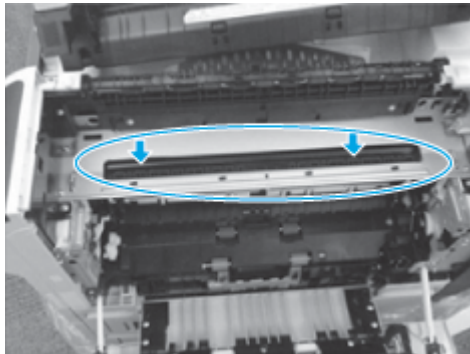

**Figure 6-2 Fuser guide removed from printer**



8. Check the paper path rollers at the fuser and paper delivery assembly for blockage or damage. Replace the fuser or paper delivery assembly if necessary.

Paper delivery assembly part number: RM1-6165-000CN

Fuser kit (110V) part number: CE707-67912

Fuser kit (220V) part number: CE707-67913

---

 **NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

---

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

9. Use the **Manual sensor tests** to toggle the fuser output sensor (PS6). If the sensor is not properly functioning, replace the fuser assembly.

Fuser kit (110V) part number: CE707-67912

Fuser kit (220V) part number: CE707-67913

---

 **NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

---

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

10. Use the **Component tests** to activate the fuser motor (M4). If the motor is not properly functioning, replace the motor.

Part number: RM1-6074-000CN

## 13.B9.CZ

Fuser wrap jam.

This jam occurs when the paper does not reach the fuser output sensor (PS6) in a designated amount of time after the paper reached the fuser output sensor (PS6). It is determined that the paper is being wrapped around the fuser roller.

Z = Fuser mode.

- 13.B9.C1 (event code)

Fuser wrap jam, Auto Sense (Normal)--special case distinguished from typed Normal.

- 13.B9.C2 (event code)

Fuser wrap jam, Normal (typed not from Auto Sense).

- 13.B9.C3 (event code)

Fuser wrap jam, Light media 1 (either typed or from Auto Sense).

- 13.B9.C4 (event code)

Fuser wrap jam, Heavy media 1 (either typed or from Auto Sense).

- 13.B9.C5 (event code)

Fuser wrap jam, Heavy media 2 (either typed or from Auto Sense).

- 13.B9.C6 (event code)

Fuser wrap jam, Heavy media 3 (either typed or from Auto Sense).

- 13.B9.C7 (event code)

Fuser wrap jam, Glossy media 1 (either typed or from Auto Sense).

- 13.B9.C8 (event code)

Fuser wrap jam, Glossy media 2 (either typed or from Auto Sense).

- 13.B9.C9 (event code)

Fuser wrap jam, Glossy media 3 (either typed or from Auto Sense).

- **13.B9.CA** (event code)

Fuser wrap jam, Glossy film (either typed or from Auto Sense).

- **13.B9.CB** (event code)

Stopped at fuser jam, OHT (either typed or from Auto Sense).

- **13.B9.CC** (event code)

Stopped at fuser jam, Label.

- **13.B9.CD** (event code)

Stopped at fuser jam, Envelope 1.

- **13.B9.CE** (event code)

Stopped at fuser jam (engine fuser mode).

- **13.B9.CF** (event code)

Stopped at fuser jam (unknown fuser mode).

### Recommended action for customers

1. Open the right door, and then clear any jammed paper.
2. Make sure that the paper meets HP specifications.
3. Remove the fuser, and then clear any jammed paper.

---

 **CAUTION:** The fuser might be hot.

---

4. Replace the fuser, and then close the door.
5. Check for obstructions in the paper path.
6. Verify that the secondary transfer roller is seated properly and not worn or deformed. Replace it if necessary.

Part number: CC522-67912

7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Open the right door.
2. Remove the fuser, and then remove any paper wrapped around the fuser roller.

---

 **CAUTION:** The fuser might be hot.

---

3. Replace the fuser, and then close the door.
4. Perform a cleaning page procedure to make sure that all of the toner is removed from the fuser roller.

5. Use the **Manual sensor tests** to toggle the fuser output sensor (PS6). If the sensor is not properly functioning, replace the fuser.

Fuser kit (110V) part number: CE707-67912

Fuser kit (220V) part number: CE707-67913

---

 **NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.


---

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.


6. For *reoccurring 13.B9.yz* paper jams in the fuser area, inspect the fuser guide. If the guide is broken, replace it. The guide can be easily installed as a CSR-A

Part number: RC2-6551-010CN

**Figure 6-3 Fuser guide location**

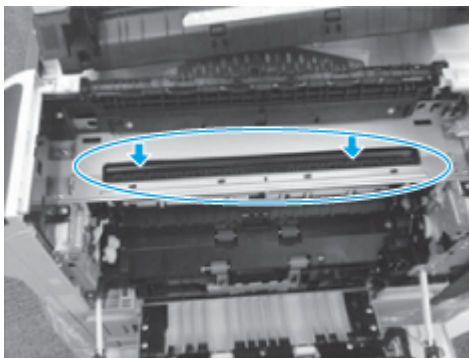

**Figure 6-4 Fuser guide removed from printer**

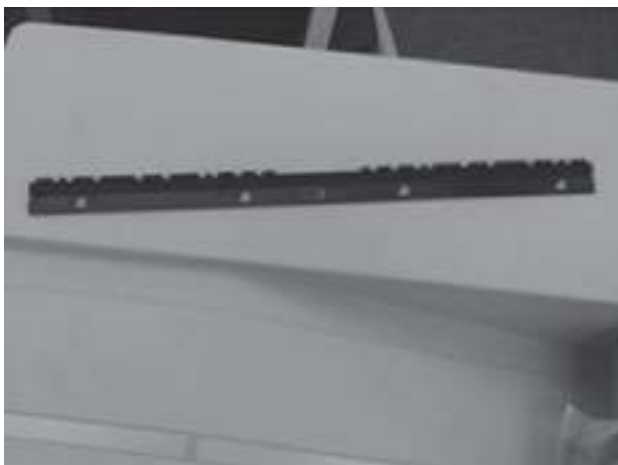

7. If the error persists, the fuser roller or pressure roller might be damaged. Replace the fuser.

Fuser kit (110V) part number: CE707-67912

Fuser kit (220V) part number: CE707-67913

---

 **NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

---

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

## 13.B9.DZ

Fuser delivery delay jam.

This jam occurs when the paper does not reach the fuser output sensor (PS6) in a designated amount of time after the paper reached the fuser output sensor (PS6).

- **13.B9.D0** (event code)

Leading edge of paper is stopped between PS5 and PS6 – unknown source tray.

- **13.B9.D1** (event code)

Leading edge of paper is stopped between PS5 and PS6 – fed from Tray 1.

- **13.B9.D2** (event code)

The leading edge of paper is stopped between PS5 and PS6 – fed from Tray 2.

- **13.B9.D3** (event code)

The leading edge of paper is stopped between PS5 and PS6 – fed from Tray 3.

- **13.B9.D4** (event code)

The leading edge of paper is stopped between PS5 and PS6 – fed from Tray 4.

- **13.B9.D5** (event code)

The leading edge of paper is stopped between PS5 and PS6 – fed from Tray 5.

- **13.B9.D6** (event code)

The leading edge of paper is stopped between PS5 and PS6 – fed from Tray 6.

- **13.B9.DD** (event code)

The leading edge of paper is stopped between PS5 and PS6 – fed from duplexer.

### Recommended action for customers

1. Open the right door, and then clear any jammed paper.
2. Make sure that the paper meets HP specifications.
3. Remove the fuser, and then clear any jammed paper.

---

 **CAUTION:** The fuser might be hot.

---

4. Replace the fuser, and then close the door.
5. Check for obstructions in the paper path.
6. Verify that the secondary transfer roller is seated properly and not worn or deformed. Replace it if necessary.

Part number: CC522-67912

7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Open the right door, and then remove any jammed paper.
2. Remove the fuser, and then remove any jammed paper.

---


**⚠ CAUTION:** The fuser might be hot.

---

3. Replace the fuser, and then close the door.
4. Make sure that the paper meets HP specifications.
5. Check for obstructions in and around the fuser.
6. For *reoccurring 13.B9.yz* paper jams in the fuser area, inspect the fuser guide. If the guide is broken, replace it. The guide can be easily installed as a CSR-A

Part number: RC2-6551-010CN

**Figure 6-5 Fuser guide location**

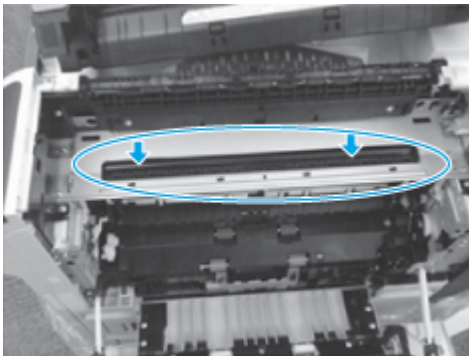

**Figure 6-6 Fuser guide removed from printer**



7. Use the **Manual sensor tests** to toggle the fuser output sensor (PS6). If the sensor is not properly functioning, replace the fuser.

Paper delivery assembly part number: RM1-6165-000CN

Fuser kit (110V) part number: CE707-67912

Fuser kit (220V) part number: CE707-67913

---

 **NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

---

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

8. Check connections (J516) on the fuser motor and (J81A) on the DC controller.
9. Use the **Component tests** to activate the fuser motor (M4). If the motor is not properly functioning, replace the motor.

Part number: RM1-6074-000CN

### 13.B9.FF

Power on jam, fuser output sensor. At power on, door close, or auto-flushing: paper stays at PS6.

This jam occurs when the paper exists at PS6 at power on or door close. Due to the current FW timing requirements, the displayed jam code is always 13.FF.FF, only the event log will have 13.WX.FF.

#### Recommended action

1. Open the right door, and then remove any jammed paper.
2. Remove the fuser, and then remove any jammed paper.

---

 **CAUTION:** The fuser might be hot.

---

3. Use the **Manual sensor tests** to toggle the fuser exit sensor. If the sensor or lever is not properly functioning, replace the fuser.

Paper delivery assembly part number: RM1-6165-000CN

Fuser kit (110V) part number: CE707-67912

Fuser kit (220V) part number: CE707-67913

---

 **NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

---

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

### 13.BA.EE

This jam occurs when the front door is opened during a print job.

#### Recommended action for customers

1. Close the doors on the printer.
2. Turn the printer off, and then on.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Close the front door.
2. Check the projection tabs of the front door that engage the door sensor (SW2 and PS14). If either tab is damaged, replace the front door assembly. If the door open detection switch is damaged, replace it.

Front door assembly part number: CE707-67902

Door open detection switch part number: WC4-5251-000CN

3. Check the connectors (SW2 - J241/J242 and PS14 - J171S) on the DC controller PCA and the connector (SW2 - J708F and PS14 - J536S) on the door open detection switch SW2 and PS14.

## 13.BB.EE

This jam occurs when one of the following doors was opened during a print job:

- Stapler/stacker jam access door
- Right door
- Trays 3-6 tray access door

## Recommended action for customers

1. Close the doors on the printer.
2. Turn the printer off, and then on.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Check the doors listed above to make sure that they are closed.
2. Check the projection tabs of the right door that engage the door sensors (PS14 or PS15). If either tab is damaged, replace the right door.

Right door assembly (simplex) part number: RM1-6138-000CN

Right door assembly (duplex) part number: RM1-6007-000CN

3. Use the **Manual sensor test** to activate the right door sensor. Replace the sensor if it is not properly functioning.

Part number: WC4-5251-000CN

4. Check the appropriate connectors on the DC controller PCA and the appropriate connector on the paper feeder or stapler stacker assembly.

## 13.E1.DZ

Late to standard bin sensor (output bin)

This jam occurs when the leading edge of the paper does not reach the face-down output bin full sensor (PS10) in the designated amount of time after activating PS6.



Z = Fuser mode.

- **13.E1.D1** (event code)  
Late to standard bin sensor, Auto Sense (Normal)--special case distinguished from typed Normal.
- **13.E1.D2** (event code)  
Late to standard bin sensor, Normal (typed not from Auto Sense).
- **13.E1.D3** (event code)  
Late to standard bin sensor, Light media 1 (either typed or from Auto Sense).
- **13.E1.D4** (event code)  
Late to standard bin sensor, Heavy media 1 (either typed or from Auto Sense).
- **13.E1.D5** (event code)  
Late to standard bin sensor, Heavy media 2 (either typed or from Auto Sense).
- **13.E1.D6** (event code)  
Late to standard bin sensor, Heavy media 3 (either typed or from Auto Sense).
- **13.E1.D7** (event code)  
Late to standard bin sensor, Glossy media 1 (either typed or from Auto Sense).
- **13.E1.D8** (event code)  
Late to standard bin sensor, Glossy media 2 (either typed or from Auto Sense).
- **13.E1.D9** (event code)  
Late to standard bin sensor, Glossy media 3 (either typed or from Auto Sense).
- **13.E1.DA** (event code)  
Late to standard bin sensor, Glossy film (either typed or from Auto Sense).
- **13.E1.DB** (event code)  
Late to standard bin sensor, OHT (either typed or from Auto Sense).
- **13.E1.DC** (event code)  
Late to standard bin sensor, Label.
- **13.E1.DD** (event code)  
Late to standard bin sensor, Envelope 1.
- **13.E1.DE** (event code)  
Late to standard bin sensor. Rough mode (either typed or from Auto Sense).

## Recommended action for customers

1. Remove any paper from the output bin.

2. Open the right door.
3. Remove the fuser, and then remove any paper wrapped around the fuser roller.

---

 **CAUTION:** The fuser might be hot.

---

4. Replace the fuser, and then close the door.
5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Remove any paper from the output bin.
2. Open the right door.
3. Remove the fuser, and then remove any paper wrapped around the fuser roller.

---

 **CAUTION:** The fuser might be hot.

---

4. Replace the fuser, and then close the door.
5. Verify that the output gate on the paper delivery assembly and the output-bin full sensor flag are properly functioning.
6. Use the **Tray/bin manual sensor tests** to toggle the following sensors:

- Output-bin-Full Sensor (PS10): If the sensor does not respond, send an on-site technician to replace the paper delivery assembly.

Part number: RM1-6165-000CN

- Fuser Output Sensor (PS6): If the sensor does not respond, replace the fuser.

Paper delivery assembly part number: RM1-6165-000CN

Fuser kit (110V) part number: CE707-67912

Fuser kit (220V) part number: CE707-67913

---

 **NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

---

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

## 13.FF.FF

Jams at multiple sensors. Power on residual paper jam, multiple sensors in multiple subsystems.

This jam occurs when paper is present at multiple sensors at power on or door close. Due to the current FW timing requirements, the displayed jam code is always 13.FF.FF, only the event log will have 13.WX.FF.

### Recommended action

1. Remove any paper from the output bin.
2. Open the right door.

3. Remove the fuser, and then remove any paper wrapped around the fuser roller.

---

 **CAUTION:** The fuser might be hot.

---

4. Replace the fuser, and then close the door.
5. View or print the event log to find previous jam errors. Troubleshoot jam errors starting with the most recent.

## 20.00.00, 21.00.00 Error Messages

### 20.\* errors

Errors in the 20.\* family are related to the printer memory. The page might require more memory than the printer has available.

#### Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

1. Touch the **OK** button to continue.
2. Reduce the page complexity.
3. Add product memory.

### 20 . 00 . 00 Insufficient memory: <Device> To continue, touch “OK”

The printer has experienced a memory error. You might have tried to transfer too many fonts or macros.

#### Recommended action

- Touch the **OK** button to print the transferred data. Some data might be lost. Reduce the page complexity.

### 21.\* errors

Errors in the 21.\* family are related to the printer memory and complexity of the image being printed. The page might require more memory than the printer has available.

#### Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

1. Touch the **OK** button to clear the error.
2. Reduce the page complexity.
3. Add product memory.

## 21 . 00 . 00 Page Too Complex

The printer displays this message to indicate that the page decompression process was too slow for the printer.

### Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to continue. There might be some data loss on the page that was being formatted when the error occurred.

## 21 . 00 . 00 Page too complex To continue, touch “OK”

The page decompression process was too slow for the printer.

### Recommended action

- Touch the **OK** button to continue. There may be some data loss.

## 32.wx.yz Error Messages

### 32.\* errors

Errors in the 32.\* family are related to either product start events or to backup and restore events.

### Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

1. Turn the printer off, and then on.
2. Retry the job.

## 32 . 08 . A1, 32 . 08 . A2, 32 . 08 . A3

An event related to starting the printer.

**32.08.A1** (event code)

Shutdown event. Boot after abnormal shutdown.

**32.08.A2** (event code)

Boot from normal shutdown event.

**32.08.A3** (event code)

Regular boot event.

### Recommended action

There is no action needed for this message.

- No action necessary.

### 32.1C.05

The restore job ticket was submitted with invalid credentials.

#### Recommended action

1. Verify the credentials that were submitted.
2. Check the domain, user name, and password.

### 32.1C.06 (event code)

The backup job ticket was submitted with invalid credentials.

#### Recommended action

1. Verify the credentials that were submitted.
2. Check the domain, user name, and password.

### 32.1C.07 (event code)

Backup restore permissions error.

There was an error during the creation, read, or write of the restore file.

#### Recommended action

- Retry the job.

### 32.1C.08 (event code)

Not enough disk space to perform backup/restore, or a network share issue.

There was an error during the creation, read, or write of the backup file.

#### Recommended action

1. Retry the job.
2. Remove stored jobs and retry.
3. If the error persists, try using a larger capacity storage device for the share location and check the network share settings.
4. Check the network share or try setting up a new shared network drive or folder.

### 32.1C.09 (event code)

Tried to restore a backup file that was not valid for this printer.

The data in the backup file specified in the restore job ticket is no longer valid due to a corruption of the data, or the data is no longer present.

#### Recommended action

- Use a valid backup file.

### 32.1C.0A (event code)

Backup file is invalid.

The data in the backup file specified in the restore job ticket is no longer valid due to a corruption of the data, or the data is no longer present.

#### Recommended action

1. Use a valid backup file.
2. Reboot, and then observe the state of the printer.
3. If the error persists, perform a partition clean from the **Preboot** menu.

### 32.1C.0D (event code)

Backup/restore failed, auto-reboot failed, or the printer might be busy.

#### Recommended action

- Reboot, and then retry the backup/restore.

### 32.1C.11 (event code)

Backup/restore time-out while communicating with the engine.

The backup operation was aborted because the printer is busy.

#### Recommended action

- Wait until the printer is idle, and then try again.

### 32.1C.13, 32.1C.14

Not enough space exists to perform the backup.

The backup was aborted because the disk is at a critical level or full.

Scheduled backup failure.

#### Recommended action

- Free up disk space, and then try again.

### 32.1C.15

The restore operation was aborted because the backup file was created by a previous version of firmware no longer supported by the feature.

#### Recommended action

- Use the current backup file.

### 32.1C.2E

The restore operation was aborted because the printer is busy.

### Recommended action

1. Wait until the printer is idle, and then retry.
2. Turn the printer off then on, and then retry.

### 32.1C.2F

Reset failure.

### Recommended action

- Turn the printer off, and then on. Retry the job.

### 32.1C.40

The backup operation completed successfully (informational).

### Recommended action

See recommended action.

- No action necessary.

### 32.1C.41

The backup operation encountered an error (informational).

### Recommended action

See recommended action.

- No action necessary.

### 32.1C.42

The backup operation completed, but with a warning message (informational).

### Recommended action

See recommended action.

- No action necessary.

### 32.1C.43

A component in the backup file is not supported by the current version of firmware and will not be restored (informational).

### Recommended action

See recommended action.

- No action necessary.

### 32.1C.44

A component in the backup file is not transferable to another printer and will not be restored (informational).

#### Recommended action

See recommended action.

- No action necessary.

### 32.1C.45

Some data was not included in the backup file (informational).

#### Recommended action

See recommended action.

- No action necessary.

### 32.1C.46

An expected component could not be found and was thus not backed up. Because components should be known on backups, this code is a warning (informational).

#### Recommended action

See recommended action.

- No action necessary.

### 32.1C.47

Some data was not restored from the backup file (informational).

#### Recommended action

See recommended action.

- No action necessary.

### 32.1C.48

The backup job ticket was submitted using an invalid network path.

#### Recommended action

1. Check that a shared folder was provided as part of the network path and not left blank.
2. Check that the server and the shared folder exists.
3. Check that you (or the applicable user) has permission to access the shared folder on the provided server.

### 32.1C.49

The backup job ticket was submitted with a bad encryption.





**NOTE:** This would only apply to a web services call to perform a backup with a blank PIN

### Recommended action

- Verify that the encryption personal identification number (PIN) meets the restrictions for the printer.

### 32.1C.4A

An error occurred when creating the temporary directories used to store the backup files in transition to and from the compressed (ZIP) file.

### Recommended action

1. Retry the job.
2. If this does not resolve the issue, turn the printer off then on again and retry the job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

### 32.1C.56

Reset aborted. Backup/restore in progress (informational).

### Recommended action

See recommended action.

- No action necessary.

### 32.1C.57

Reset aborted (informational).

### Recommended action

See recommended action.

- No action necessary.

### 32.1C.58

Unknown reset error (informational).

### Recommended action

See recommended action.

- No action necessary.

### 32.1C.60

The restore operation completed successfully (informational).

### Recommended action

See recommended action.

- No action necessary.

### 32.1C.61

The restore operation encountered an error.

### Recommended action

- Review the printer's event log to see specific details about the failure.

### 32.1C.62

The restore operation completed, but with a warning message.

### Recommended action

- Review the error log to see specific details about the failure.

### 32.1C.68

The restore job ticket was submitted using an invalid network path.

### Recommended action

1. Check that a shared folder was provided as part of the network path and not left blank.
2. Check that the server and the shared folder exist.
3. Check that you (or the applicable user) has permission to access the shared folder on the provided server.
4. Check that the path includes the compressed .ZIP file name as part of the path.

### 32.1C.69

The restore job ticket was submitted with a bad encryption personal identification number (PIN).

### Recommended action

- Verify the encryption personal identification number (PIN) is the same PIN used to encrypt the backup file.

### 32.1C.6A

An error occurred when creating the temporary directories used to store the restore files in transition to and from the compressed (ZIP) file.

### Recommended action

- Retry the job.

## 32.1C.6D

An unusual error occurred when running the restore operation.

### Recommended action

- Retry the job.

## 33.wx.yz Error Messages

### 33.\* errors

Errors in the 33.\* family are related to the printer's storage system or the formatter. The component might have been previously installed in another printer and is therefore locked to that other printer. Or, the component might be incorrect for this printer.

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, investigate if the hard disk drive (HDD) or formatter are the original ones. If recently swapped or replaced, turn the printer off, install the original HDD and/or formatter, and then turn the printer on.
3. If the issue persists, locate and notate the complete 33.WX.YZ error message as displayed on the control panel of the printer and contact your HP-authorized service or support provider, or contact customer support at <http://www.hp.com/go/contactHP>.

### Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. If the issue persists, investigate if the hard disk drive (HDD) or formatter are the original ones. If recently swapped or replaced, turn the printer off, install the original HDD and/or formatter, and then turn the printer on.
3. If the formatter/HDD were recently replaced and the original is unavailable verify the correct formatter/HDD are installed by referencing the part numbers.
4. If the issue persists, locate and notate the complete 33.WX.YZ error message as displayed on the control panel of the printer. Reference support content for the specific error and take the necessary action.
5. If the error cannot be cleared and you are unable to get the complete error code from the printer, perform a **Partial Clean** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives"

(ish\_4502973-4502949-16) - Or click here: [HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#).

---

 **CAUTION:** A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

---

6. If the error persists, download and from the **Preboot** menu install the latest version of printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

7. If the error persists, elevate the case using the Standard Support Process.

## Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. If the issue persists, investigate if the hard disk drive (HDD) or formatter are the original ones. If recently swapped or replaced, turn the printer off, install the original HDD and/or formatter, and then turn the printer on.
3. If the formatter/HDD were recently replaced and the original is unavailable verify the correct formatter/HDD are installed by referencing the part numbers.
4. If the issue persists, locate and notate the complete 33.WX.YZ error message as displayed on the control panel of the printer. Reference support content for the specific error and take the necessary action.
5. If the error cannot be cleared and you are unable to get the complete error code from the printer, perform a **Partial Clean** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - Or click here: [HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#).

---

 **CAUTION:** A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

---

6. If the error persists, download and from the **Preboot** menu install the latest version of printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

7. If the error persists, elevate the case using the Standard Support Process.

## 33.01.xx

A save or restore process has occurred.

- **33.01.01** (event code)

A restore process has occurred.

- **33.01.02** (event code)

A save process has occurred.

- **33.01.03** (event code)

Save recover functionality OK after previously being disabled.

### Recommended action

See recommended action.

- No action necessary.

## 33.02.01

A used part (board or disk) with data was replaced in the device.

An encrypted board or disk with existing data previously locked to a different printer has replaced the original. If you continue, data is permanently lost.

### Recommended action

1. If this error appears after updating the firmware to FutureSmart Bundle Version 3.4, go to, or search for:: [HP LaserJet Enterprise - A 33.02.01 error received after upgrading the firmware to FutureSmart version 3.4](#) (c04561645).
2. Reinstall the used board or disk back into its original printer.
3. To save the data on the board or disk, turn the printer off and replace the board or disk with another board or disk.
4. To delete the data on the board or disk and continue, touch the **OK** button.

## 33.02.02

A Save/Recover status error occurred on the printer and one or both of the Save/Recover features are disabled.

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Turn the printer power off, and then on.
2. If the error persists, elevate the case following your standard support process.

### 33.02.03

The Save/Recover backup feature has failed. The Save/Recover features are disabled, but the printer continues to function.

#### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action for call-center agents and onsite technicians

1. Turn the printer power off, and then on.
2. If the error persists, elevate the case following your standard support process.

### 33.03.01

The controller encountered an unexpected data length for the Storage ID value.

#### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action for call-center agents and onsite technicians

1. Turn the printer power off, and then on.
2. For U.S. based printers, verify the printer is a 110 volt model. If the customer received a 220 volt printer, they might experience this issue along with reboot problems.
3. If the error persists, elevate the case following your standard support process. Return the printer ICB to the Global Business Unit with a full diagnostic log from the printer

### 33.03.02

The controller encountered an unexpected data length value for the engine to recover the DCC NVRAM value.

#### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Turn the printer power off, and then on.
2. For U.S. based printers, verify the printer is a 110 volt model. If the customer received a 220 volt printer, they might experience this issue along with reboot problems.
3. If the error persists, elevate the case following your standard support process. Return the printer ICB to the Global Business Unit with a full diagnostic log from the printer

### 33.03.05 EFI Boot error

EFI BIOS event showing that a replacement formatter Recover attempt was unsuccessful.

## Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, replace the formatter.

M806 part number: CZ244-67901

M806 (China/India) part number: CZ244-67902

M830 part number: CF367-67915

M830 (China/India) part number: CF367-67916

## Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

This issue is caused by an unsuccessful formatter recovery after a formatter has been replaced.

1. Turn off the printer, and then turn on the printer.
2. If the error persists, perform a **Partial Clean** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives"

(ish\_4502973-4502949-16) - Or click here: [HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#).

---

 **CAUTION:** A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

---

- a. Turn on the printer.
- b. Press the HP logo that displays in the middle of the screen when you see the “1/8” under the logo.
- c. Touch the down arrow button ▼ to highlight [Administrator](#), and then press the [OK](#) button.
- d. Touch the down arrow button ▼ to highlight [Partial Clean](#), and then press the [OK](#) button.
- e. Touch the [OK](#) button again.
- f. Touch the Home button  to highlight [Continue](#), and then press the [OK](#) button.

The printer will automatically reboot and should return to a Ready state.

3. If the error persists, download and from the **Preboot** menu install the latest version of printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

4. If the issue persists, remove and reinstall the formatter board.
5. If the error persists, replace the formatter.

M806 part number: CZ244-67901

M806 (China/India) part number: CZ244-67902

M830 part number: CF367-67915

M830 (China/India) part number: CF367-67916

For instructions: *Removal and replacement: Formatter PCA*

See the Repair Service Manual for this product.

6. If the error persists, elevate the case using the Standard Support Process.

### 33.03.06

The memory PCA was not detected on startup.

#### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).



## Recommended action for call-center agents and onsite technicians

1. Turn the printer power off, and then on.
2. If the error persists, turn the printer off, disconnect the power cord, and then remove the formatter cover. Press firmly on the interconnect cable connection to the formatter.
3. If the error persists, replace the interconnect board (ICB).

Part number: CE707-67907

### 33.05.0z SureStart errors

A SureStart error has occurred.

The printer detected and recovered from a corrupted version of BIOS.

- **33.05.01** Boot code corrupt (event code)
- **33.05.02** Boot code corrupt (event code)
- **33.05.03** Boot code corrupt (event code)

The newly downloaded firmware failed to cryptographically validate the BIOS code.

- **33.05.04** Security alert
- **33.05.04** Upgrade corrupt (event code)
- **33.05.05** Security alert
- **33.05.05** Boot code corrupt (event code)
- **33.05.06** Security alert
- **33.05.06** Upgrade corrupt (event code)
- **33.05.07** Security alert
- **33.05.07** Upgrade corrupt (event code)
- **33.05.08** Invalid boot attempt (event code)
- **33.05.09** Downgrade attempted (event code)

### Recommended action

Follow these troubleshooting steps in the order presented.

- **For 33.05.01, 33.05.02, and 33.05.03 errors:** No action is necessary.
- **For all other errors:** Download a firmware bundle to the printer from the Preboot menu.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)



**NOTE:** For more information on SureStart, search for: "SureStart Whitelisting and Intrusion Detection Troubleshooting Manual" (c04863614) [or, Click here: HP SureStart Whitelisting and Intrusion Detection Troubleshooting Manual.](#)

### 33.05.1x Whitelisting errors

An error occurred with a firmware file digital signature or an error with the certificate used to validate the firmware file certificate.

- **33.05.10** Security alert
- **33.05.10** Firmware verification Error: XX (Event code)
- **33.05.11** Security alert
- **33.05.11** Firmware verification Error: XX (Event code)
- **33.05.12** Security alert
- **33.05.12** Firmware verification Error: XX (Event code)

#### Recommended action

Follow these troubleshooting steps in the order presented.

1. Perform a [Format Disk](#) procedure.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) *Or click here: [HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#).*

2. If the device does not reboot to [Ready](#), download a firmware bundle to the device from the Preboot menu.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)



**NOTE:** Performing a Format Disk procedure is required before downloading a firmware bundle.

For more information on SureStart, go to: (Doc ID: c04863614). [HP SureStart Whitelisting and Intrusion Detection Troubleshooting Manual](#)

### 33.05.2x Intrusion detection errors

The intrusion detection system has encountered an error.

The intrusion detection memory process determined an unauthorized change in system memory.

- **33.05.21** Security alert
- **33.05.21** Potential intrusion (Event code)

The intrusion detection memory process heartbeat was not detected.

- **33.05.22** Security alert
- **33.05.22** Cannot scan for potential intrusions (Event code)

The intrusion detection memory process did not initialize.

- **33.05.23** Security alert
- **33.05.23** Intrusion detection not initialized (Event code)

- **33.05.24** Intrusion detection initialization error (Event code)

### Recommended action for customers

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.



**NOTE:** Selecting **Continue** from the Preboot menu will not resolve the error. The printer must be turned off, and then on to clear the error allowing the printer to reboot to a **Ready** state.



**NOTE:** With firmware version 3.7, when selecting **Continue** from the Preboot menu after encountering a **33.05.2z** or **33.05.5z** error, the following message displays:

**"A disk or boot error has occurred. Clear Error. Press Any Key"**

This message should be ignored.

---

#### Information on the Intrusion Detection error.

For more information on SureStart, go to: [HP SureStart Whitelisting and Intrusion Detection Troubleshooting Manual](#) (Doc ID: c04863614).

## 33.05.5z Intrusion detection errors

The intrusion detection system has encountered an error.

The intrusion detection memory process determined an unauthorized change in system memory.

- **33.05.51** Security alert
- **33.05.51** Potential intrusion (Event code)

The intrusion detection memory process heartbeat was not detected.

- **33.05.52** Security alert
- **33.05.52** Cannot scan for potential intrusions (Event code)

The intrusion detection memory process did not initialize.

- **33.05.53** Security alert
- **33.05.53** Intrusion detection not initialized (Event code)
- **33.05.54** Intrusion detection initialization error (Event code)

### Recommended action for customers

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.



**NOTE:** Selecting **Continue** from the Preboot menu will not resolve the error. The printer must be turned off, and then on to clear the error allowing the printer to reboot to a **Ready** state.



**NOTE:** With firmware version 3.7, when selecting **Continue** from the Preboot menu after encountering a **33.05.2z** or **33.05.5z** error, the following message displays:

**"A disk or boot error has occurred. Clear Error. Press Any Key"**

This message should be ignored.

#### Information on the Intrusion Detection error.

For more information on SureStart, go to: [HP SureStart Whitelisting and Intrusion Detection Troubleshooting Manual](#) (Doc ID: c04863614).

## 40.wx.yz Error Messages

### 40.\* errors

Errors in the 40.\* family are related to input/output accessories, such as USB storage devices, Jetdirect cards, or EIO cards or on-board network functions.

### Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

1. Touch the **OK** button to clear the error.
2. Remove and then reinstall the accessory.

### 40 . 00 . 01 USB I/O buffer overflow To continue, touch "OK"

The USB buffer has overflowed.

### Recommended action

1. Touch the **OK** button to print the transferred data (some data might be lost).
2. Check the host configuration.

## 40 . 00 . 02 Embedded I/O buffer overflow To continue, touch “OK”

The product has experienced a JetDirect buffer overflow.

### Recommended action

1. Touch the **OK** button to print the transferred data (some data might be lost).
2. Check the host configuration.

## 40 . 00 . 03 EIO [x] buffer overflow To continue, touch “OK”

Too much data was sent to the EIO card in the specified slot (x). An incorrect communications protocol might be in use.

### Recommended action

- Touch the **OK** button to print the transferred data (some data might be lost).

## 40 . 00 . 04 EIO [x] bad transmission To continue, touch “OK”

The connection between the product and the USB device has been broken.

### Recommended action

1. Touch the **OK** button to clear the error message and continue printing.
2. Remove, and then reinstall the USB device.

## 40 . 00 . 05 Embedded I/O bad transmission To continue, touch OK

The USB device has been removed.

### Recommended action

1. Touch the **OK** button to clear the error message (data will be lost).
2. Install the USB device.

## 40 . 08 . 0x USB storage accessory removed

The USB storage accessory has been removed.

x = 0 or 1; information code.

Secure file erase is enabled.

### Recommended action

See recommended action.

- No action necessary.

## 40 . 0x . 05 USB storage accessory removed

The USB storage accessory was removed.

x = 1, 2, 3, 5, or 6; information code.

## Recommended action

See recommended action.

- No action necessary.

## 41.wx.yz Error Messages

### 41 . wx . yz Error To use another tray, touch "Options"

A printer error has occurred.

WX = error type

Y = fuser mode

Z = source tray

- WX = 02: Beam detected misprint error
- WX = 06: ITB top detection error
- WX = 07: Optional input source delay
- WX = 08: Media transportation error
- WX = 09: Sub-thermistor abnormally high temperature
- WX = 10: Pickup failure
- WX = 11: Illegal duplex
- WX = 18: Scan line inclination adjustment request
- WX = 19: T2 roller HV
- WX = 20: Image drum HV
- Y = 0: Photo paper 1, Photo paper 2, Photo paper 3, Designated paper 2, Designated paper 3, or NA, typed or Autosense
- Y = 1: Autosense (normal): special case distinguished from typed Normal
- Y = 2: Normal, typed (not Autosense)
- Y = 3: Light paper 1, 2, or 3, typed or Autosense
- Y = 4: Heavy paper 1, typed or Autosense
- Y = 5: Heavy paper 2, typed or Autosense
- Y = 6: Heavy paper 3, typed or Autosense
- Y = 7: Glossy paper 1, typed or Autosense
- Y = 8: Glossy paper 2, typed or Autosense
- Y = 9: Glossy paper 3, typed or Autosense

- Y = A: Glossy film, typed or Autosense
- Y = B: Transparency, typed or Autosense
- Y = C: Label
- Y = D: Envelope 1, Envelope 2, Envelope 3
- Y = E: Rough (designated paper 1), typed or Autosense
- Y = F: reserved for future fuser mode
- Z = 1: Tray 1
- Z = 2: Tray 2
- Z = 3: Tray 3
- Z = 4: Tray 4
- Z = 5: Tray 5
- Z = 6: Tray 6
- Z = D: Duplexer

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. To clear message, touch the **OK** button.
2. If the message reappears, turn the printer off, and then on.
3. If the error persists, replace the DC controller PCA.

DC Controller PCA (simplex) part number: CE707-67906

DC Controller PCA (duplex) part number: CE708-67902

For instructions: *Removal and replacement: DC controller* See the Repair Service Manual for this product.

## 41.01.YZ

An unknown misprint error occurred on the printer.

Y = Type, Z = Tray

- Y = 0: Photo Media (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)

- Y = 3: Light media 1, 2, or 3 mode
- Y = 4: Heavy media 1
- Y = 5: Heavy media 2
- Y = 6: Heavy media 3
- Y = 7: Glossy media 1
- Y = 8: Glossy media 2
- Y = 9: Glossy media 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode
- Z = 0: From unknown tray
- Z = 1: From Tray 1
- Z = 2: From Tray 2
- Z = 3: From Tray 3
- Z = 4: From Tray 4
- Z = 5: From Tray 5
- Z = 6: From Tray 6
- Z = 7: From Tray 7
- Z = 8: From Tray 8
- Z = 9: From Tray 9
- Z = D: From duplexer

### Recommended action

- Turn the printer off, and then on.

### 41 . 02 . 00 Error

A beam detected misprint error.

### Recommended action for customers

Follow these troubleshooting steps in the order presented.



1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. If the error persists, replace the laser/scanner assembly.

For instructions: *Removal and replacement: Laser scanner* See the Repair Service Manual for this product.

Part number: RM1-6122-070CN

## 41 . 02 . 0z Error

A beam detected misprint error.

- Z = 5: Black drum station
- Z = 6: Cyan drum station
- Z = 7: Magenta drum station
- Z = 8: Yellow drum station

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. If the error persists, replace the laser/scanner assembly.

For instructions: *Removal and replacement: Laser scanner* See the Repair Service Manual for this product.

Part number: RM1-6122-070CN

## 41 . 03 . yz Unexpected size in Tray <X> To use another tray, touch "Options"

The printer detected a different paper size than expected.

If the message **To use another tray, touch "Options"** is displayed, that means another tray is available for use.

Y = Size mismatch, Z = Source

- Y = 0: Detected paper is longer or shorter than expected
- Y = A: Detected paper too long

- Y = B: Detected paper too short
- Y = C: Unexpected size
- Y = D: Detected media too wide
- Y = E: Detected media too narrow
- Z = 1: Tray 1
- Z = 2: Tray 2
- Z = 3: Tray 3
- Z = 4: Tray 4
- Z = 5: Tray 5
- Z = 6: Tray 6
- Z = D: Duplexer

### Recommended action for customers

1. Make sure that the tray is loaded with the correct paper size.
2. Ensure that the sliding paper guides in the paper tray are set to the correct size and are correctly adjusted.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Make sure that the tray is loaded with the correct paper size and that the sliding paper guides are correctly adjusted.
2. Use the **Tray/Bin Manual Sensor Test** to verify that the tray paper switch is correctly functioning.
3. If the error persists, replace the lifter drive assembly.

Part number: RM1-6039-000CN

## 41.04.YZ

An unknown misprint error occurred on the printer.

Y = Type, Z = Tray

- Y = 0: Photo Media (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light media 1, 2, or 3 mode
- Y = 4: Heavy media 1
- Y = 5: Heavy media 2

- Y = 6: Heavy media 3
- Y = 7: Glossy media 1
- Y = 8: Glossy media 2
- Y = 9: Glossy media 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode
- Z = 0: From unknown tray
- Z = 1: From Tray 1
- Z = 2: From Tray 2
- Z = 3: From Tray 3
- Z = 4: From Tray 4
- Z = 5: From Tray 5
- Z = 6: From Tray 6
- Z = 7: From Tray 7
- Z = 8: From Tray 8
- Z = 9: From Tray 9
- Z = D: From duplexer

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Turn the printer power off, and then on.
2. If the error persists, replace the laser/scanner assembly.

For instructions: *Removal and replacement: Laser scanner* See the Repair Service Manual for this product.

Part number: RM1-6122-070CN

## 41.05.yz Unexpected type in Tray <X> To use another tray, touch "Options"

The printer detected a different paper type than expected.

If the message **To use another tray, touch "Options"** is displayed, that means another tray is available for use.

Y = Expected type, Z = Detected type

- Y = 0: Unknown
- Y = 1: Normal paper
- Y = 3: LBP transparency
- Y = 4 Glossy paper
- Y = 5: Gloss film
- Y = 6: Non-assured transparency
- Y = 7: Heavy paper
- Y = 8: Light paper
- Y = 9: Rough paper
- Y = A: Extra heavy glossy paper (glossy paper 3)
- Y = B: Heavy glossy paper (glossy paper 2)
- Y = C: Heavy paper 3
- Y = D: Heavy paper 2
- Z = 1: Normal paper
- Z = 3: LBP transparency
- Z = 4: Glossy paper
- Z = 5: Gloss film
- Z = 6: Non-assured transparency
- Z = 7: Heavy paper
- Z = 8: Light paper
- Z = A: Extra heavy glossy paper (glossy paper 3)
- Z = B: Heavy glossy paper (glossy paper 2)
- Z = C: Heavy paper 3
- Z = D: Heavy paper 2

### Recommended action for customers

1. Load the tray with the size and type of paper indicated, or use another tray if available.

2. If this message displays and the tray is loaded with the correct paper type, check the print driver settings to make sure that they match the tray type settings.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Load the tray with the size and type of paper indicated, or use another tray if available.
2. If this message displays and the tray is loaded with the correct paper type, check the print driver settings to make sure that they match the tray type settings.
3. Clean the paper sensor.
4. If the error persists, replace the paper pickup assembly.

Tray 2 paper pickup assembly part number: CE707-67903

Trays 3-6 paper pickup assembly part number: RM1-6944-000CN

### 41 . 07 . yz Error To continue, touch "OK"

A media transportation error has occurred.

Y = Type, Z = Tray

- Y = 0: Photo media 1, Photo media 2, Photo media 3, Designated media 2, Designated media 3, or N/A, typed or AutoSense
- Y = 1: AutoSense (Normal): special case distinguished from typed Normal
- Y = 2: Normal: typed (not AutoSense)
- Y = 3: Light media 1, 2, or 3: typed or AutoSense
- Y = 4: Heavy media 1: typed or AutoSense
- Y = 5: Heavy media 2: typed or AutoSense
- Y = 6: Heavy media 3: typed or AutoSense
- Y = 7: Glossy media 1: typed or AutoSense
- Y = 8: Glossy media 2: typed or AutoSense
- Y = 9: Glossy media 3: typed or AutoSense
- Y = A: Glossy film: typed or AutoSense
- Y = B: OHT: typed or AutoSense
- Y = C: Label
- Y = D: Envelope 1, Envelope 2, or Envelope 3
- Y = E: Rough (designated media 1): typed or AutoSense
- Z = 1: Tray 1

- Z = 2: Tray 2
- Z = 3: Tray 3
- Z = 4: Tray 4
- Z = 5: Tray 5
- Z = 6: Tray 6
- Z = D: Duplexer

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. If the error persists, replace the DC controller PCA.

DC Controller PCA (simplex) part number: CE707-67906

DC Controller PCA (duplex) part number: CE708-67902

For instructions: *Removal and replacement: DC controller* See the Repair Service Manual for this product.

## 42.wx.yz Error Messages

### 42.\* errors

Errors in the 42.\* family indicate an internal system failure has occurred.

### Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on. Retry the job.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on. Retry the job.

2. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

## 46.wx.yz Error Messages

### 46.\* error messages

Errors in the 46.\* family occur when the printer is trying to perform an action that it is not able to complete.

- No network connectivity
- A problem with the file being printed, with the software application sending the job, or with the print driver

#### Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Verify the printer is connected to the network, look at the network port connection on the back of the printer, and verify that the amber activity light flashes indicating network traffic, and the green link-status light is continuously lit indicating a network link. If the problem continues, try a different network cable or port on the hub and check network configuration settings such as the printer's IP address.
3. Send a different file from the same software application to see if the error is specific to the original file. Try sending a job from a different software application to see if the error is specific to the application. Verify the computer has the correct print driver installed.
4. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Verify the printer is connected to the network. If it is not, use a different network cable, and check the configuration settings.
3. Send a different file from the same software application to see if the error is specific to the original file. Try sending a job from a different software application to see if the error is specific to the application. Verify the computer has the correct print driver installed.

4. Upgrade the printer firmware.
5. If the error persists, go to WISE and search for the following document that contains links to flowcharts that you can use to troubleshoot the issue:

HP FutureSmart - 49 Error Troubleshooting (Persistent and Intermittent) (Document ID: c03122817)

Or, click the following link: [HP FutureSmart - 49 Error Troubleshooting \(Persistent and Intermittent\)](#)

## 47.wx.yz Error Messages

### 47.\* errors

Errors in the 47.\* family indicate an internal error has occurred.

#### Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

### 47.00.xx

Back channel internal error.

#### Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).



## Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

### 47.01.xx

Image transformer internal error.

## Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the **Format Disk** item in the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

### 47.02.xx

Job parser internal error.

## Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

### 47.03.xx

Print job internal error.

## Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

### 47.04.xx

Print spooler 9100 internal error.

## Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the **Format Disk** item in the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

### 47.05.xx

Print spooler framework internal error.

## Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

### 47.06.xx

Print application internal error.

## Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

## 47.FC.yz Printer Calibration Failed To continue, touch "OK"

The device is unable to access or implement one of the image patterns files.

y = Calibration type, z = Event

- 47.FC.00 (event code) Color plane registration (CPR) Image not found at system initialization
- 47.FC.01 (event code) CPR Store Image failure
- 47.FC.02 (event code) CPR Image not found
- 47.FC.03 (event code) CPR Print engine execution failure
- 47.FC.10 (event code) Consecutive Dmax Dhalf Image not found at system initialization
- 47.FC.11 (event code) Consecutive Dmax Dhalf Store image failure
- 47.FC.12 (event code) Consecutive Dmax Dhalf Image not found
- 47.FC.13 (event code) Consecutive Dmax Dhalf Print engine execution failure
- 47.FC.20 (event code) Error Diffusion Image not found at system initialization
- 47.FC.21 (event code) Error Diffusion Store image failure
- 47.FC.22 (event code) Error Diffusion Image not found
- 47.FC.23 Error Diffusion Print engine execution failure
- 47.FC.30 0 (event code) Drum Speed Adjustment Image not found at system initialization
- 47.FC.31 (event code) Drum Speed Adjustment Store image failure
- 47.FC.32 (event code) Drum Speed Adjustment Image not found
- 47.FC.33 (event code) Drum Speed Adjustment Print engine execution failure
- 47.FC.40 (event code) Pulse Width Modulation Image not found at system initialization
- 47.FC.41 (event code) Pulse Width Modulation Store image failure
- 47.FC.42 (event code) Pulse Width Modulation Image not found
- 47.FC.43 (event code) Pulse Width Modulation Print engine execution failure

## Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the product off, and then on again.
2. If the error persists, reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the product off, and then on again.
2. If the error persists over multiple power cycles, then do the following.
  - In the [Support Tools](#) > [Troubleshooting](#) > [Diagnostics](#) menu, run the hard disk tests to validate the health of the device. Fix any issue found with the mass storage device.
3. If the error persists, reload the firmware.
4. If the error persists, perform a **Format Disk** procedure using the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: [HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#)*.

# 48.wx.yz, 49.wx.yz Error Messages

## 48.\* errors

Errors in the 48.\* family indicate an internal error has occurred.

## Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. In most cases, no action is necessary.
2. If the error persists, upgrade the printer firmware.
3. If the error persists, continue troubleshooting with the flowcharts for either Intermittent or Persistent 48 error troubleshooting (whichever is appropriate) in document c03122817. Search for the following document on **WISE**: HP LaserJet FutureSmart Devices - 49 Error Troubleshooting (Persistent and Intermittent).

Or click the following link: [HP LaserJet FutureSmart Devices - 49 Error Troubleshooting \(Persistent and Intermittent\)](#)

---

 **NOTE:** 48.wx.yz errors are similar to 49.wx.yz errors and use the same troubleshooting steps and procedures.

---

## 48 . 01 . xx Error

A job framework internal error has occurred.

XX values range from 0 to 9 and 0A to 0C. All enumerations have the same description and recommended action.

### Recommended action

- No action is necessary.

## 49 . xx . yy Error To continue turn off then on

A firmware error occurred.

Possible causes:

- Corrupted print jobs
- Software application issues
- Non-product specific print drivers
- Poor quality USB or network cables
- Bad network connections or incorrect configurations
- Invalid firmware operations
- Unsupported accessories

A 49 error might happen at any time for multiple reasons. Although some types of 49 errors can be caused by hardware failures, it is more common for 49 errors to be caused by printing a specific document or performing some task on the printer.

49 errors most often occur when a printer is asked to perform an action that the printer firmware is not capable of and might not have been designed to comply with, such as:

- Printing files with unsupported programming commands
- A unique combination of user environment and user interactions with the printer
- Interfacing with a third-party solution that was not designed to work with the printer

- Specific timing, network traffic, or concurrent processing of jobs

## Recommended action for customers

 **NOTE:** LaserJet formatter PCAs are rarely the root cause of 49 service errors. Please do not replace the formatter unless troubleshooting has identified the formatter as the root cause.

1. Turn the printer off, and then on.
2. If the error persists, check the following:
  - The error might be caused by a network connectivity problem, such as a bad USB or network interface cable, a bad USB port, or an invalid network configuration setting.
  - The error might be caused by the print job, due to an invalid print driver, a problem with the software application, or a problem with the file being printed.
  - Upgrading the printer firmware might help resolve the error.  
For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

 **NOTE:** LaserJet formatter PCAs are rarely the root cause of 49 service errors. Please do not replace the formatter unless troubleshooting has identified the formatter as the root cause.

1. Turn the printer off, and then on.
2. If the error persists, check the following:
  - The error might be caused by a network connectivity problem, such as a bad interface cable, a bad USB port, or an invalid network configuration setting.
  - The error might be caused by the print job, due to an invalid print driver, a problem with the software application, or a problem with the file being printed.
  - Upgrading the printer firmware might help resolve the error.
3. If the error persists, continue troubleshooting with the flowcharts for either Intermittent or Persistent 49 error troubleshooting (whichever is appropriate) in document c03122817. Search for the following document on **WISE**: HP LaserJet FutureSmart Devices - 49 Error Troubleshooting (Persistent and Intermittent).

 **NOTE:** 48 errors are similar to 49 errors.

Or click the following link: [HP LaserJet FutureSmart Devices - 49 Error Troubleshooting \(Persistent and Intermittent\)](#)

## 49 . 38 . 07 Error To continue turn off then on

A firmware error has occurred.

## Recommended action

1. For U.S. based printers, verify the printer is a 110 volt model. If the customer received a 220 volt printer, they might experience this issue along with reboot problems.
2. If the error persists, continue troubleshooting with the flowcharts for either intermittent or persistent 49 errors (whichever is appropriate) located in the following document, go to, or search for: [HP LaserJet FutureSmart Devices - 49 Error Troubleshooting \(Persistent and Intermittent\)](#) (c03122817)

## 49 . 38 . 14 Error To continue turn off then on

A firmware error has occurred.

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. If the error persists, ensure the customer is using firmware version to 20140529 or later. If needed, update the firmware.
3. If the error persists, replace the DC controller PCA.

DC Controller PCA (simplex) part number: CE707-67906

DC Controller PCA (duplex) part number: CE708-67902

For instructions: *Removal and replacement: DC controller* See the Repair Service Manual for this product.

## 50.wx.yz Error Messages

### 50 . 1x . yz or 50 . 2x . yz Fuser error To continue turn off then on

Low fuser temperature and fuser warm-up failure.

X = fuser mode

- 1: Autosense (normal): special case distinguished from typed Normal
- 2: Normal, typed (not Autosense)
- 3: Light paper 1, 2, or 3, typed or Autosense
- 4: Heavy paper 1, typed or Autosense
- 5: Heavy paper 2, typed or Autosense
- 6: Heavy paper 3, typed or Autosense



- 7: Glossy paper 1, typed or Autosense
- 8: Glossy paper 2, typed or Autosense
- 9: Glossy paper 3, typed or Autosense
- A: Glossy film, typed or Autosense
- B: OHT
- C: Label
- D: Envelope 1, 2, or 3 mode
- E: Rough
- F: Other mode

Y = previous printer sleep state

Z = next printer sleep state

- 0: Printing
- 1: Standby level 1 (no temperature control)
- 2: Standby level 2 (high temperature control)
- 3: Standby level 3 (middle temperature control)
- 4: Standby level 4 (low temperature control)
- 5: Middle sleep
- 6: Deep sleep
- 7: Power off

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



**NOTE:** Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.  
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Remove and then reseal the fuser. Make sure there is no residual paper in the fuser. Make sure the device is not located in front of a vent or window where cool air may interfere with the ability of the fuser to heat up.
2. Check the printer power source. Make sure the power source meets printer requirements. Make sure this is the only device using the circuit.
3. Replace the fuser.  
Fuser kit (110V) part number: CE707-67912  
Fuser kit (220V) part number: CE707-67913



**NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

4. Check the connector (J704) between the fuser and the printer. If it is damaged, replace the fuser drive assembly or fuser.  
Fuser drive assembly part number: CE707-67904  
Fuser kit (110V) part number: CE707-67912  
Fuser kit (220V) part number: CE707-67913



**NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

5. If the error persists, replace the low-voltage power supply.  
Low-voltage power supply PCA (110V) part number: RM1-6753-000CN  
Low-voltage power supply PCA (220V) part number: RM1-6754-000CN  
For instructions: *Removal and replacement: Low-voltage power supply (LVPS)* See the Repair Service Manual for this product.
6. If this printer has been previously serviced, check the connector (J131) on the DC controller PCA and the connectors (J109 and J110) on the power line between the low-voltage power supply and the fuser.

## 50 . 3x . yz Fuser error To continue turn off then on

Fuser high temperature error.

X = fuser mode

- 1: Autosense (normal): special case distinguished from typed Normal
- 2: Normal, typed (not Autosense)
- 3: Light paper 1, 2, or 3, typed or Autosense
- 4: Heavy paper 1, typed or Autosense

- 5: Heavy paper 2, typed or Autosense
- 6: Heavy paper 3, typed or Autosense
- 7: Glossy paper 1, typed or Autosense
- 8: Glossy paper 2, typed or Autosense
- 9: Glossy paper 3, typed or Autosense
- A: Glossy film, typed or Autosense
- B: OHT
- C: Label
- D: Envelope 1, 2, or 3 mode
- E: Rough
- F: Other mode

Y = previous printer sleep state

Z = next printer sleep state

- 0: Printing
- 1: Standby level 1 (no temperature control)
- 2: Standby level 2 (high temperature control)
- 3: Standby level 3 (middle temperature control)
- 4: Standby level 4 (low temperature control)
- 5: Middle sleep
- 6: Deep sleep
- 7: Power off

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



**NOTE:** Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

---

3. Ensure the paper type and fuser mode are correct for the paper being used.  
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.

5. Retest the printer.
6. If the error persists, please contact customer support at: [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action for call-center agents and onsite technicians

1. Remove and then reseal the fuser.
2. Check the paper type setting using the printer menus and in the printer driver. Make sure that they match and are correct for the type of media being used.

3. Replace the fuser.

Fuser kit (110V) part number: CE707-67912

Fuser kit (220V) part number: CE707-67913



**NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

4. If the error persists, replace the low-voltage power supply.

Low-voltage power supply PCA (110V) part number: RM1-6753-000CN

Low-voltage power supply PCA (220V) part number: RM1-6754-000CN

For instructions: *Removal and replacement: Low-voltage power supply (LVPS)* See the Repair Service Manual for this product.

5. If this printer has been previously serviced, check the connector (J131) on the DC controller PCA.

## 50 . 4x . yz Fuser error To continue turn off then on

The fuser drive circuit failure.

X = fuser mode

- 1: Autosense (normal): special case distinguished from typed Normal
- 2: Normal, typed (not Autosense)
- 3: Light paper 1, 2, or 3, typed or Autosense
- 4: Heavy paper 1, typed or Autosense
- 5: Heavy paper 2, typed or Autosense
- 6: Heavy paper 3, typed or Autosense
- 7: Glossy paper 1, typed or Autosense
- 8: Glossy paper 2, typed or Autosense
- 9: Glossy paper 3, typed or Autosense
- A: Glossy film, typed or Autosense
- B: OHT

- C: Label
- D: Envelope 1, 2, or 3 mode
- E: Rough
- F: Other mode

Y = previous printer sleep state

Z = next printer sleep state

- 0: Printing
- 1: Standby level 1 (no temperature control)
- 2: Standby level 2 (high temperature control)
- 3: Standby level 3 (middle temperature control)
- 4: Standby level 4 (low temperature control)
- 5: Middle sleep
- 6: Deep sleep
- 7: Power off

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.

---

 **NOTE:** Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

---

3. Ensure the paper type and fuser mode are correct for the paper being used.  
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Check the power source. Make sure the power source meets printer requirements.

---

 **NOTE:** If the power source does not meet the power frequency requirement of 43 to 67Hz, the fuser temperature control does not work properly and causes this error.

---

2. If the error persists, replace the low-voltage power supply.

Low-voltage power supply PCA (110V) part number: RM1-6753-000CN

Low-voltage power supply PCA (220V) part number: RM1-6754-000CN

For instructions: *Removal and replacement: Low-voltage power supply (LVPS)* See the Repair Service Manual for this product.

3. If this printer has been previously serviced, check the connector (J21) on the DC controller PCA.

## 50 . 7x . yz Fuser error To continue turn off then on

Fuser pressure-release mechanism failure.

X = fuser mode

- 1: Autosense (normal): special case distinguished from typed Normal
- 2: Normal, typed (not Autosense)
- 3: Light paper 1, 2, or 3, typed or Autosense
- 4: Heavy paper 1, typed or Autosense
- 5: Heavy paper 2, typed or Autosense
- 6: Heavy paper 3, typed or Autosense
- 7: Glossy paper 1, typed or Autosense
- 8: Glossy paper 2, typed or Autosense
- 9: Glossy paper 3, typed or Autosense
- A: Glossy film, typed or Autosense
- B: OHT
- C: Label
- D: Envelope 1, 2, or 3 mode
- E: Rough
- F: Other mode

Y = previous printer sleep state

Z = next printer sleep state

- 0: Printing
- 1: Standby level 1 (no temperature control)
- 2: Standby level 2 (high temperature control)
- 3: Standby level 3 (middle temperature control)
- 4: Standby level 4 (low temperature control)

- 5: Middle sleep
- 6: Deep sleep
- 7: Power off

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



**NOTE:** Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.  
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Remove and then reseal the fuser. Make sure there is no residual paper in the fuser.
2. Check the fuser pressure-release sensor flag. If it is damaged, replace the fuser.

Fuser kit (110V) part number: CE707-67912

Fuser kit (220V) part number: CE707-67913



**NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

3. Use the **Manual sensor test** to verify that the fuser pressure-release sensor (PS9) is properly functioning. If it is not, replace the fuser gear assembly.  
Part number: RM1-7914-060CN
4. Use the fuser pressure-release drive test in the **Component tests** to verify that the fuser motor (M4) is properly functioning. If it is not, replace the fuser motor.  
Part number: RM1-6074-000CN
5. If the error persists, replace the low-voltage power supply.  
Low-voltage power supply PCA (110V) part number: RM1-6753-000CN  
Low-voltage power supply PCA (220V) part number: RM1-6754-000CN

For instructions: *Removal and replacement: Low-voltage power supply (LVPS)* See the Repair Service Manual for this product.

6. If this printer has been previously serviced, check the connector (J181) on the DC controller PCA.

## 50 . 8x . yz Fuser error To continue turn off then on

Low fuser temperature 2 error.

X = fuser mode

- 1: Autosense (normal): special case distinguished from typed Normal
- 2: Normal, typed (not Autosense)
- 3: Light paper 1, 2, or 3, typed or Autosense
- 4: Heavy paper 1, typed or Autosense
- 5: Heavy paper 2, typed or Autosense
- 6: Heavy paper 3, typed or Autosense
- 7: Glossy paper 1, typed or Autosense
- 8: Glossy paper 2, typed or Autosense
- 9: Glossy paper 3, typed or Autosense
- A: Glossy film, typed or Autosense
- B: OHT
- C: Label
- D: Envelope 1, 2, or 3 mode
- E: Rough
- F: Other mode

Y = previous printer sleep state

Z = next printer sleep state

- 0: Printing
- 1: Standby level 1 (no temperature control)
- 2: Standby level 2 (high temperature control)
- 3: Standby level 3 (middle temperature control)
- 4: Standby level 4 (low temperature control)
- 5: Middle sleep
- 6: Deep sleep
- 7: Power off



## Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.

---

 **NOTE:** Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

---

3. Ensure the paper type and fuser mode are correct for the paper being used.  
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Remove and then reseal the fuser. Make sure there is no residual paper in the fuser. Make sure the device is not located in front of a vent or window where cool air may interfere with the ability of the fuser to heat up.
2. Check the printer power source. Make sure the power source meets printer requirements. Make sure this is the only device using the circuit.

3. Replace the fuser.

Fuser kit (110V) part number: CE707-67912

Fuser kit (220V) part number: CE707-67913

---

 **NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

---

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

4. Check the connector (J704) between the fuser and the printer. If it is damaged, replace the fuser drive assembly or fuser.

Fuser drive assembly part number: CE707-67904

Fuser kit (110V) part number: CE707-67912

Fuser kit (220V) part number: CE707-67913

---

 **NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

---

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

5. If the error persists, replace the low-voltage power supply.  
 Low-voltage power supply PCA (110V) part number: RM1-6753-000CN  
 Low-voltage power supply PCA (220V) part number: RM1-6754-000CN  
 For instructions: *Removal and replacement: Low-voltage power supply (LVPS)* See the Repair Service Manual for this product.
6. If this printer has been previously serviced, check the connector (J131) on the DC controller PCA and the connectors (J109 and J110) on the power line between the low-voltage power supply assembly and the fuser.

## 50 . 9x . yz Fuser error To continue turn off then on

Fuser high temperature 2 error.

X = fuser mode

- 1: Autosense (normal): special case distinguished from typed Normal
- 2: Normal, typed (not Autosense)
- 3: Light paper 1, 2, or 3, typed or Autosense
- 4: Heavy paper 1, typed or Autosense
- 5: Heavy paper 2, typed or Autosense
- 6: Heavy paper 3, typed or Autosense
- 7: Glossy paper 1, typed or Autosense
- 8: Glossy paper 2, typed or Autosense
- 9: Glossy paper 3, typed or Autosense
- A: Glossy film, typed or Autosense
- B: OHT
- C: Label
- D: Envelope 1, 2, or 3 mode
- E: Rough
- F: Other mode

Y = previous printer sleep state

Z = next printer sleep state

- 0: Printing
- 1: Standby level 1 (no temperature control)
- 2: Standby level 2 (high temperature control)
- 3: Standby level 3 (middle temperature control)

- 4: Standby level 4 (low temperature control)
- 5: Middle sleep
- 6: Deep sleep
- 7: Power off

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
  2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.
- 
-  **NOTE:** Unplug the printer from any power-strip or uninterruptured power supply, and plug it directly into a wall socket.
- 
3. Ensure the paper type and fuser mode are correct for the paper being used.  
Check the size and type on the control panel Trays menu or use the EWS Trays menu
  4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
  5. Retest the printer.
  6. If the error persists, please contact customer support at: [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Remove and then reseal the fuser.
2. Check the paper type setting using the printer menus and in the printer driver. Make sure that they match and are correct for the type of media being used.
3. Replace the fuser.  
Fuser kit (110V) part number: CE707-67912  
Fuser kit (220V) part number: CE707-67913

---

 **NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

---

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

4. If this printer has been previously serviced, check the connector (J131) on the DC controller PCA.

## 50 .Ax .yz Fuser error To continue turn off then on

Low fuser temperature 3 error.

X = fuser mode

- 1: Autosense (normal): special case distinguished from typed Normal

- 2: Normal, typed (not Autosense)
- 3: Light paper 1, 2, or 3, typed or Autosense
- 4: Heavy paper 1, typed or Autosense
- 5: Heavy paper 2, typed or Autosense
- 6: Heavy paper 3, typed or Autosense
- 7: Glossy paper 1, typed or Autosense
- 8: Glossy paper 2, typed or Autosense
- 9: Glossy paper 3, typed or Autosense
- A: Glossy film, typed or Autosense
- B: OHT
- C: Label
- D: Envelope 1, 2, or 3 mode
- E: Rough
- F: Other mode

Y = previous printer sleep state

Z = next printer sleep state

- 0: Printing
- 1: Standby level 1 (no temperature control)
- 2: Standby level 2 (high temperature control)
- 3: Standby level 3 (middle temperature control)
- 4: Standby level 4 (low temperature control)
- 5: Middle sleep
- 6: Deep sleep
- 7: Power off

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



**NOTE:** Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

---

3. Ensure the paper type and fuser mode are correct for the paper being used.  
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action for call-center agents and onsite technicians

1. Remove and then reseal the fuser. Make sure there is no residual paper in the fuser. Make sure the device is not located in front of a vent or window where cool air may interfere with the ability of the fuser to heat up.
2. Check the printer power source. Make sure the power source meets printer requirements. Make sure this is the only device using the circuit.
3. Replace the fuser.

Fuser kit (110V) part number: CE707-67912

Fuser kit (220V) part number: CE707-67913

---

 **NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

---

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

4. Check the connector (J704) between the fuser and the printer. If it is damaged, replace the fuser drive assembly or fuser.

Fuser drive assembly part number: CE707-67904

Fuser kit (110V) part number: CE707-67912

Fuser kit (220V) part number: CE707-67913

---

 **NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

---

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

5. If this printer has been previously serviced, check the connector (J131) on the DC controller PCA and the connectors (J109 and J110) on the power line between the low-voltage power supply assembly and the fuser.

## 50 . Bx . yz Fuser error To continue turn off then on

Fuser high temperature 3 error.

X = fuser mode

- 1: Autosense (normal): special case distinguished from typed Normal
- 2: Normal, typed (not Autosense)
- 3: Light paper 1, 2, or 3, typed or Autosense

- 4: Heavy paper 1, typed or Autosense
- 5: Heavy paper 2, typed or Autosense
- 6: Heavy paper 3, typed or Autosense
- 7: Glossy paper 1, typed or Autosense
- 8: Glossy paper 2, typed or Autosense
- 9: Glossy paper 3, typed or Autosense
- A: Glossy film, typed or Autosense
- B: OHT
- C: Label
- D: Envelope 1, 2, or 3 mode
- E: Rough
- F: Other mode

Y = previous printer sleep state

Z = next printer sleep state

- 0: Printing
- 1: Standby level 1 (no temperature control)
- 2: Standby level 2 (high temperature control)
- 3: Standby level 3 (middle temperature control)
- 4: Standby level 4 (low temperature control)
- 5: Middle sleep
- 6: Deep sleep
- 7: Power off

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



**NOTE:** Unplug the printer from any power-strip or uninterruptible power supply, and plug it directly into a wall socket.

---

3. Ensure the paper type and fuser mode are correct for the paper being used.

Check the size and type on the control panel Trays menu or use the EWS Trays menu

4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action for call-center agents and onsite technicians

1. Remove and then reseal the fuser.
2. Check the paper type setting using the printer menus and in the printer driver. Making sure that they match and are correct for the type of media being used.
3. Replace the fuser.

Fuser kit (110V) part number: CE707-67912

Fuser kit (220V) part number: CE707-67913



**NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

4. Check the connector (J704) between the fuser and the printer. If it is damaged, replace the fuser drive assembly or fuser.

Fuser drive assembly part number: CE707-67904

Fuser kit (110V) part number: CE707-67912

Fuser kit (220V) part number: CE707-67913



**NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

5. If this printer has been previously serviced, check the connector (J131) on the DC controller PCA.

## 51.wx.yz, 52.wx.yz Error Messages

### 51.\* errors

Errors in the 51.\* family are related to the laser scanner.

#### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](http://HP FutureSmart - Latest Firmware Versions)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Ensure the printer is running the most current version of firmware.  
For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
2. Check all connections on the laser/scanner and from the laser/scanner to the DC controller, and reseal them if necessary.
3. If the error persists, replace the laser scanner.

### 51.00.yz Error To continue turn off then on

An error with the laser/scanner assembly has occurred in the printer.

- 51.00.10 : Beam detect error
- 51.00.19 : Laser malfunction
- 51.00.20 : Black laser scanner error
- 51.00.21 : Cyan laser scanner error
- 51.00.22 : Magenta laser scanner error
- 51.00.23 : Yellow laser scanner error

#### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Check the flat flexible cable (FFC) connections to the laser scanners.
3. Replace the laser scanner.

For instructions: *Removal and replacement: Laser scanner* See the Repair Service Manual for this product.

Part number: RM1-6122-070CN

### 52.\* errors

Errors in the 52.\* family are related to the laser scanner.



### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Ensure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Check all connections on the laser/scanner and from the laser/scanner to the DC controller, and reseal them if necessary.
3. If the error persists, replace the laser scanner.

## 52 . wx . 00 To continue turn off then on

Laser/scanner error

- 52 . 00 . 00 : Laser/scanner motor start up error
- 52 . 20 . 00 : Laser/scanner rotation error

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Use the scanner motor (M10) drive test in the **Component tests** to test the motor. If the motor does not run, replace the laser/scanner assembly.



**NOTE:** Listen for a high pitched whine from the motor.

Part number: RM1-6122-070CN

For instructions: *Removal and replacement: Laser scanner* See the Repair Service Manual for this product.

2. If the laser/scanner assembly has been removed or replaced, check the connectors (J831 and J832) on the laser-driver PCA and the connectors (J61 and J62) on the DC controller PCA.

## 54.wx.yz Error Messages

### 54.\* errors

Errors in the 54.\* family are related to the image-formation system.

- For HP LaserJet printers, they can indicate a problem with the toner cartridges or the transfer unit (color printers only), or they can indicate a problem with a sensor, such as with the laser/scanner.
- For HP PageWide printers, they can indicate a problem with the calibration process.

#### Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Make sure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Check the supplies status page using the [Supplies](#) menu on the control panel to verify that toner cartridges, toner collection unit (TCU), or the transfer belt kit are not past their useful life. Replace the supplies and maintenance parts as necessary.

To print a Supplies Status Page:

- a. From the Home screen on the printer control panel, select [Administration](#).
- b. Open the following menus:
  - i. [Reports](#)
  - ii. [Configuration/Status Pages](#)
- c. Scroll to and select [Supplies Status Page](#).
- d. Select [Print](#) to print the page.

To order parts, go to <https://www.hp.com/buy/parts>.

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.

2. Check the supplies status page to verify that the toner cartridges, TCU, or the transfer belt kit are not past their useful life. Replace the supplies and maintenance parts as necessary.
3. For color printers, inspect the transfer belt for damage. Replace the transfer belt if necessary or instruct the customer to replace it.
4. For color printers, if the error persists, replace the registration assembly.
5. Check the connections between the laser/scanner and the DC controller, and from the laser/scanner to the printer. Reseat them if necessary. If the error persists, replace the laser scanner.

## 54.00.03

Environmental sensor failure.

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. If the environmental sensor has been removed or replaced, check the connector (J2) on the environmental sensor and the connector (J108) on the DC controller PCA.
3. If the error persists, replace the environmental sensor assembly.

Part number: RK2-2884-000CN

## 54.00.06, 54.00.14, or 54.00.19

Registration density sensor failure

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Open and close the right door (or turn on and then off the power switch) to perform the color plane registration.
2. If the error persists, replace the registration density sensor assembly.

Part number: RM1-7922-000CN

## 54.01.05

Paper sensor is out of calibration range

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then clean the paper sensor with a lint-free cloth. Turn the printer on.
2. If the error persists, replace the paper pickup assembly.

Part number: CE707-67903

## 54.06.21

Primary laser/scanner beam detect abnormality

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. If the error persists, replace the laser/scanner assembly.

For instructions: *Removal and replacement: Laser scanner* See the Repair Service Manual for this product.

Part number: RM1-6122-070CN

3. If the printer has had parts removed or replaced, check the connector (J110-C/M or J111-C/M) on the DC controller PCA.

## 54.0x.07

Drum home position sensor failure

X = 5: Black

X = 6: Cyan

X = 7: Magenta

X = 8: Yellow

## Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. If the error persists, replace the main drive assembly.  
Main drive assembly (simplex) part number: CE707-67905  
Main drive assembly (duplex) part number: CE708-67901
3. If this printer has been previously serviced, check the connector (J181) on the DC controller PCA.

## 54 . 0x . 0B or 54 . 0x . 0C

Density sensor out of range error or Dhalf calibration failure

- X = 0: Black
- X = 1: Cyan
- X = 2: Magenta
- X = 3: Yellow

## Recommended action for customers

1. Check the supplies status page for 10.22.69 or 10.22.70 messages to make sure the print cartridges are not past their useful life.

**10.22.69:** Intermediate transfer belt (ITB) very low.

**10.22.70:** Intermediate transfer belt (ITB) printing past very low.

---

 **NOTE:** When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

 **NOTE:** HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

---

Part number: CC522-67911

For instructions: *Removal and replacement: Intermediate transfer belt (ITB)* See the Repair Service Manual for this product.

2. Check the ITB for damage. Replace the transfer kit, if needed.

Part number: CC522-67911

For instructions: *Removal and replacement: Intermediate transfer belt (ITB)* See the Repair Service Manual for this product.

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Check the supplies status page for 10.22.69 or 10.22.70 messages to make sure the print cartridges are not past their useful life.

**10.22.69:** Intermediate transfer belt (ITB) very low.

**10.22.70:** Intermediate transfer belt (ITB) printing past very low.

---

 **NOTE:** When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

 **NOTE:** HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

---

Part number: CC522-67911

For instructions: *Removal and replacement: Intermediate transfer belt (ITB)* See the Repair Service Manual for this product.

2. Check the ITB for damage. Replace the transfer kit, if needed.

Part number: CC522-67911

For instructions: *Removal and replacement: Intermediate transfer belt (ITB)* See the Repair Service Manual for this product.

3. Make sure the CPR sensor is not contaminated with toner or paper dust. Clean the sensor with compressed air and soft brush.

4. If error persists, replace the registration sensor assembly.

Part number: RM1-7922-000CN

### 54 . 0X . 0D or 54 . 0X . 0E

Optical memory element abnormal or CPR sensor out of range

- X = 0: Black
- X = 1: Cyan
- X = 2: Magenta
- X = 3: Yellow

### Recommended action for customers

1. Check the supplies status page for 10.22.69 or 10.22.70 messages to make sure the print cartridges are not past their useful life.

**10.22.69:** Intermediate transfer belt (ITB) very low.

**10.22.70:** Intermediate transfer belt (ITB) printing past very low.

---

 **NOTE:** When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

 **NOTE:** HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

---

Part number: CC522-67911

For instructions: *Removal and replacement: Intermediate transfer belt (ITB)* See the Repair Service Manual for this product.

2. Check the ITB for damage. Replace the transfer kit, if needed.

Part number: CC522-67911

For instructions: *Removal and replacement: Intermediate transfer belt (ITB)* See the Repair Service Manual for this product.

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Check the supplies status page for 10.22.69 or 10.22.70 messages to make sure the print cartridges are not past their useful life.

**10.22.69:** Intermediate transfer belt (ITB) very low.

**10.22.70:** Intermediate transfer belt (ITB) printing past very low.

 **NOTE:** When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

 **NOTE:** HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

---

Part number: CC522-67911

For instructions: *Removal and replacement: Intermediate transfer belt (ITB)* See the Repair Service Manual for this product.

2. Check the ITB for damage. Replace the transfer kit, if needed.

Part number: CC522-67911

For instructions: *Removal and replacement: Intermediate transfer belt (ITB)* See the Repair Service Manual for this product.

3. Make sure the CPR sensor is not contaminated with toner or paper dust. Clean the sensor with compressed air and soft brush.

4. If error persists, replace the registration sensor assembly.

Part number: RM1-7922-000CN

## 54.11.05

Media sensor is not functioning properly.

## Recommended action for customers

1. Clean the media sensor with a lint-free cloth, and then turn the printer off and then on.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Clean the media sensor with a lint-free cloth, and then turn the printer off and then on.
2. If the error persists, replace the paper pickup assembly. The threshold level for the media sensor (Media sensor value ) is located on a label on the paper pickup assembly. Use the **Service** menu to input this value into the printer memory after replacing the paper pickup assembly.  
  
Part number: CE707-67903
3. If this printer has been previously serviced, check the connector (J542) on the media sensor and the connector (J112) on the DC controller PCA.

### 54.12.05

Media sensor is not functioning properly.

### Recommended action for customers

1. Clean the media sensor with a lint-free cloth, and then turn the printer off and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action

1. Clean the media sensor with a lint-free cloth, and then turn the printer off and then on.
2. If the error persists replace the right door assembly.  
  
Right door assembly (simplex) part number: RM1-6138-000CN  
Right door assembly (duplex) part number: RM1-6007-000CN
3. If this printer has been previously serviced, check the connector (J114) on the media sensor and the connector (J152) on the DC controller PCA..

## 55.wx.yz, 56.wx.yz Error Messages

### 55 . wx . yz DC controller error To continue turn off then on

The communication link between the formatter and DC controller was lost.

- 55 . 00 . 00 : Internal communication error
- 55 . 00 . 01 : DC controller memory error
- 55 . 00 . 03 : DC controller no engine response
- 55 . 00 . 04 : DC controller communications timeout
- 55 . 01 . 06 : DC controller NVRAM abnormal read/write
- 55 . 02 . 06 : DC controller NVRAM not accessible



## Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Perform an engine test.
3. Verify the connectors on the DC controller.
4. If the error persists, replace the DC controller.

DC Controller PCA (simplex) part number: CE707-67906

DC Controller PCA (duplex) part number: CE708-67902

For instructions: *Removal and replacement: DC controller* See the Repair Service Manual for this product.

## 56.\* errors

Errors in the 56.\* family indicate a communication problem with an optional paper tray or other external accessory.

## Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

1. Turn the printer off, and then on.
2. If any third-party hardware is installed, remove it and try printing again.
3. If an optional paper tray is installed, remove it. Check the connectors on the tray for damage. If the connector is damaged, replace the tray.
4. Reinstall the tray, and make sure it is correctly seated.

## 56.00.01 Illegal Input Printer Error To continue turn off then on

The printer experienced a communication error with the optional paper tray.

## Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Remove, and then reseal the optional tray.
3. Check the input connectors for damage. Replace a damaged connector.

Part number: VS1-7514-008CN

4. Remove any third-party hardware.
5. Upgrade the firmware.
6. If the error persists, replace the DC controller.

DC Controller PCA (simplex) part number: CE707-67906

DC Controller PCA (duplex) part number: CE708-67902

For instructions: *Removal and replacement: DC controller* See the Repair Service Manual for this product.

## 56 . 00 . 02 Selected media output bin unavailable

The bin selected for output is unavailable.

### Recommended action

1. Turn the printer off, and then on.
2. Remove any third-party hardware.
3. Attempt the remote firmware update again.
4. If the error persists, elevate the case following your standard support process.

## 56 . 00 . 03 Media input path operation error

A tray is open and is blocking the paper path above the selected tray.

### Recommended action

1. Close the open tray.
2. If all trays are closed, use the **Tray/Bin Manual Sensor Test** to check the tray closed sensors for the trays above the selected tray.
3. If the error persists, elevate the case following your standard support process.

## 57.wx.yz Error Messages

### 57.\* errors

Errors in the 57.\* family indicate a problem with a fan.

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.
2. Press the Power button again to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Use the printer troubleshooting manual to identify the locations of each fan. Turn the printer off and then on, and listen for noise coming from the area of each fan. Replace any fan that is not making noise.
2. Update the firmware to the latest version. If the latest version firmware is already installed, reinstall it now.

For more information, see:

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. Remove enough parts to access the DC controller or the power supply PCA. Check the connections from each fan to the DC controller or power supply PCA. Reseat them if necessary.
4. With the DC controller or power supply PCA exposed, turn the printer on. Immediately measure the voltage between the connectors for each fan and the DC controller. If the voltage changes from 0V to approximately 24V during the power-on cycle, replace the affected fan. If the voltage remains at 0V, replace the DC controller.

## 57.00.01

Power supply fan (FM1) failure

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on. Listen for fan noise at the front, lower-left corner of the printer. If no noise is heard, replace the power supply fan (FM1).

Part number: RK2-2276-000CN

2. If this part has been removed or replaced, check the connector (J21) on the DC controller PCA and the connector (J106) on the low-voltage power supply assembly.

## 57.00.02

Fuser fan (FM2) failure

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on. Listen for fan noise at the front, lower-right corner of the printer. If no noise is heard, replace the fuser fan (FM2).

Part number: RK2-2728-000CN

2. If this part has been removed or replaced, check the connector (J121) on the DC controller PCA and the intermediate connector (J524).

## 57.00.03

Formatter fan (FM3) failure

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on. Listen for fan noise at the lower back, center of the printer. If no noise is heard, replace the formatter fan (FM3).

Part number: RK2-3301-000CN

2. If this part has been removed or replaced, check the connector (J142) on the interconnect board.

## 58.wx.yz Error Messages

### 58.\* errors

Errors in the 58.\* family indicate an electrical problem inside the printer.

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Make sure the printer is connected to a dedicated power outlet and not to a surge protector or other type of extension cord.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Make sure the printer is connected to a dedicated power outlet and not to a surge protector or other type of extension cord.
3. Check all connections on the DC Controller and the power supply. Trace the connections from the DC Controller and power supply to the sensors and other components and reseal them if necessary.

## 58 . 00 . 02 environmental sensor malfunction

The printer has experienced an environmental sensor error.

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Turn the printer off and then on.
2. Verify that the connector (J33S) on the DC controller PCA and the sensor (J502S) are connected correctly and undamaged.
3. If the error persists, replace the environmental sensor.

Part number: RK2-2884-000CN

## 58 . 00 . 04 Error To continue turn off then on

The low-voltage power supply is defective.

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Check the connector (J143) on the DC controller PCA.
3. If the error persists, replace the low voltage power supply.

For instructions: *Removal and replacement: Low-voltage power supply (LVPS)* See the Repair Service Manual for this product.

Low-voltage power supply PCA (110V) part number: RM1-6753-000CN

Low-voltage power supply PCA (220V) part number: RM1-6754-000CN

## 59.wx.yz Error Messages

### 59.\* errors

Errors in the 59.\* family indicate a problem with one of the motors or with the lifter drive assembly for one of the trays.

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Check all connections on the main control board of the printer, (DC controller, Engine control board ECB) each motor, and to the paper feeder drive PCA (for an optional paper feeder). Reseat them if necessary.

### 59.00.30 or 59.00.40

Fuser motor (M4) start up error or fuser motor (M4) rotational error

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Use the fuser motor (M4) drive test in the **Component Test** to verify that the fuser motor is properly functioning. If it is not, replace the fuser motor assembly.

Part number: RM1-6074-000CN

2. If the printer has been serviced, check the connector (J516) on the fuser motor and the connector (J81) on the DC controller PCA.

## 59.00.90 or 59.00.A0

ITB motor (M1) start up error or ITB motor (M1) abnormal rotational error

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Use the ITB motor (M1) drive test in the **Component Test** to verify that the ITB motor is properly functioning. If it is not, replace the ITB motor assembly.

Part number: RM1-6088-000CN

2. If the printer has been serviced, check the connector (J517) on the ITB motor and the connector (J81) on the DC controller PCA.

## 59.00.C0

Developer alienation motor (M6) error

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Use the developer engagement and disengagement drive test in the **Component Test** to verify that the disengagement mechanism is properly functioning. If it is not, replace the ITB motor assembly.

Part number: RM1-6088-000CN

2. Use the sensor test in the **Manual Sensor Test** to verify that the developer disengagement sensor (PS11) is properly functioning. If it is not, replace the main drive assembly.

Main drive assembly (simplex) part number: CE707-67905

Main drive assembly (duplex) part number: CE708-67901

3. If the printer has been serviced, check the connector (J518) on the developer disengagement motor, the connector (J1005) on the driver PCA and the connector (J91) on the DC controller PCA.
4. If the error persists, refer to the additional troubleshooting and parts recommendations in the following document:

Go to or search for: [HP Color LaserJet CP5225, CP5525, M750, M775 MFP - 59.0C/59.00.0C error may be accompanied with grinding noise and or missing color on output](#)

## 59.00.F0

T1 alienation mechanism failure

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents


Follow these troubleshooting steps in the order presented.

1. Reseat the ITB and make sure the ITB is installed correctly.
  - a. Open the right door, and then grasp the small handles on the ITB.



- b. Pull the ITB out of the product until the two large handles expand along the right and left sides of the ITB.

**Figure 6-7 Remove the ITB (2 of 3)**

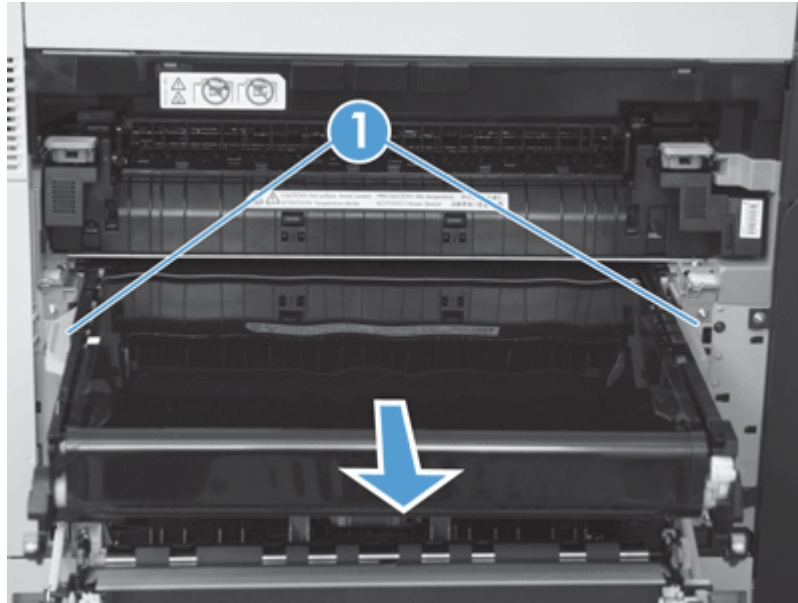

- c. Continue to slide the ITB out of the product until it stops, and then slightly rotate the ITB up to remove it.

**CAUTION:** The ITB is a sensitive component. Be careful when handling the ITB so that it is not damaged. Always place the ITB in a safe and protected location.

2. Use the T1 roller alienation switch (SW5) test in the **Manual Sensor Test** to verify that the switch is functioning correctly. If it is not, replace the main drive assembly.

**Table 6-4 Part numbers: Main drive assembly**

| Part number    | Description                            |
|----------------|----------------------------------------|
| RM1-6173-100CN | Kit-Main Drive Assembly <b>Simplex</b> |
| RM2-5832-000CN | Kit-Main Drive Assembly <b>Duplex</b>  |

3. Use the T1 roller engagement and disengagement drive test in the **Component Test** to verify that the T1 roller disengagement mechanism is functioning correctly. If it is not, replace the fuser drive assembly.

Part number: CE707-67911

4. If the printer has been serviced, check the connector (J181) on the DC controller PCA.

### Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the error persists, check the connector (J181) on the DC controller PCA, and then attempt to reset the ITB.

3. If the error persists, defeat the front door interlock.
  - a. Remove the toner cartridge.
  - b. Open the front door, and then insert a folded piece of paper into the front door switch.
  - c. Check the door switch is engaged or disengaged.

**Figure 6-8** Door switch Disengaged



**Figure 6-9** Door switch engaged



4. Check the ITB for T1 switch movement.
  - a. Remove the ITB.
  - b. Rotate the white gear (callout 1) and check if the switch (callout 2) actuates when the white gear is turned.

**Figure 6-10 ITB: T1 switch movement**



- c. Reinstall the ITB and ensure it is fully seated.
5. Check the sensor state when the ITB roller alienation switch, SW5 is triggered.
  - a. Open the front door.
  - b. Remove the toner cartridges and ITB.
  - c. Dismiss any warning messages to install the cartridges.
  - d. Use the **Manual Sensor Test** diagnostic test on the printer control panel to verify the ITB roller alienation switch (SW5) is functioning correctly.
    - i. From the Home screen, select **Support Tools**.
    - ii. Open the **Troubleshooting** menu, and then select **Diagnostic Tests**.
    - iii. Select **Manual Sensor Test**.
    - iv. Scroll to select **SW5** switch option.
    - v. Activate the sensor by gently moving the SW5 switch (located on the rear ITB guide rail) to the left and release.

- e. Check if the sensor counter value on the control panel display increments to 2.

 **NOTE:** The sensor counter value will increment to "2" when moving one time to the left and then for returning one time to its home position.

**Figure 6-11 SW5 switch**



6. Reboot the printer, and then check if the printer intermittently returns to a "Ready" state.
  - If the printer returns to a "Ready" state, try printing color pages, and then check if color/colors are missing on the printouts. If colors are missing on the printout, see the next step to continue troubleshooting.
  - If the printer does not return to a "Ready" state, see the next step to continue troubleshooting.

 **NOTE:** Typically, intermittent 59.00.F0 error and intermittent missing color(s) indicates a solenoid within the Fuser Drive assembly is not functioning or activating correctly.

7. Remove the following parts in the order presented to repair the solenoid.


Refer the Service manual to remove and replace parts or go to the following support document in WISE: ish\_10288465-10286334-16, *Repair the fuser drive assembly solenoid when a 59.00.F0 error displays on the control panel.*

 **NOTE:** No parts are required to be replaced to repair the solenoid.

- a. Intermediate Transfer Belt (ITB)
- b. Fuser
- c. Control panel assembly
- d. Stapler/Stacker assembly
- e. Rear cover
- f. Rear upper cover
- g. Right upper cover



- h. Front upper cover
  - i. Top right cover
  - j. Toner collection unit (TCU) access door
  - k. Residual toner full sensor
  - l. First-transfer high-voltage power supply
- 8. Remove the fuser drive assembly.
  - a. Remove one screw (callout 1), and then remove the bracket (callout 2) to remove the fuser connector cover.

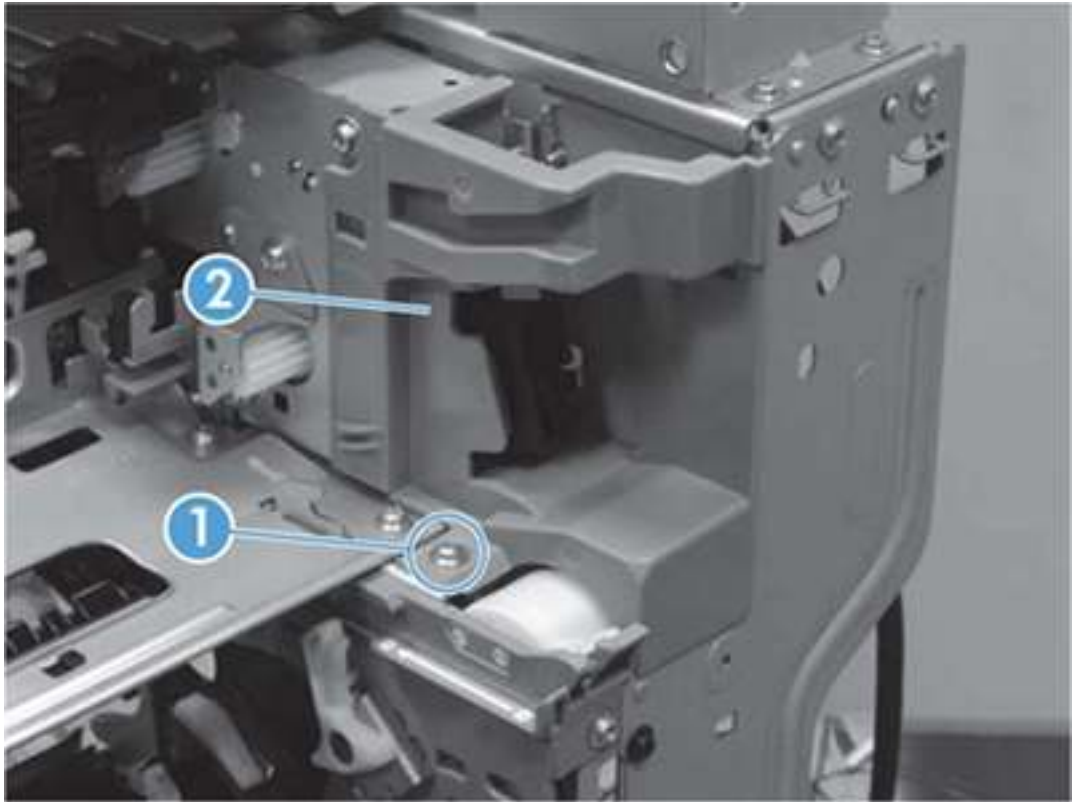

- b.** Disconnect the following cables (highlighted in red in the image below):

  - i.** One large white connector (callout 1): Remove the wire from the plastic holder.
  - ii.** Two black connectors (callout 2) : Remove the wiring from the wire holder.

**Figure 6-13** Disconnect connectors



- c. Remove the four screws numbered 1, 2, 3, 4 on the metal plate.  
(Screws 1, 2 are machine screws and screws 3, 4 are plastic threaded screws).

**Figure 6-14** Remove four screws.



- d. Pull the fuser drive assembly away from printer to remove it.

**Figure 6-15** Remove fuser drive assembly




- 9. Locate the solenoid and disconnect the solenoid cable.
  - a. Remove one screw.
  - b. Remove the solenoid cable from the wire guides.



- c. Disconnect the solenoid cable.

**Figure 6-16** Disconnect solenoid cable

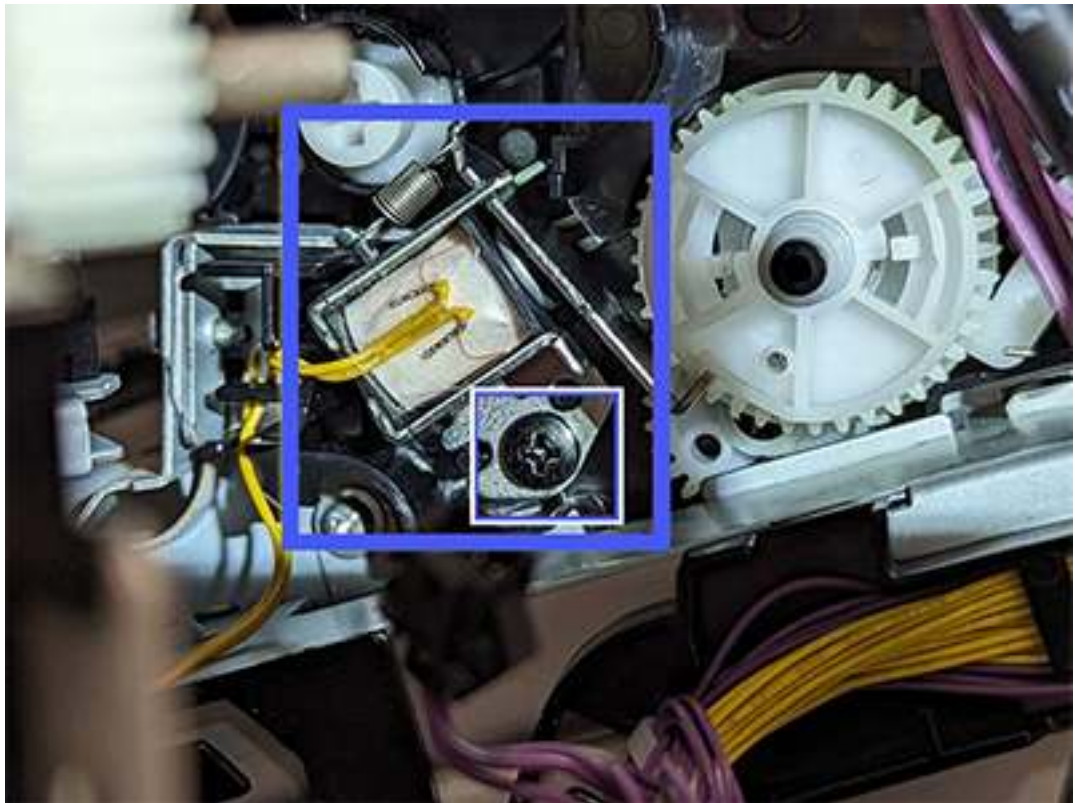


- 10. Clean the solenoid foam pad.




- a. Remove the spring

**Figure 6-17** Remove spring

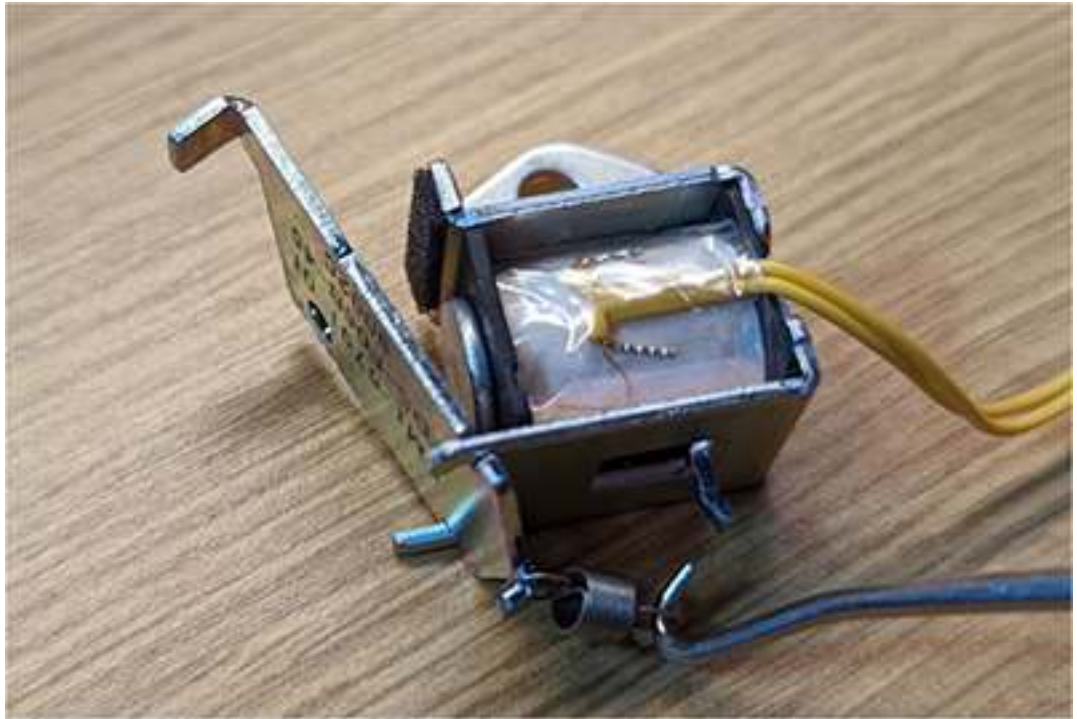


- b. Remove the solenoid plate.

**Figure 6-18** Remove plate

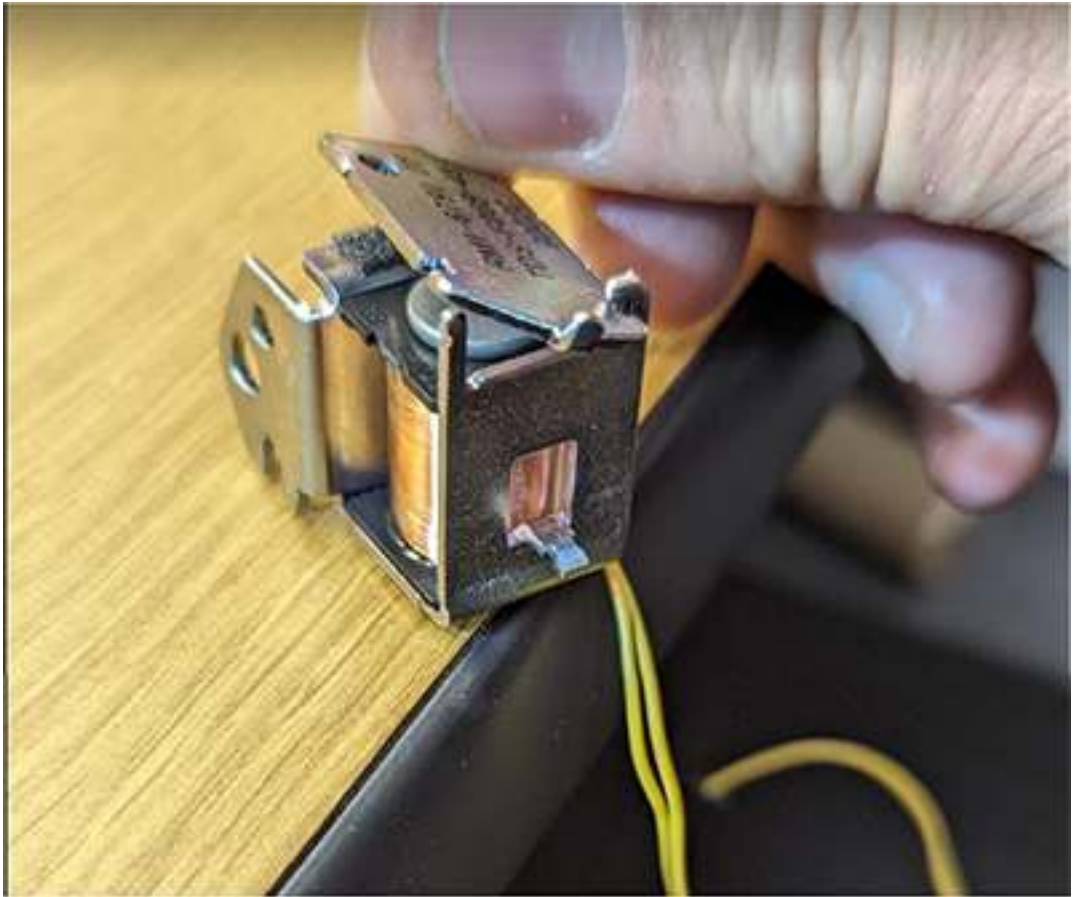

- c. Clean the foam pad. Scrape the solenoid foam pad with a razor blade.

**Figure 6-19** Clean foam pad

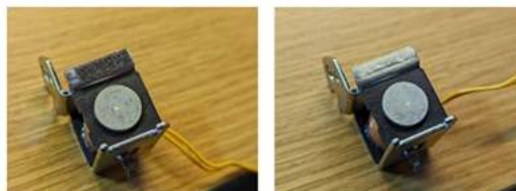


11. Reassemble the solenoid.



**NOTE:** When reassembled, the solenoid should spring open immediately after being released.


Figure 6-20 Reassemble solenoid

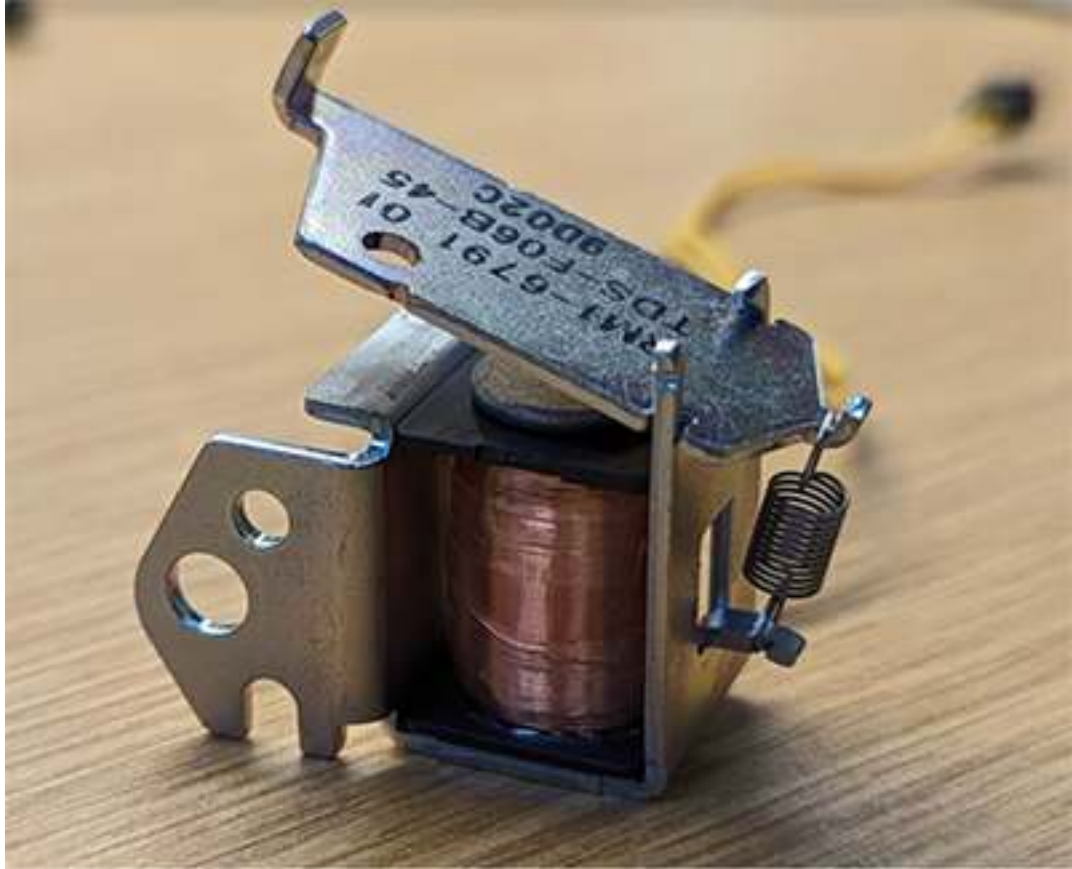

12. Reinstall the solenoid.
  - a. Ensure to align the solenoid screw hole and guide pin (indicated in the image below with yellow highlight).
  - b. Rotate the white gear slightly clockwise to activate the solenoid.

- c. When reinstalling the fuser drive, ensure to match the shaft with the positive sign (+) on it with the shaft above the solenoid.

**Figure 6-21 Reinstall solenoid**

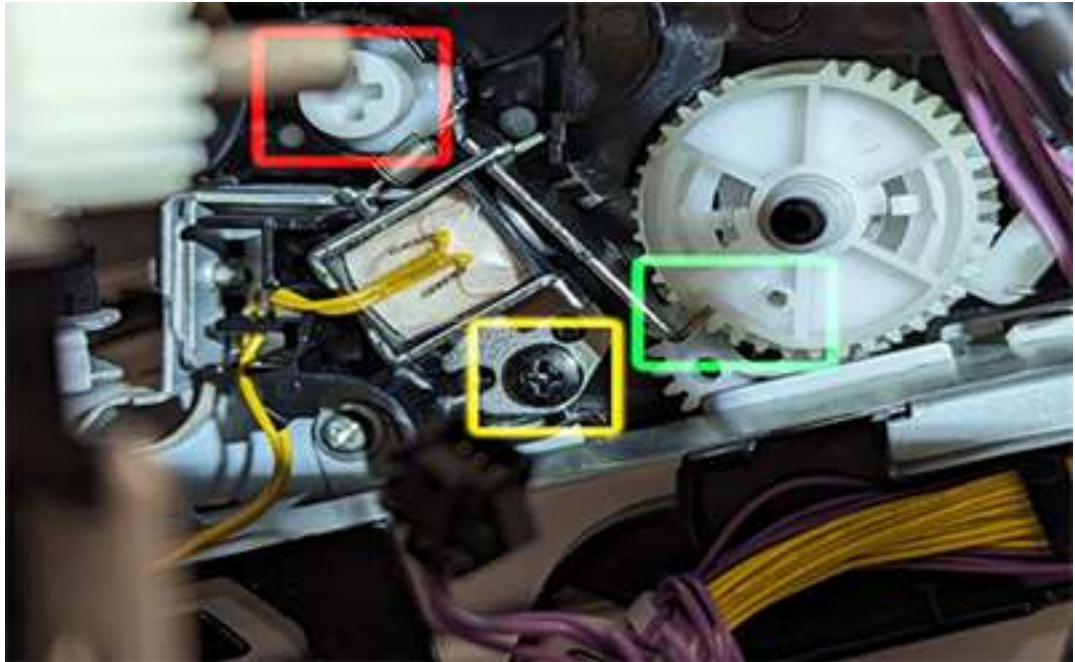

13. Reinstall the parts, and then check if the error persists.

To install an assembly, reverse the removal steps.

## 59 . 05 . 50 Error To continue turn off then on

Black motor start up error

59 . 05 . 50 : Black image drum start up error (ITB motor; M1)

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Use the ITB drum motor (M1) drive test in the **Component Test** to verify that the motor is properly functioning. If it is not, replace the ITB motor assembly.  
  
Part number: RM1-6088-000CN
2. If the printer has been serviced, check the connector (J517) on the ITB motor and the connector (J81) on the DC controller PCA.

## 59 . 0x . 50 Error To continue turn off then on

Motor start up error

X = 6: cyan

X = 7: magenta

X = 8: yellow

59 . 06 . 50 , 59 . 07 . 50 , or 59 . 08 . 50 : CMY drum motor (M2) start up error

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Use the drum motor (M2) drive test in the **Component Test** to verify that the motor is properly functioning. If it is not, replace the drum motor assembly.  
  
Part number: RM1-6088-000CN
2. If the printer has been serviced, check the connector (J515) on the drum motor and the connector (J81) on the DC controller PCA.

## 59 . 05 . 60 Error To continue turn off then on

Motor rotational error

59 . 05 . 60 : Black image drum rotational error (ITB motor; M1).

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Use the ITB drum motor (M1) drive test in the **Component Test** to verify that the motor is properly functioning. If it is not, replace the ITB motor assembly.  
  
Part number: RM1-6088-000CN
2. If the printer has been serviced, check the connector (J517) on the ITB motor and the connector (J81) on the DC controller PCA.



## 59 . 0x . 60 Error To continue turn off then on

Motor rotational error

X = 6: cyan

X = 7: magenta

X = 8: yellow

59 . 06 . 60 , 59 . 07 . 60 , or 59 . 08 . 60 : CMY drum motor (M2) rotation error

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Use the drum motor (M2) drive test in the **Component Test** to verify that the motor is properly functioning. If it is not, replace the drum motor assembly.

Part number: RM1-6088-000CN

2. If the printer has been serviced, check the connector (J515) on the drum motor and the connector (J81) on the DC controller PCA.

## 59 . 05 . 70 Error To continue turn off then on

Motor abnormal rotation

59 . 05 . 70 : Black developer motor abnormal start up error (ITB motor; M1)

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Use the ITB drum motor (M1) drive test in the **Component Test** to verify that the motor is properly functioning. If it is not, replace the ITB motor assembly.

Part number: RM1-6088-000CN

2. If the printer has been serviced, check the connector (J517) on the ITB motor and the connector (J81) on the DC controller PCA.

## 59 . 0x . 70 Error To continue turn off then on

Motor abnormal rotation

X = 6: cyan

X = 7: magenta

X = 8: yellow

59 . 06 . 70 , 59 . 07 . 70 , or 59 . 08 . 70 : CMY developer motor (M3) abnormal start up error

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Use the developer motor (M3) drive test in the **Component Test** to verify that the motor is properly functioning. If it is not, replace the developer motor assembly.  
  
Part number: RM1-6088-000CN
2. If the printer has been serviced, check the connector (J514) on the developer motor and the connector (J81) on the DC controller PCA.

## 59 . 05 . 80 Error To continue turn off then on

59 . 05 . 80 : Black developer motor failure error (ITB motor; M1)

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Use the ITB drum motor (M1) drive test in the **Component Test** to verify that the motor is properly functioning. If it is not, replace the ITB motor assembly.  
  
Part number: RM1-6088-000CN
2. If the printer has been serviced, check the connector (J517) on the ITB motor and the connector (J81) on the DC controller PCA.

## 59 . 0x . 80 Error To continue turn off then on

Developer motor failure error.

X = 6: cyan

X = 7: magenta

X = 8: yellow

59 . 06 . 80 , 59 . 07 . 80 , or 59 . 08 . 80 : CMY developer motor (M3) failure error

#### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action for call-center agents and onsite technicians

1. Use the developer motor (M3) drive test in the **Component Test** to verify that the motor is properly functioning. If it is not, replace the developer motor assembly.

Part number: RM1-6088-000CN

2. If the printer has been serviced, check the connector (J514) on the developer motor and the connector (J81) on the DC controller PCA.

## 60.wx.yz, 61.wx.yz, 62.wx.yz Error Messages

### 60.\* errors

Errors in the 60.\* family are related to one of the optional trays.

#### Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.



**NOTE:** You can determine the tray number from the last digit in the error number. For example:

- 60.00.02 or 60.01.02 = Tray 2
- 60.00.03 or 60.01.03 = Tray 3

1. Open the failing tray and remove all paper from the tray.
2. Close the tray to check if the error persists.
3. Reload the paper and test the printer.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.



Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Use the [Tray/Bin Manual Sensor](#) test to verify that the sensors for each tray are functioning correctly.
2. Check all connectors on the paper feeder PCA.
3. Replace the optional paper feeder.

## 60.00.02

Media input Tray 2 lift-up motor (M9) failure

### Recommended action for customers

1. Open the tray reporting the error.
2. Ensure the tray is not over load. Remove some paper and close the tray.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Use the Tray 2 paper surface sensor (PS4) test in the **Tray/Bin Manual Sensor Test** to verify that the sensor is properly functioning. If it is not, replace the lifter drive assembly.

Part number: RM1-6039-000CN

2. Open and close Tray 2 and listen at the back of the printer for the sound of the lifer motor (M9) operating. If it does not operate, replace the lifter drive assembly.

Part number: RM1-6039-000CN

3. If the printer has been serviced, check the intermediate connector (J742) and the connector (J151) on the DC controller PCA.
4. If the error persists, replace Tray 2.

Part number: CE710-67907

## 60.00.03 or 60.00.04

Media input Tray 3 lift-up motor (M2) failure or media input Tray 4 lift-up motor (M2) failure

**60.00.03:** Tray 3 lift-up motor (M2)

**60.00.04:** Tray 4 lift-up motor (M2)

### Recommended action for customers

1. Open the tray reporting the error.
2. Ensure the tray is not over load. Remove some paper and close the tray.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Use the Tray 3 paper surface sensor (SR2) or Tray 4 paper surface sensor (SR2) test in the **Tray/Bin Manual Sensor Test** to verify that the sensor is properly functioning. If it is not, replace the lifter drive assembly.

Part number: RM1-3819-000CN

---

 **NOTE:** Both the Tray 3 and Tray 4 paper surface sensors are designated as SR2. The first one listed in the Tray/Bin manual test is Tray 3, the second one listed is Tray 4.

---

2. Open and close Tray 3 or Tray 4 and listen at the back of the printer for the sound of the lifter motor (M2) operating. If it does not operate, replace the lifter drive assembly.

Part number: RM1-3819-000CN

---

 **NOTE:** Both the Tray 3 and Tray 4 lifter motors are designated as M2. Listen for the appropriate motor to operate.

---

3. If the printer has been serviced, check the connector (J2003) on the paper feeder controller PCA, the intermediate connector (J702) and the connector (J2006) on the paper feeder controller PCA.

---

 **TIP:** Check the connector (J2006) on the paper feeder controller PCA associated with the tray.

---

4. If the error persists, replace the tray.

Part number: CF235-67917

## 60.00.05 or 60.00.06

Media input Tray 5 lift-up motor (M82) failure or media input Tray 6 lift-up motor (M92) failure

**60.00.05:** Tray 5 lift-up motor (M82)

**60.00.06:** Tray 6 lift-up motor (M92)

## Recommended action for customers

1. Open the tray reporting the error.
2. Ensure the tray is not over load. Remove some paper and close the tray.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Use the Tray 5 paper surface sensor (SR82) or Tray 6 paper surface sensor (SR92) test in the **Tray/Bin Manual Sensor Test** to verify that the sensor is properly functioning. If it is not, replace the lifter drive assembly.

Part number: RM1-3819-000CN

2. Open and close Tray 5 or Tray 6 and listen at the back of the printer for the sound of the lifter motor (M82 or M92) operating. If it does not operate, replace the lifter drive assembly.

Part number: RM1-3819-000CN

3. If the printer has been serviced, check the connector (J2003) on the paper feeder controller PCA, the intermediate connector (J702), and the connector (J2006) on the paper feeder controller PCA.



**TIP:** Check the connector (J2006) on the paper feeder controller PCA associated with the tray.

4. If the error persists, replace the cassette tray.

Part number: CF235-67917

## 60 . 10 . 0z Media input source <z> pickup mechanism malfunction

- 60 . 10 . 01 Media input source 1 pickup mechanism malfunction
- 60 . 10 . 02 Media input source 2 pickup mechanism malfunction
- 60 . 10 . 03 Media input source 3 pickup mechanism malfunction
- 60 . 10 . 04 Media input source 4 pickup mechanism malfunction
- 60 . 10 . 05 Media input source 5 pickup mechanism malfunction
- 60 . 10 . 06 Media input source 6 pickup mechanism malfunction

### Recommended action for customers

1. Open the tray reporting the error.
2. Ensure the tray is not over load. Remove some paper and close the tray.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Use the **Tray <X> Pickup Motor** tests (M5, M1, M82, M92, M3301, M3304) in the **Component test** to verify that the pickup motors are properly functioning. If a pickup motor is not functioning, replace the paper pickup assembly.

Tray 2 paper pickup assembly part number: CE707-67903

Trays 3-6 paper pickup assembly part number: RM1-6944-000CN

3. If the error persists, elevate the case following your standard support process.

## 61 . 00 . 01

Color table read failure.

### Recommended action

1. Turn the printer off, and then on.
2. If the error persists, reload the firmware. If the error still persists, perform a firmware upgrade.
3. If the firmware upgrade does not resolve the problem, replace the hard disk.

Encrypted hard disk drive kit part number: D3L08-67903

U.S. Government hard disk drive part number: D3L08-67904

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

## 62.\* errors

Errors in the 62.\* family indicate a problem with the print engine.

### Recommended action for customers

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Check all connectors on the formatter. Reseat them if necessary.
3. Upgrade the printer firmware.
4. If the error persists print the event log from the control panel, or access it from the HP Embedded Web Server (EWS), then elevate the case using the Standard Support Process.



---

**NOTE:** To access the EWS, open a Web browser, and in the address line, enter the printer IP address.

---

## 62.00.00 No system To continue turn off then on

The printer experienced an internal system failure.

### Recommended action

1. Turn the printer off, and then on.
2. Reload the firmware.
3. Perform a firmware upgrade.
4. If the error persists, replace the hard disk.

Encrypted hard disk drive kit part number: D3L08-67903

U.S. Government hard disk drive part number: D3L08-67904

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

## 69.wx.yz, 70.wx.yz Error Messages

### 69 . 11 . yz Error To continue, touch "OK"

This message displays to indicate an error during a duplex operation.

y and z are variables and can be 0-9, or A-F

#### Recommended action

- Turn the printer off, and then on.

### 70.\* errors

Messages in the 70.\* family indicate a problem with the DC controller or Formatter (ECB) depending on your printer.

#### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Replace the DC controller or the Formatter as needed.

### 70 . 00 . 00 Error To continue turn off then on

The printer experienced a DC controller failure.

#### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

#### Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.

2. If the error persists, replace the DC controller.

For instructions: *Removal and replacement: DC controller* See the Repair Service Manual for this product.

DC Controller PCA (simplex) part number: CE707-67906

DC Controller PCA (duplex) part number: CE708-67902

## 80.wx.yz, 81.wx.yz Error Messages

### 80.\* errors

Errors in the 80.\* family indicate a problem with an external I/O device, such as a Jetdirect card, an EIO card, or an external hard disk.

- **80.00.00 error:** Managed device lost connection to service provider. The product is under a service contract and has lost network connectivity for license validation.
- **80.01.01 error:** HP Accessibility Assistant connection error. Managed device is unable to establish a connection with the HP Accessibility Assistant.
- **80.01.02 error:** Managed Device Unknown HP Accessibility Assistant error.
- **80.01.03 error:** HP Accessibility Assistant connection lost. The product lost communication with the HP Accessibility Assistant.
- **80.01.04 error:** HP Accessibility Assistant disconnected. The HP Accessibility Assistant was disconnected from the product.
- **80.01.05 error:** HP Accessibility Assistant detected. Restart required. The HP Accessibility Assistant was connected to the product after turn on. The HP Accessibility Assistant is not a plug-and-play device.

### Recommended action for customers

Customer actions for 80.\* errors.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. Reload the printer firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call center agents

Call center agent actions for 80.\* errors.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.

3. If the error persists, perform a [Partial Clean](#) procedure using the [Preboot](#) menu.

---

 **NOTE:** For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

---

- a. Turn the printer on.
  - b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
  - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
  - d. Press the down arrow button to highlight [Partial Clean](#), and then press the [OK](#) button.
  - e. Press the [OK](#) button again.
  - f. Press the back button once to highlight [Continue](#), and then press the [OK](#) button.
  - g. The printer automatically initializes and then returns to a Ready state.
4. If the error persists, perform a [Format Disk](#) procedure using the [Preboot](#) menu, and then upgrade the firmware to the latest version.

---

 **NOTE:** For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

---

- a. Turn the printer on.
  - b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
  - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
  - d. Press the down arrow button to highlight [Format Disk](#), and then press the [OK](#) button.
  - e. Press the [OK](#) button again.
  - f. Wait for the printer to automatically initialize. The message **99.09.67** appears on the control panel.
  - g. Reload the firmware using a USB flash drive. See [99.09.67 error](#) for more information.
5. If the error persists, dispatch an onsite technician (no replacement parts required).

### Recommended action for call center agents

Call center agent actions for 80.\* errors.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. If the error persists, perform a [Partial Clean](#) procedure using the [Preboot](#) menu.

---

 **NOTE:** For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state

drives" (ish\_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

---

- a. Turn the printer on.
  - b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
  - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
  - d. Press the down arrow button to highlight [Partial Clean](#), and then press the [OK](#) button.
  - e. Press the [OK](#) button again.
  - f. Press the back button once to highlight [Continue](#), and then press the [OK](#) button.
  - g. The printer automatically initializes and then returns to a Ready state.
4. If the error persists, perform a [Format Disk](#) procedure using the [Preboot](#) menu, and then upgrade the firmware to the latest version.



**NOTE:** For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

---

- a. Turn the printer on.
- b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
- c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
- d. Press the down arrow button to highlight [Format Disk](#), and then press the [OK](#) button.
- e. Press the [OK](#) button again.
- f. Wait for the printer to automatically initialize. The message **99.09.67** appears on the control panel.
- g. Reload the firmware using a USB flash drive. See [99.09.67 error](#) for more information.

## 80 . 0x . yz Embedded Jetdirect Error

Embedded HP JetDirect print server critical error.

- 80 . 01 . 80 (event code): No heartbeat
- 80 . 01 . 81 (event code): Reclaim timeout
- 80 . 01 . 82 (event code): Invalid data length
- 80 . 01 . 8B (event code): Invalid max outstanding packet header field
- 80 . 01 . 8C (event code): Invalid channel mapping response
- 80 . 03 . 01 (event code): No PGP buffers
- 80 . 03 . 02 (event code): Channel table full



- 80 . 03 . 03 (event code): Producer index not reset
- 80 . 03 . 04 (event code): Consumer index not reset
- 80 . 03 . 05 (event code): Queue position size too small
- 80 . 03 . 06 (event code): Transport overflow
- 80 . 03 . 07 (event code): No overflow packets
- 80 . 03 . 08 (event code): Invalid identify response
- 80 . 03 . 09 (event code): Invalid channel map return status
- 80 . 03 . 10 (event code): Invalid reclaim return status
- 80 . 03 . 12 (event code): Datagram invalid buffer
- 80 . 03 . 13 (event code): Max stream channels
- 80 . 03 . 14 (event code): Max datagram channels
- 80 . 03 . 15 (event code): Card reset failed
- 80 . 03 . 16 (event code): Self test failure
- 80 . 03 . 17 (event code): Unknown PGP packet
- 80 . 03 . 18 (event code): Duplicate I/O channel

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. If the error persists, replace the formatter.

Part number: D3L08-67901

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

## 81 . wx . 00 Wireless Network Error To continue turn off then on

A wireless network component on the product has failed.

### Recommended action

1. Turn the product off, and then on.
2. If the error persists, turn the product off, reseal the wireless network component, and then turn the product on.

3. If the error persists, replace the wireless network component.

## 81.wx.yz Embedded Jetdirect Error To continue turn off then on

The printer experienced an embedded HP Jetdirect print server critical error.

- 81.02.00 (event code): Wireless Networking Event <UVWXYZ>
- 81.03.00 (event code): Access Point Wireless Networking Event <UVWXYZ>
- 81.04.00 (event code): Jetdirect Inside Networking Event <UVWXYZ>
- 81.07.00 (event code): Internal Wireless Networking Event <UVWXYZ>
- 81.08.00 (event code): Internal Access Point Wireless Networking Event <UVWXYZ>
- 81.09.00 (event code): Internal Jetdirect Inside Networking Event <UVWXYZ>

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Turn the printer off, reseal the EIO accessory, and then turn the printer on.
3. If the error persists, replace the formatter.

Part number: D3L08-67901

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

## 82.wx.yz Error Messages

### 82.\* errors

Errors in the 82.\* family indicate a problem with an external I/O device, such as a Jetdirect card, an EIO card, or an external hard disk.

- **82.00.00 error:** Memory Error.
- **82.73.45 error:** Memory Error. Disk successfully cleaned. Event log only.
- **82.73.46 error:** Memory Error. A hard disk or compact flash disk cleaning failed. Usually caused by a failure of the disk hardware. Event log only.
- **82.73.47 error:** Memory Error. Some of sanitized disk did not correctly verify. Event log only.

## Recommended action for customers

Customer actions for 80.\* errors.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. Reload the printer firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call center agents

Call center agent actions for 80.\* errors.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. If the error persists, perform a [Partial Clean](#) procedure using the [Preboot](#) menu.



**NOTE:** For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: [HP LaserJet Enterprise](#), [HP LaserJet Managed](#) - Various methods to clean the hard disk drives or solid-state drives.*

- a. Turn the printer on.
  - b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
  - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
  - d. Press the down arrow button to highlight [Partial Clean](#), and then press the [OK](#) button.
  - e. Press the [OK](#) button again.
  - f. Press the back button once to highlight [Continue](#), and then press the [OK](#) button.
  - g. The printer automatically initializes and then returns to a Ready state.
4. If the error persists, perform a [Format Disk](#) procedure using the [Preboot](#) menu, and then upgrade the firmware to the latest version.



**NOTE:** For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: [HP LaserJet Enterprise](#), [HP LaserJet Managed](#) - Various methods to clean the hard disk drives or solid-state drives.*

- a. Turn the printer on.
- b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.

- c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
  - d. Press the down arrow button to highlight [Format Disk](#), and then press the [OK](#) button.
  - e. Press the [OK](#) button again.
  - f. Wait for the printer to automatically initialize. The message **99.09.67** appears on the control panel.
  - g. Reload the firmware using a USB flash drive. See [99.09.67 error](#) for more information.
5. If the error persists, dispatch an onsite technician (no replacement parts required).

### Recommended action for call center agents

Call center agent actions for 80.\* errors.

- 1. Turn the printer off, reconnect the network cable, and then turn the printer on.
- 2. Try another network cable.
- 3. If the error persists, perform a [Partial Clean](#) procedure using the [Preboot](#) menu.



**NOTE:** For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: [HP LaserJet Enterprise](#), [HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#).*

---

- a. Turn the printer on.
  - b. Press the HP logo that displays in the middle of the screen when you see the [1/8](#) under the logo.
  - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
  - d. Press the down arrow button to highlight [Partial Clean](#), and then press the [OK](#) button.
  - e. Press the [OK](#) button again.
  - f. Press the back button once to highlight [Continue](#), and then press the [OK](#) button.
  - g. The printer automatically initializes and then returns to a Ready state.
4. If the error persists, perform a [Format Disk](#) procedure using the [Preboot](#) menu, and then upgrade the firmware to the latest version.



**NOTE:** For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: [HP LaserJet Enterprise](#), [HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#).*

---

- a. Turn the printer on.
- b. Press the HP logo that displays in the middle of the screen when you see the [1/8](#) under the logo.
- c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
- d. Press the down arrow button to highlight [Format Disk](#), and then press the [OK](#) button.

- e. Press the **OK** button again.
- f. Wait for the printer to automatically initialize. The message **99.09.67** appears on the control panel.
- g. Reload the firmware using a USB flash drive. See [99.09.67 error](#) for more information.

## 82 . 73 . 45 Disk Successfully cleaned

Event log only, disk successfully cleaned.

### Recommended action

See recommended action.

- No action necessary.

## 82 . 73 . 46, 82 . 73 . 47

A hard disk or compact flash disk cleaning failed.

This error is usually caused by a failure of the disk hardware.

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the product off, and then on.
2. Reload the printer firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Use the **Format Disk** item in the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

3. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

## 98.wx.yz Error Messages

### 98.\* errors

Errors in the 98.\* family are related to data corruption in the firmware.

## Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Download and install the most current version of the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Use the [Format Disk](#) item in the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

4. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

## 98.00.01 or 98.01.00 Corrupt data in firmware volume

Data corruption has occurred in the firmware volume.

### Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Use the [Format Disk](#) item in the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

3. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

## 98 . 00 . 02 Corrupt data in the solutions volume

Data corruption has occurred in the solutions volume.

### Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Use the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

3. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

## 98 . 00 . 03 Corrupt data in the configuration volume

Data corruption has occurred in the configuration volume.

### Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Download the firmware again, and then attempt the upgrade again.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Use the **Format Disk** item in the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

4. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

## 98.00.04 Corrupt data in the job data volume

Data corruption has occurred in the job data volume.

### Recommended action

1. Turn the printer off, and then on.
2. Make sure the printer is running the most current version of firmware.  
For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
3. Rerun the file erase function.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## 98.01.yz

Partition Manager error (Create extended partition failed, failed to format secondary disk, or unable to format partition)

### Recommended action

1. Turn the printer off, and then on.
2. Use the **Format Disk** option in the **Preboot** menu.
3. Reload the firmware.
4. If the error persists, use the **Erase and Unlock** option in the **Preboot** menu.
5. Reload the firmware



## 98.02.yz

Partition Manager error (Unable to wipe drive or drive not found)

### Recommended action

1. Turn the printer off, and then on.
2. Use the **Format Disk** option in the **Preboot** menu.
3. Reload the firmware.
4. If the error persists, use the **Erase and Unlock** option in the **Preboot** menu.
5. Reload the firmware

## 98.03.yz

Partition Manager error (Corrupt data in Data, Config, Firmware, or Solutions volume)

### Recommended action

1. Turn the printer off, and then on.
2. Use the **Format Disk** option in the **Preboot** menu.
3. Reload the firmware.
4. If the error persists, use the **Erase and Unlock** option in the **Preboot** menu.
5. Reload the firmware

# 99.wx.yz Error Messages

## 99.\* errors

Errors in the 99.\* family are related to the firmware upgrade process.

### Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Make sure the connection to the network is good, and then try the firmware upgrade again.
2. If the error persists, try using the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Make sure the connection to the network is good, and then try the upgrade again.

2. Try using the USB upgrade method.
3. If the error persists, run the [Format Disk](#) process from the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

4. If the error persists, replace the hard disk drive.



---

**NOTE:** Do NOT replace the formatter board, it will not resolve the issue.

---

## 99 . 00 . 01 Upgrade not performed file is corrupt

A remote firmware upgrade (RFU) was not performed.

This is a CRC error in the firmware image (bad image).

### Recommended action

- Download the firmware upgrade file, and then attempt the upgrade again.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)

## 99 . 00 . 02 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading the header number and size. It indicates a problem with the network environment, not the product.

### Recommended action

Follow these troubleshooting steps in the order presented.

The most common cause is an issue with the network environment.

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



---

**NOTE:** If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

---

2. If the error persists, use the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)

## 99 . 00 . 03 Upgrade not performed error writing to disk

Remote firmware upgrade (.bdl) was not performed. An error occurred when writing to the hard disk.

## Recommended action

1. Download the firmware again, and then attempt the upgrade again.
2. If the error persists, perform the clean disk/format disk process.
3. Download the firmware from the **Preboot** menu, and then attempt the upgrade again.
4. If the error persists, replace the hard disk.

Encrypted hard disk drive kit part number: D3L08-67903

U.S. Government hard disk drive part number: D3L08-67904

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

## 99 . 00 . 04 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading the header.

The most common cause is an issue with the network environment.

## Recommended action

Follow these troubleshooting steps in the order presented.

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



**NOTE:** If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)

## 99 . 00 . 05 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading image data.

The most common cause is an issue with the network environment.

## Recommended action

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



**NOTE:** If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)

## 99 . 00 . 06 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

Unexpected read error when reading header number and size.

### Recommended action

1. Download the RFU file and attempt the upgrade again.
2. If the error persists, replace the hard disk.

Encrypted hard disk drive kit part number: D3L08-67903

U.S. Government hard disk drive part number: D3L08-67904

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

## 99 . 00 . 07 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

Unexpected read error when reading rest of header.

### Recommended action

1. Download the RFU file and attempt the upgrade again.
2. If the error persists, replace the hard disk.

Encrypted hard disk drive kit part number: D3L08-67903

U.S. Government hard disk drive part number: D3L08-67904

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

## 99 . 00 . 08 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

Unexpected read error when reading image data.

### Recommended action

1. Download the RFU file and attempt the upgrade again.
2. If the error persists, replace the hard disk.

Encrypted hard disk drive kit part number: D3L08-67903

U.S. Government hard disk drive part number: D3L08-67904

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

## 99 . 00 . 09 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled.

### Recommended action

- Resend the remote firmware upgrade (RFU).

## 99 . 00 . 10 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled when reading the header number and size.

### Recommended action

- Resend the remote firmware upgrade (RFU).

## 99 . 00 . 11 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled when reading the rest of the header, after reading the header number and size.

### Recommended action

- Resend the remote firmware upgrade (RFU).

## 99 . 00 . 12 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The header number is 1, but the header size does not match version 1 size.

### Recommended action

1. Download the remote firmware upgrade (RFU) file again.  
Make sure that you download the file for the correct printer model.  
For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
2. Resend the RFU.

## 99 . 00 . 13 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The header number is 2, but the header size does not match version 2 size.

### Recommended action

1. Download the remote firmware upgrade (RFU) file again.  
Make sure that you download the file for the correct printer model.  
For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Resend the RFU.

## 99.00.14 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The file is invalid.

### Recommended action

1. Download the remote firmware upgrade (RFU) file again.  
Make sure that you download the file for the correct printer model.  
For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
2. Resend the RFU.

## 99.01.xx

A firmware install error has occurred.

The specific message varies depending on the cause, but the solution for each message is the same.

- 99.01.00
- 99.01.10
- 99.01.20
- 99.01.21

### Recommended action

Follow these troubleshooting steps in the order presented.

- Reload the firmware.  
For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)  
Firmware update steps,  
For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)

## 99.00.2x

There is a compatibility issue with the firmware.

The specific message varies depending on the cause, but the solution for each message is the same.

- 99.00.20 (event log)  
The bundle is not for this product.
- 99.00.21 (event log)  
The bundle is not signed with the correct signature, or the signature is invalid.
- 99.00.22 (event log)  
The bundle header version is not supported by this firmware.

- 99.00.23 (event log)

The package header version is not supported by this firmware.

- 99.00.24 (event log)

The format of the bundle is invalid.

- 99.00.25 (event log)

The format of the package is invalid.

- 99.00.26 (event log)

A CRC32 check did not pass.

- 99.00.27 (event log)

An I/O error occurred while downloading the bundle.

### Recommended action

Follow these troubleshooting steps in the order presented.

1. **99.00.27 only:** Turn the product off, and then on.
2. Download the correct firmware file, and then resend the firmware upgrade.  
  
For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#) For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).
3. If the error persists, try installing the upgrade by another method (USB or Embedded Web Server).  
  
For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

### 99.02.01

Firmware installation was successful.

### Recommended action

See recommended action.

- No action necessary.

### 99.02.09

Firmware upgrade cancelled by user.

### Recommended action

See recommended action.

- No action necessary.

### 99.05.56

Firmware install error: loctlSetBaudRate failed

## Recommended action for customers

1. Perform a clean disk from the [Preboot](#) menu.
2. Reload latest version of firmware via USB drive.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

## Recommended action for call-center agents and onsite technicians

1. Perform a clean disk from the [Preboot](#) menu.
2. Reload latest version of firmware via USB drive.
3. If the issue persists, replace the formatter assembly.

Part number: D3L08-67901

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

## 99 . 09 . 60 Unsupported disk

[Preboot](#) menu error.

The hard disk currently installed is not recognized or supported by the printer.

### Recommended action

1. Do **NOT** replace the formatter board. Check the **99 . 09 . xx** header for hard disk part numbers and **Preboot** menu instructions, if needed.
2. Install the correct hard disk for this printer.  
  
Encrypted hard disk drive kit part number: D3L08-67903  
U.S. Government hard disk drive part number: D3L08-67904  
  
For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.
3. If the recommended hard disk is installed and this error persists, run the **Format Disk** procedure from the **Preboot** menu (**Administrator / Format Disk**), and then reload the firmware.

## 99 . 09 . 61 Unsupported disk

The hard disk drive installed is not support in this printer.

The hard disk drive (HDD) is not encrypted and the printer is configured for an encrypted HDD.

### Recommended action



**NOTE:** Do NOT replace the formatter board, it will not resolve this error.

- Access the [Preboot](#) menu, and then select [Lock Disk](#) to lock the disk.
  - a. Access the [Preboot](#) menu
  - b. Turn the product on.



- c. Touch the HP logo that displays in the center of the touchscreen until the **Preboot** menu item opens.
- d. Use the arrow buttons on the touchscreen to navigate the **Preboot** menu.
- e. Touch the **OK** button to select a menu item.

## 99 . 09 . 62 Unknown disk

This error indicates that there is an encryption mismatch between the HDD and the formatter.

This typically happens because an HDD was swapped into a device from another device.

### Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action



**NOTE:** Do NOT replace the formatter board, it will not resolve this error.

1. Use the **Preboot** menu to unlock the disk.
  - a. Access the **Preboot** menu
  - b. Turn the product on.
  - c. Touch the HP logo that displays in the center of the touchscreen until the **Preboot** menu item opens.
  - d. Use the arrow buttons on the touchscreen to navigate the **Preboot** menu.
  - e. Touch the **OK** button to select a menu item.
2. If a disk is to be reused in a different product, execute the **Erase and Unlock** procedure from the **Preboot** menu, and then reload the firmware.
  - From the **Preboot** menu, open the following menus:
    - **Administration** (select 3)
    - **Manage Disks** (select 6)
    - **Boot Device** (select 6)
    - **Erase / Unlock** (select 2)
3. If the previous steps did not resolve the issue, replace the hard disk drive.

## 99 . 09 . 63 Incorrect disk

A new or blank disk has been installed in a device which previously had an encrypted disk.

## Recommended action

1. Do **NOT** replace the formatter board. Check the **99 . 09 . xx** header for hard disk part numbers and **Preboot** menu instructions, if needed.
2. Follow the procedure to load firmware on a new hard disk, and then lock it to this printer.

## 99 . 09 . 64 Disk malfunction

A fatal hard disk failure has occurred.

## Recommended action

- Replace the hard disk drive.

Encrypted hard disk drive kit part number: D3L08-67903

U.S. Government hard disk drive part number: D3L08-67904

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

## 99 . 09 . 65 Disk data error

Disk data corruption has occurred.

## Recommended action



---

**NOTE:** Do NOT replace the formatter board, it will not resolve this error.

---

- Use the [Format Disk](#) procedure from the [Preboot](#) menu, and then resend the remote firmware upgrade (RFU).

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish\_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

## 99 . 09 . 66 No disk installed

A disk drive is not installed in the printer.

## Recommended action

1. Do **NOT** replace the formatter board. Check the **99 . 09 . xx** header for hard disk part numbers and **Preboot** menu instructions, if needed.
2. Install a compatible hard disk drive.  
  
Encrypted hard disk drive kit part number: D3L08-67903  
U.S. Government hard disk drive part number: D3L08-67904  
  
For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.
3. If a compatible hard disk is installed, reseal the hard disk to make sure it is correctly connected.

4. If the error persists, replace the hard disk drive.

Encrypted hard disk drive kit part number: D3L08-67903

U.S. Government hard disk drive part number: D3L08-67904

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

## 99 . 09 . 67 Disk is not bootable please download firmware

The printer has a non-secure disk installed as the boot disk, and it has been replaced with a new service part. A new firmware image needs to be downloaded to the device.



**NOTE:** When installing a new hard drive or eMMC, the disk should be formatted through the Preboot menu, BEFORE loading firmware.

### Recommended action

1. Do **NOT** replace the formatter board. Check the 99 . 09 . **xx** header for hard disk part numbers and **Preboot** menu instructions, if needed.
2. Press any button to continue to the **Preboot** menu.
3. Press the [Help](#) button to see the help text for the error.
4. Select the **Administration** menu.



**NOTE:** If there is a password assigned to the Administrator, a prompt to enter the password displays.

5. Select the [Format disk](#) option, select [OK](#).
6. Select the [Download](#) item, and then download the latest firmware. The user can now download a new firmware bundle to the printer.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

7. The user can now download a new firmware bundle to the printer.

## 99 . 09 . 68

The secondary encrypted disk has been removed from this device.

### Recommended action

1. Do **NOT** replace the formatter board. Check the 99 . 09 . **xx** header for hard disk part numbers and **Preboot** menu instructions, if needed.
2. Reinstall the secondary encrypted storage device.

---

## 7 Alphabetical control panel messages

Use the following alphabetical message to see further information on the message.

### Alphabetical messages

#### Accept bad signature

The printer is performing a remote firmware upgrade, and the code signature is invalid.

#### Recommended action

Download the correct firmware upgrade file for this printer, and then reinstall the upgrade. See the printer user guide for more information.

- 

#### Bad optional tray connection

The optional tray is not connected, not connected correctly, or a connection is not working correctly.

#### Recommended action

1. Turn the printer off.
2. Remove and then reinstall the optional tray.
3. Reconnect the connectors for the tray.
4. If the problem continues, replace the connector for the tray.

#### <binname> full Remove all paper from bin

The specified output bin is full.

#### Recommended action

- Empty the bin to continue printing.

#### Calibration reset pending

A calibration reset occurs when all jobs are processed.

## Recommended action

- To begin the reset sooner, cancel all jobs by pressing the [Stop](#) button ☒.

## Canceling

The printer is canceling the current job.

## Recommended action

See recommended action.

- No action necessary.

## Canceling...<jobname>

The printer is canceling the current job <jobname>.

## Recommended action

See recommended action.

- No action necessary.

## Checking engine

The printer is conducting an internal test.

## Recommended action

See recommended action.

- No action necessary.

## Checking paper path

The printer is checking for possible paper jams.

## Recommended action

See recommended action.

- No action necessary.

## Chosen personality not available To continue touch “OK”

A print job requested a printer language (personality) that is not available for this printer. The job will not print and will be cleared from memory.

## Recommended action

- Print the job by using a print driver for a different printer language, or add the requested language to the printer (if possible). To see a list of available personalities, print a configuration page.
  - a. From the Home screen on the printer control panel, go to the following menus: **Reports > Configuration/Status Pages**
  - b. Select [Configuration Page](#), then select the [Print](#) button to print the pages.

## Cleaning

The printer is performing an automatic cleaning cycle. Printing will continue after the cleaning is complete.

### Recommended action

See recommended action.

- No action necessary.

## Cleaning do not grab paper

The printer is performing an automatic cleaning cycle. Printing will continue after the cleaning is complete.

### Recommended action

See recommended action.

- No action necessary.

## Clearing event log

This message is displayed while the event log is cleared. The printer exits the menus when the event log has been cleared.

### Recommended action

See recommended action.

- No action necessary.

## Clearing paper path

The printer is attempting to eject jammed paper.

### Recommended action

- Check the progress at the bottom of the display.

## Close front door

The front door of the printer is open.

### Recommended action

1. Close the door.
2. Use the **Manual Sensor Test** to verify that the front door switch is properly functioning. If the switch fails the test, replace the switch.  
  
Part number: WC4-5251-000CN
3. Check the sensor flag on the front-door assembly. If it is damaged, replace the front door assembly.  
  
Front door assembly part number: CE707-67902

4. If the printer has been recently serviced, check the connector (J708) on the 24V interlock switch and the connector (J121) on the DC controller PCA.

## Close lower right door

The optional paper feeder right door is open.

### Recommended action

1. Open and then close the door.
2. Use the right-door switch (SW1) test in the **Tray/Bin Manual Sensor Test** to verify that the switch is properly functioning. If the switch fails the test, replace the switch.

Part number: WC2-5512-000CN

3. Check the sensor flag on the right door assembly. If it is damaged, replace the lower right door assembly.

Part number: RM1-6953-000CN

## Close right door

A door on the right side of the printer is open.

### Recommended action

1. Close the right door.
2. If the error persists, use the **Manual Sensor Test** to verify that the right door opening/closing sensor is properly functioning. If the sensor fails, replace the right door switch.

Part number: WG8-5935-000CN

3. Check the right door sensor flag. If it is damaged, replace the right door.

Right door assembly (simplex) part number: RM1-6138-000CN

Right door assembly (duplex) part number: RM1-6007-000CN

4. If this printer was previously serviced, reconnect the connector (J708) on the 24V interlock switch and the connector (J181) on the DC controller PCA.

## Close middle right door

The 1 x 500-sheet optional paper feeder right door is open.

### Recommended action

1. Close the door.
2. Use the right-door switch (SW1) test in the **Tray/bin Manual Sensor Test** to verify that the switch is properly functioning. If the switch fails the test, replace the switch.

Part number: WC2-5512-000CN

3. Check the sensor flag on the right door assembly. If it is damaged, replace the door assembly.

Part number: RM1-6946-000CN

## Close upper right door For help press ?

The upper-right door of the printer is open.

### Recommended action

1. Close the door.
2. Use the right-door switch (SP15) test in the **Manual Sensor Test** to verify that the switch is properly functioning. If the switch fails the test, replace the switch.

Part number: WG8-5935-000CN

3. Check the sensor flag on the right door assembly. If it is damaged, replace the door assembly.

Right door assembly (simplex) part number: RM1-6138-000CN

Right door assembly (duplex) part number: RM1-6007-000CN

4. If the printer has been recently serviced, check the connector (J708) on the 24V interlock switch and the connector (J181) on the DC controller PCA.

## Cooling device

The printer is cooling.

### Recommended action

See recommended action.

- No action necessary.

## Communication lost

A **Communication lost** message appears on the control panel in five different languages.

This error occurs when the control panel can no longer communicate with the formatter.

### Recommended action

- Use the following document to troubleshoot this issue. [HP LaserJet Enterprise Printers - Communication lost message appears on the control panel in five different languages](#)

## Data received To print last page press "OK"

The printer is waiting for the command to print the last page.

### Recommended action

- Touch the "OK" button on the control panel to print the last page of the job.

## Event log is empty

No printer events are in the log.

### Recommended action

See recommended action.



- No action necessary.

## Expected drive missing

The printer cannot find the encrypted hard drive.

### Recommended action

- Install the encrypted hard disk drive.

## [File System] device failure To clear press OK

The specified device has failed.

### Recommended action

- Press the **OK** button to clear the error.

## [File System] file operation failed To clear press OK

A PjL file system command attempted to perform an illogical operation.

### Recommended action

- Press the **OK** button to clear the error.

## [File System] file system is full To clear press OK

A PjL file system command could not store something on the file system, because the file system was full.

### Recommended action

- Press the **OK** button to clear the error.

## [File System] is not initialized

This file-storage component must be initialized before use.

### Recommended action

- Use the HP Embedded Web Server or HP Web Jetadmin to initialize the file system.

## [File System] is write protected

The file system device is protected and no new files can be written to it.

### Recommended action

- Press the **OK** button to clear the error.

## HP Secure hard drive disabled

The hard disk drive has been encrypted for another printer.

## Recommended action

- Remove the hard disk drive or use the Embedded Web Server for more information.

## Incompatible <supply>

The indicated supply <supply> is not compatible with this printer.

- **10.00.35** (event code): Black print cartridge
- **10.01.35** (event code): Cyan print cartridge
- **10.02.35** (event code): Magenta print cartridge
- **10.03.35** (event code): Yellow print cartridge
- **10.23.35** (event code): Fuser kit

## Recommended action

- Replace the supply with one that is designed for this printer.

Black print cartridge part number: CE270-67901

Cyan print cartridge part number: CE271-67901

Yellow print cartridge part number: CE272-67901

Magenta print cartridge part number: CE273-67901

For instructions: *Removal and replacement: Fuser*

Fuser kit (110V) part number: CE707-67912

Fuser kit (220V) part number: CE707-67913



**NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

## Incompatible supplies

Print cartridges or other supply items are installed that were not designed for this printer. The printer cannot print with these supplies installed.

- **10.00.35** (event code): Black print cartridge
- **10.01.35** (event code): Cyan print cartridge
- **10.02.35** (event code): Magenta print cartridge
- **10.03.35** (event code): Yellow print cartridge
- **10.23.35** (event code): Fuser kit

## Recommended action

1. Touch the **OK** button to identify the incompatible supplies.
2. Replace the supplies with those that are designed for this printer.

Black print cartridge part number: CE270-67901

Cyan print cartridge part number: CE271-67901  
Yellow print cartridge part number: CE272-67901  
Magenta print cartridge part number: CE273-67901  
For instructions: *Removal and replacement: Fuser*  
Fuser kit (110V) part number: CE707-67912  
Fuser kit (220V) part number: CE707-67913



**NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

## Initializing...

The printer is starting.

### Recommended action

See recommended action.

- No action necessary.

## Install Fuser Unit

The fuser has been removed or installed incorrectly.

### Recommended action



**CAUTION:** The fuser can be hot while the printer is in use. Wait for the fuser to cool before handling it.

1. Open the right door.
2. Install or adjust the fuser.
3. Close the right door.

## Install <supply>

A supply item is either not installed or installed incorrectly.

- **10.00.15** (event code): Black print cartridge
- **10.10.15** (event code): Cyan print cartridge
- **10.02.15** (event code): Magenta print cartridge
- **10.03.15** (event code): Yellow print cartridge
- **10.23.15** (event code): Fuser kit

### Recommended action

- Install the supply item or make sure that the installed supply item is fully seated.

## Install <supply> Close rear door

The toner collection unit has been removed or has been installed incorrectly.

- **10.31.15** (event code): Toner collection unit

### Recommended action

- Replace or reinstall the toner collection unit correctly to continue printing.

### Install supplies

More than one supply is missing or is installed incorrectly.

### Recommended action

1. Touch the **OK** button to identify the supplies that need to be replaced.
2. Touch the **OK** button a second time for more information about the specific supply.
3. Install the supply or make sure it is correctly installed and fully seated.

### Install Transfer Unit

The transfer unit is either not installed or not installed correctly.

### Recommended action

1. Open the right door.
2. Install the ITB.



**NOTE:** If the ITB is already installed, remove it, and then reinstall the ITB.

---

3. Close the right door.
4. If the error persists, use the ITB alienation sensor switch (SW5) in the **Manual Sensor Test** to verify that the switch is properly functioning. If it is not, replace the main drive assembly.  
  
Main drive assembly (simplex) part number: CE707-67905  
Main drive assembly (duplex) part number: CE708-67901
5. If the error persists, use the T1 roller engagement and disengagement drive test in the **Component Test** to verify that the ITB alienation mechanism is properly functioning. If it is not, replace the fuser drive assembly.  
  
Part number: CE707-67904
6. If the printer was recently serviced, check the connector (J181) on the DC controller PCA.

### Internal disk not functional

The printer internal disk is not working correctly.

### Recommended action

1. Turn off the printer, and then remove and reinstall the disk. Turn on the printer.
2. If the error persists, replace the internal hard drive.

For instructions: *Removal and replacement: Hard disk drive*

Encrypted hard disk drive kit part number: D3L08-67903

U.S. Government hard disk drive part number: D3L08-67904

## Internal disk spinning up

The internal hard disk drive device is spinning up its platter. Jobs that require hard disk drive access must wait.

### Recommended action

See recommended action.

- No action necessary.

## Load Tray <X>: [Type], [Size]

This message displays even though there is media loaded in the indicated tray.

### Recommended action

1. Use the cassette media present sensor test in the **Tray/Bin Manual Sensor Test** to verify that the sensor is correctly functioning.
2. Make sure that the sensor flag on the media presence sensor is not damaged and moves freely.
3. Reconnect the corresponding connector:
  - MP tray: connector (J736) on the MP tray media out sensor and the connector (J152) on the DC controller PCA.
  - Printer cassette: connectors (J739 and J742) on the cassette media out sensor and the connector (J151) on the DC controller PCA.
  - 1 X 500-sheet paper feeder cassette: connector (J702D) on the paper feeder cassette media out sensor and the connector (J2003) on the paper feeder controller PCA.
  - Paper deck cassette 1: connector (J702D) on the paper deck cassette 1 media out sensor and connector (J2003) on the paper deck controller PCA 1
  - Paper deck cassette 2: connector (J802D) on the paper deck cassette 2 media out sensor and connector (J2003B) on the paper deck controller PCA 2.
  - Paper deck cassette 3: connector (J902D) on the paper deck cassette 3 media out sensor and connector (J2003C) on the paper deck controller PCA 3.

## Loading program <XX> Do not power off

Programs and fonts can be stored on the printer's file system and are loaded into RAM when the printer is turned on. The number <XX> specifies a sequence number indicating the current program being loaded.

### Recommended action

See recommended action.

- No action necessary.

## Manually feed output stack Then touch "OK" to print second side

The printer has printed the first side of a manual duplex job and is waiting for you (or the applicable user) to insert the output stack to print the second side.

### Recommended action

1. Maintaining the same orientation, remove the pages from the output bin.
2. Flip the document printed side up.
3. Load the document in Tray 1.
4. Touch the **OK** button to print the second side of the job.

## Manually feed: <Type><Size>

This message appears when manual feed is selected, Tray 1 is not loaded, and other trays are empty.

### Recommended action

1. Load the tray with requested paper.
2. If the paper is already in the tray, press the **Help** button to exit the message and then press the **OK** button to print.
3. To use another tray, clear paper from Tray 1, press the **Help** button to exit the message and then press the **OK** button.

## Moving solenoid

The solenoid is moving as part of a component test.

### Recommended action

- To exit press **X**

## Moving solenoid and motor

The solenoid and a motor are moving as part of a component test.

### Recommended action

- To exit press **X**

## No job to cancel

You have pressed the stop button but the printer is not actively processing any jobs.

### Recommended action

See recommended action.

- No action necessary.

## No USB drive or files found

The formatter was not able to detect the USB thumb drive.


If you experience the “No USB drive or files found” attempting to upgrade printer firmware via the walk up easy-access USB port perform the following.

### Recommended action for customers

Follow these steps to try to resolve this error.

If you experience the “No USB drive or files found” attempting to upgrade printer firmware via the walk up easy-access USB port perform the following.

1. 1. After the firmware file has been downloaded from hp.com uncompress the file and copy the xxxxxx.bdl file to the root of a portable USB flash memory storage device (thumb drive), insert the USB flash memory storage device into the easy-access USB port, and attempt to flash the firmware.
2. If the issue persists, verify the USB flash drive is formatted as FAT32. If unsure, format the flash drive as FAT32 and/or try a different flash drive and repeat step 1.
3. If the issue persists, the USB flash drive can be inserted directly into a USB port on the printer's formatter and the firmware flashed.
  - a. Locate the printer's formatter interface located at the rear left side of printer.
  - b. If necessary, rotate the printer for easier access to the formatter ports.
  - c. Locate the USB connection port (callout 2).

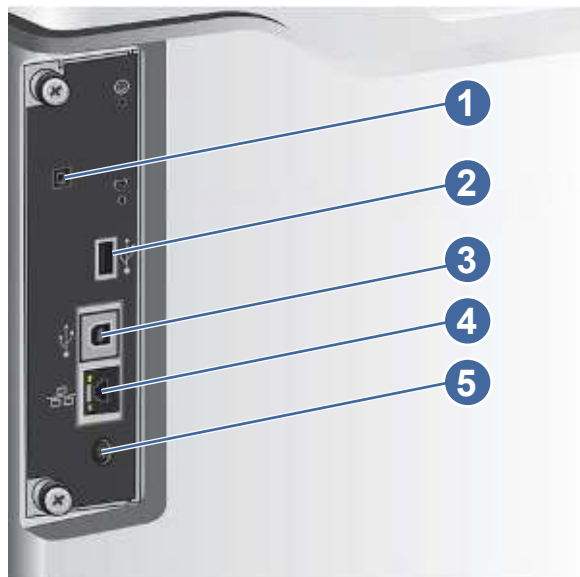

- d. Insert the USB flash drive (callout 2).
  - e. Attempt to flash the printer's firmware.
  - f. After the firmware update remove the USB flash drive.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at [www.hp.com/go/contactHP](http://www.hp.com/go/contactHP).

### Recommended action for call center agents

Follow these steps to try to resolve this error.

1. Try another thumb drive.
2. Use both the rear and walk up USB ports.
3. If the error persists, install another formatter board.

For instructions: *Removal and replacement: Formatter*

Part number: D3L08-67905

4. If the error persists, elevate using the standard support process.

### Recommended action for onsite technicians

Follow these steps to try to resolve this error.

1. Try another thumb drive.
2. Use both the rear and walk up USB ports.
3. If the error persists, install another formatter board.

For instructions: *Removal and replacement: Formatter*

Part number: D3L08-67905

4. If the error persists, elevate using the standard support process.

## Paused...

The printer is paused, and there are no error messages pending at the display. The I/O continues receiving data until the memory is full.

### Recommended action

- Press the **Stop** button.

## Performing Color Band Test...

A color-band test is being performed.

### Recommended action

- No action is necessary.

## Performing Paper Path Test

A paper path test is being performed.

### Recommended action

See recommended action.

- No action necessary.



## Please Wait...

The printer is in the process of clearing data.

### Recommended action

See recommended action.

- No action necessary.

## Printing CMYK samples...

The printer is printing the CMYK sample pages.

### Recommended action

- No action is necessary.

## Printing Color Usage Log...

The printer is printing the Color Usage log.

### Recommended action

- No action is necessary.

## Printing Configuration...

The printer is printing the Configuration page.

### Recommended action

See recommended action.

- No action necessary.

## Printing Demo Page...

The printer is printing the Demo page.

### Recommended action

- No action is necessary.

## Printing Diagnostics Page...

The printer is printing the Diagnostics page.

### Recommended action

- No action is necessary.

## Printing engine test...

The printer is printing an engine test page.

### Recommended action

See recommended action.

- No action necessary.

### Printing Event Log...

The printer is printing the Event Log page.

### Recommended action

See recommended action.

- No action necessary.

### Printing File Directory...

The printer is printing the File Directory pages.

### Recommended action

See recommended action.

- No action necessary.

### Printing Font List...

The printer is printing the Font List pages.

### Recommended action

See recommended action.

- No action necessary.

### Printing Help Page...

The printer is printing the Help page.

### Recommended action

See recommended action.

- No action necessary.

### Printing Menu Map...

The printer is printing the Menu Map pages.

### Recommended action

See recommended action.

- No action necessary.

### Printing PQ Troubleshooting...

The printer is printing the PQ Troubleshooting pages.

### Recommended action

- No action is necessary.

### Printing Registration Page

The printer is printing the Registration pages.

### Recommended action

See recommended action.

- No action necessary.

### Printing RGB Samples...

The printer is printing the RGB Sample pages.

### Recommended action

- No action is necessary.

### Printing stopped...

Time has expired on the Print/Stop test.

### Recommended action

See recommended action.

- No action necessary.

### Printing Supplies Status Page...

The printer is printing the Supplies Status page.

### Recommended action

See recommended action.

- No action necessary.

### Printing Usage Page...

The printer is printing the Usage page.

### Recommended action

See recommended action.

- No action necessary.

### Processing duplex job Do not grab paper until job completes

Paper temporarily comes into the output bin while printing a duplex job.

### Recommended action

See recommended action.

- No action necessary.

## Processing job from tray <x>... Do not grab paper until job completes

The printer is actively processing a job from the designated tray.

### Recommended action

See recommended action.

- No action necessary.

## Processing...

The printer is currently processing a job but is not yet picking pages. When paper motion begins, this message is replaced by a message that indicates the tray the job is using.

### Recommended action

See recommended action.

- No action necessary.

## Processing... copy <x> of <y>

The printer is currently processing or printing collated copies. The message indicates that copy number <x> of total copies <y> is currently being processed.

### Recommended action

See recommended action.

- No action necessary.

## Ready

The printer is online and ready for data. No status or printer attendance messages are pending at the display.

### Recommended action

See recommended action.

- No action necessary.

## Ready <IP Address>

The printer is online and ready for data. No status or printer attendance messages are pending at the display. The printer IP address displays.

### Recommended action

See recommended action.

- No action necessary.

## Remove all toner cartridges

The printer is testing the transfer unit assembly.

## Recommended action

1. To perform the test, remove all the print cartridges. To cancel the test, press the **Stop** button ⊗.
2. To exit press X

## Remove at least one toner cartridge

The printer is testing the print-cartridge motor.

## Recommended action

1. To perform the test, remove at least one print cartridge. To cancel the test, press the **Stop** button ⊗.
2. To exit press X

## Remove shipping lock from Tray 2

The Tray 2 shipping lock was not removed before you turned the printer on.

## Recommended action

- Open Tray 2, and then remove the shipping lock.

## Replace <supply>

This alert displays only if the printer is configured to stop when a supply reaches the very low threshold. The printer indicates when a supply level is at its estimated end of life. The actual life remaining might be different than estimated.

The supply does not need to be replaced now unless the print quality is no longer acceptable.

HP recommends that the customer have a replacement supply available to install when print quality is no longer acceptable.

The printer can be configured to stop when the supply level is very low. The supply might still be able to produce acceptable print quality.

- **10.00.70** (event code): Black print cartridge
- **10.01.70** (event code): Cyan print cartridge
- **10.02.70** (event code): Magenta print cartridge
- **10.03.70** (event code): Yellow print cartridge
- **10.23.70** (event code): Fuser kit
- **10.31.70** (event code): Toner collection unit
- **10.22.70** (event code): Transfer kit

## Recommended action

1. Touch the **OK** button to find out which supplies need to be replaced or check the event log for the specific error code.
2. Configure the printer to continue printing by using the **Manage Supplies** menu.

3. If the print quality is no longer acceptable, **the customer is responsible** for purchasing and replacing the specified supply.

Black print cartridge part number: CE270A

Cyan print cartridge part number: CE271A

Yellow print cartridge part number: CE272A

Magenta print cartridge part number: CE273A

For instructions: *Removal and replacement: Fuser*

Fuser kit (110V) part number: CE977A

Fuser kit (220V) part number: CE978A

Toner collection unit part number: CE980A

For instructions: *Removal and replacement: Intermediate transfer belt (ITB)*

Transfer kit part number: CE516A



**NOTE:** After replacing the fuser, reset the fuser page counter by selecting **New fuser** in the **Reset Supplies** sub-menu.

## Restore Factory Settings

The printer is restoring factory settings.

### Recommended action

See recommended action.

- No action necessary.

## Restricted from printing in color

This message displays when color printing is disabled for the printer or when it is disabled for a particular user or print job.

### Recommended action

- To enable color printing for the printer, change the **Restrict color use** setting in the **Manage Supplies** menu.

## Rotating <color> motor

A component test is in progress. the component selected is the indicated <color> cartridge motor.

<color> =

- Black
- Cyan
- Magenta
- Yellow

## Recommended action

1. Press the **Stop** button ⊗ when ready to stop this test.
2. **To exit press X**

## Rotating Motor

The printer is executing a component test and the component selected is a motor.

## Recommended action

1. Press the **STOP** button when ready to stop this test.
2. To exit, press **X**.

## Size mismatch in Tray <x>

The paper in the listed tray does not match the size specified for that tray.

## Recommended action

1. Load the correct paper.
2. Make sure that the paper is positioned correctly.
3. Close the tray, and then make sure that the control panel lists the correct size and type for the specified tray.
4. If necessary, use the control panel menus to reconfigure the size and type settings for the specified tray.
5. If error persists, use the tray/bin manual sensor test to test the switch.

## <Supply> almost full

The toner collection bottle is almost full.

- 10 . 31 . 60 (event code): Toner collection unit

## Recommended action

- Replace the toner collection unit.

Part number: CE980A

## <Supply> low OR Supplies low

The printer indicates when a supply level, or more than one supply, is low. Actual print cartridge life might vary. You do not need to replace the print cartridge at this time unless print quality is no longer acceptable.

When multiple supplies are low, more than one event code is recorded.

- 10 . 00 . 60 (event code): Black print cartridge
- 10 . 01 . 60 (event code): Cyan print cartridge

- 10 . 02 . 60 (event code): Magenta print cartridge
- 10 . 03 . 60 (event code): Yellow print cartridge
- 10 . 23 . 60 (event code): Fuser kit
- 10 . 22 . 60 (event code): Transfer kit

### Recommended action

1. If print quality is no longer acceptable, replace the supply.
2. HP recommends that the customer have a replacement supply available to install when print quality is no longer acceptable.



**NOTE:** When an HP supply has reached its approximated end of life, the HP Premium Protection Warranty ends.

---

### <Supply> very low OR Supplies very low

The printer indicates when a supply level, or more than one supply, is very low. Actual print cartridge life might vary. You do not need to replace the print cartridge at this time unless print quality is no longer acceptable.

When multiple supplies are low, more than one event code is recorded.

- 10 . 00 . 70 (event code): Black print cartridge
- 10 . 01 . 70 (event code): Cyan print cartridge
- 10 . 02 . 70 (event code): Magenta print cartridge
- 10 . 03 . 70 (event code): Yellow print cartridge
- 10 . 23 . 70 (event code): Fuser kit
- 10 . 22 . 70 (event code): Transfer kit

### Recommended action

1. If print quality is no longer acceptable, replace the supply.
2. HP recommends that the customer have a replacement supply available to install when print quality is no longer acceptable.



**NOTE:** When an HP supply has reached its approximated end of life, the HP Premium Protection Warranty ends.

---

### Supplies in wrong positions

Two or more print-cartridge slots contain the wrong print cartridge.

From left to right, the print cartridges should be installed in the following order:

- Yellow
- Magenta



- Cyan
- Black

### Recommended action

- Install the correct cartridge in each slot.

### Tray <X> empty: [Type], [Size]

The specified tray is empty and the current job does not need this tray to print.

- X = 1: Tray 1
- X = 2: Tray 2
- X = 3: Tray 3
- X = 4: Tray 4
- X = 5: Tray 5
- X = 6: Tray 6

### Recommended action

- Refill the tray at a convenient time.



**NOTE:** This could be a false message. If the tray is loaded without removing the shipping lock, the printer does not sense that the paper is loaded. Remove the shipping lock, and then load the tray.

### <Tray X> lifting

The printer is in the process of lifting paper in the indicated tray.

- X = 2: Tray 2
- X = 3: Tray 3
- X = 4: Tray 4
- X = 5: Tray 5
- X = 6: Tray 6

### Recommended action

- No action is necessary.

### Tray <X> open

The specified tray is open or not closed completely.

- Tray 2 open
- Tray 3 open
- Tray 4 open

- Tray 5 open
- Tray 6 open

### Recommended action

1. Close the tray.
2. If this message appears after the lifter drive assembly was removed or replaced, make sure that the connector on the assembly is correctly connected and fully seated.
3. If the error persists, use the Media size switches (SW2,3 - SW82,83 - SW92,93) test in the **Tray/Bin Manual Sensor Test** to test the switches.
4. If they do not respond, replace the associated the lifter drive assembly.

Tray 2 lifter drive assembly part number: RM1-6039-000CN

Trays 3–6 lifter drive assembly part number: RM1-3819-000CN

### Tray <X> overfilled

The tray is filled above the stack-height mark.

- X = 2: Tray 2
- X = 3: Tray 3
- X = 4: Tray 4
- X = 5: Tray 5
- X = 6: Tray 6

### Recommended action

1. Remove enough paper so that the paper stack does not exceed the limit for the tray.
2. If this message displays after the lifter drive assembly was removed or replaced, make sure that the connector on the assembly is correctly connected and fully seated.

### Troubleshooting

The printer is in the troubleshooting process.

### Recommended action

1. Press the **Stop** ⊗ button .
2. **To exit press X**

### Type mismatch Tray <x>

The specified tray contains a paper type that does not match the configured type.

### Recommended action

The specified tray will not be used until this condition is addressed. Printing can continue from other trays.

1. Load the correct paper in the specified tray.
2. On the printer control panel, make sure the paper type loaded in the tray matches the specified setting for the tray.

## Unsupported drive installed To continue, touch “OK”

A non-supported hard disk drive has been installed. The hard disk drive is unusable by this printer.

### Recommended action

1. Turn the printer off.
2. Remove the hard drive.
3. Turn the printer on.

## Unsupported supply in use OR Unsupported supply installed To continue, touch “OK”

A non-supported supply has been installed.

OR

One of the print cartridges is for a different HP printer.

- XX = 00: Black print cartridge
- XX = 01: Cyan print cartridge
- XX = 02: Magenta print cartridge
- XX = 03: Yellow print cartridge

### Recommended action

- Install the correct supplies for this printer. See the Parts chapter in this manual for supply part numbers.

Black print cartridge part number: CE270-67901

Cyan print cartridge part number: CE271-67901

Yellow print cartridge part number: CE272-67901

Magenta print cartridge part number: CE273-67901

## Unsupported tray configuration

The printer has too many optional trays installed.

### Recommended action

- Turn the printer off, remove the unsupported trays, and then turn the printer on.

## Unsupported USB accessory detected Remove USB accessory

A non-supported USB accessory has been installed.

### Recommended action

- Turn the printer off, remove the USB accessory, and then turn the printer on.

### USB accessory needs too much power Remove USB and turn off then on

A USB accessory is drawing too much electrical current. Printing cannot continue.

### Recommended action

1. Remove the USB accessory. Turn the printer off, and then on.
2. Use a USB accessory that uses less power or that contains its own power supply.

### USB accessory not functional

A parameter in the USB accessory is not correctly functioning.

### Recommended action

1. Turn the printer off.
2. Remove the USB accessory.
3. Insert a replacement USB accessory.
4. Turn the printer on.

### Used supply installed To continue, touch “OK”ORUsed supply in use

One of the print cartridges has been previously used.

- XX = 00: Black print cartridge  
Black print cartridge
- XX = 01: Cyan print cartridge  
Cyan print cartridge
- XX = 02: Magenta print cartridge  
Magenta print cartridge
- XX = 03: Yellow print cartridge  
Yellow print cartridge

### Recommended action

- If you believe you purchased a genuine HP supply, go to [www.hp.com/go/anticounterfeit](http://www.hp.com/go/anticounterfeit).

### Wrong cartridge in <color> slot

The indicated slot for a print cartridge contains a print cartridge that is not the correct color.

**The indicated print cartridge is installed in the wrong position:**

- 10 . 00 . 25 (event code): Black print cartridge

- 10 . 01 . 25 (event code): Cyan print cartridge
- 10 . 02 . 25 (event code): Magenta print cartridge
- 10 . 03 . 25 (event code): Yellow print cartridge

### Recommended action

- Remove the print cartridge from that slot, and install a print cartridge that is the correct color.

---

# Index

## Symbols/Numerics

76.00.24 5

## B

backup error  
    32.WX.YZ error 4  
    reset error 4  
    restore error 4

## C

cartridges  
    error messages 193  
    replace message 193  
clock  
    error message 26  
connector error  
    65.WX.YZ error 5

## D

DC controller communication error  
    55.WX.YZ error 4  
DC controller firmware error  
    70.WX.YZ error 5  
digital sending error (firmware)  
    44.WX.YZ error 4  
document feeder error  
    31.WX.YZ error 4  
duplexer error  
    69.WX.YZ error 5

## E

Embedded Jetdirect error  
    80.WX.YZ error 5  
engine error (LaserJet)  
    46.WX.YZ error 4  
    63.WX.YZ error 5  
engine error (PageWide)  
    61.WX.YZ error 5  
event log error (firmware)  
    42.WX.YZ error 4

## F

fan error  
    58.WX.YZ error 4  
firmware communication error  
    49.WX.YZ error 4  
firmware install error  
    99.WX.YZ error 5  
hard disk error 5  
remote firmware upgrade  
    error 5  
fuser error  
    41.WX.YZ error 4  
    laser scanner error 4  
    paper path error 4  
fuser error (LaserJet)  
    50.WX.YZ error 4

## H

hard disk partition error  
    98.WX.YZ error 5

## I

input accessory error  
    67.WX.YZ error 5  
input/output error  
    40.WX.YZ error 4  
internal clock errors 26  
internal diagnostics error  
    90.WX.YZ error 5  
video display error 5

## J

jam error (LaserJet)  
    13.WX.YZ error 4  
jam error (PageWide)  
    13.WX.YZ error 4  
job accounting error (firmware)  
    48.WX.YZ error 4  
job management error  
    (firmware) 4  
job pipeline error (firmware) 4

job parser error (firmware)  
    47.WX.YZ error 4  
    printer calibration error 4

## L

laser scanner error (LaserJet)  
    51.WX.YZ error 4  
    52.WX.YZ error 4  
last update 1

## M

memory  
    insufficient 63  
    supply errors 19  
memory error  
    82.WX.YZ error 5  
    EMMC error 5  
    hard disk error 5  
motor error (LaserJet)  
    59.WX.YZ error 5

## N

Near Field Communication error  
    81.WX.YZ error 5  
Bluetooth error 5  
external I/O card error 5  
internal EIO error 5  
wireless error 5

## O

output accessory error  
    66.WX.YZ error 5  
OXPd/Web kit error  
    45.WX.YZ error 4

## P

page error  
    21.WX.YZ error 4  
paper handling error (LaserJet)  
    56.WX.YZ error 4

- print bar error (PageWide)
  - 62.WX.YZ error 5
- print cartridges
  - error messages 193
  - replace message 193
- printer memory error
  - 20.WX.YZ error 4

## R

- real-time clock error
  - 11.WX.YZ error 4
- replace supplies message 193

## S

- scanner error
  - 30.WX.YZ error 4
- security error
  - 33.WX.YZ error 4
- sensor error
  - 54.WX.YZ error 4
  - 58.WX.YZ error 4
- supplies
  - error messages 193
  - memory errors 19
  - replace message 193
- supplies error (LaserJet)
  - 10.WX.YZ error 4
- supplies error (PageWide)
  - 17.WX.YZ error 4
- system error (LaserJet)
  - 62.WX.YZ error 5

## T

- tray motor error (LaserJet)
  - 60.WX.YZ error 5