

CÓDIGO	REVISÃO	DATA
FRGH.049		

REGISTRO DE INVESTIGAÇÃO DE PRODUTO

Caso algum campo não seja aplicável, preencha com N/A.

1. IDENTIFICAÇÃO DO PRODUTO

Produto:	HealthGo Air
Data:	15/04/2026
Número de Série / Lote:	202507300012
HGID:	26031803
Cliente (caso aplicável):	DOUGLAS LAZZERIS

2. INFORMAÇÕES DO PROBLEMA

PROBLEMA RELATADO PELO CLIENTE:

O aparelho está piscando o led vermelho intermitentemente e não reconhece o dispositivo no Software.

PROBLEMA CONSTATADO PELO SUPORTE:

Falha de autenticação de sensores

3. ANÁLISE TÉCNICA INTERNA

RESULTADO DA INVESTIGAÇÃO:

Foi realizada uma análise detalhada dos logs do Software e identificamos falha de autenticação. Eu subi uma SVM para forçar o funcionamento do que estaria ocasionando o erro e visualizei que um dos sensores está fora dos limites do conversor MCP3564, representado nos logs por um erro de Hardware. Todavia, solicito o recolhimento para investigação.

OBSERVAÇÕES:

Trata-se de um aparelho que foi recolhido recentemente e reenviado ao cliente.

CÓDIGO	REVISÃO	DATA
FRGH.049		

4. EVIDÊNCIA FOTOGRÁFICA

```

2026-04-15T13:28:20.9804488-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="MCP3564: canal 4 fora dos limites
, conversor 0. \n"
2026-04-15T13:28:20.9810334-03:00 WRN Received error from device error=INITIALIZATION_FAIL
2026-04-15T13:28:20.9810334-03:00 WRN FULL ERROR protoErr="payloadType:ERROR_EVENT errorCode:INITIALIZATION_FAIL descr
iption:"\n\nSM: INITIALIZE Erro no logger. \n\n"
2026-04-15T13:28:20.9815764-03:00 WRN ERROR CODE ErrorCode=INITIALIZATION_FAIL
2026-04-15T13:28:20.9821273-03:00 WRN ERROR DESCRIPTION Description="\nSM: INITIALIZE Erro no logger. \n"
2026-04-15T13:28:20.982691-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="SM: INITIALIZE Erro no logger. \n"
2026-04-15T13:28:21.0201585-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="MCP3564: canal 4 fora dos limites
, conversor 0. \n"
2026-04-15T13:28:21.2200491-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="MCP3564: canal 4 fora dos limites
, conversor 0. \n"
2026-04-15T13:28:21.4200085-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="MCP3564: canal 4 fora dos limites
, conversor 0. \n"
2026-04-15T13:28:21.6201744-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="MCP3564: canal 4 fora dos limites
, conversor 0. \n"
2026-04-15T13:28:21.8206192-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="MCP3564: canal 4 fora dos limites
, conversor 0. \n"
2026-04-15T13:28:22.0203714-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="MCP3564: canal 4 fora dos limites
, conversor 0. \n"
2026-04-15T13:28:22.2202174-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="MCP3564: canal 4 fora dos limites
, conversor 0. \n"
2026-04-15T13:28:22.4201697-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="MCP3564: canal 4 fora dos limites
, conversor 0. \n"
2026-04-15T13:28:22.6201969-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="MCP3564: canal 4 fora dos limites
, conversor 0. \n"
2026-04-15T13:28:22.820137-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="MCP3564: canal 4 fora dos limites
, conversor 0. \n"

```

5. DISPOSIÇÃO FINAL

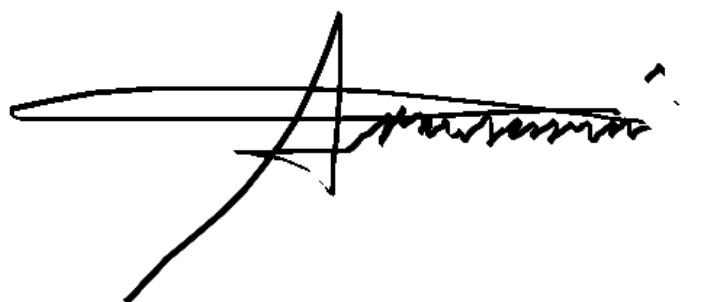
X Recolhimento do produto

Atualização de firmware

Recalibração Remota

CÓDIGO	REVISÃO	DATA
FRGH.049		

ASSINATURA

A handwritten signature in black ink, appearing to read 'André Luiz de Souza', is written over a horizontal line. The signature is stylized with a large, sweeping 'A' and a long, horizontal stroke.

Analista responsável: André Luiz de Souza