

1 Process Capability

- In managing variables the usual aim is not to achieve exactly the same diameter for every piston, the same weight for every tablet, sales figures exactly as forecast, etc but to reduce the variation of products and process parameters around a **target value**.
- No adjustment of a process is called for as long as there has been no identified change in its accuracy or precision. This means that, in controlling a process, it is necessary to establish first that it is in statistical control, and then to compare it's centering and spread with the specified target value and specification tolerance.
- We have seen previously that, if a process is not in statistical control, special causes of variation may be identified with the aid of *control charts*.
- Only when all the special causes have been accounted for, or eliminated, can process capability be sensibly assessed. The variation due to common causes may then be examined and the "natural specification" compared with any imposed specification or tolerance zone.
- The relationship between process variability and tolerances may be formalized by consideration of the standard deviation, σ , of the process.
- In order to manufacture within the specification, the distance between the **upper specification limit** (USL) or upper tolerance (+T) and **lower specification limit** (LSL) or lower tolerance (-T), i.e. (USL-LSL) or 2T must be equal to or greater than the width of the base of the process bell, i.e. 6σ .

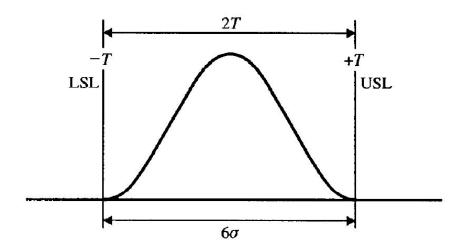

The relationship between USL - LSL (i.e. 2T) and 6σ gives rise to three levels of precision of the process (Figure below):

- (a) **High Relative Precision**, where the tolerance band is very much greater than $6\sigma~(2T>>6\sigma)$
- (b) **Medium Relative Precision**, where the tolerance band is just greater than $6\sigma~(2T>6\sigma)$
- (c) Low Relative Precision, where the tolerance band is less than 6σ ($2T < 6\sigma$)

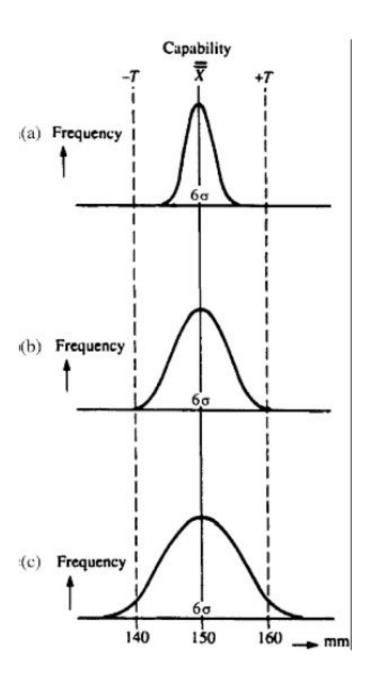

1.1 Process Capability Indices

- A process capability index is a measure relating the actual performance of a process to its specified performance, where processes are considered to be a combination of the plant or equipment, the method itself, the people, the materials and the environment.
- These indices assumes process output is approximately normally distributed.
- The absolute minimum requirement is that three process standard deviations each side of the process mean are contained within the specification limits.
- This means that approximately 99.7 per cent of output will be within the tolerances. A more stringent requirement is often stipulated to ensure that produce of the correct quality is consistently obtained over the long term.
- When a process is under statistical control (i.e. only random or common causes of variation are present), a process capability index may be calculated.
- Process capability indices are simply a means of indicating the variability of a process relative to the product specification tolerance.

C_p index


- In order to manufacture within a specification, the difference between the USL and the LSL must be less than the total process variation.
- A comparison of 6σ with (USL-LSL) or 2T gives an obvious process capability index, known as the C_p of the process:

$$\hat{C}_p = \frac{USL - LSL}{6\hat{\sigma}}$$

- This estimates what the process is capable of producing if the process mean were to be centered between the specification limits. Clearly, any value of C_p below 1 means that the process variation is greater than the specified tolerance band so the process is incapable.
- For increasing values of C_p the process becomes increasingly capable. The C_p index makes no comment about the centring of the process, it is a simple comparison of total variation with tolerances.

C_{pk} index


• It is possible to envisage a relatively wide tolerance band with a relatively small process variation, but in which a significant proportion of the process output lies outside the tolerance band (Figure below).

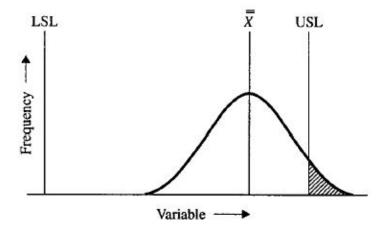

• This does not invalidate the use of Cp as an index to measure the 'potential capability' of a process when centred, but suggests the need for another index which takes account of both the process variation and the centring. Such an index is the C_{pk} , which is widely accepted as a means of communicating process capability.

$$Cpk_{\rm u} = \frac{{\rm USL} - \overline{X}}{3\sigma}$$
 $Cpk_{\rm l} = \frac{\overline{X} - {\rm LSL}}{3\sigma}$.

- For upper and lower specification limits, there are two C_{pk} values, C_{pku} and C_{pkl} . These relate the difference between the process mean and the upper and the lower specification limits respectively, to 3σ (half the total process variation).
- The overall process C_{pk} is the lower value of C_{pku} and C_{pkl} . A C_{pk} of 1 or less means that the process variation and its centring is such that at least one of the tolerance limits will be exceeded and the process is incapable. As in the case of C_p , increasing values of C_{pk} correspond to increasing capability.
- It may be possible to increase the C_{pk} value by centring the process so that its mean value and the mid-specification or target, coincide. A comparison of the C_p and the C_{pk} will show zero difference if the process is centred on the target value.

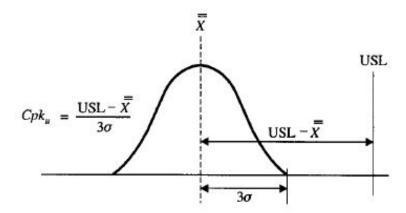

• The C_{pk} can be used when there is only one specification limit, upper or lower – a one-sided specification. This occurs quite frequently and the C_p index cannot be used in this situation.

Example 1

Example 1.

In tablet manufacture, the process parameters from 20 samples of size n=4 are:

Mean Range (\overline{R}) = 91 mg, Process mean (\overline{X}) = 2500 mg Specified requirements USL = 2650 mg, LSL = 2350 mg Standard Deviation (s) = 44.2

$$Cp = \frac{\text{USL} - \text{LSL}}{6\sigma}$$
 or $\frac{2T}{6\sigma} = \frac{2650 - 2350}{6 \times 44.2} = \frac{300}{265.2} = 1.13$
 $Cpk = \text{lesser of } \frac{\text{USL} - \overline{X}}{3\sigma}$ or $\frac{\overline{X} - \text{LSL}}{3\sigma}$
 $= \frac{2650 - 2500}{3 \times 44.2}$ or $\frac{2500 - 2350}{3 \times 44.2} = 1.13$.

Example 2

Example 2.

If the process parameters from 20 samples of size n=4 are:

Mean range $(\overline{R}) = 91 \,\text{mg}$, Process mean $(\overline{\overline{X}}) = 2650 \,\text{mg}$ Specified requirements USL = 2750 mg, LSL = 2250 mg Standard Deviation (s) = 44.2

$$Cp = \frac{\text{USL} - \text{LSL}}{6\sigma}$$
 or $\frac{2T}{6\sigma} = \frac{2750 - 2250}{6 \times 44.2} = \frac{500}{265.2} = 1.89$
 $Cpk = \text{lesser of } \frac{2750 - 2650}{3 \times 44.2}$ or $\frac{2650 - 2250}{3 \times 44.2}$
= lesser of 0.75 or 3.02 = 0.75.

Conclusion – the Cp at 1.89 indicates a potential for higher capability than in example (i), but the low Cpk shows that this potential is not being realized because the process is not centred.

It is important to emphasize that in the calculation of all process capability indices, no matter how precise they may appear, the results are only ever approximations – we never actually know anything, progress lies in obtaining successively closer approximations to the truth. In the case of the process capability this is true because:

- there is always some variation due to sampling;
- no process is ever fully in statistical control;
- no output exactly follows the normal distribution or indeed any other standard distribution.

Interpreting process capability indices without knowledge of the source of the data on which they are based can give rise to serious misinterpretation.

Interpreting capability indices - IMPORTANT

In the calculation of process capability indices so far, we have derived the standard deviation, σ , and recognized that this estimates the short-term variations within the process. This short term is the period over which the process remains relatively stable, but we know that processes do not remain stable for all time and so we need to allow within the specified tolerance limits for:


- some movement of the mean;
- the detection of changes of the mean;
- possible changes in the scatter (range);
- the detection of changes in the scatter;
- the possible complications of non-normal distributions.

Taking these into account, the following values of the C_{pk} index represent the given level of confidence in the process capability:


- $C_{pk} < 1$ A situation in which the production system is **not capable** and there will inevitably be non-conforming output from the process.
- $C_{pk} = 1$ A situation in which the production system is not really capable, since any change within the process will result in some undetected non-conforming output.
- $C_{pk} = 1.33$ A still far from acceptable situation since non-conformance is not likely to be detected by the process control charts.
- $C_{pk} = 1.5$ Not yet satisfactory since non-conforming output will occur and the chances of detecting it are still not good enough.
- $C_{pk} = 1.67$ Promising, non-conforming output will occur but there is a very good chance that it will be detected.
- $C_{pk} = 2$ High level of confidence in the production system, provided that control charts are in regular use.

The C_{pm} Index

- Another Index C_{pm} incorporates the target when calculating the standard deviation. The standard error, denoted $\hat{\sigma}_{Cpm}$ compares each observation to a reference value.
- However, instead of comparing the data to the mean, the data is compared to the target. These differences are squared. Thus any observation that is different from the target observation will increase the $\hat{\sigma}_{Cpm}$ standard deviation.
- As this difference increases, so does the Cpm. And as this index becomes larger, the C_{pm} gets smaller.
- If the difference between the data and the target is small, so too is the sigma. And as this sigma gets smaller, the Cpm index becomes larger. The higher the C_{pm} index, the better the process.
- In the following charts the process is the same, but as the process becomes more centred, the C_{pm} gets better.

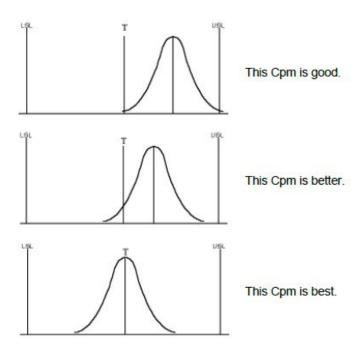

In these 3 charts, the process stays centred about the target, but as the variation is reduced, the $\rm Cpm$ gets better.

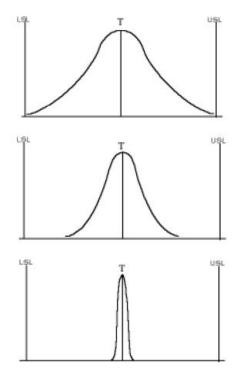

This Cpm is reasonably good.

This Cpm is better.

This Cpm is best.


| | Population Known | Population Unknown |
|-----|--|---|
| Ср | $C_p = rac{USL - LSL}{6\sigma}$ | $\hat{C}_p = rac{USL - LSL}{6s}$ |
| Cpk | $C_{pk} = \min\left[\frac{USL - \mu}{3\sigma}, \frac{\mu - LSL}{3\sigma}\right]$ | $\hat{C}_{pk} = \min \left[\frac{USL - \bar{x}}{3s}, \frac{\bar{x} - LSL}{3s} \right]$ |
| Cpm | $C_{pm} = rac{USL - LSL}{6\sqrt{\sigma^2 + (\mu - T)^2}}$ | $\hat{C}_{pm} = rac{USL - LSL}{6\sqrt{s^2 + (ar{x} - T)^2}}$ |

1.2 Worked Example with R

Data set used – diameter (piston rings data set)

R code used previously, reminding ourselves about the data set.

```
data(pistonrings)
attach(pistonrings)
dim(pistonrings)
diameter <- qcc.groups(diameter, sample)
obj <- qcc(diameter[1:25,], type="xbar",
newdata=diameter[26:40,])</pre>
```

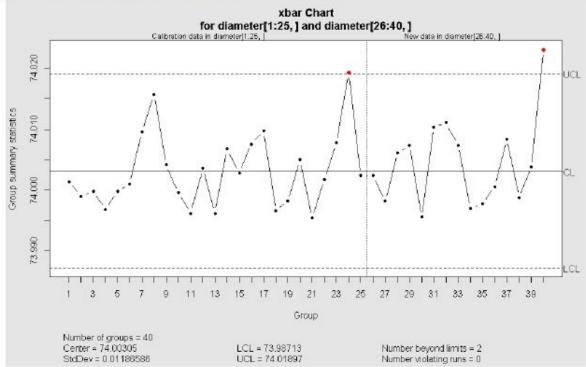

1.3 Implementation of Process Capability Analysis

Indices and Confidence intervals for those indices.


```
> process.capability(obj, spec.limits=c(73.95,74.05))
Process Capability Analysis
Call:
process.capability(object = obj, spec.limits = c(73.95,
74.05))
Number of obs = 125
                              Target = 74
       Center = 74.00305
                                 LSL = 73.95
       StdDev = 0.01186586
                                 USL = 74.05
Capability indices:
      Value
              2.5%
                     97.5%
             1.230
Cp
      1.405
                    1.579
      1.490
             1.327
                    1.653
Cp 1
      1.319
             1.173
                    1.465
Cp u
Cp k
      1.319
             1.145
                    1.493
Cpm
      1.360
             1.187
                    1.534
Exp<LSL 0%
             Obs<LSL 0%
Exp>USL 0%
             Obs>USL 0%
```

Process Capability

To perform a capability analysis on a process, the process needs to be in statistical control. It is usually assumed that the process characteristic being measured is normally distributed.

This may be checked out using tests for normality such as the Kolmogorov-Smirnov test or the Anderson-Darling test. Process capability compares process performance with process requirements.

Process requirements determine specification limits. **LSL** and **USL** represent the lower specification limit and the upper specification limit. The data used to determine whether a process is in statistical control may be used to do the capability analysis. The *3-sigma* distance on either side of the mean is called the process spread.

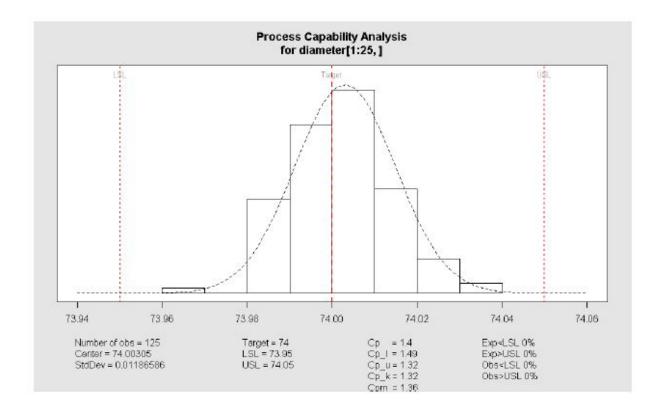

The mean and standard deviation for the process characteristic may be estimated from the data gathered for the statistical process control study.

Calculating Process Capability Indices

$$\hat{C}_P = \frac{\text{USL} - \text{LSL}}{6s}$$

$$\hat{C}_{PK} = \min \left[\frac{\text{USL} - \bar{x}}{3s}, \frac{\bar{x} - \text{LSL}}{3s} \right]$$

$$\hat{C}_{PM} = \frac{\text{USL} - \text{LSL}}{6\sqrt{s^2 + (\bar{x} - T)^2}}$$

Process Potential Index $(C_P \text{ Index})$

The process potential index, or C_P , measures a process's potential capability, which is defined as the allowable spread over the actual spread. The allowable

spread is the difference between the upper specification limit and the lower specification limit. The actual spread is determined from the process data collected and is calculated by multiplying six times the standard deviation, s. The standard deviation quantifies a process's variability. As the standard deviation increases in a process, the C_P decreases in value. As the standard deviation decreases (i.e., as the process becomes less variable), the C_P increases in value.

Interpreting the C_P Index

Assuming the process distribution is normal and the process average is exactly centered between the engineering requirements, a C_P index of 1 would give a capable process.

By convention, when a process has a C_P value less than 1.0, it is considered potentially incapable of meeting specification requirements. Conversely, when a process C_P is greater than or equal to 1.0, the process has the potential of being capable.

However, to allow a bit of room for **process** drift, the generally accepted minimum value for C_P is 1.33. In general, the larger C_P is, the better.

In a process qualified as a **Six Sigma process** (i.e., one that allows plus or minus six standard deviations within the specifications limits), the C_P is greater than or equal to 2.0.

Shortcomings of the C_P Index

The C_P index has two major shortcomings. First, it cannot be used unless there are both upper and lower specifications. Second, it does not account for process centering. If the process average is not exactly centered relative to the engineering requirements, the C_P index will give misleading results. In recent years, the C_P index has largely been replaced by C_{PK} .

The Process Capability Index $(C_{PK} \text{ Index})$

The process capability index, or C_{PK} , measures a process's ability to create product within specification limits. C_{PK} represents the difference between the actual process average and the closest specification limit over the standard deviation, times three.

The C_{PM} Index

A C_{PM} of at least 1 is required, and 1.33 is preferred. C_{PM} is closely related to C_P . The difference represents the potential gain to be obtained by moving the process mean closer to the target. Unlike C_{PK} , the target need not be the center of the specification range.

2 Process Capability

Process capability compares the output of an in-control process to the specification limits by using capability indices. The comparison is made by forming the ratio of the spread between the process specifications (the specification "width") to the spread of the process values, as measured by 6 process standard deviation units (the process "width").

3 What is Process Capability?

Process capability compares the output of an in-control process to the specification limits by using capability indices. The comparison is made by forming the ratio of the spread between the process specifications (the specification "width") to the spread of the process values, as measured by 6 process standard deviation units (the process "width").

3.1 Process Capability Index

Process Capability Index is used to find out how well the process is centered within the specification limits. It is denoted by Cpk.

$$Cpk = Cp(1 - K)$$

$$K = \frac{2(\text{Design Target} - \text{Process Average})}{(USL - LSL)}$$

Where,

• Cp = Process Capability

Design target is the actual specification targetted without +/- allowance.