

	DOCUMENT TITLE: CAPA Report Form	Revision: A
	DOCUMENT #: FM1-QM.SLQ016	Effective Date: 25Sep2020

CAPA #:001-2025

SECTION I: INITIATION OF CAPA PROPOSAL

ORIGINATOR

☐ CORRECTIVE ACTION

☒ PREVENTIVE ACTION

INITIATED BY: Ethan Rao

DATE: 30 July 2025

DETAILED DESCRIPTION OF NON-CONFORMANCE/OPPORTUNITY FOR IMPROVEMENT:

On 5 occasions over a period of 3 years, it was reported to Silq that the port allowing connection of the saline syringe to the catheter became unseated from the catheter when the syringe was being connected. The check valve on the catheter is not always seated completely flush against the catheter tubing. The gap between the check valve and tubing varies from sample to sample. See image below of a catheter sample with a gap between the valve and the tubing.

Valve placement with gap:



SOURCE OF INFORMATION (NCMR#, COMPLAINT#, OBSERVATION, ETC.): PCFs: 2022002 (Lot HDX-8006110821), 2023002 (Lot SLQ1610-012022), 2024002 (Lot SLQ-81020403231), 2024003 (Lot SLQ-81040413231), and 2025001 (Lot SLQ-81040413231)

SECTION II: INITIAL INVESTIGATION BY QA

	DOCUMENT TITLE: CAPA Report Form	Revision: A
	DOCUMENT #: FM1-QM.SLQ016	Effective Date: 25Sep2020

CAPA #:001-2025


QUALITY	INITIAL INVESTIGATION (INCLUDE ACTIVITY, RESULTS AND RECOMMENDATION): In June 2024, following PCF2024003, A random sampling of 100 16Fr x 10mL catheters were pulled from inventory, and the gap was measured. There was great inconsistency in how the valves are placed. The results are summarized in the table below:																
	<table border="1"> <thead> <tr> <th>Valve Gap Length</th> <th>Number of catheters</th> </tr> </thead> <tbody> <tr> <td>0 mm</td> <td>3</td> </tr> <tr> <td>1 mm</td> <td>4</td> </tr> <tr> <td>2 mm</td> <td>21</td> </tr> <tr> <td>3 mm</td> <td>31</td> </tr> <tr> <td>4 mm</td> <td>27</td> </tr> <tr> <td>5 mm</td> <td>14</td> </tr> </tbody> </table> Contact was made with the Pathway MedTech, a contract manufacturer and the supplier of the untreated catheters to Silq. Subsequently, the manufacturer of the untreated catheters was notified and an agreement was made on November 6th, 2024 to use an improved valve that ensures secure placement and prevents dislodgement on future shipments of the untreated catheters. Because the issue occurred on a small percentage of total units and presented no significant risk to patients, no additional design changes or inspection processes were implemented at that time. Following PCF2025001 reported in July 2025, the first instance of the issue since the June 2024 investigation, this CAPA was initiated by Ethan Rao with the intent to review all Silq catheters in inventory that were manufactured with untreated catheters obtained prior to November 6th, 2024. Units that meet either of the criteria listed above will be removed from inventory and used for research and development purposes. The relevant lots are Lot SLQ-11202024 and Lot SLQ-05012025				Valve Gap Length	Number of catheters	0 mm	3	1 mm	4	2 mm	21	3 mm	31	4 mm	27	5 mm
Valve Gap Length	Number of catheters																
0 mm	3																
1 mm	4																
2 mm	21																
3 mm	31																
4 mm	27																
5 mm	14																
SECTION III: APPROVALS TO OPEN or REJECT BY CAPA TEAM																	
CAPA TEAM	☒ Approved ☐ Rejected		If rejected, provide rationale:														
	ASSIGNED CAPA OWNER: Ethan Rao																
	Quality Assurance: <i>Ethan Rao</i>	Date: 15 Aug 2025	R&D/Engineering: 	Date: 15 Aug 2025													
	MFG / Operations: <i>Chris Turner</i>	Date: 15 Aug 2025	Other:	Date:													
	Other:	Date	Other:	Date:													

	DOCUMENT TITLE: CAPA Report Form	Revision: A
	DOCUMENT #: FM1-QM.SLQ016	Effective Date: 25Sep2020

CAPA #:001-2025

SECTION IV: INVESTIGATION AND DETERMINATION OF ROOT CAUSE

Silq researchers continued to evaluate the 100 randomly sampled catheters and established criteria that could potentially be used for a non-destructive evaluation of the existing inventory to identify any units where this issue may occur. The proposed rejection criteria were as follows:

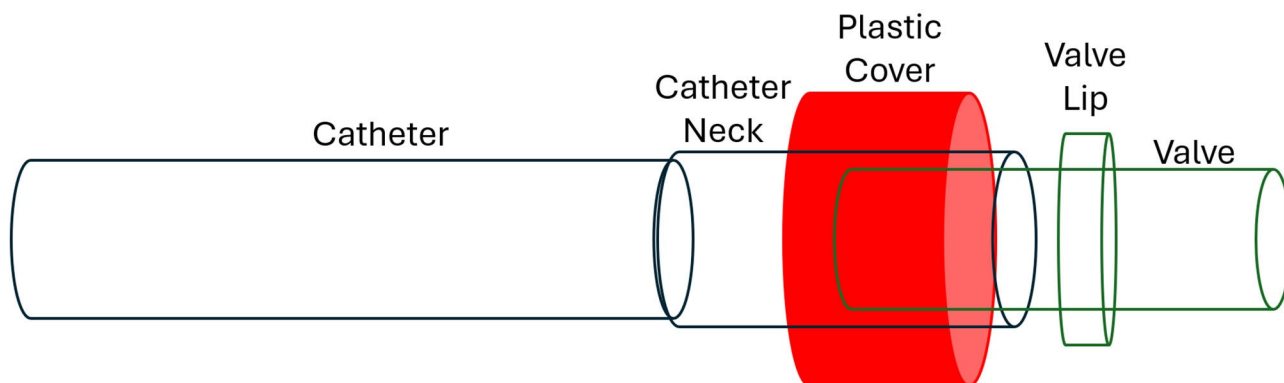

- 1) The check valve is not securely and properly seated to the catheter neck connector.
- 2) The maximum length from the plastic cover to the end of the valve should be less than 26mm.

RISK / HAZARD ANALYSIS SUMMARY (SAFETY ISSUE ONLY): Non-conformance presents only a remote risk the patient will need to seek a premature catheter exchange. No patient injuries as a result of the nonconformance have been reported

DOES THE RISK MANAGEMENT REPORT NEED TO BE UPDATED: ☐ YES ☒ NO (THERE ARE NO NEW FAILURE MODES, INCREASE IN INCIDENCE, OR HAZARDS)

ANALYSIS COMPLETED BY: Ethan Rao

DATE: 11 Nov 2025

DATA ATTACHED: ☐ YES ☒ NO

SECTION V: CORRECTIVE ACTION or PREVENTIVE ACTION PLAN

OWNER	#	CORRECTIVE / PREVENTIVE ACTION:	RESPONSIBILITY:	ESTIMATED DATE ACTION WILL BE IMPLEMENTED:
	1	100% visual/dimensional inspection of the SLQ-211610SPT finished goods	Ethan Rao	18 Nov 2025
	2	Revision of device drawings to reflect updated specifications for conformance	Ethan Rao	18 Jan 2026



DOCUMENT TITLE:
CAPA Report Form

Revision: A

DOCUMENT #:
FM1-QM.SLQ016

Effective Date:
25Sep2020

CAPA #:001-2025

DOCUMENT CONSIDERATION THAT THE ACTION(S) DOES NOT ADVERSELY IMPACT PRODUCT OR SYSTEM: Non-conformance presents only a remote risk the patient will need to seek a premature catheter exchange. There is no potential adverse impact on finished goods

RESPONSIBLE DEPARTMENT MANAGEMENT ACTION PLAN APPROVAL: *Brian McVerry*

DATE:
01 Sep 2025

ACTION PLAN SUMMARY COMPLETED BY: Ethan Rao

DATE: 01 Sep 2025

DATE ACTION PLAN IMPLEMENTATION COMPLETE:
18 Nov 2025

Owner Signature:

DATE:
17 Nov 2025

Ethan Rao

SECTION VI: VERIFICATION OF EFFECTIVENESS

OWNER	#	DESCRIBE METHOD TO BE USED TO CONFIRM EFFECTIVENESS:	ACCEPTANCE CRITERIA:	RESULTS OF EFFECTIVENESS CHECK:
	1	All product complaints regarding inspected devices to be monitored. CAPA will be closed if no reoccurrences of valve malfunction are observed	1) No reoccurrences of valve malfunction in product complaints between 17 Nov 2025 and 17 Nov 2026	☐ Effectiveness confirmed ☐ Action was not effective Initial/Date:
	2	Revision of device drawings to reflect updated specifications for conformance	1) Completion of revision of device drawings to reflect updated specifications for conformance	☒ Effectiveness confirmed ☐ Action was not effective Initial/Date: ER 13 Mar 2026
				☐ Effectiveness confirmed ☐ Action was not effective Initial/Date:
	EFFECTIVENESS PLAN COMPLETED BY: Ethan Rao			Ethan Rao DATE: 28 Nov 2025
	QA PLAN APPROVAL: Brian McVerry		Brian McVerry DATE: 28 Nov 2025	
	COMMENTS REGARDING EFFECTIVENESS CHECK RESULTS:			
	JUSTIFICATION FOR THE PLANNED ACTION(S): Per the investigation in Section IV, it was determined that a non destructive visual/dimensional inspection of the SLQ-211610SPT finished goods is appropriate to identify any units that could potentially exhibit nonconforming attributes.			

SECTION VII: CAPA TEAM APPROVAL to CLOSE CAPA – ACTIONS EFFECTIVE

☐ CAPA CLOSED	Comments:
--------------------------------------	------------------

	DOCUMENT TITLE: CAPA Report Form	Revision: A
	DOCUMENT #: FM1-QM.SLQ016	Effective Date: 25Sep2020

CAPA #:001-2025

CAPA TEAM				
	Quality Assurance:	DATE:	R&D/Engineering:	DATE:
	MFG / Operations:	DATE:	Other:	DATE:
	Other:	DATE:	Other:	DATE: