737-600/700/800/900

FAULT ISOLATION MANUAL

Oman Air (SAOC)

This document has EAR data with Export Control Classification Numbers (ECCN) of:
9E991

EXPORT CONTROLLED - This technology or software is subject to the U.S. Export Administration Regulations (EAR), (15 C.F.R. Parts 730-774). No authorization from the U.S. Department of Commerce is required for export, re-export, in-country transfer, or access EXCEPT to country group E:1 or E:2 countries/persons per Supp.1 to Part 740 of the EAR.

BOEING PROPRIETARY

Copyright © 2002 - 2026 The Boeing Company

Boeing claims copyright in each page of this document only to the extent that the page contains copyrightable subject matter. Boeing also claims copyright in this document as a compilation and/or collective work.

This document includes proprietary information owned by The Boeing Company and/or one or more third parties. Treatment of the document and the information it contains is governed by contract with Boeing. For more information, contact The Boeing Company, P.O. Box 3707, Seattle, Washington 98124.

Boeing, the Boeing signature, the Boeing symbol, 707, 717, 727, 737, 737 MAX, 747, 757, 767, 777, 787, Dreamliner, BBJ, DC-8, DC-9, DC-10, KC-10, KC-46, KDC-10, MD-10, MD-11, MD-80, MD-88, MD-90, P-8A, P-8I, Poseidon and the Boeing liveries are all trademarks owned by The Boeing Company; and no trademark license is granted in connection with this document unless provided in writing by Boeing.

DOCUMENT D633A103-OMR

ORIGINAL ISSUE DATE: FEBRUARY 10, 2002
PAGE DATE: Jun 15/2026

This manual is applicable to the aircraft in this list:

Customer / Model Series	Operator		Manufacturer			Registration Number
	Identification Code	Effectivity Code	Block Number	Serial Number	Line Number	
737-71M	OMR	701	YB551	33103	1154	A4O-BO
737-8Q8	OMR	802	YC171	30652	1018	SP-ENR
737-8BK	OMR	805	YJ956	29685	2457	VQ-BDY
737-81M	OMR	807	YJ904	35108	2554	A4O-BU
737-81M	OMR	809	YJ910	35287	2804	SP-ESH
737-8FZ	OMR	810	YF112	29682	2853	TC-TLI
737-8FZ	OMR	812	YF113	29637	3051	4L-GEZ
737-8FZ	OMR	813	YF114	29664	3060	9XR-WY
737-81M	OMR	815	YT177	40067	5152	P2-PXB
737-81M	OMR	816	YT178	40068	5160	PK-GUA
737-81M	OMR	818	YT180	44422	5297	SU-GGB
737-81M	OMR	819	YT181	44423	5310	PK-GUC
737-81M	OMR	820	YT182	60391	6001	A4O-BAA
737-81M	OMR	821	YT183	60392	6035	A4O-BAB
737-81M	OMR	822	YT184	60393	6102	A4O-BAC
737-81M	OMR	823	YT185	60394	6163	A4O-BAE
737-8SH	OMR	824	YW916	41350	6238	CN-RGW
737-8SH	OMR	825	YW917	41351	6274	ET-AZY
737-8SH	OMR	826	YW918	41354	6307	ET-AZZ
737-91MER	OMR	901	YH751	40069	5150	A4O-BI
737-91MER	OMR	902	YH752	44424	5320	A4O-BY
737-91MER	OMR	903	YH753	40070	5395	N903SY
737-91MER	OMR	904	YH754	44425	5419	N904SY
737-91MER	OMR	905	YH755	40071	5639	A4O-BT

EFFECTIVE AIRCRAFT

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Oman Air (SAOC)
OMR
Revision No. 90
Jun 15/2026

To: All holders of this Boeing Document D633A103-OMR

Attached is the current revision to the Boeing 737-600/700/800/900 Fault Isolation Manual.

The Fault Isolation Manual (FIM) is furnished either as a printed manual or as digital products, or a combination of the two. This revision replaces all previous digital products. All products are reissued with all obsolete data deleted and all updated pages added.

For printed manuals, changes are indicated on the List of Effective Pages (LEP). The pages which are revised will be identified on the LEP by an R (Revised), A (Added), O (Overflow, i.e. changes to the document structure and/or page layout), or D (Deleted). The pages that contain customer originated data will be identified on the LEP by a C (COC). Each page in the LEP is identified by Chapter-Section-Subject number, page number and page date.

Pages replaced or made obsolete by this revision should be removed and destroyed.

ATTENTION

IF YOU RECEIVE PRINTED REVISIONS, PLEASE VERIFY THAT YOU HAVE RECEIVED AND FILED THE PREVIOUS REVISION. BOEING MUST BE NOTIFIED WITHIN 30 DAYS IF YOU HAVE NOT RECEIVED THE PREVIOUS REVISION. REQUESTS FOR REVISIONS OTHER THAN THE PREVIOUS REVISION WILL REQUIRE A COMPLETE MANUAL REPRINT SUBJECT TO REPRINT CHARGES SHOWN IN THE DATA AND SERVICES CATALOG.

TRANSMITTAL LETTER

ECCN 9E991 BOEING PROPRIETARY - See title page for details

TEMPORARY REVISIONS

Remove any Temporary Revisions that have a date earlier than the date of this revision.

Do not remove any Temporary Revisions (TRs) that have a date later than the date of this revision. TRs with a later date will be incorporated into the next revision of the manual (unless they are superseded by a subsequent TR).

A TR status report is sent with each TR. The TR status report has a list of all TRs that were sent for this manual during the last two revision cycles. At the top of the list is the date and time that the list was created.

When you have more than one TR, the TR status report with the latest date and time gives you the most current information.

ECCN 9E991 BOEING PROPRIETARY - See title page for details

LOCATION OF CHANGE	DESCRIPTION OF CHANGE
FRONTMATTER	Added information for the "R VALVE OPEN Light for WING ANTI-ICE" faults.
	Changed commercial tool table.
	Changed information for the "WING ANTI-ICE R VALVE OPEN light" faults.
	Changed special tool table.
	Changed standard tool table.
	Changed the list of Service Bulletins.
CHAPTER 21	
21-23 TASK 803	Added 21-23-00-810-803, Main Deck Overboard Exhaust Valve Does Not Operate - Fault Isolation.
21-53 TASK 820	Changed the sequence of the possible causes.
	Added the note for the STCV.
21-53 TASK SUPPORT	Added the note to the STCV block.
CHAPTER 22	
22-13 TASK 807	Changed the format of the steps.
	Changed the part number of the Elevator Autopilot Actuator in the resistance check.
CHAPTER 24	
24-34 TASK 802	Changed the format of the steps.
	Added the note for EEC control light ON and maintenance messages.
CHAPTER 27	Removed maintenance message FLAP sig error.
	Added maintenance message FLAP sig inactive.
27-11 TASK 813	Removed the Circuit Breakers section.
	Removed the instructions for the speedbrake handle and thrust levers from the Initial Evaluation section.
	Changed the word in the procedure from singular to plural.
CHAPTER 30	Changed the data for fault code 301 015 42.
CHAPTER 34	Added maintenance message CONTROL FAIL.
34-46 TASK 801	Changed effectivity from “OMR 701-799, 802, 805, 807, 809, 810, 812, 813 PRE SB 737-34-2617” to “OMR 701-799, 802, 805, 807, 809, 810, 812, 813”
	Changed effectivity from “OMR 815, 816, 818-826, 901-999; OMR 701-799, 802, 805, 807, 809, 810, 812, 813 POST SB 737-34-2617” to “OMR 815, 816, 818-826, 901-999”
	Changed figure effectivity.
34-46 TASK 859	Changed effectivity from “OMR 701-799, 802, 805, 807, 809, 810, 812, 813 PRE SB 737-34-2617” to “OMR 701-799, 802, 805, 807, 809, 810, 812, 813”
34-46 TASK 864	Changed effectivity aircraft information.

HIGHLIGHTS

ECCN 9E991 BOEING PROPRIETARY - See title page for details

LOCATION OF CHANGE	DESCRIPTION OF CHANGE
34-46 TASK 866	Changed effectivity aircraft information.
34-61 TASK 835	Changed effectivity from “OMR 805, 807, 809, 810, 812, 813, 815, 816, 818-826, 901-999; OMR 701-799, 802 ((PRE SB 737-34-2600 AND (((POST SB 737-34-1768 AND PRE SB 737-34-1918) OR PRE SB 737-34-3066 AND ((POST SB 737-34-1918 AND PRE SB 737-34A2216) OR (POST SB 737-34A2216 AND PRE SB 737-34-2252))) OR (POST SB 737-34-2252 AND PRE SB 737-34-2906 AND PRE SB 737-34-3066))) OR PRE SB 737-34-3066 AND (POST SB 737-34-2600 OR POST SB 737-34-2906)) OR POST SB 737-34-3066” to “OMR 805, 807, 809, 810, 812, 813, 815, 816, 818-826, 901-999; OMR 701-799, 802 ((PRE SB 737-34-2600 AND (((POST SB 737-34-1768 AND PRE SB 737-34-1918) OR PRE SB 737-34-3066 AND ((POST SB 737-34-1918 AND PRE SB 737-34A2216) OR (POST SB 737-34A2216 AND PRE SB 737-34-2252))) OR (POST SB 737-34-2252 AND PRE SB 737-34-2906 AND PRE SB 737-34-3066))) OR PRE SB 737-34-3066 AND (POST SB 737-34-2600 OR POST SB 737-34-2906)) OR POST SB 737-34-3066 OR POST SB 737-34-3657”
34-61 TASK 848	Changed effectivity from “OMR 818, 824; OMR 701-799, 802, 805, 807, 809, 810, 812, 813, 815, 816, 819-823, 825, 826, 901-999 POST SB 737-34-3066” to “OMR 701-799, 802, 805, 807, 809, 810, 812, 813, 815, 816, 819-823, 825, 826, 901-999 POST SB 737-34-3066 AND PRE SB 737-34-3657; OMR 818, 824 PRE SB 737-34-3657”
	Changed effectivity from “OMR 818, 824; OMR 701-799, 807 POST SB 737-23-1330 AND POST SB 737-34-3066; OMR 802 POST SB 737-23-1334 AND POST SB 737-34-3066; OMR 805, 809, 810, 812, 813, 815, 816, 819-823, 825, 826, 901-999 POST SB 737-34-3066” to “OMR 701-799, 807 POST SB 737-23-1330 AND POST SB 737-34-3066 AND PRE SB 737-34-3657; OMR 802 POST SB 737-23-1334 AND POST SB 737-34-3066 AND PRE SB 737-34-3657; OMR 805, 809, 810, 812, 813, 815, 816, 819-823, 825, 826, 901-999 POST SB 737-34-3066 AND PRE SB 737-34-3657; OMR 818, 824 PRE SB 737-34-3657”
CHAPTER 49	
49-10 TASK 811	Changed a tool reference.
CHAPTER 71	
F71-06 TASK 807	Changed the format of the steps.
	Changed the steps to do a check of the applicable Engine Anti-Ice Switch with DEU input monitoring.
	Removed the steps to continue.
	Changed the Repair Confirmation.
CHAPTER 73	
F73-22 TASK 803	Changed the format of the steps.
	Added a note for additional engine configurations.
F73-22 TASK 804	Changed effectivity from “OMR 813 POST SB 737-71-2010” to “OMR 813 POST SB 737-71-2010; OMR 820, 821 POST SB 737-71-2066”

HIGHLIGHTS

ECCN 9E991 BOEING PROPRIETARY - See title page for details

LOCATION OF CHANGE	DESCRIPTION OF CHANGE
F73-22 TASK 807	Changed an acronym reference.
F73-31 TASK 803	Changed the voltage value in the Table 203 to 0V.
CHAPTER 75	
F75-34 TASK 808	Changed the format of the step.
	Changed the connector equipment number.
CHAPTER 76	
F76-05 TASK 809	Added the steps for the air/ground relay fault.
CHAPTER 77	
F77-05 TASK 807	Changed the format of the steps.
	Changed the wire harnesses.
CHAPTER 78	
F78-36 TASK 803	Changed the description of FADEC 2 fault to Channel B.
CHAPTER 79	
F79-05 TASK 801	Changed the troubleshooting steps for the oil retention.

HIGHLIGHTS

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Subject/Page	Date	COC
TITLE PAGE		
O 1	Jun 15/2026	
2	BLANK	
EFFECTIVE AIRCRAFT		
1	Feb 15/2026	
2	BLANK	
TRANSMITTAL LETTER		
O 1	Jun 15/2026	
2	Feb 15/2013	
HIGHLIGHTS		
1 thru 3	Jun 15/2026	
4	BLANK	
EFFECTIVE PAGES		
1 thru 4	Jun 15/2026	
EFFECTIVE CHAPTERS		
O 1	Jun 15/2026	
2	BLANK	
REVISION RECORD		
1	Feb 15/2013	
2	Feb 15/2013	
RECORD OF TEMPORARY REVISIONS		
1	Feb 15/2013	
2	Feb 15/2013	
SERVICE BULLETIN LIST		
1	Jun 15/2025	
2	Feb 15/2024	
O 3	Jun 15/2026	
4	Sep 15/2023	
5	Oct 15/2024	
6	Feb 15/2026	
7	Feb 15/2026	
8	Feb 15/2026	
9	Feb 15/2026	
O 10	Jun 15/2026	
O 11	Jun 15/2026	
12	Feb 15/2026	
13	Feb 15/2026	
14	Feb 15/2026	
O 15	Jun 15/2026	
16	Feb 15/2026	

Subject/Page	Date	COC
SERVICE BULLETIN LIST (cont)		
17	Feb 15/2026	
O 18	Jun 15/2026	
19	Feb 15/2026	
20	Feb 15/2026	
21	Oct 15/2025	
22	Oct 15/2025	
23	Oct 15/2025	
24	Oct 15/2025	
25	Oct 15/2025	
26	Oct 15/2025	
27	Oct 15/2025	
O 28	Jun 15/2026	
O 29	Jun 15/2026	
O 30	Jun 15/2026	
O 31	Jun 15/2026	
O 32	Jun 15/2026	
O 33	Jun 15/2026	
O 34	Jun 15/2026	
O 35	Jun 15/2026	
O 36	Jun 15/2026	
O 37	Jun 15/2026	
O 38	Jun 15/2026	
O 39	Jun 15/2026	
O 40	Jun 15/2026	
O 41	Jun 15/2026	
O 42	Jun 15/2026	
O 43	Jun 15/2026	
O 44	Jun 15/2026	
O 45	Jun 15/2026	
O 46	Jun 15/2026	
O 47	Jun 15/2026	
O 48	Jun 15/2026	
O 49	Jun 15/2026	
O 50	Jun 15/2026	
O 51	Jun 15/2026	
O 52	Jun 15/2026	
O 53	Jun 15/2026	
O 54	Jun 15/2026	
O 55	Jun 15/2026	

Subject/Page	Date	COC
SERVICE BULLETIN LIST (cont)		
O 56	Jun 15/2026	
O 57	Jun 15/2026	
O 58	Jun 15/2026	
O 59	Jun 15/2026	
O 60	Jun 15/2026	
O 61	Jun 15/2026	
O 62	Jun 15/2026	
O 63	Jun 15/2026	
O 64	Jun 15/2026	
O 65	Jun 15/2026	
O 66	Jun 15/2026	
O 67	Jun 15/2026	
O 68	Jun 15/2026	
69	Feb 15/2026	
O 70	Jun 15/2026	
O 71	Jun 15/2026	
O 72	Jun 15/2026	
O 73	Jun 15/2026	
O 74	Jun 15/2026	
O 75	Jun 15/2026	
O 76	Jun 15/2026	
O 77	Jun 15/2026	
O 78	Jun 15/2026	
O 79	Jun 15/2026	
O 80	Jun 15/2026	
O 81	Jun 15/2026	
O 82	Jun 15/2026	
O 83	Jun 15/2026	
O 84	Jun 15/2026	
O 85	Jun 15/2026	
O 86	Jun 15/2026	
O 87	Jun 15/2026	
O 88	Jun 15/2026	
O 89	Jun 15/2026	
O 90	Jun 15/2026	
O 91	Jun 15/2026	
O 92	Jun 15/2026	
O 93	Jun 15/2026	
O 94	Jun 15/2026	

A = Added, R = Revised, D = Deleted, O = Overflow, C = Customer Originated Change

EFFECTIVE PAGES

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Subject/Page	Date	COC
SERVICE BULLETIN LIST (cont)		
O 95	Jun 15/2026	
O 96	Jun 15/2026	
O 97	Jun 15/2026	
O 98	Jun 15/2026	
INTRODUCTION		
1	Feb 15/2013	
2	Feb 15/2018	
3	Feb 15/2018	
4	Feb 15/2013	
5	Feb 15/2018	
6	Feb 15/2018	
7	Feb 15/2013	
8	Feb 15/2013	
9	Feb 15/2013	
10	Feb 15/2013	
11	Feb 15/2013	
12	Feb 15/2022	
13	Feb 15/2013	
14	Feb 15/2013	
15	Feb 15/2013	
R 16	Jun 15/2026	
R 17	Jun 15/2026	
O 18	Jun 15/2026	
O 19	Jun 15/2026	
O 20	Jun 15/2026	
O 21	Jun 15/2026	
O 22	Jun 15/2026	
O 23	Jun 15/2026	
O 24	Jun 15/2026	
O 25	Jun 15/2026	
O 26	Jun 15/2026	
O 27	Jun 15/2026	
O 28	Jun 15/2026	
O 29	Jun 15/2026	
O 30	Jun 15/2026	
31	Feb 15/2026	
R 32	Jun 15/2026	
O 33	Jun 15/2026	
O 34	Jun 15/2026	

Subject/Page	Date	COC
INTRODUCTION (cont)		
A 35	Jun 15/2026	
A 36	BLANK	
OBSERVED FAULT LIST - ALPHA		
1	Jun 15/2023	
2	Jun 15/2023	
3	Feb 15/2023	
4	Feb 15/2023	
5	Feb 15/2023	
6	Feb 15/2023	
7	Jun 15/2023	
8	Jun 15/2023	
9	Jun 15/2023	
10	Jun 15/2023	
11	Sep 15/2023	
12	Sep 15/2023	
13	Jun 15/2023	
14	Jun 15/2023	
15	Jun 15/2023	
16	Jun 15/2023	
17	Jun 15/2023	
18	Jun 15/2023	
19	Feb 15/2026	
20	Feb 15/2026	
21	Feb 15/2026	
22	Feb 15/2026	
23	Feb 15/2025	
24	Feb 15/2025	
25	Feb 15/2025	
26	Feb 15/2025	
27	Feb 15/2025	
28	Feb 15/2025	
29	Feb 15/2025	
30	Feb 15/2025	
31	Feb 15/2025	
32	Feb 15/2025	
33	Feb 15/2025	
34	Feb 15/2026	
35	Feb 15/2025	
36	Feb 15/2025	

Subject/Page	Date	COC
OBSERVED FAULT LIST - ALPHA (cont)		
37	Feb 15/2025	
38	Feb 15/2025	
39	Feb 15/2025	
40	Feb 15/2025	
41	Feb 15/2025	
42	Feb 15/2025	
43	Feb 15/2025	
44	Feb 15/2025	
45	Feb 15/2025	
46	Feb 15/2025	
47	Feb 15/2025	
48	Feb 15/2025	
49	Feb 15/2025	
50	Feb 15/2025	
51	Feb 15/2025	
52	Feb 15/2025	
53	Feb 15/2025	
54	Feb 15/2025	
55	Feb 15/2025	
56	Feb 15/2025	
57	Feb 15/2025	
58	Feb 15/2025	
59	Feb 15/2025	
60	Feb 15/2025	
61	Feb 15/2025	
62	Feb 15/2025	
63	Feb 15/2025	
64	Feb 15/2025	
65	Feb 15/2025	
66	Feb 15/2025	
67	Feb 15/2025	
68	Feb 15/2025	
69	Feb 15/2025	
70	Feb 15/2025	
71	Feb 15/2025	
72	Feb 15/2025	
73	Feb 15/2025	
74	Feb 15/2025	

A = Added, R = Revised, D = Deleted, O = Overflow, C = Customer Originated Change

EFFECTIVE PAGES

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Subject/Page	Date	COC
OBSERVED FAULT LIST - ALPHA (cont)		
75	Feb 15/2025	
76	Feb 15/2025	
77	Feb 15/2025	
78	Feb 15/2025	
79	Feb 15/2025	
80	Feb 15/2025	
81	Feb 15/2025	
82	Feb 15/2025	
83	Feb 15/2025	
84	Feb 15/2025	
85	Feb 15/2025	
86	Feb 15/2025	
87	Feb 15/2025	
88	Feb 15/2025	
89	Feb 15/2025	
90	Feb 15/2025	
91	Feb 15/2025	
92	Feb 15/2025	
93	Feb 15/2025	
94	Feb 15/2026	
95	Feb 15/2026	
96	Feb 15/2026	
97	Feb 15/2026	
98	Feb 15/2026	
99	Feb 15/2026	
100	Feb 15/2026	
101	Feb 15/2026	
102	Feb 15/2026	
103	Feb 15/2026	
104	Feb 15/2026	
105	Feb 15/2026	
106	Feb 15/2026	
107	Feb 15/2026	
108	Feb 15/2026	
109	Feb 15/2026	
110	Feb 15/2026	
111	Feb 15/2026	
112	Feb 15/2026	
OBSERVED FAULT LIST - ALPHA (cont)		
113	Feb 15/2026	
114	Feb 15/2026	
115	Feb 15/2026	
116	Feb 15/2026	
117	Feb 15/2026	
118	Feb 15/2026	
119	Feb 15/2026	
120	Feb 15/2026	
121	Feb 15/2026	
122	Feb 15/2026	
123	Feb 15/2026	
124	Feb 15/2026	
125	Feb 15/2026	
126	Feb 15/2026	
127	Feb 15/2026	
128	Feb 15/2026	
129	Feb 15/2026	
130	Feb 15/2026	
131	Feb 15/2026	
132	Feb 15/2026	
133	Feb 15/2026	
134	Feb 15/2026	
135	Feb 15/2026	
136	Feb 15/2026	
137	Feb 15/2026	
138	Feb 15/2026	
139	Feb 15/2026	
140	Feb 15/2026	
OBSERVED FAULT LIST - SYSTEM		
1	Feb 15/2026	
2	Feb 15/2026	
3	Feb 15/2026	
4	Feb 15/2026	
5	Feb 15/2026	
6	Feb 15/2026	
7	Feb 15/2026	
8	Feb 15/2026	
9	Feb 15/2026	
OBSERVED FAULT LIST - SYSTEM (cont)		
10	Feb 15/2026	
11	Feb 15/2026	
12	Feb 15/2026	
13	Feb 15/2026	
14	Feb 15/2026	
15	Feb 15/2026	
16	Feb 15/2026	
17	Feb 15/2026	
18	Feb 15/2026	
19	Feb 15/2026	
20	Feb 15/2026	
21	Feb 15/2026	
22	Feb 15/2026	
23	Feb 15/2026	
24	Feb 15/2026	
25	Feb 15/2026	
26	Feb 15/2026	
27	Feb 15/2026	
28	Feb 15/2026	
29	Feb 15/2026	
30	Feb 15/2026	
31	Jun 15/2023	
32	Feb 15/2024	
33	Feb 15/2024	
34	Jun 15/2023	
35	Sep 15/2023	
36	Jun 15/2023	
37	Jun 15/2023	
38	Oct 15/2023	
39	Jun 15/2023	
40	Feb 15/2023	
41	Oct 15/2023	
42	Feb 15/2023	
43	Feb 15/2023	
44	Feb 15/2023	
45	Feb 15/2023	
R 46	Jun 15/2026	
R 47	Jun 15/2026	

A = Added, R = Revised, D = Deleted, O = Overflow, C = Customer Originated Change

EFFECTIVE PAGES

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Subject/Page	Date	COC
OBSERVED FAULT LIST - SYSTEM (cont)		
48	Feb 15/2023	
49	Feb 15/2023	
50	Oct 15/2025	
51	Oct 15/2025	
52	Oct 15/2025	
53	Oct 15/2025	
54	Oct 15/2025	
55	Oct 15/2025	
56	Oct 15/2025	
57	Oct 15/2025	
58	Oct 15/2025	
59	Oct 15/2025	
60	Oct 15/2025	
61	Oct 15/2025	
62	Oct 15/2025	
63	Oct 15/2025	
64	Oct 15/2025	
65	Oct 15/2025	
66	Oct 15/2025	
67	Oct 15/2025	
68	Oct 15/2025	
69	Oct 15/2025	
70	Oct 15/2025	
71	Oct 15/2025	
72	Oct 15/2025	
73	Oct 15/2025	
74	Oct 15/2025	
75	Oct 15/2025	
76	Oct 15/2025	
77	Oct 15/2025	
78	Oct 15/2025	
79	Oct 15/2025	
80	Oct 15/2025	
81	Feb 15/2026	
82	Feb 15/2026	
83	Feb 15/2026	
84	Feb 15/2026	
85	Oct 15/2025	

Subject/Page	Date	COC
OBSERVED FAULT LIST - SYSTEM (cont)		
86	Oct 15/2025	
87	Oct 15/2025	
88	Oct 15/2025	
89	Oct 15/2025	
90	Oct 15/2025	
91	Oct 15/2025	
92	Oct 15/2025	
93	Oct 15/2025	
94	Oct 15/2025	
95	Oct 15/2025	
96	Oct 15/2025	
97	Oct 15/2025	
98	Oct 15/2025	
99	Oct 15/2025	
100	Oct 15/2025	
101	Oct 15/2025	
102	Oct 15/2025	
103	Oct 15/2025	
104	BLANK	
CABIN FAULT LIST		
1	Jun 15/2017	
2	Oct 15/2020	
3	Feb 15/2013	
4	Feb 15/2013	
5	Oct 15/2019	
6	Feb 15/2013	
7	Feb 15/2013	
8	Feb 15/2013	
9	Feb 15/2013	
10	Feb 15/2013	
11	Feb 15/2013	
12	Feb 15/2013	
13	Feb 15/2013	
14	Jun 15/2014	
15	Jun 15/2014	
16	Feb 15/2013	
17	Feb 15/2013	
18	Feb 15/2013	

Subject/Page	Date	COC
CABIN FAULT LIST (cont)		
19	Feb 15/2013	
20	Feb 15/2020	
21	Feb 15/2013	
22	Feb 15/2013	
CABIN FAULT LOCATOR		
1	Feb 15/2026	
2	Sep 15/2023	
3	Feb 15/2026	
4	Sep 15/2023	
CABIN FAULT CODE INDEX		
101	Sep 15/2023	
102	Sep 15/2023	
103	Sep 15/2023	
104	Sep 15/2023	
105	Sep 15/2023	
106	Sep 15/2023	
107	Sep 15/2023	
108	Sep 15/2023	
109	Sep 15/2023	
110	Sep 15/2023	
111	Sep 15/2023	
112	Sep 15/2023	

A = Added, R = Revised, D = Deleted, O = Overflow, C = Customer Originated Change

EFFECTIVE PAGES

ECCN 9E991 BOEING PROPRIETARY - See title page for details

	Chapter	Date	Title
	05	Feb 15/2026	TIME LIMITS/MAINTENANCE CHECKS
R	21	Jun 15/2026	AIR CONDITIONING
R	22	Jun 15/2026	AUTOFLIGHT
	23	Feb 15/2026	COMMUNICATIONS
R	24	Jun 15/2026	ELECTRICAL POWER
	25	Feb 15/2026	EQUIPMENT/FURNISHINGS
	26	Feb 15/2026	FIRE PROTECTION
R	27	Jun 15/2026	FLIGHT CONTROLS
	28	Feb 15/2026	FUEL
	29	Feb 15/2026	HYDRAULIC POWER
R	30	Jun 15/2026	ICE AND RAIN PROTECTION
	31	Feb 15/2026	INDICATING/RECORDING SYSTEMS
	32	Feb 15/2026	LANDING GEAR
	33	Feb 15/2026	LIGHTS
R	34	Jun 15/2026	NAVIGATION
	35	Feb 15/2026	OXYGEN
	36	Feb 15/2026	PNEUMATIC
	38	Feb 15/2026	WATER/WASTE
	46	Feb 15/2026	INFORMATION SYSTEMS
	47	Feb 15/2026	INERT GAS SYSTEM
R	49	Jun 15/2026	AUXILIARY POWER UNIT
	52	Feb 15/2026	DOORS
	56	Feb 15/2026	WINDOWS
	CFM56 ENGINES (CFM56-7)		
R	71	Jun 15/2026	POWER PLANT
R	73	Jun 15/2026	ENGINE FUEL AND CONTROL
	74	Feb 15/2026	IGNITION
R	75	Jun 15/2026	AIR
R	76	Jun 15/2026	ENGINE CONTROLS
R	77	Jun 15/2026	ENGINE INDICATION
R	78	Jun 15/2026	EXHAUST
R	79	Jun 15/2026	OIL
	80	Feb 15/2026	STARTING

A = Added, R = Revised

EFFECTIVE CHAPTERS

ECCN 9E991 BOEING PROPRIETARY - See title page for details

All revisions to this manual will be accompanied by transmittal sheet bearing the revision number. Enter the revision number in numerical order, together with the revision date, the date filed and the initials of the person filing.

Revision		Filed	
Number	Date	Date	Initials

Revision		Filed	
Number	Date	Date	Initials

All temporary revisions to this manual will be accompanied by a cover sheet bearing the temporary revision number. Enter the temporary revision number in numerical order, together with the temporary revision date, the date the temporary revision is inserted and the initials of the person filing.

When the temporary revision is incorporated or cancelled, and the pages are removed, enter the date the pages are removed and the initials of the person who removed the temporary revision.

Temporary Revision		Inserted		Removed	
Number	Date	Date	Initials	Date	Initials

Temporary Revision		Inserted		Removed	
Number	Date	Date	Initials	Date	Initials

Number	Incorporated	Started/ Completed	ATA	Subject
SB 11-1125	No Effect		-	PLACARDS AND MARKINGS - Exterior Placards and Markings - Application of Exterior Decorative Paint System on Left Side and Right Side Wings
SB 11-1129	No Effect		-	PLACARDS AND MARKINGS - Exterior Placards and Markings - Forward Airstair Decal Installation
SB 11-1129R1	No Effect		-	PLACARDS AND MARKINGS - Exterior Placards and Markings - Forward Airstair Decal Installation
SB 11-1156	No Effect		-	PLACARD AND MARKINGS - Flight Deck - Change Control Column Checklist Placards
SB 11-1156R1	No Effect		-	PLACARD AND MARKINGS - Flight Deck - Change Control Column Checklist Placards
SB 11-1279	No Effect		-	PLACARDS AND MARKINGS - Exterior Placards And Markings - Left And Right Wing Cold Soak Fuel Frost Markings Change
SB 11-1279R1	No Effect		-	PLACARDS AND MARKINGS - Exterior Placards And Markings - Left And Right Wing Cold Soak Fuel Frost Markings Change
SB 11A1109	No Effect		-	PLACARDS AND MARKINGS - Interior Placards - Installation Of In-Flight Speedbrake Usage Limitation Marker
SB 11A1109R1	No Effect		-	PLACARDS AND MARKINGS - Interior Placards - Installation Of In-Flight Speedbrake Usage Limitation Marker
SB 21-1144	No Effect		-	AIR CONDITIONING - Passenger Cabin Conditioned Air Distribution System - Transition Duct Assemblies and Sidewall Riser Ducts Replacement
SB 21-1148	No Effect		-	AIR CONDITIONING - Pack Flow Control and Pack Cooling System - Ram Air Inlet System Components Inspection and Replacement.
SB 21-1148R1	No Effect		-	AIR CONDITIONING - Pack Flow Control and Pack Cooling System - Ram Air Inlet System Components Inspection and Replacement.

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 21-1148R2	No Effect		-	AIR CONDITIONING - Pack Flow Control and Pack Cooling System - Ram Air Inlet System Components Inspection and Replacement.
SB 21-1148R3	No Effect		-	AIR CONDITIONING - Pack Flow Control and Pack Cooling System - Ram Air Inlet System Components Inspection and Replacement.
SB 21-1148R4	No Effect		-	AIR CONDITIONING - Pack Flow Control and Pack Cooling System - Ram Air Inlet System Components Inspection and Replacement.
SB 21-1148R5	No Effect		-	AIR CONDITIONING - Pack Flow Control and Pack Cooling System - Ram Air Inlet System Components Inspection and Replacement.
SB 21-1148R6	No Effect		-	AIR CONDITIONING - Pack Flow Control and Pack Cooling System - Ram Air Inlet System Components Inspection and Replacement.
SB 21-1148R7	No Effect		-	AIR CONDITIONING - Pack Flow Control and Pack Cooling System - Ram Air Inlet System Components Inspection and Replacement.
SB 21-1154R4	JUN 15/2009	S	SECTION 21-75	AIR CONDITIONING - Temperature Control and Cabin Pressure Control Systems - Installation of Pneumatic Air Cleaner System
SB 21-1155	No Effect		-	AIR CONDITIONING - Equipment Cooling System - Equipment Cooling Duct Inspection and Tape Installation to Prevent a Rub Condition
SB 21-1155R1	No Effect		-	AIR CONDITIONING - Equipment Cooling System - Equipment Cooling Duct Inspection and Tape Installation to Prevent a Rub Condition
SB 21-1155R2	No Effect		-	AIR CONDITIONING - Equipment Cooling System - Equipment Cooling Duct Inspection and Tape Installation to Prevent a Rub Condition

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 21-1155R3	No Effect		-	AIR CONDITIONING - Equipment Cooling System - Equipment Cooling Duct Inspection and Tape Installation to Prevent a Rub Condition
SB 21-1155R4	No Effect		-	AIR CONDITIONING - Equipment Cooling System - Equipment Cooling Duct Inspection and Tape Installation to Prevent a Rub Condition
SB 21-1158	No Effect		-	AIR CONDITIONING - Passenger Cabin Conditioned Air Distribution - Change to the Spuds on the Overhead Air Distribution Ducts to Increase Air Flow in the Overhead of the Airplane
SB 21-1158R1	No Effect		-	AIR CONDITIONING - Passenger Cabin Conditioned Air Distribution - Change to the Spuds on the Overhead Air Distribution Ducts to Increase Air Flow in the Overhead of the Airplane
SB 21-1165	MAY 12/2026	S	SECTION 21-33	AIR CONDITIONING - Cabin Pressure Indication and Warning System - Redundant Pressure Switch Installation
SB 21-1165R1	MAY 12/2026	S	SECTION 21-33	AIR CONDITIONING - Cabin Pressure Indication and Warning System - Redundant Pressure Switch Installation
SB 21-1165R2	MAY 12/2026	S	SECTION 21-33	AIR CONDITIONING - Cabin Pressure Indication and Warning System - Redundant Pressure Switch Installation
SB 21-1165R3	MAY 12/2026	S	SECTION 21-33	AIR CONDITIONING - Cabin Pressure Indication and Warning System - Redundant Pressure Switch Installation
SB 21-1165R4	JUN 15/2018	S	SECTION 21-33	AIR CONDITIONING - Cabin Pressure Indication and Warning System - Redundant Pressure Switch Installation
SB 21-1174	No Effect		-	AIR CONDITIONING - Pack Flow Control and Pack Cooling System - Replacement of Shaft Assemblies and Link Arm Assemblies to Increase the Clearance for the Ram Air Inlet Actuators

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 21-1174R1	No Effect		-	AIR CONDITIONING - Pack Flow Control and Pack Cooling System - Replacement of Shaft Assemblies and Link Arm Assemblies to Increase the Clearance for the Ram Air Inlet Actuators
SB 21-1174R2	No Effect		-	AIR CONDITIONING - Pack Flow Control and Pack Cooling System - Replacement of Shaft Assemblies and Link Arm Assemblies to Increase the Clearance for the Ram Air Inlet Actuators
SB 21-1174R3	No Effect		-	AIR CONDITIONING - Pack Flow Control and Pack Cooling System - Replacement of Shaft Assemblies and Link Arm Assemblies to Increase the Clearance for the Ram Air Inlet Actuators
SB 21-1177	No Effect		-	AIR CONDITIONING - Pressurization Control System - Change of the Power Source to the Pressurization System Circuit Breaker
SB 21-1178	No Effect		-	AIR CONDITIONING - Flight Compartment Conditioned Air Distribution - Change of the Ducts and Plenums to Reduce Noise
SB 21-1178R1	No Effect		-	AIR CONDITIONING - Flight Compartment Conditioned Air Distribution - Change of the Ducts and Plenums to Reduce Noise
SB 21-1208	No Effect		-	AIR CONDITIONING - COOLING - Temperature Sensor Installation on the Primary Heat Exchangers Outlet Duct Assembly
SB 21-1208R1	No Effect		-	AIR CONDITIONING - COOLING - Temperature Sensor Installation on the Primary Heat Exchangers Outlet Duct Assembly
SB 21-1208R2	No Effect		-	AIR CONDITIONING - COOLING - Temperature Sensor Installation on the Primary Heat Exchangers Outlet Duct Assembly

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 21-1209	No Effect		-	AIR CONDITIONING - COOLING - Connect Temperature Sensor on the Primary Heat Exchangers Outlet Duct Assembly
SB 21-1209R1	No Effect		-	AIR CONDITIONING - COOLING - Connect Temperature Sensor on the Primary Heat Exchangers Outlet Duct Assembly
SB 21-1209R2	No Effect		-	AIR CONDITIONING - COOLING - Connect Temperature Sensor on the Primary Heat Exchangers Outlet Duct Assembly
SB 21-1225	No Effect		-	AIR CONDITIONING - Passenger Cabin Conditioned Air Distribution - Sidewall Air Distribution Change
SB 21-1263	No Effect		-	AIR CONDITIONING - Flight Compartment Conditioned Air Distribution - Supply Duct Assemblies Straps Replacement
SB 21A1203	No Effect		-	AIR CONDITIONING - Pack Flow Control and Pack Cooling System - Left Temperature Control Valve and Control Cabin Trim Air Modulating Valve Replacement
SB 21A1203R1	No Effect		-	AIR CONDITIONING - Pack Flow Control and Pack Cooling System - Left Temperature Control Valve and Control Cabin Trim Air Modulating Valve Replacement
SB 22-1154	No Effect		-	AUTOFLIGHT - Autopilot - Option/ Program Pin Changes to Activate Flight Control Computer Improvements
SB 22-1154R1	No Effect		-	AUTOFLIGHT - Autopilot - Option/ Program Pin Changes to Activate Flight Control Computer Improvements
SB 22-1213	No Effect		-	AUTOFLIGHT - YAW DAMPER SYSTEM - Deletion of a Yaw Damper Indicator
SB 22-1213R1	No Effect		-	AUTOFLIGHT - YAW DAMPER SYSTEM - Deletion of a Yaw Damper Indicator

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 22-1444	No Effect		-	AUTOFLIGHT - Digital Flight Control System - Change to Enable Flight Director Takeoff Mode Heading Select
SB 22-1464	No Effect		-	AUTOFLIGHT - Digital Flight Control System - Change of Autopilot Operation
SB 22A1215	No Effect		-	AUTOFLIGHT - Autothrottle System - Autothrottle Computer Replacement
SB 22A1224	No Effect		-	AUTOFLIGHT - Digital Flight Control System - Flight Control Computer Software Change
SB 22A1322	No Effect		-	AUTO FLIGHT - Digital Flight Control System - Flight Control Computer Software Change
SB 22A1322R1	No Effect		-	AUTO FLIGHT - Digital Flight Control System - Flight Control Computer Software Change
SB 23-1172	No Effect		-	COMMUNICATIONS - HIGH FREQUENCY (HF) COMMUNICATIONS SYSTEM - HF FERRY FLIGHT KIT INSTALLATION/REMOVAL
SB 23-1172R1	No Effect		-	COMMUNICATIONS - HIGH FREQUENCY (HF) COMMUNICATIONS SYSTEM - HF FERRY FLIGHT KIT INSTALLATION/REMOVAL
SB 23-1172R2	No Effect		-	COMMUNICATIONS - HIGH FREQUENCY (HF) COMMUNICATIONS SYSTEM - HF FERRY FLIGHT KIT INSTALLATION/REMOVAL
SB 23-1330	FEB 15/2024 FEB 15/2024 FEB 15/2024 FEB 15/2024 FEB 15/2024 FEB 15/2024 FEB 15/2024 FEB 15/2024	S	SECTION 23-11 SECTION 23-12 SECTION 23-27 SECTION 31-33 SECTION 31-62 SECTION 34-45 SECTION 34-61 SECTION 49-40	COMMUNICATIONS - Aircraft Communications Addressing and Reporting System - Installation of ACARS Communications Management Unit and Over Aviation Data Link, Airplane Personality Module and Multi-Input Printer; Replacement of Very High Frequency Communications System With New VHF Communications Data Link Mode 2 Capable System

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 23-1330R1	JUN 15/2013 JUN 15/2013 JUN 15/2013 JUN 15/2013 JUN 15/2013 JUN 15/2013 JUN 15/2013 JUN 15/2013	S	SECTION 23-11 SECTION 23-12 SECTION 23-27 SECTION 31-33 SECTION 31-62 SECTION 34-45 SECTION 34-61 SECTION 49-40	COMMUNICATIONS - Aircraft Communications Addressing and Reporting System - Installation of ACARS Communications Management Unit and Over Aviation Data Link, Airplane Personality Module and Multi-Input Printer; Replacement of Very High Frequency Communications System With New VHF Communications Data Link Mode 2 Capable System
SB 23-1334	OCT 15/2010 OCT 15/2010 OCT 15/2010 OCT 15/2010 OCT 15/2010 OCT 15/2010 OCT 15/2010	S	SECTION 23-11 SECTION 23-27 SECTION 31-33 SECTION 31-62 SECTION 34-45 SECTION 34-61 SECTION 49-40	COMMUNICATIONS - Aircraft Communications Addressing and Reporting System - Installation of Communications Management Unit, Airplane Personality Module and Multi-Input Printer; Replacement of Very High Frequency Communications System With New VHF Communications Data Link Mode 2 Capable System
SB 23-1334R1	JUN 15/2013 JUN 15/2013 JUN 15/2013 JUN 15/2013 JUN 15/2013 JUN 15/2013 JUN 15/2013	S	SECTION 23-11 SECTION 23-27 SECTION 31-33 SECTION 31-62 SECTION 34-45 SECTION 34-61 SECTION 49-40	COMMUNICATIONS - Aircraft Communications Addressing and Reporting System - Installation of Communications Management Unit, Airplane Personality Module and Multi-Input Printer; Replacement of Very High Frequency Communications System With New VHF Communications Data Link Mode 2 Capable System
SB 23-1592	No Effect		-	COMMUNICATIONS - High Frequency (HF) Communication System - Activate Dual HF Data Link
SB 23-1605R10	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R11	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R12	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 23-1605R13	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R14	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R15	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R16	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R17	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R18	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R19	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R20	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R21	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R22	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R23	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R24	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R25	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R26	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 23-1605R27	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R28	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R29	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R30	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R31	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R32	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R33	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R34	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R4	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R5	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R6	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R7	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R8	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation
SB 23-1605R9	No Effect		-	COMMUNICATIONS - Low Frequency Underwater Locator Device (LF-ULD) - Installation

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 23-1658	No Effect		-	COMMUNICATIONS - Passenger Address System - Passenger Address System Wiring Change
SB 23-1658R1	No Effect		-	COMMUNICATIONS - Passenger Address System - Passenger Address System Wiring Change
SB 23-1658R2	No Effect		-	COMMUNICATIONS - Passenger Address System - Passenger Address System Wiring Change
SB 23-1659R1	No Effect		-	COMMUNICATIONS - Passenger Address System - Passenger Address System Wiring Change
SB 23-1882	No Effect		-	COMMUNICATIONS - Cabin Interphone System - Forward Attendant Handset Replacement
SB 24-1147	MAY 12/2026 MAY 12/2026	S	SECTION 30-71 SECTION 38-10	ELECTRICAL POWER - Electrical Load Distribution - Installation of the Inflight Entertainment System Circuit Breaker, Relays and Wiring
SB 24-1147R1	MAY 12/2026 MAY 12/2026	S	SECTION 30-71 SECTION 38-10	ELECTRICAL POWER - Electrical Load Distribution - Installation of the Inflight Entertainment System Circuit Breaker, Relays and Wiring
SB 24-1147R2	MAY 12/2026 MAY 12/2026	S	SECTION 30-71 SECTION 38-10	ELECTRICAL POWER - Electrical Load Distribution - Installation of the Inflight Entertainment System Circuit Breaker, Relays and Wiring
SB 24-1147R3	MAY 12/2026 MAY 12/2026	S	SECTION 30-71 SECTION 38-10	ELECTRICAL POWER - Electrical Load Distribution - Installation of the Inflight Entertainment System Circuit Breaker, Relays and Wiring
SB 24-1149	No Effect		-	ELECTRICAL POWER - General - Corrosion Protection of the Electrical Connectors in the Main Wheel Well
SB 24-1149R1	No Effect		-	ELECTRICAL POWER - General - Corrosion Protection of the Electrical Connectors in the Main Wheel Well
SB 24-1149R2	No Effect		-	ELECTRICAL POWER - General - Corrosion Protection of the Electrical Connectors in the Main Wheel Well

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 24-1149R3	No Effect		-	ELECTRICAL POWER - General - Corrosion Protection of the Electrical Connectors in the Main Wheel Well
SB 24-1149R4	No Effect		-	ELECTRICAL POWER - General - Corrosion Protection of the Electrical Connectors in the Main Wheel Well
SB 24-1149R5	No Effect		-	ELECTRICAL POWER - General - Corrosion Protection of the Electrical Connectors in the Main Wheel Well
SB 24-1154	No Effect		-	ELECTRICAL POWER - P6 Circuit Breaker Panel - Guard Installation for the Circuit Breakers for the Overwing Door Flight Locks
SB 24-1155	No Effect		-	ELECTRICAL POWER - Standby Power Control Unit (SPCU) Tray Brace And Tray Stiffener Assembly Installation
SB 24-1155R1	No Effect		-	ELECTRICAL POWER - Standby Power Control Unit (SPCU) Tray Brace And Tray Stiffener Assembly Installation
SB 24-1155R2	No Effect		-	ELECTRICAL POWER - Standby Power Control Unit (SPCU) Tray Brace And Tray Stiffener Assembly Installation
SB 24-1155R3	No Effect		-	ELECTRICAL POWER - Standby Power Control Unit (SPCU) Tray Brace And Tray Stiffener Assembly Installation
SB 24-1159	No Effect		-	ELECTRICAL POWER - Electrical Load Distribution - Change of the In Flight Entertainment Audio System Wiring
SB 24-1159R1	No Effect		-	ELECTRICAL POWER - Electrical Load Distribution - Change of the In Flight Entertainment Audio System Wiring
SB 24-1161	No Effect		-	ELECTRICAL POWER - Electrical Load Distribution - Installation of Protection Guards on the P6 and P18 Load Control Panels

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 24-1161R1	No Effect		-	ELECTRICAL POWER - Electrical Load Distribution - Installation of Protection Guards on the P6 and P18 Load Control Panels
SB 24-1161R2	No Effect		-	ELECTRICAL POWER - Electrical Load Distribution - Installation of Protection Guards on the P6 and P18 Load Control Panels
SB 24-1165	No Effect		-	ELECTRICAL POWER - Standby Power System - Removal and Replacement of the Static Inverter Module
SB 24-1165R1	No Effect		-	ELECTRICAL POWER - Standby Power System - Removal and Replacement of the Static Inverter Module
SB 24-1165R2	No Effect		-	ELECTRICAL POWER - Standby Power System - Removal and Replacement of the Static Inverter Module
SB 24-1165R3	No Effect		-	ELECTRICAL POWER - Standby Power System - Removal and Replacement of the Static Inverter Module
SB 24-1167	No Effect		-	ELECTRICAL POWER - General - Replacement of Antiskid System Electrical Connectors in the Main Wheel Wells
SB 24-1167R1	No Effect		-	ELECTRICAL POWER - General - Replacement of Antiskid System Electrical Connectors in the Main Wheel Wells
SB 24-1171	No Effect		-	ELECTRICAL POWER - Electrical Load Distribution - Inspection, Repair and Installation of Protective Sleeve on Wire Bundle W0018 in the Flight Compartment
SB 24-1171R1	No Effect		-	ELECTRICAL POWER - Electrical Load Distribution - Inspection, Repair and Installation of Protective Sleeve on Wire Bundle W0018 in the Flight Compartment

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 24-1171R2	No Effect		-	ELECTRICAL POWER - Electrical Load Distribution - Inspection, Repair and Installation of Protective Sleeve on Wire Bundle W0018 in the Flight Compartment
SB 24-1171R3	No Effect		-	ELECTRICAL POWER - Electrical Load Distribution - Inspection, Repair and Installation of Protective Sleeve on Wire Bundle W0018 in the Flight Compartment
SB 24-1171R4	No Effect		-	ELECTRICAL POWER - Electrical Load Distribution - Inspection, Repair and Installation of Protective Sleeve on Wire Bundle W0018 in the Flight Compartment
SB 24-1172	No Effect		-	ELECTRICAL - Electrical Power - Inspection and Repair of Electrical Bonding Resistance at the Wing-To-Body Feed Through Receptacles
SB 24-1172R1	No Effect		-	ELECTRICAL - Electrical Power - Inspection and Repair of Electrical Bonding Resistance at the Wing-To-Body Feed Through Receptacles
SB 24-1172R2	No Effect		-	ELECTRICAL - Electrical Power - Inspection and Repair of Electrical Bonding Resistance at the Wing-To-Body Feed Through Receptacles
SB 24-1173	No Effect		-	ELECTRICAL - Electrical Power - Replacement of Wire Support Bracket and Inspection of the Rod End Plates on the Rudder Feel and Centering Unit
SB 24-1173R1	No Effect		-	ELECTRICAL - Electrical Power - Replacement of Wire Support Bracket and Inspection of the Rod End Plates on the Rudder Feel and Centering Unit
SB 24-1173R2	No Effect		-	ELECTRICAL - Electrical Power - Replacement of Wire Support Bracket and Inspection of the Rod End Plates on the Rudder Feel and Centering Unit

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 24-1176	No Effect		-	ELECTRICAL POWER - AC Generation System - Inspection and Re-Pin Wires at Two Wing-To-Strut Electrical Connectors at Each Engine Strut Bracket
SB 24-1176R1	No Effect		-	ELECTRICAL POWER - AC Generation System - Inspection and Re-Pin Wires at Two Wing-To-Strut Electrical Connectors at Each Engine Strut Bracket
SB 24-1176R2	No Effect		-	ELECTRICAL POWER - AC Generation System - Inspection and Re-Pin Wires at Two Wing-To-Strut Electrical Connectors at Each Engine Strut Bracket
SB 24-1176R3	No Effect		-	ELECTRICAL POWER - AC Generation System - Inspection and Re-Pin Wires at Two Wing-To-Strut Electrical Connectors at Each Engine Strut Bracket
SB 24-1198	No Effect		-	ELECTRICAL POWER - AC External Power - Change of the External Power Receptacle
SB 24-1198R1	No Effect		-	ELECTRICAL POWER - AC External Power - Change of the External Power Receptacle
SB 24-1203	No Effect		-	ELECTRICAL POWER - AC External Power - Change of the External Power Receptacle Contacts
SB 24-1203R1	No Effect		-	ELECTRICAL POWER - AC External Power - Change of the External Power Receptacle Contacts
SB 24-1205	No Effect		-	ELECTRICAL POWER - Standby Power System - Replacement of the M9 Static Inverter Terminal Lugs
SB 24-1205R1	No Effect		-	ELECTRICAL POWER - Standby Power System - Replacement of the M9 Static Inverter Terminal Lugs
SB 24-1205R2	No Effect		-	ELECTRICAL POWER - Standby Power System - Replacement of the M9 Static Inverter Terminal Lugs

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 24-1269	No Effect		-	ELECTRICAL POWER - Electrical Power - Change of the Main Deck Cargo Door Circuit Breakers Power Source and Replacement of the Main Deck Cargo Door Circuit Breaker
SB 24-1269R1	No Effect		-	ELECTRICAL POWER - Electrical Power - Change of the Main Deck Cargo Door Circuit Breakers Power Source and Replacement of the Main Deck Cargo Door Circuit Breaker
SB 24A1148	No Effect		-	ELECTRICAL POWER - General - Corrosion Protection of the Electrical Connectors in the Main Wheel Well
SB 24A1148R1	No Effect		-	ELECTRICAL POWER - General - Corrosion Protection of the Electrical Connectors in the Main Wheel Well
SB 24A1148R2	No Effect		-	ELECTRICAL POWER - General - Corrosion Protection of the Electrical Connectors in the Main Wheel Well
SB 24A1148R3	No Effect		-	ELECTRICAL POWER - General - Corrosion Protection of the Electrical Connectors in the Main Wheel Well
SB 24A1150	No Effect		-	ELECTRICAL POWER - AC Electrical Load Distribution - Inspection of the Power Supply Voltage to the Captain's Pitot Heaters
SB 25-1475	No Effect		-	EQUIPMENT AND FURNISHINGS - Door-Mounted Escape System - Replace Trigger Housing on Slide Regulator Valve
SB 25-1491	No Effect		-	EQUIPMENT/FURNISHINGS - Emergency - Door Mounted Escape System - Change Evacuation Slide Inflation Valve Regulator
SB 25-1491R1	No Effect		-	EQUIPMENT/FURNISHINGS - Emergency - Door Mounted Escape System - Change Evacuation Slide Inflation Valve Regulator
SB 25-1493	No Effect		-	EQUIPMENT/FURNISHINGS - Insulation Blanket - Moisture Reduction of Insulation Blankets at the Automatic Overwing Exit Doors

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 25-1493R1	No Effect		-	EQUIPMENT/FURNISHINGS - Insulation Blanket - Moisture Reduction of Insulation Blankets at the Automatic Overwing Exit Doors
SB 25-1543	No Effect		-	EQUIPMENT / FURNISHINGS - Flight Compartment and Forward Cargo Compartment - Flight Deck Noise Reduction Change
SB 25-1544	No Effect		-	EQUIPMENT/FURNISHING - Passenger Cabin Partitions and Compartments - Support Fitting Assembly Air Conditioning Extrusions Replacement
SB 25-1544R1	No Effect		-	EQUIPMENT/FURNISHING - Passenger Cabin Partitions and Compartments - Support Fitting Assembly Air Conditioning Extrusions Replacement
SB 25-1544R2	No Effect		-	EQUIPMENT/FURNISHING - Passenger Cabin Partitions and Compartments - Support Fitting Assembly Air Conditioning Extrusions Replacement
SB 25-1544R3	No Effect		-	EQUIPMENT/FURNISHING - Passenger Cabin Partitions and Compartments - Support Fitting Assembly Air Conditioning Extrusions Replacement
SB 25-1545	No Effect		-	EQUIPMENT AND FURNISHINGS - Passenger Compartment - Modification Of The Oxygen Activation Mechanism Within The Passenger Service Units
SB 25-1545R1	No Effect		-	EQUIPMENT AND FURNISHINGS - Passenger Compartment - Modification Of The Oxygen Activation Mechanism Within The Passenger Service Units
SB 25-1545R2	No Effect		-	EQUIPMENT AND FURNISHINGS - Passenger Compartment - Modification Of The Oxygen Activation Mechanism Within The Passenger Service Units
SB 25-1593	No Effect		-	EQUIPMENT/FURNISHINGS - Passenger Cabin Partitions And Compartments - Install Overhead Stowage Bin Durability Patch

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 25-1602	No Effect		-	EQUIPMENT/FURNISHINGS - Automatic Overwing Exit Door Surround Structure - Change Upper and Lower Door Sills
SB 25-1602R1	No Effect		-	EQUIPMENT/FURNISHINGS - Automatic Overwing Exit Door Surround Structure - Change Upper and Lower Door Sills
SB 25-1606	No Effect		-	EQUIPMENT/FURNISHINGS - Flight Compartment - Flight Library Stowage Unit Installation
SB 25-1612	No Effect		-	EQUIPMENT/FURNISHINGS - Detachable Emergency Equipment - 46 Person Life Raft Location Change
SB 25-1617	No Effect		-	EQUIPMENT / FURNISHINGS - Flight Compartment - Cup Holders Installation Change
SB 25-1617R1	No Effect		-	EQUIPMENT / FURNISHINGS - Flight Compartment - Cup Holders Installation Change
SB 25-1617R2	No Effect		-	EQUIPMENT / FURNISHINGS - Flight Compartment - Cup Holders Installation Change
SB 25-1641	No Effect		-	EQUIPMENT / FURNISHINGS - Passenger Cabin Partitions And Compartments - Center Overhead Stowage Box with Life Raft or Life Raft Provisions - 9G Tie Rod Attachment Change
SB 25-1641R1	No Effect		-	EQUIPMENT / FURNISHINGS - Passenger Cabin Partitions And Compartments - Center Overhead Stowage Box with Life Raft or Life Raft Provisions - 9G Tie Rod Attachment Change
SB 25-1641R2	No Effect		-	EQUIPMENT / FURNISHINGS - Passenger Cabin Partitions And Compartments - Center Overhead Stowage Box with Life Raft or Life Raft Provisions - 9G Tie Rod Attachment Change

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 25-1641R3	No Effect		-	EQUIPMENT / FURNISHINGS - Passenger Cabin Partitions And Compartments - Center Overhead Stowage Box with Life Raft or Life Raft Provisions - 9G Tie Rod Attachment Change
SB 25-1660	No Effect		-	Equipment/Furnishings- Electrical Equipment Rack Moisture Shroud - Change
SB 25-1660R1	No Effect		-	Equipment/Furnishings- Electrical Equipment Rack Moisture Shroud - Change
SB 25-1663R3	No Effect		-	EQUIPMENT/FURNISHINGS - Window Shade and Reveal Assembly - Boeing Sky Interior Automatic Overwing Exit Door Window Shade, Reveal Assembly, and Insulation Blanket Replacement
SB 25-1689	MAY 12/2026	S	SECTION 33-20	EQUIPMENT / FURNISHINGS - Lavatories - Modular Lavatory A - Replace Lavatory A Threshold Light With Strike Plate
SB 25-1689R1	MAY 12/2026	S	SECTION 33-20	EQUIPMENT / FURNISHINGS - Lavatories - Modular Lavatory A - Replace Lavatory A Threshold Light With Strike Plate
SB 25-1689R2	MAY 12/2026	S	SECTION 33-20	EQUIPMENT / FURNISHINGS - Lavatories - Modular Lavatory A - Replace Lavatory A Threshold Light With Strike Plate
SB 25-1689R3	MAY 12/2026	S	SECTION 33-20	EQUIPMENT / FURNISHINGS - Lavatories - Modular Lavatory A - Replace Lavatory A Threshold Light With Strike Plate
SB 25-1707	No Effect		-	EQUIPMENT/FURNISHINGS - Passenger Compartment - Service Units - Passenger Service Unit (PSU) and Life Vest Panel Modification
SB 25-1707R1	No Effect		-	EQUIPMENT/FURNISHINGS - Passenger Compartment - Service Units - Passenger Service Unit (PSU) and Life Vest Panel Modification

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 25-1707R2	No Effect		-	EQUIPMENT/FURNISHINGS - Passenger Compartment - Service Units - Passenger Service Unit (PSU) and Life Vest Panel Modification
SB 25-1709	No Effect		-	EQUIPMENT/FURNISHINGS - Passenger Compartment - Automatic Overwing Exit Door - Door Lining with Rigid Shade - Installation
SB 25-1709R1	No Effect		-	EQUIPMENT/FURNISHINGS - Passenger Compartment - Automatic Overwing Exit Door - Door Lining with Rigid Shade - Installation
SB 25-1713	No Effect		-	EQUIPMENT / FURNISHINGS - Flight Compartment - Forward Instrument Panel Foot Guards Installation
SB 25-1720	No Effect		-	EQUIPMENT/FURNISHINGS - Flight Compartment - Second Observer Seat Structure Inspection
SB 25-1790	No Effect		-	EQUIPMENT/FURNISHINGS - Flight Compartment Equipment - First Observer's Seat Cup Holder - Change
SB 25-1791	No Effect		-	EQUIPMENT/FURNISHINGS - Flight Compartment Equipment - First Observer's Seat Cup Holder - Change
SB 25-1797	No Effect		-	EQUIPMENT/FURNISHINGS - Flight Compartment - Floor Surface Finish Change and Pilot's Seat Position Placard Replacement
SB 25-1808	No Effect		-	EQUIPMENT/FURNISHINGS - Flight Compartment - P9 Forward Electronics Panel and Control Stand Bulb Seal Installation
SB 25-1825	No Effect		-	EQUIPMENT/FURNISHINGS - Electrical Equipment Rack Moisture Shroud - E5 Electronic Equipment Rack Moisture Shroud Replacement
SB 25-1825R1	No Effect		-	EQUIPMENT/FURNISHINGS - Electrical Equipment Rack Moisture Shroud - E5 Electronic Equipment Rack Moisture Shroud Replacement
SB 25-1831	No Effect		-	EQUIPMENT/FURNISHINGS - Passenger Compartment - Mid Exit Door Head Strike Pads Replacement

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 25-1851	No Effect		-	EQUIPMENT / FURNISHINGS - Passenger Compartment - Passenger Service Unit-Mounted Video Monitor Secondary Retention Lanyards Installation
SB 25-1851R1	No Effect		-	EQUIPMENT / FURNISHINGS - Passenger Compartment - Passenger Service Unit-Mounted Video Monitor Secondary Retention Lanyards Installation
SB 25-1854	No Effect		-	EQUIPMENT/FURNISHINGS - Flight Compartment Panels - Aft Ceiling Panel Hook and Loop Tape Replacement
SB 25-1854R1	No Effect		-	EQUIPMENT/FURNISHINGS - Flight Compartment Panels - Aft Ceiling Panel Hook and Loop Tape Replacement
SB 25-1855	No Effect		-	EQUIPMENT / FURNISHINGS - Door-Mounted Escape System - Escape Slide Assembly Inspection and Replacement
SB 25-1855R1	No Effect		-	EQUIPMENT / FURNISHINGS - Door-Mounted Escape System - Escape Slide Assembly Inspection and Replacement
SB 25-1858	No Effect		-	EQUIPMENT / FURNISHINGS - Passenger Compartment - Passenger Service Unit-Mounted Video Monitor Secondary Retention Lanyards Installation
SB 25-1858R1	No Effect		-	EQUIPMENT / FURNISHINGS - Passenger Compartment - Passenger Service Unit-Mounted Video Monitor Secondary Retention Lanyards Installation
SB 25-1887	No Effect		-	EQUIPMENT / FURNISHINGS - Passenger Compartment - Air Conditioning Rail Expansion Slip Joint Spacers Replacement

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 25A1544R4	No Effect		-	EQUIPMENT/FURNISHING - Passenger Cabin Partitions and Compartments - Support Fitting Assembly Air Conditioning Extrusions Replacement
SB 25A1626	No Effect		-	For ACO 8214-25. EQUIPMENT/FURNISHINGS - Electrical Equipment Rack Moisture Shroud - Liquid Contamination Protection Improvements On the E5 Electronic Rack Dripshield Equipment
SB 25A1732	No Effect		-	EQUIPMENT / FURNISHINGS - Flight Compartment - Captain's and First Officer's Rudder Pedal Heel Rest Cover Assembly Fastener Torque Check
SB 25A1732R1	No Effect		-	EQUIPMENT / FURNISHINGS - Flight Compartment - Captain's and First Officer's Rudder Pedal Heel Rest Cover Assembly Fastener Torque Check
SB 25A1732R2	No Effect		-	EQUIPMENT / FURNISHINGS - Flight Compartment - Captain's and First Officer's Rudder Pedal Heel Rest Cover Assembly Fastener Torque Check
SB 26-1112	No Effect		-	FIRE PROTECTION - Detection - Corrosion Protection of the Fenwal Connectors in the Main Wheel Well
SB 26-1112R1	No Effect		-	FIRE PROTECTION - Detection - Corrosion Protection of the Fenwal Connectors in the Main Wheel Well
SB 26-1121	No Effect		-	FIRE PROTECTION - Lower Cargo Compartment Smoke Detection - Installation of Forward Cargo Compartment Smoke Penetration Sealing Provisions
SB 26-1121R1	No Effect		-	FIRE PROTECTION - Lower Cargo Compartment Smoke Detection - Installation of Forward Cargo Compartment Smoke Penetration Sealing Provisions

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 26-1121R2	No Effect		-	FIRE PROTECTION - Lower Cargo Compartment Smoke Detection - Installation of Forward Cargo Compartment Smoke Penetration Sealing Provisions
SB 26-1121R3	APR 11/2019	C	CHAPTER 26	FIRE PROTECTION - Lower Cargo Compartment Smoke Detection - Installation of Forward Cargo Compartment Smoke Penetration Sealing Provisions
SB 26-1122	No Effect		-	FIRE PROTECTION - Lower Cargo Compartment Smoke Detection - Forward Cargo Compartment Smoke Penetration Electrical Changes
SB 26-1122R1	No Effect		-	FIRE PROTECTION - Lower Cargo Compartment Smoke Detection - Forward Cargo Compartment Smoke Penetration Electrical Changes
SB 26-1122R2	MAR 07/2017	C	CHAPTER 26	FIRE PROTECTION - Lower Cargo Compartment Smoke Detection - Forward Cargo Compartment Smoke Penetration Electrical Changes
SB 26-1123	No Effect		-	FIRE PROTECTION - Engine Fire Detection - Replacement of the Left and/or Right Engine Core Fire Detection Loop A and/or Loop B Harnesses
SB 26-1123R1	No Effect		-	FIRE PROTECTION - Engine Fire Detection - Replacement of the Left and/or Right Engine Core Fire Detection Loop A and/or Loop B Harnesses
SB 26-1123R10	No Effect		-	FIRE PROTECTION - Engine Fire Detection - Replacement of the Left and/or Right Engine Core Fire Detection Loop A and/or Loop B Harnesses
SB 26-1123R11	No Effect		-	FIRE PROTECTION - Engine Fire Detection - Replacement of the Left and/or Right Engine Core Fire Detection Loop A and/or Loop B Harnesses

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 26-1123R2	No Effect		-	FIRE PROTECTION - Engine Fire Detection - Replacement of the Left and/or Right Engine Core Fire Detection Loop A and/or Loop B Harnesses
SB 26-1123R3	No Effect		-	FIRE PROTECTION - Engine Fire Detection - Replacement of the Left and/or Right Engine Core Fire Detection Loop A and/or Loop B Harnesses
SB 26-1123R4	No Effect		-	FIRE PROTECTION - Engine Fire Detection - Replacement of the Left and/or Right Engine Core Fire Detection Loop A and/or Loop B Harnesses
SB 26-1123R5	No Effect		-	FIRE PROTECTION - Engine Fire Detection - Replacement of the Left and/or Right Engine Core Fire Detection Loop A and/or Loop B Harnesses
SB 26-1123R6	No Effect		-	FIRE PROTECTION - Engine Fire Detection - Replacement of the Left and/or Right Engine Core Fire Detection Loop A and/or Loop B Harnesses
SB 26-1123R7	No Effect		-	FIRE PROTECTION - Engine Fire Detection - Replacement of the Left and/or Right Engine Core Fire Detection Loop A and/or Loop B Harnesses
SB 26-1123R8	No Effect		-	FIRE PROTECTION - Engine Fire Detection - Replacement of the Left and/or Right Engine Core Fire Detection Loop A and/or Loop B Harnesses
SB 26-1123R9	No Effect		-	FIRE PROTECTION - Engine Fire Detection - Replacement of the Left and/or Right Engine Core Fire Detection Loop A and/or Loop B Harnesses
SB 26-1124	No Effect		-	FIRE PROTECTION - Wheel Well, Wing, and Lower Aft Body Overheat Detection System - Main Wheel Well Connector Corrosion Prevention

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 26-1131	No Effect		-	FIRE PROTECTION - Wheel Well, Wing, and Lower Aft Body Overheat Detection System - Duct Leak Overheat Detector Support Installation
SB 26-1131R1	No Effect		-	FIRE PROTECTION - Wheel Well, Wing, and Lower Aft Body Overheat Detection System - Duct Leak Overheat Detector Support Installation
SB 26-1131R2	No Effect		-	FIRE PROTECTION - Wheel Well, Wing, and Lower Aft Body Overheat Detection System - Duct Leak Overheat Detector Support Installation
SB 26-1142	No Effect		-	FIRE PROTECTION - Engine Fire Detection - Engine Core Fire Detection Harness and Fire Detector Assembly Bracket Installation
SB 26-1142R1	No Effect		-	FIRE PROTECTION - Engine Fire Detection - Engine Core Fire Detection Harness and Fire Detector Assembly Bracket Installation
SB 26A1118	No Effect		-	FIRE PROTECTION - Engine Fire Extinguishing Bottles - Grounds Inspection/Check
SB 26A1118R1	No Effect		-	FIRE PROTECTION - Engine Fire Extinguishing Bottles - Grounds Inspection/Check
SB 26A1122R3	JUN 15/2020	S	SECTION 21-27	FIRE PROTECTION - Lower Cargo Compartment Smoke Detection - Forward Cargo Compartment Smoke Penetration Electrical Changes
SB 26A1137	No Effect		-	FIRE PROTECTION - Cargo Bay Smoke Detection - Equipment Cooling System Smoke Clearance Mode Operational Test for Cargo Smoke Protection
SB 26A1137R1	No Effect		-	FIRE PROTECTION - Cargo Bay Smoke Detection - Equipment Cooling System Smoke Clearance Mode Operational Test for Cargo Smoke Protection

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 26A1137R2	No Effect		-	FIRE PROTECTION - Cargo Bay Smoke Detection - Equipment Cooling System Smoke Clearance Mode Operational Test for Cargo Smoke Protection
SB 27-1242	No Effect		-	FLIGHT CONROLS - Lift Augmenting Leading Edge - Cruise Depressurization Valve Modification
SB 27-1247R1	No Effect		-	FLIGHT CONTROLS - Rudder and Rudder Trim Control System - Wire Provisions for Rudder System Enhancement
SB 27-1247R2	No Effect		-	FLIGHT CONTROLS - Rudder and Rudder Trim Control System - Wire Provisions for Rudder System Enhancement
SB 27-1248	JUN 15/2010	S	SECTION 27-31	FLIGHT CONTROLS - Elevator Pitot-Static System - Turn the Pitot Probe Down
SB 27-1253R1	OCT 10/2006	S	SECTION 27-21	FLIGHT CONTROLS - Rudder and Rudder Trim Control System - Installation of an Enhanced Rudder Control System (RSEP) - Test
SB 27-1253R2	FEB 10/2007	S	SECTION 27-21	FLIGHT CONTROLS - Rudder and Rudder Trim Control System - Installation of an Enhanced Rudder Control System (RSEP) - Test
SB 27-1253R3	JUN 15/2010	S	SECTION 27-21	FLIGHT CONTROLS - Rudder and Rudder Trim Control System - Installation of an Enhanced Rudder Control System (RSEP) - Test
SB 27-1253R4	JUL 01/2010	S	SECTION 27-21	FLIGHT CONTROLS - Rudder and Rudder Trim Control System - Installation of an Enhanced Rudder Control System (RSEP) - Test
SB 27-1254	No Effect		-	FLIGHT CONTROLS - Control Cables - Control Cable Assemblies with Low Zinc Coating - Inspection and Replacement
SB 27-1254R1	No Effect		-	FLIGHT CONTROLS - Control Cables - Control Cable Assemblies with Low Zinc Coating - Inspection and Replacement

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 27-1254R2	No Effect		-	FLIGHT CONTROLS - Control Cables - Control Cable Assemblies with Low Zinc Coating - Inspection and Replacement
SB 27-1262	No Effect		-	FLIGHT CONTROLS - Rudder and Rudder Trim Control System - Replacement of the P5-3 Panel (RSEP)
SB 27-1262R1	No Effect		-	FLIGHT CONTROLS - Rudder and Rudder Trim Control System - Replacement of the P5-3 Panel (RSEP)
SB 27-1273	No Effect		-	FLIGHT CONTROLS - Aileron and Aileron Trim Control System - Aileron Balance Tab Freeplay Check and Lubrication
SB 27-1273R1	No Effect		-	FLIGHT CONTROLS - Aileron and Aileron Trim Control System - Aileron Balance Tab Freeplay Check and Lubrication
SB 27-1273R2	No Effect		-	FLIGHT CONTROLS - Aileron and Aileron Trim Control System - Aileron Balance Tab Freeplay Check and Lubrication
SB 27-1273R3	No Effect		-	FLIGHT CONTROLS - Aileron and Aileron Trim Control System - Aileron Balance Tab Freeplay Check and Lubrication
SB 27-1282	No Effect		-	FLIGHT CONTROLS - Rudder and Rudder Trim Control System - Wire Bundle W443 and Left Forward Rudder Quadrant Clearance Inspection
SB 27-1282R1	No Effect		-	FLIGHT CONTROLS - Rudder and Rudder Trim Control System - Wire Bundle W443 and Left Forward Rudder Quadrant Clearance Inspection
SB 27-1282R2	No Effect		-	FLIGHT CONTROLS - Rudder and Rudder Trim Control System - Wire Bundle W443 and Left Forward Rudder Quadrant Clearance Inspection
SB 27-1284	No Effect		-	FLIGHT CONTROLS - Elevator and Tab - Left and Right Elevator Tab Pushrods Replacement

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 27-1284R1	No Effect		-	FLIGHT CONTROLS - Elevator and Tab - Left and Right Elevator Tab Pushrods Replacement
SB 27-1289	No Effect		-	737 STABILIZER TAKEOFF WARNING SWITCHES - TEST OF THE TAKEOFF WARNING INDICATION
SB 27-1290	JUN 15/2010 JUN 15/2010	S	SECTION 21-51 SECTION 29-20	FLIGHT CONTROLS - Trailing Edge Flap System - Flaps Up and Flap Landing Warning Limit Switch Replacement
SB 27-1290R1	SEP 30/2010 SEP 30/2010	S	SECTION 21-51 SECTION 29-20	FLIGHT CONTROLS - Trailing Edge Flap System - Flaps Up and Flap Landing Warning Limit Switch Replacement
SB 27-1290R2	FEB 15/2012 FEB 15/2012	S	SECTION 21-51 SECTION 29-20	FLIGHT CONTROLS - Trailing Edge Flap System - Flaps Up and Flap Landing Warning Limit Switch Replacement
SB 27-1290R3	APR 10/2012 APR 10/2012	S	SECTION 21-51 SECTION 29-20	FLIGHT CONTROLS - Trailing Edge Flap System - Flaps Up and Flap Landing Warning Limit Switch Replacement
SB 27-1290R4	NOV 28/2012 NOV 28/2012	S	SECTION 21-51 SECTION 29-20	FLIGHT CONTROLS - Trailing Edge Flap System - Flaps Up and Flap Landing Warning Limit Switch Replacement
SB 27-1290R5	NOV 28/2012 NOV 28/2012	S	SECTION 21-51 SECTION 29-20	FLIGHT CONTROLS - Trailing Edge Flap System - Flaps Up and Flap Landing Warning Limit Switch Replacement
SB 27-1291	No Effect		-	LEADING EDGE FLAP AND SLAT CONTROL SYSTEM - Leading Edge Slats - Titanium Proximity Sensor Provisional Installation
SB 27-1291R1	No Effect		-	LEADING EDGE FLAP AND SLAT CONTROL SYSTEM - Leading Edge Slats - Titanium Proximity Sensor Provisional Installation
SB 27-1300	No Effect		-	FLIGHT CONTROLS - Elevator and Tab - Elevator Tab Control Mechanism - Aft Attach Lug Modification

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

	Number	Incorporated	Started/ Completed	ATA	Subject
	SB 27-1300R1	No Effect		-	FLIGHT CONTROLS - Elevator and Tab - Elevator Tab Control Mechanism - Aft Attach Lug Modification
	SB 27-1304	FEB 15/2017 FEB 15/2017	S	SECTION 21-51 SECTION 29-20	FLIGHT CONTROLS - Trailing Edge Flap System - Flaps Up and Flap Landing Warning Limit Switches and Related Wire Bundles - Inspection and Replacement
	SB 27-1304R1	JUN 15/2018 JUN 15/2018	S	SECTION 21-51 SECTION 29-20	FLIGHT CONTROLS - Trailing Edge Flap System - Flaps Up and Flap Landing Warning Limit Switches and Related Wire Bundles - Inspection and Replacement
	SB 27-1316	No Effect		-	FLIGHT CONTROLS - Stall Warning System - Wire Bundle - Ground Wires Inspection and Change
	SB 27-1316R1	No Effect		-	FLIGHT CONTROLS - Stall Warning System - Wire Bundle - Ground Wires Inspection and Change
	SB 27-1316R2	No Effect		-	FLIGHT CONTROLS - Stall Warning System - Wire Bundle - Ground Wires Inspection and Change
A	SB 27-1318R1	No Effect		-	FLIGHT CONTROLS - Horizontal Stabilizer Trim Control System - Wire Bundle Routing Change
A	SB 27-1318R2	No Effect		-	FLIGHT CONTROLS - Horizontal Stabilizer Trim Control System - Wire Bundle Routing Change
	SB 27-1322	No Effect		-	FLIGHT CONTROL - Stall Warning System - Button (Colored Cap) Installation on Stick Shaker Circuit Breakers
	SB 27A1259	No Effect		-	FLIGHT CONTROLS - Rudder Feel and Centering Unit - Inspection and Replacement of Spring Assembly
	SB 27A1259R1	No Effect		-	FLIGHT CONTROLS - Rudder Feel and Centering Unit - Inspection and Replacement of Spring Assembly
	SB 27A1260	No Effect		-	FLIGHT CONTROLS - Flight Controls Hydraulic Modular Package - Replacement of Suspect Discrepant Compensators

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 27A1271	No Effect		-	FLIGHT CONTROLS - Elevator and Tab - Elevator Input Torque Tube - Modification
SB 27A1271R1	No Effect		-	FLIGHT CONTROLS - Elevator and Tab - Elevator Input Torque Tube - Modification
SB 27A1277	No Effect		-	FLIGHT CONTROLS - Horizontal Stabilizer Trim Control System - Ballscrew and Ball Nut Inspection , Lubrication, and Repair/Overhaul
SB 27A1277R1	No Effect		-	FLIGHT CONTROLS - Horizontal Stabilizer Trim Control System - Ballscrew and Ball Nut Inspection , Lubrication, and Repair/Overhaul
SB 27A1277R2	No Effect		-	FLIGHT CONTROLS - Horizontal Stabilizer Trim Control System - Ballscrew and Ball Nut Inspection , Lubrication, and Repair/Overhaul
SB 27A1280	No Effect		-	RUDDER - Rudder and Rudder Trim Control System - Operational Test of the Standby Hydraulic Actuation System and Rudder Main Power Control Unit Force Fight Monitor Test - Test Frequency Change
SB 27A1280R1	No Effect		-	RUDDER - Rudder and Rudder Trim Control System - Operational Test of the Standby Hydraulic Actuation System and Rudder Main Power Control Unit Force Fight Monitor Test - Test Frequency Change
SB 27A1296	No Effect		-	FLIGHT CONTROLS - Elevator Tab Control Mechanism Detailed Inspection
SB 27A1296R1	No Effect		-	FLIGHT CONTROLS - Elevator Tab Control Mechanism Detailed Inspection
SB 27A1297	No Effect		-	FLIGHT CONTROLS - Elevator Tab Control Mechanism Detailed Inspection
SB 27A1297R1	No Effect		-	FLIGHT CONTROLS - Elevator Tab Control Mechanism Detailed Inspection
SB 27A1297R2	No Effect		-	FLIGHT CONTROLS - Elevator Tab Control Mechanism Detailed Inspection

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 27A1299	No Effect		-	FLIGHT CONTROLS - Elevator Tab Control Mechanism Detailed Inspection and Bearing Retainer Installation
SB 27A1299R1	No Effect		-	FLIGHT CONTROLS - Elevator Tab Control Mechanism Detailed Inspection and Bearing Retainer Installation
SB 27A1314	No Effect		-	FLIGHT CONTROLS - Rudder and Rudder Trim Control System - Rudder Pedal Shroud Assemblies and Upper Cover Assemblies Change
SB 27A1314R1	No Effect		-	FLIGHT CONTROLS - Rudder and Rudder Trim Control System - Rudder Pedal Shroud Assemblies and Upper Cover Assemblies Change
SB 27A1314R2	No Effect		-	FLIGHT CONTROLS - Rudder and Rudder Trim Control System - Rudder Pedal Shroud Assemblies and Upper Cover Assemblies Change
SB 27A1330	No Effect		-	FLIGHT CONTROLS - Horizontal Stabilizer Trim Control System - Horizontal Stabilizer Trim Actuator Lower Gimbal Assembly Fastener Inspection and Torque Check
SB 28-1179	MAY 12/2026	S	SECTION 73-06	FUEL - Distribution - PS-2 Fuel System Module Removal and Replacement
SB 28-1179R1	MAY 12/2026	S	SECTION 73-06	FUEL - Distribution - PS-2 Fuel System Module Removal and Replacement
SB 28-1179R2	MAY 12/2026	S	SECTION 73-06	FUEL - Distribution - PS-2 Fuel System Module Removal and Replacement
SB 28-1190	No Effect		-	FUEL - Fuel Quantity Indicating System (FQIS) - Center Fuel Tank Wire Support Bracket Replacement
SB 28-1190R1	No Effect		-	FUEL - Fuel Quantity Indicating System (FQIS) - Center Fuel Tank Wire Support Bracket Replacement
SB 28-1194	MAY 12/2026	S	SECTION 27-32	FUEL - Fuel Boost Pump - Relocation of Connector Pins at Wing/Body Connectors
SB 28-1194R1	MAY 12/2026	S	SECTION 27-32	FUEL - Fuel Boost Pump - Relocation of Connector Pins at Wing/Body Connectors

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 28-1194R2	MAY 12/2026	S	SECTION 27-32	FUEL - Fuel Boost Pump - Relocation of Connector Pins at Wing/Body Connectors
SB 28-1194R3	MAY 12/2026	S	SECTION 27-32	FUEL - Fuel Boost Pump - Relocation of Connector Pins at Wing/Body Connectors
SB 28-1199	No Effect		-	FUEL - Engine Fuel Feed System - Engine Fuel Shutoff Valve Wire and Conduit Assembly Replacement
SB 28-1199R1	No Effect		-	FUEL - Engine Fuel Feed System - Engine Fuel Shutoff Valve Wire and Conduit Assembly Replacement
SB 28-1199R2	No Effect		-	FUEL - Engine Fuel Feed System - Engine Fuel Shutoff Valve Wire and Conduit Assembly Replacement
SB 28-1200	No Effect		-	FUEL - Pressure Fueling System - Inspection for Wire Chafing behind P15 Refuel Panel
SB 28-1200R1	No Effect		-	FUEL - Pressure Fueling System - Inspection for Wire Chafing behind P15 Refuel Panel
SB 28-1209	No Effect		-	FUEL - Indicating - Wing Center Tank Wire Bundles Installation Change
SB 28-1209R1	No Effect		-	FUEL - Indicating - Wing Center Tank Wire Bundles Installation Change
SB 28-1225	No Effect		-	FUEL - Distribution - Engine Fuel Feed System - Inspection/Repair of the Electrical Bond between the Bulkhead Fitting and the Wing Front Spar
SB 28-1225R1	No Effect		-	FUEL - Distribution - Engine Fuel Feed System - Inspection/Repair of the Electrical Bond between the Bulkhead Fitting and the Wing Front Spar
SB 28-1251	No Effect		-	FUEL - Engine Fuel Feed System - Ground Module Inspection and Replacement
SB 28-1251R1	No Effect		-	FUEL - Engine Fuel Feed System - Ground Module Inspection and Replacement
SB 28-1251R2	No Effect		-	FUEL - Engine Fuel Feed System - Ground Module Inspection and Replacement

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 28-1257	No Effect		-	FUEL - Engine Fuel Feed System - Boost Pump Control Relay Ground Location Change
SB 28-1257R1	No Effect		-	FUEL - Engine Fuel Feed System - Boost Pump Control Relay Ground Location Change
SB 28-1272	No Effect		-	FUEL - Engine Fuel Feed System - Main Tanks Engine Fuel Spar Valve Body Replacement
SB 28-1272R1	No Effect		-	FUEL - Engine Fuel Feed System - Main Tanks Engine Fuel Spar Valve Body Replacement
SB 28-1303	No Effect		-	FUEL - General - Left Environmental Control Systems Bay Wire Clamp - Inspection and Replacement
SB 28-1303R1	No Effect		-	FUEL - General - Left Environmental Control Systems Bay Wire Clamp - Inspection and Replacement
SB 28-1312	No Effect		-	FUEL - General - Left and Right Environmental Control Systems Bay Wire Clamp - Inspection and Replacement
SB 28-1312R1	No Effect		-	FUEL - General - Left and Right Environmental Control Systems Bay Wire Clamp - Inspection and Replacement
SB 28-1312R2	No Effect		-	FUEL - General - Left and Right Environmental Control Systems Bay Wire Clamp - Inspection and Replacement
SB 28-1314	No Effect		-	FUEL - Engine Fuel Feed System - Engine Fuel Shutoff Spar Valve Actuator Replacement
SB 28-1327	No Effect		-	FUEL - Water Scavenge Jet Pump - Water Scavenge System Change
SB 28-1327R1	No Effect		-	FUEL - Water Scavenge Jet Pump - Water Scavenge System Change
SB 28-1340	No Effect		-	FUEL - Fuel Quantity Indicating System - Wire Bundle W0422 Wire Replacement

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 28-1340R1	No Effect		-	FUEL - Fuel Quantity Indicating System - Wire Bundle W0422 Wire Replacement
SB 28-1355	AUG 31/2018	S	SECTION 28-41	FUEL - Fuel Quantity Indicating System (FQIS) - Built In Test Equipment Test and Corrective Action
SB 28-1356	No Effect		-	FUEL - Fuel Quantity Indicating System (FQIS) - Center Wing Tank Fuel Quantity Indicating System Wire Inspection and Change
SB 28-1363	No Effect		-	FUEL - Fuel Quantity Indicating System - Fuel Quantity Processor Unit Replacement
SB 28-1371	No Effect		-	FUEL - Engine Fuel Feed System - Fuel Boost Pump Pressure Switches Sealing Boot and Marker Installation
SB 28A1148R1	No Effect		-	ENGINE FUEL FEED SYSTEM - Tank Fuel Boost Pump - Aft Boost Pump Wiring Support Bracket Installation
SB 28A1148R2	No Effect		-	ENGINE FUEL FEED SYSTEM - Tank Fuel Boost Pump - Aft Boost Pump Wiring Support Bracket Installation
SB 28A1148R3	No Effect		-	ENGINE FUEL FEED SYSTEM - Tank Fuel Boost Pump - Aft Boost Pump Wiring Support Bracket Installation
SB 28A1184	No Effect		-	FUEL - Distribution - Fuel Boost and Override Pump Motor - Impeller Replacement
SB 28A1188	No Effect		-	FUEL - Fuel Boost Pump - Aft Fuel Boost Pump Ground Shield Wire Change
SB 28A1188R1	No Effect		-	FUEL - Fuel Boost Pump - Aft Fuel Boost Pump Ground Shield Wire Change
SB 28A1197	No Effect		-	FUEL - Distribution - Fuel Pump Motor-Impeller Inspection
SB 28A1197R1	No Effect		-	FUEL - Distribution - Fuel Pump Motor-Impeller Inspection
SB 28A1197R2	No Effect		-	FUEL - Distribution - Fuel Pump Motor-Impeller Inspection

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 28A1201	JUN 15/2010	S	SECTION 28-22	FUEL - Engine Fuel Feed System - Fuel Pump Control Ground Fault Interrupter (GFI) Relay Installation
SB 28A1201R1	MAY 28/2009	S	SECTION 28-22	FUEL - Engine Fuel Feed System - Fuel Pump Control Ground Fault Interrupter (GFI) Relay Installation
SB 28A1206	JUN 15/2010	S	SECTION 28-22	FUEL - Distribution - Center Fuel Tank Boost Pump Auto Shutoff and Master Caution Logic Change
SB 28A1206R1	OCT 15/2011	S	SECTION 28-22	FUEL - Distribution - Center Fuel Tank Boost Pump Auto Shutoff and Master Caution Logic Change
SB 28A1206R2	OCT 15/2009	S	SECTION 28-22	FUEL - Distribution - Center Fuel Tank Boost Pump Auto Shutoff and Master Caution Logic Change
SB 28A1206R3	OCT 15/2014	S	SECTION 28-22	FUEL - Distribution - Center Fuel Tank Boost Pump Auto Shutoff and Master Caution Logic Change
SB 28A1207	No Effect		-	FUEL - Engine Fuel Feed System - Motor Operated Valve - Actuator Replacement
SB 28A1207R1	No Effect		-	FUEL - Engine Fuel Feed System - Motor Operated Valve - Actuator Replacement
SB 28A1248	No Effect		-	FUEL - Engine Fuel Feed System - Center Fuel Tank, Fuel Pumps - Power Failed ON Protection System (Un-commanded Pump ON) - Relays Installation
SB 28A1248R1	No Effect		-	FUEL - Engine Fuel Feed System - Center Fuel Tank, Fuel Pumps - Power Failed ON Protection System (Un-commanded Pump ON) - Relays Installation
SB 28A1248R2	No Effect		-	FUEL - Engine Fuel Feed System - Center Fuel Tank, Fuel Pumps - Power Failed ON Protection System (Un-commanded Pump ON) - Relays Installation

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 28A1248R3	No Effect		-	FUEL - Engine Fuel Feed System - Center Fuel Tank, Fuel Pumps - Power Failed ON Protection System (Un-commanded Pump ON) - Relays Installation
SB 29-1106	MAY 12/2026 MAY 12/2026	S	SECTION 21-00 SECTION 29-10	HYDRAULIC POWER - Hydraulic Reservoir Pressurization System - Removal of the Reservoir Pressurization Module and Depressurization Valves
SB 29-1106R1	MAY 12/2026 MAY 12/2026	S	SECTION 21-00 SECTION 29-10	HYDRAULIC POWER - Hydraulic Reservoir Pressurization System - Removal of the Reservoir Pressurization Module and Depressurization Valves
SB 29-1106R2	MAY 12/2026 MAY 12/2026	S	SECTION 21-00 SECTION 29-10	HYDRAULIC POWER - Hydraulic Reservoir Pressurization System - Removal of the Reservoir Pressurization Module and Depressurization Valves
SB 29-1106R3	MAY 12/2026 MAY 12/2026	S	SECTION 21-00 SECTION 29-10	HYDRAULIC POWER - Hydraulic Reservoir Pressurization System - Removal of the Reservoir Pressurization Module and Depressurization Valves
SB 29-1106R4	MAY 12/2026 MAY 12/2026	S	SECTION 21-00 SECTION 29-10	HYDRAULIC POWER - Hydraulic Reservoir Pressurization System - Removal of the Reservoir Pressurization Module and Depressurization Valves
SB 29-1106R5	MAY 12/2026 MAY 12/2026	S	SECTION 21-00 SECTION 29-10	HYDRAULIC POWER - Hydraulic Reservoir Pressurization System - Removal of the Reservoir Pressurization Module and Depressurization Valves
SB 29-1106R6	MAY 12/2026 MAY 12/2026	S	SECTION 21-00 SECTION 29-10	HYDRAULIC POWER - Hydraulic Reservoir Pressurization System - Removal of the Reservoir Pressurization Module and Depressurization Valves

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 29-1106R7	MAY 12/2026 MAY 12/2026	S	SECTION 21-00 SECTION 29-10	HYDRAULIC POWER - Hydraulic Reservoir Pressurization System - Removal of the Reservoir Pressurization Module and Depressurization Valves
SB 29-1106R8	MAY 12/2026 MAY 12/2026	S	SECTION 21-00 SECTION 29-10	HYDRAULIC POWER - Hydraulic Reservoir Pressurization System - Removal of the Reservoir Pressurization Module and Depressurization Valves
SB 29-1110	No Effect		-	HYDRAULIC POWER - Hydraulic Reservoir - Overfill Warning Marker Installation
SB 29-1110R1	No Effect		-	HYDRAULIC POWER - Hydraulic Reservoir - Overfill Warning Marker Installation
SB 29-1111	No Effect		-	HYDRAULIC POWER - Hydraulic Systems A and B Engine Driven Pump - Support Bracket Change for the Hydraulic Pressure Hose
SB 29-1113	No Effect		-	HYDRAULIC POWER - Right Main Landing Gear Wheel Well - Wire Bundle and Hydraulic Tubing - Inspection, Repair and New Clamps Installation
SB 29-1113R1	No Effect		-	HYDRAULIC POWER - Right Main Landing Gear Wheel Well - Wire Bundle and Hydraulic Tubing - Inspection, Repair and New Clamps Installation
SB 29-1114	No Effect		-	HYDRAULIC POWER - Main - Hydraulic Systems A and B Pressure Module Check Valve Inspection and Replacement
SB 29-1114R1	No Effect		-	HYDRAULIC POWER - Main - Hydraulic Systems A and B Pressure Module Check Valve Inspection and Replacement
SB 29-1114R2	No Effect		-	HYDRAULIC POWER - Main - Hydraulic Systems A and B Pressure Module Check Valve Inspection and Replacement

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 29-1120	No Effect		-	HYDRAULIC POWER - No.8 Spoiler Hydraulic Pressure Tube Assemblies - Replacement
SB 29-1121	No Effect		-	HYDRAULIC POWER - Hydraulic Systems A and B - Right Main Landing Gear Wheel Well Hydraulic Tube Assemblies Inspection and Replacement
SB 29-1121R1	No Effect		-	HYDRAULIC POWER - Hydraulic Systems A and B - Right Main Landing Gear Wheel Well Hydraulic Tube Assemblies Inspection and Replacement
SB 29-1123	No Effect		-	HYDRAULIC POWER - Hydraulic Systems A and B - Pressure Module Check Valve Inspection and Replacement
SB 29-1123R1	No Effect		-	HYDRAULIC POWER - Hydraulic Systems A and B - Pressure Module Check Valve Inspection and Replacement
SB 29-1128	No Effect		-	HYDRAULIC POWER - Hydraulic Systems A and B - Aileron Power Control Unit Support Assembly and Hydraulic Hose Assembly Inspection and Hose Guard Assembly Installation
SB 29-1128R1	No Effect		-	HYDRAULIC POWER - Hydraulic Systems A and B - Aileron Power Control Unit Support Assembly and Hydraulic Hose Assembly Inspection and Hose Guard Assembly Installation
SB 29-1138	No Effect		-	HYDRAULIC POWER - Standby Hydraulic System - Hydraulic Tube Assembly and Fire Suppression Tube Assembly Clearance Inspection
SB 29A1119	No Effect		-	HYDRAULIC POWER - Hydraulic Systems A and B - Wire Bundles and Hydraulic Tube Clamp Installation
SB 29A1119R1	No Effect		-	HYDRAULIC POWER - Hydraulic Systems A and B - Wire Bundles and Hydraulic Tube Clamp Installation

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 30-1054	No Effect		-	ICE AND RAIN PROTECTION - Windows, Windshields and Doors - Windshield Wiper Motor Converter Replacement
SB 30-1054R1	No Effect		-	ICE AND RAIN PROTECTION - Windows, Windshields and Doors - Windshield Wiper Motor Converter Replacement
SB 30-1056	No Effect		-	ICE AND RAIN PROTECTION - Water and Drain Line Heaters - Change - Gray Water Composite Drain Mast Bonding Jumper Installation
SB 30-1056R1	No Effect		-	ICE AND RAIN PROTECTION - Water and Drain Line Heaters - Change - Gray Water Composite Drain Mast Bonding Jumper Installation
SB 30-1056R2	No Effect		-	ICE AND RAIN PROTECTION - Water and Drain Line Heaters - Change - Gray Water Composite Drain Mast Bonding Jumper Installation
SB 30-1056R3	No Effect		-	ICE AND RAIN PROTECTION - Water and Drain Line Heaters - Change - Gray Water Composite Drain Mast Bonding Jumper Installation
SB 30-1058	No Effect		-	ICE AND RAIN PROTECTION - Control Cabin Window Anti-Icing System - Coil Cord Assembly Replacement on the Number 2 Windows in the Flight Compartment
SB 30-1058R1	No Effect		-	ICE AND RAIN PROTECTION - Control Cabin Window Anti-Icing System - Coil Cord Assembly Replacement on the Number 2 Windows in the Flight Compartment
SB 30-1058R2	No Effect		-	ICE AND RAIN PROTECTION - Control Cabin Window Anti-Icing System - Coil Cord Assembly Replacement on the Number 2 Windows in the Flight Compartment
SB 30-1058R3	No Effect		-	ICE AND RAIN PROTECTION - Control Cabin Window Anti-Icing System - Coil Cord Assembly Replacement on the Number 2 Windows in the Flight Compartment

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 30-1058R4	No Effect		-	ICE AND RAIN PROTECTION - Control Cabin Window Anti-Icing System - Coil Cord Assembly Replacement on the Number 2 Windows in the Flight Compartment
SB 30-1058R5	No Effect		-	ICE AND RAIN PROTECTION - Control Cabin Window Anti-Icing System - Coil Cord Assembly Replacement on the Number 2 Windows in the Flight Compartment
SB 30-1070	No Effect		-	ICE AND RAIN PROTECTION - PITOT AND STATIC - POLARITY STANDARDIZATION TO ADDRESS UN-ANNUNCIATED FAILURE OF PITOT PROBE HEATERS
SB 30-1070R1	No Effect		-	ICE AND RAIN PROTECTION - PITOT AND STATIC - POLARITY STANDARDIZATION TO ADDRESS UN-ANNUNCIATED FAILURE OF PITOT PROBE HEATERS
SB 30-1070R2	No Effect		-	ICE AND RAIN PROTECTION - PITOT AND STATIC - POLARITY STANDARDIZATION TO ADDRESS UN-ANNUNCIATED FAILURE OF PITOT PROBE HEATERS
SB 30-1078	No Effect		-	ICE AND RAIN PROTECTION - Control Cabin Window Anti-Icing System - Number 2 Windows Heat Sensor Wiring Change
SB 30-1078R1	No Effect		-	ICE AND RAIN PROTECTION - Control Cabin Window Anti-Icing System - Number 2 Windows Heat Sensor Wiring Change
SB 30-1078R2	SEP 01/2021	C	CHAPTER 30	ICE AND RAIN PROTECTION - Control Cabin Window Anti-Icing System - Number 2 Windows Heat Sensor Wiring Change
SB 30A1057	No Effect		-	ICE AND RAIN PROTECTION - Windshield Wiper System - Change the Windshield Wiper Motor
SB 30A1057R1	No Effect		-	ICE AND RAIN PROTECTION - Windshield Wiper System - Change the Windshield Wiper Motor

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 30A1057R2	No Effect		-	ICE AND RAIN PROTECTION - Windshield Wiper System - Change the Windshield Wiper Motor
SB 30A1057R3	No Effect		-	ICE AND RAIN PROTECTION - Windshield Wiper System - Change the Windshield Wiper Motor
SB 30A1063	MAY 12/2026	S	SECTION 30-31	ICE AND RAIN PROTECTION - PITOT AND STATIC - Air Data Probe Anti-Icing System - Air Data Probe Heat Automation Installation
SB 30A1063R1	MAY 12/2026	S	SECTION 30-31	ICE AND RAIN PROTECTION - PITOT AND STATIC - Air Data Probe Anti-Icing System - Air Data Probe Heat Automation Installation
SB 30A1063R2	MAY 12/2026	S	SECTION 30-31	ICE AND RAIN PROTECTION - PITOT AND STATIC - Air Data Probe Anti-Icing System - Air Data Probe Heat Automation Installation
SB 31-1205	No Effect		-	INDICATING/RECORDING SYSTEM - Common Display System (CDS) - Operational Program Software (OPS) Upgrade
SB 31-1246	MAY 12/2026	S	SECTION 31-62	INDICATING AND RECORDING SYSTEMS - Common Display System - Display Electronic Unit Operational Program Software Change
SB 31-1284	No Effect		-	INDICATING/RECORDING SYSTEMS - Master Caution - Addition of Quick Disconnects to The Master Caution and Fire Warning Switchlight wires
SB 31-1284R1	No Effect		-	INDICATING/RECORDING SYSTEMS - Master Caution - Addition of Quick Disconnects to The Master Caution and Fire Warning Switchlight wires
SB 31-1284R2	No Effect		-	INDICATING/RECORDING SYSTEMS - Master Caution - Addition of Quick Disconnects to The Master Caution and Fire Warning Switchlight wires
SB 31-1293	No Effect		-	INDICATING/RECORDING SYSTEMS - Common Display System - Updated Phase 3 Display Unit Database Installation

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 31-1295	MAY 12/2026	S	SECTION 31-62	INDICATING AND RECORDING SYSTEMS - Common Display System - Display Electronic Unit Operational Program Software Change
SB 31-1327	MAY 12/2026 MAY 12/2026	S	SECTION 31-62 SECTION 34-21	INDICATING/RECORDING SYSTEMS - Common Display System (CDS) - Change the Operational Program Software (OPS) for the CDS Display Electronic Unit (DEU)
SB 31-1327R1	MAY 12/2026 MAY 12/2026	S	SECTION 31-62 SECTION 34-21	INDICATING/RECORDING SYSTEMS - Common Display System (CDS) - Change the Operational Program Software (OPS) for the CDS Display Electronic Unit (DEU)
SB 31-1449	No Effect		-	INDICATING/RECORDING SYSTEMS - Flight Data Recorder System - Ground Wire Change
SB 31-1449R1	No Effect		-	INDICATING/RECORDING SYSTEMS - Flight Data Recorder System - Ground Wire Change
SB 31-1449R2	No Effect		-	INDICATING/RECORDING SYSTEMS - Flight Data Recorder System - Ground Wire Change
SB 31-1449R3	No Effect		-	INDICATING/RECORDING SYSTEMS - Flight Data Recorder System - Ground Wire Change
SB 31-1471	No Effect		-	INDICATING/RECORDING SYSTEMS - Common Display System - Installation of Phase 3A Display Unit and Database Software
SB 31-1471R1	No Effect		-	INDICATING/RECORDING SYSTEMS - Common Display System - Installation of Phase 3A Display Unit and Database Software
SB 31-1650	OCT 15/2025 OCT 15/2025 OCT 15/2025	S	SECTION 31-62 SECTION 31-63 SECTION 34-21	INDICATING/RECORDING SYSTEMS - Common Display System - Installation of Common Display System Blockpoint 2015 Software
SB 31-1656	No Effect		-	INDICATING/RECORDING SYSTEMS - Wireless Quick Access Recorder - Installation of Provisional Ethernet Wiring between Wireless Quick Access Recorder and the Airborne Data Loader

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 31-2139	No Effect		-	INDICATING/RECORDING SYSTEMS - Common Display System - Change of Optional Features
SB 31-2155	No Effect		-	INDICATING/RECORDING SYSTEMS - Common Display System - Change of Optional Features
SB 31A1332	MAY 12/2026	S	SECTION 21-33	INDICATING / RECORDING SYSTEMS - Aural Warning System - Installation of the Cabin Altitude Warning System and Takeoff Configuration Warning System Lights
SB 31A1332R1	MAY 12/2026	S	SECTION 21-33	INDICATING / RECORDING SYSTEMS - Aural Warning System - Installation of the Cabin Altitude Warning System and Takeoff Configuration Warning System Lights
SB 31A1332R2	MAY 12/2026	S	SECTION 21-33	INDICATING / RECORDING SYSTEMS - Aural Warning System - Installation of the Cabin Altitude Warning System and Takeoff Configuration Warning System Lights
SB 31A1332R3	MAY 12/2026	S	SECTION 21-33	INDICATING / RECORDING SYSTEMS - Aural Warning System - Installation of the Cabin Altitude Warning System and Takeoff Configuration Warning System Lights
SB 31A1332R4	MAY 12/2026	S	SECTION 21-33	INDICATING / RECORDING SYSTEMS - Aural Warning System - Installation of the Cabin Altitude Warning System and Takeoff Configuration Warning System Lights
SB 31A1332R5	MAY 12/2026	S	SECTION 21-33	INDICATING / RECORDING SYSTEMS - Aural Warning System - Installation of the Cabin Altitude Warning System and Takeoff Configuration Warning System Lights
SB 31A1880	APR 17/2020 APR 17/2020 APR 17/2020	S	SECTION 31-62 SECTION 31-63 SECTION 34-21	INDICATING/RECORDING SYSTEMS - Common Display System - Display Electronic Unit Block Point 2015A Software Change
SB 31A1880R1	OCT 15/2025 OCT 15/2025 OCT 15/2025	S	SECTION 31-62 SECTION 31-63 SECTION 34-21	INDICATING/RECORDING SYSTEMS - Common Display System - Display Electronic Unit Block Point 2015A Software Change

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 32-1191	No Effect		-	LANDING GEAR - MAIN GEAR AND NOSE GEAR - INNER CYLINDER AXLE INSPECTION AND REPAIR
SB 32-1191R1	No Effect		-	LANDING GEAR - MAIN GEAR AND NOSE GEAR - INNER CYLINDER AXLE INSPECTION AND REPAIR
SB 32-1191R2	No Effect		-	LANDING GEAR - MAIN GEAR AND NOSE GEAR - INNER CYLINDER AXLE INSPECTION AND REPAIR
SB 32-1191R3	No Effect		-	LANDING GEAR - MAIN GEAR AND NOSE GEAR - INNER CYLINDER AXLE INSPECTION AND REPAIR
SB 32-1362	No Effect		-	LANDING GEAR - Nose Landing Gear - Change the Lower Bearing Seal Retainer
SB 32-1362R1	No Effect		-	LANDING GEAR - Nose Landing Gear - Change the Lower Bearing Seal Retainer
SB 32-1368	No Effect		-	LANDING GEAR - Main Gear and Doors - Left and Right Main Landing Gear Shimmy Damper Assembly Repairs and Seals Replacement
SB 32-1368R1	No Effect		-	LANDING GEAR - Main Gear and Doors - Left and Right Main Landing Gear Shimmy Damper Assembly Repairs and Seals Replacement
SB 32-1369	MAY 12/2026	S	SECTION 32-32	LANDING GEAR - Main Landing Gear Extension and Retraction - Retract Actuator Cylinder Assembly Modification Or Replacement
SB 32-1369R1	MAY 12/2026	S	SECTION 32-32	LANDING GEAR - Main Landing Gear Extension and Retraction - Retract Actuator Cylinder Assembly Modification Or Replacement
SB 32-1369R2	MAY 12/2026	S	SECTION 32-32	LANDING GEAR - Main Landing Gear Extension and Retraction - Retract Actuator Cylinder Assembly Modification Or Replacement
SB 32-1369R3	MAY 12/2026	S	SECTION 32-32	LANDING GEAR - Main Landing Gear Extension and Retraction - Retract Actuator Cylinder Assembly Modification Or Replacement

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 32-1369R4	MAY 12/2026	S	SECTION 32-32	LANDING GEAR - Main Landing Gear Extension and Retraction - Retract Actuator Cylinder Assembly Modification Or Replacement
SB 32-1376	No Effect		-	LANDING GEAR - Main Landing Gear - Forward Trunnion Pin Inspection and Replacement.
SB 32-1376R1	No Effect		-	LANDING GEAR - Main Landing Gear - Forward Trunnion Pin Inspection and Replacement.
SB 32-1376R2	No Effect		-	LANDING GEAR - Main Landing Gear - Forward Trunnion Pin Inspection and Replacement.
SB 32-1393	No Effect		-	LANDING GEAR - Main Gear and Doors - Outer Cylinder Walking Beam Clevis Bushing and Retract Actuator Clevis Bushing Replacement
SB 32-1393R1	No Effect		-	LANDING GEAR - Main Gear and Doors - Outer Cylinder Walking Beam Clevis Bushing and Retract Actuator Clevis Bushing Replacement
SB 32-1394	No Effect		-	LANDING GEAR - Nose Landing Gear Extension and Retraction - Gear Lock Actuator Trunnion Seals Replacement
SB 32-1402R1	No Effect		-	LANDING GEAR - Main Landing Gear - Forward Trunnion Pin Inspection and Replacement.
SB 32-1408	MAY 12/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Messier-Bugatti Carbon Brakes and Wheels for 737-700 Airplanes
SB 32-1408R1	MAY 12/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Messier-Bugatti Carbon Brakes and Wheels for 737-700 Airplanes
SB 32-1408R2	MAY 12/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Messier-Bugatti Carbon Brakes and Wheels for 737-700 Airplanes
SB 32-1408R3	MAY 12/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Messier-Bugatti Carbon Brakes and Wheels for 737-700 Airplanes

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 32-1408R4	JUN 15/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Messier-Bugatti Carbon Brakes and Wheels for 737-700 Airplanes
SB 32-1410	No Effect		-	LANDING GEAR - Main Landing Gear - Wire Bundle and Hanger Link Assembly Inspection, Repair and Modification
SB 32-1410R1	No Effect		-	LANDING GEAR - Main Landing Gear - Wire Bundle and Hanger Link Assembly Inspection, Repair and Modification
SB 32-1410R2	No Effect		-	LANDING GEAR - Main Landing Gear - Wire Bundle and Hanger Link Assembly Inspection, Repair and Modification
SB 32-1418	No Effect		-	LANDING GEAR - Extension and Retraction - Main Landing Gear Retract Actuator Change or Replacement
SB 32-1418R1	No Effect		-	LANDING GEAR - Extension and Retraction - Main Landing Gear Retract Actuator Change or Replacement
SB 32-1422	MAY 12/2026	S	SECTION 32-30	LANDING GEAR - Extension and Retraction - Control System Aft Control Quadrant Clearance Measurement and Replacement
SB 32-1429	MAY 12/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Messier-Bugatti-Dowty Carbon Brakes and Wheels for 737-800 Airplanes
SB 32-1429R1	MAY 12/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Messier-Bugatti-Dowty Carbon Brakes and Wheels for 737-800 Airplanes
SB 32-1429R2	MAY 12/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Messier-Bugatti-Dowty Carbon Brakes and Wheels for 737-800 Airplanes

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 32-1429R3	MAY 12/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Messier-Bugatti-Dowty Carbon Brakes and Wheels for 737-800 Airplanes
SB 32-1429R4	MAY 12/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Messier-Bugatti-Dowty Carbon Brakes and Wheels for 737-800 Airplanes
SB 32-1429R5	JUN 15/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Messier-Bugatti-Dowty Carbon Brakes and Wheels for 737-800 Airplanes
SB 32-1430R1	No Effect		-	LANDING GEAR - Wheels and Brakes - Main Landing Gear Steel Brakes and Related Wheels to Messier-Bugatti-Dowty Carbon Brakes and Related Wheels Replacement for 737-900ER Airplanes
SB 32-1430R2	No Effect		-	LANDING GEAR - Wheels and Brakes - Main Landing Gear Steel Brakes and Related Wheels to Messier-Bugatti-Dowty Carbon Brakes and Related Wheels Replacement for 737-900ER Airplanes
SB 32-1430R3	No Effect		-	LANDING GEAR - Wheels and Brakes - Main Landing Gear Steel Brakes and Related Wheels to Messier-Bugatti-Dowty Carbon Brakes and Related Wheels Replacement for 737-900ER Airplanes
SB 32-1430R4	No Effect		-	LANDING GEAR - Wheels and Brakes - Main Landing Gear Steel Brakes and Related Wheels to Messier-Bugatti-Dowty Carbon Brakes and Related Wheels Replacement for 737-900ER Airplanes
SB 32-1433	MAY 12/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Goodrich Carbon Brakes and Wheels for 737-700 Airplanes

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 32-1433R1	MAY 12/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Goodrich Carbon Brakes and Wheels for 737-700 Airplanes
SB 32-1433R2	MAY 12/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Goodrich Carbon Brakes and Wheels for 737-700 Airplanes
SB 32-1433R3	MAY 12/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Goodrich Carbon Brakes and Wheels for 737-700 Airplanes
SB 32-1433R4	JUN 15/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Goodrich Carbon Brakes and Wheels for 737-700 Airplanes
SB 32-1440	No Effect		-	LANDING GEAR - Extension and Retraction - Nose Landing Gear Retract Actuator Change or Replacement
SB 32-1440R1	No Effect		-	LANDING GEAR - Extension and Retraction - Nose Landing Gear Retract Actuator Change or Replacement
SB 32-1441	MAY 12/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Goodrich Carbon Brakes and Wheels for 737-800 Airplanes
SB 32-1441R1	MAY 12/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Goodrich Carbon Brakes and Wheels for 737-800 Airplanes
SB 32-1441R2	MAY 12/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Goodrich Carbon Brakes and Wheels for 737-800 Airplanes
SB 32-1441R3	MAY 12/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Goodrich Carbon Brakes and Wheels for 737-800 Airplanes

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 32-1441R4	MAY 12/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Goodrich Carbon Brakes and Wheels for 737-800 Airplanes
SB 32-1441R5	JUN 15/2026	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Goodrich Carbon Brakes and Wheels for 737-800 Airplanes
SB 32-1442	No Effect		-	LANDING GEAR - Steering - Nose Wheel Steering System Mechanism Component Change
SB 32-1442R1	No Effect		-	LANDING GEAR - Steering - Nose Wheel Steering System Mechanism Component Change
SB 32-1442R2	No Effect		-	LANDING GEAR - Steering - Nose Wheel Steering System Mechanism Component Change
SB 32-1442R3	No Effect		-	LANDING GEAR - Steering - Nose Wheel Steering System Mechanism Component Change
SB 32-1442R4	No Effect		-	LANDING GEAR - Steering - Nose Wheel Steering System Mechanism Component Change
SB 32-1442R5	No Effect		-	LANDING GEAR - Steering - Nose Wheel Steering System Mechanism Component Change
SB 32-1443	MAY 12/2026	S	SECTION 32-30	LANDING GEAR - Extension and Retraction - Manual Extension Control Mechanism Access Door Switch Replacement
SB 32-1443R1	MAY 12/2026	S	SECTION 32-30	LANDING GEAR - Extension and Retraction - Manual Extension Control Mechanism Access Door Switch Replacement
SB 32-1444	No Effect		-	LANDING GEAR - Tires and Wheels - Main Landing Gear Inboard Wheel Half Inspection
SB 32-1448	No Effect		-	LANDING GEAR - Main Landing Gear - Forward and Aft Trunnion Pin Assemblies Inspection and Change

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 32-1448R1	No Effect		-	LANDING GEAR - Main Landing Gear - Forward and Aft Trunnion Pin Assemblies Inspection and Change
SB 32-1448R2	No Effect		-	LANDING GEAR - Main Landing Gear - Forward and Aft Trunnion Pin Assemblies Inspection and Change
SB 32-1449	No Effect		-	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Goodrich Carbon Brakes and Wheels for 737-900ER Airplanes
SB 32-1449R1	No Effect		-	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Goodrich Carbon Brakes and Wheels for 737-900ER Airplanes
SB 32-1449R3	No Effect		-	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Goodrich Carbon Brakes and Wheels for 737-900ER Airplanes
SB 32-1449R4	No Effect		-	LANDING GEAR - Wheels and Brakes - Replace Steel Brakes and Wheels with Goodrich Carbon Brakes and Wheels for 737-900ER Airplanes
SB 32-1486	No Effect		-	LANDING GEAR - Main and Nose Landing Gear - Landing Gear External Surface Inspection and Outer Cylinder Assembly Trunnion Bore Inspection
SB 32-1486R1	No Effect		-	LANDING GEAR - Main and Nose Landing Gear - Landing Gear External Surface Inspection and Outer Cylinder Assembly Trunnion Bore Inspection
SB 32-1494R24	JUN 15/2024	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replacement of Existing Main Landing Gear Carbon Brakes and Wheels with Steel Brakes and Wheels
SB 32-1494R25	JAN 05/2024	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replacement of Existing Main Landing Gear Carbon Brakes and Wheels with Steel Brakes and Wheels
SB 32-1494R26	DEC 06/2024	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replacement of Existing Main Landing Gear Carbon Brakes and Wheels with Steel Brakes and Wheels

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

	Number	Incorporated	Started/ Completed	ATA	Subject
	SB 32-1494R27	JUN 15/2025	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replacement of Existing Main Landing Gear Carbon Brakes and Wheels with Steel Brakes and Wheels
	SB 32-1494R28	OCT 15/2025	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replacement of Existing Main Landing Gear Carbon Brakes and Wheels with Steel Brakes and Wheels
	SB 32-1494R29	OCT 15/2025	S	SECTION 32-42	LANDING GEAR - Wheels and Brakes - Replacement of Existing Main Landing Gear Carbon Brakes and Wheels with Steel Brakes and Wheels
	SB 32-1508	No Effect		-	LANDING GEAR - Tail Skid System - Tail Skid Assembly Support Fitting - Replacement
	SB 32-1508R1	No Effect		-	LANDING GEAR - Tail Skid System - Tail Skid Assembly Support Fitting - Replacement
	SB 32-1515	No Effect		-	LANDING GEAR - Main Landing Gear Extension and Retraction - Downlock Actuator Hose Clamp Configuration Change
	SB 32-1515R1	No Effect		-	LANDING GEAR - Main Landing Gear Extension and Retraction - Downlock Actuator Hose Clamp Configuration Change
A	SB 32-1528	JUN 15/2020	S	SECTION 32-42	LANDING GEAR - Antiskid/Autobrake System - Antiskid Valves Replacement
	SB 32-1588	No Effect		-	LANDING GEAR - Air/Ground System - Replacement of the PSEU Takeoff Warning Toggle Switch Placard
	SB 32-1596	No Effect		-	LANDING GEAR - Tires and Wheels - Main Landing Gear (MLG) Wheel Assembly Change
	SB 32A1585	No Effect		-	LANDING GEAR - Main Landing Gear - Outer Cylinder Inspection and Replacement
	SB 32A1599	No Effect		-	LANDING GEAR - Hydraulic Brake System - Main Landing Gear Brake Hydraulic Hoses Inspection

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 33-1136	No Effect		-	LIGHTS - Floor Proximity Lights - Modification to the PhotoLuminescent Installation
SB 33-1146	No Effect		-	LIGHTS - Strobe Position Lights - Lightning Protection of the Tail Strobe Light and System Wiring
SB 33-1146R1	No Effect		-	LIGHTS - Strobe Position Lights - Lightning Protection of the Tail Strobe Light and System Wiring
SB 33-1146R2	No Effect		-	LIGHTS - Strobe Position Lights - Lightning Protection of the Tail Strobe Light and System Wiring
SB 33-1146R3	No Effect		-	LIGHTS - Strobe Position Lights - Lightning Protection of the Tail Strobe Light and System Wiring
SB 33-1152	No Effect		-	LIGHTS - Retractable Landing Light - Replacement of Retractable Landing Lights and Wire Connectors
SB 33-1157	No Effect		-	LIGHTS - Anti-Collision Lights - Lower Anti-Collision Light Power Supply Cable Assembly Inspection and Replacement
SB 33-1158	No Effect		-	LIGHTS - Air Conditioning Compartment Lights - Wire Bundle Inspection and Clamps Installation
SB 33-1181	No Effect		-	LIGHTS - Landing Lights - LED Landing, Taxi, and Runway Turnoff Lights (LTRTL) Fastener Replacement for Riding Condition
SB 34-1650	No Effect		-	NAVIGATION - Flight Management Computer (FMC) System - Update the FMC Software to Version 10.5
SB 34-1650R1	No Effect		-	NAVIGATION - Flight Management Computer (FMC) System - Update the FMC Software to Version 10.5
SB 34-1666	No Effect		-	NAVIGATION - FLIGHT Management Computer System - Update the FMC Software to Version 10.4A
SB 34-1721	No Effect		-	NAVIGATION - Air Data Inertial Reference System (ADIRS) - Wiring Change to activate 2005 MAGVAR table

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

	Number	Incorporated	Started/ Completed	ATA	Subject
	SB 34-1721R1	No Effect		-	NAVIGATION - Air Data Inertial Reference System (ADIRS) - Wiring Change to activate 2005 MAGVAR table
	SB 34-1768	MAY 12/2026	S	SECTION 34-61	NAVIGATION - Flight Management Computer (FMC) System - Update the FMC Software to Version 10.6
	SB 34-1811	No Effect		-	NAVIGATION - Flight Environment Data - Pitot Static Probe Bond Inspection and Grounding Plate Installation
	SB 34-1811R1	No Effect		-	NAVIGATION - Flight Environment Data - Pitot Static Probe Bond Inspection and Grounding Plate Installation
	SB 34-1875	No Effect		-	NAVIGATION - Independent Position Determining - Enhanced Ground Proximity Warning System Computer Change
	SB 34-1885	No Effect		-	ANTENNA WATER WICKING
	SB 34-1918	MAY 12/2026	S	SECTION 34-61	NAVIGATION - Flight Management Computer (FMC) System - Update the FMC Software to Version 10.7
	SB 34-1918R1	MAY 12/2026	S	SECTION 34-61	NAVIGATION - Flight Management Computer (FMC) System - Update the FMC Software to Version 10.7
A	SB 34-2252	MAY 12/2026	S	SECTION 34-61	NAVIGATION - Flight Management Computer System - Flight Management Computer Operational Program U11 Software Installation
A	SB 34-2252R1	MAY 12/2026	S	SECTION 34-61	NAVIGATION - Flight Management Computer System - Flight Management Computer Operational Program U11 Software Installation
	SB 34-2395	No Effect		-	NAVIGATION - Low Range Radio Altimeter - Installation of the Antenna Gaskets
	SB 34-2395R1	No Effect		-	NAVIGATION - Low Range Radio Altimeter - Installation of the Antenna Gaskets

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 34-2403R1	MAY 12/2026	S	SECTION 34-45	NAVIGATION - Traffic Alert and Collision Avoidance System (TCAS) - Replacement of TCAS Computer with a TCAS Change 7.1 Computer
SB 34-2403R2	MAY 12/2026	S	SECTION 34-45	NAVIGATION - Traffic Alert and Collision Avoidance System (TCAS) - Replacement of TCAS Computer with a TCAS Change 7.1 Computer
SB 34-2403R3	MAY 12/2026	S	SECTION 34-45	NAVIGATION - Traffic Alert and Collision Avoidance System (TCAS) - Replacement of TCAS Computer with a TCAS Change 7.1 Computer
SB 34-2403R4	MAY 12/2026	S	SECTION 34-45	NAVIGATION - Traffic Alert and Collision Avoidance System (TCAS) - Replacement of TCAS Computer with a TCAS Change 7.1 Computer
SB 34-2421	No Effect		-	NAVIGATION - Air Data Inertial Reference System - Air Data Inertial Reference Unit Replacement and 2015 Magnetic Variation Table Activation
SB 34-2421R1	No Effect		-	NAVIGATION - Air Data Inertial Reference System - Air Data Inertial Reference Unit Replacement and 2015 Magnetic Variation Table Activation
SB 34-2421R2	No Effect		-	NAVIGATION - Air Data Inertial Reference System - Air Data Inertial Reference Unit Replacement and 2015 Magnetic Variation Table Activation
SB 34-2424	No Effect		-	NAVIGATION - Low Range Radio Altimeter System - Radio Altimeter Antenna Harness Assembly Replacement
SB 34-2454	No Effect		-	NAVIGATION - Air Data System - Altimetry System Test
SB 34-2454R1	No Effect		-	NAVIGATION - Air Data System - Altimetry System Test
SB 34-2454R2	No Effect		-	NAVIGATION - Air Data System - Altimetry System Test
SB 34-2454R3	No Effect		-	NAVIGATION - Air Data System - Altimetry System Test
SB 34-2454R4	No Effect		-	NAVIGATION - Air Data System - Altimetry System Test

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

	Number	Incorporated	Started/ Completed	ATA	Subject
	SB 34-2454R5	No Effect		-	NAVIGATION - Air Data System - Altimetry System Test
	SB 34-2454R6	No Effect		-	NAVIGATION - Air Data System - Altimetry System Test
	SB 34-2461	No Effect		-	NAVIGATION - ATC System - Rockwell Collins Air Traffic Control Transponder Replacement
	SB 34-2600	MAY 12/2026	S	SECTION 34-61	NAVIGATION - Flight Management Computer System - Flight Management Computer Operational Program U12 Software Installation
	SB 34-2600R1	MAY 12/2026	S	SECTION 34-61	NAVIGATION - Flight Management Computer System - Flight Management Computer Operational Program U12 Software Installation
A	SB 34-2617	No Effect		-	NAVIGATION - Enhanced Ground Proximity Warning System - Mode 4 Too Low Flaps Alert and Gear Stuck Down Fault Detection Speed Changes
A	SB 34-2617R1	No Effect		-	NAVIGATION - Enhanced Ground Proximity Warning System - Mode 4 Too Low Flaps Alert and Gear Stuck Down Fault Detection Speed Changes
	SB 34-2836	No Effect		-	NAVIGATION - Flight Management Computer System - Change Operation from Joint Aviation Authorities/European Aviation Safety Agency to Federal Aviation Administration Flight Rules
	SB 34-2853	JUN 15/2016	S	SECTION 34-45	NAVIGATION - Traffic Alert and Collision Avoidance System (TCAS) - Replacement of Existing TCAS Computer with a TCAS 7.1 Computer
	SB 34-2877	OCT 15/2016 OCT 15/2016 OCT 15/2016 OCT 15/2016	S	SECTION 22-11 SECTION 22-31 SECTION 34-45 SECTION 34-53	NAVIGATION - Traffic Alert and Collision Avoidance System (TCAS) - Traffic Alert and Collision Avoidance System 7.1 Computer Change, Air Traffic Control Transponder Replacement and Feature Activation
	SB 34-2906	MAY 12/2026	S	SECTION 34-61	NAVIGATION - Flight Management Computer System - Flight Management Computer Operational Program Software U13 Installation

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

	Number	Incorporated	Started/ Completed	ATA	Subject
	SB 34-2906R1	MAY 12/2026	S	SECTION 34-61	NAVIGATION - Flight Management Computer System - Flight Management Computer Operational Program Software U13 Installation
	SB 34-2906R2	MAY 12/2026	S	SECTION 34-61	NAVIGATION - Flight Management Computer System - Flight Management Computer Operational Program Software U13 Installation
	SB 34-3066	JUN 15/2020	S	SECTION 34-61	NAVIGATION - Flight Management Computer System - Flight Management Computer Operational Program Software U14 Installation
	SB 34-3066R1	OCT 15/2025	S	SECTION 34-61	NAVIGATION - Flight Management Computer System - Flight Management Computer Operational Program Software U14 Installation
	SB 34-3239	FEB 15/2019 FEB 15/2019 FEB 15/2019	S	SECTION 22-11 SECTION 22-31 SECTION 34-53	NAVIGATION - ATC System - Installation of Elementary, Enhanced Surveillance and Extended Squitter/ADS-B 'OUT' Wiring and Feature Activation
	SB 34-3341	No Effect		-	NAVIGATION - Air Traffic Control System - Replacement of the Air Traffic Control Transponders
	SB 34-3342	No Effect		-	NAVIGATION - Air Traffic Control (ATC) System - Replacement of the Air Traffic Control Transponders and Multi-Mode Receivers to Enable ADS-B "Out"
	SB 34-3550	JUN 15/2020 JUN 15/2020	S	SECTION 34-45 SECTION 34-53	NAVIGATION - Air Traffic Control (ATC) System - Installation of ADS-B OUT Wiring and Replacement of Air Traffic Control Transponders with DO-260B Compliant Air Traffic Control Transponders and Replacement of the Traffic Alert and Collision Avoidance System (TCAS) Computer and Antennas
A	SB 34-3657	OCT 15/2026	S	SECTION 34-61	NAVIGATION - Flight Management Computer System - Flight Management Computer Operational Program Software U14.1 Installation

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 34-4030	No Effect		-	NAVIGATION - Enhanced Ground Proximity Warning System (EGPWS) - Change of Enhanced Ground Proximity Warning System Altitude Callouts to Menu ID 51
SB 34-4077	No Effect		-	NAVIGATION - Air Data Inertial Reference System - Air Data Inertial Reference Unit Change And 2025 Magnetic Variation Table Activation
SB 34-4278	No Effect		-	NAVIGATION - Flight Management Computer System - Change of Optional Features
SB 34-4279	No Effect		-	NAVIGATION - Flight Management Computer System - Change from Metric Units to English Units and Change of Common Display System Options
SB 34-4279R1	No Effect		-	NAVIGATION - Flight Management Computer System - Change from Metric Units to English Units and Change of Common Display System Options
SB 34-4279R2	JUN 15/2026	C	CHAPTER 34	NAVIGATION - Flight Management Computer System - Change from Metric Units to English Units and Change of Common Display System Options
SB 34A1801	No Effect		-	NAVIGATION - Flight Management Computer System - Change the Operational Program Software to version 10.5A
SB 34A2104	No Effect		-	NAVIGATION - Flight Management Computer System - Flight Management Computer Operational Program Software U10.8 Installation
SB 34A2207	No Effect		-	NAVIGATION - Flight Management Computer System - Flight Management Computer Operational Program Software U10.7 Installation
SB 34A2207R1	No Effect		-	NAVIGATION - Flight Management Computer System - Flight Management Computer Operational Program Software U10.7 Installation

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 34A2216	MAY 12/2026	S	SECTION 34-61	NAVIGATION - Flight Management Computer System - Flight Management Computer Operational Program Software U10.8A Installation
SB 34A2216R1	MAY 12/2026	S	SECTION 34-61	NAVIGATION - Flight Management Computer System - Flight Management Computer Operational Program Software U10.8A Installation
SB 34A2216R2	MAY 12/2026	S	SECTION 34-61	NAVIGATION - Flight Management Computer System - Flight Management Computer Operational Program Software U10.8A Installation
SB 34A2216R3	MAY 12/2026	S	SECTION 34-61	NAVIGATION - Flight Management Computer System - Flight Management Computer Operational Program Software U10.8A Installation
SB 34A2292	No Effect		-	NAVIGATION - Enhanced Ground Proximity Warning System - Air Speed Low Alert Changes
SB 35-1146R16	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R17	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R18	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 35-1146R19	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R20	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R21	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R22	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R23	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R24	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 35-1146R25	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R26	JUL 06/2016	C	CHAPTER 35	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R27	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R28	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R29	OCT 25/2016	C	CHAPTER 35	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R30	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 35-1146R31	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R32	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R33	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R34	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R35	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R36	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 35-1146R37	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R38	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R39	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R40	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R41	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R42	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 35-1146R43	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R44	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R45	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R46	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R47	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R48	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 35-1146R49	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R50	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R51	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R52	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R53	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R54	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 35-1146R55	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R56	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R57	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R58	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R59	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R60	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 35-1146R61	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R62	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R63	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R64	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R65	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R66	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 35-1146R67	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R68	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R69	AUG 17/2022	C	CHAPTER 35	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R70	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R71	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R72	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 35-1146R73	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R74	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R75	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R76	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R77	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
SB 35-1146R78	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

	Number	Incorporated	Started/ Completed	ATA	Subject
A	SB 35-1146R79	No Effect		-	OXYGEN - Oxygen Generator - Replacement of All Lavatory Emergency Chemical Oxygen Generator System Components with Compressed Oxygen Cylinder Constant Dispensing System Components
	SB 35-1162	No Effect		-	OXYGEN - Flight Crew Oxygen System - Crew Oxygen Cylinder Rack Assembly and Shroud Replacement
	SB 35-1211	No Effect		-	OXYGEN - Passenger Oxygen System - Oxygen Generator and Thermal Pad Inspection and Replacement
	SB 35A1126	No Effect		-	OXYGEN - Crew and Passenger Gaseous Oxygen Systems - Oxygen Cylinder Inspection/Replacement
	SB 36-1019	No Effect		-	PNEUMATIC - Engine Bleed Air Distribution System - Clamp Installation On Engine Sense Tubes for the Pneumatic System Flex Lines
	SB 36-1019R1	No Effect		-	PNEUMATIC - Engine Bleed Air Distribution System - Clamp Installation On Engine Sense Tubes for the Pneumatic System Flex Lines
	SB 36-1021	No Effect		-	PNEUMATIC - Bleed Air Precooler System - Change to the Aircraft Condition Monitoring System to Give More Inputs to the Digital Flight Data Acquisition Unit for Easier Environmental Control System Troubleshooting
	SB 36-1021R1	No Effect		-	PNEUMATIC - Bleed Air Precooler System - Change to the Aircraft Condition Monitoring System to Give More Inputs to the Digital Flight Data Acquisition Unit for Easier Environmental Control System Troubleshooting

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 36-1021R2	No Effect		-	PNEUMATIC - Bleed Air Precooler System - Change to the Aircraft Condition Monitoring System to Give More Inputs to the Digital Flight Data Acquisition Unit for Easier Environmental Control System Troubleshooting
SB 36-1021R3	No Effect		-	PNEUMATIC - Bleed Air Precooler System - Change to the Aircraft Condition Monitoring System to Give More Inputs to the Digital Flight Data Acquisition Unit for Easier Environmental Control System Troubleshooting
SB 36-1021R4	No Effect		-	PNEUMATIC - Bleed Air Precooler System - Change to the Aircraft Condition Monitoring System to Give More Inputs to the Digital Flight Data Acquisition Unit for Easier Environmental Control System Troubleshooting
SB 38-1048	No Effect		-	WATER/WASTE - Waste Disposal - Drain Mast - Inspection For Fatigue Cracks/Replacement Of A Cracked Forward Drain Mast Assembly
SB 38-1048R1	No Effect		-	WATER/WASTE - Waste Disposal - Drain Mast - Inspection For Fatigue Cracks/Replacement Of A Cracked Forward Drain Mast Assembly
SB 38-1053	No Effect		-	WATER/WASTE - Waste Disposal - Drain Mast - Inspection For Fatigue Cracks/Replacement Of A Cracked Forward Drain Mast Assembly
SB 38-1053R1	No Effect		-	WATER/WASTE - Waste Disposal - Drain Mast - Inspection For Fatigue Cracks/Replacement Of A Cracked Forward Drain Mast Assembly
SB 38-1057	No Effect		-	POTABLE WATER - Passenger Water System - Hose and Fitting Replacement, Fitting Heater and Shroud Installation
SB 38A1072	No Effect		-	FUEL - APU Fuel Feed System - APU Fuel Feed Line Shroud Inspection

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 38A1072R1	No Effect		-	FUEL - APU Fuel Feed System - APU Fuel Feed Line Shroud Inspection
SB 46-1014	MAY 12/2026 MAY 12/2026	S	CHAPTER 46 SECTION 46-13	INFORMATION SYSTEMS - Crew Information System - Change of Network File Server to Activate the Onboard Network System
SB 46-1014R1	AUG 21/2015 AUG 21/2015	S	CHAPTER 46 SECTION 46-13	INFORMATION SYSTEMS - Crew Information System - Change of Network File Server to Activate the Onboard Network System
SB 46-1019	No Effect		-	INFORMATION SYSTEMS - Onboard Network System - Network File Server Operational Program Configuration Software Change
SB 46-1019R1	No Effect		-	INFORMATION SYSTEMS - Onboard Network System - Network File Server Operational Program Configuration Software Change
SB 46-1050	JUN 15/2026 JUN 15/2026	S	CHAPTER 46 SECTION 46-13	INFORMATION SYSTEMS - Onboard Network System - Network File Server Removal
SB 47-1002	MAY 12/2026 MAY 12/2026	S	SECTION 26-18 SECTION 28-21	INERT GAS SYSTEM - Installation of the Provisions for Nitrogen Generation System
SB 47-1002R1	MAY 12/2026 MAY 12/2026	S	SECTION 26-18 SECTION 28-21	INERT GAS SYSTEM - Installation of the Provisions for Nitrogen Generation System
SB 47-1002R2	MAY 12/2026 MAY 12/2026	S	SECTION 26-18 SECTION 28-21	INERT GAS SYSTEM - Installation of the Provisions for Nitrogen Generation System
SB 47-1002R3	MAY 12/2026 MAY 12/2026	S	SECTION 26-18 SECTION 28-21	INERT GAS SYSTEM - Installation of the Provisions for Nitrogen Generation System
SB 47-1003	FEB 15/2012 FEB 15/2012 FEB 15/2012 FEB 15/2012 FEB 15/2012	S	SECTION 26-18 SECTION 28-21 SECTION 28-41 CHAPTER 47 SECTION 47-31	INERT GAS SYSTEM - Installation of the Nitrogen Generation System

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

	Number	Incorporated	Started/ Completed	ATA	Subject
	SB 47-1003R1	APR 24/2012	S	SECTION 26-18	INERT GAS SYSTEM - Installation of the Nitrogen Generation System
		APR 24/2012		SECTION 28-21	
		APR 24/2012		SECTION 28-41	
		APR 24/2012		CHAPTER 47	
		APR 24/2012		SECTION 47-31	
	SB 47-1003R2	SEP 27/2013	S	SECTION 26-18	INERT GAS SYSTEM - Installation of the Nitrogen Generation System
		SEP 27/2013		SECTION 28-21	
		SEP 27/2013		SECTION 28-41	
		SEP 27/2013		CHAPTER 47	
		SEP 27/2013		SECTION 47-31	
	SB 47-1003R3	JUL 24/2015	S	SECTION 26-18	INERT GAS SYSTEM - Installation of the Nitrogen Generation System
		JUL 24/2015		SECTION 28-21	
		JUL 24/2015		SECTION 28-41	
		JUL 24/2015		CHAPTER 47	
		JUL 24/2015		SECTION 47-31	
	SB 47-1003R4	OCT 15/2022	S	SECTION 26-18	INERT GAS SYSTEM - Installation of the Nitrogen Generation System
		OCT 15/2022		SECTION 28-21	
		OCT 15/2022		SECTION 28-41	
		OCT 15/2022		CHAPTER 47	
		OCT 15/2022		SECTION 47-31	
	SB 47-1011	No Effect		-	INERT GAS SYSTEM - Air Separation Unit - Air Separation Module High Flow Valve Connector Replacement
	SB 47-1012	No Effect		-	INERT GAS SYSTEM - Air Separation Unit - Inspection of Tubes and Clamp Installation
	SB 47-1015	MAY 12/2026	S	SECTION 26-18	INERT GAS SYSTEM - Air Separation Unit - Air Separation Module and Filter Element Replacement
		MAY 12/2026		SECTION 28-21	
		MAY 12/2026		SECTION 47-31	
	SB 47-1020	No Effect		-	INERT GAS SYSTEM - Nitrogen-Enriched Air Distribution - Tube Assemblies Replacement
A	SB 47-1020R1	No Effect		-	INERT GAS SYSTEM - Nitrogen-Enriched Air Distribution - Tube Assemblies Replacement
	SB 49-1133	No Effect		-	AIRBORNE AUXILIARY POWER - Auxiliary Power Unit Air Inlet - Auxiliary Power Unit Flap and Vortex Generator Assembly Modification

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

	Number	Incorporated	Started/ Completed	ATA	Subject
	SB 49-1133R1	No Effect		-	AIRBORNE AUXILIARY POWER - Auxiliary Power Unit Air Inlet - Auxiliary Power Unit Flap and Vortex Generator Assembly Modification
	SB 49-1133R2	No Effect		-	AIRBORNE AUXILIARY POWER - Auxiliary Power Unit Air Inlet - Auxiliary Power Unit Flap and Vortex Generator Assembly Modification
	SB 49-1134	No Effect		-	AIRBORNE AUXILIARY POWER - APU Air Inlet - Inlet Plenum Replacement
	SB 49-1139	No Effect		-	AIRBORNE AUXILIARY POWER - Cowl Door Insulation Panel and Aft Bulkhead Seal Replacement
	SB 49-1139R1	No Effect		-	AIRBORNE AUXILIARY POWER - Cowl Door Insulation Panel and Aft Bulkhead Seal Replacement
	SB 49-1150	MAR 15/2017	C	CHAPTER 49	AIRBORNE AUXILIARY POWER - Auxiliary Power Unit Ignition and Start System - Start Converter Unit Replacement and Wiring Change
	SB 49-1150R1	No Effect		-	AIRBORNE AUXILIARY POWER - Auxiliary Power Unit Ignition and Start System - Start Converter Unit Replacement and Wiring Change
	SB 49-1162	JUN 15/2017	S	SECTION 49-10	AIRBORNE AUXILIARY POWER - APU CONTROLS - Electronic Control Unit Operational Program Software Change
		JUN 15/2017		SECTION 49-15	
		JUN 15/2017		SECTION 49-31	
		JUN 15/2017		SECTION 49-32	
		JUN 15/2017		SECTION 49-40	
		JUN 15/2017		SECTION 49-52	
		JUN 15/2017		SECTION 49-53	
		JUN 15/2017		SECTION 49-54	
		JUN 15/2017		SECTION 49-55	
		JUN 15/2017		SECTION 49-60	
		JUN 15/2017		SECTION 49-70	
		JUN 15/2017		SECTION 49-90	
	SB 49-1195	No Effect		-	AIRBORNE AUXILIARY POWER - APU Power Plant - Auxiliary Power Unit Replacement
A	SB 49-1207	No Effect		-	AIRBORNE AUXILIARY POWER - APU Indicating System - Data Memory Module Replacement

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 52-1152	No Effect		-	DOORS - Forward Airstair Door Reliability Improvement - Replace Door Lockpin Actuators, Open Limit/Warning Switch Brackets, and Raceway Cover Assembly
SB 52-1156	No Effect		-	DOORS - Forward Airstair and Door - Forward Airstair Speedup And Slowdown System Deletion
SB 52-1157	No Effect		-	DOORS - Entrance Stairs - Forward Airstair - Airstair Handrail Safety Improvements
SB 52-1157R1	No Effect		-	DOORS - Entrance Stairs - Forward Airstair - Airstair Handrail Safety Improvements
SB 52-1159	MAY 12/2026	S	SECTION 52-10	DOORS - Door Warning System - Forward Entry Door Latch Switch and Wiring Installation and Modification
SB 52-1159R1	MAY 12/2026	S	SECTION 52-10	DOORS - Door Warning System - Forward Entry Door Latch Switch and Wiring Installation and Modification
SB 52-1164	No Effect		-	DOORS - Forward and Aft Cargo Doors - Lanyard Assembly Replacement
SB 52-1165	No Effect		-	DOORS - Aft Entry And Aft Galley Service Door - Door Snubber Stop Link Assembly Change
SB 52-1165R1	No Effect		-	DOORS - Aft Entry And Aft Galley Service Door - Door Snubber Stop Link Assembly Change
SB 52-1169	No Effect		-	DOORS - Landing Gear Doors - Inboard Main Landing Gear Doors - Inspection and Repair
SB 52-1170	No Effect		-	DOORS - Landing Gear Center Door Assembly Attachments - Inspection, Repair and Modification
SB 52-1170R1	No Effect		-	DOORS - Landing Gear Center Door Assembly Attachments - Inspection, Repair and Modification
SB 52-1173	No Effect		-	FORWARD AIRSTAIR - Stair Tread - Anti-Slip Material Edge Seal Modification

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 52-1175	No Effect		-	DOORS - Forward Entry Door Guide Arm and Roller - Radius Link Pin Change
SB 52-1175R1	No Effect		-	DOORS - Forward Entry Door Guide Arm and Roller - Radius Link Pin Change
SB 52-1175R2	No Effect		-	DOORS - Forward Entry Door Guide Arm and Roller - Radius Link Pin Change
SB 52-1175R3	No Effect		-	DOORS - Forward Entry Door Guide Arm and Roller - Radius Link Pin Change
SB 52A1167	No Effect		-	DOORS - Landing Gear Doors - Inboard Main Landing Gear Door Hinge Fittings - Inspection and Replacement
SB 52A1180	No Effect		-	DOORS - Forward Entry Door - Stop Fitting Assembly Inspection
SB 52A1180R1	No Effect		-	DOORS - Forward Entry Door - Stop Fitting Assembly Inspection
SB 53-1237	No Effect		-	FUSELAGE - Wing To Body Fairing - Wheel Well - Bonded Panel (Bow-Tie Panel) - Fastener Replacement
SB 53-1237R1	No Effect		-	FUSELAGE - Wing To Body Fairing - Wheel Well - Bonded Panel (Bow-Tie Panel) - Fastener Replacement
SB 53-1244	No Effect		-	FUSELAGE - Passenger Cabin Floors - Station 520 to 540 - Pivot Link Assembly Repair/Replace
SB 53-1244R1	No Effect		-	FUSELAGE - Passenger Cabin Floors - Station 520 to 540 - Pivot Link Assembly Repair/Replace
SB 53-1244R2	No Effect		-	FUSELAGE - Passenger Cabin Floors - Station 520 to 540 - Pivot Link Assembly Repair/Replace
SB 53-1244R3	No Effect		-	FUSELAGE - Passenger Cabin Floors - Station 520 to 540 - Pivot Link Assembly Repair/Replace
SB 53-1244R4	No Effect		-	FUSELAGE - Passenger Cabin Floors - Station 520 to 540 - Pivot Link Assembly Repair/Replace

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 53-1244R5	No Effect		-	FUSELAGE - Passenger Cabin Floors - Station 520 to 540 - Pivot Link Assembly Repair/Replace
SB 53-1245	No Effect		-	FUSELAGE - Wing-to-Body Fairing - High Pressure Door and Doubler - Replacement
SB 53-1251	No Effect		-	FUSELAGE - Frames and Bulkheads - Body Station 1016 Aft Pressure Bulkhead - Apex Inspection
SB 53-1252	No Effect		-	FUSELAGE - Stabilizer Center Section Front Spar - Sliding Seal and Track Modification.
SB 53-1252R1	No Effect		-	FUSELAGE - Stabilizer Center Section Front Spar - Sliding Seal and Track Modification.
SB 53-1264	No Effect		-	FUSELAGE - Fillet Fairings - Aft Wing-to-Body Fairing - Inboard Flap Primary Torque Tube Inspection/Repair and Aft Wing-to-Body Fairing Modification
SB 53-1264R1	No Effect		-	FUSELAGE - Fillet Fairings - Aft Wing-to-Body Fairing - Inboard Flap Primary Torque Tube Inspection/Repair and Aft Wing-to-Body Fairing Modification
SB 53-1276	No Effect		-	FUSELAGE - Forward and Aft Cargo Compartment - Corrosion Prevention Modification
SB 53-1276R1	No Effect		-	FUSELAGE - Forward and Aft Cargo Compartment - Corrosion Prevention Modification
SB 53-1276R2	No Effect		-	FUSELAGE - Forward and Aft Cargo Compartment - Corrosion Prevention Modification
SB 53-1277	No Effect		-	FUSELAGE - Structure Attachment Fittings - Nose Wheel Well Retract Actuator Support Fitting Inspection and Modification
SB 53-1277R1	No Effect		-	FUSELAGE - Structure Attachment Fittings - Nose Wheel Well Retract Actuator Support Fitting Inspection and Modification

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 53-1280	No Effect		-	FUSELAGE - Fillet Fairings - Aft Outboard Wing to Body Fairing Modification
SB 53-1282	No Effect		-	FUSELAGE - Wheel Well - Nose Wheel Upper Drag Brace and Trunnion Bushing Replacement
SB 53-1282R1	No Effect		-	FUSELAGE - Wheel Well - Nose Wheel Upper Drag Brace and Trunnion Bushing Replacement
SB 53-1285	No Effect		-	FUSELAGE - Passenger Cabin Floors - Sections 41 and 47 - Addition of Gel Tape to Prevent Corrosion of Passenger Cabin Floor Panel Support Structure
SB 53-1285R1	No Effect		-	FUSELAGE - Passenger Cabin Floors - Sections 41 and 47 - Addition of Gel Tape to Prevent Corrosion of Passenger Cabin Floor Panel Support Structure
SB 53-1294	No Effect		-	FUSELAGE - Skin - Lower Bulkhead Chords at Body Station 540 - Skin Inspection, Chord Splice Installation and Skin Repair
SB 53-1294R1	No Effect		-	FUSELAGE - Skin - Lower Bulkhead Chords at Body Station 540 - Skin Inspection, Chord Splice Installation and Skin Repair
SB 53-1294R2	No Effect		-	FUSELAGE - Skin - Lower Bulkhead Chords at Body Station 540 - Skin Inspection, Chord Splice Installation and Skin Repair
SB 53-1294R3	No Effect		-	FUSELAGE - Skin - Lower Bulkhead Chords at Body Station 540 - Skin Inspection, Chord Splice Installation and Skin Repair
SB 53-1296	No Effect		-	FUSELAGE - Passenger Cabin Floors - Station 727B Splice Strap Installation
SB 53-1296R1	No Effect		-	FUSELAGE - Passenger Cabin Floors - Station 727B Splice Strap Installation
SB 53-1297	No Effect		-	FUSELAGE - Equipment Attachment Fittings - Aft Cargo Waste Tank Enclosure - Stanchion Modification

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 53-1298	No Effect		-	FUSELAGE - Skin - Dorsal Fin Seal Retainer and Fuselage Skin Station 847 To 1007 - Inspection
SB 53-1303	No Effect		-	FUSELAGE - Structure Around Openings - Number 3 Window Frame - Inspection and Freeze Plug Installation
SB 53-1303R1	No Effect		-	FUSELAGE - Structure Around Openings - Number 3 Window Frame - Inspection and Freeze Plug Installation
SB 53-1307	No Effect		-	FUSELAGE - Fillet Fairings - Aft Wing to Body Fairing - Panel 194E and Aft Center Wheel Well Panel 193D - Inspection and Rework
SB 53-1307R1	No Effect		-	FUSELAGE - Fillet Fairings - Aft Wing to Body Fairing - Panel 194E and Aft Center Wheel Well Panel 193D - Inspection and Rework
SB 53-1310	No Effect		-	FUSELAGE - Skin - Chem-Mill Steps in Crown Skins at Specified Locations - Inspection and Modification
SB 53-1310R1	No Effect		-	FUSELAGE - Skin - Chem-Mill Steps in Crown Skins at Specified Locations - Inspection and Modification
SB 53-1311	No Effect		-	FUSELAGE - Skin - Chem-mill Steps in Crown Skins at Specified Locations - Inspection and Modification
SB 53-1311R1	No Effect		-	FUSELAGE - Skin - Chem-mill Steps in Crown Skins at Specified Locations - Inspection and Modification
SB 53-1316	No Effect		-	FUSELAGE - Frames and Bulkheads - Number 1 Window Frame and Windshield Assembly Replacement and Head Up Display Realignment
SB 53-1316R1	No Effect		-	FUSELAGE - Frames and Bulkheads - Number 1 Window Frame and Windshield Assembly Replacement and Head Up Display Realignment
SB 53-1326	No Effect		-	FUSELAGE - Cargo Compartment Sidewall Linings - Inspection and Repair

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 53-1330	No Effect		-	FUSELAGE - Structure Around Openings - Number 1 Window Frame Cracking - Temporary Repair
SB 53-1330R1	No Effect		-	FUSELAGE - Structure Around Openings - Number 1 Window Frame Cracking - Temporary Repair
SB 53-1335	No Effect		-	FUSELAGE - Structure Around Openings - Number 1 Window Frame - Modification
SB 53-1335R1	No Effect		-	FUSELAGE - Structure Around Openings - Number 1 Window Frame - Modification
SB 53-1335R2	No Effect		-	FUSELAGE - Structure Around Openings - Number 1 Window Frame - Modification
SB 53-1336	No Effect		-	FUSELAGE - Structure Around Openings - Number 1 Window Frame - Permanent Repair
SB 53-1336R1	No Effect		-	FUSELAGE - Structure Around Openings - Number 1 Window Frame - Permanent Repair
SB 53-1341	No Effect		-	FUSELAGE - Miscellaneous Exterior Service Doors - External Power Receptacle Door - Bonding Jumper Inspection and Replacement
SB 53-1341R1	No Effect		-	FUSELAGE - Miscellaneous Exterior Service Doors - External Power Receptacle Door - Bonding Jumper Inspection and Replacement
SB 53-1345	No Effect		-	FUSELAGE - Structure Around Openings - Number 3 Window Frame - Permanent Repair
SB 53-1345R1	No Effect		-	FUSELAGE - Structure Around Openings - Number 3 Window Frame - Permanent Repair
SB 53-1345R2	No Effect		-	FUSELAGE - Structure Around Openings - Number 3 Window Frame - Permanent Repair
SB 53-1397	No Effect		-	FUSELAGE - Frames and Bulkheads - STA 663.75 Frame Fitting Assembly - Repair or Preventative Modification

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 53-1399	No Effect		-	FUSELAGE - Skin - Skin Lap Splice at S-4, S-14 and S-24 - Inspection
SB 53-1399R1	No Effect		-	FUSELAGE - Skin - Skin Lap Splice at S-4, S-14 and S-24 - Inspection
SB 53A1248	No Effect		-	FUSELAGE - Body Station 1016 Aft Pressure Bulkhead Web - Inspection for Web Cracks at the Y-Chord
SB 53A1248R1	No Effect		-	FUSELAGE - Body Station 1016 Aft Pressure Bulkhead Web - Inspection for Web Cracks at the Y-Chord
SB 53A1248R2	No Effect		-	FUSELAGE - Body Station 1016 Aft Pressure Bulkhead Web - Inspection for Web Cracks at the Y-Chord
SB 53A1248R3	No Effect		-	FUSELAGE - Body Station 1016 Aft Pressure Bulkhead Web - Inspection for Web Cracks at the Y-Chord
SB 53A1251R1	No Effect		-	FUSELAGE - Frames and Bulkheads - Body Station 1016 Aft Pressure Bulkhead - Apex Inspection
SB 53A1251R2	No Effect		-	FUSELAGE - Frames and Bulkheads - Body Station 1016 Aft Pressure Bulkhead - Apex Inspection
SB 53A1253	No Effect		-	FUSELAGE - General - Station 1016 Aft Pressure Bulkhead - Inspection For Web Oil Canning
SB 53A1253R1	No Effect		-	FUSELAGE - General - Station 1016 Aft Pressure Bulkhead - Inspection For Web Oil Canning
SB 53A1289	No Effect		-	FUSELAGE - Skin - Inspection Of The Skin For Scribe Lines
SB 53A1289R1	No Effect		-	FUSELAGE - Skin - Inspection Of The Skin For Scribe Lines
SB 53A1325	No Effect		-	FUSELAGE - Frames and Bulkheads - Body Station (STA) 727 Bulkhead Lower Frame Web and Inner Chord - Inspection, Preventive Modification and Repair
SB 53A1325R1	No Effect		-	FUSELAGE - Frames and Bulkheads - Body Station (STA) 727 Bulkhead Lower Frame Web and Inner Chord - Inspection, Preventive Modification and Repair

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

	Number	Incorporated	Started/ Completed	ATA	Subject
A	SB 53A1351	No Effect		-	FUSELAGE - Skin - Window Corner Inspection
A	SB 53A1352	No Effect		-	FUSELAGE - Skin - S-14 Lap Splice Lower Fastener Row Inspection
A	SB 53A1352R1	No Effect		-	FUSELAGE - Skin - S-14 Lap Splice Lower Fastener Row Inspection
	SB 53A1353	No Effect		-	FUSELAGE - Body Station 1016 Aft Pressure Bulkhead - Inspection for Fatigue Cracks at Web Lap Splices
A	SB 53A1368	No Effect		-	FUSELAGE - Skin - Lower Bulkhead Chords at Body Station 540 - Inspection, Repair and Preventive Modification
	SB 53A1383	No Effect		-	FUSELAGE - Structure Around Openings - Forward Galley Door Bear Strap Inspection
	SB 53A1383R1	No Effect		-	FUSELAGE - Structure Around Openings - Forward Galley Door Bear Strap Inspection
	SB 53A1383R2	No Effect		-	FUSELAGE - Structure Around Openings - Forward Galley Door Bear Strap Inspection
	SB 53A1383R3	No Effect		-	FUSELAGE - Structure Around Openings - Forward Galley Door Bear Strap Inspection
	SB 53A1384	No Effect		-	FUSELAGE - Frames and Bulkheads - Body Station 727 Bulkhead - Fastener Inspection and Repair
	SB 53A1385	No Effect		-	FUSELAGE - Frames and Bulkheads - Missing Shim at STA 727 Inner Chord to Stringer S-18A Web - Inspection
	SB 53A1402	No Effect		-	FUSELAGE - Frames and Bulkheads - Shimming Non Conformities at STA 727 Frame Inner Chord and S-18A Web Inspection
	SB 53A1402R1	No Effect		-	FUSELAGE - Frames and Bulkheads - Shimming Non Conformities at STA 727 Frame Inner Chord and S-18A Web Inspection

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

	Number	Incorporated	Started/ Completed	ATA	Subject
	SB 53A1403	No Effect		-	FUSELAGE - Frames and Bulkheads - STA 1016 Aft Pressure Bulkhead - 0.040 Inch Dome Apex Web Lap Splice Inspection
	SB 53A1404	No Effect		-	FUSELAGE - Frames and Bulkheads - STA 578, STA 597, STA 601, STA 616, and STA 639 Stub Beam Straps - Inspection
	SB 53A1404R1	No Effect		-	FUSELAGE - Frames and Bulkheads - STA 578, STA 597, STA 601, STA 616, and STA 639 Stub Beam Straps - Inspection
	SB 53A1407	No Effect		-	FUSELAGE - Skin - Forward Galley Door Cutout - Forward Upper Corner Fuselage Skin and Bear Strap Inspection
	SB 53A1410	No Effect		-	FUSELAGE - Frames and Bulkheads - Frames at STA 312 From S-20R to S-23R, STA 328 From S-19R to S-22R and STA 344 From S-20R to S-23R Inspection
	SB 53A1414	No Effect		-	FUSELAGE - Frames and Bulkheads - STA 663.75 Frame Fitting and Failsafe Strap - Inspection
	SB 53A1414R1	No Effect		-	FUSELAGE - Frames and Bulkheads - STA 663.75 Frame Fitting and Failsafe Strap - Inspection
	SB 53A1421	No Effect		-	FUSELAGE - Skin - Skin and Structure Common to the Aft Drain Mast Inspection
A	SB 53A1428	No Effect		-	FUSELAGE - Cabin Floors - Forward Main Deck Cargo Compartment Water Leakage Test and Sealant Repair
	SB 54-1041	No Effect		-	NACELLES / PYLONS - Aft Fairing - Fluid Accumulation in Engine Strut Aft Fairing - Installation of New Engine Strut Aft Fairing Seals
	SB 54-1041R1	No Effect		-	NACELLES / PYLONS - Aft Fairing - Fluid Accumulation in Engine Strut Aft Fairing - Installation of New Engine Strut Aft Fairing Seals

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 54-1041R2	No Effect		-	NACELLES / PYLONS - Aft Fairing - Fluid Accumulation in Engine Strut Aft Fairing - Installation of New Engine Strut Aft Fairing Seals
SB 54-1042	No Effect		-	NACELLES / PYLONS - Engine Strut Upper Link - Inspection / Modification
SB 54-1042R1	No Effect		-	NACELLES / PYLONS - Engine Strut Upper Link - Inspection / Modification
SB 54-1043	No Effect		-	NACELLES/PYLONS - Strut Drains and Seals - Aft Fairing Drain Tube Assembly Replacement.
SB 54-1043R1	No Effect		-	NACELLES/PYLONS - Strut Drains and Seals - Aft Fairing Drain Tube Assembly Replacement.
SB 54-1043R2	No Effect		-	NACELLES/PYLONS - Strut Drains and Seals - Aft Fairing Drain Tube Assembly Replacement.
SB 54-1043R3	No Effect		-	NACELLES/PYLONS - Strut Drains and Seals - Aft Fairing Drain Tube Assembly Replacement.
SB 54-1045	No Effect		-	NACELLES/PYLONS - Heat Insulation Blankets - Replacement
SB 54-1046	No Effect		-	NACELLES/PYLONS - Strut to Wing Fairings - Thumbnail Fairing Edge Seal Replacement
SB 54-1046R1	No Effect		-	NACELLES/PYLONS - Strut to Wing Fairings - Thumbnail Fairing Edge Seal Replacement
SB 54-1047	No Effect		-	NACELLES/PYLONS - Strut Aft Fairing Heat Shield Assembly and Insulation Blanket Installation
SB 54-1049	No Effect		-	NACELLES/PYLONS- Strut Drains and Seals - Strut Seal Plane Access Panels Leak Inspection
SB 54-1051	No Effect		-	NACELLES/PYLONS - Strut to Wing Fairings - Strut Aft Fairing Heat Shield Block Installation
SB 54-1059	No Effect		-	NACELLES/PYLONS - Strut - Fan Cowl Support Beam, Number 1 Hinge Fitting Fastener Change

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 54-1059R1	No Effect		-	NACELLES/PYLONS - Strut - Fan Cowl Support Beam, Number 1 Hinge Fitting Fastener Change
SB 55-1086	No Effect		-	STABILIZERS - Horizontal Stabilizer - Inspection of the Pins and Bolts that Attach the Horizontal Stabilizer to the Horizontal Stabilizer Center Section
SB 55-1086R1	No Effect		-	STABILIZERS - Horizontal Stabilizer - Inspection of the Pins and Bolts that Attach the Horizontal Stabilizer to the Horizontal Stabilizer Center Section
SB 55-1086R2	No Effect		-	STABILIZERS - Horizontal Stabilizer - Inspection of the Pins and Bolts that Attach the Horizontal Stabilizer to the Horizontal Stabilizer Center Section
SB 55-1086R3	No Effect		-	STABILIZERS - Horizontal Stabilizer - Inspection of the Pins and Bolts that Attach the Horizontal Stabilizer to the Horizontal Stabilizer Center Section
SB 55-1089	No Effect		-	STABILIZERS - Horizontal Stabilizer - Trailing Edge Panel, Conductive Strip and Tip Cap Assembly - Change
SB 55-1089R1	No Effect		-	STABILIZERS - Horizontal Stabilizer - Trailing Edge Panel, Conductive Strip and Tip Cap Assembly - Change
SB 55-1090	No Effect		-	STABILIZERS - Horizontal Stabilizer - Rear Spar Termination Fitting - Inspection
SB 55-1090R1	No Effect		-	STABILIZERS - Horizontal Stabilizer - Rear Spar Termination Fitting - Inspection
SB 55-1093	No Effect		-	STABILIZERS - Horizontal Stabilizer - Replacement of Rear Spar Attach Pins With Unapproved Surface Coating
SB 55-1096	No Effect		-	STABILIZERS - Horizontal Stabilizer - Lower Skin Cracking and Modification
SB 55-1106	No Effect		-	STABILIZERS - Horizontal Stabilizer - Elevator Upper and Lower Skin Panel Paint Change
SB 55-1106R1	No Effect		-	STABILIZERS - Horizontal Stabilizer - Elevator Upper and Lower Skin Panel Paint Change

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 55A1072	No Effect		-	STABILIZERS - Elevator - Tab Assembly - Inspection of Elevator Tab Hinge and Elevator Tab Control Mechanism
SB 55A1072R1	No Effect		-	STABILIZERS - Elevator - Tab Assembly - Inspection of Elevator Tab Hinge and Elevator Tab Control Mechanism
SB 55A1080	No Effect		-	STABILIZERS - Elevator - Elevator and Elevator Tab Replacement
SB 55A1080R1	No Effect		-	STABILIZERS - Elevator - Elevator and Elevator Tab Replacement
SB 55A1082	No Effect		-	STABILIZERS - Elevator - Modification to Improve the Structural Damping Characteristics and Enhance the Wear Characteristics of the Elevator Tab
SB 55A1082R1	No Effect		-	STABILIZERS - Elevator - Modification to Improve the Structural Damping Characteristics and Enhance the Wear Characteristics of the Elevator Tab
SB 55A1084	No Effect		-	HORIZONTAL STABILIZER - Trailing Edge - Elevator Balance Bay Panel Seal Trim
SB 55A1084R1	No Effect		-	HORIZONTAL STABILIZER - Trailing Edge - Elevator Balance Bay Panel Seal Trim
SB 55A1097	No Effect		-	STABILIZERS - Horizontal Stabilizer - Rear Spar Upper Chord Inspection
SB 55A1097R1	No Effect		-	STABILIZERS - Horizontal Stabilizer - Rear Spar Upper Chord Inspection
SB 55A1104	No Effect		-	STABILIZERS - Horizontal Stabilizer - Pivot Hinge and Jackscrew Freeplay Inspection
SB 56-1016	No Effect		-	WINDOWS - Control Cabin Sliding Windows - Number 2 Openable Window - Hold Open Latch Assembly - Inspection and Replacement
SB 56-1017	MAY 12/2026 MAY 12/2026	S	SECTION 30-41 SECTION 56-11	WINDOWS - Flight Compartment - Control Cabin Fixed Windows - Deletion of Number 4 and Number 5 Windows.

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 56-1017R1	MAY 12/2026 MAY 12/2026	S	SECTION 30-41 SECTION 56-11	WINDOWS - Flight Compartment - Control Cabin Fixed Windows - Deletion of Number 4 and Number 5 Windows.
SB 56-1017R2	MAY 12/2026 MAY 12/2026	S	SECTION 30-41 SECTION 56-11	WINDOWS - Flight Compartment - Control Cabin Fixed Windows - Deletion of Number 4 and Number 5 Windows.
SB 56-1024	No Effect		-	WINDOWS - Control Cabin Sliding Windows - Left Side and Right Side number 2 Window Frame Repair and Modification
SB 56-1024R1	No Effect		-	WINDOWS - Control Cabin Sliding Windows - Left Side and Right Side number 2 Window Frame Repair and Modification
SB 56-1025	No Effect		-	WINDOWS - Flight Compartment - Flight Deck Number 2 Window Pane - Replacement
SB 56A1022	No Effect		-	WINDOWS - Flight Compartment - Flight Deck Number 2, Number 4 and Number 5 Windows - Inspection
SB 56A1022R1	No Effect		-	WINDOWS - Flight Compartment - Flight Deck Number 2, Number 4 and Number 5 Windows - Inspection
SB 57-1250R1	No Effect		-	WINGS - Center Wing Box - Application of the Secondary Fuel Vapor-Barrier to Areas on the Front Spar and the Top if the Wing Center Section
SB 57-1250R2	No Effect		-	WINGS - Center Wing Box - Application of the Secondary Fuel Vapor-Barrier to Areas on the Front Spar and the Top if the Wing Center Section
SB 57-1278	No Effect		-	WINGS - Trailing Edge and Trailing Edge Devices - Outboard Flap Bellcrank Assembly Inspection and Modification.
SB 57-1278R1	No Effect		-	WINGS - Trailing Edge and Trailing Edge Devices - Outboard Flap Bellcrank Assembly Inspection and Modification.

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 57-1278R2	No Effect		-	WINGS - Trailing Edge and Trailing Edge Devices - Outboard Flap Bellcrank Assembly Inspection and Modification.
SB 57-1281	No Effect		-	WINGS - Trailing Edge Flaps - Repair of Inboard Main Flap Upper Skin and Modification of Nutplate Strip Assembly
SB 57-1284	No Effect		-	Wings - Trailing Edge and Trailing Edge Devices - Inspection, Repair / Modification - Wing Buttock Line 147 to Wing Buttock Line 201
SB 57-1284R1	No Effect		-	Wings - Trailing Edge and Trailing Edge Devices - Inspection, Repair / Modification - Wing Buttock Line 147 to Wing Buttock Line 201
SB 57-1286	No Effect		-	WINGS - Center Wing - Rear Spar Vapor Barrier - Inspection, Repair and Modification
SB 57-1286R1	No Effect		-	WINGS - Center Wing - Rear Spar Vapor Barrier - Inspection, Repair and Modification
SB 57-1288	No Effect		-	WINGS - Trailing Edge Flap - Number 3 and Number 6 Tailcone Assemblies - Inspection and Repair
SB 57-1288R1	No Effect		-	WINGS - Trailing Edge Flap - Number 3 and Number 6 Tailcone Assemblies - Inspection and Repair
SB 57-1293	No Effect		-	WINGS - Leading Edge and Leading Edge Devices - Fuel Drain Path Modification
SB 57-1293R1	No Effect		-	WINGS - Leading Edge and Leading Edge Devices - Fuel Drain Path Modification
SB 57-1293R2	No Effect		-	WINGS - Leading Edge and Leading Edge Devices - Fuel Drain Path Modification
SB 57-1293R3	No Effect		-	WINGS - Leading Edge and Leading Edge Devices - Fuel Drain Path Modification

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

	Number	Incorporated	Started/ Completed	ATA	Subject
	SB 57-1300	No Effect		-	WINGS - TRAILING EDGE FLAPS - Inboard Flaps - Inboard Main Flap Tracks, #4 and #5 - Inspection and Exchange Program
	SB 57-1306	No Effect		-	WINGS - TRAILING EDGE FLAPS - Inboard Flaps - Inboard Main Flap Tracks, #4 and #5 - Super D-Gun Coating, Detailed Inspection and Exchange Program
	SB 57-1309	No Effect		-	WINGS - Center Wing Box - Front Spar Shear Fitting - Inspection, Repair and Preventive Modification
	SB 57-1309R1	No Effect		-	WINGS - Center Wing Box - Front Spar Shear Fitting - Inspection, Repair and Preventive Modification
	SB 57-1310	No Effect		-	WINGS - Center Wing - Wing Spars - Forward Trunnion Support Fitting - Fuse Pin Bores - Inspection For Corrosion
	SB 57-1310R1	No Effect		-	WINGS - Center Wing - Wing Spars - Forward Trunnion Support Fitting - Fuse Pin Bores - Inspection For Corrosion
	SB 57-1310R2	No Effect		-	WINGS - Center Wing - Wing Spars - Forward Trunnion Support Fitting - Fuse Pin Bores - Inspection For Corrosion
	SB 57-1312	No Effect		-	WINGS - Outer Wing - Wire Bundle Support General Visual Inspection, Replace TFE-4X with TFE-2X sleeve
	SB 57-1316	No Effect		-	WINGS - Spoilers - Installation of Polyurethane Protective Tape on Lower Skin Surface of Inboard Ground Spoiler Number 6 and 7
	SB 57-1325	No Effect		-	WINGS - Trailing Edge Flaps - Outboard Aft Flap, Inboard Closure Rib Preventive Modification
	SB 57-1325R1	No Effect		-	WINGS - Trailing Edge Flaps - Outboard Aft Flap, Inboard Closure Rib Preventive Modification
A	SB 57-1330	No Effect		-	WINGS - Center Wing Box - Wing Center Section Rear Spar Vertical Pressure Deck Web - Modification

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 57-1331	No Effect		-	WINGS - Trailing Edge Flaps - Inboard Main Flap Seal Fastener Change
SB 57-1336	No Effect		-	WINGS - Wing Leading Edge - Upper Skin Panel - Fastener Change
SB 57-1341	No Effect		-	WINGS - Trailing Edge Flaps - Aft Flap Assembly Change
SB 57-1357	No Effect		-	WINGS - Main Landing Gear Forward Housing Assembly - Forward Trunnion Support Fitting Repair and Modification
SB 57A1279	No Effect		-	WINGS - Center and Outer Wing - Fastener Sealing and Wire Bundle Support General Visual Inspection
SB 57A1279R1	No Effect		-	WINGS - Center and Outer Wing - Fastener Sealing and Wire Bundle Support General Visual Inspection
SB 57A1279R2	No Effect		-	WINGS - Center and Outer Wing - Fastener Sealing and Wire Bundle Support General Visual Inspection
SB 57A1279R3	No Effect		-	WINGS - Center and Outer Wing - Fastener Sealing and Wire Bundle Support General Visual Inspection
SB 57A1302	No Effect		-	WINGS - Leading Edge Slats- Main Track Down Stop Modification and Detailed Inspection
SB 57A1302R1	No Effect		-	WINGS - Leading Edge Slats- Main Track Down Stop Modification and Detailed Inspection
SB 57A1314	No Effect		-	WINGS - Trailing Edge Flaps - Inboard Flap Assembly - Inboard Carriage to Torque Tube Attachment - Inspection and Modification
SB 57A1314R1	No Effect		-	WINGS - Trailing Edge Flaps - Inboard Flap Assembly - Inboard Carriage to Torque Tube Attachment - Inspection and Modification
SB 57A1327	No Effect		-	WINGS - Leading Edge And Leading Edge Devices - Krueger Flap Inspection
SB 57A1327R1	No Effect		-	WINGS - Leading Edge And Leading Edge Devices - Krueger Flap Inspection

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 57A1327R2	No Effect		-	WINGS - Leading Edge And Leading Edge Devices - Krueger Flap Inspection
SB 57A1356	No Effect		-	WINGS - Outer Wing - Outboard Lower Wing Skin at Stringers S-9 and S-10 Inspection
SB 57A1359	No Effect		-	WINGS - Wing Leading Edge - Engine Fuel Shutoff Valve Access Panel Inspection and Test
SB 71-1582	No Effect		-	POWER PLANT - General - Intermix One or Substitute Any Combination of CFM56-7B Single Annular Combustor (SAC) Engines or CFM56-7B High Pressure Compressor and/or High Pressure Turbine Technology Insertion Kit Engines for the Two CFM56-7B SAC/3 Technology Insertion Program Base Engines
SB 71-1582R1	No Effect		-	POWER PLANT - General - Intermix One or Substitute Any Combination of CFM56-7B Single Annular Combustor (SAC) Engines or CFM56-7B High Pressure Compressor and/or High Pressure Turbine Technology Insertion Kit Engines for the Two CFM56-7B SAC/3 Technology Insertion Program Base Engines
SB 71-1582R2	No Effect		-	POWER PLANT - General - Intermix One or Substitute Any Combination of CFM56-7B Single Annular Combustor (SAC) Engines or CFM56-7B High Pressure Compressor and/or High Pressure Turbine Technology Insertion Kit Engines for the Two CFM56-7B SAC/3 Technology Insertion Program Base Engines
SB 71-1582R3	No Effect		-	POWER PLANT - General - Intermix One or Substitute Any Combination of CFM56-7B Single Annular Combustor (SAC) Engines or CFM56-7B High Pressure Compressor and/or High Pressure Turbine Technology Insertion Kit Engines for the Two CFM56-7B SAC/3 Technology Insertion Program Base Engines

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 71-1582R4	No Effect		-	POWER PLANT - General - Intermix One or Substitute Any Combination of CFM56-7B Single Annular Combustor (SAC) Engines or CFM56-7B High Pressure Compressor and/or High Pressure Turbine Technology Insertion Kit Engines for the Two CFM56-7B SAC/3 Technology Insertion Program Base Engines
SB 71-1588	No Effect		-	POWER PLANT - General - Intermix One or Substitute Any Combination of CFM56-7B Single Annular Combustor (SAC)/3 Technology Insertion Program Engines or CFM56-7B High Pressure Compressor and/or High Pressure Turbine Technology Insertion Kit Engines for the Two CFM56-7B SAC Base Engines
SB 71-1588R1	No Effect		-	POWER PLANT - General - Intermix One or Substitute Any Combination of CFM56-7B Single Annular Combustor (SAC)/3 Technology Insertion Program Engines or CFM56-7B High Pressure Compressor and/or High Pressure Turbine Technology Insertion Kit Engines for the Two CFM56-7B SAC Base Engines
SB 71-1588R2	No Effect		-	POWER PLANT - General - Intermix One or Substitute Any Combination of CFM56-7B Single Annular Combustor (SAC)/3 Technology Insertion Program Engines or CFM56-7B High Pressure Compressor and/or High Pressure Turbine Technology Insertion Kit Engines for the Two CFM56-7B SAC Base Engines
SB 71-1588R3	No Effect		-	POWER PLANT - General - Intermix One or Substitute Any Combination of CFM56-7B Single Annular Combustor (SAC)/3 Technology Insertion Program Engines or CFM56-7B High Pressure Compressor and/or High Pressure Turbine Technology Insertion Kit Engines for the Two CFM56-7B SAC Base Engines

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 71-1588R4	No Effect		-	POWER PLANT - General - Intermix One or Substitute Any Combination of CFM56-7B Single Annular Combustor (SAC)/3 Technology Insertion Program Engines or CFM56-7B High Pressure Compressor and/or High Pressure Turbine Technology Insertion Kit Engines for the Two CFM56-7B SAC Base Engines
SB 71-1588R5	No Effect		-	POWER PLANT - General - Intermix One or Substitute Any Combination of CFM56-7B Single Annular Combustor (SAC)/3 Technology Insertion Program Engines or CFM56-7B High Pressure Compressor and/or High Pressure Turbine Technology Insertion Kit Engines for the Two CFM56-7B SAC Base Engines
SB 71-1588R6	No Effect		-	POWER PLANT - General - Intermix One or Substitute Any Combination of CFM56-7B Single Annular Combustor (SAC)/3 Technology Insertion Program Engines or CFM56-7B High Pressure Compressor and/or High Pressure Turbine Technology Insertion Kit Engines for the Two CFM56-7B SAC Base Engines
SB 71-1588R7	No Effect		-	POWER PLANT - General - Intermix One or Substitute Any Combination of CFM56-7B Single Annular Combustor (SAC)/3 Technology Insertion Program Engines or CFM56-7B High Pressure Compressor and/or High Pressure Turbine Technology Insertion Kit Engines for the Two CFM56-7B SAC Base Engines
SB 71-1608	No Effect		-	POWER PLANT - Power Plant - Inspection and Repair of the Engine Build Up Brackets To Prevent Damage to the Engine Fan Case
SB 71-1658	No Effect		-	POWER PLANT - Change One or Two CFM56-7BE Engines for One or Any Combination of Two CFM56-7B Single Annular Combustor (SAC) Engines or CFM56-7B/3 SAC Engines

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 71-1658R1	No Effect		-	POWER PLANT - Change One or Two CFM56-7BE Engines for One or Any Combination of Two CFM56-7B Single Annular Combustor (SAC) Engines or CFM56-7B/3 SAC Engines
SB 71-1658R2	No Effect		-	POWER PLANT - Change One or Two CFM56-7BE Engines for One or Any Combination of Two CFM56-7B Single Annular Combustor (SAC) Engines or CFM56-7B/3 SAC Engines
SB 71-1673	No Effect		-	POWER PLANT - Change One or Any Combination of Two CFM56-7B Single Annular Combustor (SAC) Engines or CFM56-7B/3 SAC Engines for One or Two CFM56-7BE Engines
SB 71-1673R1	No Effect		-	POWER PLANT - Change One or Any Combination of Two CFM56-7B Single Annular Combustor (SAC) Engines or CFM56-7B/3 SAC Engines for One or Two CFM56-7BE Engines
SB 71-1674	No Effect		-	POWER PLANT - Change One or Any Combination of Two CFM56-7B Single Annular Combustor (SAC) Engines or CFM56-7B/3 SAC Engines for One or Two CFM56-7BE Engines
SB 71-1674R1	No Effect		-	POWER PLANT - Change One or Any Combination of Two CFM56-7B Single Annular Combustor (SAC) Engines or CFM56-7B/3 SAC Engines for One or Two CFM56-7BE Engines
SB 71-1674R2	No Effect		-	POWER PLANT - Change One or Any Combination of Two CFM56-7B Single Annular Combustor (SAC) Engines or CFM56-7B/3 SAC Engines for One or Two CFM56-7BE Engines
SB 71-1682	No Effect		-	POWER PLANT - Power Plant - B1 Flange Inspection
SB 71-1682R1	No Effect		-	POWER PLANT - Power Plant - B1 Flange Inspection
SB 71-1682R2	No Effect		-	POWER PLANT - Power Plant - B1 Flange Inspection
SB 71-1682R3	No Effect		-	POWER PLANT - Power Plant - B1 Flange Inspection

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

	Number	Incorporated	Started/ Completed	ATA	Subject
	SB 71-1717	No Effect		-	POWER PLANT - Engine Cowling - Heat Resistant Aluminized Primer Installation to the Lipskin of the Engine Inlet Cowl
	SB 71-1725	No Effect		-	POWER PLANT - Power Plant - Installation of Engine Ownership Placard
	SB 71-1864	No Effect		-	POWER PLANT (LEAP-1B Engines) - Engine Cowling - Left Fan Cowl Radial Restraint Shear Pin Replacement
	SB 71-1870	No Effect		-	POWER PLANT (LEAP-1B Engines) - Engine Cowling - Left and Right Fan Cowl Assembly Alignment Bumper Installation
A	SB 71-1891	No Effect		-	POWER PLANT (LEAP-1B Engines) - Power Plant - Electronic Engine Control Blower System Change
	SB 71-1937	No Effect		-	POWER PLANT (CFM56 ENGINES (CFM56-7)) - Engine Cowling - Right Fan Cowl Radial Restraint Change and Starter Vent Doubler Installation
	SB 71-1937R1	No Effect		-	POWER PLANT (CFM56 ENGINES (CFM56-7)) - Engine Cowling - Right Fan Cowl Radial Restraint Change and Starter Vent Doubler Installation
	SB 71-1938	No Effect		-	POWER PLANT (CFM56 ENGINES (CFM56-7)) - Engine Cowling - Inlet Cowl Aft Bulkhead Fasteners and Crushable Spacers Replacement
	SB 71-1938R1	No Effect		-	POWER PLANT (CFM56 ENGINES (CFM56-7)) - Engine Cowling - Inlet Cowl Aft Bulkhead Fasteners and Crushable Spacers Replacement
	SB 71-2010	OCT 15/2023	S	SECTION 73-22	POWER PLANT - Power Plant - Change the Operational Thrust Rating of CFM56-7B Engines From 26K to 27K and Return to 26K
A	SB 71-2066	JUN 15/2026	S	SECTION 73-22	POWER PLANT - Power Plant - Change the Operational Thrust Rating of CFM56-7B Engines From 26K to 27K and Return to 26K

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

	Number	Incorporated	Started/ Completed	ATA	Subject
	SB 71A1462	No Effect		-	POWER PLANT - Engine Mounts - Aft Engine Mount, Link Assembly, Hanger Fitting, Inspection, Correction and Identification of Parts
	SB 71A1462R1	No Effect		-	POWER PLANT - Engine Mounts - Aft Engine Mount, Link Assembly, Hanger Fitting, Inspection, Correction and Identification of Parts
	SB 71A1462R2	No Effect		-	POWER PLANT - Engine Mounts - Aft Engine Mount, Link Assembly, Hanger Fitting, Inspection, Correction and Identification of Parts
	SB 71A1462R3	No Effect		-	POWER PLANT - Engine Mounts - Aft Engine Mount, Link Assembly, Hanger Fitting, Inspection, Correction and Identification of Parts
A	SB 73-1018	No Effect		-	ENGINE FUEL AND CONTROL - Fuel Control System - Electronic Engine Control (EEC) Version 6.1 Software Change
	SB 73A1016	No Effect		-	ENGINE FUEL AND CONTROL - Electronic Engine Control (EEC) - Software Change
	SB 73A1016R1	No Effect		-	ENGINE FUEL AND CONTROL - Electronic Engine Control (EEC) - Software Change
	SB 77-1069R2	MAY 12/2026 MAY 12/2026	S	SECTION 77-05 SECTION 77-31	ENGINE INDICATING - Airborne Vibration Monitoring (AVM) System - Replace Conditioner Unit for CFM56-7B Engines
	SB 78-1074	No Effect		-	EXHAUST - Thrust Reverser - Blocker Door Aero/Fire Seal Replacement
	SB 78-1074R1	No Effect		-	EXHAUST - Thrust Reverser - Blocker Door Aero/Fire Seal Replacement
	SB 78-1075	No Effect		-	EXHAUST - Thrust Reverser System - Inspection and Replacement of the Fire Seal on Each Thrust Reverser Half
	SB 78-1075R1	No Effect		-	EXHAUST - Thrust Reverser System - Inspection and Replacement of the Fire Seal on Each Thrust Reverser Half
	SB 78-1076	No Effect		-	EXHAUST - Thrust Reverser System - Replacement of Cascade Assemblies

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 78-1076R1	No Effect		-	EXHAUST - Thrust Reverser System - Replacement of Cascade Assemblies
SB 78-1077	No Effect		-	EXHAUST - Thrust Reverser System - Installation of Lightning Strike Protection on the Thrust Reverser
SB 78-1078	No Effect		-	EXHAUST - Thrust Reverser Indicating System - Addition of a Resistor to the Thrust Reverser Sync Lock Time Delay Circuit
SB 78-1078R1	No Effect		-	EXHAUST - Thrust Reverser Indicating System - Addition of a Resistor to the Thrust Reverser Sync Lock Time Delay Circuit
SB 78-1078R2	No Effect		-	EXHAUST - Thrust Reverser Indicating System - Addition of a Resistor to the Thrust Reverser Sync Lock Time Delay Circuit
SB 78-1078R3	No Effect		-	EXHAUST - Thrust Reverser Indicating System - Addition of a Resistor to the Thrust Reverser Sync Lock Time Delay Circuit
SB 78-1079	No Effect		-	EXHAUST - Thrust Reverser - Thrust Reverser Inner Wall Inspection, Repair, and Cooling Hole Modification
SB 78-1079R1	No Effect		-	EXHAUST - Thrust Reverser - Thrust Reverser Inner Wall Inspection, Repair, and Cooling Hole Modification
SB 78-1079R2	No Effect		-	EXHAUST - Thrust Reverser - Thrust Reverser Inner Wall Inspection, Repair, and Cooling Hole Modification
SB 78-1079R3	No Effect		-	EXHAUST - Thrust Reverser - Thrust Reverser Inner Wall Inspection, Repair, and Cooling Hole Modification
SB 78-1082	No Effect		-	EXHAUST - Thrust Reverser - Installation of a Cooling Hole and Bushing, Apply Sealant and Install Flange Insulation Assemblies on the Thrust Reversers
SB 78-1082R1	No Effect		-	EXHAUST - Thrust Reverser - Installation of a Cooling Hole and Bushing, Apply Sealant and Install Flange Insulation Assemblies on the Thrust Reversers

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 78-1083	No Effect		-	EXHAUST - Thrust Reverser System - Inspection and Change to or Replacement of the Thrust Reverser Actuator Attach Fittings And Actuator Rod Ends
SB 78-1083R1	No Effect		-	EXHAUST - Thrust Reverser System - Inspection and Change to or Replacement of the Thrust Reverser Actuator Attach Fittings And Actuator Rod Ends
SB 78-1083R2	No Effect		-	EXHAUST - Thrust Reverser System - Inspection and Change to or Replacement of the Thrust Reverser Actuator Attach Fittings And Actuator Rod Ends
SB 78-1083R3	JUN 20/2016	C	CHAPTER 78	EXHAUST - Thrust Reverser System - Inspection and Change to or Replacement of the Thrust Reverser Actuator Attach Fittings And Actuator Rod Ends
SB 78-1085	No Effect		-	EXHAUST - Thrust Reverser System - Change to the Insulation Blankets on the Thrust Reversers
SB 78-1085R1	No Effect		-	EXHAUST - Thrust Reverser System - Change to the Insulation Blankets on the Thrust Reversers
SB 78-1086	No Effect		-	EXHAUST - Thrust Reverser System - Inspection of the Fire Seal and Installation of a New Fire Seal Bracket on the Thrust Reverser
SB 78-1086R1	No Effect		-	EXHAUST - Thrust Reverser System - Inspection of the Fire Seal and Installation of a New Fire Seal Bracket on the Thrust Reverser
SB 78-1086R2	No Effect		-	EXHAUST - Thrust Reverser System - Inspection of the Fire Seal and Installation of a New Fire Seal Bracket on the Thrust Reverser
SB 78-1087	No Effect		-	EXHAUST - Thrust Reverser System - Replacement of the Lockout Handle Assembly on the Thrust Reverser Actuators

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Number	Incorporated	Started/ Completed	ATA	Subject
SB 78-1087R1	No Effect		-	EXHAUST - Thrust Reverser System - Replacement of the Lockout Handle Assembly on the Thrust Reverser Actuators
SB 78-1087R2	No Effect		-	EXHAUST - Thrust Reverser System - Replacement of the Lockout Handle Assembly on the Thrust Reverser Actuators
SB 78-1088	No Effect		-	EXHAUST - Thrust Reverser - Thrust Reverser Inner Wall Inspection and Repair
SB 78-1088R1	No Effect		-	EXHAUST - Thrust Reverser - Thrust Reverser Inner Wall Inspection and Repair
SB 78-1089	No Effect		-	EXHAUST - Engine Primary Exhaust Nozzle and Plug Assembly Installation
SB 78-1089R1	No Effect		-	EXHAUST - Engine Primary Exhaust Nozzle and Plug Assembly Installation
SB 78-1090	No Effect		-	EXHAUST - Thrust Reverser System - Inspection for and Removal of the Thrust Reverser Inner Wall Cooling Hole Blockage
SB 78-1090R1	No Effect		-	EXHAUST - Thrust Reverser System - Inspection for and Removal of the Thrust Reverser Inner Wall Cooling Hole Blockage
SB 78-1093	No Effect		-	EXHAUST - Thrust Reverser Control System - Change Wires, Connectors and Backshells for Wire Bundles W7522 and W8228
SB 78-1093R1	No Effect		-	EXHAUST - Thrust Reverser Control System - Change Wires, Connectors and Backshells for Wire Bundles W7522 and W8228
SB 78-1094	No Effect		-	EXHAUST - Thrust Reverser System - Translating Sleeve Acoustic Panel Identification Plate Installation
SB 78-1096	No Effect		-	EXHAUST (CFM56 ENGINES (CFM56-7)) - Thrust Reverser System - Aft Cowl Lower Closeout Fitting Heat Shield and Seals Installation

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

	Number	Incorporated	Started/ Completed	ATA	Subject
	SB 78-1106	No Effect		-	EXHAUST - Turbine Exhaust System - Engine Primary Exhaust Nozzle Change
	SB 78-1106R1	No Effect		-	EXHAUST - Turbine Exhaust System - Engine Primary Exhaust Nozzle Change
A	SB 78A1097	No Effect		-	EXHAUST (CFM56 Engines (CFM56-7)) - Thrust Reverser System - Upper Locking Hydraulic Actuators Integrity Test
	SB 78A1099	No Effect		-	EXHAUST (CFM56 Engines (CFM56-7)) - Thrust Reverser System - Upper Locking Hydraulic Actuators Proximity Sensor Target Correction

A = Added, R = Revised

SERVICE BULLETIN LIST

ECCN 9E991 BOEING PROPRIETARY - See title page for details

INTRODUCTION

1. General

A. This publication was prepared by the Boeing Commercial Airplane Group in accordance with Air Transport Association of America Specification No. 100, Specification for Manufacturers' Technical Data. It contains information required to isolate and correct faults in the systems and equipment installed in the 737-600/700/800/900 family of airplanes.

NOTE: "THIS MANUAL IS PREPARED SPECIFICALLY TO COVER THE BOEING AIRPLANES LISTED IN THE 'LIST OF EFFECTIVE AIRPLANES' SECTION, FOR THE OPERATOR NAMED ON THE TITLE PAGE. IT CONTAINS INSTRUCTIONS AND INFORMATION APPLICABLE SOLELY TO THOSE SPECIFIC AIRPLANES, IN THEIR AS-DELIVERED CONFIGURATION PLUS ANY APPLICABLE BOEING SERVICE BULLETINS OR OTHER OPERATOR CHANGES THE INCORPORATION OF WHICH THE NAMED OPERATOR HAS NOTIFIED BOEING."

NOTE: "THE NAMED OPERATOR IS SOLELY RESPONSIBLE FOR THE ACCURACY AND VALIDITY OF ALL INFORMATION FURNISHED BY THAT NAMED OPERATOR OR ANY OTHER PARTY BESIDES BOEING AND, IF IN RECEIPT OF ACTIVE REVISION SERVICE, THAT ANY MODIFICATIONS TO THE AIRPLANES ARE PROPERLY REFLECTED IN THE MAINTENANCE INSTRUCTIONS CONTAINED IN THIS MANUAL. OPERATORS ARE RESPONSIBLE FOR ENSURING THAT THE MAINTENANCE DOCUMENTATION THEY ARE USING IS COMPLETE AND MATCHES THE CURRENT CONFIGURATION OF THE AIRPLANE. THE BOEING COMPANY ASSUMES NO RESPONSIBILITY IN THIS REGARD. CUSTOMIZATION DOES NOT TRACK THE CONFIGURATION OF AIRCRAFT LISTED ON THE LIST OF EFFECTIVE AIRPLANES PAGE THAT HAVE BEEN CONVEYED TO ANOTHER OPERATOR."

NOTE: "THIS MANUAL IS NOT SUITABLE FOR USE, INCLUDING WITHOUT LIMITATION, GENERAL INSTRUCTIONS OR TRAINING, FOR ANY AIRPLANES NOT LISTED HEREIN, NOR DOES IT NECESSARILY APPLY TO LISTED AIRPLANES THAT HAVE BEEN CONVEYED TO OTHER OPERATORS."

B. Communications concerning this publication should be directed to Boeing Commercial Airplane Group; Attention: Manager, Maintenance Engineering Technical Services. However, to expedite a reply to the proper Boeing organization, it is requested that you use the Publications Change Request form. This form, supplied by Boeing, is available to you through your publications organization or access it on MyBoeingFleet at: https:// www.myboeingfleet.com:443/boldweb/pcr_select.bhtml (user ID and password required). For an account, contact your companies MyBoeingFleet.com Account Administrator or contact Digital Data Customer Support at 1-206-544-9990. You can also e-mail requests directly in the Boeing Communication System at this address: http:// bcsweb.web.boeing.com/. Please provide this information: airline name, your name, phone number, e-mail address, airplane model-type, title of manual or document number, ATA chapter-section-subject, and the description of the change requested.

C. The Fault Isolation Manual and the Fault Reporting Manual together provide a structured method for the airplane operator to report and correct faults in airplane systems.

(1) The Fault Reporting Manual (FRM) is primarily for the flight crews and the cabin crews. The FRM contains these two alphabetical lists of faults:

(a) Observed Faults

(b) Cabin Faults

(2) For each fault in the FRM, there is a unique 8-digit fault code.

ECCN 9E991 BOEING PROPRIETARY - See title page for details

(3) The Fault Isolation Manual (FIM) is for the maintenance crews. It contains alphabetical lists and numerical indexes of all the faults given in the FRM. The FIM also has a fault isolation procedure for each of the faults.

2. Types of Faults

A. Observed Faults

(1) Observed faults are the problem symptoms sensed by the flights crew or the maintenance crew. These are the types of observed faults:

(a) Faults that are shown on the pilot's panels and displays:

1) Fault lights

2) Failure and alert flags

3) Alert messages

4) Indicated values that are not normal.

(b) Flight crew observations in the flight compartment or during walk-around

(c) Servicing crew observations

(d) Ground maintenance crew observations

B. Cabin Faults

(1) Cabin faults are the problems symptoms which can occur with the systems and equipment in the passenger cabin.

C. Maintenance Messages

(1) Maintenance Messages are the fault indications that you get from the Built-in-Test BITE feature of a system or individual component. They help you find the cause of an observed fault. These are Maintenance Messages:

(a) A specific light or lights

(b) An alphanumeric code

(c) A group of English words with or without an associated numeric code.

(2) Most BITE Tests are performed at the front panel of components in the Electronic Equipment Bay. Some BITE Tests are performed in the flight compartment.

(3) The Control Display Unit (CDU)s are in the flight compartment. You can access the BITE for several airplane systems through a CDU.

3. FIM Content - Front Matter

A. Introductory/Record-Keeping Pages

(1) Effective Aircraft

(2) Transmittal Letter

(3) Effective Pages (for front matter)

(4) Effective Chapters

(5) Revision Record

(6) Record of Temporary Revisions

(7) Service Bulletin List

(8) Introduction

ECCN 9E991 BOEING PROPRIETARY - See title page for details

B. Observed Fault List

(1) There are two Observed Fault Lists. For each fault, each list gives a fault code and a FIM task number.

(a) The Observed Faults List (Alphabetical) gives an alphabetical list of all observed faults.

(b) The Observed Fault List (System Order) groups all of the observed faults into applicable airplane systems. The systems are presented in ATA chapter-section order.

(2) Each fault description starts with a keyword. It is possible that different users of the FIM will think of a different keyword to describe a given fault. Because of this, you can find a specific fault in several locations in the alphabetical list, with a different keyword in each location. For example, you will find each of these fault descriptions in the alphabetical list, with the same fault code and task number for each one:

(a) Boom microphone/headset: does not operate - captain's

(b) Headset/boom microphone: does not operate - captain's

(c) Microphone, boom/headset: does not operate - captain's

(3) One of the fault descriptions for a given fault is the "primary" description and the others are "alternate" descriptions. The alphabetical list includes the primary and alternate descriptions for each fault. The system-order list includes only the primary description for each fault. The Fault Code Index in each chapter includes only the primary description for each fault.

C. Cabin Fault List

(1) The Cabin Fault List is divided into sections by system. These are the cabin systems:

(a) Communications/Public Address

(b) Doors/Windows

(c) Emergency Equipment

(d) Galleys

(e) In-Flight Entertainment

(f) Lights

(g) Miscellaneous

(h) Seats


(i) Toilets/Lavatories

(2) In each section of the Cabin Fault List there is an alphabetical list of components. For each component there is a series of possible problems, with a fault code for each problem. There is also a task number if the FIM has a task for the problem.

D. Cabin Fault Code Index

(1) The Cabin Fault Code Index is in alphanumeric order by fault code. It contains the same information as the Cabin Faults List.

ECCN 9E991 BOEING PROPRIETARY - See title page for details

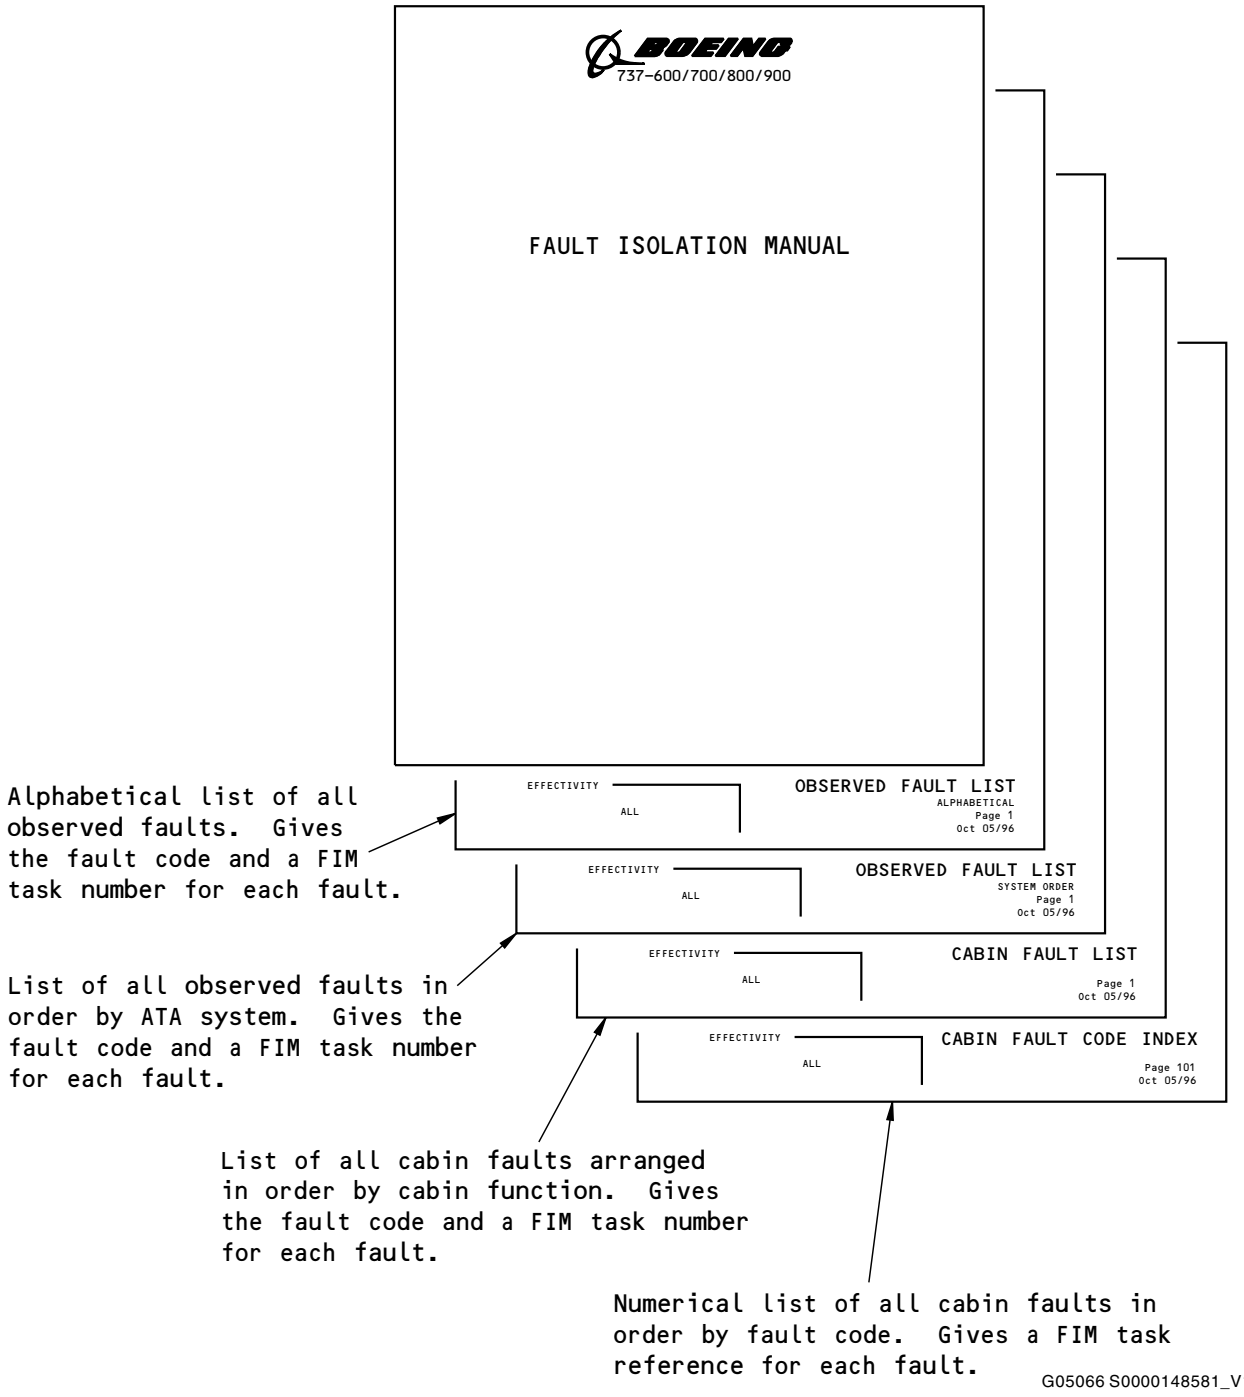

Subjects at Front of FIM
Figure 1

INTRODUCTION

ECCN 9E991 BOEING PROPRIETARY - See title page for details

4. FIM Content - Numbered Chapters

A. List of Effective Pages

B. How to Use the FIM

(1) These are simplified illustrations that give a summary of how to use the FIM and the airplane systems BITE to isolate faults. The six illustrations are:

(a) Fault Isolation Process

(b) Getting Fault Information from BITE

(c) Finding the Fault Isolation Task in the FIM

(d) Doing the Fault Isolation Task

(e) Subjects at the Front of the FIM

(f) Subjects in Each FIM Chapter.

C. Fault Code Index

(1) The Fault Code Index is a numerical list of all fault codes for the chapter. For each code, there is a fault description and a FIM task number. The fault description in the Fault Code Index is the primary description for the fault.

D. Maintenance Message Index

(1) Maintenance messages are the fault indications that you get from the built-in test BITE feature of a system or individual component. They help you find the cause of an observed fault. These are maintenance messages:

(a) A specific light or lights

(b) An alphanumeric code

(c) A group of English words with or without an associated numeric code.

NOTE: Some components and systems have maintenance messages with associated 7-digit codes (for example: 31-61014 or 73-10212). The first two digits of these codes is the FIM chapter of the system for which the fault applies.

(2) The Maintenance Message Index is an alphanumeric listing of the fault indications, codes, or messages from the built-in test equipment (BITE) in that chapter. Components with BITE that can only show internal faults will not be included in the Maintenance Message Indexes.

(3) At the front of each Maintenance Message Index, there is an alphabetical list of all the systems and components that have BITE with messages in the indexes. For each system or component, this list gives the chapter number where you can find the correct Maintenance Message Index.

(4) All of the maintenance messages from a component or system BITE will be in the Maintenance Message Index of the chapter for the specific component or system. If a maintenance message has an associated 7-digit code, where the first two digits are not the same chapter as the component or system BITE, you will also find it in the Maintenance Message Index of the chapter that is the first two digits of the code. This is an example:

(a) The PSEU maintenance message "52-71001 FWD ENT DOOR OPEN" is in the Maintenance Message Index for the PSEU (Chapter 32) and is also in the Chapter 52 Maintenance Message Index.

ECCN 9E991 BOEING PROPRIETARY - See title page for details

E. Tasks

(1) The fault isolation procedures in the FIM are structured as tasks according to the Aircraft Maintenance Task-Oriented Support System (AMTOSS) format described in ATA Specification 100. The introduction to the Aircraft Maintenance Manual (AMM) has a more detailed description of AMTOSS.

(2) Fault isolation tasks are grouped together at the chapter-section level. The tasks are arranged in numerical order by AMTOSS task number.

(3) If there is a system or component that has BITE with any of these qualities, you will find the BITE procedure as the first task in the applicable chapter-section:

(a) The BITE test is not easy to do

(b) The BITE has maintenance messages for external faults as well as for internal faults.

(c) There are steps that you need to do to prepare for the BITE test.

(4) For details on the structure and content of FIM tasks, refer to the paragraph below, "Fault Isolation Task Features".

F. Task Support




CAUTION

MAKE SURE THAT YOU DO ALL OF THE STEPS TO THE END OF THE TASK. LARGE BLANK SPACES CAN OCCUR AT THE BOTTOM OF PAGES WHICH DO NOT ALWAYS INDICATE THAT YOU ARE AT THE END OF THE TASK. IF YOU DO NOT MAKE SURE THAT YOU COMPLETED THE TASK, DAMAGE TO THE EQUIPMENT OR SYSTEM MALFUNCTION COULD OCCUR.

(1) The fault isolation Task Support pages appear in certain chapter-sections at the end of the final task. These pages contain illustrations and charts to support the fault isolation tasks. They include simplified schematics, and component location and access illustrations.

ECCN 9E991 BOEING PROPRIETARY - See title page for details

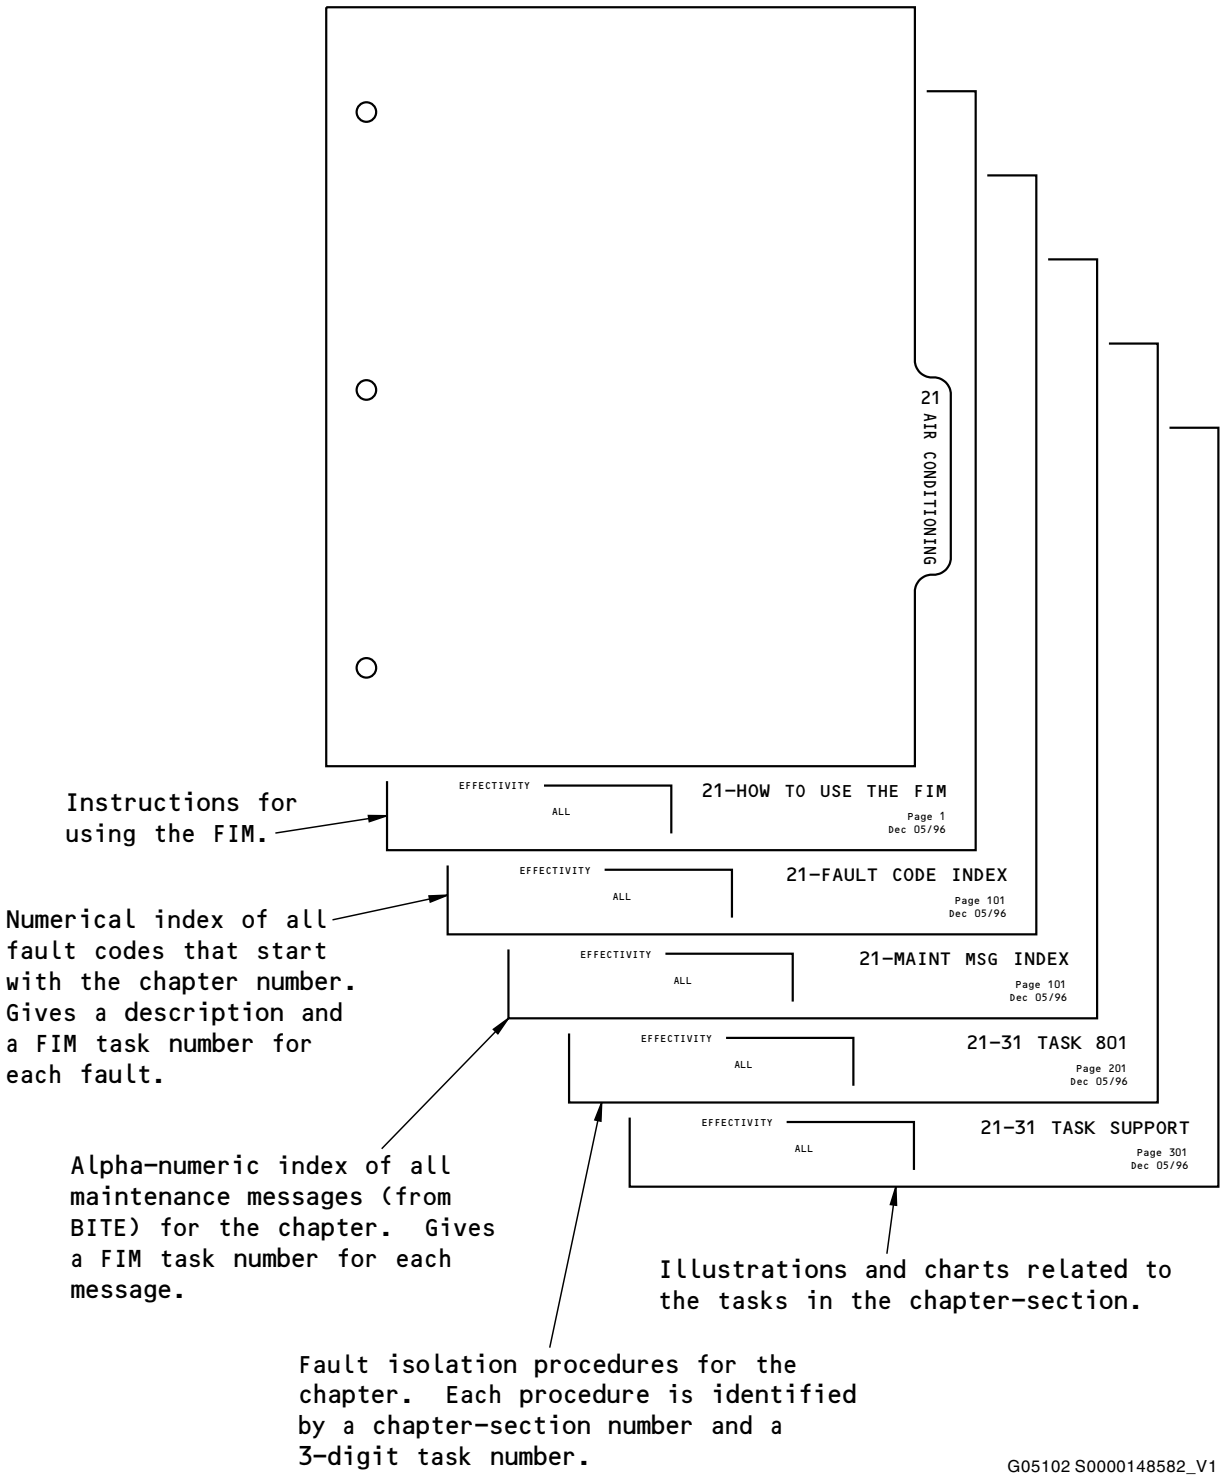

Subjects in Each FIM Chapter
Figure 2

INTRODUCTION

ECCN 9E991 BOEING PROPRIETARY - See title page for details

5. Using the FIM to Isolate Faults

A. Observed Fault

(1) You can find the FIM task for an observed fault by two methods; by the fault code, or by the fault description.

(2) If you have a fault code for the observed fault (possibly reported by the flight crew), then use the Fault Code Index.

(a) Look at the first two digits of the fault code. This is the FIM chapter number you need. Go to that chapter in the FIM and find the Fault Code Index near the front of the chapter.

(b) Find the fault code for the observed fault in the Fault Code Index.

(c) To correct the problem now, read the task number in the GO TO FIM TASK column on the same line as the fault code.

(d) Find the specified task in the applicable section of the FIM and do the steps in the task.

(3) If you do not have a fault code for the observed fault, then use one of the Observed Fault Lists.

(a) If you know the ATA chapter-section number of the system for which the fault applies, then go to the Observed Fault List (System Order) near the front of the FIM. Find the applicable system in the Observed Fault List (System Order).

(b) If you do not know the ATA chapter-section number of the system for which the fault applies, then go to the Observed Fault List (Alphabetical) near the front of the FIM.

(c) Think of a word related to the observed fault (this keyword will be the first word of the fault description).

(d) Find the fault description in the Observed Fault List (look for the keyword alphabetically).

NOTE: If you do not find the fault, try a different keyword.

(e) To correct the problem now, read the task number in the GO TO FIM TASK column on the same line as the fault description.

NOTE: If you want the fault code for the observed fault, you will find it adjacent to the task number.

(f) Find the specified task in the applicable section of the FIM and do the steps in the task.

B. Cabin Fault

(1) You can find the FIM task for an cabin fault by two methods; by the fault code, or by the fault description.

(2) If you have a fault code for the cabin fault (possibly reported by the flight crew or cabin crew), then use the Cabin Fault Code Index.

(a) Go to the Cabin Fault Code Index near the front of the FIM (it is immediately after the Cabin Fault List).

(b) Find the fault code for the cabin fault in the Cabin Fault Code Index.

(c) On the same line as the fault code, look for a task number in the GO TO FIM TASK column.

1) If there is a task number in the GO TO FIM TASK column, then find the specified task in the FIM and do the steps in the task.

2) If "AIRLINE METHOD" is in the GO TO FIM TASK column, then there is no task for the problem in the FIM. Follow your airline's method to correct the problem.

(3) If you do not have a fault code for the cabin fault, then use the Cabin Fault List.

(a) Go to the Cabin Fault List near the front of the FIM.

ECCN 9E991 BOEING PROPRIETARY - See title page for details

(b) Find the pages for the general cabin system (galleys, seats, etc.).

(c) Find the component and problem description for the applicable cabin fault.


NOTE: If you want the fault code for the cabin fault, you will find it adjacent to the task number.

(d) On the same line as the fault description, look for a task number in the GO TO FIM TASK column.

1) If there is a task number in the GO TO FIM TASK column, then find the specified task in the FIM and do the steps in the task.

2) If "AIRLINE METHOD" is in the GO TO FIM TASK column, then there is no task for the problem in the FIM. Follow your airline's method to correct the problem.


ECCN 9E991 BOEING PROPRIETARY - See title page for details

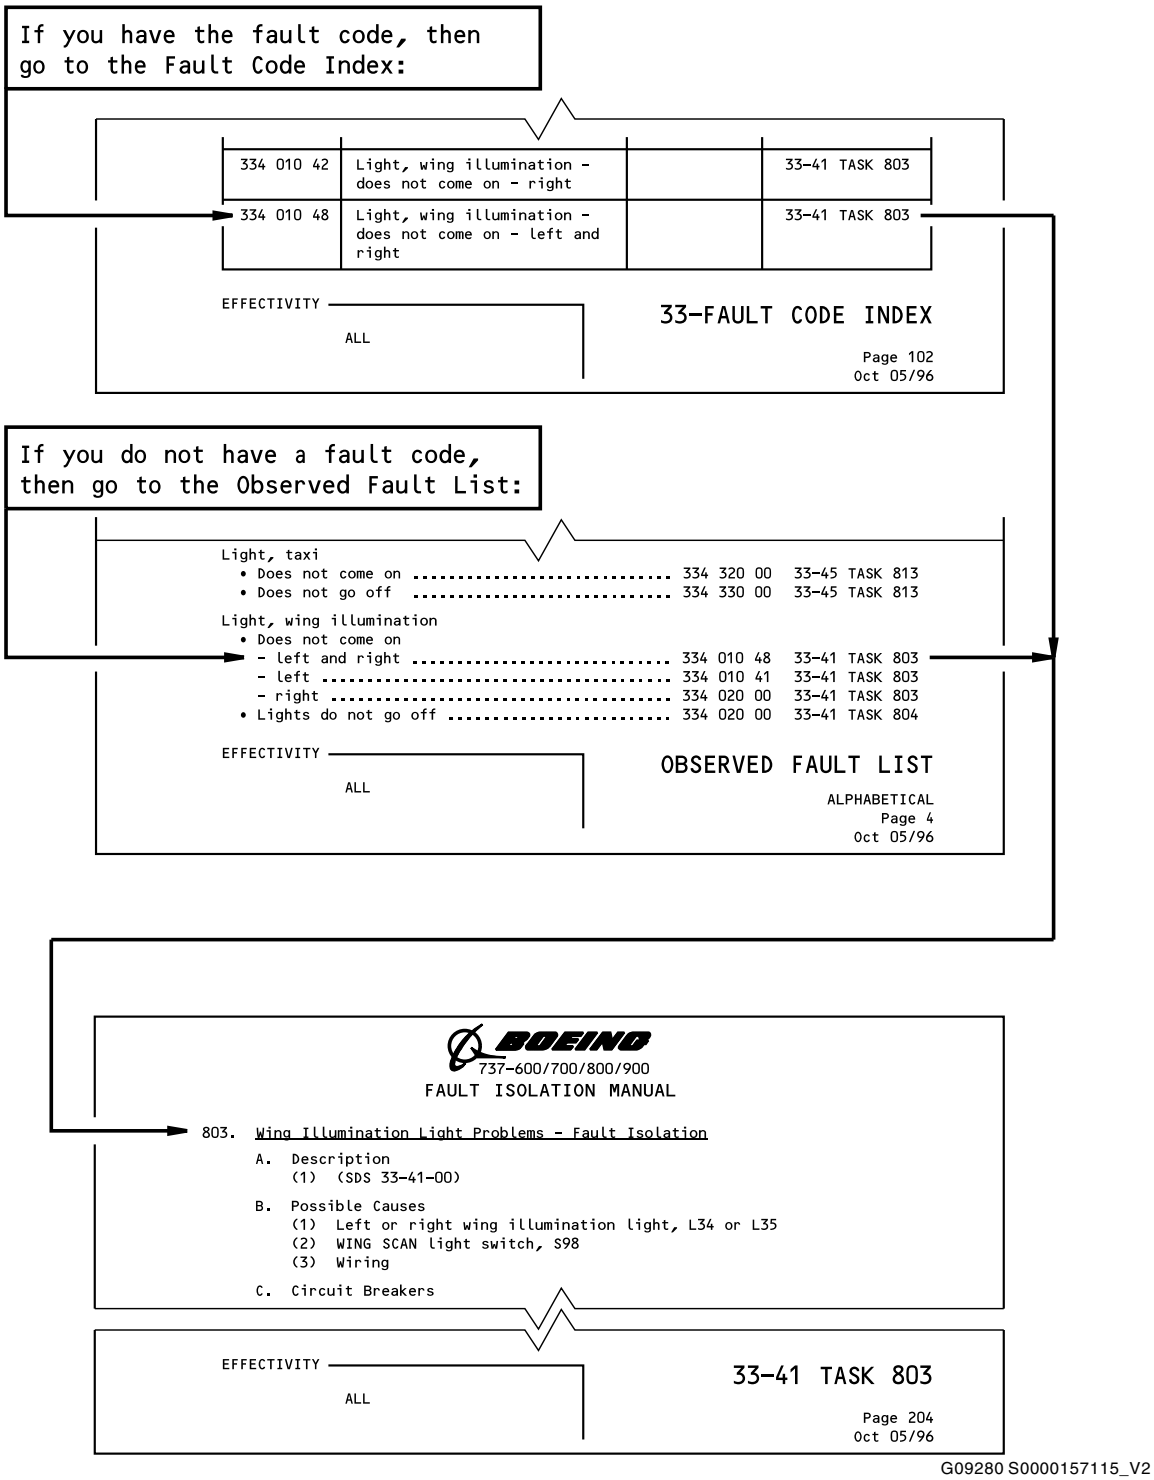

Fault Isolation Process for Observed Fault
Figure 3

INTRODUCTION

ECCN 9E991 BOEING PROPRIETARY - See title page for details

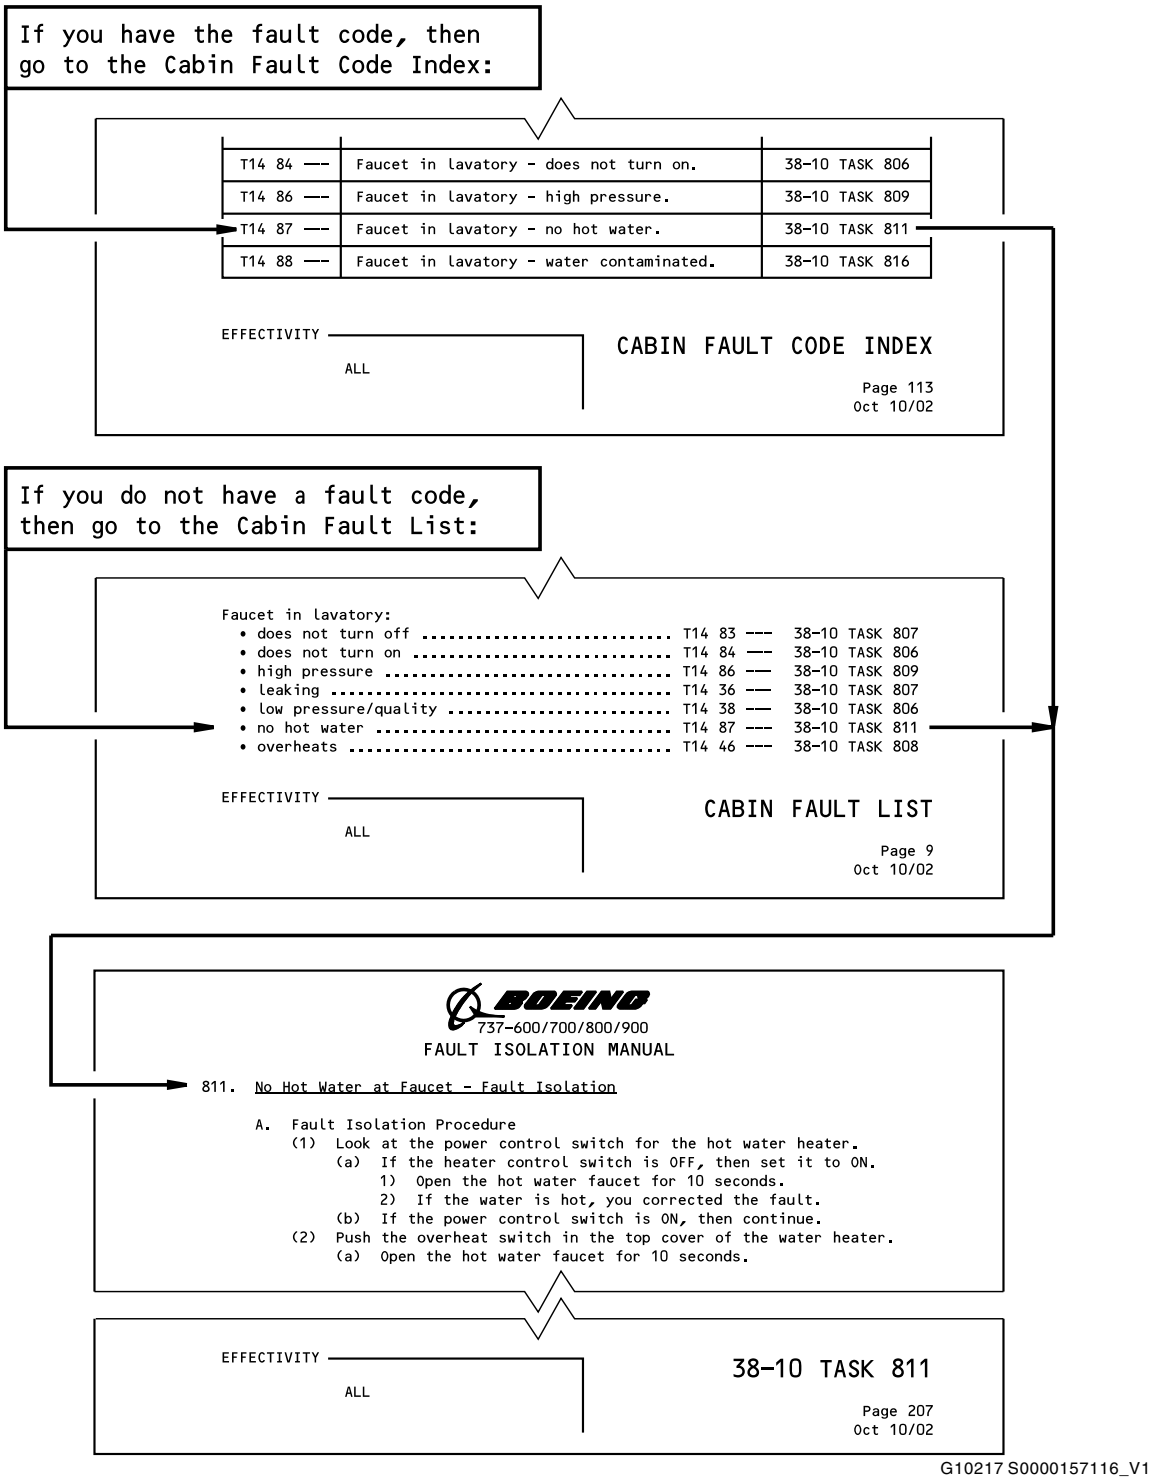

G10217 S0000157116_V1

Fault Isolation Process for Cabin Fault
Figure 4

INTRODUCTION

ECCN 9E991 BOEING PROPRIETARY - See title page for details

6. Fault Isolation Task Features

A. General

(1) The FIM is a tool to help you operate the airplane economically. The procedures in the FIM help you to quickly isolate the cause of each airplane fault.

(2) To isolate the cause of a fault, you can also use your knowledge from:

(a) Your past experience with airplane faults

(b) The conditions under which the fault occurred

(c) The history of faults on your airplane or your fleet.

(3) It is not a requirement to do the steps in the FIM procedure in the order shown. But if you do not plan to follow the FIM procedure exactly, make sure that you read it before you start to isolate the fault. Some FIM procedures start with important steps that have an effect on other steps later in the procedure.

B. Description

(1) The Description paragraph gives information on the conditions that can cause the fault. This paragraph can describe the logic, conditions, and inputs for some faults. The Description paragraph can give a reference to a part of the System Description Section (Part I) of the Aircraft Maintenance Manual.

C. List of Possible Causes

(1) The list of possible causes gives you a way to quickly see the causes that you will find in the Fault Isolation Procedure.

(2) If you use the maintenance records of your airline to see if the fault occurred before, then you can find which steps in the fault isolation task were done in the past and prevent repetition of the same maintenance actions.

(3) You can use this list to find what necessary parts are available before you begin the Fault Isolation Procedure.

D. List of Circuit Breakers

(1) The list of circuit breakers gives you way to quickly know which circuit breakers are part of the circuit that has the problem.

(2) The list gives the name of the circuit breakers the same as you will see on the panel.

(3) There is an alphanumeric code before the name of the circuit breaker. This code gives the panel and the location of the circuit breaker on the panel. The number at the start of the code is the panel number. The letter and the numbers that follow are the grid location for the circuit breaker on the panel. For example; for 18D4, "18" is the Electrical Load Circuit Breaker Panel (P18), "D" is the column on the P18 panel, and "4" is the row on the P18 panel.

E. Related Data

(1) The Related Data paragraph gives references to other data that applies to the problem. The references can be to the Task Support section in the FIM, the System Schematics Manual, or the Wiring Diagram Manual.

F. Initial Evaluation

(1) Most fault isolation tasks have an Initial Evaluation paragraph. The purpose of the Initial Evaluation is to verify that the fault condition still exists before you start the Fault Isolation Procedure. The Initial Evaluation paragraph can also have you do a quick check to learn more about the fault.

ECCN 9E991 BOEING PROPRIETARY - See title page for details

(2) When a specific fault occurs, the steps in the Initial Evaluation will usually verify that the fault exists. Then they will instruct you to do a Fault Isolation Procedure that follows the Initial Evaluation.

(3) When the Initial Evaluation cannot verify that the fault exists at the present time, then the steps in the task cannot isolate the fault. In this case, the Initial Evaluation will tell you that there was an intermittent fault.

(a) If you have an intermittent fault, then follow your airline's policy for intermittent faults.

(b) Use your judgement and the maintenance records of your airline to decide what action to take.

(c) Monitor the airplane to see if the fault occurs on subsequent flights.

(d) If the fault occurs on subsequent flights, then use your judgement to determine which other maintenance action to take.

(4) There is no Initial Evaluation paragraph for observed faults whose existence is readily apparent (for example: wiper blade missing, drain mast frozen, ceiling panel wet). Also, there is no Initial Evaluation paragraph for observed faults whose existence cannot be verified on the ground (for example: engine surge, autopilot problem).

(5) Generally, it is not a requirement to do the Initial Evaluation. However, it is recommended that you always do the Initial Evaluation because it will tell you whether the fault isolation procedure can isolate the fault.

(6) Part or all of the Initial Evaluation can be necessary to set some initial conditions or to find out which Fault Isolation Procedure to do. There will be a note or a step at the beginning of the Fault Isolation Procedure to tell you if any of the Initial Evaluation is necessary.

G. Assumed Conditions at Start of Task

(1) Each fault isolation task starts with these assumptions (unless the task tells you differently):

(a) External electrical power is on.

(b) Hydraulic power is off.

(c) Pneumatic power is off.

(d) Engines are shut down.

(e) All circuit breakers for the system are closed.

(f) No equipment in the system is deactivated.

(g) The fault was caused by a single failure, not multiple simultaneous failures.

H. Fault Isolation Steps

(1) The Fault Isolation Procedure is a sequence of steps which provide several paths to isolate the fault.

(2) There can be a paragraph at the beginning of the procedure to prepare the airplane or system for fault isolation. This will be followed, at the end of the path, by a paragraph to return the airplane or system to normal.

(3) There can be one or more quick checks near the beginning of the procedure. This will help you do much fault isolation in a small amount of time. The quick checks will direct you to the next step to begin the fault isolation path.

(4) The steps that follow any quick checks are more specific checks of the possible causes. The order of the more specific checks of the possible causes can differ from that in the list of possible causes. A specific check of a possible cause that is not the most probable can be quick and easy. For this reason, it can show before the specific check for a possible cause that is more probable.

ECCN 9E991 BOEING PROPRIETARY - See title page for details

(5) To follow the correct path through the Fault Isolation Procedure, remember these rules:

(a) Do the steps of the task in the specified order.

(b) Obey the "If ... then" statements that you see. These will guide you along the correct path.

(c) When you are at the endpoint of the path, the step says "You corrected the fault."

(d) When you see these words, complete the step you are on (if it is necessary). You have now completed the fault isolation.

I. Replacing Components

(1) The steps of the fault isolation task make a clear distinction between the installation of a new component and installation of the same component you removed.

(2) REPLACE

(a) When a step tells you to "Replace" a component, then remove the specified component and install a new component from your airline's stock of spare parts.

(3) RE-INSTALL

(a) In some procedures, a step tells you to remove a component so that you can do a specific check. If the subsequent steps say "Re-install" the component, then install the same component that you removed previously.

(4) INSTALL A NEW

(a) In some procedures, a step tells you to remove a component so that you can do a specific check. If the subsequent steps say "Install a new" component, then install a new or certified serviceable component from your airline's stock of spare parts.

(5) EXCHANGE

(a) If a step tells you to "Exchange" two interchangeable components, then you remove both components, move each component to the other's location, then install those two components. This step is used in some procedures to see if the fault is in the component and moves with the component to the other location.

J. Repair Confirmation

(1) After each corrective action in a Fault Isolation Procedure, there are steps that will verify that you corrected the fault.

(a) If the steps to confirm the repair tell you that "you corrected the fault", then you know that the fault is gone.

(b) If the steps are short, they are inside the paragraph.

(c) If the steps are long, they are in a separate "Repair Confirmation" section at the end of the task.

(d) In the Repair Confirmation paragraph, after the corrective action, if the steps tell you that the fault still exists, then return to the subsequent step of the fault isolation procedure (the step after the one that referred you to the Repair Confirmation).

K. References to Other Manuals

(1) References to tasks in the Aircraft Maintenance Manual (AMM) or to subjects in other manuals look like this:

(a) AMM TASK 12-14-01-600-802 p301

(b) AMM TASK 21-27-01-400-801 p401

(c) FIM 21-31 TASK 804

INTRODUCTION

ECCN 9E991 BOEING PROPRIETARY - See title page for details

(d) FIM 21-31 TASK SUPPORT Fig. 302

(e) SSM 29-11-01

(f) WDM 27-02-44

(g) SWPM 20-60-01

(2) The first two examples above are references to tasks in the AMM. The first six digits of the task number give the AMM chapter-section-subject (12-14-01, 21-27-01). The three digits after the letter "p" (p301, p401) give the first page of the page block that has the task. The third and fourth examples are references to another task in the FIM and to an illustration in the FIM. The last three examples above are references to other manuals.

(3) AMM = Aircraft Maintenance Manual

(4) FIM = Fault Isolation Manual

(5) SSM = System Schematics Manual

(6) WDM = Wiring Diagram Manual

(7) SWPM = Standard Wiring Practices Manual

L. Electrical Checks

(1) Electrical checks are used at components to find if they have a fault. Electrical checks are also used to find a problem in the wiring (also referred to as wiring checks).

(2) A step can tell you to do a specific electrical check. When a step says "Do a wiring check", These are the checks you must do:

(a) Examine any connectors that you disconnect for contamination, damage, and bent or pushed back pins

(b) Do these three types of electrical checks for the specified contacts (pins):

1) Continuity from pin to pin

2) Short circuits between the pins

3) Short circuits from each pin to structure ground.

(3) ARINC 429 Wiring Checks

(a) An ARINC 429 wiring circuit connects a transmitting LRU to one or more receiving LRUs.

(b) To check the resistance between two pins of an ARINC 429 wiring circuit, first remove all LRUs which are connected to the circuit (refer to the applicable wiring diagram or schematic to see which LRUs are connected to the circuit).

1) This will prevent effects on the measurement from the resistance of the ARINC 429 receivers and transmitters in the LRUs.

2) This will prevent damage to connected LRUs by test equipment that operates at a high voltage (for example, when you use an ohmmeter which measures very high resistances to check for insulation problems).

(c) To make electrical measurements at ARINC 600 connectors, use the break out, A34016-XX to get access to the electrical contacts.

(d) After you complete the wiring check (and the subsequent wiring repair, if it is necessary), re-install the LRUs you removed.

ECCN 9E991 BOEING PROPRIETARY - See title page for details

7. Tool Lists

The tables that follow show all of the tools that are referred to in this manual.

There is a table for each type of tool. The data in each table is sorted by the GSE requirement identifier.

- The table for Standard Tools shows the standard tools.
- The table for Commercial Tools shows the tools that are commercially available.
- The table for Special Tools shows the tools that are manufactured for specific requirements.
- When there is a fourth table, it shows the airline-specific tools.

Table 1 Standard Tools

Reference	Description
STD-201	Container - Fuel Resistant, 5-Gallon (19-Liter)
STD-274	DMM - with inductance measuring capabilIty
STD-858	Tag - DO NOT OPERATE
STD-1015	Wrench - Torque, 0 to 200 in-lbs (0 to 22.59 N-m), +/-5% accuracy
STD-1054	Container - Fuel Resistant, 5-Gallon (19-Liter)
STD-1062	Lock - Circuit breaker, Open Position, Approved for Flight
STD-1122	Thermometer - Alcohol/Mercury (or equivalent meter meets task requirements)
STD-1158	Container - 20 Gallon (76 Liter)
STD-1201	Gauge - Pressure, 0-75 PSIG (0-518 KPa)
STD-1223	Collector - Graduated (Scaled)
STD-1231	Multimeter - Standard
STD-1390	Headphone - 600 Ohm, with 1/4 Inch Mono Audio Plug
STD-1397	Gauge - Force
STD-1454	Regulator - Pressure, 0-250 PSI with Pressure Gauge, 3/8 Inch ID Connections
STD-1455	Source - Nitrogen, 0-250 PSIG
STD-3907	Mirror - Dental
STD-3914	Gauge - Hydraulic Pressure, 0 to 2100 psi (0 to 14479 kPa)
STD-6338	Container - Graduated - 1000 ml measuring flask
STD-6505	Container - Measuring, 500 cc, Calibrated in cc (ml)
STD-7422	Meter - Torque, 0-15 in-lbs, +/-5% accuracy, +/- 1 in-lbs resolution
STD-7618	Ohmmeter - Standard
STD-12563	Lamp - 28V DC, 500 mA
STD-12923	Assembly - Adapter Cable (part of SPL-12921)

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Table 2 Commercial Tools

Reference	Description	Part Number	Supplier	A/P Effectivity
COM-1276	Tester - Insulation Resistance (Output Test Voltage 100/250/500/1000 VDC or equivalent)	1587 FC	4U744	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		212359	U0146	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		L-5	60336	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 212459 (OR 212459CL)	1UZZ9	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 656	2K742	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
COM-1550	Bonding Meter - Approved, Intrinsically Safe (Approved for use in Class I, Divisions I & II hazardous (classified) locations. Outside these hazardous locations, COM-614 can be used in lieu of COM-1550).	620LK	1CRL2	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		720A-BK-KIT	49374	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		M1	3AD17	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER

INTRODUCTION

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Table 2 Commercial Tools (Continued)

Reference	Description	Part Number	Supplier	A/P Effectivity
COM-1550 (Cont)		M1B	3AD17	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		T477W (C15292)	06659	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
COM-1557	Gauge - Force	DG-200	92456	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		FDIX 100	0BFD9	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		FDIX 50	0BFD9	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		FG-60KBM	45KA8	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		LG-050	92456	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		LG-100	92456	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: DPP-500G	92456	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER

INTRODUCTION

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Table 2 Commercial Tools (Continued)

Reference	Description	Part Number	Supplier	A/P Effectivity
COM-1557 (Cont)		Opt: DPPH-150	92456	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: DPPH-200	92456	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: DPPH-50	92456	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: FDI 100	0BFD9	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: FDI 50	0BFD9	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: FDV 100	0BFD9	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: FDV 50	0BFD9	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
COM-1562	Analyzer - Data Bus, ARINC 429	01-1001-05	0Z3C6	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		01-1001-12	0Z3C6	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER

INTRODUCTION

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Table 2 Commercial Tools (Continued)

Reference	Description	Part Number	Supplier	A/P Effectivity
COM-1562 (Cont)		403557	CG603	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		800-0630	1JSZ6	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		DT400H-01	0Z3C6	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		UA1410	0H231	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 01-1001-10	0Z3C6	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 01-1404-00	41364	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 1116-4000-21	A0197	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 429EBP	41364	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 429EX	41364	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER

INTRODUCTION

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Table 2 Commercial Tools (Continued)

Reference	Description	Part Number	Supplier	A/P Effectivity
COM-1562 (Cont)		Opt: 702125-01	CG603	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: DT400H	0Z3C6	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: MODEL 429HBA	5J927	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: TYPE 030/026	$0494	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
COM-1572	Thermometer - Infrared, Intrinsically Safe	568 EX	89536	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		568 EX/BR	89536	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		568 EX/CN	89536	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		568 EX/ETL	89536	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: DHS24XC-FM	08086	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Table 2 Commercial Tools (Continued)

Reference	Description	Part Number	Supplier	A/P Effectivity
COM-1572 (Cont)		Opt: DHS24XF-FM	08086	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: EX-MP4 A	3GT36	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: IR-16L3 IS	75037	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
COM-1741	Meter - LCR (Inductance, Capacitance, Resistance; Use COM-20443 for OH bleed loop testing)	878B	08098	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		879B	08098	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		880	08098	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		U1733P	1LQK8	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 875B	08098	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 878A	08098	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER

INTRODUCTION

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Table 2 Commercial Tools (Continued)

Reference	Description	Part Number	Supplier	A/P Effectivity
COM-1741 (Cont)		Opt: 879	08098	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
COM-1793	Multimeter - Digital/Analog (or equivalent meter meets task requirements)	117	89536	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		260-8XPI	55026	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		287	89536	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		289	89536	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		87V	89536	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		FLUKE 27 II	89536	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		FLUKE-77-4	89536	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		WA2025	4MJL8	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Table 2 Commercial Tools (Continued)

Reference	Description	Part Number	Supplier	A/P Effectivity
COM-1793 (Cont)		Opt: 187	89536	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 189	89536	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 21	89536	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 27	89536	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 77 SERIES III	89536	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 87	89536	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: FLUKE 27	89536	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: MODEL 27	89536	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
COM-1797	Stethoscope - Mechanics, 12 Inch Probe	GA111D	55719	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER

INTRODUCTION

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Table 2 Commercial Tools (Continued)

Reference	Description	Part Number	Supplier	A/P Effectivity
COM-1797 (Cont)		Opt: GA111C	55719	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
COM-1914	Test Set - Air Data Model FLMTS (Flight Line Maintenance)	ADSE 650	3BSK6	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		ADTS2000	52892	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		ADTS3350ER	52892	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		ADTS405MKII	U0427	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		ADTS530	U0427	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		ADTS552F	U0427	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		ADTS553F	U0427	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		ADTS554F	U0427	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER

INTRODUCTION

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Table 2 Commercial Tools (Continued)

Reference	Description	Part Number	Supplier	A/P Effectivity
COM-1914 (Cont)		D60340MK	K1474	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		DPS1000	21844	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		MODEL 6300	0RDZ5	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		MPS34C	48RQ2	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		MPS43B	A0197	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		MPS45	48RQ2	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		MPS49	48RQ2	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		TES9463	88277	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 01-0987-00	41364	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Table 2 Commercial Tools (Continued)

Reference	Description	Part Number	Supplier	A/P Effectivity
COM-1914 (Cont)		Opt: 18910480000	89944	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 18910920000	89944	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: ADTS405F	U0427	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: ADTS505	U0427	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: D60302	K1474	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: D60340	K1474	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: D60383	K1474	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: DPS350	21844	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: DPS450	21844	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Table 2 Commercial Tools (Continued)

Reference	Description	Part Number	Supplier	A/P Effectivity
COM-1914 (Cont)		Opt: DPS500	21844	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: MPS31C	48RQ2	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: MPS43	A0197	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
COM-4316	Fiberscope - Flexible Borescope	IF2D5	32212	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 7110561	32212	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: IF6C5X1-8	32212	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
COM-5187	Reflectometer - Time Domain (TDR)	1205CXB	93929	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		6021-5154	1UW81	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		W1101	FB3T5	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Table 2 Commercial Tools (Continued)

Reference	Description	Part Number	Supplier	A/P Effectivity
COM-5187 (Cont)		Opt: 1205	93929	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 1205CXA	93929	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 1270	93929	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 1270A	93929	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 1502C	80009	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: 900AST	53387	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
COM-5892	Jack - Tripod, Forward Body	15-54-40	00994	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		714A	94861	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
COM-7456	Analyzer - Oxygen	MODEL 111B	1UM84	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER

INTRODUCTION

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Table 2 Commercial Tools (Continued)

Reference	Description	Part Number	Supplier	A/P Effectivity
COM-7517	Test Kit - Oil Condition	MODEL V3A	96009	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: MODEL V-3	96009	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
COM-10724	Megohmmeter (10-50 VDC, 50-100 VDC, 100-500 VDC, 500-1090 VDC, 50 k Ohms - 200 T Ohms, +/-3% Basic Accuracy)	1864-9700	62015	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
COM-13811	Multimeter (Analog / Digital with Low/ High Z Impedance functions or equivalent)	FLUKE 289	89536	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		WA2025	4MJL8	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: MODEL 8 MK7	00426	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
COM-17158	Controller - Loop	Opt: 9240 SI	FBCN9	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
COM-17417	Controller - Loop	20549 SI	FBCN9	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
COM-20443	Meter - LCR and Z (Inductance, Capacitance, Resistance and Impedance)	880	08098	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER

INTRODUCTION

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Table 3 Special Tools

Reference	Description	Part Number	Supplier	A/P Effectivity
SPL-1473	Probe - Kit, Ultrasonic Leak	B00033	62373	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		ST6760A-1	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
SPL-1585	Kit - Rigging Pin	F70207-109	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
SPL-1676	Lock Assembly - Flight Controls (used on valve p/n 10-60710-2 and 10-60710-6)	F80049-66	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: F80049-17	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: F80049-31	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: F80049-46	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
SPL-1681	Adapter - Force Check, Rudder Pedal	F80212-30	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
SPL-1690	Actuators/Deactuators Set - Proximity Sensor	8-758-01	08748	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER

INTRODUCTION

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Table 3 Special Tools (Continued)

Reference	Description	Part Number	Supplier	A/P Effectivity
SPL-1690 (Cont)		A27092-139	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		A27092-146	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: A27092-106	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: A27092-84	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
SPL-1742	Regulator - Air Pressure, Elevator Feel Computer	F72928-109	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		F72928-110	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		F72928-111	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: F72928-58	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: F72928-62	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Table 3 Special Tools (Continued)

Reference	Description	Part Number	Supplier	A/P Effectivity
SPL-1742 (Cont)		Opt: F72928-63	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
SPL-1771	Alignment Equipment - Fuel Shutoff Valve	B28009-1	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
SPL-1934	Equipment - Test, Pressure Leak, Crew Oxygen System	C35001-37	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: C35001-1	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
SPL-2462	Deactivator - Check Valve	C21006-7	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: C21006-1	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: PF80-012-500	053H3	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
SPL-5359	Test Fixture - Rod End and Stroke Stop, Locking and Non-Locking Thrust Reverser Actuator			
SPL-6190	Force Gage Equipment - Landing Gear Lever, Flight Deck	G32021-18	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Table 3 Special Tools (Continued)

Reference	Description	Part Number	Supplier	A/P Effectivity
SPL-6191	Diagnostic - Air Pack	020240-01	64818	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		C21007-74	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
SPL-9118	Kit - Rigging Pin	F70207-128	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
SPL-11153	Air Sampler, Aircraft Pneumatic System	J21009-48	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: J21009-33	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
SPL-12921	Test Equipment - Compartment Overheat Detection Module	C26007-72	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: C26007-1	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
SPL-12922	Assembly - Extender Box C26007-3, -73 (included in C26007 Eqpt)	C26007-72	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: C26007-1	81205	737-600, -700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER

ECCN 9E991 BOEING PROPRIETARY - See title page for details

Table 3 Special Tools (Continued)

Reference	Description	Part Number	Supplier	A/P Effectivity
SPL-13463	Test Cabling - 737 BSI (Boeing Sky Interior) Light Assemblies (for airplane with BSI only)	C33001-61	81205	737-700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: C33001-1	81205	737-700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER
		Opt: C33001-58	81205	737-700, -700BC, -700BJ, -700C, -700ER, -700QC, -800, -800BCF, -800BJ, -900, -900BJ, -900ER

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
5G Interference of Radio Altimeter Signals	343 601 00	34-33 TASK 809
A/P amber warning annunciator light		
• light on flashing, autopilot went to CWS mode	221 020 00	22-11 TASK 801
A/P red warning annunciator light		
• light on steady	221 010 00	22-11 TASK 801
A/T amber warning annunciator light		
• light on flashing	223 120 00	22-32 TASK 801
A/T LIMIT indication shows on autothrottle thrust mode display	223 220 00	22-32 TASK 815
Abnormal noise during APU system operation	492 162 00	49-55 TASK 809
AC and DC metering panel		
• has missing segments	243 030 00	24-31 TASK 827
AC Generator Drive System		
• DRIVE Light is illuminated		
- GEN-1	241 010 01	24-11 TASK 801
- GEN-2	241 010 02	24-11 TASK 802
• DRIVE Light is not illuminated		
- GEN-1	241 012 01	24-11 TASK 804
- GEN-2	241 012 02	24-11 TASK 805
• Red DPI Button is extended		
- GEN-1	241 011 01	24-11 TASK 803
- GEN-2	241 011 02	24-11 TASK 803
ACARS		
• call annunciation problem	232 328 00	23-27 TASK 818
• CDU interface problem	232 326 00	23-27 TASK 815
• CDU scratchpad shows APM WARN	232 315 00	23-27 TASK 825
• CMU cannot print data to the Multi-function Printer	232 719 00	23-27 TASK 812
• communication problem	232 325 00	23-27 TASK 814
• does not operate correctly	232 310 00	23-27 TASK 801
• input problem	232 327 00	23-27 TASK 816
• MU cannot print data to the Multi-function Printer	232 720 00	23-27 TASK 812

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Accessory compartment light		
• does not come on	333 050 00	33-30 TASK 801
• Does not go off	333 051 00	33-30 TASK 801
ADF		
• Audio problem		
- no. 1	345 310 01	34-57 TASK 806
- no. 2	345 310 02	34-57 TASK 807
• Bearing pointer 1 does not show, ADF flag does not show		
- no. 1	345 370 01	34-57 TASK 820
• Bearing pointer 2 does not show, ADF flag does not show		
- no. 2	345 370 02	34-57 TASK 821
• indication blank		
- no. 1 captain's	345 320 31	34-57 TASK 808
- no. 1 captain's and first officer's	345 320 48	34-57 TASK 810
- no. 1 first officer's	345 320 32	34-57 TASK 809
- no. 2 captain's	345 330 31	34-57 TASK 811
- no. 2 captain's and first officer's	345 330 48	34-57 TASK 813
- no. 2 first officer's	345 330 32	34-57 TASK 812
• Tone problem		
- no. 1	345 340 01	34-57 TASK 814
- no. 2	345 340 02	34-57 TASK 815
ADF control panel problem	345 380 00	34-57 TASK 822
ADF flag shows on the display		
- no. 1 captain's	345 350 31	34-57 TASK 816
- no. 1 first officer's	345 350 32	34-57 TASK 817
- no. 2 captain's	345 360 31	34-57 TASK 818
- no. 2 first officer's	345 360 32	34-57 TASK 819
ADF flag shows on the radio magnetic indicator	342 430 00	34-22 TASK 803
AFT cargo fire light		
• light on (false alarm)	261 225 45	26-16 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Aft entry door		
• Difficult to operate between cocked and fully open position		
- door jamming or binding	521 015 45	52-10 TASK 813
Aft galley door		
• Difficult to operate between cocked and fully open position		
- door jamming or binding	524 015 45	52-10 TASK 814
AFT SUPPLY DUCT air temperature indication is not correct	216 170 00	21-61 TASK 860
AFT ZONE CABIN air temperature indication is not correct	216 120 00	21-61 TASK 857
Aileron		
• Does not go back to neutral		
- left	271 060 41	27-11 TASK 803
- left and right	271 060 48	27-11 TASK 802
- right	271 060 42	27-11 TASK 803
• does not move to full travel		
- left	271 010 41	27-11 TASK 805
- left and right	271 010 48	27-11 TASK 806
- right	271 010 42	27-11 TASK 805
• does not operate		
- left	271 020 41	27-11 TASK 807
- left and right	271 020 48	27-11 TASK 812
- right	271 020 42	27-11 TASK 807
• high trim	271 120 00	27-11 TASK 816
• slow response to contol wheel movement, hydraulic power on	271 110 00	27-11 TASK 808
Aileron trim		
• left wing down and right wing down does not operate	271 050 48	27-11 TASK 815
• left wing down does not operate	271 050 41	27-11 TASK 814
• right wing down does not operate	271 050 42	27-11 TASK 814

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Air		
• no flow from foot outlet		
- captain's	212 020 31	21-22 TASK 801
- first officer's	212 020 32	21-22 TASK 801
• no flow from windshield outlet		
- captain's	212 010 31	21-22 TASK 801
- first officer's	212 010 32	21-22 TASK 801
Air conditioning compartment light		
• does not come on		
- left	333 030 41	33-30 TASK 801
- right	333 030 42	33-30 TASK 801
• Does not go off		
- left	333 031 41	33-30 TASK 801
- right	333 031 42	33-30 TASK 801
Air inlet door, for the APU		
• Does not fully open or fully close	491 010 00	49-60 TASK 801
Air mix valve indicator		
• does not operate, pointer does not move, temperature is OK		
- CONT CABIN	216 010 00	21-61 TASK 841
- PASS CABIN	216 020 00	21-61 TASK 841
Air mode		
• Shows with the airplane on the ground	320 020 00	32-09 TASK 801
Air outlet, foot		
• no flow		
- captain's	212 020 31	21-22 TASK 801
- first officer's	212 020 32	21-22 TASK 801
Air outlet, windshield		
• no flow		
- captain's	212 010 31	21-22 TASK 801
- first officer's	212 010 32	21-22 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Air supply cleaner purge valve (at air conditioning pack)		
• does not operate correctly during system test		
- left pack	217 821 41	21-75 TASK 801
- right pack	217 821 42	21-75 TASK 801
AIR TEMP indication problem		
- air temperature selector at AFT SUPPLY DUCT	216 170 00	21-61 TASK 860
- air temperature selector at AFT ZONE CABIN	216 120 00	21-61 TASK 857
- air temperature selector at CONT CAB SUPPLY DUCT	216 140 00	21-61 TASK 858
- air temperature selector at FWD SUPPLY DUCT	216 180 00	21-61 TASK 859
- air temperature selector at FWD ZONE CABIN	216 130 00	21-61 TASK 856
- air temperature selector at PACK L	215 060 00	21-61 TASK 854
- air temperature selector at PACK R	215 070 00	21-61 TASK 855
- air temperature selector at PASS CABIN	216 190 00	21-61 TASK 843
- air temperature selector at SUPPLY DUCT	216 160 00	21-61 TASK 842
Airframe		
• Vibration or lateral oscillation is excessive	055 170 00	05-51 TASK 813
Airspeed display		
• does not show		
- captain's	342 045 31	31-63 TASK 809
- first officer's	342 045 32	31-63 TASK 809
• minimum manuever speed or minimum speed on captain's PFD disagrees with first officer's PFD	342 044 00	34-21 TASK 830
• Shows IAS DISAGREE message		
- captain's	342 046 31	31-62 TASK 876
- first officer's	342 046 32	31-62 TASK 876
Airspeed Unreliable	342 065 00	31-62 TASK 876
Airstair tread light		
• does not come on	334 290 00	33-40 TASK 801
• Does not go off	334 291 00	33-40 TASK 801
Airstair, forward		
• uncommanded motion	526 560 00	Reference Not Currently Available

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
ALIGN lights for the L and R IRS		
• lights on flashing	342 230 00	34-21 TASK 805
ALT DISAGREE message shows on airpseed display		
- captain's	342 091 31	31-62 TASK 875
- first officer's	342 091 32	31-62 TASK 875
ALT flag shows on integrated standby flight display	342 602 00	34-24 TASK 805
ALT flag shows on the EFIS display		
- captain's	342 080 31	34-21 TASK 827
- first officer's	342 080 32	34-21 TASK 828
Altitude display		
• is blank		
- captain's	342 090 31	31-63 TASK 809
- first officer's	342 090 32	31-63 TASK 809
• shows ALT DISAGREE message		
- captain's	342 091 31	31-62 TASK 875
- first officer's	342 091 32	31-62 TASK 875
Altitude reporting		
• does not operate		
- ATC switch at 1	345 110 01	34-53 TASK 801
- ATC switch at 1 or 2	345 110 48	34-53 TASK 801
- ATC switch at 2	345 110 02	34-53 TASK 801
Altitude Unreliable	342 095 00	31-62 TASK 875
ALTITUDE window display on the mode control panel		
• does not change with altitude selector switch change	221 770 00	22-11 TASK 803
• does not show	221 780 00	22-11 TASK 803
ALTN mode light for the EEC		
• light does not come ON during the EEC Test		
- engine 1	730 350 51	73-05 TASK 810
- engine 2	730 350 52	73-05 TASK 810
• light on		
- engine 1	730 080 51	73-05 TASK 811
- engine 2	730 080 52	73-05 TASK 811

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Angle of attack (AOA) indication on PFD		
• captain's and first officer's indicators do not agree	342 151 00	34-21 TASK 834
Anti-collision (strobe) light		
• Does not go off		
- left wing	334 250 41	33-44 TASK 801
- right wing	334 250 42	33-44 TASK 801
- tail	334 260 00	33-44 TASK 801
Anti-collision light		
• does not come on correctly		
- left wing	334 230 41	33-44 TASK 801
- lower	334 270 47	33-44 TASK 801
- right wing	334 230 42	33-44 TASK 801
- tail	334 240 00	33-44 TASK 801
- upper	334 270 46	33-44 TASK 801
• Does not go off		
- lower	334 280 47	33-44 TASK 801
- upper	334 280 46	33-44 TASK 801
ANTI-ICE & RAIN ENG 1 & WING CONT circuit breaker tripped.	301 121 00	30-11 TASK 810
ANTISKID INOP light		
• light on	324 070 00	32-42 TASK 829
AOA DISAGREE message shows on PFDs	342 151 00	34-21 TASK 834
APU		
• Abnormal noise during system operation	492 162 00	49-55 TASK 809
• Air Inlet Door does not fully open or fully close	491 010 00	49-60 TASK 801
• backfire	492 150 00	49-55 TASK 801
• does not start, FAULT light ON	492 100 00	49-60 TASK 801
• does not start, MAINT light ON	492 110 00	49-60 TASK 801
• does not start, no APU indication lights ON	492 130 00	49-15 TASK 805
• does not start, OVER SPEED light ON	492 120 00	49-60 TASK 801
• fire false alarm	261 060 00	26-10 TASK 801
• fuel valve does not fully open or fully close	493 010 00	49-60 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
APU (continued)		
• oil consumption high	492 140 00	49-95 TASK 801
• Operates with hydraulic contaminated fuel	491 040 00	49-10 TASK 811
• Surges during ECS operation	492 161 00	49-55 TASK 810
• Surges during main engine start	492 160 00	49-55 TASK 808
• Vibration is excessive	491 020 00	49-15 TASK 807
APU BITE INOP message shows on the CDU	496 010 00	49-65 TASK 801
APU BOTTLE DISCHARGED light for the APU fire extinguishing system		
• light on	262 070 00	26-20 TASK 802
APU DET INOP light		
• light on	261 050 00	26-10 TASK 801
APU EGT indicator		
• does not operate correctly	497 010 00	49-75 TASK 801
APU FAULT light		
• light on, APU had a protective shutdown	492 010 00	49-60 TASK 801
• light on, APU operates without a protective shutdown	492 020 00	49-15 TASK 801
APU fire detector fault	261 050 00	26-10 TASK 801
APU fire extinguishing		
• APU light on fire control panel comes on when not commanded	262 221 00	26-20 TASK 806
• Bottle does not release extinguishant when activated at the remote APU fire control panel	262 130 00	26-20 TASK 804
• Bottle does not release extinguishant when the fire handle is turned	262 120 00	26-20 TASK 803
• indication not normal when the EXT TEST switch is moved to 1 or 2	262 080 00	26-20 TASK 801
APU GEN OFF BUS light		
• light not on, APU speed at 95%	492 050 00	49-15 TASK 804
• light on with APU generator on line	242 050 00	24-21 TASK 801
APU generator will not come on line	242 045 00	24-21 TASK 820

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
APU LOW OIL PRESSURE light		
• light on, APU had a protective shutdown	492 060 00	49-60 TASK 801
• light on, APU operates with no protective shutdown	492 030 00	49-15 TASK 802
APU MAINT light		
• light on	492 070 00	49-60 TASK 801
APU OVER SPEED light		
• light on during APU shutdown	492 080 00	49-60 TASK 801
• light on, APU had a protective shutdown	492 090 00	49-60 TASK 801
• light on, APU operates with no protective shutdown	492 040 00	49-15 TASK 803
APU service light		
• does not come on	333 060 00	33-30 TASK 801
• Does not go off	333 061 00	33-30 TASK 801
APU starter-generator		
• noisy during APU start	491 030 00	49-45 TASK 803
Arm rest problem		
- captain's	251 060 31	25-99 TASK 801
- first officer's	251 060 32	25-99 TASK 801
Ash (volcanic) condition	055 050 00	05-51 TASK 803
Assist handle problem		
- captain's	251 100 31	25-99 TASK 801
- first officer's	251 100 32	25-99 TASK 801
ATC		
• Altitude reporting does not operate		
- no. 1	345 110 01	34-53 TASK 801
- no. 1 and no. 2	345 110 48	34-53 TASK 801
- no. 2	345 110 02	34-53 TASK 801
• code indicator does not respond to selector movement	345 120 00	34-53 TASK 814
• Transmission weak or intermittent		
- no. 1	345 130 01	34-53 TASK 802
- no. 1 and no. 2	345 130 48	34-53 TASK 801
- no. 2	345 130 02	34-53 TASK 803
• Transponder fail light on	345 140 00	34-53 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
ATC System		
• XPNDR FAIL light on the ATC Control Panel is on	345 113 00	34-53 TASK 817
ATT flag shows on integrated standby flight display	342 603 00	34-24 TASK 806
ATT flag shows on the EFIS display		
- captain's	342 010 31	34-21 TASK 825
- first officer's	342 010 32	34-21 TASK 826
Attendant control panel		
• amber light on ACP switch assembly does not come on during operational test	234 811 00	23-42 TASK 841
Attitude display		
• does not show		
- captain's	342 015 31	31-63 TASK 809
- first officer's	342 015 32	31-63 TASK 809
Audio control panel indicator light problem		
- captain's	235 101 31	23-51 TASK 807
- first observer's	235 101 33	23-51 TASK 807
- first officer's	235 101 32	23-51 TASK 807
Audio control panel selector switch problem		
- captain's	235 103 31	23-51 TASK 807
- first observer's	235 103 33	23-51 TASK 807
- first officer's	235 103 32	23-51 TASK 807
Audio control panel volume control problem		
- captain's	235 102 31	23-51 TASK 807
- first observer's	235 102 33	23-51 TASK 807
- first officer's	235 102 32	23-51 TASK 807
AUTO BRAKE DISARM light		
• light on	324 080 00	32-42 TASK 828
AUTO FAIL light		
• light on and ALTN light on, AUTO FAIL light goes off when pressurization mode selector switch is at ALTN	213 010 00	21-31 TASK 801
• light on, ALTN light not on	213 020 00	21-31 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
AUTO SLAT FAIL light		
• light on	278 060 00	27-32 TASK 801
AUTO temperature control		
• does not operate		
- AFT CAB	216 050 00	21-62 TASK 905
- CONT CAB	216 040 00	21-62 TASK 905
- FWD CAB	216 060 00	21-62 TASK 905
- PASS CABIN	216 070 00	21-61 TASK 862
• Too cold, cannot make warmer in AUTO and MANUAL mode, air mix valve does not move to HOT		
- CONT CABIN	216 460 00	21-61 TASK 845
- PASS CABIN	216 470 00	21-61 TASK 847
• Too cold, cannot make warmer, OK in MANUAL mode		
- CONT CABIN	216 420 00	21-61 TASK 801
- PASS CABIN	216 430 00	21-61 TASK 801
• Too cold, no temperature control in AUTO		
- CONT CABIN	216 435 00	21-62 TASK 905
- PASS CABIN	216 405 00	21-62 TASK 905
• Too hot, cannot make cooler in AUTO and MANUAL mode, air mix valve does not move to COLD		
- CONT CABIN	216 440 00	21-61 TASK 844
- PASS CABIN	216 450 00	21-61 TASK 846
• Too hot, cannot make cooler, OK in MANUAL mode		
- CONT CABIN	216 400 00	21-61 TASK 801
- PASS CABIN	216 410 00	21-61 TASK 801
Autobrakes		
• AUTO BRAKE DISARM light comes on during landing	324 097 00	32-42 TASK 833
• brakes grab during landing when using autobrakes	324 095 00	32-42 TASK 832
• deceleration rate is not correct	324 090 00	32-42 TASK 807
• Wheel continues to spin in the Main Gear Wheel Well after Gear Retraction	324 098 00	32-42 TASK 834
Autoflight annunciator		
• FMC annunciator light stays on	221 015 00	22-11 TASK 858

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Autopilot		
• A and B disengage automatically while in dual mode	221 140 00	22-11 TASK 801
• A/P amber warning annunciator light on flashing, autopilot went to CWS mode	221 020 00	22-11 TASK 801
• A/P red warning annunciator light on steady	221 010 00	22-11 TASK 801
• Airplane does not align correctly with runway during approach	221 960 00	22-11 TASK 825
• Airplane does not flare correctly during multi-channel approach, FLARE shows normal on the flight mode annunciator	221 750 00	22-11 TASK 801
• Airplane does not go to set altitude with V/S, LVL CHG, or VNAV pitch mode set		
- CMD A engaged	221 330 00	22-11 TASK 801
- CMD A or CMD B engaged	221 350 00	22-11 TASK 801
- CMD B engaged	221 340 00	22-11 TASK 801
• Airplane does not go to the set heading or keep the set heading with HDG SEL roll mode set		
- CMD A engaged	221 370 00	22-11 TASK 801
- CMD A or CMD B engaged	221 390 00	22-11 TASK 801
- CMD B engaged	221 380 00	22-11 TASK 801
• Airplane does not go to the set vertical speed with V/S pitch mode set		
- CMD A engaged	221 520 00	22-11 TASK 801
- CMD A or CMD B engaged	221 540 00	22-11 TASK 801
- CMD B engaged	221 530 00	22-11 TASK 801
• Airplane does not keep the same altitude with ALT HLD pitch mode set		
- CMD A engaged	221 490 00	22-11 TASK 801
- CMD A or CMD B engaged	221 510 00	22-11 TASK 801
- CMD B engaged	221 500 00	22-11 TASK 801
• Airplane does not keep the set airspeed with MCP SPD (LVL CHG) pitch mode set		
- CMD A engaged	221 430 00	22-11 TASK 801
- CMD A or CMD B engaged	221 450 00	22-11 TASK 801
- CMD B engaged	221 440 00	22-11 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Autopilot (continued)		
• Airplane does not keep the set course with VOR roll mode set		
- CMD A engaged	221 460 00	22-11 TASK 801
- CMD A or CMD B engaged	221 480 00	22-11 TASK 801
- CMD B engaged	221 470 00	22-11 TASK 801
• Airplane does not keep the set heading		
- CWS A engaged	221 400 00	22-11 TASK 801
- CWS A or CWS B engaged	221 420 00	22-11 TASK 801
- CWS B engaged	221 410 00	22-11 TASK 801
• Airplane has pitch oscillation (porpoises) during multi-channel approach	221 310 00	22-16 TASK 801
• Airplane has pitch oscillation (porpoises) with any A/P engaged in CMD	221 320 00	22-16 TASK 801
• Airplane roll is not smooth (jerky) with any A/P engaged in CMD	221 760 00	22-11 TASK 801
• control columns move when the autopilot engages	221 940 00	22-16 TASK 802
• Control wheels move when the autopilot engages	221 950 00	22-16 TASK 803
• disengages automatically		
- CMD A engaged	221 080 00	22-11 TASK 801
- CMD A or CMD B engaged	221 100 00	22-11 TASK 801
- CMD B engaged	221 090 00	22-11 TASK 801
- CWS A engaged	221 110 00	22-11 TASK 801
- CWS A or CWS B engaged	221 130 00	22-11 TASK 801
- CWS B engaged	221 120 00	22-11 TASK 801
• Does not disengage when CMD switch is pushed to off		
- CMD A engaged	221 570 00	22-11 TASK 803
- CMD A or CMD B engaged	221 590 00	22-11 TASK 803
- CMD B engaged	221 580 00	22-11 TASK 803
• Does not disengage when CWS switch is pushed to off		
- CWS A engaged	221 600 00	22-11 TASK 803
- CWS A or CWS B engaged	221 620 00	22-11 TASK 803
- CWS B engaged	221 610 00	22-11 TASK 803

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Autopilot (continued)		
• Does not disengage when disengage switch is pushed		
- captain's control column	221 550 31	22-13 TASK 809
- first officer's control column	221 550 32	22-13 TASK 809
- mode control panel	221 560 00	22-11 TASK 803
• Does not engage in dual mode, CMD A engages, CMD B does not engage, FLARE pitch mode does not show on the flight mode annunciator	221 690 00	22-17 TASK 807
• Does not engage in dual mode, CMD B engages, CMD A does not engage, FLARE pitch mode does not show on the flight mode annunciator	221 700 00	22-17 TASK 807
• does not engage when CMD switch is pushed during flight	221 625 00	22-11 TASK 856
• Does not engage when CMD switch is pushed, switch lights do not come on and CMD status does not show on the flight mode annunciator		
- CMD A	221 630 00	22-11 TASK 801
- CMD A or CMD B	221 650 00	22-11 TASK 801
- CMD B	221 640 00	22-11 TASK 801
• Does not engage when CWS switch is pushed, switch lights do not come on, CWS P and CWS R status do not show on the flight mode annunciator		
- CWS A	221 660 00	22-11 TASK 801
- CWS A or CWS B	221 680 00	22-11 TASK 801
- CWS B	221 670 00	22-11 TASK 801
• does not keep pitch attitude		
- CWS A engaged	221 250 00	22-11 TASK 801
- CWS A or CWS B engaged	221 270 00	22-11 TASK 801
- CWS B engaged	221 260 00	22-11 TASK 801
• does not keep roll attitude		
- CWS A engaged	221 280 00	22-11 TASK 801
- CWS A or CWS B engaged	221 300 00	22-11 TASK 801
- CWS B engaged	221 290 00	22-11 TASK 801
• Flight Crew is unable to arm LNAV on the Ground before Takeoff	221 001 00	22-11 TASK 830
• Flight Crew is unable to arm VNAV on the Ground before Takeoff	221 102 00	22-11 TASK 831

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Autopilot (continued)		
• goes less than the normal bank angle with any A/P engaged in CMD	221 740 00	22-11 TASK 801
• goes more than the set bank angle limit in HDG SEL or VOR		
- CMD A engaged	221 710 00	22-11 TASK 801
- CMD A or CMD B engaged	221 730 00	22-11 TASK 801
- CMD B engaged	221 720 00	22-11 TASK 801
• NLND3 LCH shows in DFCS BITE FAULT HISTORY	221 203 00	22-17 TASK 807
• NO ALND LCH shows in DFCS BITE FAULT HISTORY	221 204 00	22-17 TASK 807
• NO AUTOLAND shows on the ENG 1 (ENG 2) Display	221 201 00	22-11 TASK 838
• NO LAND 3 shows on the engine display	221 202 00	22-11 TASK 855
• P MODE FAIL shows in DFCS BITE FAULT HISTORY	221 205 00	22-11 TASK 801
• pitch or roll mode does not engage or disengages automatically, autopilot went to CWS mode		
- CMD A engaged	221 220 00	22-11 TASK 801
- CMD A or CMD B engaged	221 240 00	22-11 TASK 801
- CMD B engaged	221 230 00	22-11 TASK 801
• R MODE FAIL shows in DFCS BITE FAULT HISTORY	221 206 00	22-11 TASK 801
• SPDTRM LCH shows in DFCS BITE FAULT HISTORY	221 207 00	22-17 TASK 807
• Status does not show on the flight mode annunciator, switch lights are on	221 180 00	22-11 TASK 801
• TO/GA pitch mode does not show on the flight mode annunciator for go-around when TO/GA switch is pushed and F/D on		
- captain's	221 200 31	22-11 TASK 801
- captain's and first officer's	221 200 48	22-11 TASK 801
- first officer's	221 200 32	22-11 TASK 801
• Travel is not within limits, column force is normal	273 010 00	27-31 TASK 809
Autothrottle		
• A/T amber warning annunciator light on flashing	223 120 00	22-32 TASK 801
• A/T LIMIT indication shows on thrust mode display	223 220 00	22-32 TASK 815

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Autothrottle (continued)		
• Airplane does not keep the set airspeed with MCP SPD (LVL CHG) pitch mode set		
- CMD A engaged	221 430 00	22-11 TASK 801
- CMD A or CMD B engaged	221 450 00	22-11 TASK 801
- CMD B engaged	221 440 00	22-11 TASK 801
• disengages automatically	223 130 00	22-32 TASK 806
• does not arm, ARM light does not come on, ARM does not show on the flight mode annunciator	223 170 00	22-32 TASK 810
• does not automatically disengage after touchdown	223 110 00	22-32 TASK 806
• Does not disengage when disengage switch is pushed		
- engine 1 thrust lever	223 140 51	22-32 TASK 805
- engine 2 thrust lever	223 140 52	22-32 TASK 805
• Does not disengage when thrust levers are split	223 190 00	22-32 TASK 811
• Does not go to full rated N1 when TO/GA switch is pushed a second time during go-around		
- engine 1	223 070 51	22-32 TASK 804
- engine 1 and engine 2	223 070 48	22-32 TASK 804
- engine 2	223 070 52	22-32 TASK 804
• Does not go to reduced N1 when TO/GA switch is pushed one time during go-around		
- engine 1	223 080 51	22-32 TASK 804
- engine 1 and engine 2	223 080 48	22-32 TASK 804
- engine 2	223 080 52	22-32 TASK 804
• does not keep N1 limit in N1 mode		
- engine 1	223 020 51	22-32 TASK 801
- engine 1 and engine 2	223 020 48	22-32 TASK 801
- engine 2	223 020 52	22-32 TASK 801
• does not keep set speed in SPEED mode		
- engine 1	223 030 51	22-32 TASK 801
- engine 1 and engine 2	223 030 48	22-32 TASK 801
- engine 2	223 030 52	22-32 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Autothrottle (continued)		
• engine N1 speed fluctuates, engine N1 speed is normal with autothrottle OFF		
- engine 1	223 040 51	22-32 TASK 801
- engine 1 and engine 2	223 040 48	22-32 TASK 801
- engine 2	223 040 52	22-32 TASK 801
• mode does not change when mode switch is pushed	223 200 00	22-32 TASK 809
• overcontrols with A/T mode engaged	223 150 00	22-32 TASK 808
• selected target speed bug problem on the mach airspeed indicator		
- captain's	223 010 31	22-32 TASK 803
- first officer's	223 010 32	22-32 TASK 803
• Status does not show on Flight Mode Annunciator (FMA)	223 050 00	22-32 TASK 807
• Status mode does not change automatically	223 090 00	22-32 TASK 807
• throttle resolver angle indication is blank during BITE interactive range check	223 210 00	22-32 TASK 813
• Thrust lever does not move back in RETARD mode		
- engine 1	223 100 51	22-32 TASK 802
- engine 1 and engine 2	223 100 48	22-32 TASK 802
- engine 2	223 100 52	22-32 TASK 802
• Thrust lever does not move forward when TO/GA switch is pushed		
- engine 1	223 060 51	22-32 TASK 804
- engine 1 and engine 2	223 060 48	22-32 TASK 804
- engine 2	223 060 52	22-32 TASK 804
• Thrust lever problem		
- engine 1	223 160 51	22-32 TASK 808
- engine 1 and engine 2	223 160 48	22-32 TASK 808
- engine 2	223 160 52	22-32 TASK 808
• thrust levers are split, OK with autothrottle disengaged	223 180 00	22-32 TASK 811
AUX PITOT light		
• light on	303 010 00	30-31 TASK 801
AVM signal conditioner		
• display blank	770 061 00	77-05 TASK 809

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
AVM signal conditioner (continued)		
• flight history shows "00" for two of the vibration indications		
- engine 1	770 062 51	77-05 TASK 808
- engine 2	770 062 52	77-05 TASK 808
Ax, crash		
• missing	256 020 00	25-99 TASK 801
Battery charger		
• CHARGER light flashes		
- auxiliary battery charger	243 132 00	24-31 TASK 835
- main battery charger	243 131 00	24-31 TASK 834
BATTERY DISCHARGE light		
• comes on during flight	243 121 00	24-31 TASK 833
Battery voltage		
• less than 22 volts with BAT switch at ON and no AC power on the charger	494 010 00	49-45 TASK 801
• less than 26 volts with AC power on the charger	494 020 00	49-45 TASK 802
Birdstrike/FOD		
• in engine, engine had a surge/stall		
- engine 1	710 030 51	71-05 TASK 805
- engine 2	710 030 52	71-05 TASK 805
• in engine, engine parameters normal		
- engine 1	710 010 51	71-05 TASK 801
- engine 2	710 010 52	71-05 TASK 801
• in engine, engine parameters not normal or unknown		
- engine 1	710 020 51	71-05 TASK 801
- engine 2	710 020 52	71-05 TASK 801
• on airframe/area unknown, engine parameters normal	055 130 00	05-51 TASK 804
BLEED TRIP OFF Light comes ON		
• during climb		
- light No. 1	361 012 01	36-10 TASK 809
- light No. 2	361 012 02	36-10 TASK 809

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
BLEED TRIP OFF Light comes ON (continued)		
• during cruise		
- light No. 1	361 013 01	36-10 TASK 809
- light No. 2	361 013 02	36-10 TASK 809
• during idle descent		
- light No. 1	361 014 01	36-10 TASK 809
- light No. 2	361 014 02	36-10 TASK 809
• during takeoff		
- light No. 1	361 011 01	36-10 TASK 809
- light No. 2	361 011 02	36-10 TASK 809
Bleed valve		
• does not close when the bleed switches are moved to off, the engine is the bleed source	361 020 00	36-10 TASK 802
Boom microphone/headset		
• damaged		
- captain's	235 020 31	23-51 TASK 802
- first officer's	235 020 32	23-51 TASK 802
• does not operate		
- captain's	235 010 31	23-51 TASK 801
- first officer's	235 010 32	23-51 TASK 801
Brake pressure indicator		
• decreases faster than specified during parking brake hold check		
- parking brake released	324 161 00	32-44 TASK 802
- parking brake set	324 160 00	32-44 TASK 801
• does not operate	324 020 00	32-44 TASK 806
• low/zero with parking brake released	324 010 00	32-44 TASK 805
• low/zero with parking brake set	324 110 00	32-44 TASK 805
Brakes		
• Abnormal Noise or Vibration	324 172 00	32-44 TASK 808
• grab, drag, or lock	324 030 00	32-42 TASK 816
• overheated during stop	055 621 00	Reference Not Currently Available
• pull to the left	324 040 00	32-42 TASK 817

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Brakes (continued)		
• pull to the right	324 050 00	32-42 TASK 817
Buffet, severe turbulence, stall, or overspeed	055 070 00	05-51 TASK 808
CAB DOOR UNLOCKED light for the flight compartment door		
• does not come on when the door is unlocked	525 010 00	52-50 TASK 801
CABIN ALT indication		
• fluctuates	213 040 00	21-31 TASK 801
Cabin altitude and differential pressure gauge		
• indicates high cabin pressure differential and low cabin altitude	213 121 00	21-33 TASK 803
Cabin altitude warning system		
• does not operate	213 060 00	21-33 TASK 801
CABIN CLIMB Indicator		
• does not operate, pointer does not move or fluctuates	213 080 00	21-33 TASK 802
Call horn		
• does not sound	234 340 00	23-43 TASK 801
• operates continuously	234 350 00	23-43 TASK 802
• Sounds, ADIRU power problem, ON DC light on		
- left	342 200 41	34-21 TASK 829
- right	342 200 42	34-21 TASK 829
• Sounds, equipment cooling problem	342 190 00	34-21 TASK 829
Call system		
• attendant call chime does not operate in passenger cabin	234 395 00	23-42 TASK 803
• call light does not come on, attendant to flight compartment	234 380 00	23-42 TASK 806
• call light does not come on, ground crew to flight compartment	234 370 00	23-43 TASK 804
• Chime does not sound in the flight compartment	234 390 00	23-42 TASK 804
• does not operate, attendant to flight compartment	234 371 00	23-42 TASK 805
• does not operate, flight compartment to attendant	234 400 00	23-42 TASK 802
• does not operate, ground crew to flight compartment	234 360 00	23-43 TASK 803

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
CAPT PITOT light		
• light on	303 020 00	30-31 TASK 802
Cargo compartment light		
• does not come on		
- aft	333 080 45	33-30 TASK 801
- forward	333 080 44	33-30 TASK 801
• Does not go off		
- aft	333 081 45	33-30 TASK 801
- forward	333 081 44	33-30 TASK 801
Cargo Door		
• Difficult to open/close	523 010 00	52-30 TASK 801
• does not unlatch/latch	523 020 00	52-30 TASK 802
Cargo Door (Main Deck)		
• does not latch	523 283 00	52-32 TASK 817
• does not lock	523 284 00	52-32 TASK 816
• does not raise	523 220 00	52-32 TASK 805
• does not stop at canopy position when lowered	523 230 00	52-32 TASK 806
• does not stop at canopy position when raised	523 240 00	52-32 TASK 804
• does not unlatch	523 285 00	52-32 TASK 815
• does not unlock	523 286 00	52-32 TASK 814
Cargo Door (Main Deck) Threshold Light		
• does not turn OFF	333 091 00	33-35 TASK 801
• does not turn ON	333 092 00	33-35 TASK 801
Cargo fire detection		
• AFT cargo fire light on (false alarm)	261 225 45	26-16 TASK 801
• FWD cargo fire light on (false alarm)	261 225 44	26-16 TASK 801
• MAIN cargo fire light on (false alarm)	261 225 00	26-16 TASK 801
Cargo fire extinguishing		
• Bottle does not release extinguishant when DISCH switch is pushed	262 200 00	26-23 TASK 803
• DISCH light on, DISCH switch not pushed	262 205 00	26-23 TASK 802
• EXT AFT light does not come on during cargo fire test	262 210 45	26-23 TASK 812

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Cargo fire extinguishing (continued)		
• EXT FWD light does not come on during cargo fire test .	262 210 44	26-23 TASK 812
Cargo fire test		
• DETECTOR FAULT light stays ON after TEST switch is pushed	261 075 00	26-16 TASK 802
• Test failed, AFT cargo fire light does not come on, DETECTOR FAULT light comes on		
- DET SELECT switch at A	261 205 45	26-16 TASK 804
- DET SELECT switch at B	261 210 45	26-16 TASK 804
- DET SELECT switch at NORM	261 215 45	26-16 TASK 804
• Test failed, AFT cargo fire light does not come on, DETECTOR FAULT light is off	261 200 45	26-16 TASK 806
• Test failed, EXT AFT light does not come on	262 210 45	26-23 TASK 812
• Test failed, EXT FWD light does not come on	262 210 44	26-23 TASK 812
• Test failed, FWD cargo fire light does not come on, DETECTOR FAULT light comes on		
- DET SELECT switch at A	261 205 44	26-16 TASK 804
- DET SELECT switch at B	261 210 44	26-16 TASK 804
- DET SELECT switch at NORM	261 215 44	26-16 TASK 804
• Test failed, FWD cargo fire light does not come on, DETECTOR FAULT light is off	261 200 44	26-16 TASK 806
• Test failed, warning lights and alarm do not operate	261 220 00	26-16 TASK 807
CDS display unit problem		
- center lower	316 050 47	31-63 TASK 824
- center upper	316 050 46	31-63 TASK 824
- left inboard	316 030 41	31-63 TASK 824
- left outboard	316 040 41	31-63 TASK 824
- right inboard	316 030 42	31-63 TASK 824
- right outboard	316 040 42	31-63 TASK 824
CDS FAULT annunciation shows on pilot's display		
- captain's	316 070 31	31-62 TASK 884
- first officer's	316 070 32	31-62 TASK 884
CDS MAINT annunciation shows on pilot's display		
- captain's	316 060 31	31-62 TASK 884
- first officer's	316 060 32	31-62 TASK 884

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
CDU		
• 429 HARDWARE CDU message shows		
- captain's	346 635 31	34-61 TASK 850
- first officer's	346 635 32	34-61 TASK 850
• ANALOG FAULT CDU message shows		
- captain's	346 642 31	34-61 TASK 854
- first officer's	346 642 32	34-61 TASK 854
• ANNUC FAULT CDU message shows		
- captain's	346 636 31	34-61 TASK 851
- first officer's	346 636 32	34-61 TASK 851
• APM WARN shows on CDU scratchpad for ACARS	232 315 00	23-27 TASK 825
• ARINC RA message shows		
- captain's	346 637 31	34-61 TASK 852
- first officer's	346 637 32	34-61 TASK 852
• ATN DATA BASE INVALID Message shows on the CDU Scratchpad	346 145 00	34-61 TASK 846
• brightness control problem		
- captain's	346 020 31	34-61 TASK 803
- first officer's	346 020 32	34-61 TASK 803
• CDU USER 1 message shows		
- captain's	346 639 31	34-61 TASK 853
- first officer's	346 639 32	34-61 TASK 853
• CDU USER 2 message shows		
- captain's	346 640 31	34-61 TASK 853
- first officer's	346 640 32	34-61 TASK 853
• CDU USER 3 message shows		
- captain's	346 641 31	34-61 TASK 853
- first officer's	346 641 32	34-61 TASK 853
• CRT CONTROL CDU message shows		
- captain's	346 643 31	34-61 TASK 854
- first officer's	346 643 32	34-61 TASK 854
• DATA BASE INVALID message shows	346 360 00	34-61 TASK 818

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
CDU (continued)		
• DATALINK FAIL message shows		
- captain's	346 365 31	23-27 TASK 801
- first officer's	346 365 32	23-27 TASK 801
• DATALINK FULL message shows	346 150 00	34-61 TASK 848
• display blank		
- captain's	346 040 31	34-61 TASK 804
- first officer's	346 040 32	34-61 TASK 804
• display is dim or out of focus		
- captain's	346 050 31	34-61 TASK 803
- first officer's	346 050 32	34-61 TASK 803
• DME data on NAV STATUS display shows FAIL	346 510 00	34-61 TASK 801
• EXEC key does not operate when pushed		
- captain's	346 060 31	34-61 TASK 805
- first officer's	346 060 32	34-61 TASK 805
• EXEC key light bar does not come on		
- captain's	346 065 31	34-61 TASK 806
- first officer's	346 065 32	34-61 TASK 806
• FAIL light is on	346 080 00	34-61 TASK 807
• FMC annunciator light on the autoflight annunicator stays on	221 015 00	22-11 TASK 858
• FMC DISAGREE message shows	346 075 00	34-61 TASK 835
• FMC menu prompt flashes or is slow to respond	346 131 00	34-61 TASK 838
• FMC shows in the middle of the display	346 070 00	34-61 TASK 807
• GPS-L data on POS REF display is missing	346 460 00	34-61 TASK 801
• GPS-R data on POS REF display is missing	346 470 00	34-61 TASK 801
• GS data on POS REF display is missing	346 480 00	34-61 TASK 801
• ILS data on NAV STATUS display shows FAIL	346 500 00	34-61 TASK 801
• IRS-L data on POS REF display is missing	346 440 00	34-61 TASK 801
• IRS-R data on POS REF display is missing	346 450 00	34-61 TASK 801
• key does not operate when pushed		
- captain's	346 010 31	34-61 TASK 802
- first officer's	346 010 32	34-61 TASK 802
• MODEL/ENG DATA INVALID message shows	346 380 00	34-61 TASK 819

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
CDU (continued)		
• MSG light does not come on		
- captain's	346 270 31	34-61 TASK 810
- first officer's	346 270 32	34-61 TASK 810
• NAV DATA OUT OF DATE message shows	346 160 00	34-61 TASK 808
• NO INTERRUPT RA ARINC message shows		
- captain's	346 644 31	34-61 TASK 854
- first officer's	346 644 32	34-61 TASK 854
• OAT DISAGREE - DELETED Message shows on the CDU Scratchpad	346 141 00	34-61 TASK 842
• OFST light does not come on		
- captain's	346 280 31	34-61 TASK 810
- first officer's	346 280 32	34-61 TASK 810
• OP PROGRAM INVALID shows in the middle of the display	346 260 00	34-61 TASK 811
• P ARINC message shows		
- captain's	346 638 31	34-61 TASK 852
- first officer's	346 638 32	34-61 TASK 852
• PRINTER FAIL message shows	346 375 00	31-33 TASK 804
• PROCESSOR CDU message shows		
- captain's	346 645 31	34-61 TASK 854
- first officer's	346 645 32	34-61 TASK 854
• PROGRAM PIN ERROR message shows	346 390 00	34-61 TASK 820
• PROGRAM PIN NOT IN DB message shows	346 400 00	34-61 TASK 821
• RESYNC FAIL, SINGLE FMC OP/SINGLE FMC OP message shows	346 180 00	34-61 TASK 832
• SCANNING DME FAIL message shows	346 350 00	34-61 TASK 801
• SERVICE BACKLIGHT SOON shows on CDU Scratchpad		
- captain's	346 051 31	34-61 TASK 841
- first officer's	346 051 32	34-61 TASK 841
• SINGLE FMC OPERATION message shows	346 370 00	34-61 TASK 807
• VOR data on NAV STATUS display shows FAIL	346 490 00	34-61 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
CDU (continued)		
• WATCHDOG TIMER CDU message shows		
- captain's	346 646 31	34-61 TASK 854
- first officer's	346 646 32	34-61 TASK 854
Chart holder, sidewall problem		
- captain's	251 130 31	25-99 TASK 801
- first officer's	251 130 32	25-99 TASK 801
Chart light		
• does not come on correctly		
- captain's	331 150 31	33-10 TASK 801
- first officer's	331 150 32	33-10 TASK 801
• Does not go off		
- captain's	331 151 31	33-10 TASK 801
- first officer's	331 151 32	33-10 TASK 801
CHECK DBL OR INTERFACE message shows on CDU during FMC software load	346 290 00	34-61 TASK 812
CHECK MEDIA message shows on CDU during FMC software load	346 330 00	34-61 TASK 816
Circuit breaker "ANTI-ICE & RAIN ENG 1 & WING CONT" tripped	301 121 00	30-11 TASK 810
Circuit breaker collars (spare)		
• missing	256 201 00	25-99 TASK 801
Circuit breaker panel light		
• does not come on	331 040 00	33-10 TASK 801
• Does not go off	331 041 00	33-10 TASK 801
Clock		
• does not operate		
- captain's	312 020 31	31-25 TASK 801
- first officer's	312 020 32	31-25 TASK 802
Common Display System		
• DEU-1 Restart during an APU Start on Battery Only		
- No. 1	316 082 01	31-63 TASK 828

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Common Display System (continued)		
• Display Units are blanking during an APU Start on Battery Only	316 081 00	31-63 TASK 828
• Landing Altitude Indication on the Primary Flight Display (PFD)		
- reference bar does not operate correctly	316 601 48	31-62 TASK 887
Conditioned Air Distribution		
• Low flow to the Flight Deck	212 201 00	21-22 TASK 802
CONFIG message shows in fuel quantity indication (flight compartment)	284 022 00	28-41 TASK 820
CONT CABIN air mix valve indicator		
• does not operate, pointer does not move, temperature is OK	216 010 00	21-61 TASK 841
CONT CABIN SUPPLY DUCT air temperature indication is not correct	216 140 00	21-61 TASK 858
Control Cabin Door		
• CAB DOOR UNLOCKED light does not come on when the door is unlocked	525 010 00	52-50 TASK 801
• Difficult to open/close	525 020 00	52-50 TASK 802
• does not release electrically	525 040 00	52-50 TASK 803
• key is damaged	525 032 00	52-99 TASK 801
• key is missing	525 030 00	52-99 TASK 801
Control column		
• does not move freely		
- captain's	273 020 31	27-31 TASK 801
- first officer's	273 020 32	27-31 TASK 801
• high force, hydraulic power off	273 150 00	27-31 TASK 814
• high force, hydraulic power on	273 140 00	27-31 TASK 813
• low force	273 130 00	27-31 TASK 812
• moves when the autopilot engages	221 940 00	22-16 TASK 802
• shaker does not operate during test	273 110 00	27-32 TASK 836
• shaker operates continuously	273 115 00	27-32 TASK 834
Control panel, HF 1 problem	231 010 00	23-11 TASK 805

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Control panel, HF 2 problem	231 020 00	23-11 TASK 805
Control stand floodlight		
• does not come on correctly	331 090 00	33-10 TASK 801
• Does not go off	331 091 00	33-10 TASK 801
Control wheel		
• does not move freely		
- captain's	271 030 31	27-11 TASK 813
- first officer's	271 030 32	27-11 TASK 813
• does not stay in the center position from one direction		
- captain's	271 100 31	27-11 TASK 810
- captain's and first officer's	271 100 48	27-11 TASK 810
- first officer's	271 100 32	27-11 TASK 810
• has too much play		
- captain's	271 040 31	27-11 TASK 801
- captain's and first officer's	271 040 48	27-11 TASK 801
- first officer's	271 040 32	27-11 TASK 801
• high force, hydraulic power off		
- captain's	271 080 31	27-11 TASK 809
- captain's and first officer's	271 080 48	27-11 TASK 809
- first officer's	271 080 32	27-11 TASK 809
• high force, hydraulic power on		
- captain's	271 070 31	27-11 TASK 804
- captain's and first officer's	271 070 48	27-11 TASK 804
- first officer's	271 070 32	27-11 TASK 804
• light force in one or both directions		
- captain's	271 090 31	27-11 TASK 811
- captain's and first officer's	271 090 48	27-11 TASK 811
- first officer's	271 090 32	27-11 TASK 811
• moves when the autopilot engages	221 950 00	22-16 TASK 803
COURSE window display on the mode control panel		
• does not change with course selector switch change		
- captain's	221 790 31	22-11 TASK 803
- first officer's	221 790 32	22-11 TASK 803

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
COURSE window display on the mode control panel (continued)		
• does not show		
- captain's	221 800 31	22-11 TASK 803
- first officer's	221 800 32	22-11 TASK 803
COWL ANTI-ICE light		
• light comes on at high thrust setting (takeoff or climb) and goes off at reduced thrust		
- ENG ANTI-ICE 1	302 011 51	30-21 TASK 809
- ENG ANTI-ICE 2	302 011 52	30-21 TASK 809
• light comes on independent of engine thrust setting		
- ENG ANTI-ICE 1	302 010 51	30-21 TASK 801
- ENG ANTI-ICE 2	302 010 52	30-21 TASK 801
COWL VALVE OPEN Light		
• slow to go from Bright to Dim when the ENG ANTI-ICE Switch is moved to ON		
- ENG ANTI-ICE 1	302 020 51	30-21 TASK 802
- ENG ANTI-ICE 2	302 020 52	30-21 TASK 802
• slow to go from Bright to OFF when the ENG ANTI-ICE Switch is moved to OFF		
- ENG ANTI-ICE 1	302 030 51	30-21 TASK 803
- ENG ANTI-ICE 2	302 030 52	30-21 TASK 803
• Stays ON bright		
- ENG ANTI-ICE 1	302 040 51	30-21 TASK 804
- ENG ANTI-ICE 2	302 040 52	30-21 TASK 804
• Stays ON bright when the ENG ANTI-ICE Switch is moved to ON		
- ENG-1	302 050 51	30-21 TASK 805
- ENG-2	302 050 52	30-21 TASK 805
Crash ax		
• missing	256 020 00	25-99 TASK 801
Crew oxygen pressure indicator		
• does not agree with bottle pressure	351 010 00	35-12 TASK 801
• pressure decreases	351 020 00	35-12 TASK 802
• pressure low	351 030 00	35-12 TASK 803

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Crew oxygen pressure indicator (continued)		
• Pressure zero	351 040 00	35-12 TASK 804
Crew portable oxygen		
• damaged	353 010 00	35-99 TASK 801
• pressure low	353 020 00	35-99 TASK 801
• was used	353 030 00	35-99 TASK 801
Crossfeed VALVE OPEN light		
• does not come on bright when the valve is in transit	282 125 00	28-22 TASK 808
• Stays ON bright when the Crossfeed Selector is moved to the OFF position	282 120 00	28-22 TASK 807
• Stays ON bright when the Crossfeed Selector is moved to the ON position	282 110 00	28-22 TASK 807
Cup holder problem		
- captain's	251 140 31	25-99 TASK 801
- first officer's	251 140 32	25-99 TASK 801
- observer's	251 140 33	25-99 TASK 801
DATA BASE INVALID message shows on the CDU	346 360 00	34-61 TASK 818
DATALINK FAIL message shows on the CDU		
- captain's	346 365 31	23-27 TASK 801
- first officer's	346 365 32	23-27 TASK 801
DB EXCEEDS FMC MEMORY message shows on CDU during FMC software load	346 300 00	34-61 TASK 813
DB-OFP INCOMPATIBLE message shows on CDU during FMC software load	346 320 00	34-61 TASK 815
DC FAIL light for the IRS on		
- left	342 060 41	34-21 TASK 842
- right	342 060 42	34-21 TASK 842
Differential pressure indicator on IDG		
• extended		
- left	242 121 41	24-11 TASK 803
- right	242 121 42	24-11 TASK 803
DISCH light for cargo fire extinguishing		
• light not on when DISCH switch is pushed	262 200 00	26-23 TASK 803

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
DISCH light for cargo fire extinguishing (continued)		
• light on, DISCH switch not pushed	262 205 00	26-23 TASK 802
Display unit problem		
- center lower	316 050 47	31-63 TASK 824
- center upper	316 050 46	31-63 TASK 824
- left inboard	316 030 41	31-63 TASK 824
- left outboard	316 040 41	31-63 TASK 824
- right inboard	316 030 42	31-63 TASK 824
- right outboard	316 040 42	31-63 TASK 824
DISPLAYS CONTROL PANEL annunciation shows on pilot's display		
- captain's	316 026 31	31-62 TASK 801
- first officer's	316 026 32	31-62 TASK 801
DME		
• Data on NAV STATUS display of CDU shows FAIL	346 510 00	34-61 TASK 801
• distance shows dashes		
- DME1	345 230 01	34-55 TASK 801
- DME2	345 230 02	34-55 TASK 801
• test problem when you push the TEST switch on the navigation control panel		
- captain's	345 210 31	34-55 TASK 801
- first officer's	345 210 32	34-55 TASK 801
DME1 shows on the display	345 220 01	34-55 TASK 802
DME2 shows on the display	345 220 02	34-55 TASK 802
Dome light		
• does not come on correctly	331 050 00	33-10 TASK 801
• Does not go off	331 051 00	33-10 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Door warning annunciator is on		
- AFT CARGO	523 611 45	52-30 TASK 803
- AFT ENTRY	521 611 45	52-10 TASK 801
- AFT SERVICE	524 611 45	52-10 TASK 801
- EQUIP	524 612 00	52-40 TASK 801 or 52-40 TASK 802
- FWD CARGO	523 611 44	52-30 TASK 803
- FWD ENTRY	521 611 44	52-10 TASK 801
- FWD SERVICE	524 611 44	52-10 TASK 801
Door, Cargo		
• Difficult to open/close	523 010 00	52-30 TASK 801
• does not unlatch/latch	523 020 00	52-30 TASK 802
Door, Cargo (Main Deck)		
• does not raise	523 220 00	52-32 TASK 805
• does not stop at canopy position when lowered	523 230 00	52-32 TASK 806
• does not stop at canopy position when raised	523 240 00	52-32 TASK 804
Door, Entry		
• Handle Movement		
- forward	521 011 44	52-10 TASK 815
Door, Entry Exterior Handle		
• Difficult to operate		
- aft	521 010 45	52-10 TASK 811
- forward	521 010 44	52-10 TASK 811
Door, Fight Compartment		
• CAB DOOR UNLOCKED light does not come on when the door is unlocked	525 010 00	52-50 TASK 801
• Difficult to open/close	525 020 00	52-50 TASK 802
• does not release electrically	525 040 00	52-50 TASK 803
• key is damaged	525 032 00	52-99 TASK 801
• key is missing	525 030 00	52-99 TASK 801
Door, Flight Deck Enhanced Security		
• chime does not sound with switch set to AUTO and correct code in keypad	525 121 00	52-50 TASK 808

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Door, Flight Deck Enhanced Security (continued)		
• chime sounds with switch set to DENY	525 131 00	52-50 TASK 807
• does not lock with switch set to AUTO	525 141 00	52-50 TASK 804
• does not unlock with switch set to AUTO and correct code in keypad	525 151 00	52-50 TASK 806
• does not unlock with switch set to UNLKD	525 161 00	52-50 TASK 805
• LOCK FAIL light is on	525 171 00	52-50 TASK 809
• unlocks with switch set to DENY	525 181 00	52-50 TASK 807
Door, Galley Service Exterior Handle		
• Difficult to operate	524 010 00	52-10 TASK 811
Drain mast		
• Does not heat	307 010 00	30-71 TASK 801
• overheats	307 020 00	30-71 TASK 802
DSPLY SOURCE 1 annunciation shows on display		
• captains's and first officer's	316 083 41	31-63 TASK 820
DSPLY SOURCE 2 annunciation shows on display		
• captains's and first officer's	316 083 42	31-63 TASK 820
DSPLY SOURCE annunciation shows on pilot's display		
- captain's	316 080 31	31-63 TASK 820
- first officer's	316 080 32	31-63 TASK 820
DUAL BLEED light		
• light on, APU BLEED switch at OFF	495 010 00	49-55 TASK 803
DUCT OVERHEAT light		
• light on, cannot reset		
- CONT CABIN	216 100 00	21-61 TASK 837
- PASS CABIN	216 105 00	21-61 TASK 838
• light on, comes on again after reset		
- CONT CABIN	216 090 00	21-61 TASK 848
- PASS CABIN	216 095 00	21-61 TASK 849
• light on, stays off after reset		
- CONT CABIN	216 080 00	21-61 TASK 839
- PASS CABIN	216 085 00	21-61 TASK 840

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Duct Pressure Indication		
• BLEED TRIP OFF Light comes ON during climb		
- light No. 1	361 012 01	36-10 TASK 809
- light No. 2	361 012 02	36-10 TASK 809
• BLEED TRIP OFF Light comes ON during cruise		
- light No. 1	361 013 01	36-10 TASK 809
- light No. 2	361 013 02	36-10 TASK 809
• BLEED TRIP OFF Light comes ON during idle descent		
- light No. 1	361 014 01	36-10 TASK 809
- light No. 2	361 014 02	36-10 TASK 809
• BLEED TRIP OFF Light comes ON during takeoff		
- light No. 1	361 011 01	36-10 TASK 809
- light No. 2	361 011 02	36-10 TASK 809
• high, the engine is the bleed source	361 030 00	36-10 TASK 803
• L and R pointers not the same (split), the APU is the bleed source	361 080 00	36-10 TASK 808
• L and R pointers not the same (split), with either pointer below 18 psig during takeoff, climb and cruise; the engine is the bleed source	361 070 00	36-10 TASK 807
• low (below 18 psig) during takeoff, climb and cruise; the engine is the bleed source	361 040 00	36-10 TASK 810
• low or not constant during main engine start, the APU is the bleed source	495 031 00	49-55 TASK 807
• low or not constant during pack operation, the APU is the bleed source	495 032 00	49-55 TASK 806
• Zero, the APU is the bleed source	495 050 00	49-55 TASK 804
Dust Condition (Extreme)	055 613 00	05-51 TASK 802
EAU BITE		
• Lights (all) do not come on during the BITE procedure	780 200 00	78-34 TASK 809
EEC		
• does not power-up		
- engine 1	730 430 51	73-05 TASK 804
- engine 2	730 430 52	73-05 TASK 804

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
EEC ALTN mode light		
• light does not come ON during the EEC Test		
- engine 1	730 350 51	73-05 TASK 810
- engine 2	730 350 52	73-05 TASK 810
• light on		
- engine 1	730 080 51	73-05 TASK 811
- engine 2	730 080 52	73-05 TASK 811
EEC BITE		
• BITE INOP shows on the CDU		
- engine 1	730 420 51	73-05 TASK 802
- engine 2	730 420 52	73-05 TASK 802
• CH A EEC DATA NOT AVAILABLE shows on the CDU		
- engine 1	730 400 51	73-05 TASK 803
- engine 2	730 400 52	73-05 TASK 803
• CH B EEC DATA NOT AVAILABLE shows on the CDU		
- engine 1	730 410 51	73-05 TASK 803
- engine 2	730 410 52	73-05 TASK 803
• ENGINE MAINTENANCE CAN NOT BE ACCESSED - THE ENGINE'S FLIGHT INDICATOR SHOWS FLIGHT shows on the CDU, airplane is on the ground		
- engine 1	730 440 51	73-05 TASK 813
- engine 2	730 440 52	73-05 TASK 813
• FLIGHT LEGS BETWEEN CHANNEL A AND CHANNEL B ARE NOT SYNCHRONIZED shows on Recent Faults page or Fault History page		
- engine 1	730 456 51	73-05 TASK 815
- engine 2	730 456 52	73-05 TASK 815
• maintenance message does not erase		
- engine 1	730 450 51	73-06 TASK 814
- engine 2	730 450 52	73-06 TASK 814
EEC Test failed		
• ALTN mode light did not come on		
- engine 1	730 350 51	73-05 TASK 810
- engine 2	730 350 52	73-05 TASK 810

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
EEC Test failed (continued)		
• ENGINE CONTROL light did not come on		
- engine 1	730 330 51	73-06 TASK 813
- engine 2	730 330 52	73-06 TASK 813
• FILTER BYPASS light did not come on		
- engine 1	730 340 51	73-05 TASK 812
- engine 2	730 340 52	73-05 TASK 812
• OIL FILTER BYPASS Message does not show on the Engine Display		
- ENG 1	790 120 51	79-05 TASK 818
- ENG 2	790 120 52	79-05 TASK 818
EFIS control panel problem		
- captain's	316 020 31	31-63 TASK 819
- first officer's	316 020 32	31-63 TASK 821
EGT indicator for the APU		
• does not operate correctly	497 010 00	49-75 TASK 801
EGT overtemperature (except starting)		
• EGT over amber band limit due to surge/stall		
- engine 1	710 100 51	71-05 TASK 804
- engine 2	710 100 52	71-05 TASK 804
• EGT over amber band limit, no surge/stall		
- engine 1	710 090 51	71-06 TASK 804
- engine 2	710 090 52	71-06 TASK 804
• EGT over redline due to surge/stall		
- engine 1	710 115 51	71-06 TASK 806
- engine 2	710 115 52	71-06 TASK 806
• EGT over redline, no surge/stall		
- engine 1	710 110 51	71-06 TASK 805
- engine 2	710 110 52	71-06 TASK 805
EGT, FF, oil pressure, and oil temperature indications		
• continue to show after engine shutdown		
- left engine	710 135 51	71-06 TASK 808
- right engine	710 135 52	71-06 TASK 808

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
EGT, N1, N2, and FF indications		
• read low or fluctuate		
- engine 1	710 130 51	73-06 TASK 809
- engine 2	710 130 52	73-06 TASK 809
ELEC 1 LOW PRESSURE light		
• light on	293 190 00	29-30 TASK 810
ELEC 1 OVERHEAT light		
• light on	293 030 00	29-30 TASK 805
ELEC 2 LOW PRESSURE light		
• light on	293 200 00	29-30 TASK 811
ELEC 2 OVERHEAT light		
• light on	293 040 00	29-30 TASK 806
ELEC light		
• light on	243 050 00	24-31 TASK 801
Electrical power		
• power to the electric motor-driven pump is interrupted during normal operation		
- system A	291 020 00	29-10 TASK 803
- system B	291 025 00	29-10 TASK 804
Electronic equipment compartment light		
• does not come on	333 040 00	33-30 TASK 801
• Does not go off	333 041 00	33-30 TASK 801
Elevator		
• control cable tension repeatedly checks low	273 030 00	27-31 TASK 802
• does not move correctly	273 040 00	27-31 TASK 810
• hard to operate during landing	273 155 00	27-31 TASK 817
• Too much play in elevator surface	273 050 00	27-31 TASK 804
Elevator tab surface		
• has too much play	273 120 00	27-31 TASK 805
Emergency Locator Transmitter (ELT)		
• ELT light is on	232 411 00	23-24 TASK 807

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Emergency Locator Transmitter (ELT) (continued)		
• no ELT signal on VHF when ELT switch set to ON during test	232 410 00	23-24 TASK 801
• Self Test Fails	232 401 00	23-24 TASK 801
ENG 1 LOW PRESSURE light		
• light off when the electric motor-driven pump is operated	291 010 51	29-10 TASK 801
• light on	293 210 51	29-30 TASK 812
ENG 1 OVERHEAT light		
• light is on	261 011 51	26-10 TASK 811
ENG 2 LOW PRESSURE light		
• light off when the electric motor-driven pump is operated	291 010 52	29-10 TASK 802
• light on	293 210 52	29-30 TASK 813
ENG 2 OVERHEAT light		
• light is on	261 011 52	26-10 TASK 811
ENG FAIL message shows over EGT indication		
- engine 1	730 020 51	73-05 TASK 805
- engine 2	730 020 52	73-05 TASK 805
ENG VALVE CLOSED light		
• slow to go from Bright to Dim when the Start Lever is moved to CUTOFF		
- engine 1	730 030 51	73-06 TASK 802
- engine 2	730 030 52	73-06 TASK 802
• slow to go from Bright to OFF when the Start Lever is moved to IDLE		
- engine 1	730 040 51	73-06 TASK 803
- engine 2	730 040 52	73-06 TASK 803
• Stays off for all start lever positions		
- engine 1	730 061 51	73-06 TASK 815
- engine 2	730 061 52	73-06 TASK 815
• Stays off or bright when start lever moved to CUTOFF		
- engine 1	730 050 51	73-06 TASK 804
- engine 2	730 050 52	73-06 TASK 804

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
ENG VALVE CLOSED light (continued)		
• Stays ON bright when the Start Lever is moved to IDLE; Engine start is normal		
- engine 1	730 060 51	73-06 TASK 805
- engine 2	730 060 52	73-06 TASK 805
Engine		
• slow to accelerate		
- left engine	710 260 51	73-05 TASK 814
- right engine	710 260 52	73-05 TASK 814
• slow to decelerate		
- left engine	710 270 51	73-05 TASK 816
- right engine	710 270 52	73-05 TASK 816
• Slow to shut down when start lever moved to CUTOFF		
- left engine	730 035 51	73-06 TASK 804
- right engine	730 035 52	73-06 TASK 804
Engine 1 fire extinguishing		
• Test failed	262 010 00	26-20 TASK 801
Engine 2 fire extinguishing		
• Test failed	262 020 00	26-20 TASK 801
Engine Accessory Unit (EAU) BITE		
• Lights (all) do not come on during the BITE procedure	780 200 00	78-34 TASK 809
Engine automatic acceleration with no thrust lever movement		
- engine 1	730 070 51	73-06 TASK 806
- engine 2	730 070 52	73-06 TASK 806
Engine BITE		
• BITE INOP shows on the CDU		
- engine 1	730 420 51	73-05 TASK 802
- engine 2	730 420 52	73-05 TASK 802
• CH A EEC DATA NOT AVAILABLE shows on the CDU		
- engine 1	730 400 51	73-05 TASK 803
- engine 2	730 400 52	73-05 TASK 803

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Engine BITE (continued)		
• CH B EEC DATA NOT AVAILABLE shows on the CDU		
- engine 1	730 410 51	73-05 TASK 803
- engine 2	730 410 52	73-05 TASK 803
• ENGINE MAINTENANCE CAN NOT BE ACCESSED - THE ENGINE'S FLIGHT INDICATOR SHOWS FLIGHT shows on the CDU, airplane is on the ground		
- engine 1	730 440 51	73-05 TASK 813
- engine 2	730 440 52	73-05 TASK 813
• FLIGHT LEGS BETWEEN CHANNEL A AND CHANNEL B ARE NOT SYNCHRONIZED shows on Recent Faults page or Fault History page		
- engine 1	730 456 51	73-05 TASK 815
- engine 2	730 456 52	73-05 TASK 815
• maintenance message does not erase		
- engine 1	730 450 51	73-06 TASK 814
- engine 2	730 450 52	73-06 TASK 814
ENGINE CONTROL light		
• light does not come ON during the EEC Test		
- engine 1	730 330 51	73-06 TASK 813
- engine 2	730 330 52	73-06 TASK 813
• light on		
- engine 1	730 010 51	73-06 TASK 801
- engine 2	730 010 52	73-06 TASK 801
Engine EEC		
• does not power-up		
- engine 1	730 430 51	73-05 TASK 804
- engine 2	730 430 52	73-05 TASK 804
Engine EGT indication		
• blank		
- engine 1	770 010 51	73-05 TASK 804
- engine 2	770 010 52	73-05 TASK 804
• Zero or fluctuates		
- engine 1	770 015 51	77-05 TASK 801
- engine 2	770 015 52	77-05 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Engine fire extinguishing		
• APU BOTTLE DISCHARGE light on	262 070 00	26-20 TASK 802
• indication not normal when the EXT TEST switch is moved to 1	262 010 00	26-20 TASK 801
• indication not normal when the EXT TEST switch is moved to 2	262 020 00	26-20 TASK 801
• L BOTTLE DISCHARGDE light on	262 050 00	26-20 TASK 802
• left bottle does not release extinguishant when the fire handle is turned	262 030 00	26-20 TASK 803
• R BOTTLE DISCHARGED light on	262 060 00	26-20 TASK 802
• right bottle does not release extinguishant when the fire handle is turned	262 040 00	26-20 TASK 803
Engine fire light		
• light is on		
- engine 1	261 021 51	26-10 TASK 811
- engine 2	261 021 52	26-10 TASK 811
Engine Fire, Flames or Smoke		
• Flames or Smoke from the Engine Exhaust or Center Plug		
- engine 1	710 040 51	71-05 TASK 811
- engine 2	710 040 52	71-05 TASK 811
Engine flameout		
• engine restart not attempted; record engine condition		
- engine 1	730 150 51	73-06 TASK 808
- engine 2	730 150 52	73-06 TASK 808
• engine restart not OK, F/F low		
- engine 1	730 100 51	73-06 TASK 808
- engine 2	730 100 52	73-06 TASK 808
• engine restart not OK, F/F zero		
- engine 1	730 110 51	73-06 TASK 808
- engine 2	730 110 52	73-06 TASK 808
• engine restart not OK, low windmill N2		
- engine 1	730 130 51	73-06 TASK 808
- engine 2	730 130 52	73-06 TASK 808

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Engine flameout (continued)		
• engine restart not OK, unknown/other reasons		
- engine 1	730 140 51	73-06 TASK 808
- engine 2	730 140 52	73-06 TASK 808
• engine restart not OK, VIB high		
- engine 1	730 120 51	71-05 TASK 808
- engine 2	730 120 52	71-05 TASK 808
• engine restart OK; record suspected cause of flameout		
- engine 1	730 090 51	73-06 TASK 807
- engine 2	730 090 52	73-06 TASK 807
Engine fuel indication		
• FF, N1, N2, and EGT read low or fluctuate		
- engine 1	730 160 51	73-06 TASK 809
- engine 2	730 160 52	73-06 TASK 809
• fuel flow is high, engine parameters (EGT, N1, N2) normal		
- engine 1	730 170 51	73-07 TASK 802
- engine 2	730 170 52	73-07 TASK 802
• fuel flow is intermittent or blank, engine parameters (EGT, N1, N2, and fuel used) normal		
- engine 1	730 180 51	73-07 TASK 802
- engine 2	730 180 52	73-07 TASK 802
• fuel flow is zero or low, engine parameters (EGT, N1, N2) not normal and fuel used is low		
- engine 1	730 200 51	73-06 TASK 809
- engine 2	730 200 52	73-06 TASK 809
• fuel flow is zero or low, engine parameters (EGT, N1, N2, and fuel used) normal		
- engine 1	730 190 51	73-07 TASK 802
- engine 2	730 190 52	73-07 TASK 802
• fuel used indication not normal, fuel flow normal		
- engine 1	730 210 51	73-07 TASK 801
- engine 2	730 210 52	73-07 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Engine idle speed		
• Approach idle speed high		
- engine 1	730 220 51	73-05 TASK 806
- engine 2	730 220 52	73-05 TASK 806
• Approach idle speed low, ENG ANTI-ICE switch at ON		
- engine 1	730 230 51	73-07 TASK 803
- engine 2	730 230 52	73-07 TASK 803
• Approach idle speed low, landing flaps selected		
- engine 1	730 240 51	73-07 TASK 804
- engine 2	730 240 52	73-07 TASK 804
• Approach idle speed low, landing flaps selected and ENG ANTI-ICE switch at ON		
- engine 1	730 250 51	73-07 TASK 803
- engine 2	730 250 52	73-07 TASK 803
• minimum idle speed high		
- engine 1	730 260 51	73-05 TASK 807
- engine 2	730 260 52	73-05 TASK 807
• minimum idle speed low		
- engine 1	730 270 51	73-05 TASK 807
- engine 2	730 270 52	73-05 TASK 807
Engine motoring		
• no or low maximum dry motor speed (N2 low), duct pressure low (less than 30 psi), START VLV OPEN message shows on the engine display		
- engine 1	800 010 51	80-07 TASK 801
- engine 2	800 010 52	80-07 TASK 801
• no or low maximum dry motor speed (N2 low), duct pressure normal, START VLV OPEN message shows on the engine display		
- engine 1	800 020 51	80-07 TASK 802
- engine 2	800 020 52	80-07 TASK 802
Engine N1 indication		
• blank		
- engine 1	770 020 51	77-05 TASK 802
- engine 2	770 020 52	77-05 TASK 802

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Engine N1 indication (continued)		
• fluctuates		
- engine 1	770 025 51	77-05 TASK 806
- engine 2	770 025 52	77-05 TASK 806
Engine N2 indication		
• blank		
- engine 1	770 030 51	77-05 TASK 803
- engine 2	770 030 52	77-05 TASK 803
• fluctuates		
- engine 1	770 035 51	77-05 TASK 807
- engine 2	770 035 52	77-05 TASK 807
Engine nacelle or strut dragged or damaged		
- engine 1	055 100 51	05-51 TASK 811
- engine 2	055 100 52	05-51 TASK 811
Engine oil consumption		
• high (oil quantity decreases at a quick rate)		
- engine 1	790 010 51	79-05 TASK 801
- engine 2	790 010 52	79-05 TASK 801
Engine oil pressure indication		
• high		
- engine 1	790 015 51	79-05 TASK 802
- engine 2	790 015 52	79-05 TASK 802
• intermittent or blank		
- engine 1	790 050 51	79-05 TASK 807
- engine 2	790 050 52	79-05 TASK 807
• low or zero (red)		
- engine 1	790 045 51	79-05 TASK 803
- engine 2	790 045 52	79-05 TASK 803
• red bar shows on oil pressure indication scale/bar		
- left engine	790 055 51	31-63 TASK 827
- right engine	790 055 52	31-63 TASK 827

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Engine oil quantity indication		
• high		
- engine 1	790 060 51	79-05 TASK 808
- engine 2	790 060 52	79-05 TASK 808
• inaccurate, intermittent, remains constant, or blank		
- engine 1	790 080 51	79-05 TASK 810
- engine 2	790 080 52	79-05 TASK 810
• low		
- engine 1	790 070 51	79-05 TASK 809
- engine 2	790 070 52	79-05 TASK 809
Engine oil temperature indication		
• high (amber)		
- engine 1	790 085 51	79-05 TASK 811
- engine 2	790 085 52	79-05 TASK 811
• high (red)		
- engine 1	790 090 51	79-05 TASK 812
- engine 2	790 090 52	79-05 TASK 812
• intermittent or blank		
- engine 1	790 100 51	79-05 TASK 815
- engine 2	790 100 52	79-05 TASK 815
• red bar shows on oil temperature indication scale/bar		
- left engine	790 095 51	31-63 TASK 827
- right engine	790 095 52	31-63 TASK 827
Engine overspeed		
• N1 over redline		
- engine 1	710 060 51	71-06 TASK 801
- engine 2	710 060 52	71-06 TASK 801
• N2 over redline		
- engine 1	710 070 51	71-06 TASK 802
- engine 2	710 070 52	71-06 TASK 802
• reverse thrust (N1) over limit, write maximum N1		
- engine 1	710 080 51	71-06 TASK 803
- engine 2	710 080 52	71-06 TASK 803

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Engine overtemperature (except starting)		
• EGT over amber band limit due to surge/stall		
- engine 1	710 100 51	71-05 TASK 804
- engine 2	710 100 52	71-05 TASK 804
• EGT over amber band limit, no surge/stall		
- engine 1	710 090 51	71-06 TASK 804
- engine 2	710 090 52	71-06 TASK 804
• EGT over redline due to surge/stall		
- engine 1	710 115 51	71-06 TASK 806
- engine 2	710 115 52	71-06 TASK 806
• EGT over redline, no surge/stall		
- engine 1	710 110 51	71-06 TASK 805
- engine 2	710 110 52	71-06 TASK 805
Engine parameters		
• EGT fluctuates at all power settings		
- engine 1	710 140 51	71-06 TASK 807
- engine 2	710 140 52	71-06 TASK 807
• EGT high		
- engine 1	710 150 51	71-06 TASK 807
- engine 2	710 150 52	71-06 TASK 807
• EGT low		
- engine 1	710 160 51	71-06 TASK 807
- engine 2	710 160 52	71-06 TASK 807
• N1, N2, EGT, and FF read low or fluctuate		
- engine 1	710 130 51	73-06 TASK 809
- engine 2	710 130 52	73-06 TASK 809
Engine seizure		
- engine 1	055 120 51	05-51 TASK 811
- engine 2	055 120 52	05-51 TASK 811
Engine start		
• EGT increase and lightoff not normal (impending hot start), fuel flow and duct pressure normal		
- engine 1	800 030 51	80-05 TASK 801
- engine 2	800 030 52	80-05 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Engine start (continued)		
• engine overtemperature, EGT red, engine did not have an automatic shutdown		
- engine 1	800 270 51	80-05 TASK 807
- engine 2	800 270 52	80-05 TASK 807
• engine overtemperature, EGT red, engine had an automatic shutdown		
- engine 1	800 070 51	80-05 TASK 802
- engine 2	800 070 52	80-05 TASK 802
• fuel flow high, EGT high, engine started		
- engine 1	800 080 51	80-05 TASK 803
- engine 2	800 080 52	80-05 TASK 803
• fuel flow low, high, or zero, EGT and N2 increase normal, engine started		
- engine 1	800 090 51	80-05 TASK 804
- engine 2	800 090 52	80-05 TASK 804
• No EGT Rise (no Lightoff) during L (R) Engine start attempt and Zero Fuel Flow indicated; ENG VALVE CLOSED and SPAR VALVE CLOSED Lights are OFF		
- engine 1	800 200 51	80-06 TASK 805
- engine 2	800 200 52	80-06 TASK 805
• No EGT Rise (no Lightoff) during L (R) Engine start attempt; Duct Pressure and N2 Normal and SPAR VALVE CLOSED Light is ON		
- engine 1	800 150 51	80-06 TASK 802
- engine 2	800 150 52	80-06 TASK 802
• no lightoff, duct pressure and N2 normal, ENG VALVE CLOSED light on		
- engine 1	800 140 51	80-06 TASK 801
- engine 2	800 140 52	80-06 TASK 801
• no lightoff, fuel flow normal, ignition switch at IGN L, engine start normal with ignition switch at IGN R or BOTH		
- engine 1	800 180 51	80-06 TASK 803
- engine 2	800 180 52	80-06 TASK 803

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Engine start (continued)		
• no lightoff, fuel flow normal, ignition switch at IGN R, engine start normal with ignition switch at IGN L or BOTH		
- engine 1	800 190 51	80-06 TASK 804
- engine 2	800 190 52	80-06 TASK 804
• no N1 rotation, EGT and N2 increase normal, engine started		
- engine 1	800 110 51	80-05 TASK 805
- engine 2	800 110 52	80-05 TASK 805
• slow N2 acceleration to idle or hung start		
- engine 1	800 220 51	80-05 TASK 806
- engine 2	800 220 52	80-05 TASK 806
• START VLV OPEN message does not show on the engine display, N2 rotation normal		
- engine 1	800 050 51	80-07 TASK 803
- engine 2	800 050 52	80-07 TASK 803
• START VLV OPEN message does not show on the engine display, no N2 rotation		
- engine 1	800 060 51	80-07 TASK 804
- engine 2	800 060 52	80-07 TASK 804
• START VLV OPEN message flashes (for up to 10 seconds) and then stays on during engine engine operation		
- engine 1	800 062 51	80-07 TASK 809
- engine 2	800 062 52	80-07 TASK 809
Engine start switch		
• switch does not hold in GRD position, switch manually held in GRD position, N2 rotation normal		
- engine 1	800 230 51	80-07 TASK 805
- engine 2	800 230 52	80-07 TASK 805
• switch does not hold in GRD position, switch manually held in GRD position, no N2 rotation		
- engine 1	800 240 51	80-07 TASK 806
- engine 2	800 240 52	80-07 TASK 806

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Engine start switch (continued)		
• Switch moves from GRD to OFF before N2 is at 55%, engine started		
- engine 1	800 250 51	80-07 TASK 807
- engine 2	800 250 52	80-07 TASK 807
• Switch stays at GRD after N2 is more than 55%, engine started		
- engine 1	800 260 51	80-07 TASK 808
- engine 2	800 260 52	80-07 TASK 808
Engine strut or nacelle dragged or damaged		
- engine 1	055 100 51	05-51 TASK 811
- engine 2	055 100 52	05-51 TASK 811
Engine surge/stall		
• Surge/stall during acceleration or deceleration, engine operation normal after thrust was decreased to idle, engine shutdown		
- engine 1	710 180 51	71-05 TASK 804
- engine 2	710 180 52	71-05 TASK 804
• Surge/stall during acceleration or deceleration, engine operation not normal after thrust was decreased to idle, engine shutdown		
- engine 1	710 190 51	71-05 TASK 804
- engine 2	710 190 52	71-05 TASK 804
• Surge/stall during reverse thrust, engine operation normal after thrust was decreased to idle		
- engine 1	710 240 51	71-05 TASK 804
- engine 2	710 240 52	71-05 TASK 804
• Surge/stall during reverse thrust, engine operation not normal after thrust was decreased to idle		
- engine 1	710 250 51	71-05 TASK 804
- engine 2	710 250 52	71-05 TASK 804
• Surge/stall during takeoff, engine operation normal after surge		
- engine 1	710 200 51	71-05 TASK 804
- engine 2	710 200 52	71-05 TASK 804

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Engine surge/stall (continued)		
• Surge/stall during takeoff, engine operation not normal after surge, engine shutdown		
- engine 1	710 210 51	71-05 TASK 804
- engine 2	710 210 52	71-05 TASK 804
Engine Tachometer System		
• Thrust Targets Do Not Agree Between ENG-1 and ENG-2	771 101 00	77-11 TASK 804
Engine takeoff thrust		
• low		
- engine 1	730 280 51	73-05 TASK 808
- engine 2	730 280 52	73-05 TASK 808
Engine thrust loss (automatic deceleration)		
• With no movement of thrust levers, engine parameters normal		
- engine 1	730 300 51	73-06 TASK 812
- engine 2	730 300 52	73-06 TASK 812
• With no movement of thrust levers, engine parameters not normal (VIB high)		
- engine 1	730 310 51	71-05 TASK 808
- engine 2	730 310 52	71-05 TASK 808
Engine turns while fire handle is in the pulled position		
- engine 1	291 201 51	29-11 TASK 801
- engine 2	291 201 52	29-11 TASK 801
Engine VIB indication		
• blank		
- engine 1	770 040 51	77-05 TASK 805
- engine 2	770 040 52	77-05 TASK 805
• Zero or fluctuates		
- engine 1	770 050 51	77-05 TASK 804
- engine 2	770 050 52	77-05 TASK 804

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Engine vibration		
• Vibration high		
- engine 1	710 232 51	71-05 TASK 808
- engine 2	710 232 52	71-05 TASK 808
Entry Door		
• Handle Movement		
- forward	521 011 44	52-10 TASK 815
Entry door exterior handle		
• Difficult to operate		
- aft	521 010 45	52-10 TASK 811
- forward	521 010 44	52-10 TASK 811
EQUIP COOLING EXHAUST OFF light		
• light on with switch at ALTERNATE	212 080 00	21-27 TASK 805
• light on with switch at NORMAL	212 090 00	21-27 TASK 806
EQUIP COOLING SUPPLY OFF light		
• light on with switch at ALTERNATE	212 100 00	21-27 TASK 807
• light on with switch at NORMAL	212 110 00	21-27 TASK 808
Equipment Cooling Exhaust Fans Do Not Shut Off When Commanded During a Cargo Compartment Smoke Alert	212 120 00	21-27 TASK 811
Equipment Cooling Supply Fans Do Not Shut Off When Commanded During a Cargo Compartment Smoke Alert	212 115 00	21-27 TASK 810
Escape rope (lanyard)		
• damaged		
- captain's	256 130 31	25-61 TASK 802
- first officer's	256 130 32	25-61 TASK 802
• unstowed		
- captain's	256 140 31	25-61 TASK 803
- first officer's	256 140 32	25-61 TASK 803
Escape rope (lanyard) compartment cover		
• will not close		
- captain's	256 120 31	25-61 TASK 801
- first officer's	256 120 32	25-61 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
EXT AFT light for cargo fire extinguishing		
• light does not come on during cargo fire test	262 210 45	26-23 TASK 812
EXT FWD light for cargo fire extinguishing		
• light does not come on during cargo fire test	262 210 44	26-23 TASK 812
EXT TEST		
• Test failed		
- APU	262 080 00	26-20 TASK 801
- engine 1	262 010 00	26-20 TASK 801
- engine 2	262 020 00	26-20 TASK 801
F/O PITOT light		
• light on	303 030 00	30-31 TASK 803
FAIL light on the CDU		
• light on	346 080 00	34-61 TASK 807
Faucet water flow not sufficient	381 021 00	38-10 TASK 806
Faucet water pressure too high	381 022 00	38-10 TASK 809
Faucet water too hot	381 024 00	38-10 TASK 808
Fault did not occur in any system during the flight leg	999 999 99	31-98 TASK 801
FAULT light for the APU		
• light on, APU had a protective shutdown	492 010 00	49-60 TASK 801
• light on, APU operates without a protective shutdown	492 020 00	49-15 TASK 801
FAULT light for the fire detection system on (P8 control stand)		
- engine 1	261 040 51	26-10 TASK 801
- engine 2	261 040 52	26-10 TASK 801
FAULT light for the IRS		
• light on		
- left	342 070 41	34-21 TASK 803
- right	342 070 42	34-21 TASK 803

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
FD flag shows on flight director display		
- captain's	221 170 31	22-11 TASK 801
- captain's and first officer's	221 170 48	22-11 TASK 801
- first officer's	221 170 32	22-11 TASK 801
FD status		
• does not show on the flight mode annunciator with F/D on		
- captain's	221 150 31	22-11 TASK 801
- captain's and first officer's	221 150 48	22-11 TASK 801
- first officer's	221 150 32	22-11 TASK 801
FEEL DIFF PRESS light		
• light on	273 060 00	27-31 TASK 815
FF, N1, N2, and EGT		
• read low or fluctuate		
- engine 1	730 160 51	73-06 TASK 809
- engine 2	730 160 52	73-06 TASK 809
FILTER BYPASS light		
• light does not come ON during the EEC Test		
- engine 1	730 340 51	73-05 TASK 812
- engine 2	730 340 52	73-05 TASK 812
• light on		
- engine 1	730 320 51	73-05 TASK 801
- engine 2	730 320 52	73-05 TASK 801
Fire extinguisher, flight compartment		
• missing	262 110 00	26-99 TASK 801
• seal broken or missing	262 090 00	26-99 TASK 801
• used	262 100 00	26-99 TASK 801
Fire extinguishing		
• during test fire handle light does not come on		
- APU	262 222 50	26-20 TASK 807
- engine 1	262 222 51	26-20 TASK 807
- engine 2	262 222 52	26-20 TASK 807

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Fire extinguishing bottle		
• APU bottle discharged	262 070 00	26-20 TASK 802
• does not release extinguishant when activated at the remote APU fire control panel	262 130 00	26-20 TASK 804
• does not release extinguishant when the fire handle is turned		
- APU	262 120 00	26-20 TASK 803
- engine left	262 030 00	26-20 TASK 803
- engine right	262 040 00	26-20 TASK 803
• engine left bottle discharged	262 050 00	26-20 TASK 802
• engine right bottle discharged	262 060 00	26-20 TASK 802
Fire handle in the pulled position while engine turns		
- engine 1	291 201 51	29-11 TASK 801
- engine 2	291 201 52	29-11 TASK 801
Fire, false alarm		
- APU	261 060 00	26-10 TASK 801
Fire/overheat detection test		
• Test failed, warning lights and alarm do not operate		
- APU	261 070 00	26-10 TASK 801
- engine 1	261 030 51	26-10 TASK 801
- engine 2	261 030 52	26-10 TASK 801
- wheel well	261 100 00	26-18 TASK 833
Fireproof gloves		
• damaged	256 015 00	25-99 TASK 801
• missing	256 010 00	25-99 TASK 801
Flame or smoke in APU exhaust	492 150 00	49-55 TASK 801
Flames, momentary, from APU exhaust during main engine start	492 160 00	49-55 TASK 808
Flap lever		
• does not move freely	275 100 00	27-51 TASK 843
Flap Maneuvering Speed Cursor		
• Does Not Show on the PFD	316 084 00	31-63 TASK 829

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Flap position indicator		
• has fast movement	275 030 00	27-51 TASK 844
• has needles split	275 040 00	27-51 TASK 840
• has slow movement	275 050 00	27-51 TASK 845
• needle(s) do not operate	275 060 00	27-51 TASK 841
• needle(s) stick	275 070 00	27-51 TASK 842
Flaps		
• do not extend with alternate control	275 091 00	27-51 TASK 838
• do not operate with alternate control	275 090 00	27-51 TASK 837
• do not operate with primary control	275 080 00	27-51 TASK 836
• Do not retract with alternate control	275 092 00	27-51 TASK 839
• lever does not move freely	275 100 00	27-51 TASK 843
• load relief occurrs at wrong airspeed	275 020 00	27-51 TASK 803
• operation is fast	275 110 00	27-51 TASK 844
• operation is slow	275 120 00	27-51 TASK 845
• TE Flap Transmission Torque Trip Indicator extended	275 140 00	27-51 TASK 849
• Trailing Edge Flap Lockout on Aproach	275 081 00	27-51 TASK 836
Flaps and Slats, Leading Edge		
• do not extend during alternate system operation	278 020 00	27-81 TASK 802
• do not extend during normal system operation	278 030 00	27-81 TASK 803
• Do not retract	278 040 00	27-81 TASK 803
• one or more Leading Edge Surfaces operate slowly	278 050 00	27-81 TASK 805
Flaps, Leading Edge		
• droops too much with hydraulic pressure off	278 010 00	27-81 TASK 801
• TRANSIT light stays on		
- 1	278 070 01	27-88 TASK 820
- 2	278 070 02	27-88 TASK 820
- 3	278 070 03	27-88 TASK 820
- 4	278 070 04	27-88 TASK 820
Flaps/Slats extended with airplane speed over placard limit	055 090 00	05-51 TASK 810

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Flashlight		
• Battery low	256 070 00	25-99 TASK 801
• damaged	256 080 00	25-99 TASK 801
• does not come on	256 090 00	25-99 TASK 801
• Does not go off	256 091 00	25-99 TASK 801
• missing	256 100 00	25-99 TASK 801
Flashlight LED		
• does not come on	256 110 00	25-99 TASK 801
Flight altitude display		
• indication blank	213 090 00	21-31 TASK 803
Flight Compartment		
• Outlet Unit Does Not Operate	238 302 00	23-82 TASK 802
• Outlet Unit Has No Power or USB Problems	238 303 00	23-82 TASK 803
Flight deck door (enhanced security door)		
• chime does not sound with switch set to AUTO and correct code in keypad	525 121 00	52-50 TASK 808
• chime sounds with switch set to DENY	525 131 00	52-50 TASK 807
• does not lock with switch set to AUTO	525 141 00	52-50 TASK 804
• does not unlock with switch set to AUTO and correct code in keypad	525 151 00	52-50 TASK 806
• does not unlock with switch set to UNLKD	525 161 00	52-50 TASK 805
• LOCK FAIL light is on	525 171 00	52-50 TASK 809
• unlocks with switch set to DENY	525 181 00	52-50 TASK 807
Flight director		
• bars are biased out of view after TOGA button is pushed		
- captain's	221 165 31	22-11 TASK 829
- first officer's	221 165 32	22-11 TASK 829
• Display does not move correctly to guide the airplane to the set altitude		
- captain's	221 360 31	22-11 TASK 801
- captain's and first officer's	221 360 48	22-11 TASK 801
- first officer's	221 360 32	22-11 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Flight director (continued)		
• does not operate, FD status does not show on the flight mode annunciator, autopilot not on		
- captain's	221 160 31	22-11 TASK 801
- captain's and first officer's	221 160 48	22-11 TASK 801
- first officer's	221 160 32	22-11 TASK 801
• FD flag shows on flight director display		
- captain's	221 170 31	22-11 TASK 801
- captain's and first officer's	221 170 48	22-11 TASK 801
- first officer's	221 170 32	22-11 TASK 801
• FD status does not show on the flight mode annunciator with F/D on		
- captain's	221 150 31	22-11 TASK 801
- captain's and first officer's	221 150 48	22-11 TASK 801
- first officer's	221 150 32	22-11 TASK 801
• pitch or roll mode does not engage or disengages automatically, flight command display goes out of view		
- captain's	221 210 31	22-11 TASK 801
- captain's and first officer's	221 210 48	22-11 TASK 801
- first officer's	221 210 32	22-11 TASK 801
• TO/GA pitch mode does not show on the flight mode annunciator for takeoff when TO/GA switch is pushed and F/D on		
- captain's	221 190 31	22-11 TASK 801
- captain's and first officer's	221 190 48	22-11 TASK 801
- first officer's	221 190 32	22-11 TASK 801
Flight interphone		
• does not operate		
- all stations	235 030 48	23-51 TASK 803
- captain's	235 030 31	23-51 TASK 804
- first observer's	235 030 33	23-51 TASK 804
- first officer's	235 030 32	23-51 TASK 804
Flight kit light		
• does not come on correctly		
- captain's	331 110 31	33-10 TASK 801
- first officer's	331 110 32	33-10 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Flight kit light (continued)		
• Does not go off		
- captain's	331 111 31	33-10 TASK 801
- first officer's	331 111 32	33-10 TASK 801
FLIGHT LEGS BETWEEN CHANNEL A AND CHANNEL B ARE NOT SYNCHRONIZED shows on Engine BITE Recent Faults page or Fault History page		
- engine 1	730 456 51	73-05 TASK 815
- engine 2	730 456 52	73-05 TASK 815
FLIGHT RECORDER OFF light		
• light on	313 010 00	31-31 TASK 805
Floodlight, control stand		
• does not come on correctly	331 090 00	33-10 TASK 801
• Does not go off	331 091 00	33-10 TASK 801
Floodlight, glareshield (AFCS)		
• does not come on correctly	331 070 00	33-10 TASK 801
• Does not go off	331 071 00	33-10 TASK 801
Floodlight, oxygen mask		
• does not come on	331 140 00	33-10 TASK 801
Floodlight, panel		
• does not come on correctly		
- captain's	331 080 31	33-10 TASK 801
- center	331 080 43	33-10 TASK 801
- first officer's	331 080 32	33-10 TASK 801
• Does not go off		
- captain's	331 081 31	33-10 TASK 801
- center	331 081 43	33-10 TASK 801
- first officer's	331 081 32	33-10 TASK 801
FLT ALT display		
• indication blank	213 090 00	21-31 TASK 803
FLT CONTROL A LOW PRESSURE light		
• light on	270 010 00	27-21 TASK 813

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
FLT CONTROL B LOW PRESSURE light		
• light on	270 020 00	27-21 TASK 814
FMC DISAGREE message shows on CDU	346 075 00	34-61 TASK 835
FMC DISAGREE message shows on the PFD	346 076 00	34-61 TASK 835
FMC FAIL light on the CDU		
• light on	346 080 00	34-61 TASK 807
FMC menu prompt flashes or is slow to respond	346 131 00	34-61 TASK 838
FMC Nav data crossloading problem	346 120 00	34-61 TASK 832
FMC shows in the middle of the CDU display	346 070 00	34-61 TASK 807
FMC software load		
• CHECK DBL OR INTERFACE message shows on CDU	346 290 00	34-61 TASK 812
• CHECK MEDIA message shows on CDU	346 330 00	34-61 TASK 816
• DB EXCEEDS FMC MEMORY message shows on CDU	346 300 00	34-61 TASK 813
• DB-OFP INCOMPATIBLE message shows on CDU	346 320 00	34-61 TASK 815
• INCORRECT DISK INSERTED message shows on CDU	346 340 00	34-61 TASK 817
• RESET COUNT EXCEEDED message shows on CDU	346 310 00	34-61 TASK 814
FMCS		
• LNAV disengages during flight	346 101 00	34-61 TASK 844
• VNAV disengages during flight	346 102 00	34-61 TASK 845
FOD/Birdstrike		
• in engine, engine had a surge/stall		
- engine 1	710 030 51	71-05 TASK 805
- engine 2	710 030 52	71-05 TASK 805
• in engine, engine parameters normal		
- engine 1	710 010 51	71-05 TASK 801
- engine 2	710 010 52	71-05 TASK 801
• in engine, engine parameters not normal or unknown		
- engine 1	710 020 51	71-05 TASK 801
- engine 2	710 020 52	71-05 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
FOD/Birdstrike (continued)		
• on airframe/area unknown, engine parameters normal . .	055 130 00	05-51 TASK 804
Fog, high humidity, or ice in cabin	215 010 00	21-51 TASK 801
Foot air outlet		
• does not operate		
- captain's	212 020 31	21-22 TASK 801
- first officer's	212 020 32	21-22 TASK 801
Forward thrust lever		
• Difficult to move in forward thrust		
- engine 1	760 020 51	76-05 TASK 802
- engine 2	760 020 52	76-05 TASK 802
• has lost motion, no engine response to thrust lever movement		
- engine 1	760 030 51	76-05 TASK 803
- engine 2	760 030 52	76-05 TASK 803
• jammed in forward thrust (no movement)		
- engine 1	760 025 51	76-05 TASK 804
- engine 2	760 025 52	76-05 TASK 804
• levers not aligned (staggered) for same N1 on both engines	760 010 00	76-05 TASK 801
FQIS BITE INOP message		
• Shows on CDU	284 101 00	28-41 TASK 819
Fuel pump LOW PRESSURE light		
• light comes on, but not in the specified time (15 +/-2 seconds) during boost pump auto-shutoff functional test		
- center tank, left pump	282 312 41	28-22 TASK 820
- center tank, right pump	282 312 42	28-22 TASK 821
• light does not come on during boost pump auto-shutoff functional test		
- center tank, left pump	282 311 41	28-22 TASK 820
- center tank, right pump	282 311 42	28-22 TASK 821

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Fuel pump LOW PRESSURE light (continued)		
• light on		
- center tank, left pump	282 130 43	28-22 TASK 801
- center tank, right pump	282 140 43	28-22 TASK 802
- no. 1 aft fuel pump	282 150 01	28-22 TASK 803
- no. 1 fwd and aft fuel pumps	282 160 01	28-22 TASK 803
- no. 1 fwd fuel pump	282 170 01	28-22 TASK 804
- no. 2 aft fuel pump	282 150 02	28-22 TASK 805
- no. 2 fwd and aft fuel pumps	282 160 02	28-22 TASK 805
- no. 2 fwd fuel pump	282 170 02	28-22 TASK 806
Fuel quantity indication, flight compartment		
• CONFIG message shows	284 022 00	28-41 TASK 820
• error or blank		
- all tanks	284 020 48	28-41 TASK 813
- center tank	284 020 43	28-41 TASK 813
- no. 1 tank	284 020 01	28-41 TASK 813
- no. 2 tank	284 020 02	28-41 TASK 813
• fluctuates or is too high or too low		
- center tank	284 010 43	28-41 TASK 814
- no. 1 tank	284 010 01	28-41 TASK 814
- no. 2 tank	284 010 02	28-41 TASK 814
• IMBAL message shows	284 023 00	28-41 TASK 820
• LOW message shows	284 024 00	28-41 TASK 820
Fuel quantity indicator, refuel panel		
• blank		
- all tanks	282 010 48	28-21 TASK 804
- center tank	282 010 43	28-21 TASK 804
- tank no. 1	282 010 01	28-21 TASK 804
- tank no. 2	282 010 02	28-21 TASK 804
• Display is not correct with switch at TEST GAGES		
- all tanks	282 011 48	28-21 TASK 802
- center tank	282 011 43	28-21 TASK 802
- tank no. 1	282 011 01	28-21 TASK 802
- tank no. 2	282 011 02	28-21 TASK 802

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Fuel quantity indicator, refuel panel (continued)		
• flashes		
- center tank	282 015 43	28-21 TASK 816
- tank no. 1	282 015 01	28-21 TASK 816
- tank no. 2	282 015 02	28-21 TASK 816
• shows ARINC error message		
- all tanks	282 013 48	28-21 TASK 817
- center tank	282 013 43	28-21 TASK 817
- tank no. 1	282 013 01	28-21 TASK 817
- tank no. 2	282 013 02	28-21 TASK 817
• Shows Id FAIL		
- all tanks	282 012 48	28-21 TASK 805
- center tank	282 012 43	28-21 TASK 805
- tank no. 1	282 012 01	28-21 TASK 805
- tank no. 2	282 012 02	28-21 TASK 805
Fuel suction feed		
• engine does not continue running the full five minutes during Engine Fuel Suction Feed Operational Test	282 251 00	28-22 TASK 819
Fuel tank		
• boost pump circuit breaker open		
- center tank, left pump	282 301 43	28-22 TASK 817
- center tank, right pump	282 302 43	28-22 TASK 818
- No. 1 tank, aft pump	282 301 01	28-22 TASK 814
- No. 1 tank, forward pump	282 302 01	28-22 TASK 813
- No. 2 tank, aft pump	282 301 02	28-22 TASK 816
- No. 2 tank, forward pump	282 302 02	28-22 TASK 815
• DC fuel pump circuit breaker open	282 303 00	28-25 TASK 803
• unwanted fuel transfer from a main tank to the center tank		
- from tank 1	282 100 01	28-21 TASK 803
- from tank 2	282 100 02	28-21 TASK 813
Fuel temperature indicator		
• does not operate correctly	284 030 00	28-43 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Fuel transfer (migration)		
• Unwanted fuel transfer from the center tank to the No. 1 tank	282 101 00	28-21 TASK 814
• Unwanted fuel transfer from the center tank to the No. 2 tank	282 102 00	28-21 TASK 815
Fuel valve for the APU		
• Does not fully open or fully close	493 010 00	49-60 TASK 801
Fumes or Smoke in Cabin		
• Pneumatic Power supplied by APU	499 010 00	49-55 TASK 802
• Pneumatic Power supplied by Engine		
- engine 1	710 300 51	71-05 TASK 807
- engine 2	710 300 52	71-05 TASK 807
FWD cargo fire light		
• light on (false alarm)	261 225 44	26-16 TASK 801
FWD SUPPLY DUCT air temperature indication is not correct	216 180 00	21-61 TASK 859
FWD ZONE CABIN air temperature indication is not correct	216 130 00	21-61 TASK 856
G/S flag shows on integrated standby flight display	342 604 00	34-24 TASK 808
G/S flag shows on the EFIS display		
- captain's	343 030 31	34-31 TASK 806
- first officer's	343 030 32	34-31 TASK 807
G/S flag shows on the Standby Attitude Indicator	342 650 00	34-24 TASK 802
Galley faucet leaks or faucet damaged	381 045 00	38-10 TASK 805
Galley service door exterior handle		
• Difficult to operate	524 010 00	52-10 TASK 811
GEN OFF BUS and SOURCE OFF lights		
• lights on with IDG 1 and IDG 2 on line		
- no. 1	242 040 01	24-21 TASK 801
- no. 2	242 040 02	24-21 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Generator SOURCE OFF light		
• light comes on and the transfer bus is not energized from the selected power source	242 080 00	24-21 TASK 823
• light comes on but no fault light on GCU is on		
- GEN 1 SOURCE OFF light	242 080 01	24-21 TASK 821
- GEN 2 SOURCE OFF light	242 080 02	24-21 TASK 821
Glareshield (AFCS) Floodlight		
• does not come on correctly	331 070 00	33-10 TASK 801
• Does not go off	331 071 00	33-10 TASK 801
Glideslope and localizer pointers		
• do not show, G/S and LOC flags do not show		
- captain's	343 050 31	34-31 TASK 809
- first officer's	343 050 32	34-31 TASK 809
Gloves, fireproof		
• damaged	256 015 00	25-99 TASK 801
• missing	256 010 00	25-99 TASK 801
GPS light on IRS mode select unit		
• Comes on when Master Caution pushed	345 411 00	34-58 TASK 802
• Stays on continuously	345 410 00	34-58 TASK 801
GPS Receiver		
• GPS-L and GPS-R position not available	345 641 48	34-58 TASK 810
• GPS-L position not available	345 641 41	34-58 TASK 811
• GPS-R position not available	345 641 42	34-58 TASK 812
• position, date, and/or time are not correct	345 641 00	34-58 TASK 809
GPS-L data on POS REF display of CDU		
• missing	346 460 00	34-61 TASK 801
GPS-R data on POS REF display		
• missing	346 470 00	34-61 TASK 801
GPWS		
• BITE display is blank	344 420 00	34-46 TASK 821

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
GPWS INOP light		
• light on	344 410 00	34-46 TASK 801
Ground mode		
• Shows with airplane in the air	320 030 00	32-09 TASK 801
Ground proximity		
• MAP/TERR RANGE DISAGREE message shows	344 470 00	34-46 TASK 858
• TERR FAIL message shows	344 450 00	34-46 TASK 856
• TERR POS message shows	344 430 00	34-46 TASK 856
• TERR RANGE DISAGREE message shows	344 460 00	34-46 TASK 857
• Terrain display does not show		
- captain's	344 480 31	34-46 TASK 853
- captain's and first officer's	344 480 48	34-46 TASK 853
- first officer's	344 480 32	34-46 TASK 853
GS data on POS REF display of CDU		
• missing	346 480 00	34-61 TASK 801
GYRO flag shows on the Standby Attitude Indicator	342 670 00	34-24 TASK 801
Hand microphone		
• damaged		
- captain's	235 060 31	23-51 TASK 802
- first observer's	235 060 33	23-51 TASK 802
- first officer's	235 060 32	23-51 TASK 802
• does not operate		
- captain's	235 050 31	23-51 TASK 801
- first observer's	235 050 33	23-51 TASK 801
- first officer's	235 050 32	23-51 TASK 801
Handle, assist problem		
- captain's	251 100 31	25-99 TASK 801
- first officer's	251 100 32	25-99 TASK 801
Hard landing or high drag/side load landing	055 040 00	05-51 TASK 806
HDG flag shows on integrated standby flight display	342 605 00	34-24 TASK 809
HDG flag shows on the radio magnetic indicator	342 410 00	34-22 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
HDG/TRK flag shows on the EFIS display		
- captain's	342 130 31	34-21 TASK 825
- first officer's	342 130 32	34-21 TASK 826
HEADING window display on the mode control panel		
• does not change with heading selector switch change	221 810 00	22-11 TASK 803
• does not show	221 820 00	22-11 TASK 803
Heading/track display		
• does not show		
- captain's	342 140 31	34-21 TASK 825
- first officer's	342 140 32	34-21 TASK 826
Headphone		
• damaged		
- captain's	235 070 31	23-51 TASK 802
- first observer's	235 070 33	23-51 TASK 802
- first officer's	235 070 32	23-51 TASK 802
- second observer's	235 070 34	23-51 TASK 802
• does not operate		
- captain's	235 040 31	23-51 TASK 801
- first observer's	235 040 33	23-51 TASK 801
- first officer's	235 040 32	23-51 TASK 801
- second observer's	235 040 34	23-51 TASK 801
Headset/boom microphone		
• damaged		
- captain's	235 020 31	23-51 TASK 802
- first officer's	235 020 32	23-51 TASK 802
• does not operate		
- captain's	235 010 31	23-51 TASK 801
- first officer's	235 010 32	23-51 TASK 801
HF 1 control panel problem	231 010 00	23-11 TASK 805
HF 1 radio		
• reception and transmission problem at all stations	231 060 48	23-11 TASK 806

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
HF 1 radio (continued)		
• reception and transmission problem at one station		
- captain's	231 060 31	23-11 TASK 806
- first observer's	231 060 33	23-11 TASK 806
- first officer's	231 060 32	23-11 TASK 806
• reception problem at all stations	231 070 48	23-11 TASK 806
• reception problem at one station		
- captain's	231 070 31	23-11 TASK 806
- first observer's	231 070 33	23-11 TASK 806
- first officer's	231 070 32	23-11 TASK 806
• Transmission problem at all stations	231 080 48	23-11 TASK 806
• Transmission problem at one station		
- captain's	231 080 31	23-11 TASK 806
- first observer's	231 080 33	23-11 TASK 806
- first officer's	231 080 32	23-11 TASK 806
HF 2 control panel problem	231 020 00	23-11 TASK 805
HF 2 radio		
• reception and transmission problem at all stations	231 180 48	23-11 TASK 806
• reception and transmission problem at one station		
- captain's	231 180 31	23-11 TASK 806
- first observer's	231 180 33	23-11 TASK 806
- first officer's	231 180 32	23-11 TASK 806
• reception problem at all stations	231 190 48	23-11 TASK 806
• reception problem at one station		
- captain's	231 190 31	23-11 TASK 806
- first observer's	231 190 33	23-11 TASK 806
- first officer's	231 190 32	23-11 TASK 806
• Transmission problem at all stations	231 200 48	23-11 TASK 806
• Transmission problem at one station		
- captain's	231 200 31	23-11 TASK 806
- first observer's	231 200 33	23-11 TASK 806
- first officer's	231 200 32	23-11 TASK 806

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Horn, call		
• does not sound	234 340 00	23-43 TASK 801
• operates continuously	234 350 00	23-43 TASK 802
• Sounds, ADIRU power problem, ON DC light on		
- left	342 200 41	34-21 TASK 829
- right	342 200 42	34-21 TASK 829
• Sounds, equipment cooling problem	342 190 00	34-21 TASK 829
Humidity high, fog, or ice in cabin	215 010 00	21-51 TASK 801
HYD BRAKE PRESS indicator		
• decreases faster than specified during parking brake hold check		
- parking brake released	324 161 00	32-44 TASK 802
- parking brake set	324 160 00	32-44 TASK 801
• does not operate	324 020 00	32-44 TASK 806
• low/zero with parking brake released	324 010 00	32-44 TASK 805
• low/zero with parking brake set	324 110 00	32-44 TASK 805
Hydraulic fluid		
• Comes out of the reservoir vent line	291 050 00	29-10 TASK 805
• Comes out of the reservoir vent line drain mast	291 060 00	29-10 TASK 805
• fluid leakage	291 040 00	29-10 TASK 812
• Transfers from system A to system B	291 070 00	29-10 TASK 806
• Transfers from system B to system A	291 080 00	29-10 TASK 807
Hydraulic fluid leakage in fuel tank	282 315 00	28-21 TASK 818
Hydraulic fluid quantity indication		
• does not return to the same level after operation of a "heavy use" system	293 150 00	29-30 TASK 808
• error or blank		
- system A	293 050 00	31-62 TASK 801
- system B	293 060 00	31-62 TASK 801
• flight compartment display and hydraulic reservoir gauge do not read the same		
- system A	293 070 00	31-62 TASK 801
- system B	293 080 00	31-62 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Hydraulic fluid quantity indication (continued)		
• flight compartment display moves erratically or jumps between readings		
- system A	293 110 00	31-62 TASK 801
- system B	293 120 00	31-62 TASK 801
• flight compartment display shows zero, reservoir has hydraulic fluid		
- system A	293 090 00	31-62 TASK 801
- system B	293 100 00	31-62 TASK 801
• Shows RF (76%)		
- system A	293 130 00	29-30 TASK 815
- system B	293 140 00	29-30 TASK 815
Hydraulic pressure indication		
• above 3200 psi		
- system A	291 090 00	29-10 TASK 808
- system B	291 100 00	29-10 TASK 809
• Below 2800 psi		
- system A	291 110 00	29-10 TASK 810
- system B	291 120 00	29-10 TASK 811
• momentarily below 2900 psi		
- system A	291 131 00	29-10 TASK 813
- system B	291 132 00	29-10 TASK 813
- systems A and B	291 133 00	29-10 TASK 813
• Zero		
- system A	293 020 00	29-30 TASK 803
- system B	293 025 00	29-30 TASK 804
Hydraulic reservoir gauge		
• Shows zero or below, reservoir has hydraulic fluid		
- system A	293 160 00	29-30 TASK 808
- system B	293 170 00	29-30 TASK 808
IAS DISAGREE message shows on airpseed display		
- captain's	342 046 31	31-62 TASK 876
- first officer's	342 046 32	31-62 TASK 876

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
IAS/MACH window display on the mode control panel		
• does not change with selector switch change	221 890 00	22-11 TASK 803
• does not show	221 900 00	22-11 TASK 803
IDG comes on line after 20 seconds	242 085 00	24-21 TASK 824
IDG differential pressure indicator		
• extended		
- left	242 121 41	24-11 TASK 803
- right	242 121 42	24-11 TASK 803
ILS		
• Audio tone does not occur or is weak		
- captain's	343 070 31	34-31 TASK 811
- first officer's	343 070 32	34-31 TASK 811
• Data on NAV STATUS display of CDU shows FAIL	346 500 00	34-61 TASK 801
• frequency shows dashes		
- ILS 1	343 060 01	34-31 TASK 810
- ILS 2	343 060 02	34-31 TASK 810
• test problem when you push the TEST switch on the navigation control panel		
- captain's	343 020 31	34-31 TASK 801
- first officer's	343 020 32	34-31 TASK 801
IMBAL message shows in fuel quantity indication (flight compartment)	284 023 00	28-41 TASK 820
INCORRECT DISK INSERTED message shows on CDU during FMC software load	346 340 00	34-61 TASK 817
Indicator light		
• does not come on correctly	331 010 00	33-10 TASK 801
• Does not go off	331 011 00	33-10 TASK 801
Integrated standby flight display		
• airspeed indication is different than common display system	342 614 00	34-24 TASK 816
• ALT flag shows	342 602 00	34-24 TASK 805
• altitude indication is different than common display system	342 612 00	34-24 TASK 813

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Integrated standby flight display (continued)		
• ATT flag shows	342 603 00	34-24 TASK 806
• attitude display disagrees with primary display; no flag shows	342 611 00	34-24 TASK 814
• dedicated battery system, front panel fault light is on	342 613 00	34-24 TASK 815
• display blank	342 601 00	34-24 TASK 804
• G/S flag shows	342 604 00	34-24 TASK 808
• HDG flag shows	342 605 00	34-24 TASK 809
• LOC flag shows	342 606 00	34-24 TASK 808
• OUT OF ORDER flag shows	342 607 00	34-24 TASK 810
• PROGRAM PIN ERROR flag shows	342 608 00	34-24 TASK 811
• SPD flag shows	342 609 00	34-24 TASK 812
• WAIT ATT flag shows	342 610 00	34-24 TASK 807
Interphone, flight		
• does not operate		
- all stations	235 030 48	23-51 TASK 803
- captain's	235 030 31	23-51 TASK 804
- first observer's	235 030 33	23-51 TASK 804
- first officer's	235 030 32	23-51 TASK 804
Interphone, service		
• distorted		
- all jacks	234 030 48	23-41 TASK 803
- jack adjacent to APU	234 120 00	23-41 TASK 802
- jack at aft entry light panel	234 150 00	23-41 TASK 802
- jack at EE rack	234 070 00	23-41 TASK 802
- jack at external power receptacle panel	234 190 00	23-41 TASK 802
- jack at left wheel well	234 230 00	23-41 TASK 802
- jack at right wheel well	234 270 00	23-41 TASK 802
- jack at right wing refueling slat	234 310 00	23-41 TASK 802
- jack in the electronic equipment bay	234 430 00	23-41 TASK 802
• does not connect to flight interphone	234 010 00	23-41 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Interphone, service (continued)		
• does not operate		
- all jacks	234 020 48	23-41 TASK 801
- jack adjacent to APU	234 100 00	23-41 TASK 802
- jack at aft entry light panel	234 140 00	23-41 TASK 802
- jack at EE rack	234 060 00	23-41 TASK 802
- jack at external power receptacle panel	234 180 00	23-41 TASK 802
- jack at left wheel well	234 220 00	23-41 TASK 802
- jack at right wheel well	234 260 00	23-41 TASK 802
- jack at right wing refueling slat	234 300 00	23-41 TASK 802
- jack in the electronic equipment bay	234 410 00	23-41 TASK 802
• intermittent		
- all jacks	234 040 48	23-41 TASK 803
- jack adjacent to APU	234 110 00	23-41 TASK 802
- jack at aft entry light panel	234 160 00	23-41 TASK 802
- jack at EE rack	234 080 00	23-41 TASK 802
- jack at external power receptacle panel	234 200 00	23-41 TASK 802
- jack at left wheel well	234 240 00	23-41 TASK 802
- jack at right wheel well	234 280 00	23-41 TASK 802
- jack at right wing refueling slat	234 320 00	23-41 TASK 802
- jack in the electronic equipment bay	234 420 00	23-41 TASK 802
• volume problem		
- all jacks	234 050 48	23-41 TASK 803
- jack adjacent to APU	234 130 00	23-41 TASK 802
- jack at aft entry light panel	234 170 00	23-41 TASK 802
- jack at EE rack	234 090 00	23-41 TASK 802
- jack at external power receptacle panel	234 210 00	23-41 TASK 802
- jack at left wheel well	234 250 00	23-41 TASK 802
- jack at right wheel well	234 290 00	23-41 TASK 802
- jack at right wing refueling slat	234 330 00	23-41 TASK 802
- jack in the electronic equipment bay	234 440 00	23-41 TASK 802
IRS DC FAIL light on		
- left	342 060 41	34-21 TASK 842
- right	342 060 42	34-21 TASK 842

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
IRS display unit (ISDU)		
• maintenance code shows in right window when HDG/STS mode selected	342 220 00	34-21 TASK 835
IRS FAULT light		
• light on		
- left	342 070 41	34-21 TASK 803
- right	342 070 42	34-21 TASK 803
IRS mode select unit		
• GPS light comes on when Master Caution pushed	345 411 00	34-58 TASK 802
• GPS light stays on continuously	345 410 00	34-58 TASK 801
IRS-L data on POS REF display of CDU is missing	346 440 00	34-61 TASK 801
IRS-R data on POS REF display of CDU		
• missing	346 450 00	34-61 TASK 801
Isolation valve		
• does not operate correctly	361 060 00	36-10 TASK 806
L ALPHA VANE light		
• light on	303 040 00	30-31 TASK 804
L BOTTLE DISCHARGED light		
• light on for the engine fire extinguishing	262 050 00	26-20 TASK 802
L ELV PITOT light		
• light on	303 050 00	30-31 TASK 805
L VALVE OPEN Light for WING ANTI-ICE		
• does not come on	301 080 00	30-11 TASK 805
• Does not go bright during transition	301 015 41	30-11 TASK 804
• slow to go from Bright to Dim when the WING ANTI-ICE Switch is moved to ON	301 010 00	30-11 TASK 801
• slow to go from Bright to OFF when the WING ANTI-ICE Switch is moved to OFF	301 020 00	30-11 TASK 802
• Stays ON bright	301 030 00	30-11 TASK 803
LAND ALT display		
• indication blank	213 100 00	21-31 TASK 803

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Landing Gear		
• LEFT GEAR, RIGHT GEAR, and NOSE GEAR Red and Green Lights (ALL) are ON at the same time		
- Gear Commanded DN	326 072 02	32-30 TASK 816
- Gear Commanded UP	326 072 01	32-30 TASK 815
Landing gear lever		
• does not move to the UP position in flight, is free to move to the UP position when the lock override is used	323 010 00	32-30 TASK 813
Landing gear position lights		
• lights not correct	326 010 00	32-09 TASK 801
Landing gear, main		
• LEFT GEAR green light does not come on with landing gear lever at DN, LEFT GEAR red light on, alternate gear extension was attempted	326 040 41	32-32 TASK 805
• LEFT GEAR green light does not come on with landing gear lever at DN, LEFT GEAR red light on, indications normal after alternate gear extension	326 050 41	32-32 TASK 802
• LEFT GEAR green light does not go off with landing gear lever at UP, LEFT GEAR red light on	326 060 41	32-32 TASK 801
• RIGHT GEAR green light does not come on with landing gear lever at DN, RIGHT GEAR red light on, alternate gear extension was attempted	326 040 42	32-32 TASK 805
• RIGHT GEAR green light does not come on with landing gear lever at DN, RIGHT GEAR red light on, indications normal after alternate gear extension	326 050 42	32-32 TASK 802
• RIGHT GEAR green light does not go off with landing gear lever at UP, RIGHT GEAR red light on	326 060 42	32-32 TASK 801
• slow to extend		
- left	323 090 41	32-32 TASK 804
- left and right	323 090 48	32-32 TASK 803
- right	323 090 42	32-32 TASK 804
• Slow to retract		
- left	323 080 41	32-32 TASK 804
- left and right	323 080 48	32-32 TASK 803
- right	323 080 42	32-32 TASK 804

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Landing gear, main and nose		
• Does not extend when landing gear lever moved to DN position	326 076 00	32-30 TASK 816
• does not retract when landing gear lever moved to UP position	326 075 00	32-30 TASK 815
• Gears (all) extends with landing gear lever at OFF, NOSE GEAR, RIGHT GEAR, and LEFT GEAR green lights on	326 070 00	32-30 TASK 809
Landing gear, nose		
• NOSE GEAR green light does not come on with landing gear lever at DN, NOSE GEAR red light on	326 110 00	32-30 TASK 812
• NOSE GEAR green light does not come on with landing gear lever at DN, NOSE GEAR red light on, alternate gear extension was attempted	326 080 00	32-30 TASK 807
• NOSE GEAR green light does not go off with landing gear lever at UP, NOSE GEAR red light on	326 090 00	32-30 TASK 810
• NOSE GEAR red light on, airplane on ground	323 140 00	32-30 TASK 814
• slow to extend	323 120 00	32-30 TASK 806
• Slow to retract	323 130 00	32-30 TASK 806
Landing light		
• does not come on		
- left fixed	334 030 41	33-40 TASK 801
- left retractable	334 040 41	33-40 TASK 801
- right fixed	334 030 42	33-40 TASK 801
- right retractable	334 040 42	33-40 TASK 801
• Does not extend		
- left retractable	334 060 41	33-40 TASK 801
- right retractable	334 060 42	33-40 TASK 801
• Does not go off		
- left fixed	334 070 41	33-40 TASK 801
- left retractable	334 080 41	33-40 TASK 801
- right fixed	334 070 42	33-40 TASK 801
- right retractable	334 080 42	33-40 TASK 801
• does not retract		
- left retractable	334 100 41	33-40 TASK 801
- right retractable	334 100 42	33-40 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Landing warning horn		
• does not sound	312 030 00	31-51 TASK 815
• sounds (false warning)	312 035 00	31-51 TASK 815
Landing was hard or had high drag/side loads	055 040 00	05-51 TASK 806
Landing with airplane overweight	055 060 00	05-51 TASK 807
Lavatory		
• Lavatory Water (specify location) is cold. The Heater Power Switch is ON, and the Heater Pilot Light is not ON	381 051 00	38-10 TASK 828
Lavatory faucet leak	381 023 00	38-10 TASK 807
Lavatory sink drain stopper inoperative	383 031 00	38-30 TASK 818
LCD segment		
• does not operate correctly	331 060 00	33-10 TASK 801
LE DEVICES		
• FLAPS TRANSIT light stays ON		
- 1	278 070 01	27-88 TASK 820
- 2	278 070 02	27-88 TASK 820
- 3	278 070 03	27-88 TASK 820
- 4	278 070 04	27-88 TASK 820
• SLATS TRANSIT light stays on		
- 1	278 080 01	27-88 TASK 820
- 2	278 080 02	27-88 TASK 820
- 3	278 080 03	27-88 TASK 820
- 4	278 080 04	27-88 TASK 820
- 5	278 080 05	27-88 TASK 820
- 6	278 080 06	27-88 TASK 820
- 7	278 080 07	27-88 TASK 820
- 8	278 080 08	27-88 TASK 820
Leading Edge Flaps		
• droops too much with hydraulic pressure off	278 010 00	27-81 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Leading Edge Flaps (continued)		
• TRANSIT light stays on		
- 1	278 070 01	27-88 TASK 820
- 2	278 070 02	27-88 TASK 820
- 3	278 070 03	27-88 TASK 820
- 4	278 070 04	27-88 TASK 820
Leading Edge Flaps and Slats		
• do not extend during alternate system operation	278 020 00	27-81 TASK 802
• do not extend during normal system operation	278 030 00	27-81 TASK 803
• Do not retract	278 040 00	27-81 TASK 803
• do not retract from the mid-extend position (LE Lockout)	278 041 00	27-81 TASK 812
• one or more Leading Edge Surfaces operate slowly	278 050 00	27-81 TASK 805
Leading Edge Slats		
• TRANSIT light stays on		
- 1	278 080 01	27-88 TASK 820
- 2	278 080 02	27-88 TASK 820
- 3	278 080 03	27-88 TASK 820
- 4	278 080 04	27-88 TASK 820
- 5	278 080 05	27-88 TASK 820
- 6	278 080 06	27-88 TASK 820
- 7	278 080 07	27-88 TASK 820
- 8	278 080 08	27-88 TASK 820
LEFT GEAR red light		
• light on, LEFT GEAR green light does not come on with landing gear lever at DN, alternate gear extension was attempted	326 040 41	32-32 TASK 805
• light on, LEFT GEAR green light does not come on with landing gear lever at DN, indications normal after alternate gear extension	326 050 41	32-32 TASK 802
• light on, LEFT GEAR green light does not go off with landing gear lever at UP	326 060 41	32-32 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Life vest		
• missing/damaged		
- captain's	256 050 31	25-99 TASK 801
- first observer's	256 050 33	25-99 TASK 801
- first officer's	256 050 32	25-99 TASK 801
- second observer's	256 050 34	25-99 TASK 801
Light, accessory compartment		
• does not come on	333 050 00	33-30 TASK 801
• Does not go off	333 051 00	33-30 TASK 801
Light, air conditioning compartment		
• does not come on		
- left	333 030 41	33-30 TASK 801
- right	333 030 42	33-30 TASK 801
• Does not go off		
- left	333 031 41	33-30 TASK 801
- right	333 031 42	33-30 TASK 801
Light, airstair tread		
• does not come on	334 290 00	33-40 TASK 801
• Does not go off	334 291 00	33-40 TASK 801
Light, anti-collision		
• does not come on correctly		
- left wing	334 230 41	33-44 TASK 801
- lower	334 270 47	33-44 TASK 801
- right wing	334 230 42	33-44 TASK 801
- tail	334 240 00	33-44 TASK 801
- upper	334 270 46	33-44 TASK 801
• Does not go off		
- lower	334 280 47	33-44 TASK 801
- upper	334 280 46	33-44 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Light, anti-collision (strobe)		
• Does not go off		
- left wing	334 250 41	33-44 TASK 801
- right wing	334 250 42	33-44 TASK 801
- tail	334 260 00	33-44 TASK 801
Light, APU service		
• does not come on	333 060 00	33-30 TASK 801
• Does not go off	333 061 00	33-30 TASK 801
Light, cargo compartment		
• does not come on		
- aft	333 080 45	33-30 TASK 801
- forward	333 080 44	33-30 TASK 801
• Does not go off		
- aft	333 081 45	33-30 TASK 801
- forward	333 081 44	33-30 TASK 801
Light, chart		
• does not come on correctly		
- captain's	331 150 31	33-10 TASK 801
- first officer's	331 150 32	33-10 TASK 801
• Does not go off		
- captain's	331 151 31	33-10 TASK 801
- first officer's	331 151 32	33-10 TASK 801
Light, circuit breaker panel		
• does not come on	331 040 00	33-10 TASK 801
• Does not go off	331 041 00	33-10 TASK 801
Light, control stand flood		
• does not come on correctly	331 090 00	33-10 TASK 801
• Does not go off	331 091 00	33-10 TASK 801
Light, dome		
• does not come on correctly	331 050 00	33-10 TASK 801
• Does not go off	331 051 00	33-10 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Light, electronic equipment compartment		
• does not come on	333 040 00	33-30 TASK 801
• Does not go off	333 041 00	33-30 TASK 801
Light, flight kit		
• does not come on correctly		
- captain's	331 110 31	33-10 TASK 801
- first officer's	331 110 32	33-10 TASK 801
• Does not go off		
- captain's	331 111 31	33-10 TASK 801
- first officer's	331 111 32	33-10 TASK 801
Light, glareshield (AFCS) flood		
• does not come on correctly	331 070 00	33-10 TASK 801
• Does not go off	331 071 00	33-10 TASK 801
Light, indicator		
• does not come on correctly	331 010 00	33-10 TASK 801
• Does not go off	331 011 00	33-10 TASK 801
Light, landing		
• does not come on		
- left fixed	334 030 41	33-40 TASK 801
- left retractable	334 040 41	33-40 TASK 801
- right fixed	334 030 42	33-40 TASK 801
- right retractable	334 040 42	33-40 TASK 801
• Does not extend		
- left retractable	334 060 41	33-40 TASK 801
- right retractable	334 060 42	33-40 TASK 801
• Does not go off		
- left fixed	334 070 41	33-40 TASK 801
- left retractable	334 080 41	33-40 TASK 801
- right fixed	334 070 42	33-40 TASK 801
- right retractable	334 080 42	33-40 TASK 801
• does not retract		
- left retractable	334 100 41	33-40 TASK 801
- right retractable	334 100 42	33-40 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Light, logo		
• does not come on		
- left	334 340 41	33-40 TASK 801
- right	334 340 42	33-40 TASK 801
• Does not go off		
- left	334 350 41	33-40 TASK 801
- right	334 350 42	33-40 TASK 801
Light, Main Deck Cargo Door Threshold		
• does not turn OFF	333 091 00	33-35 TASK 801
• does not turn ON	333 092 00	33-35 TASK 801
Light, map		
• does not come on correctly		
- captain's	331 120 31	33-10 TASK 801
- first officer's	331 120 32	33-10 TASK 801
• Does not go off		
- captain's	331 121 31	33-10 TASK 801
- first officer's	331 121 32	33-10 TASK 801
Light, observer's reading		
• does not come on correctly	331 130 00	33-10 TASK 801
• Does not go off	331 131 00	33-10 TASK 801
Light, oxygen mask flood		
• does not come on	331 140 00	33-10 TASK 801
Light, panel flood		
• does not come on correctly		
- captain's	331 080 31	33-10 TASK 801
- center	331 080 43	33-10 TASK 801
- first officer's	331 080 32	33-10 TASK 801
• Does not go off		
- captain's	331 081 31	33-10 TASK 801
- center	331 081 43	33-10 TASK 801
- first officer's	331 081 32	33-10 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Light, position (NAV)		
• does not come on		
- left wing aft	334 120 41	33-40 TASK 801
- left wing forward	334 110 41	33-40 TASK 801
- right wing aft	334 120 42	33-40 TASK 801
- right wing forward	334 130 42	33-40 TASK 801
• Does not go off		
- left wing aft	334 200 41	33-40 TASK 801
- left wing forward	334 190 41	33-40 TASK 801
- right wing aft	334 200 42	33-40 TASK 801
- right wing forward	334 210 42	33-40 TASK 801
Light, runway turnoff		
• does not come on		
- left	334 300 41	33-40 TASK 801
- right	334 300 42	33-40 TASK 801
• Does not go off		
- left	334 310 41	33-40 TASK 801
- right	334 310 42	33-40 TASK 801
Light, tailcone		
• does not come on	333 070 00	33-30 TASK 801
• Does not go off	333 071 00	33-30 TASK 801
Light, taxi		
• does not come on	334 320 00	33-40 TASK 801
• Does not go off	334 330 00	33-40 TASK 801
Light, wheel well		
• does not come on		
- main landing gear	333 010 00	33-30 TASK 801
- nose landing gear	333 020 00	33-30 TASK 801
• does not go off		
- main landing gear	333 011 00	33-30 TASK 801
- nose landing gear	333 021 00	33-30 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Light, wing illumination		
• does not come on		
- left	334 010 41	33-40 TASK 801
- right	334 010 42	33-40 TASK 801
• Does not go off		
- left	334 020 41	33-40 TASK 801
- right	334 020 42	33-40 TASK 801
Lighted pushbutton switch		
• does not come on correctly	331 020 00	33-10 TASK 801
• Does not go off	331 021 00	33-10 TASK 801
Lighting, Boeing Sky Interior (BSI)		
• a sequence of BSI Lights does not respond to ACP Signal	332 026 00	33-20 TASK 805
• Ceiling Cross Bin Light does not come ON	332 003 00	33-20 TASK 808
• Ceiling Cross Bin Light stays in BOOTLOADER (Warm White) Mode	332 022 00	33-20 TASK 820
• Ceiling Cross Bin Lights do not come ON		
- ALL LEFT AFT	332 006 00	33-20 TASK 816
- ALL LEFT FWD	332 004 00	33-20 TASK 814
- ALL RIGHT AFT	332 007 00	33-20 TASK 815
- ALL RIGHT FWD	332 005 00	33-20 TASK 813
• Ceiling Wash Light does not come ON	332 008 00	33-20 TASK 808
• Ceiling Wash Light stays in BOOTLOADER (Warm White) Mode	332 023 00	33-20 TASK 820
• Ceiling Wash Lights do not come ON		
- ALL LEFT AFT	332 011 00	33-20 TASK 816
- ALL LEFT FWD	332 009 00	33-20 TASK 814
- ALL RIGHT AFT	332 012 00	33-20 TASK 815
- ALL RIGHT FWD	332 010 00	33-20 TASK 813
• Center Overhead Stowage (COS) Light does not come ON	332 013 00	33-20 TASK 808
• Center Overhead Stowage (COS) Light stays in BOOTLOADER (Warm White) Mode	332 024 00	33-20 TASK 820

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Lighting, Boeing Sky Interior (BSI) (continued)		
• Center Overhead Stowage (COS) Lights do not come ON		
- ALL LEFT FWD	332 014 00	33-20 TASK 814
- ALL RIGHT AFT	332 017 00	33-20 TASK 815
- ALL RIGHT FWD	332 015 00	33-20 TASK 813
- LEFT AFT	332 016 00	33-20 TASK 816
• Cove and Direct Lights do not come ON		
- ALL	332 002 00	33-20 TASK 810
• Direct Light does not come ON	332 018 00	33-20 TASK 808
• Direct Light stays in BOOTLOADER (Warm White) Mode	332 025 00	33-20 TASK 820
• Light at the end of the Data Bus does not fully respond to ACP Signal	332 027 00	33-20 TASK 804
• Light at the end of the Data Bus does not partially respond to ACP Signal	332 028 00	33-20 TASK 804
• Light does not fully respond to ACP Signal	332 029 00	33-20 TASK 803
• Light does not partially respond to ACP Signal	332 030 00	33-20 TASK 803
• Light flashes	332 031 00	33-20 TASK 821
• Lights do not come ON		
- ALL	332 001 00	33-20 TASK 809
• Window Light does not come ON	332 019 00	33-20 TASK 806
• Window Lights do not come ON		
- ALL LEFT SIDE	332 020 00	33-20 TASK 812
- ALL RIGHT SIDE	332 021 00	33-20 TASK 811
Lightning Strike	055 611 00	05-51 TASK 801
Lightplate		
• does not come on	331 030 00	33-10 TASK 801
• Does not go off	331 031 00	33-10 TASK 801
LOC flag shows on integrated standby flight display	342 606 00	34-24 TASK 808
LOC flag shows on the EFIS display		
- captain's	343 010 31	34-31 TASK 806
- first officer's	343 010 32	34-31 TASK 807
LOC flag shows on the Standby Attitude Indicator	342 660 00	34-24 TASK 802

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Localizer and glideslope pointers		
• do not show, LOC and G/S flags do not show		
- captain's	343 050 31	34-31 TASK 809
- first officer's	343 050 32	34-31 TASK 809
Logo light		
• does not come on		
- left	334 340 41	33-40 TASK 801
- right	334 340 42	33-40 TASK 801
• Does not go off		
- left	334 350 41	33-40 TASK 801
- right	334 350 42	33-40 TASK 801
LOW message shows in fuel quantity indication (flight compartment)	284 024 00	28-41 TASK 820
LOW OIL PRESSURE light for the APU		
• light on, APU had a protective shutdown	492 060 00	49-60 TASK 801
• light on, APU operates with no protective shutdown	492 030 00	49-15 TASK 802
LOW OIL PRESSURE message for the engine		
• message shows, oil pressure low or zero (red)		
- engine 1	790 045 51	79-05 TASK 803
- engine 2	790 045 52	79-05 TASK 803
LOW PRESSURE light for ELEC 1 hydraulic pump		
• light on	293 190 00	29-30 TASK 810
LOW PRESSURE light for ELEC 2 hydraulic pump		
• light on	293 200 00	29-30 TASK 811
LOW PRESSURE light for ENG 1 hydraulic pump		
• light off when the electric motor-driven pump is operated		
- ENG 1 hydraulic pump	291 010 51	29-10 TASK 801
• light on	293 210 51	29-30 TASK 812
LOW PRESSURE light for ENG 2 hydraulic pump		
• light off when the electric motor-driven pump is operated		
- ENG 2 hydraulic pump	291 010 52	29-10 TASK 802
• light on	293 210 52	29-30 TASK 813

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
LOW PRESSURE light for FLT CONTROL A		
• light on	270 010 00	27-21 TASK 813
LOW PRESSURE light for FLT CONTROL B		
• light on	270 020 00	27-21 TASK 814
LOW PRESSURE light for STBY HYD		
• light on	293 220 00	29-30 TASK 814
LOW PRESSURE light for the fuel pump		
• light comes on, but not in the specified time (15 +/-2 seconds) during boost pump auto-shutoff functional test		
- center tank, left pump	282 312 41	28-22 TASK 820
- center tank, right pump	282 312 42	28-22 TASK 821
• light does not come on during boost pump auto-shutoff functional test		
- center tank, left pump	282 311 41	28-22 TASK 820
- center tank, right pump	282 311 42	28-22 TASK 821
• light on		
- center tank, left pump	282 130 43	28-22 TASK 801
- center tank, right pump	282 140 43	28-22 TASK 802
- no. 1 aft fuel pump	282 150 01	28-22 TASK 803
- no. 1 fwd and aft fuel pumps	282 160 01	28-22 TASK 803
- no. 1 fwd fuel pump	282 170 01	28-22 TASK 804
- no. 2 aft fuel pump	282 150 02	28-22 TASK 805
- no. 2 fwd and aft fuel pumps	282 160 02	28-22 TASK 805
- no. 2 fwd fuel pump	282 170 02	28-22 TASK 806
LOW QUANTITY light for STANDBY HYD		
• light on	293 180 00	29-30 TASK 809
Mach airspeed warning		
• does not sound when MACH AIRSPEED WARNING TEST switch is pushed		
- NO 1	341 030 01	34-16 TASK 801
- NO 2	341 030 02	34-16 TASK 801
MACH TRIM FAIL light		
• light on	221 030 00	22-11 TASK 860
• light on when MASTER CAUTION switch is pushed	221 040 00	22-11 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
MAIN cargo fire light		
• light on (false alarm)	261 225 00	26-16 TASK 801
Main Deck Air Distribution System Shutoff Valves Do Not Operate	212 030 00	21-23 TASK 801
Main Deck Cargo Door (MDCD)		
• does not latch	523 283 00	52-32 TASK 817
• does not lock	523 284 00	52-32 TASK 816
• does not unlatch	523 285 00	52-32 TASK 815
• does not unlock	523 286 00	52-32 TASK 814
Main landing gear		
• LEFT GEAR green light does not come on with landing gear lever at DN, LEFT GEAR red light on, alternate gear extension was attempted	326 040 41	32-32 TASK 805
• LEFT GEAR green light does not come on with landing gear lever at DN, LEFT GEAR red light on, indications normal after alternate gear extension	326 050 41	32-32 TASK 802
• LEFT GEAR green light does not go off with landing gear lever at UP, LEFT GEAR red light on	326 060 41	32-32 TASK 801
• RIGHT GEAR green light does not come on with landing gear lever at DN, RIGHT GEAR red light on, alternate gear extension was attempted	326 040 42	32-32 TASK 805
• RIGHT GEAR green light does not come on with landing gear lever at DN, RIGHT GEAR red light on, indications normal after alternate gear extension	326 050 42	32-32 TASK 802
• RIGHT GEAR green light does not go off with landing gear lever at UP, RIGHT GEAR red light on	326 060 42	32-32 TASK 801
• Shimmy or Vibrate at Taxi, Takeoff, or Landing	325 140 00	32-11 TASK 802
• slow to extend		
- left	323 090 41	32-32 TASK 804
- left and right	323 090 48	32-32 TASK 803
- right	323 090 42	32-32 TASK 804
• Slow to retract		
- left	323 080 41	32-32 TASK 804
- left and right	323 080 48	32-32 TASK 803
- right	323 080 42	32-32 TASK 804

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
MAINT light for the APU		
• light on	492 070 00	49-60 TASK 801
Maintenance code shows in right window of IRS display unit when HDG/STS mode selected	342 220 00	34-21 TASK 835
Manual mode control of aft outflow valve		
• does not operate	213 030 00	21-31 TASK 811
MANUAL VALVE indicator		
• does not operate, pointer does not move or fluctuates	213 110 00	21-31 TASK 803
MAP flag shows on CDS		
- captain's	346 090 31	34-61 TASK 801
- first officer's	346 090 32	34-61 TASK 801
Map light		
• does not come on correctly		
- captain's	331 120 31	33-10 TASK 801
- first officer's	331 120 32	33-10 TASK 801
• Does not go off		
- captain's	331 121 31	33-10 TASK 801
- first officer's	331 121 32	33-10 TASK 801
MAP RANGE DISAGREE message shows		
- captain's	346 100 31	34-61 TASK 830
- first officer's	346 100 32	34-61 TASK 830
MAP/TERR RANGE DISAGREE message shows	344 470 00	34-46 TASK 858
MAP/WXR RANGE DISAGREE message shows		
- captain's	344 020 31	34-43 TASK 810
- first officer's	344 020 32	34-43 TASK 811
Marker beacon		
• Audio tone does not occur or is weak when passing marker, indications are normal	343 110 00	34-32 TASK 801
• FT does not show on the display when you push the TEST switch on the navigation control panel	343 150 00	34-32 TASK 803
• indication does not show on the display when passing marker, audio tone does not occur or is weak	343 120 00	34-32 TASK 802

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Marker beacon (continued)		
• indication does not show on the display when passing marker, audio tone is normal	343 130 00	34-32 TASK 803
• test problem when you push the TEST switch on the navigation control panel	343 140 00	34-51 TASK 801
MASTER CAUTION light		
• light does not come on during test	315 101 00	31-52 TASK 801
Master dim and test system		
• does not operate correctly	331 160 00	33-10 TASK 801
Microphone, boom/headset		
• damaged		
- captain's	235 020 31	23-51 TASK 802
- first officer's	235 020 32	23-51 TASK 802
• does not operate		
- captain's	235 010 31	23-51 TASK 801
- first officer's	235 010 32	23-51 TASK 801
Microphone, hand		
• damaged		
- captain's	235 060 31	23-51 TASK 802
- first observer's	235 060 33	23-51 TASK 802
- first officer's	235 060 32	23-51 TASK 802
• does not operate		
- captain's	235 050 31	23-51 TASK 801
- first observer's	235 050 33	23-51 TASK 801
- first officer's	235 050 32	23-51 TASK 801
Mode Control Panel		
• ALTITUDE window display does not change with altitude selector switch change	221 770 00	22-11 TASK 803
• ALTITUDE window display does not show	221 780 00	22-11 TASK 803
• ALTITUDE window problem		
- stays at 50000	221 775 00	22-11 TASK 853

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Mode Control Panel (continued)		
• COURSE window display does not change with course selector switch change		
- captain's	221 790 31	22-11 TASK 803
- first officer's	221 790 32	22-11 TASK 803
• COURSE window display does not show		
- captain's	221 800 31	22-11 TASK 803
- first officer's	221 800 32	22-11 TASK 803
• HEADING window display does not change with heading selector switch change	221 810 00	22-11 TASK 803
• HEADING window display does not show	221 820 00	22-11 TASK 803
• IAS/MACH window display does not change with selector switch change	221 890 00	22-11 TASK 803
• IAS/MACH window display does not show	221 900 00	22-11 TASK 803
• lower switch light does not come on for all mode switches	221 860 00	22-11 TASK 803
• one of the switch lights does not come on for one mode switch	221 870 00	22-11 TASK 803
• upper switch light does not come on for all mode switches	221 880 00	22-11 TASK 803
• VERT SPEED window display does not change with vertical speed selector change	221 830 00	22-11 TASK 803
• VERT SPEED window display does not show	221 840 00	22-11 TASK 803
MODEL/ENG DATA INVALID message shows on the CDU	346 380 00	34-61 TASK 819
MSG light on the CDU		
• does not come on		
- captain's	346 270 31	34-61 TASK 810
- first officer's	346 270 32	34-61 TASK 810
Multi-mode receiver		
• does not respond when TEST button pushed	343 330 00	34-31 TASK 818
Multi-Mode Receiver (MMR)		
• GPS-L and GPS-R position not available	345 641 48	34-58 TASK 810
• GPS-L position not available	345 641 41	34-58 TASK 811
• GPS-R position not available	345 641 42	34-58 TASK 812

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Multi-Mode Receiver (MMR) (continued)		
• position, date, and/or time are not correct	345 641 00	34-58 TASK 809
N1 overspeed		
• over limit in reverse thrust, write maximum N1		
- engine 1	710 080 51	71-06 TASK 803
- engine 2	710 080 52	71-06 TASK 803
• over redline in forward thrust		
- engine 1	710 060 51	71-06 TASK 801
- engine 2	710 060 52	71-06 TASK 801
N1, N2, EGT, and FF indications		
• read low or fluctuate		
- engine 1	710 130 51	73-06 TASK 809
- engine 2	710 130 52	73-06 TASK 809
N2 overspeed		
- engine 1	710 070 51	71-06 TASK 802
- engine 2	710 070 52	71-06 TASK 802
Nacelle or strut dragged or damaged		
- engine 1	055 100 51	05-51 TASK 811
- engine 2	055 100 52	05-51 TASK 811
NAV DATA OUT OF DATE message shows on CDU	346 160 00	34-61 TASK 808
Navigation control panel		
• panel problem	343 040 00	34-31 TASK 808
• Test failed DME		
- captain's	345 210 31	34-55 TASK 801
- first officer's	345 210 32	34-55 TASK 801
• Test failed VOR		
- captain's	345 020 31	34-51 TASK 801
- first officer's	345 020 32	34-51 TASK 801
• Test fails ILS		
- captain's	343 020 31	34-31 TASK 801
- first officer's	343 020 32	34-31 TASK 801
• Test fails Marker Beacon	343 140 00	34-51 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Neutral shift		
• does not operate correctly	273 080 00	27-31 TASK 807
Nitrogen generation system		
• operability indicator DEGRADED (blue) light is on	470 813 00	47-31 TASK 840
• operability indicator has all lights off	470 812 00	47-31 TASK 801
• operability indicator INOPERATIVE (amber) light is on	470 811 00	47-31 TASK 801
NLND3 LCH shows in DFCS BITE FAULT HISTORY	221 203 00	22-17 TASK 807
NO ALND LCH shows in DFCS BITE FAULT HISTORY	221 204 00	22-17 TASK 807
NO AUTOLAND shows on the Engine Display	221 201 00	22-11 TASK 838
No faults occurred during the flight leg	999 999 99	31-98 TASK 801
No hot water at faucet	381 025 00	38-10 TASK 811
NO LAND 3 shows on the engine display	221 202 00	22-11 TASK 855
Noise, pounding heard through air distribution system	215 015 00	21-51 TASK 802
Noise, sharp, from APU exhaust during main engine start	492 160 00	49-55 TASK 808
NOSE GEAR red light		
• light on, airplane on ground	323 140 00	32-30 TASK 814
• light on, NOSE GEAR green light does not come on with landing gear lever at DN	326 110 00	32-30 TASK 812
• light on, NOSE GEAR green light does not come on with landing gear lever at DN, alternate gear extention was attempted	326 080 00	32-30 TASK 807
• light on, NOSE GEAR green light does not go off with landing gear lever at UP	326 090 00	32-30 TASK 810
• light on, NOSE GEAR green light off with landing gear lever at UP	326 115 00	32-30 TASK 811
Nose landing gear		
• NOSE GEAR green light does not come on with landing gear lever at DN, NOSE GEAR red light on	326 110 00	32-30 TASK 812
• NOSE GEAR green light does not come on with landing gear lever at DN, NOSE GEAR red light on, alternate gear extension was attempted	326 080 00	32-30 TASK 807
• NOSE GEAR green light does not go off with landing gear lever at UP, NOSE GEAR red light on	326 090 00	32-30 TASK 810

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Nose landing gear (continued)		
• NOSE GEAR green light off with landing gear lever at UP, NOSE GEAR red light on	326 115 00	32-30 TASK 811
• NOSE GEAR red light on, airplane on ground	323 140 00	32-30 TASK 814
• slow to extend	323 120 00	32-30 TASK 806
• Slow to retract	323 130 00	32-30 TASK 806
Nose landing gear shock strut		
• deflated or pressure is low	322 010 00	32-21 TASK 801
Nose rudder trim		
• does not operate		
- left	272 010 41	27-21 TASK 801
- left and right	272 010 48	27-21 TASK 803
- right	272 010 42	27-21 TASK 802
Nose wheel		
• makes a loud noise in the wheel well	325 010 00	32-51 TASK 801
• Shimmy or Vibrate at Landing	325 040 00	32-51 TASK 804
• Shimmy or Vibrate at takeoff	325 050 00	32-51 TASK 804
• Shimmy or Vibrate during taxi	325 045 00	32-51 TASK 804
• Strut bottoms during taxi	325 020 00	32-51 TASK 802
• Vibrates at gear retraction	325 030 00	32-51 TASK 803
Observer's reading light		
• does not come on correctly	331 130 00	33-10 TASK 801
• Does not go off	331 131 00	33-10 TASK 801
OFF light for the EQUIP COOLING EXHAUST		
• light on with switch at ALTERNATE	212 080 00	21-27 TASK 805
• light on with switch at NORMAL	212 090 00	21-27 TASK 806
OFF light for the EQUIP COOLING SUPPLY		
• light on with switch at ALTERNATE	212 100 00	21-27 TASK 807
• light on with switch at NORMAL	212 110 00	21-27 TASK 808

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
OFST light on the CDU		
• does not come on		
- captain's	346 280 31	34-61 TASK 810
- first officer's	346 280 32	34-61 TASK 810
OIL FILTER BYPASS Message		
• does not show on the Engine Display during the EEC Test		
- ENG 1	790 120 51	79-05 TASK 818
- ENG 2	790 120 52	79-05 TASK 818
• shows on the Engine Display		
- ENG 1	790 110 51	79-05 TASK 817
- ENG 2	790 110 52	79-05 TASK 817
Oil leakage or fuel leakage from drain at engine		
- left engine	710 811 51	71-05 TASK 810
- right engine	710 811 52	71-05 TASK 810
ON light for WINDOW HEAT		
• does not come on		
- L FWD	304 030 41	30-41 TASK 802
- L SIDE	304 040 41	30-41 TASK 809
- R FWD	304 030 42	30-41 TASK 802
- R side	304 040 42	30-41 TASK 809
Onboard Network System		
• shows "System dataload state is currently disabled"	461 801 00	46-13 TASK 856
OP PROGRAM INVALID shows in the middle of the CDU display	346 260 00	34-61 TASK 811
OUT OF ORDER flag shows on integrated standby flight display	342 607 00	34-24 TASK 810
Outflow valve position indicator		
• does not operate, pointer does not move or fluctuates	213 110 00	21-31 TASK 803
Outflow valve, aft		
• does not operate in manual mode	213 030 00	21-31 TASK 811
OVER SPEED light for the APU		
• light on during APU shutdown	492 080 00	49-60 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
OVER SPEED light for the APU (continued)		
• light on, APU had a protective shutdown	492 090 00	49-60 TASK 801
• light on, APU operates with no protective shutdown	492 040 00	49-15 TASK 803
OVERHEAT light for ELEC 1 hydraulic pump		
• light on	293 030 00	29-30 TASK 805
OVERHEAT light for ELEC 2 hydraulic pump		
• light on	293 040 00	29-30 TASK 806
OVERHEAT light for WINDOW HEAT		
• light on		
- L FWD	304 010 41	30-41 TASK 801
- L SIDE	304 020 41	30-41 TASK 801
- R FWD	304 010 42	30-41 TASK 801
- R SIDE	304 020 42	30-41 TASK 801
Overspeed		
• With flaps/slats extended	055 090 00	05-51 TASK 810
• With landing gear down	055 080 00	05-51 TASK 809
Overspeed, severe turbulence, stall, or buffet	055 070 00	05-51 TASK 808
Overweight landing	055 060 00	05-51 TASK 807
OVHT/FIRE TEST		
• Test failed, warning lights and alarm do not operate		
- APU	261 070 00	26-10 TASK 801
- engine 1	261 030 51	26-10 TASK 801
- engine 2	261 030 52	26-10 TASK 801
- wheel well	261 100 00	26-18 TASK 833
Oxygen mask		
• communication problem		
- captain's	235 071 31	23-51 TASK 808
- first observer's	235 071 33	23-51 TASK 808
- first officer's	235 071 32	23-51 TASK 808
Oxygen mask floodlight		
• does not come on	331 140 00	33-10 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Oxygen mask, flight crew		
• damaged		
- captain's	351 050 31	35-12 TASK 805
- first officer's	351 050 32	35-12 TASK 805
- observer's	351 050 33	35-12 TASK 805
• difficult to release from stowage		
- captain's	351 060 31	35-12 TASK 806
- first observer's	351 060 33	35-12 TASK 806
- first officer's	351 060 32	35-12 TASK 806
• harness fails to deflate		
- captain's	351 070 31	35-12 TASK 805
- first observer's	351 070 33	35-12 TASK 805
- first officer's	351 070 32	35-12 TASK 805
• harness fails to inflate		
- captain's	351 080 31	35-12 TASK 805
- first observer's	351 080 33	35-12 TASK 805
- first officer's	351 080 32	35-12 TASK 805
• harness leaking		
- captain's	351 090 31	35-12 TASK 805
- first observer's	351 090 33	35-12 TASK 805
- first officer's	351 090 32	35-12 TASK 805
• hose problem		
- captain's	351 100 31	35-12 TASK 805
- first officer's	351 100 32	35-12 TASK 805
- observer's	351 100 33	35-12 TASK 805
• panel (door, pin, etc.) damaged		
- captain's	351 110 31	35-12 TASK 807
- first officer's	351 110 32	35-12 TASK 807
- observer's	351 110 33	35-12 TASK 807
Oxygen masks, passenger		
• Masks (all) do not drop when PASS OXYGEN switch manually set to ON	352 030 00	35-22 TASK 803
• PASS OXY ON light does not come on during automatic oxygen system deployment	352 050 00	35-22 TASK 806

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Oxygen masks, passenger (continued)		
• PASS OXY ON light does not come on during manual oxygen system deployment	352 040 00	35-22 TASK 805
Oxygen regulator operation		
• Difficult to exhale		
- captain's	351 120 31	35-12 TASK 805
- first observer's	351 120 33	35-12 TASK 805
- first officer's	351 120 32	35-12 TASK 805
• leaking		
- captain's	351 130 31	35-12 TASK 805
- first observer's	351 130 33	35-12 TASK 805
- first officer's	351 130 32	35-12 TASK 805
• no pressure breathing available		
- captain's	351 140 31	35-12 TASK 805
- first observer's	351 140 33	35-12 TASK 805
- first officer's	351 140 32	35-12 TASK 805
P MODE FAIL shows in DFCS BITE FAULT HISTORY	221 205 00	22-11 TASK 801
PA system		
- distorted from flight compartment	233 020 00	23-31 TASK 801
- does not operate from flight compartment	233 010 00	23-31 TASK 801
- intermittent from flight compartment	233 030 00	23-31 TASK 801
- volume problem from flight compartment	233 040 00	23-31 TASK 802
Pack airflow/temperature diagnostics tool		
• Tool shows pack airflow is too low or too high	215 350 00	21-52 TASK 857
• Tool shows pack outlet temperature is too cold or too hot	215 351 00	21-52 TASK 856
PACK Light		
• comes ON During MASTER CAUTION Recall		
- L PACK	215 202 41	21-53 TASK 821
- R PACK	215 202 42	21-53 TASK 821
• is ON without MASTER CAUTION Recall		
- L PACK	215 201 41	21-53 TASK 820
- R PACK	215 201 42	21-53 TASK 820

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
PACK TRIP OFF light		
• light on at cruise, light comes on again after reset		
- left	215 030 41	21-52 TASK 830
- right	215 030 42	21-52 TASK 831
• light on at cruise, light stays off after reset		
- left	215 020 41	21-52 TASK 824
- right	215 020 42	21-52 TASK 825
• light on during approach, light comes on again after reset		
- left	215 060 41	21-52 TASK 832
- right	215 060 42	21-52 TASK 833
• light on during approach, light stays off after reset		
- left	215 050 41	21-52 TASK 822
- right	215 050 42	21-52 TASK 823
• light on during climb, light comes on again after reset		
- left	215 090 41	21-52 TASK 834
- right	215 090 42	21-52 TASK 835
• light on during climb, light stays off after reset		
- left	215 080 41	21-52 TASK 820
- right	215 080 42	21-52 TASK 821
• light on on ground, light comes on again after reset		
- left	215 120 41	21-52 TASK 828
- right	215 120 42	21-52 TASK 829
• light on on ground, light stays off after reset		
- left	215 110 41	21-52 TASK 818
- right	215 110 42	21-52 TASK 819
• light on, cannot reset		
- left	215 040 41	21-52 TASK 816
- right	215 040 42	21-52 TASK 817
PACK, L air temperature indication problem	215 060 00	21-61 TASK 854
PACK, R air temperature indication problem	215 070 00	21-61 TASK 855
Packs, Divergent Pack Outlet Temperatures Noted Between Left and Right Packs	215 203 00	21-53 TASK 819

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Panel floodlight		
• does not come on correctly		
- captain's	331 080 31	33-10 TASK 801
- center	331 080 43	33-10 TASK 801
- first officer's	331 080 32	33-10 TASK 801
• Does not go off		
- captain's	331 081 31	33-10 TASK 801
- center	331 081 43	33-10 TASK 801
- first officer's	331 081 32	33-10 TASK 801
Panel light, circuit breaker		
• does not come on	331 040 00	33-10 TASK 801
• Does not go off	331 041 00	33-10 TASK 801
Parking Brake		
• Brake pressure indicator decreases faster than specified during parking brake hold check		
- parking brake released	324 161 00	32-44 TASK 802
- parking brake set	324 160 00	32-44 TASK 801
• lever does not release	324 120 00	32-44 TASK 807
• lever does not set	324 130 00	32-44 TASK 807
• PARK BRAKE Light on the Control Stand stays OFF when the Parking Brake is set	324 141 00	32-44 TASK 803
• PARK BRAKE Light on the Control Stand stays ON when the Parking Brake is released	324 142 00	32-44 TASK 804
PASS CABIN air mix valve indicator		
• does not operate, pointer does not move, temperature is OK	216 020 00	21-61 TASK 841
PASS CABIN air temperature indication		
• not correct	216 190 00	21-61 TASK 843
PASS OXY ON light		
• light does not come on during automatic oxygen system deployment	352 050 00	35-22 TASK 806
• light does not come on during manual oxygen system deployment	352 040 00	35-22 TASK 805
• light on, all masks dropped automatically, switch was not moved, cabin pressure was normal	352 010 00	35-22 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
PASS OXY ON light (continued)		
• light on, all masks failed to drop automatically, masks dropped after PASS OXY switch was moved	352 020 00	35-22 TASK 802
Passenger address system		
- distorted from flight compartment	233 020 00	23-31 TASK 801
- does not operate from flight compartment	233 010 00	23-31 TASK 801
- intermittent from flight compartment	233 030 00	23-31 TASK 801
- volume problem from flight compartment	233 040 00	23-31 TASK 802
Passenger Compartments		
• Overhead Stowage Bin does not close correctly	252 401 00	25-24 TASK 801
• Overhead Stowage Bin does not open correctly	252 402 00	25-24 TASK 801
• Overhead Stowage Bin is out of adjustment	252 403 00	25-24 TASK 801
Passenger oxygen masks		
• Masks (all) do not drop when PASS OXYGEN switch manually set to ON	352 030 00	35-22 TASK 803
Pilot call system		
• call light does not come on, attendant to flight compartment	234 380 00	23-42 TASK 806
• call light does not come on, ground crew to flight compartment	234 370 00	23-43 TASK 804
• Chime does not sound in the flight compartment	234 390 00	23-42 TASK 804
• does not operate, flight compartment to attendant	234 400 00	23-42 TASK 802
• does not operate, ground crew to flight compartment	234 360 00	23-43 TASK 803
Pitch control		
• Too sensitive in control wheel steering mode (airplane overreacts to column input)	273 090 00	27-31 TASK 811
Pitch limit indication		
• does not agree between the captain's and the first officer's display	342 025 00	34-21 TASK 854
PITCH message shows on the attitude display		
- captain's	342 020 31	34-21 TASK 825
- first officer's	342 020 32	34-21 TASK 826
Pitch oscillation (porpoising)		
• during autopilot multi-channel approach	221 310 00	22-16 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Pitch oscillation (porpoising) (continued)		
• with any autopilot engaged in CMD	221 320 00	22-16 TASK 801
Pitch up or pitch down of airplane too much	273 100 00	27-31 TASK 808
Pitot probe		
• Does not get hot	303 060 00	30-31 TASK 806
POS SHIFT page of CDU shows large IRS drift	342 225 00	34-21 TASK 836
Position (NAV) light		
• does not come on		
- left wing aft	334 120 41	33-40 TASK 801
- left wing forward	334 110 41	33-40 TASK 801
- right wing aft	334 120 42	33-40 TASK 801
- right wing forward	334 130 42	33-40 TASK 801
• Does not go off		
- left wing aft	334 200 41	33-40 TASK 801
- left wing forward	334 190 41	33-40 TASK 801
- right wing aft	334 200 42	33-40 TASK 801
- right wing forward	334 210 42	33-40 TASK 801
Potable water		
• auxiliary tank (40-gallon) leaks	381 042 00	25-99 TASK 801
• contaminated	381 026 00	38-10 TASK 810
• indicator on service panel shows level of zero	381 010 00	38-10 TASK 813
• level not accurate at attendant's panel	381 011 00	38-10 TASK 812
• main tank (60-gallon) leaks	381 041 00	25-99 TASK 801
• System does not pressurize	381 020 00	38-10 TASK 803
• tank does not fill	381 030 00	38-10 TASK 801
• tank leaks	381 040 00	38-10 TASK 802
Pressurization		
• aft outflow valve does not operate in manual mode	213 030 00	21-31 TASK 811
• AUTO FAIL and ALTN light on, AUTO FAIL light goes off when pressurization mode selector switch is at ALTN	213 010 00	21-31 TASK 801
• AUTO FAIL light on, ALTN light not on	213 020 00	21-31 TASK 801
• cannot keep the correct cabin pressure	213 050 00	21-31 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Printer (flight deck)		
• FAIL light is on	313 202 00	31-33 TASK 802
PRINTER FAIL message shows on the CDU	346 375 00	31-33 TASK 804
Probe heater indicator lights		
• do not come on when PITOT STATIC HEAT switches are OFF	303 070 00	30-31 TASK 807
PROGRAM PIN ERROR flag shows on integrated standby flight display	342 608 00	34-24 TASK 811
PROGRAM PIN ERROR message shows on the CDU	346 390 00	34-61 TASK 820
PROGRAM PIN NOT IN DB message shows on the CDU	346 400 00	34-61 TASK 821
PSEU		
• BITE display is blank	320 040 00	32-09 TASK 811
PSEU light		
• light does not come on during test	320 060 00	33-10 TASK 801
• light on	320 050 00	32-09 TASK 801
PTU		
• does not operate	292 040 00	29-20 TASK 804
Purge valve for air conditioning pack air supply cleaner		
• does not operate correctly during system test		
- left pack	217 821 41	21-75 TASK 801
- right pack	217 821 42	21-75 TASK 801
Pushbutton switch, lighted		
• does not come on correctly	331 020 00	33-10 TASK 801
• Does not go off	331 021 00	33-10 TASK 801
PWS FAIL message shows	344 010 00	34-43 TASK 815
R ALPHA VANE light		
• light on	303 080 00	30-31 TASK 808
R BOTTLE DISCHARGED light		
• light on for the engine fire extinguishing	262 060 00	26-20 TASK 802
R ELV PITOT light		
• light on	303 090 00	30-31 TASK 809

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
R MODE FAIL shows in DFCS BITE FAULT HISTORY	221 206 00	22-11 TASK 801
R VALVE OPEN Light for WING ANTI-ICE		
• does not come on	301 090 00	30-11 TASK 805
• Does not go bright during transition	301 015 42	30-11 TASK 804
• slow to go from Bright to Dim when the WING ANTI-ICE Switch is moved to ON	301 050 00	30-11 TASK 801
• slow to go from Bright to OFF when the WING ANTI-ICE Switch is moved to OFF	301 060 00	30-11 TASK 802
• Stays ON bright	301 070 00	30-11 TASK 803
RA flag shows on the display		
- captain's	343 210 31	34-33 TASK 801
- first officer's	343 210 32	34-33 TASK 801
Radio Altimeter		
• problem near 5G base	343 601 00	34-33 TASK 809
Radio altitude		
• altitude indication blank and RA flag does not show		
- captain's	343 220 31	34-33 TASK 805
- first officer's	343 220 32	34-33 TASK 805
• disagrees with other radio or barometric altitude indications, and RA flag does not show		
- captain's	343 221 31	34-33 TASK 801
- first officer's	343 221 32	34-33 TASK 801
Radio magnetic indicator		
• ADF flag shows	342 430 00	34-22 TASK 803
• HDG flag shows	342 410 00	34-22 TASK 801
• VOR flag shows	342 440 00	34-22 TASK 802
Radio tuning panel problem		
- captain's	231 300 31	23-12 TASK 815
- first observer's	231 300 33	23-12 TASK 815
- first officer's	231 300 32	23-12 TASK 815
Radio, HF 1		
• reception and transmission problem at all stations	231 060 48	23-11 TASK 806

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Radio, HF 1 (continued)		
• reception and transmission problem at one station		
- captain's	231 060 31	23-11 TASK 806
- first observer's	231 060 33	23-11 TASK 806
- first officer's	231 060 32	23-11 TASK 806
• reception problem at all stations	231 070 48	23-11 TASK 806
• reception problem at one station		
- captain's	231 070 31	23-11 TASK 806
- first observer's	231 070 33	23-11 TASK 806
- first officer's	231 070 32	23-11 TASK 806
• Transmission problem at all stations	231 080 48	23-11 TASK 806
• Transmission problem at one station		
- captain's	231 080 31	23-11 TASK 806
- first observer's	231 080 33	23-11 TASK 806
- first officer's	231 080 32	23-11 TASK 806
Radio, HF 2		
• reception and transmission problem at all stations	231 180 48	23-11 TASK 806
• reception and transmission problem at one station		
- captain's	231 180 31	23-11 TASK 806
- first observer's	231 180 33	23-11 TASK 806
- first officer's	231 180 32	23-11 TASK 806
• reception problem at all stations	231 190 48	23-11 TASK 806
• reception problem at one station		
- captain's	231 190 31	23-11 TASK 806
- first observer's	231 190 33	23-11 TASK 806
- first officer's	231 190 32	23-11 TASK 806
• Transmission problem at all stations	231 200 48	23-11 TASK 806
• Transmission problem at one station		
- captain's	231 200 31	23-11 TASK 806
- first observer's	231 200 33	23-11 TASK 806
- first officer's	231 200 32	23-11 TASK 806
Radio, VHF 1		
• reception and transmission problem at all stations	231 310 48	23-12 TASK 816

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Radio, VHF 1 (continued)		
• reception and transmission problem at one station		
- captain's	231 310 31	23-12 TASK 816
- first observer's	231 310 33	23-12 TASK 816
- first officer's	231 310 32	23-12 TASK 816
• reception problem at all stations	231 320 48	23-12 TASK 816
• reception problem at one station		
- captain's	231 320 31	23-12 TASK 816
- first observer's	231 320 33	23-12 TASK 816
- first officer's	231 320 32	23-12 TASK 816
• Transmission problem at all stations	231 330 48	23-12 TASK 816
• Transmission problem at one station		
- captain's	231 330 31	23-12 TASK 816
- first observer's	231 330 33	23-12 TASK 816
- first officer's	231 330 32	23-12 TASK 816
Radio, VHF 2		
• reception and transmission problem at all stations	231 430 48	23-12 TASK 816
• reception and transmission problem at one station		
- captain's	231 430 31	23-12 TASK 816
- first observer's	231 430 33	23-12 TASK 816
- first officer's	231 430 32	23-12 TASK 816
• reception problem at all stations	231 440 48	23-12 TASK 816
• reception problem at one station		
- captain's	231 440 31	23-12 TASK 816
- first observer's	231 440 33	23-12 TASK 816
- first officer's	231 440 32	23-12 TASK 816
• Transmission problem at all stations	231 450 48	23-12 TASK 816
• Transmission problem at one station		
- captain's	231 450 31	23-12 TASK 816
- first observer's	231 450 33	23-12 TASK 816
- first officer's	231 450 32	23-12 TASK 816
Radio, VHF 3		
• reception and transmission problem at all stations	231 550 48	23-12 TASK 816

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Radio, VHF 3 (continued)		
• reception and transmission problem at one station		
- captain's	231 550 31	23-12 TASK 816
- first observer's	231 550 33	23-12 TASK 816
- first officer's	231 550 32	23-12 TASK 816
• reception problem at all stations	231 560 48	23-12 TASK 816
• reception problem at one station		
- captain's	231 560 31	23-12 TASK 816
- first observer's	231 560 33	23-12 TASK 816
- first officer's	231 560 32	23-12 TASK 816
• Transmission problem at all stations	231 570 48	23-12 TASK 816
• Transmission problem at one station		
- captain's	231 570 31	23-12 TASK 816
- first observer's	231 570 33	23-12 TASK 816
- first officer's	231 570 32	23-12 TASK 816
RAM DOOR FULL OPEN Light		
• light is not on, airplane on the ground	215 140 00	21-51 TASK 804
• light stays on, airplane in the air	215 160 00	21-51 TASK 803
Reading light, observer's		
• does not come on correctly	331 130 00	33-10 TASK 801
• Does not go off	331 131 00	33-10 TASK 801
Recirculation fan (dual-fan system)		
• does not operate		
- left	212 040 41	21-25 TASK 802
- right	212 040 42	21-25 TASK 802
Recirculation fan (single-fan system)		
• does not operate	212 040 00	21-25 TASK 801
Refuel quantity indicator		
• blank		
- all tanks	282 010 48	28-21 TASK 804
- center tank	282 010 43	28-21 TASK 804
- tank no. 1	282 010 01	28-21 TASK 804
- tank no. 2	282 010 02	28-21 TASK 804

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Refuel quantity indicator (continued)		
• Display is not correct with switch at TEST GAGES		
- all tanks	282 011 48	28-21 TASK 802
- center tank	282 011 43	28-21 TASK 802
- tank no. 1	282 011 01	28-21 TASK 802
- tank no. 2	282 011 02	28-21 TASK 802
• flashes		
- center tank	282 015 43	28-21 TASK 816
- tank no. 1	282 015 01	28-21 TASK 816
- tank no. 2	282 015 02	28-21 TASK 816
• shows ARINC error message		
- all tanks	282 013 48	28-21 TASK 817
- center tank	282 013 43	28-21 TASK 817
- tank no. 1	282 013 01	28-21 TASK 817
- tank no. 2	282 013 02	28-21 TASK 817
• Shows Id FAIL		
- all tanks	282 012 48	28-21 TASK 805
- center tank	282 012 43	28-21 TASK 805
- tank no. 1	282 012 01	28-21 TASK 805
- tank no. 2	282 012 02	28-21 TASK 805
REFUEL VALVE Light		
• light does not come on with valves selected open and refueling manifold pressurized		
- all tanks	282 030 48	28-21 TASK 807
- center tank	282 030 43	28-21 TASK 807
• light does not go off after pressing the press-to-test switch		
- all tanks	282 020 48	28-21 TASK 806
- center tank	282 020 43	28-21 TASK 806
- tank no. 1	282 020 01	28-21 TASK 806
- tank no. 2	282 020 02	28-21 TASK 806
Refuel valve position indicator light does not come on with valves selected open and refueling manifold pressurized		
- tank no. 1	282 030 01	28-21 TASK 807
- tank no. 2	282 030 02	28-21 TASK 807

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Refueling		
• fuel spill at surge tank	282 050 00	28-21 TASK 801
• Fuel Tank Auto-Shutoff is inoperative	282 051 00	28-21 TASK 801
• Refueling (all) is prevented	282 040 00	28-21 TASK 808
• Valve does not close with switch at CLOSED		
- all tanks	282 070 48	28-21 TASK 806
- center tank	282 070 43	28-21 TASK 806
- tank no. 1	282 070 01	28-21 TASK 806
- tank no. 2	282 070 02	28-21 TASK 806
Refueling does not stop at the preselected quantity	282 090 00	28-21 TASK 811
Refueling panel light		
• light does not come on with ground power on the airplane	282 080 00	28-21 TASK 810
RESET COUNT EXCEEDED message shows on CDU during FMC software load	346 310 00	34-61 TASK 814
RESYNC FAIL, SINGLE FMC OP/SINGLE FMC OP message shows on CDU	346 180 00	34-61 TASK 832
Reverse thrust lever		
• Difficult to move in Reverse Thrust		
- engine 1	760 060 51	76-05 TASK 805
- engine 2	760 060 52	76-05 TASK 805
• has lost motion, no engine response to Thrust Lever movement; Thrust Reverser operates normally		
- engine 1	760 080 51	76-05 TASK 806
- engine 2	760 080 52	76-05 TASK 806
• has lost motion, no Thrust Reverser operation		
- engine 1	760 070 51	76-05 TASK 807
- engine 2	760 070 52	76-05 TASK 807
• jammed in reverse thrust (no movement)		
- engine 1	760 065 51	76-05 TASK 808
- engine 2	760 065 52	76-05 TASK 808

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
REVERSER light		
• light ON, Thrust Reverser operates normally		
- engine 1	780 020 51	78-34 TASK 801
- engine 2	780 020 52	78-34 TASK 801
RIGHT GEAR red light		
• light on, RIGHT GEAR green light does not come on with landing gear lever at DN, alternate gear extension was attempted	326 040 42	32-32 TASK 805
• light on, RIGHT GEAR green light does not come on with landing gear lever at DN, indications normal after alternate gear extension	326 050 42	32-32 TASK 802
• light on, RIGHT GEAR green light does not go off with landing gear lever at UP	326 060 42	32-32 TASK 801
RIPS maintenance discrete check fails	237 015 00	23-71 TASK 806
ROLL message shows on the attitude display		
- captain's	342 030 31	34-21 TASK 825
- first officer's	342 030 32	34-21 TASK 826
Rudder		
• does not move correctly	272 040 00	27-21 TASK 806
• does not move freely	272 050 00	27-21 TASK 807
• STBY RUD ON light is on	272 070 00	27-21 TASK 817
• surface has excessive play	272 060 00	27-21 TASK 808
Rudder pedal steering		
• does not operate, tiller steering normal	325 060 00	32-51 TASK 805
• does not steer straight	325 061 00	32-51 TASK 810
Rudder pedals		
• Adjustment crank does not move freely		
- captain's	272 070 31	27-21 TASK 809
- first officer's	272 070 32	27-21 TASK 809
• Adjustment crank turns but rudder pedals do not move		
- captain's	272 080 31	27-21 TASK 810
- first officer's	272 080 32	27-21 TASK 810

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Rudder pedals (continued)		
• do not move freely		
- captain's	272 090 31	27-21 TASK 811
- first officer's	272 090 32	27-21 TASK 811
• kick back during flight	272 092 00	27-21 TASK 816
Rudder trim		
• high	272 015 00	27-21 TASK 818
• nose left and nose right does not operate	272 010 48	27-21 TASK 803
• nose left does not operate	272 010 41	27-21 TASK 801
• nose right does not operate	272 010 42	27-21 TASK 802
RUDDER TRIM indicator		
• does not operate correctly	272 020 00	27-21 TASK 804
• light not on	272 030 00	27-21 TASK 805
Runway turnoff light		
• does not come on		
- left	334 300 41	33-40 TASK 801
- right	334 300 42	33-40 TASK 801
• Does not go off		
- left	334 310 41	33-40 TASK 801
- right	334 310 42	33-40 TASK 801
SCANNIN DME FAIL message shows on the CDU	346 350 00	34-61 TASK 801
Seat		
• horizontal adjustment problem		
- captain's	251 020 31	25-99 TASK 801
- first officer's	251 020 32	25-99 TASK 801
• lumbar adjustment problem		
- captain's	251 030 31	25-99 TASK 801
- first officer's	251 030 32	25-99 TASK 801
• recline adjustment problem		
- captain's	251 040 31	25-99 TASK 801
- first officer's	251 040 32	25-99 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Seat (continued)		
• vertical adjustment problem		
- captain's	251 050 31	25-99 TASK 801
- first officer's	251 050 32	25-99 TASK 801
Seat arm rest problem		
- captain's	251 060 31	25-99 TASK 801
- first officer's	251 060 32	25-99 TASK 801
Seat belt problem		
- captain's	251 070 31	25-99 TASK 801
- first observer's	251 070 33	25-99 TASK 801
- first officer's	251 070 32	25-99 TASK 801
- second observer's	251 070 34	25-99 TASK 801
Seat track		
• does not move freely		
- captain's	251 080 31	25-99 TASK 801
- first officer's	251 080 32	25-99 TASK 801
Seizure of engine		
- engine 1	055 120 51	05-51 TASK 811
- engine 2	055 120 52	05-51 TASK 811
SELCAL		
• all call lights on	232 260 00	23-28 TASK 805
• call light does not come on for calls on HF 1	232 080 00	23-28 TASK 802
• call light does not come on for calls on HF 2	232 090 00	23-28 TASK 802
• call light does not come on for calls on VHF 1	232 100 00	23-28 TASK 802
• call light does not come on for calls on VHF 2	232 110 00	23-28 TASK 802
• call light does not come on for calls on VHF 3	232 120 00	23-28 TASK 802
• Call switch does not reset for HF 1, PTT reset OK	232 020 00	23-28 TASK 801
• Call switch does not reset for HF 2, PTT reset OK	232 030 00	23-28 TASK 801
• Call switch does not reset for VHF 1, PTT reset OK	232 040 00	23-28 TASK 801
• Call switch does not reset for VHF 2, PTT reset OK	232 050 00	23-28 TASK 801
• Call switch does not reset for VHF 3, PTT reset OK	232 060 00	23-28 TASK 801
• Chime does not operate for calls on HF 1, SELCAL call light comes on	232 140 00	23-28 TASK 803

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
SELCAL (continued)		
• Chime does not operate for calls on HF 2, SELCAL call light comes on	232 150 00	23-28 TASK 803
• Chime does not operate for calls on VHF 1, SELCAL call light comes on	232 160 00	23-28 TASK 803
• Chime does not operate for calls on VHF 2, SELCAL call light comes on	232 170 00	23-28 TASK 803
• Chime does not operate for calls on VHF 3, SELCAL call light comes on	232 180 00	23-28 TASK 803
• does not operate for any radio	232 250 00	23-28 TASK 804
• does not operate for HF 1	232 200 00	23-28 TASK 804
• does not operate for HF 2	232 210 00	23-28 TASK 804
• does not operate for VHF 1	232 220 00	23-28 TASK 804
• does not operate for VHF 2	232 230 00	23-28 TASK 804
• does not operate for VHF 3	232 240 00	23-28 TASK 804
Service interphone		
• distorted		
- all jacks	234 030 48	23-41 TASK 803
- jack adjacent to APU	234 120 00	23-41 TASK 802
- jack at aft entry light panel	234 150 00	23-41 TASK 802
- jack at EE rack	234 070 00	23-41 TASK 802
- jack at external power receptacle panel	234 190 00	23-41 TASK 802
- jack at left wheel well	234 230 00	23-41 TASK 802
- jack at right wheel well	234 270 00	23-41 TASK 802
- jack at right wing refueling slat	234 310 00	23-41 TASK 802
- jack in the electronic equipment bay	234 430 00	23-41 TASK 802
• does not connect to flight interphone	234 010 00	23-41 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Service interphone (continued)		
• does not operate		
- all jacks	234 020 48	23-41 TASK 801
- jack adjacent to APU	234 100 00	23-41 TASK 802
- jack at aft entry light panel	234 140 00	23-41 TASK 802
- jack at EE rack	234 060 00	23-41 TASK 802
- jack at external power receptacle panel	234 180 00	23-41 TASK 802
- jack at left wheel well	234 220 00	23-41 TASK 802
- jack at right wheel well	234 260 00	23-41 TASK 802
- jack at right wing refueling slat	234 300 00	23-41 TASK 802
- jack in the electronic equipment bay	234 410 00	23-41 TASK 802
• intermittent		
- all jacks	234 040 48	23-41 TASK 803
- jack adjacent to APU	234 110 00	23-41 TASK 802
- jack at aft entry light panel	234 160 00	23-41 TASK 802
- jack at EE rack	234 080 00	23-41 TASK 802
- jack at external power receptacle panel	234 200 00	23-41 TASK 802
- jack at left wheel well	234 240 00	23-41 TASK 802
- jack at right wheel well	234 280 00	23-41 TASK 802
- jack at right wing refueling slat	234 320 00	23-41 TASK 802
- jack in the electronic equipment bay	234 420 00	23-41 TASK 802
• volume problem		
- all jacks	234 050 48	23-41 TASK 803
- jack adjacent to APU	234 130 00	23-41 TASK 802
- jack at aft entry light panel	234 170 00	23-41 TASK 802
- jack at EE rack	234 090 00	23-41 TASK 802
- jack at external power receptacle panel	234 210 00	23-41 TASK 802
- jack at left wheel well	234 250 00	23-41 TASK 802
- jack at right wheel well	234 290 00	23-41 TASK 802
- jack at right wing refueling slat	234 330 00	23-41 TASK 802
- jack in the electronic equipment bay	234 440 00	23-41 TASK 802
Shaker, control column		
• does not operate during test	273 110 00	27-32 TASK 836
• operates continuously	273 115 00	27-32 TASK 834

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Shoulder harness		
• Does not extend or retract		
- captain's	251 090 31	25-99 TASK 801
- first observer's	251 090 33	25-99 TASK 801
- first officer's	251 090 32	25-99 TASK 801
SINGLE FMC OPERATION message shows on the CDU	346 370 00	34-61 TASK 807
Single toilet inoperative	383 028 00	38-30 TASK 820
Sink drain plugged	383 032 00	38-30 TASK 819
Slats, Leading Edge		
• TRANSIT light stays on		
- 1	278 080 01	27-88 TASK 820
- 2	278 080 02	27-88 TASK 820
- 3	278 080 03	27-88 TASK 820
- 4	278 080 04	27-88 TASK 820
- 5	278 080 05	27-88 TASK 820
- 6	278 080 06	27-88 TASK 820
- 7	278 080 07	27-88 TASK 820
- 8	278 080 08	27-88 TASK 820
Smoke		
• does not stop with recirculation fans OFF, isolation valve closed, and both pack switches at OFF		
- flight compartment	210 070 00	21-00 TASK 803
- flight compartment and passenger cabin	210 080 00	21-00 TASK 803
- passenger cabin	210 090 00	21-00 TASK 803
• Stops with recirculation fan(s) off		
- flight compartment	212 050 00	21-00 TASK 804
- flight compartment and passenger cabin	212 060 00	21-00 TASK 804
- passenger cabin	212 070 00	21-00 TASK 804
• Stops with recirculation fan(s) off, isolation valve closed, and right pack switch at off		
- flight compartment and passenger cabin	210 020 00	21-00 TASK 801
- passenger cabin	210 030 00	21-00 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Smoke (continued)		
• Stops with recirculation fan(s) off, isolation valve closed, right pack switch in auto, and left pack switch off		
- flight compartment	210 040 00	21-00 TASK 802
- flight compartment and passenger cabin	210 050 00	21-00 TASK 802
- passenger cabin	210 060 00	21-00 TASK 802
Smoke Detector		
• does not turn off	261 541 00	26-14 TASK 801
Smoke Detector in Lavatory		
• Red light flashes	261 641 00	26-14 TASK 802
Smoke goggles		
• missing		
- captain's	256 060 31	25-99 TASK 801
- first officer's	256 060 32	25-99 TASK 801
Smoke or flame in APU exhaust	492 150 00	49-55 TASK 801
Smoke or fumes in cabin		
• Pneumatic Power supplied by APU	499 010 00	49-55 TASK 802
• Pneumatic Power supplied by Engine		
- engine 1	710 300 51	71-05 TASK 807
- engine 2	710 300 52	71-05 TASK 807
• Source unknown	210 671 00	21-00 TASK 806
SOURCE OFF and GEN OFF BUS lights		
• lights on with IDG 1 and IDG 2 on line		
- no. 1	242 040 01	24-21 TASK 801
- no. 2	242 040 02	24-21 TASK 801
SOURCE OFF and TRANSFER BUS OFF lights		
• lights on with GRD PWR switch at ON		
- no. 1	244 010 01	24-41 TASK 801
- no. 1 and no. 2	244 010 48	24-41 TASK 801
- no. 2	244 010 02	24-41 TASK 801
• lights on with the APU generator on line		
- no. 1	242 060 01	24-21 TASK 801
- no. 2	242 060 02	24-21 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
SOURCE OFF light		
• light comes on but no fault light on GCU is on		
- GEN 1 SOURCE OFF light	242 080 01	24-21 TASK 821
- GEN 2 SOURCE OFF light	242 080 02	24-21 TASK 821
SPAR VALVE CLOSED light		
• does not come on bright when the valve is in transit		
- engine 1	282 240 51	28-22 TASK 811
- engine 2	282 240 52	28-22 TASK 812
• slow to go from Bright to Dim when the Start Lever is moved to CUTOFF		
- engine 1	282 180 51	28-22 TASK 809
- engine 2	282 180 52	28-22 TASK 810
• slow to go from Bright to OFF when the Start Lever is moved to IDLE		
- engine 1	282 190 51	28-22 TASK 809
- engine 2	282 190 52	28-22 TASK 810
• Stays ON bright when the Start Lever is moved to CUTOFF		
- engine 1	282 200 51	28-22 TASK 809
- engine 2	282 200 52	28-22 TASK 810
• Stays ON bright when the Start Lever is moved to IDLE		
- engine 1	282 210 51	28-22 TASK 809
- engine 2	282 210 52	28-22 TASK 810
Spare bulb kit		
• needs replenishing	251 110 00	25-99 TASK 801
SPD flag shows on integrated standby flight display	342 609 00	34-24 TASK 812
SPD flag shows on the EFIS display		
- captain's	342 040 31	34-21 TASK 827
- first officer's	342 040 32	34-21 TASK 828
SPD LIM shows		
- captain's	273 160 31	27-32 TASK 831
- first officer's	273 160 32	27-32 TASK 833
SPDTRM LCH shows in DFCS BITE FAULT HISTORY	221 207 00	22-17 TASK 807

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Speaker in the flight compartment		
• does not operate		
- captain's	235 080 31	23-51 TASK 805
- first officer's	235 080 32	23-51 TASK 806
Speed Brake		
• Auto extend does not operate	276 040 00	27-62 TASK 804
• Auto retract does not operate	276 050 00	27-62 TASK 805
• chatters	276 060 00	27-62 TASK 806
• Flight detent does not operate	276 070 00	27-61 TASK 802
• lever does not move freely	276 080 00	27-62 TASK 807
SPEED BRAKE ARMED Light		
• does not operate	276 020 00	27-62 TASK 803
• is on but the speedbrakes do not operate	276 025 00	27-62 TASK 815
SPEED BRAKE ARMED Light and the SPEED BRAKE DO NOT ARM Light		
• do not operate	276 032 00	27-62 TASK 816
Speed Brake Control System		
• Flight Spoiler does not fully deploy during Ground Speedbrake Operation		
- No. 10	276 210 10	27-62 TASK 817
- No. 11	276 210 11	27-62 TASK 817
- No. 2	276 210 02	27-62 TASK 817
- No. 3	276 210 03	27-62 TASK 817
- No. 4	276 210 04	27-62 TASK 817
- No. 5	276 210 05	27-62 TASK 817
- No. 8	276 210 08	27-62 TASK 817
- No. 9	276 210 09	27-62 TASK 817
SPEED BRAKE DO NOT ARM Light		
• light on	276 030 00	27-62 TASK 802
SPEED TRIM FAIL light		
• comes ON when MASTER CAUTION Recall switch is pushed	221 060 00	22-11 TASK 850
• light on	221 050 00	22-11 TASK 849

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
SPEEDBRAKES EXTENDED light		
• light on with airplane on the ground	276 035 00	27-62 TASK 814
Spoiler		
• does not agree with spoiler position		
- spoiler panel 03	313 015 41	31-31 TASK 877
- spoiler panel 10	313 015 42	31-31 TASK 877
Spoilers		
• Airplane rolls left when the spoilers are deployed	276 111 41	27-61 TASK 805
• Airplane rolls right when the spoilers are deployed	276 111 42	27-61 TASK 805
• do not move in one direction	276 110 00	27-61 TASK 804
• flight spoilers do not operate	276 090 00	27-61 TASK 802
• ground spoilers do not operate	276 100 00	27-61 TASK 803
• spoiler panel(s) float	276 010 00	27-61 TASK 801
STAB OUT OF TRIM light		
• light on	221 070 00	22-11 TASK 851
Stabilizer		
• control cable tension repeatedly checks low	274 010 00	27-41 TASK 801
• fails to trim		
- nose down	274 020 00	27-41 TASK 802
- nose up	274 030 00	27-41 TASK 803
- nose up and nose down	274 040 00	27-41 TASK 804
• Too much play in stabilizer surface	274 060 00	27-41 TASK 813
Stabilizer runaway while the autopilot is engaged	221 935 00	22-11 TASK 839
Stabilizer trim		
• does not hold position in flight	274 130 00	27-41 TASK 812
• does not move freely	274 070 00	27-41 TASK 805
• moves with slow speed only	274 080 00	27-41 TASK 810
• wheel coasts more than 2.5 turns (flaps down)	274 120 00	27-41 TASK 811
Stabilizer trim switches		
• do not operate trim down		
- captain's	274 160 31	27-41 TASK 806
- first officer's	274 160 32	27-41 TASK 808

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Stabilizer trim switches (continued)		
• do not operate trim up		
- captain's	274 150 31	27-41 TASK 806
- first officer's	274 150 32	27-41 TASK 808
• do not operate trim up and trim down		
- captain's	274 170 31	27-41 TASK 807
- first officer's	274 170 32	27-41 TASK 809
Stall, turbulence, buffet, or overspeed	055 070 00	05-51 TASK 808
Standby airspeed indicator problem	341 020 00	34-13 TASK 802
Standby altimeter problem	341 010 00	34-13 TASK 801
Standby Attitude Indicator		
• G/S flag shows	342 650 00	34-24 TASK 802
• glideslope deviation pointer out of view	342 630 00	34-24 TASK 802
• GYRO flag shows	342 670 00	34-24 TASK 801
• LOC flag shows	342 660 00	34-24 TASK 802
• localizer deviation pointer out of view	342 620 00	34-24 TASK 802
Standby compass light		
• does not come on	331 100 00	34-23 TASK 802
• Does not go off	331 101 00	34-23 TASK 802
Standby flight display, integrated (ISFD)		
• airspeed indication is different than common display system	342 614 00	34-24 TASK 816
• ALT flag shows	342 602 00	34-24 TASK 805
• altitude indication is different than common display system	342 612 00	34-24 TASK 813
• ATT flag shows	342 603 00	34-24 TASK 806
• attitude display disagrees with primary display; no flag shows	342 611 00	34-24 TASK 814
• dedicated battery system, front panel fault light is on	342 613 00	34-24 TASK 815
• display blank	342 601 00	34-24 TASK 804
• G/S flag shows	342 604 00	34-24 TASK 808
• HDG flag shows	342 605 00	34-24 TASK 809
• LOC flag shows	342 606 00	34-24 TASK 808

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Standby flight display, integrated (ISFD) (continued)		
• OUT OF ORDER flag shows	342 607 00	34-24 TASK 810
• PROGRAM PIN ERROR flag shows	342 608 00	34-24 TASK 811
• SPD flag shows	342 609 00	34-24 TASK 812
• WAIT ATT flag shows	342 610 00	34-24 TASK 807
STANDBY HYD LOW PRESSURE light		
• light on	293 220 00	29-30 TASK 814
STANDBY HYD LOW QUANTITY light		
• light on	293 180 00	29-30 TASK 809
Standby hydraulic pump		
• does not operate	292 010 00	29-20 TASK 801
Standby magnetic compass error	342 510 00	34-23 TASK 801
STANDBY PWR OFF light		
• light on with AC power supplied and STANDBY POWER switch at AUTO or BAT	243 010 00	24-34 TASK 803
• light on with BAT switch at ON and STANDBY POWER switch at AUTO or BAT	243 020 00	24-34 TASK 803
Start Lever LED Light		
• does not come ON when the TEST Switch is set to the OVHT/FIRE position		
- engine 1	760 081 51	76-11 TASK 803
- engine 2	760 081 52	76-11 TASK 803
STBY RUD ON light		
• light is on	272 070 00	27-21 TASK 817
Strobe light, anti-collision		
• Does not go off		
- left wing	334 250 41	33-44 TASK 801
- right wing	334 250 42	33-44 TASK 801
- tail	334 260 00	33-44 TASK 801
Strut or nacelle dragged or damaged		
- engine 1	055 100 51	05-51 TASK 811
- engine 2	055 100 52	05-51 TASK 811

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Sun visor problem		
- captain's	251 120 31	25-99 TASK 801
- first officer's	251 120 32	25-99 TASK 801
SUPPLY DUCT air temperature indication		
• not correct	216 160 00	21-61 TASK 842
Surge of APU during ECS operation	492 161 00	49-55 TASK 810
Surge of APU during main engine start	492 160 00	49-55 TASK 808
Switch, lighted pushbutton		
• does not come on correctly	331 020 00	33-10 TASK 801
• Does not go off	331 021 00	33-10 TASK 801
Tail dragged	055 110 00	05-51 TASK 812
Tailcone light		
• does not come on	333 070 00	33-30 TASK 801
• Does not go off	333 071 00	33-30 TASK 801
Takeoff warning horn		
• does not sound	312 010 00	31-51 TASK 803
• sounds (false warning)	312 015 00	31-51 TASK 803
TAS data		
• does not show on the navigation display		
- captain's	342 120 31	34-21 TASK 827
- first officer's	342 120 32	34-21 TASK 828
TAT data		
• does not show on the engine display	342 050 00	34-21 TASK 813
Taxi light		
• does not come on	334 320 00	33-40 TASK 801
• Does not go off	334 330 00	33-40 TASK 801
TCAS		
• display blank		
- captain's	344 310 31	34-45 TASK 817
- captain's and first officer's	344 310 48	34-45 TASK 817
- first officer's	344 310 32	34-45 TASK 817

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
TCAS (continued)		
• intruder symbol stays directly in front of the airplane symbol on the navigation display	344 350 00	34-45 TASK 814
• intruder symbols do not show on the navigation display	344 380 00	34-45 TASK 814
• intruder symbols show when the airplane is on the ground	344 320 00	34-45 TASK 820
• navigation display shows TCAS OFF with the control panel selector switch at TA	344 330 00	34-45 TASK 815
• navigation display shows TCAS OFF with the control panel selector switch at TA/RA	344 340 00	34-45 TASK 815
• system test does not start when the TEST switch is pushed	344 390 00	34-45 TASK 819
• system test problem	344 395 00	34-45 TASK 818
• voice annunciation (aural) problem	344 360 00	34-45 TASK 816
TCAS FAIL Flag on Navigation Display		
• Shows with ATC transponder selector at TA and does not show with selector at TA/RA	344 371 00	34-45 TASK 821
• Shows with ATC transponder selector at TA and shows with selector at TA/RA	344 370 00	34-45 TASK 821
• Shows with ATC transponder selector at TA/RA and does not show with selector at TA	344 372 00	34-45 TASK 823
TCAS OFF shows on the navigation display		
• With the control panel selector switch at TA	344 330 00	34-45 TASK 815
• With the control panel selector switch at TA/RA	344 340 00	34-45 TASK 815
TEMP PROBE light		
• light on	303 100 00	30-31 TASK 810
Temperature		
• Too cold, cannot make warmer in AUTO and MANUAL mode, air mix valve does not move to HOT		
- CONT CABIN	216 460 00	21-61 TASK 845
- PASS CABIN	216 470 00	21-61 TASK 847
• Too cold, cannot make warmer in AUTO mode, OK in MANUAL mode		
- CONT CABIN	216 420 00	21-61 TASK 801
- PASS CABIN	216 430 00	21-61 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Temperature (continued)		
• Too hot, cannot make cooler in AUTO and MANUAL mode, air mix valve does not move to COLD		
- CONT CABIN	216 440 00	21-61 TASK 844
- PASS CABIN	216 450 00	21-61 TASK 846
• Too hot, cannot make cooler in AUTO mode, OK in MANUAL mode		
- CONT CABIN	216 400 00	21-61 TASK 801
- PASS CABIN	216 410 00	21-61 TASK 801
Temperature control		
• AUTO control does not operate		
- AFT CAB	216 050 00	21-62 TASK 905
- CONT CAB	216 040 00	21-62 TASK 905
- FWD CAB	216 060 00	21-62 TASK 905
- PASS CABIN	216 070 00	21-61 TASK 862
• Cabin temperatures are uncontrollable	216 510 00	21-62 TASK 905
• cannot cool cabins, all temperature selectors set to full COLD	216 612 00	21-62 TASK 849
Temperature indication problem		
- air temperature selector at AFT SUPPLY DUCT	216 170 00	21-61 TASK 860
- air temperature selector at AFT ZONE CABIN	216 120 00	21-61 TASK 857
- air temperature selector at CONT CAB SUPPLY DUCT	216 140 00	21-61 TASK 858
- air temperature selector at FWD SUPPLY DUCT	216 180 00	21-61 TASK 859
- air temperature selector at FWD ZONE CABIN	216 130 00	21-61 TASK 856
- air temperature selector at PACK L	215 060 00	21-61 TASK 854
- air temperature selector at PACK R	215 070 00	21-61 TASK 855
- air temperature selector at PASS CABIN	216 190 00	21-61 TASK 843
- air temperature selector at SUPPLY DUCT	216 160 00	21-61 TASK 842
TERR FAIL message shows	344 450 00	34-46 TASK 856
TERR POS message shows	344 430 00	34-46 TASK 856
TERR RANGE DISAGREE message shows	344 460 00	34-46 TASK 857

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Terrain display for ground proximity		
• does not show		
- captain's	344 480 31	34-46 TASK 853
- captain's and first officer's	344 480 48	34-46 TASK 853
- first officer's	344 480 32	34-46 TASK 853
Threshold Light (Main Deck Cargo Door)		
• does not turn OFF	333 091 00	33-35 TASK 801
• does not turn ON	333 092 00	33-35 TASK 801
Throttle resolver angle indication		
• blank during BITE interactive range check	223 210 00	22-32 TASK 813
Thrust lever		
• Does not go to full rated N1 when TO/GA switch is pushed a second time during go-around		
- engine 1	223 070 51	22-32 TASK 804
- engine 1 and engine 2	223 070 48	22-32 TASK 804
- engine 2	223 070 52	22-32 TASK 804
• Does not go to reduced N1 when TO/GA switch is pushed one time during go-around		
- engine 1	223 080 51	22-32 TASK 804
- engine 1 and engine 2	223 080 48	22-32 TASK 804
- engine 2	223 080 52	22-32 TASK 804
• does not move back with autothrottle in RETARD mode		
- engine 1	223 100 51	22-32 TASK 802
- engine 1 and engine 2	223 100 48	22-32 TASK 802
- engine 2	223 100 52	22-32 TASK 802
• does not move forward when TO/GA switch is pushed		
- engine 1	223 060 51	22-32 TASK 804
- engine 1 and engine 2	223 060 48	22-32 TASK 804
- engine 2	223 060 52	22-32 TASK 804
• levers not aligned (staggered) for same N1 on both engines	760 010 00	76-05 TASK 801
• split, OK with autothrottle disengaged	223 180 00	22-32 TASK 811
Thrust mode		
• does not show on the engine display	346 230 00	34-61 TASK 809

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Thrust Reverser Deploy		
• REV message does not show, thrust reverser does not deploy, and reverse thrust lever does not move to full reverse thrust		
- engine 1	780 030 51	78-34 TASK 807
- engine 2	780 030 52	78-34 TASK 807
• REV message shows amber, reverse thrust lever does not move to full reverse thrust		
- engine 1	780 050 51	78-34 TASK 802
- engine 2	780 050 52	78-34 TASK 802
• REV message shows amber, reverse thrust lever moves to full reverse thrust but engine does not go to full reverse thrust		
- engine 1	780 040 51	78-34 TASK 802
- engine 2	780 040 52	78-34 TASK 802
• REV message shows green, reverse thrust lever does not move to full reverse thrust		
- engine 1	780 060 51	78-34 TASK 803
- engine 2	780 060 52	78-34 TASK 803
• REV message shows green, reverse thrust lever moves to full reverse thrust but engine does not go to full reverse thrust		
- engine 1	780 065 51	78-34 TASK 804
- engine 2	780 065 52	78-34 TASK 804
• Reverse Thrust Levers set to Full Reverse Thrust, but ENG-1 and ENG-2 T/R Sleeves do not deploy		
- engine 1 and engine 2	780 201 48	78-34 TASK 810
• time to extend thrust reverser too slow (more than 3 seconds)		
- engine 1	780 070 51	78-34 TASK 805
- engine 2	780 070 52	78-34 TASK 805
Thrust Reverser Stow		
• REV message shows amber or green, ENG CONTROL light off, REVERSER light on		
- engine 1	780 090 51	78-34 TASK 806
- engine 2	780 090 52	78-34 TASK 806

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Thrust Reverser Stow (continued)		
• REV message shows amber or green, ENG CONTROL light on, REVERSER light off		
- engine 1	780 080 51	78-36 TASK 806
- engine 2	780 080 52	78-36 TASK 806
• REV message shows green, ENG CONTROL light off, REVERSER light on		
- engine 1	780 105 51	78-34 TASK 806
- engine 2	780 105 52	78-34 TASK 806
• REVERSER Light does not come ON momentarily during stow; Thrust Reverser operates normally		
- engine 1	780 100 51	78-34 TASK 808
- engine 2	780 100 52	78-34 TASK 808
• time to retract thrust reverser too slow (more than 5 seconds)		
- engine 1	780 110 51	78-34 TASK 805
- engine 2	780 110 52	78-34 TASK 805
Tiller steering		
• does not operate	325 070 00	32-51 TASK 806
• response is sluggish	325 080 00	32-51 TASK 807
• Steers in left direction only	325 090 00	32-51 TASK 808
• Steers in right direction only	325 100 00	32-51 TASK 808
Tire problem		
- main gear left inboard	324 150 02	32-42 TASK 820
- main gear left outboard	324 150 01	32-42 TASK 820
- main gear right inboard	324 150 03	32-42 TASK 820
- main gear right outboard	324 150 04	32-42 TASK 820
- nose gear left	324 150 05	32-42 TASK 820
- nose gear right	324 150 06	32-42 TASK 820
TO/GA pitch mode		
• does not show on the flight mode annunciator for go-around when TO/GA switch is pushed and F/D on		
- captain's	221 200 31	22-11 TASK 801
- captain's and first officer's	221 200 48	22-11 TASK 801
- first officer's	221 200 32	22-11 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
TO/GA pitch mode (continued)		
• does not show on the flight mode annunciator for takeoff when TO/GA switch is pushed and F/D on		
- captain's	221 190 31	22-11 TASK 801
- captain's and first officer's	221 190 48	22-11 TASK 801
- first officer's	221 190 32	22-11 TASK 801
Toilet		
• overflows	383 024 00	38-30 TASK 814
• plugged	383 025 00	38-30 TASK 815
Toilet flush system		
• does not flush		
- all toilets	383 121 48	38-30 TASK 811
• does not turn off	383 026 00	38-30 TASK 816
• plugged/blocked	383 027 00	38-30 TASK 817
Toilet flush valve assembly		
• blocked	383 029 00	38-30 TASK 830
TR UNIT light		
• light on	243 040 00	24-31 TASK 826
TRANSFER BUS OFF and SOURCE OFF lights		
• lights on with GRD PWR switch at ON		
- no. 1	244 010 01	24-41 TASK 801
- no. 1 and no. 2	244 010 48	24-41 TASK 801
- no. 2	244 010 02	24-41 TASK 801
• lights on with the APU generator on line		
- no. 1	242 060 01	24-21 TASK 801
- no. 2	242 060 02	24-21 TASK 801
TRANSFER BUS OFF light		
• comes on	242 075 00	24-21 TASK 822
• flickers with IDG on line		
- generator 1	242 070 01	24-21 TASK 818
- generator 2	242 070 02	24-21 TASK 819
Trim air valve does not operate	216 310 00	21-62 TASK 838

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Trim switch		
• does not operate correctly	272 100 00	27-21 TASK 812
Turbulence (severe), stall, buffet, or overspeed	055 070 00	05-51 TASK 808
Unreliable Airspeed	342 065 00	31-62 TASK 876
Unreliable Altitude	342 095 00	31-62 TASK 875
Vacuum blower inoperative	383 033 00	38-30 TASK 821
VALVE OPEN light for fuel crossfeed		
• does not come on bright when the valve is in transit	282 125 00	28-22 TASK 808
• Stays ON bright when the Crossfeed Selector is moved to the OFF position	282 120 00	28-22 TASK 807
• Stays ON bright when the Crossfeed Selector is moved to the ON position	282 110 00	28-22 TASK 807
Valve position light, refuel panel		
• light does not come on with valves selected open and refueling manifold pressurized		
- all tanks	282 030 48	28-21 TASK 807
- center tank	282 030 43	28-21 TASK 807
- tank no. 1	282 030 01	28-21 TASK 807
- tank no. 2	282 030 02	28-21 TASK 807
• light does not go off after pressing the press-to-test switch		
- all tanks	282 020 48	28-21 TASK 806
- center tank	282 020 43	28-21 TASK 806
- tank no. 1	282 020 01	28-21 TASK 806
- tank no. 2	282 020 02	28-21 TASK 806
• Stays on with switch at CLOSED		
- all tanks	282 070 48	28-21 TASK 806
- center tank	282 070 43	28-21 TASK 806
- tank no. 1	282 070 01	28-21 TASK 806
- tank no. 2	282 070 02	28-21 TASK 806
VERIFY POSITION message shows on CDU and POS SHIFT page shows large IRS drift	342 225 00	34-21 TASK 836
VERT SPEED window display on the mode control panel		
• does not change with vertical speed selector change	221 830 00	22-11 TASK 803

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
VERT SPEED window display on the mode control panel (continued)		
• does not show	221 840 00	22-11 TASK 803
Vertical Situation Display problem		
- captain's	344 501 31	34-46 TASK 801
- first officer's	344 501 32	34-46 TASK 801
Vertical speed data		
• does not show		
- captain's	342 180 31	31-63 TASK 809
- first officer's	342 180 32	31-63 TASK 809
Vertical speed pointer		
• does not show		
- captain's	342 185 31	34-21 TASK 825
- first officer's	342 185 32	34-21 TASK 826
VHF 1 control panel problem	231 030 00	23-12 TASK 814
VHF 1 radio		
• reception and transmission problem at all stations	231 310 48	23-12 TASK 816
• reception and transmission problem at one station		
- captain's	231 310 31	23-12 TASK 816
- first observer's	231 310 33	23-12 TASK 816
- first officer's	231 310 32	23-12 TASK 816
• reception problem at all stations	231 320 48	23-12 TASK 816
• reception problem at one station		
- captain's	231 320 31	23-12 TASK 816
- first observer's	231 320 33	23-12 TASK 816
- first officer's	231 320 32	23-12 TASK 816
• Transmission problem at all stations	231 330 48	23-12 TASK 816
• Transmission problem at one station		
- captain's	231 330 31	23-12 TASK 816
- first observer's	231 330 33	23-12 TASK 816
- first officer's	231 330 32	23-12 TASK 816
VHF 2 control panel problem	231 040 00	23-12 TASK 814

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
VHF 2 radio		
• reception and transmission problem at all stations	231 430 48	23-12 TASK 816
• reception and transmission problem at one station		
- captain's	231 430 31	23-12 TASK 816
- first observer's	231 430 33	23-12 TASK 816
- first officer's	231 430 32	23-12 TASK 816
• reception problem at all stations	231 440 48	23-12 TASK 816
• reception problem at one station		
- captain's	231 440 31	23-12 TASK 816
- first observer's	231 440 33	23-12 TASK 816
- first officer's	231 440 32	23-12 TASK 816
• Transmission problem at all stations	231 450 48	23-12 TASK 816
• Transmission problem at one station		
- captain's	231 450 31	23-12 TASK 816
- first observer's	231 450 33	23-12 TASK 816
- first officer's	231 450 32	23-12 TASK 816
VHF 3 control panel problem	231 050 00	23-12 TASK 814
VHF 3 radio		
• reception and transmission problem at all stations	231 550 48	23-12 TASK 816
• reception and transmission problem at one station		
- captain's	231 550 31	23-12 TASK 816
- first observer's	231 550 33	23-12 TASK 816
- first officer's	231 550 32	23-12 TASK 816
• reception problem at all stations	231 560 48	23-12 TASK 816
• reception problem at one station		
- captain's	231 560 31	23-12 TASK 816
- first observer's	231 560 33	23-12 TASK 816
- first officer's	231 560 32	23-12 TASK 816
• Transmission problem at all stations	231 570 48	23-12 TASK 816
• Transmission problem at one station		
- captain's	231 570 31	23-12 TASK 816
- first observer's	231 570 33	23-12 TASK 816
- first officer's	231 570 32	23-12 TASK 816

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Vibration in aft and forward fuselage	273 070 00	27-31 TASK 806
Vibration indication		
• blank		
- engine 1	770 040 51	77-05 TASK 805
- engine 2	770 040 52	77-05 TASK 805
• high		
- engine 1	710 232 51	71-05 TASK 808
- engine 2	710 232 52	71-05 TASK 808
• Zero or fluctuates		
- engine 1	770 050 51	77-05 TASK 804
- engine 2	770 050 52	77-05 TASK 804
Vibration, APU		
• excessive	491 020 00	49-15 TASK 807
Video Surveillance System		
• Distorted video from one camera	237 510 00	23-75 TASK 808
• no video at all three cameras	237 503 00	23-75 TASK 809
• no video for one camera		
- CAM 1	237 501 01	23-75 TASK 807
- CAM 2	237 501 02	23-75 TASK 807
- CAM 3	237 501 03	23-75 TASK 807
Voice recorder		
• RIPS maintenance discrete check fails	237 015 00	23-71 TASK 806
• Signal problem at monitor jack	237 010 00	23-71 TASK 801
• STATUS light or TEST light does not come on when TEST switch is pushed	237 020 00	23-71 TASK 804
• system operation problem (airplanes with AUTO/ON switch)	237 050 00	23-71 TASK 805
Volcanic ash condition	055 050 00	05-51 TASK 803
VOR		
• Audio tone does not occur or is weak		
- captain's	345 010 31	34-51 TASK 809
- first officer's	345 010 32	34-51 TASK 809

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
VOR (continued)		
• Bearing pointer 1 does not show, VOR1 flag does not show	345 030 01	34-51 TASK 805
• Bearing pointer 2 does not show, VOR2 flag does not show	345 030 02	34-51 TASK 805
• Data on NAV STATUS display of CDU shows FAIL	346 490 00	34-61 TASK 801
• deviation bar does not show on the navigation display		
- VOR1	345 050 01	34-51 TASK 806
- VOR2	345 050 02	34-51 TASK 806
• test problem when you push the TEST switch on the navigation control panel		
- captain's	345 020 31	34-51 TASK 801
- first officer's	345 020 32	34-51 TASK 801
• TO/FROM indication does not show on the navigation display		
- VOR1	345 060 01	34-51 TASK 810
- VOR2	345 060 02	34-51 TASK 810
VOR flag shows on the radio magnetic indicator	342 440 00	34-22 TASK 802
VOR frequency		
• shows dashes		
- VOR1	345 070 01	34-51 TASK 807
- VOR2	345 070 02	34-51 TASK 807
VOR1 flag shows on the display	345 040 01	34-51 TASK 801
VOR2 flag shows on the display	345 040 02	34-51 TASK 801
VSD flag shows		
- captain's	344 502 31	34-46 TASK 860
- first officer's	344 502 32	34-46 TASK 861
VSI flag shows		
- captain's	342 175 31	34-21 TASK 825
- first officer's	342 175 32	34-21 TASK 826
VTK flag shows		
- captain's	346 200 31	34-61 TASK 801
- first officer's	346 200 32	34-61 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
WAIT ATT flag shows on integrated standby flight display	342 610 00	34-24 TASK 807
Waste quantity indicator		
• Shows tank is empty when tank is full		
- attendant's panel	383 050 00	38-30 TASK 810
• Shows tank is full when tank is not full		
- attendant's panel	383 040 00	38-30 TASK 810
Waste tank		
• does not precharge	383 020 00	38-30 TASK 812
• full indication	383 023 00	38-30 TASK 809
• sensor J1/J2	383 021 00	38-30 TASK 803
• sensor J3	383 022 00	38-30 TASK 808
Waste tank drain valve handle		
• Does not drain tank when pulled	383 030 00	38-30 TASK 813
Water leakage		
- aft cargo compartment ceiling	381 050 45	38-10 TASK 804
- forward cargo compartment ceiling	381 050 44	38-10 TASK 804
Water, potable		
• auxiliary tank (40-gallon) leaks	381 042 00	25-99 TASK 801
• indicator on service panel shows level of zero	381 010 00	38-10 TASK 813
• main tank (60-gallon) leaks	381 041 00	25-99 TASK 801
• System does not pressurize	381 020 00	38-10 TASK 803
• tank does not fill	381 030 00	38-10 TASK 801
• tank leaks	381 040 00	38-10 TASK 802
Weather radar		
• +1 tilt angle shows during system displays test (predictive windshear)	344 161 00	34-43 TASK 806
• +2 tilt angle shows during system displays test (predictive windshear)	344 166 00	34-43 TASK 807
• +3 tilt angle shows during system displays test (predictive windshear)	344 171 00	34-43 TASK 806
• +4 tilt angle shows during system displays test (predictive windshear)	344 176 00	34-43 TASK 816

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Weather radar (continued)		
• -1 tilt angle shows during system displays test (predictive windshear)	344 160 00	34-43 TASK 806
• -2 tilt angle shows during system displays test (predictive windshear)	344 165 00	34-43 TASK 807
• -3 tilt angle shows during system displays test (predictive windshear)	344 170 00	34-43 TASK 806
• -4 tilt angle shows during system displays test (predictive windshear)	344 175 00	34-43 TASK 816
• -5 tilt angle shows during system displays test (predictive windshear)	344 180 00	34-43 TASK 817
• -6 tilt angle shows during system displays test (predictive windshear)	344 185 00	34-43 TASK 818
• -7 tilt angle shows during system displays test (predictive windshear)	344 186 00	34-43 TASK 819
• -8 tilt angle shows during system displays test (predictive windshear)	344 190 00	34-43 TASK 821
• display blank		
- captain's	344 090 31	34-43 TASK 814
- first officer's	344 090 32	34-43 TASK 814
• gain control problem		
- left	344 100 41	34-43 TASK 814
- right	344 100 42	34-43 TASK 814
• mode selector problem		
- left	344 110 41	34-43 TASK 804
- right	344 110 42	34-43 TASK 804
• no aural warnings during system displays test (predictive windshear)	344 140 00	34-43 TASK 820
• returns weak or incorrect colors on CDS		
- captain's	344 120 31	34-43 TASK 802
- first officer's	344 120 32	34-43 TASK 802
• Tilt control problem		
- left	344 130 41	34-43 TASK 814
- right	344 130 42	34-43 TASK 814
• WINDSHEAR does not show during system displays test (predictive windshear)	344 150 00	34-43 TASK 802

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
WHEEL WELL light		
• does not come on		
- main landing gear	333 010 00	33-30 TASK 801
- nose landing gear	333 020 00	33-30 TASK 801
• does not go off		
- main landing gear	333 011 00	33-30 TASK 801
- nose landing gear	333 021 00	33-30 TASK 801
• light on	261 090 00	26-18 TASK 801
Window heat		
• Does not heat correctly		
- side window	304 090 00	30-41 TASK 809
- upper window	304 100 00	30-41 TASK 810
- windshield	304 080 00	30-41 TASK 802
• lights do not operate correctly when the test switch is moved to PWR TEST	304 050 00	30-41 TASK 801
• master caution and OVERHEAT lights do not operate correctly when the test switch is moved to OVHT	304 060 00	30-41 TASK 801
Window Heat Control		
• No BITE LED Indicators come ON		
- WHCU 1 (Win 1L / 2R)	304 031 41	30-41 TASK 806
- WHCU 2 (Win 1R / 2L)	304 031 42	30-41 TASK 806
WINDOW HEAT OVERHEAT light		
• light on		
- L FWD	304 010 41	30-41 TASK 801
- L SIDE	304 020 41	30-41 TASK 801
- R FWD	304 010 42	30-41 TASK 801
- R SIDE	304 020 42	30-41 TASK 801
WINDOW HEAT Power ON light		
• does not come on		
- L FWD	304 030 41	30-41 TASK 802
- L SIDE	304 040 41	30-41 TASK 809
- R FWD	304 030 42	30-41 TASK 802
- R SIDE	304 040 42	30-41 TASK 809

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Window, flight compartment		
• delaminated, cracked, chipped, crazed, scratched, or has bubbles		
- no. 1 left	561 010 41	56-11 TASK 802
- no. 1 right	561 010 42	56-11 TASK 802
- no. 2 left	561 020 41	56-11 TASK 802
- no. 2 right	561 020 42	56-11 TASK 802
- no. 3 left	561 030 41	56-11 TASK 802
- no. 3 right	561 030 42	56-11 TASK 802
- no. 4 left	561 040 41	56-11 TASK 803
- no. 4 right	561 040 42	56-11 TASK 803
- no. 5 left	561 050 41	56-11 TASK 804
- no. 5 right	561 050 42	56-11 TASK 804
• Sliding difficult to operate		
- no. 2 left	561 070 41	56-11 TASK 801
- no. 2 right	561 070 42	56-11 TASK 801
• Sliding has air leak		
- no. 2 left	561 080 41	56-11 TASK 801
- no. 2 right	561 080 42	56-11 TASK 801
• windows need cleaning	561 060 00	56-11 TASK 805
Windshield		
• Air outlet does not operate		
- captain's	212 010 31	21-22 TASK 801
- first officer's	212 010 32	21-22 TASK 801
Windshield wiper		
• does not operate in any switch position		
- left	304 200 41	30-42 TASK 801
- right	304 200 42	30-42 TASK 801
• does not operate in one switch position		
- left	304 210 41	30-42 TASK 802
- right	304 210 42	30-42 TASK 802
• does not park in the correct position		
- left	304 240 41	30-42 TASK 805
- right	304 240 42	30-42 TASK 805

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Windshield wiper (continued)		
• does not remove water correctly		
- left	304 260 41	30-42 TASK 807
- right	304 260 42	30-42 TASK 807
• does not stop		
- left	304 250 41	30-42 TASK 806
- right	304 250 42	30-42 TASK 806
• Speed is incorrect		
- left	304 220 41	30-42 TASK 804
- right	304 220 42	30-42 TASK 804
• Sweep is incorrect		
- left	304 230 41	30-42 TASK 803
- right	304 230 42	30-42 TASK 803
• uncommanded motion		
- left	304 262 41	30-42 TASK 808
- right	304 262 42	30-42 TASK 808
WING ANTI-ICE		
• does not come on	301 080 00	30-11 TASK 805
• Does not go bright during transition	301 015 41	30-11 TASK 804
• L VALVE OPEN Light is slow to go from Bright to Dim when the WING ANTI-ICE Switch is moved to ON	301 010 00	30-11 TASK 801
• L VALVE OPEN Light is slow to go from Bright to OFF when the WING ANTI-ICE Switch is moved to OFF	301 020 00	30-11 TASK 802
• R VALVE OPEN Light is slow to go from Bright to Dim when the WING ANTI-ICE Switch is moved to ON	301 050 00	30-11 TASK 801
• R VALVE OPEN Light is slow to go from Bright to OFF when the WING ANTI-ICE Switch is moved to OFF	301 060 00	30-11 TASK 802
• Stays ON bright	301 030 00	30-11 TASK 803
WING ANTI-ICE R VALVE OPEN light		
• does not come on	301 090 00	30-11 TASK 805
• Does not go bright during transition	301 015 42	30-11 TASK 804
• Stays ON bright	301 070 00	30-11 TASK 803

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
WING ANTI-ICE Switch		
• does not latch in the ON position with the engines not operating	301 100 00	30-11 TASK 806
• Unlatches when the engines are operating	301 110 00	30-11 TASK 807
Wing down aileron trim		
• does not operate		
- left	271 050 41	27-11 TASK 814
- left and right	271 050 48	27-11 TASK 815
- right	271 050 42	27-11 TASK 814
Wing illumination light		
• does not come on		
- left	334 010 41	33-40 TASK 801
- right	334 010 42	33-40 TASK 801
• Does not go off		
- left	334 020 41	33-40 TASK 801
- right	334 020 42	33-40 TASK 801
WING-BODY OVERHEAT light		
• light does not come on when OVHT/TEST switch is pushed		
- left	261 120 41	26-18 TASK 834
- left and right	261 120 48	26-18 TASK 834
- right	261 120 42	26-18 TASK 834
• light on	261 110 00	26-18 TASK 801
Wireless Quick Access Recorder		
• data does not transmit	313 121 00	31-31 TASK 809
WXR ATT message shows		
- captain's	344 030 31	34-43 TASK 806
- first officer's	344 030 32	34-43 TASK 806
WXR DSPY message shows		
- captain's	344 040 31	34-43 TASK 812
- first officer's	344 040 32	34-43 TASK 813

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
WXR FAIL message shows		
- captain's	344 050 31	34-43 TASK 801
- first officer's	344 050 32	34-43 TASK 801
WXR RANGE DISAGREE message shows		
- captain's	344 060 31	34-43 TASK 808
- first officer's	344 060 32	34-43 TASK 809
WXR STAB message shows		
- captain's	344 070 31	34-43 TASK 822
- first officer's	344 070 32	34-43 TASK 822
WXR WEAK message shows		
- captain's	344 080 31	34-43 TASK 802
- first officer's	344 080 32	34-43 TASK 802
Yaw damper		
• disengaged automatically, YAW DAMPER light came on	222 030 00	27-32 TASK 801
• operation not normal	222 020 00	27-32 TASK 801
YAW DAMPER light		
• Does not go off with YAW DAMPER switch at ON	222 010 00	27-32 TASK 801
ZONE TEMP light		
• light on, cannot reset		
- aft cabin	216 202 00	21-62 TASK 904
- control cabin	216 212 00	21-62 TASK 904
- forward cabin	216 222 00	21-62 TASK 904
• light on, comes on again after reset		
- aft cabin	216 203 00	21-62 TASK 903
- control cabin	216 213 00	21-62 TASK 903
- forward cabin	216 223 00	21-62 TASK 903
• light on, stays off after reset		
- aft cabin	216 201 00	21-62 TASK 903
- control cabin	216 211 00	21-62 TASK 903
- forward cabin	216 221 00	21-62 TASK 903
Zone Temperature Control		
• ZONE TEMP Light Comes ON	216 224 99	21-62 TASK 904

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
Zone Temperature Control (continued)		
• ZONE TEMP Light Comes ON unexpectedly during MASTER CAUTION Recall		
- AFT CAB	216 224 45	21-62 TASK 903
- CONT CAB	216 224 00	21-62 TASK 903
- FWD CAB	216 224 44	21-62 TASK 903
- FWD CAB and AFT CAB	216 224 48	21-62 TASK 903

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
05-5 TIME LIMITS/MAINTENANCE CHECKS - UNSCHEDULED MAINTENANCE CHECKS		
Airframe		
• Vibration or lateral oscillation is excessive	055 170 00	05-51 TASK 813
Birdstrike/FOD		
• on airframe/area unknown, engine parameters normal	055 130 00	05-51 TASK 804
Brakes		
• overheated during stop	055 621 00	Reference Not Currently Available
Dust Condition (Extreme)	055 613 00	05-51 TASK 802
Engine nacelle or strut dragged or damaged		
- engine 1	055 100 51	05-51 TASK 811
- engine 2	055 100 52	05-51 TASK 811
Engine seizure		
- engine 1	055 120 51	05-51 TASK 811
- engine 2	055 120 52	05-51 TASK 811
Hard landing or high drag/side load landing	055 040 00	05-51 TASK 806
Lightning Strike	055 611 00	05-51 TASK 801
Overspeed		
• With flaps/slats extended	055 090 00	05-51 TASK 810
• With landing gear down	055 080 00	05-51 TASK 809
Overweight landing	055 060 00	05-51 TASK 807
Tail dragged	055 110 00	05-51 TASK 812
Turbulence (severe), stall, buffet, or overspeed	055 070 00	05-51 TASK 808
Volcanic ash condition	055 050 00	05-51 TASK 803
21-0 AIR CONDITIONING - GENERAL		
Smoke		
• does not stop with recirculation fans OFF, isolation valve closed, and both pack switches at OFF		
- flight compartment	210 070 00	21-00 TASK 803
- flight compartment and passenger cabin	210 080 00	21-00 TASK 803
- passenger cabin	210 090 00	21-00 TASK 803

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
21-0 AIR CONDITIONING - GENERAL (continued)		
• Stops with recirculation fan(s) off, isolation valve closed, and right pack switch at off		
- flight compartment and passenger cabin	210 020 00	21-00 TASK 801
- passenger cabin	210 030 00	21-00 TASK 801
• Stops with recirculation fan(s) off, isolation valve closed, right pack switch in auto, and left pack switch off		
- flight compartment	210 040 00	21-00 TASK 802
- flight compartment and passenger cabin	210 050 00	21-00 TASK 802
- passenger cabin	210 060 00	21-00 TASK 802
Smoke or fumes in cabin		
• Source unknown	210 671 00	21-00 TASK 806
21-2 AIR CONDITIONING - DISTRIBUTION		
Conditioned Air Distribution		
• Low flow to the Flight Deck	212 201 00	21-22 TASK 802
EQUIP COOLING EXHAUST OFF light		
• light on with switch at ALTERNATE	212 080 00	21-27 TASK 805
• light on with switch at NORMAL	212 090 00	21-27 TASK 806
EQUIP COOLING SUPPLY OFF light		
• light on with switch at ALTERNATE	212 100 00	21-27 TASK 807
• light on with switch at NORMAL	212 110 00	21-27 TASK 808
Equipment Cooling Exhaust Fans Do Not Shut Off When Commanded During a Cargo Compartment Smoke Alert	212 120 00	21-27 TASK 811
Equipment Cooling Supply Fans Do Not Shut Off When Commanded During a Cargo Compartment Smoke Alert	212 115 00	21-27 TASK 810
Foot air outlet		
• does not operate		
- captain's	212 020 31	21-22 TASK 801
- first officer's	212 020 32	21-22 TASK 801
Main Deck Air Distribution System Shutoff Valves Do Not Operate	212 030 00	21-23 TASK 801
Recirculation fan (dual-fan system)		
• does not operate		
- left	212 040 41	21-25 TASK 802
- right	212 040 42	21-25 TASK 802

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
21-2 AIR CONDITIONING - DISTRIBUTION (continued)		
Recirculation fan (single-fan system)		
• does not operate	212 040 00	21-25 TASK 801
Smoke		
• Stops with recirculation fan(s) off		
- flight compartment	212 050 00	21-00 TASK 804
- flight compartment and passenger cabin	212 060 00	21-00 TASK 804
- passenger cabin	212 070 00	21-00 TASK 804
Windshield		
• Air outlet does not operate		
- captain's	212 010 31	21-22 TASK 801
- first officer's	212 010 32	21-22 TASK 801
21-3 AIR CONDITIONING - PRESSURIZATION		
AUTO FAIL light		
• light on and ALTN light on, AUTO FAIL light goes off when pressurization mode selector switch is at ALTN	213 010 00	21-31 TASK 801
• light on, ALTN light not on	213 020 00	21-31 TASK 801
CABIN ALT indication		
• fluctuates	213 040 00	21-31 TASK 801
Cabin altitude and differential pressure gauge		
• indicates high cabin pressure differential and low cabin altitude	213 121 00	21-33 TASK 803
Cabin altitude warning system		
• does not operate	213 060 00	21-33 TASK 801
CABIN CLIMB Indicator		
• does not operate, pointer does not move or fluctuates	213 080 00	21-33 TASK 802
FLT ALT display		
• indication blank	213 090 00	21-31 TASK 803
LAND ALT display		
• indication blank	213 100 00	21-31 TASK 803
Manual mode control of aft outflow valve		
• does not operate	213 030 00	21-31 TASK 811

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
21-3 AIR CONDITIONING - PRESSURIZATION (continued)		
MANUAL VALVE indicator		
• does not operate, pointer does not move or fluctuates . .	213 110 00	21-31 TASK 803
Pressurization		
• cannot keep the correct cabin pressure	213 050 00	21-31 TASK 801
21-5 AIR CONDITIONING - COOLING		
Fog, high humidity, or ice in cabin	215 010 00	21-51 TASK 801
Noise, pounding heard through air distribution system . .	215 015 00	21-51 TASK 802
Pack airflow/temperature diagnostics tool		
• Tool shows pack airflow is too low or too high	215 350 00	21-52 TASK 857
• Tool shows pack outlet temperature is too cold or too hot	215 351 00	21-52 TASK 856
PACK Light		
• comes ON During MASTER CAUTION Recall		
- L PACK	215 202 41	21-53 TASK 821
- R PACK	215 202 42	21-53 TASK 821
• is ON without MASTER CAUTION Recall		
- L PACK	215 201 41	21-53 TASK 820
- R PACK	215 201 42	21-53 TASK 820
PACK TRIP OFF light		
• light on at cruise, light comes on again after reset		
- left	215 030 41	21-52 TASK 830
- right	215 030 42	21-52 TASK 831
• light on at cruise, light stays off after reset		
- left	215 020 41	21-52 TASK 824
- right	215 020 42	21-52 TASK 825
• light on during approach, light comes on again after reset		
- left	215 060 41	21-52 TASK 832
- right	215 060 42	21-52 TASK 833
• light on during approach, light stays off after reset		
- left	215 050 41	21-52 TASK 822
- right	215 050 42	21-52 TASK 823

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
21-5 AIR CONDITIONING - COOLING (continued)		
• light on during climb, light comes on again after reset		
- left	215 090 41	21-52 TASK 834
- right	215 090 42	21-52 TASK 835
• light on during climb, light stays off after reset		
- left	215 080 41	21-52 TASK 820
- right	215 080 42	21-52 TASK 821
• light on on ground, light comes on again after reset		
- left	215 120 41	21-52 TASK 828
- right	215 120 42	21-52 TASK 829
• light on on ground, light stays off after reset		
- left	215 110 41	21-52 TASK 818
- right	215 110 42	21-52 TASK 819
• light on, cannot reset		
- left	215 040 41	21-52 TASK 816
- right	215 040 42	21-52 TASK 817
Packs, Divergent Pack Outlet Temperatures Noted Between Left and Right Packs	215 203 00	21-53 TASK 819
RAM DOOR FULL OPEN Light		
• light is not on, airplane on the ground	215 140 00	21-51 TASK 804
• light stays on, airplane in the air	215 160 00	21-51 TASK 803
Temperature indication problem		
- air temperature selector at PACK L	215 060 00	21-61 TASK 854
- air temperature selector at PACK R	215 070 00	21-61 TASK 855
21-6 AIR CONDITIONING - TEMPERATURE CONTROL		
Air mix valve indicator		
• does not operate, pointer does not move, temperature is OK		
- CONT CABIN	216 010 00	21-61 TASK 841
- PASS CABIN	216 020 00	21-61 TASK 841

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
21-6 AIR CONDITIONING - TEMPERATURE CONTROL (continued)		
AUTO temperature control		
• does not operate		
- AFT CAB	216 050 00	21-62 TASK 905
- CONT CAB	216 040 00	21-62 TASK 905
- FWD CAB	216 060 00	21-62 TASK 905
- PASS CABIN	216 070 00	21-61 TASK 862
• Too cold, no temperature control in AUTO		
- CONT CABIN	216 435 00	21-62 TASK 905
- PASS CABIN	216 405 00	21-62 TASK 905
DUCT OVERHEAT light		
• light on, cannot reset		
- CONT CABIN	216 100 00	21-61 TASK 837
- PASS CABIN	216 105 00	21-61 TASK 838
• light on, comes on again after reset		
- CONT CABIN	216 090 00	21-61 TASK 848
- PASS CABIN	216 095 00	21-61 TASK 849
• light on, stays off after reset		
- CONT CABIN	216 080 00	21-61 TASK 839
- PASS CABIN	216 085 00	21-61 TASK 840
Temperature		
• Too cold, cannot make warmer in AUTO and MANUAL mode, air mix valve does not move to HOT		
- CONT CABIN	216 460 00	21-61 TASK 845
- PASS CABIN	216 470 00	21-61 TASK 847
• Too cold, cannot make warmer in AUTO mode, OK in MANUAL mode		
- CONT CABIN	216 420 00	21-61 TASK 801
- PASS CABIN	216 430 00	21-61 TASK 801
• Too hot, cannot make cooler in AUTO and MANUAL mode, air mix valve does not move to COLD		
- CONT CABIN	216 440 00	21-61 TASK 844
- PASS CABIN	216 450 00	21-61 TASK 846

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
21-6 AIR CONDITIONING - TEMPERATURE CONTROL (continued)		
• Too hot, cannot make cooler in AUTO mode, OK in MANUAL mode		
- CONT CABIN	216 400 00	21-61 TASK 801
- PASS CABIN	216 410 00	21-61 TASK 801
Temperature control		
• Cabin temperatures are uncontrollable	216 510 00	21-62 TASK 905
• cannot cool cabins, all temperature selectors set to full COLD	216 612 00	21-62 TASK 849
Temperature indication problem		
- air temperature selector at AFT SUPPLY DUCT	216 170 00	21-61 TASK 860
- air temperature selector at AFT ZONE CABIN	216 120 00	21-61 TASK 857
- air temperature selector at CONT CAB SUPPLY DUCT	216 140 00	21-61 TASK 858
- air temperature selector at FWD SUPPLY DUCT	216 180 00	21-61 TASK 859
- air temperature selector at FWD ZONE CABIN	216 130 00	21-61 TASK 856
- air temperature selector at PASS CABIN	216 190 00	21-61 TASK 843
- air temperature selector at SUPPLY DUCT	216 160 00	21-61 TASK 842
Trim air valve does not operate	216 310 00	21-62 TASK 838
ZONE TEMP light		
• light on, cannot reset		
- aft cabin	216 202 00	21-62 TASK 904
- control cabin	216 212 00	21-62 TASK 904
- forward cabin	216 222 00	21-62 TASK 904
• light on, comes on again after reset		
- aft cabin	216 203 00	21-62 TASK 903
- control cabin	216 213 00	21-62 TASK 903
- forward cabin	216 223 00	21-62 TASK 903
• light on, stays off after reset		
- aft cabin	216 201 00	21-62 TASK 903
- control cabin	216 211 00	21-62 TASK 903
- forward cabin	216 221 00	21-62 TASK 903
Zone Temperature Control		
• ZONE TEMP Light Comes ON	216 224 99	21-62 TASK 904

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
21-6 AIR CONDITIONING - TEMPERATURE CONTROL (continued)		
• ZONE TEMP Light Comes ON unexpectedly during MASTER CAUTION Recall		
- AFT CAB	216 224 45	21-62 TASK 903
- CONT CAB	216 224 00	21-62 TASK 903
- FWD CAB	216 224 44	21-62 TASK 903
- FWD CAB and AFT CAB	216 224 48	21-62 TASK 903
21-7 AIR CONDITIONING - MOISTURE/AIR CONTAMINANT CONTROL		
Purge valve for air conditioning pack air supply cleaner		
• does not operate correctly during system test		
- left pack	217 821 41	21-75 TASK 801
- right pack	217 821 42	21-75 TASK 801
22-1 AUTOFLIGHT - AUTOPILOT/FLIGHT DIRECTOR		
Autoflight annunciator		
• FMC annunciator light stays on	221 015 00	22-11 TASK 858
Autopilot		
• A and B disengage automatically while in dual mode	221 140 00	22-11 TASK 801
• A/P amber warning annunciator light on flashing, autopilot went to CWS mode	221 020 00	22-11 TASK 801
• A/P red warning annunciator light on steady	221 010 00	22-11 TASK 801
• Airplane does not align correctly with runway during approach	221 960 00	22-11 TASK 825
• Airplane does not flare correctly during multi-channel approach, FLARE shows normal on the flight mode annunciator	221 750 00	22-11 TASK 801
• Airplane does not go to set altitude with V/S, LVL CHG, or VNAV pitch mode set		
- CMD A engaged	221 330 00	22-11 TASK 801
- CMD A or CMD B engaged	221 350 00	22-11 TASK 801
- CMD B engaged	221 340 00	22-11 TASK 801
• Airplane does not go to the set heading or keep the set heading with HDG SEL roll mode set		
- CMD A engaged	221 370 00	22-11 TASK 801
- CMD A or CMD B engaged	221 390 00	22-11 TASK 801
- CMD B engaged	221 380 00	22-11 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
22-1 AUTOFLIGHT - AUTOPILOT/FLIGHT DIRECTOR (continued)		
• Airplane does not go to the set vertical speed with V/S pitch mode set		
- CMD A engaged	221 520 00	22-11 TASK 801
- CMD A or CMD B engaged	221 540 00	22-11 TASK 801
- CMD B engaged	221 530 00	22-11 TASK 801
• Airplane does not keep the same altitude with ALT HLD pitch mode set		
- CMD A engaged	221 490 00	22-11 TASK 801
- CMD A or CMD B engaged	221 510 00	22-11 TASK 801
- CMD B engaged	221 500 00	22-11 TASK 801
• Airplane does not keep the set airspeed with MCP SPD (LVL CHG) pitch mode set		
- CMD A engaged	221 430 00	22-11 TASK 801
- CMD A or CMD B engaged	221 450 00	22-11 TASK 801
- CMD B engaged	221 440 00	22-11 TASK 801
• Airplane does not keep the set course with VOR roll mode set		
- CMD A engaged	221 460 00	22-11 TASK 801
- CMD A or CMD B engaged	221 480 00	22-11 TASK 801
- CMD B engaged	221 470 00	22-11 TASK 801
• Airplane does not keep the set heading		
- CWS A engaged	221 400 00	22-11 TASK 801
- CWS A or CWS B engaged	221 420 00	22-11 TASK 801
- CWS B engaged	221 410 00	22-11 TASK 801
• Airplane has pitch oscillation (porpoises) during multi-channel approach	221 310 00	22-16 TASK 801
• Airplane has pitch oscillation (porpoises) with any A/P engaged in CMD	221 320 00	22-16 TASK 801
• Airplane roll is not smooth (jerky) with any A/P engaged in CMD	221 760 00	22-11 TASK 801
• control columns move when the autopilot engages	221 940 00	22-16 TASK 802
• Control wheels move when the autopilot engages	221 950 00	22-16 TASK 803

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
22-1 AUTOFLIGHT - AUTOPILOT/FLIGHT DIRECTOR (continued)		
• disengages automatically		
- CMD A engaged	221 080 00	22-11 TASK 801
- CMD A or CMD B engaged	221 100 00	22-11 TASK 801
- CMD B engaged	221 090 00	22-11 TASK 801
- CWS A engaged	221 110 00	22-11 TASK 801
- CWS A or CWS B engaged	221 130 00	22-11 TASK 801
- CWS B engaged	221 120 00	22-11 TASK 801
• Does not disengage when CMD switch is pushed to off		
- CMD A engaged	221 570 00	22-11 TASK 803
- CMD A or CMD B engaged	221 590 00	22-11 TASK 803
- CMD B engaged	221 580 00	22-11 TASK 803
• Does not disengage when CWS switch is pushed to off		
- CWS A engaged	221 600 00	22-11 TASK 803
- CWS A or CWS B engaged	221 620 00	22-11 TASK 803
- CWS B engaged	221 610 00	22-11 TASK 803
• Does not disengage when disengage switch is pushed		
- captain's control column	221 550 31	22-13 TASK 809
- first officer's control column	221 550 32	22-13 TASK 809
- mode control panel	221 560 00	22-11 TASK 803
• Does not engage in dual mode, CMD A engages, CMD B does not engage, FLARE pitch mode does not show on the flight mode annunciator	221 690 00	22-17 TASK 807
• Does not engage in dual mode, CMD B engages, CMD A does not engage, FLARE pitch mode does not show on the flight mode annunciator	221 700 00	22-17 TASK 807
• does not engage when CMD switch is pushed during flight	221 625 00	22-11 TASK 856
• Does not engage when CMD switch is pushed, switch lights do not come on and CMD status does not show on the flight mode annunciator		
- CMD A	221 630 00	22-11 TASK 801
- CMD A or CMD B	221 650 00	22-11 TASK 801
- CMD B	221 640 00	22-11 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
22-1 AUTOFLIGHT - AUTOPILOT/FLIGHT DIRECTOR (continued)		
• Does not engage when CWS switch is pushed, switch lights do not come on, CWS P and CWS R status do not show on the flight mode annunciator		
- CWS A	221 660 00	22-11 TASK 801
- CWS A or CWS B	221 680 00	22-11 TASK 801
- CWS B	221 670 00	22-11 TASK 801
• does not keep pitch attitude		
- CWS A engaged	221 250 00	22-11 TASK 801
- CWS A or CWS B engaged	221 270 00	22-11 TASK 801
- CWS B engaged	221 260 00	22-11 TASK 801
• does not keep roll attitude		
- CWS A engaged	221 280 00	22-11 TASK 801
- CWS A or CWS B engaged	221 300 00	22-11 TASK 801
- CWS B engaged	221 290 00	22-11 TASK 801
• Flight Crew is unable to arm LNAV on the Ground before Takeoff	221 001 00	22-11 TASK 830
• Flight Crew is unable to arm VNAV on the Ground before Takeoff	221 102 00	22-11 TASK 831
• goes less than the normal bank angle with any A/P engaged in CMD	221 740 00	22-11 TASK 801
• goes more than the set bank angle limit in HDG SEL or VOR		
- CMD A engaged	221 710 00	22-11 TASK 801
- CMD A or CMD B engaged	221 730 00	22-11 TASK 801
- CMD B engaged	221 720 00	22-11 TASK 801
• NLND3 LCH shows in DFCS BITE FAULT HISTORY	221 203 00	22-17 TASK 807
• NO ALND LCH shows in DFCS BITE FAULT HISTORY	221 204 00	22-17 TASK 807
• NO AUTOLAND shows on the ENG 1 (ENG 2) Display	221 201 00	22-11 TASK 838
• NO LAND 3 shows on the engine display	221 202 00	22-11 TASK 855
• P MODE FAIL shows in DFCS BITE FAULT HISTORY	221 205 00	22-11 TASK 801
• pitch or roll mode does not engage or disengages automatically, autopilot went to CWS mode		
- CMD A engaged	221 220 00	22-11 TASK 801
- CMD A or CMD B engaged	221 240 00	22-11 TASK 801
- CMD B engaged	221 230 00	22-11 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
22-1 AUTOFLIGHT - AUTOPILOT/FLIGHT DIRECTOR (continued)		
• R MODE FAIL shows in DFCS BITE FAULT HISTORY . .	221 206 00	22-11 TASK 801
• SPDTRM LCH shows in DFCS BITE FAULT HISTORY .	221 207 00	22-17 TASK 807
• Status does not show on the flight mode annunciator, switch lights are on	221 180 00	22-11 TASK 801
• TO/GA pitch mode does not show on the flight mode annunciator for go-around when TO/GA switch is pushed and F/D on		
- captain's	221 200 31	22-11 TASK 801
- captain's and first officer's	221 200 48	22-11 TASK 801
- first officer's	221 200 32	22-11 TASK 801
Flight director		
• bars are biased out of view after TOGA button is pushed		
- captain's	221 165 31	22-11 TASK 829
- first officer's	221 165 32	22-11 TASK 829
• Display does not move correctly to guide the airplane to the set altitude		
- captain's	221 360 31	22-11 TASK 801
- captain's and first officer's	221 360 48	22-11 TASK 801
- first officer's	221 360 32	22-11 TASK 801
• does not operate, FD status does not show on the flight mode annunciator, autopilot not on		
- captain's	221 160 31	22-11 TASK 801
- captain's and first officer's	221 160 48	22-11 TASK 801
- first officer's	221 160 32	22-11 TASK 801
• FD flag shows on flight director display		
- captain's	221 170 31	22-11 TASK 801
- captain's and first officer's	221 170 48	22-11 TASK 801
- first officer's	221 170 32	22-11 TASK 801
• FD status does not show on the flight mode annunciator with F/D on		
- captain's	221 150 31	22-11 TASK 801
- captain's and first officer's	221 150 48	22-11 TASK 801
- first officer's	221 150 32	22-11 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
22-1 AUTOFLIGHT - AUTOPILOT/FLIGHT DIRECTOR (continued)		
• pitch or roll mode does not engage or disengages automatically, flight command display goes out of view		
- captain's	221 210 31	22-11 TASK 801
- captain's and first officer's	221 210 48	22-11 TASK 801
- first officer's	221 210 32	22-11 TASK 801
• TO/GA pitch mode does not show on the flight mode annunciator for takeoff when TO/GA switch is pushed and F/D on		
- captain's	221 190 31	22-11 TASK 801
- captain's and first officer's	221 190 48	22-11 TASK 801
- first officer's	221 190 32	22-11 TASK 801
MACH TRIM FAIL light		
• light on	221 030 00	22-11 TASK 860
• light on when MASTER CAUTION switch is pushed	221 040 00	22-11 TASK 801
Mode Control Panel		
• ALTITUDE window display does not change with altitude selector switch change	221 770 00	22-11 TASK 803
• ALTITUDE window display does not show	221 780 00	22-11 TASK 803
• ALTITUDE window problem		
- stays at 50000	221 775 00	22-11 TASK 853
• COURSE window display does not change with course selector switch change		
- captain's	221 790 31	22-11 TASK 803
- first officer's	221 790 32	22-11 TASK 803
• COURSE window display does not show		
- captain's	221 800 31	22-11 TASK 803
- first officer's	221 800 32	22-11 TASK 803
• HEADING window display does not change with heading selector switch change	221 810 00	22-11 TASK 803
• HEADING window display does not show	221 820 00	22-11 TASK 803
• IAS/MACH window display does not change with selector switch change	221 890 00	22-11 TASK 803
• IAS/MACH window display does not show	221 900 00	22-11 TASK 803
• lower switch light does not come on for all mode switches	221 860 00	22-11 TASK 803

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
22-1 AUTOFLIGHT - AUTOPILOT/FLIGHT DIRECTOR (continued)		
• one of the switch lights does not come on for one mode switch	221 870 00	22-11 TASK 803
• upper switch light does not come on for all mode switches	221 880 00	22-11 TASK 803
• VERT SPEED window display does not change with vertical speed selector change	221 830 00	22-11 TASK 803
• VERT SPEED window display does not show	221 840 00	22-11 TASK 803
SPEED TRIM FAIL light		
• comes ON when MASTER CAUTION Recall switch is pushed	221 060 00	22-11 TASK 850
• light on	221 050 00	22-11 TASK 849
STAB OUT OF TRIM light		
• light on	221 070 00	22-11 TASK 851
Stabilizer runaway while the autopilot is engaged	221 935 00	22-11 TASK 839
22-2 AUTOFLIGHT - SPEED - ATTITUDE CORRECTION		
Yaw damper		
• disengaged automatically, YAW DAMPER light came on	222 030 00	27-32 TASK 801
• operation not normal	222 020 00	27-32 TASK 801
YAW DAMPER light		
• Does not go off with YAW DAMPER switch at ON	222 010 00	27-32 TASK 801
22-3 AUTOFLIGHT - AUTOTHROTTLE		
A/T LIMIT indication shows on autothrottle thrust mode display	223 220 00	22-32 TASK 815
Autothrottle		
• A/T amber warning annunciator light on flashing	223 120 00	22-32 TASK 801
• disengages automatically	223 130 00	22-32 TASK 806
• does not arm, ARM light does not come on, ARM does not show on the flight mode annunciator	223 170 00	22-32 TASK 810
• does not automatically disengage after touchdown	223 110 00	22-32 TASK 806
• Does not disengage when disengage switch is pushed		
- engine 1 thrust lever	223 140 51	22-32 TASK 805
- engine 2 thrust lever	223 140 52	22-32 TASK 805
• Does not disengage when thrust levers are split	223 190 00	22-32 TASK 811

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
22-3 AUTOFLIGHT - AUTOTHROTTLE (continued)		
• Does not go to full rated N1 when TO/GA switch is pushed a second time during go-around		
- engine 1	223 070 51	22-32 TASK 804
- engine 1 and engine 2	223 070 48	22-32 TASK 804
- engine 2	223 070 52	22-32 TASK 804
• Does not go to reduced N1 when TO/GA switch is pushed one time during go-around		
- engine 1	223 080 51	22-32 TASK 804
- engine 1 and engine 2	223 080 48	22-32 TASK 804
- engine 2	223 080 52	22-32 TASK 804
• does not keep N1 limit in N1 mode		
- engine 1	223 020 51	22-32 TASK 801
- engine 1 and engine 2	223 020 48	22-32 TASK 801
- engine 2	223 020 52	22-32 TASK 801
• does not keep set speed in SPEED mode		
- engine 1	223 030 51	22-32 TASK 801
- engine 1 and engine 2	223 030 48	22-32 TASK 801
- engine 2	223 030 52	22-32 TASK 801
• engine N1 speed fluctuates, engine N1 speed is normal with autothrottle OFF		
- engine 1	223 040 51	22-32 TASK 801
- engine 1 and engine 2	223 040 48	22-32 TASK 801
- engine 2	223 040 52	22-32 TASK 801
• mode does not change when mode switch is pushed	223 200 00	22-32 TASK 809
• overcontrols with A/T mode engaged	223 150 00	22-32 TASK 808
• selected target speed bug problem on the mach airspeed indicator		
- captain's	223 010 31	22-32 TASK 803
- first officer's	223 010 32	22-32 TASK 803
• Status does not show on Flight Mode Annunciator (FMA)	223 050 00	22-32 TASK 807
• Status mode does not change automatically	223 090 00	22-32 TASK 807
• throttle resolver angle indication is blank during BITE interactive range check	223 210 00	22-32 TASK 813

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
22-3 AUTOFLIGHT - AUTOTHROTTLE (continued)		
• Thrust lever does not move back in RETARD mode		
- engine 1	223 100 51	22-32 TASK 802
- engine 1 and engine 2	223 100 48	22-32 TASK 802
- engine 2	223 100 52	22-32 TASK 802
• Thrust lever does not move forward when TO/GA switch is pushed		
- engine 1	223 060 51	22-32 TASK 804
- engine 1 and engine 2	223 060 48	22-32 TASK 804
- engine 2	223 060 52	22-32 TASK 804
• Thrust lever problem		
- engine 1	223 160 51	22-32 TASK 808
- engine 1 and engine 2	223 160 48	22-32 TASK 808
- engine 2	223 160 52	22-32 TASK 808
• thrust levers are split, OK with autothrottle disengaged	223 180 00	22-32 TASK 811
23-1 COMMUNICATIONS - SPEECH COMMUNICATIONS		
HF 1 control panel problem	231 010 00	23-11 TASK 805
HF 1 radio		
• reception and transmission problem at all stations	231 060 48	23-11 TASK 806
• reception and transmission problem at one station		
- captain's	231 060 31	23-11 TASK 806
- first observer's	231 060 33	23-11 TASK 806
- first officer's	231 060 32	23-11 TASK 806
• reception problem at all stations	231 070 48	23-11 TASK 806
• reception problem at one station		
- captain's	231 070 31	23-11 TASK 806
- first observer's	231 070 33	23-11 TASK 806
- first officer's	231 070 32	23-11 TASK 806
• Transmission problem at all stations	231 080 48	23-11 TASK 806
• Transmission problem at one station		
- captain's	231 080 31	23-11 TASK 806
- first observer's	231 080 33	23-11 TASK 806
- first officer's	231 080 32	23-11 TASK 806
HF 2 control panel problem	231 020 00	23-11 TASK 805

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
23-1 COMMUNICATIONS - SPEECH COMMUNICATIONS (continued)		
HF 2 radio		
• reception and transmission problem at all stations	231 180 48	23-11 TASK 806
• reception and transmission problem at one station		
- captain's	231 180 31	23-11 TASK 806
- first observer's	231 180 33	23-11 TASK 806
- first officer's	231 180 32	23-11 TASK 806
• reception problem at all stations	231 190 48	23-11 TASK 806
• reception problem at one station		
- captain's	231 190 31	23-11 TASK 806
- first observer's	231 190 33	23-11 TASK 806
- first officer's	231 190 32	23-11 TASK 806
• Transmission problem at all stations	231 200 48	23-11 TASK 806
• Transmission problem at one station		
- captain's	231 200 31	23-11 TASK 806
- first observer's	231 200 33	23-11 TASK 806
- first officer's	231 200 32	23-11 TASK 806
Radio tuning panel problem		
- captain's	231 300 31	23-12 TASK 815
- first observer's	231 300 33	23-12 TASK 815
- first officer's	231 300 32	23-12 TASK 815
VHF 1 control panel problem	231 030 00	23-12 TASK 814
VHF 1 radio		
• reception and transmission problem at all stations	231 310 48	23-12 TASK 816
• reception and transmission problem at one station		
- captain's	231 310 31	23-12 TASK 816
- first observer's	231 310 33	23-12 TASK 816
- first officer's	231 310 32	23-12 TASK 816
• reception problem at all stations	231 320 48	23-12 TASK 816
• reception problem at one station		
- captain's	231 320 31	23-12 TASK 816
- first observer's	231 320 33	23-12 TASK 816
- first officer's	231 320 32	23-12 TASK 816
• Transmission problem at all stations	231 330 48	23-12 TASK 816

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
23-1 COMMUNICATIONS - SPEECH COMMUNICATIONS (continued)		
• Transmission problem at one station		
- captain's	231 330 31	23-12 TASK 816
- first observer's	231 330 33	23-12 TASK 816
- first officer's	231 330 32	23-12 TASK 816
VHF 2 control panel problem	231 040 00	23-12 TASK 814
VHF 2 radio		
• reception and transmission problem at all stations	231 430 48	23-12 TASK 816
• reception and transmission problem at one station		
- captain's	231 430 31	23-12 TASK 816
- first observer's	231 430 33	23-12 TASK 816
- first officer's	231 430 32	23-12 TASK 816
• reception problem at all stations	231 440 48	23-12 TASK 816
• reception problem at one station		
- captain's	231 440 31	23-12 TASK 816
- first observer's	231 440 33	23-12 TASK 816
- first officer's	231 440 32	23-12 TASK 816
• Transmission problem at all stations	231 450 48	23-12 TASK 816
• Transmission problem at one station		
- captain's	231 450 31	23-12 TASK 816
- first observer's	231 450 33	23-12 TASK 816
- first officer's	231 450 32	23-12 TASK 816
VHF 3 control panel problem	231 050 00	23-12 TASK 814
VHF 3 radio		
• reception and transmission problem at all stations	231 550 48	23-12 TASK 816
• reception and transmission problem at one station		
- captain's	231 550 31	23-12 TASK 816
- first observer's	231 550 33	23-12 TASK 816
- first officer's	231 550 32	23-12 TASK 816
• reception problem at all stations	231 560 48	23-12 TASK 816
• reception problem at one station		
- captain's	231 560 31	23-12 TASK 816
- first observer's	231 560 33	23-12 TASK 816
- first officer's	231 560 32	23-12 TASK 816

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
23-1 COMMUNICATIONS - SPEECH COMMUNICATIONS (continued)		
• Transmission problem at all stations	231 570 48	23-12 TASK 816
• Transmission problem at one station		
- captain's	231 570 31	23-12 TASK 816
- first observer's	231 570 33	23-12 TASK 816
- first officer's	231 570 32	23-12 TASK 816
23-2 COMMUNICATIONS - DATA TRANSMISSION AND AUTOMATIC CALLING		
ACARS		
• call annunciation problem	232 328 00	23-27 TASK 818
• CDU interface problem	232 326 00	23-27 TASK 815
• CDU scratchpad shows APM WARN	232 315 00	23-27 TASK 825
• CMU cannot print data to the Multi-function Printer	232 719 00	23-27 TASK 812
• communication problem	232 325 00	23-27 TASK 814
• does not operate correctly	232 310 00	23-27 TASK 801
• input problem	232 327 00	23-27 TASK 816
• MU cannot print data to the Multi-function Printer	232 720 00	23-27 TASK 812
Emergency Locator Transmitter (ELT)		
• ELT light is on	232 411 00	23-24 TASK 807
• no ELT signal on VHF when ELT switch set to ON during test	232 410 00	23-24 TASK 801
• Self Test Fails	232 401 00	23-24 TASK 801
SELCAL		
• all call lights on	232 260 00	23-28 TASK 805
• call light does not come on for calls on HF 1	232 080 00	23-28 TASK 802
• call light does not come on for calls on HF 2	232 090 00	23-28 TASK 802
• call light does not come on for calls on VHF 1	232 100 00	23-28 TASK 802
• call light does not come on for calls on VHF 2	232 110 00	23-28 TASK 802
• call light does not come on for calls on VHF 3	232 120 00	23-28 TASK 802
• Call switch does not reset for HF 1, PTT reset OK	232 020 00	23-28 TASK 801
• Call switch does not reset for HF 2, PTT reset OK	232 030 00	23-28 TASK 801
• Call switch does not reset for VHF 1, PTT reset OK	232 040 00	23-28 TASK 801
• Call switch does not reset for VHF 2, PTT reset OK	232 050 00	23-28 TASK 801
• Call switch does not reset for VHF 3, PTT reset OK	232 060 00	23-28 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
23-2 COMMUNICATIONS - DATA TRANSMISSION AND AUTOMATIC CALLING (continued)		
• Chime does not operate for calls on HF 1, SELCAL call light comes on	232 140 00	23-28 TASK 803
• Chime does not operate for calls on HF 2, SELCAL call light comes on	232 150 00	23-28 TASK 803
• Chime does not operate for calls on VHF 1, SELCAL call light comes on	232 160 00	23-28 TASK 803
• Chime does not operate for calls on VHF 2, SELCAL call light comes on	232 170 00	23-28 TASK 803
• Chime does not operate for calls on VHF 3, SELCAL call light comes on	232 180 00	23-28 TASK 803
• does not operate for any radio	232 250 00	23-28 TASK 804
• does not operate for HF 1	232 200 00	23-28 TASK 804
• does not operate for HF 2	232 210 00	23-28 TASK 804
• does not operate for VHF 1	232 220 00	23-28 TASK 804
• does not operate for VHF 2	232 230 00	23-28 TASK 804
• does not operate for VHF 3	232 240 00	23-28 TASK 804
23-3 COMMUNICATIONS - PASSENGER ADDRESS AND ENTERTAINMENT		
Passenger address system		
- distorted from flight compartment	233 020 00	23-31 TASK 801
- does not operate from flight compartment	233 010 00	23-31 TASK 801
- intermittent from flight compartment	233 030 00	23-31 TASK 801
- volume problem from flight compartment	233 040 00	23-31 TASK 802
23-4 COMMUNICATIONS - INTERPHONE		
Attendant control panel		
• amber light on ACP switch assembly does not come on during operational test	234 811 00	23-42 TASK 841
Call horn		
• does not sound	234 340 00	23-43 TASK 801
• operates continuously	234 350 00	23-43 TASK 802
Call system		
• attendant call chime does not operate in passenger cabin	234 395 00	23-42 TASK 803
• call light does not come on, attendant to flight compartment	234 380 00	23-42 TASK 806

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
23-4 COMMUNICATIONS - INTERPHONE (continued)		
• call light does not come on, ground crew to flight compartment	234 370 00	23-43 TASK 804
• Chime does not sound in the flight compartment	234 390 00	23-42 TASK 804
• does not operate, attendant to flight compartment	234 371 00	23-42 TASK 805
• does not operate, flight compartment to attendant	234 400 00	23-42 TASK 802
• does not operate, ground crew to flight compartment	234 360 00	23-43 TASK 803
Service interphone		
• distorted		
- all jacks	234 030 48	23-41 TASK 803
- jack adjacent to APU	234 120 00	23-41 TASK 802
- jack at aft entry light panel	234 150 00	23-41 TASK 802
- jack at EE rack	234 070 00	23-41 TASK 802
- jack at external power receptacle panel	234 190 00	23-41 TASK 802
- jack at left wheel well	234 230 00	23-41 TASK 802
- jack at right wheel well	234 270 00	23-41 TASK 802
- jack at right wing refueling slat	234 310 00	23-41 TASK 802
- jack in the electronic equipment bay	234 430 00	23-41 TASK 802
• does not connect to flight interphone	234 010 00	23-41 TASK 801
• does not operate		
- all jacks	234 020 48	23-41 TASK 801
- jack adjacent to APU	234 100 00	23-41 TASK 802
- jack at aft entry light panel	234 140 00	23-41 TASK 802
- jack at EE rack	234 060 00	23-41 TASK 802
- jack at external power receptacle panel	234 180 00	23-41 TASK 802
- jack at left wheel well	234 220 00	23-41 TASK 802
- jack at right wheel well	234 260 00	23-41 TASK 802
- jack at right wing refueling slat	234 300 00	23-41 TASK 802
- jack in the electronic equipment bay	234 410 00	23-41 TASK 802

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
23-4 COMMUNICATIONS - INTERPHONE (continued)		
• intermittent		
- all jacks	234 040 48	23-41 TASK 803
- jack adjacent to APU	234 110 00	23-41 TASK 802
- jack at aft entry light panel	234 160 00	23-41 TASK 802
- jack at EE rack	234 080 00	23-41 TASK 802
- jack at external power receptacle panel	234 200 00	23-41 TASK 802
- jack at left wheel well	234 240 00	23-41 TASK 802
- jack at right wheel well	234 280 00	23-41 TASK 802
- jack at right wing refueling slat	234 320 00	23-41 TASK 802
- jack in the electronic equipment bay	234 420 00	23-41 TASK 802
• volume problem		
- all jacks	234 050 48	23-41 TASK 803
- jack adjacent to APU	234 130 00	23-41 TASK 802
- jack at aft entry light panel	234 170 00	23-41 TASK 802
- jack at EE rack	234 090 00	23-41 TASK 802
- jack at external power receptacle panel	234 210 00	23-41 TASK 802
- jack at left wheel well	234 250 00	23-41 TASK 802
- jack at right wheel well	234 290 00	23-41 TASK 802
- jack at right wing refueling slat	234 330 00	23-41 TASK 802
- jack in the electronic equipment bay	234 440 00	23-41 TASK 802
23-5 COMMUNICATIONS - AUDIO INTEGRATION		
Audio control panel indicator light problem		
- captain's	235 101 31	23-51 TASK 807
- first observer's	235 101 33	23-51 TASK 807
- first officer's	235 101 32	23-51 TASK 807
Audio control panel selector switch problem		
- captain's	235 103 31	23-51 TASK 807
- first observer's	235 103 33	23-51 TASK 807
- first officer's	235 103 32	23-51 TASK 807
Audio control panel volume control problem		
- captain's	235 102 31	23-51 TASK 807
- first observer's	235 102 33	23-51 TASK 807
- first officer's	235 102 32	23-51 TASK 807

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
23-5 COMMUNICATIONS - AUDIO INTEGRATION (continued)		
Boom microphone/headset		
• damaged		
- captain's	235 020 31	23-51 TASK 802
- first officer's	235 020 32	23-51 TASK 802
• does not operate		
- captain's	235 010 31	23-51 TASK 801
- first officer's	235 010 32	23-51 TASK 801
Flight interphone		
• does not operate		
- all stations	235 030 48	23-51 TASK 803
- captain's	235 030 31	23-51 TASK 804
- first observer's	235 030 33	23-51 TASK 804
- first officer's	235 030 32	23-51 TASK 804
Hand microphone		
• damaged		
- captain's	235 060 31	23-51 TASK 802
- first observer's	235 060 33	23-51 TASK 802
- first officer's	235 060 32	23-51 TASK 802
• does not operate		
- captain's	235 050 31	23-51 TASK 801
- first observer's	235 050 33	23-51 TASK 801
- first officer's	235 050 32	23-51 TASK 801
Headphone		
• damaged		
- captain's	235 070 31	23-51 TASK 802
- first observer's	235 070 33	23-51 TASK 802
- first officer's	235 070 32	23-51 TASK 802
- second observer's	235 070 34	23-51 TASK 802
• does not operate		
- captain's	235 040 31	23-51 TASK 801
- first observer's	235 040 33	23-51 TASK 801
- first officer's	235 040 32	23-51 TASK 801
- second observer's	235 040 34	23-51 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
23-5 COMMUNICATIONS - AUDIO INTEGRATION (continued)		
Oxygen mask		
• communication problem		
- captain's	235 071 31	23-51 TASK 808
- first observer's	235 071 33	23-51 TASK 808
- first officer's	235 071 32	23-51 TASK 808
Speaker in the flight compartment		
• does not operate		
- captain's	235 080 31	23-51 TASK 805
- first officer's	235 080 32	23-51 TASK 806
23-7 COMMUNICATIONS - AUDIO AND VIDEO MONITORING		
Video Surveillance System		
• Distorted video from one camera	237 510 00	23-75 TASK 808
• no video at all three cameras	237 503 00	23-75 TASK 809
• no video for one camera		
- CAM 1	237 501 01	23-75 TASK 807
- CAM 2	237 501 02	23-75 TASK 807
- CAM 3	237 501 03	23-75 TASK 807
Voice recorder		
• RIPS maintenance discrete check fails	237 015 00	23-71 TASK 806
• Signal problem at monitor jack	237 010 00	23-71 TASK 801
• STATUS light or TEST light does not come on when TEST switch is pushed	237 020 00	23-71 TASK 804
• system operation problem (airplanes with AUTO/ON switch)	237 050 00	23-71 TASK 805
23-8 COMMUNICATIONS - INTEGRATED AUTOMATIC TUNING		
Flight Compartment		
• Outlet Unit Does Not Operate	238 302 00	23-82 TASK 802
• Outlet Unit Has No Power or USB Problems	238 303 00	23-82 TASK 803
24-1 ELECTRICAL POWER - GENERATOR DRIVE		
AC Generator Drive System		
• DRIVE Light is illuminated		
- GEN-1	241 010 01	24-11 TASK 801
- GEN-2	241 010 02	24-11 TASK 802

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
24-1 ELECTRICAL POWER - GENERATOR DRIVE (continued)		
• DRIVE Light is not illuminated		
- GEN-1	241 012 01	24-11 TASK 804
- GEN-2	241 012 02	24-11 TASK 805
• Red DPI Button is extended		
- GEN-1	241 011 01	24-11 TASK 803
- GEN-2	241 011 02	24-11 TASK 803
24-2 ELECTRICAL POWER - AC GENERATION		
APU GEN OFF BUS light		
• light on with APU generator on line	242 050 00	24-21 TASK 801
APU generator will not come on line	242 045 00	24-21 TASK 820
Generator SOURCE OFF light		
• light comes on and the transfer bus is not energized from the selected power source	242 080 00	24-21 TASK 823
• light comes on but no fault light on GCU is on		
- GEN 1 SOURCE OFF light	242 080 01	24-21 TASK 821
- GEN 2 SOURCE OFF light	242 080 02	24-21 TASK 821
IDG comes on line after 20 seconds	242 085 00	24-21 TASK 824
IDG differential pressure indicator		
• extended		
- left	242 121 41	24-11 TASK 803
- right	242 121 42	24-11 TASK 803
SOURCE OFF and GEN OFF BUS lights		
• lights on with IDG 1 and IDG 2 on line		
- no. 1	242 040 01	24-21 TASK 801
- no. 2	242 040 02	24-21 TASK 801
TRANSFER BUS OFF and SOURCE OFF lights		
• lights on with the APU generator on line		
- no. 1	242 060 01	24-21 TASK 801
- no. 2	242 060 02	24-21 TASK 801
TRANSFER BUS OFF light		
• comes on	242 075 00	24-21 TASK 822

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
24-2 ELECTRICAL POWER - AC GENERATION (continued)		
• flickers with IDG on line		
- generator 1	242 070 01	24-21 TASK 818
- generator 2	242 070 02	24-21 TASK 819
24-3 ELECTRICAL POWER - DC GENERATION		
AC and DC metering panel		
• has missing segments	243 030 00	24-31 TASK 827
Battery charger		
• CHARGER light flashes		
- auxiliary battery charger	243 132 00	24-31 TASK 835
- main battery charger	243 131 00	24-31 TASK 834
BATTERY DISCHARGE light		
• comes on during flight	243 121 00	24-31 TASK 833
ELEC light		
• light on	243 050 00	24-31 TASK 801
STANDBY PWR OFF light		
• light on with AC power supplied and STANDBY POWER switch at AUTO or BAT	243 010 00	24-34 TASK 803
• light on with BAT switch at ON and STANDBY POWER switch at AUTO or BAT	243 020 00	24-34 TASK 803
TR UNIT light		
• light on	243 040 00	24-31 TASK 826
24-4 ELECTRICAL POWER - EXTERNAL POWER		
TRANSFER BUS OFF and SOURCE OFF lights		
• lights on with GRD PWR switch at ON		
- no. 1	244 010 01	24-41 TASK 801
- no. 1 and no. 2	244 010 48	24-41 TASK 801
- no. 2	244 010 02	24-41 TASK 801
25-1 EQUIPMENT/FURNISHINGS - FLIGHT COMPARTMENT		
Assist handle problem		
- captain's	251 100 31	25-99 TASK 801
- first officer's	251 100 32	25-99 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
25-1 EQUIPMENT/FURNISHINGS - FLIGHT COMPARTMENT (continued)		
Chart holder, sidewall problem		
- captain's	251 130 31	25-99 TASK 801
- first officer's	251 130 32	25-99 TASK 801
Cup holder problem		
- captain's	251 140 31	25-99 TASK 801
- first officer's	251 140 32	25-99 TASK 801
- observer's	251 140 33	25-99 TASK 801
Seat		
• horizontal adjustment problem		
- captain's	251 020 31	25-99 TASK 801
- first officer's	251 020 32	25-99 TASK 801
• lumbar adjustment problem		
- captain's	251 030 31	25-99 TASK 801
- first officer's	251 030 32	25-99 TASK 801
• recline adjustment problem		
- captain's	251 040 31	25-99 TASK 801
- first officer's	251 040 32	25-99 TASK 801
• vertical adjustment problem		
- captain's	251 050 31	25-99 TASK 801
- first officer's	251 050 32	25-99 TASK 801
Seat arm rest problem		
- captain's	251 060 31	25-99 TASK 801
- first officer's	251 060 32	25-99 TASK 801
Seat belt problem		
- captain's	251 070 31	25-99 TASK 801
- first observer's	251 070 33	25-99 TASK 801
- first officer's	251 070 32	25-99 TASK 801
- second observer's	251 070 34	25-99 TASK 801
Seat track		
• does not move freely		
- captain's	251 080 31	25-99 TASK 801
- first officer's	251 080 32	25-99 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
25-1 EQUIPMENT/FURNISHINGS - FLIGHT COMPARTMENT (continued)		
Shoulder harness		
• Does not extend or retract		
- captain's	251 090 31	25-99 TASK 801
- first observer's	251 090 33	25-99 TASK 801
- first officer's	251 090 32	25-99 TASK 801
Spare bulb kit		
• needs replenishing	251 110 00	25-99 TASK 801
Sun visor problem		
- captain's	251 120 31	25-99 TASK 801
- first officer's	251 120 32	25-99 TASK 801
25-2 EQUIPMENT/FURNISHINGS - PASSENGER COMPARTMENT		
Passenger Compartments		
• Overhead Stowage Bin does not close correctly	252 401 00	25-24 TASK 801
• Overhead Stowage Bin does not open correctly	252 402 00	25-24 TASK 801
• Overhead Stowage Bin is out of adjustment	252 403 00	25-24 TASK 801
25-6 EQUIPMENT/FURNISHINGS - EMERGENCY		
Circuit breaker collars (spare)		
• missing	256 201 00	25-99 TASK 801
Crash ax		
• missing	256 020 00	25-99 TASK 801
Escape rope (lanyard)		
• damaged		
- captain's	256 130 31	25-61 TASK 802
- first officer's	256 130 32	25-61 TASK 802
• unstowed		
- captain's	256 140 31	25-61 TASK 803
- first officer's	256 140 32	25-61 TASK 803
Escape rope (lanyard) compartment cover		
• will not close		
- captain's	256 120 31	25-61 TASK 801
- first officer's	256 120 32	25-61 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
25-6 EQUIPMENT/FURNISHINGS - EMERGENCY (continued)		
Fireproof gloves		
• damaged	256 015 00	25-99 TASK 801
• missing	256 010 00	25-99 TASK 801
Flashlight		
• Battery low	256 070 00	25-99 TASK 801
• damaged	256 080 00	25-99 TASK 801
• does not come on	256 090 00	25-99 TASK 801
• Does not go off	256 091 00	25-99 TASK 801
• missing	256 100 00	25-99 TASK 801
Flashlight LED		
• does not come on	256 110 00	25-99 TASK 801
Life vest		
• missing/damaged		
- captain's	256 050 31	25-99 TASK 801
- first observer's	256 050 33	25-99 TASK 801
- first officer's	256 050 32	25-99 TASK 801
- second observer's	256 050 34	25-99 TASK 801
Smoke goggles		
• missing		
- captain's	256 060 31	25-99 TASK 801
- first officer's	256 060 32	25-99 TASK 801
26-1 FIRE PROTECTION - FIRE/OVERHEAT DETECTION		
APU		
• fire false alarm	261 060 00	26-10 TASK 801
APU DET INOP light		
• light on	261 050 00	26-10 TASK 801
Cargo fire detection		
• AFT cargo fire light on (false alarm)	261 225 45	26-16 TASK 801
• FWD cargo fire light on (false alarm)	261 225 44	26-16 TASK 801
• MAIN cargo fire light on (false alarm)	261 225 00	26-16 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
26-1 FIRE PROTECTION - FIRE/OVERHEAT DETECTION (continued)		
Cargo fire test		
• DETECTOR FAULT light stays ON after TEST switch is pushed	261 075 00	26-16 TASK 802
• Test failed, AFT cargo fire light does not come on, DETECTOR FAULT light comes on		
- DET SELECT switch at A	261 205 45	26-16 TASK 804
- DET SELECT switch at B	261 210 45	26-16 TASK 804
- DET SELECT switch at NORM	261 215 45	26-16 TASK 804
• Test failed, AFT cargo fire light does not come on, DETECTOR FAULT light is off	261 200 45	26-16 TASK 806
• Test failed, FWD cargo fire light does not come on, DETECTOR FAULT light comes on		
- DET SELECT switch at A	261 205 44	26-16 TASK 804
- DET SELECT switch at B	261 210 44	26-16 TASK 804
- DET SELECT switch at NORM	261 215 44	26-16 TASK 804
• Test failed, FWD cargo fire light does not come on, DETECTOR FAULT light is off	261 200 44	26-16 TASK 806
• Test failed, warning lights and alarm do not operate	261 220 00	26-16 TASK 807
ENG 1 OVERHEAT light		
• light is on	261 011 51	26-10 TASK 811
ENG 2 OVERHEAT light		
• light is on	261 011 52	26-10 TASK 811
Engine fire light		
• light is on		
- engine 1	261 021 51	26-10 TASK 811
- engine 2	261 021 52	26-10 TASK 811
FAULT light for the fire detection system on (P8 control stand)		
- engine 1	261 040 51	26-10 TASK 801
- engine 2	261 040 52	26-10 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
26-1 FIRE PROTECTION - FIRE/OVERHEAT DETECTION (continued)		
OVHT/FIRE TEST		
• Test failed, warning lights and alarm do not operate		
- APU	261 070 00	26-10 TASK 801
- engine 1	261 030 51	26-10 TASK 801
- engine 2	261 030 52	26-10 TASK 801
- wheel well	261 100 00	26-18 TASK 833
Smoke Detector		
• does not turn off	261 541 00	26-14 TASK 801
Smoke Detector in Lavatory		
• Red light flashes	261 641 00	26-14 TASK 802
WHEEL WELL light		
• light on	261 090 00	26-18 TASK 801
WING-BODY OVERHEAT light		
• light does not come on when OVHT/TEST switch is pushed		
- left	261 120 41	26-18 TASK 834
- left and right	261 120 48	26-18 TASK 834
- right	261 120 42	26-18 TASK 834
• light on	261 110 00	26-18 TASK 801
26-2 FIRE PROTECTION - EXTINGUISHING		
APU BOTTLE DISCHARGED light for the APU fire extinguishing system		
• light on	262 070 00	26-20 TASK 802
APU fire extinguishing		
• APU light on fire control panel comes on when not commanded	262 221 00	26-20 TASK 806
• Bottle does not release extinguishant when activated at the remote APU fire control panel	262 130 00	26-20 TASK 804
• Bottle does not release extinguishant when the fire handle is turned	262 120 00	26-20 TASK 803
• indication not normal when the EXT TEST switch is moved to 1 or 2	262 080 00	26-20 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
26-2 FIRE PROTECTION - EXTINGUISHING (continued)		
Cargo fire extinguishing		
• Bottle does not release extinguishant when DISCH switch is pushed	262 200 00	26-23 TASK 803
• DISCH light on, DISCH switch not pushed	262 205 00	26-23 TASK 802
Cargo fire test		
• Test failed, EXT AFT light does not come on	262 210 45	26-23 TASK 812
• Test failed, EXT FWD light does not come on	262 210 44	26-23 TASK 812
Engine fire extinguishing		
• indication not normal when the EXT TEST switch is moved to 1	262 010 00	26-20 TASK 801
• indication not normal when the EXT TEST switch is moved to 2	262 020 00	26-20 TASK 801
• left bottle does not release extinguishant when the fire handle is turned	262 030 00	26-20 TASK 803
• right bottle does not release extinguishant when the fire handle is turned	262 040 00	26-20 TASK 803
Fire extinguisher, flight compartment		
• missing	262 110 00	26-99 TASK 801
• seal broken or missing	262 090 00	26-99 TASK 801
• used	262 100 00	26-99 TASK 801
Fire extinguishing		
• during test fire handle light does not come on		
- APU	262 222 50	26-20 TASK 807
- engine 1	262 222 51	26-20 TASK 807
- engine 2	262 222 52	26-20 TASK 807
L BOTTLE DISCHARGED light		
• light on for the engine fire extinguishing	262 050 00	26-20 TASK 802
R BOTTLE DISCHARGED light		
• light on for the engine fire extinguishing	262 060 00	26-20 TASK 802
27-0 FLIGHT CONTROLS - GENERAL		
FLT CONTROL A LOW PRESSURE light		
• light on	270 010 00	27-21 TASK 813

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
27-0 FLIGHT CONTROLS - GENERAL (continued)		
FLT CONTROL B LOW PRESSURE light		
• light on	270 020 00	27-21 TASK 814
27-1 FLIGHT CONTROLS - AILERONS AND FLAPERONS		
Aileron		
• Does not go back to neutral		
- left	271 060 41	27-11 TASK 803
- left and right	271 060 48	27-11 TASK 802
- right	271 060 42	27-11 TASK 803
• does not move to full travel		
- left	271 010 41	27-11 TASK 805
- left and right	271 010 48	27-11 TASK 806
- right	271 010 42	27-11 TASK 805
• does not operate		
- left	271 020 41	27-11 TASK 807
- left and right	271 020 48	27-11 TASK 812
- right	271 020 42	27-11 TASK 807
• high trim	271 120 00	27-11 TASK 816
• slow response to contol wheel movement, hydraulic power on	271 110 00	27-11 TASK 808
Control wheel		
• does not move freely		
- captain's	271 030 31	27-11 TASK 813
- first officer's	271 030 32	27-11 TASK 813
• does not stay in the center position from one direction		
- captain's	271 100 31	27-11 TASK 810
- captain's and first officer's	271 100 48	27-11 TASK 810
- first officer's	271 100 32	27-11 TASK 810
• has too much play		
- captain's	271 040 31	27-11 TASK 801
- captain's and first officer's	271 040 48	27-11 TASK 801
- first officer's	271 040 32	27-11 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
27-1 FLIGHT CONTROLS - AILERONS AND FLAPERONS (continued)		
• high force, hydraulic power off		
- captain's	271 080 31	27-11 TASK 809
- captain's and first officer's	271 080 48	27-11 TASK 809
- first officer's	271 080 32	27-11 TASK 809
• high force, hydraulic power on		
- captain's	271 070 31	27-11 TASK 804
- captain's and first officer's	271 070 48	27-11 TASK 804
- first officer's	271 070 32	27-11 TASK 804
• light force in one or both directions		
- captain's	271 090 31	27-11 TASK 811
- captain's and first officer's	271 090 48	27-11 TASK 811
- first officer's	271 090 32	27-11 TASK 811
Wing down aileron trim		
• does not operate		
- left	271 050 41	27-11 TASK 814
- left and right	271 050 48	27-11 TASK 815
- right	271 050 42	27-11 TASK 814
27-2 FLIGHT CONTROLS - RUDDER		
Nose rudder trim		
• does not operate		
- left	272 010 41	27-21 TASK 801
- left and right	272 010 48	27-21 TASK 803
- right	272 010 42	27-21 TASK 802
Rudder		
• does not move correctly	272 040 00	27-21 TASK 806
• does not move freely	272 050 00	27-21 TASK 807
• STBY RUD ON light is on	272 070 00	27-21 TASK 817
• surface has excessive play	272 060 00	27-21 TASK 808
Rudder pedals		
• Adjustment crank does not move freely		
- captain's	272 070 31	27-21 TASK 809
- first officer's	272 070 32	27-21 TASK 809

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
27-2 FLIGHT CONTROLS - RUDDER (continued)		
• Adjustment crank turns but rudder pedals do not move		
- captain's	272 080 31	27-21 TASK 810
- first officer's	272 080 32	27-21 TASK 810
• do not move freely		
- captain's	272 090 31	27-21 TASK 811
- first officer's	272 090 32	27-21 TASK 811
• kick back during flight	272 092 00	27-21 TASK 816
Rudder trim		
• high	272 015 00	27-21 TASK 818
RUDDER TRIM indicator		
• does not operate correctly	272 020 00	27-21 TASK 804
• light not on	272 030 00	27-21 TASK 805
Trim switch		
• does not operate correctly	272 100 00	27-21 TASK 812
27-3 FLIGHT CONTROLS - ELEVATOR		
Autopilot		
• Travel is not within limits, column force is normal	273 010 00	27-31 TASK 809
Control column		
• does not move freely		
- captain's	273 020 31	27-31 TASK 801
- first officer's	273 020 32	27-31 TASK 801
• high force, hydraulic power off	273 150 00	27-31 TASK 814
• high force, hydraulic power on	273 140 00	27-31 TASK 813
• low force	273 130 00	27-31 TASK 812
• shaker does not operate during test	273 110 00	27-32 TASK 836
• shaker operates continuously	273 115 00	27-32 TASK 834
Elevator		
• control cable tension repeatedly checks low	273 030 00	27-31 TASK 802
• does not move correctly	273 040 00	27-31 TASK 810
• hard to operate during landing	273 155 00	27-31 TASK 817
• Too much play in elevator surface	273 050 00	27-31 TASK 804

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
27-3 FLIGHT CONTROLS - ELEVATOR (continued)		
Elevator tab surface		
• has too much play	273 120 00	27-31 TASK 805
FEEL DIFF PRESS light		
• light on	273 060 00	27-31 TASK 815
Neutral shift		
• does not operate correctly	273 080 00	27-31 TASK 807
Pitch control		
• Too sensitive in control wheel steering mode (airplane overreacts to column input)	273 090 00	27-31 TASK 811
Pitch up or pitch down of airplane too much	273 100 00	27-31 TASK 808
SPD LIM shows		
- captain's	273 160 31	27-32 TASK 831
- first officer's	273 160 32	27-32 TASK 833
Vibration in aft and forward fuselage	273 070 00	27-31 TASK 806
27-4 FLIGHT CONTROLS - HORIZONTAL STABILIZER		
Stabilizer		
• control cable tension repeatedly checks low	274 010 00	27-41 TASK 801
• fails to trim		
- nose down	274 020 00	27-41 TASK 802
- nose up	274 030 00	27-41 TASK 803
- nose up and nose down	274 040 00	27-41 TASK 804
• Too much play in stabilizer surface	274 060 00	27-41 TASK 813
Stabilizer trim		
• does not hold position in flight	274 130 00	27-41 TASK 812
• does not move freely	274 070 00	27-41 TASK 805
• moves with slow speed only	274 080 00	27-41 TASK 810
• wheel coasts more than 2.5 turns (flaps down)	274 120 00	27-41 TASK 811
Stabilizer trim switches		
• do not operate trim down		
- captain's	274 160 31	27-41 TASK 806
- first officer's	274 160 32	27-41 TASK 808

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
27-4 FLIGHT CONTROLS - HORIZONTAL STABILIZER (continued)		
• do not operate trim up		
- captain's	274 150 31	27-41 TASK 806
- first officer's	274 150 32	27-41 TASK 808
• do not operate trim up and trim down		
- captain's	274 170 31	27-41 TASK 807
- first officer's	274 170 32	27-41 TASK 809
27-5 FLIGHT CONTROLS - FLAPS		
Flap position indicator		
• has fast movement	275 030 00	27-51 TASK 844
• has needles split	275 040 00	27-51 TASK 840
• has slow movement	275 050 00	27-51 TASK 845
• needle(s) do not operate	275 060 00	27-51 TASK 841
• needle(s) stick	275 070 00	27-51 TASK 842
Flaps		
• do not extend with alternate control	275 091 00	27-51 TASK 838
• do not operate with alternate control	275 090 00	27-51 TASK 837
• do not operate with primary control	275 080 00	27-51 TASK 836
• Do not retract with alternate control	275 092 00	27-51 TASK 839
• lever does not move freely	275 100 00	27-51 TASK 843
• load relief occurrs at wrong airspeed	275 020 00	27-51 TASK 803
• operation is fast	275 110 00	27-51 TASK 844
• operation is slow	275 120 00	27-51 TASK 845
• TE Flap Transmission Torque Trip Indicator extended	275 140 00	27-51 TASK 849
• Trailing Edge Flap Lockout on Aproach	275 081 00	27-51 TASK 836
27-6 FLIGHT CONTROLS - SPOILERS AND DRAG DEVICES		
Speed Brake		
• Auto extend does not operate	276 040 00	27-62 TASK 804
• Auto retract does not operate	276 050 00	27-62 TASK 805
• chatters	276 060 00	27-62 TASK 806
• Flight detent does not operate	276 070 00	27-61 TASK 802
• lever does not move freely	276 080 00	27-62 TASK 807

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
27-6 FLIGHT CONTROLS - SPOILERS AND DRAG DEVICES (continued)		
SPEED BRAKE ARMED Light		
• does not operate	276 020 00	27-62 TASK 803
• is on but the speedbrakes do not operate	276 025 00	27-62 TASK 815
SPEED BRAKE ARMED Light and the SPEED BRAKE DO NOT ARM Light		
• do not operate	276 032 00	27-62 TASK 816
Speed Brake Control System		
• Flight Spoiler does not fully deploy during Ground Speedbrake Operation		
- No. 10	276 210 10	27-62 TASK 817
- No. 11	276 210 11	27-62 TASK 817
- No. 2	276 210 02	27-62 TASK 817
- No. 3	276 210 03	27-62 TASK 817
- No. 4	276 210 04	27-62 TASK 817
- No. 5	276 210 05	27-62 TASK 817
- No. 8	276 210 08	27-62 TASK 817
- No. 9	276 210 09	27-62 TASK 817
SPEED BRAKE DO NOT ARM Light		
• light on	276 030 00	27-62 TASK 802
SPEEDBRAKES EXTENDED light		
• light on with airplane on the ground	276 035 00	27-62 TASK 814
Spoilers		
• Airplane rolls left when the spoilers are deployed	276 111 41	27-61 TASK 805
• Airplane rolls right when the spoilers are deployed	276 111 42	27-61 TASK 805
• do not move in one direction	276 110 00	27-61 TASK 804
• flight spoilers do not operate	276 090 00	27-61 TASK 802
• ground spoilers do not operate	276 100 00	27-61 TASK 803
• spoiler panel(s) float	276 010 00	27-61 TASK 801
27-8 FLIGHT CONTROLS - LIFT AUGMENTATION		
AUTO SLAT FAIL light		
• light on	278 060 00	27-32 TASK 801
Leading Edge Flaps		
• droops too much with hydraulic pressure off	278 010 00	27-81 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
27-8 FLIGHT CONTROLS - LIFT AUGMENTATION (continued)		
• TRANSIT light stays on		
- 1	278 070 01	27-88 TASK 820
- 2	278 070 02	27-88 TASK 820
- 3	278 070 03	27-88 TASK 820
- 4	278 070 04	27-88 TASK 820
Leading Edge Flaps and Slats		
• do not extend during alternate system operation	278 020 00	27-81 TASK 802
• do not extend during normal system operation	278 030 00	27-81 TASK 803
• Do not retract	278 040 00	27-81 TASK 803
• do not retract from the mid-extend position (LE Lockout)	278 041 00	27-81 TASK 812
• one or more Leading Edge Surfaces operate slowly	278 050 00	27-81 TASK 805
Leading Edge Slats		
• TRANSIT light stays on		
- 1	278 080 01	27-88 TASK 820
- 2	278 080 02	27-88 TASK 820
- 3	278 080 03	27-88 TASK 820
- 4	278 080 04	27-88 TASK 820
- 5	278 080 05	27-88 TASK 820
- 6	278 080 06	27-88 TASK 820
- 7	278 080 07	27-88 TASK 820
- 8	278 080 08	27-88 TASK 820
28-2 FUEL - DISTRIBUTION		
Crossfeed VALVE OPEN light		
• does not come on bright when the valve is in transit	282 125 00	28-22 TASK 808
• Stays ON bright when the Crossfeed Selector is moved to the OFF position	282 120 00	28-22 TASK 807
• Stays ON bright when the Crossfeed Selector is moved to the ON position	282 110 00	28-22 TASK 807
Fuel suction feed		
• engine does not continue running the full five minutes during Engine Fuel Suction Feed Operational Test	282 251 00	28-22 TASK 819

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
28-2 FUEL - DISTRIBUTION (continued)		
Fuel tank		
• boost pump circuit breaker open		
- center tank, left pump	282 301 43	28-22 TASK 817
- center tank, right pump	282 302 43	28-22 TASK 818
- No. 1 tank, aft pump	282 301 01	28-22 TASK 814
- No. 1 tank, forward pump	282 302 01	28-22 TASK 813
- No. 2 tank, aft pump	282 301 02	28-22 TASK 816
- No. 2 tank, forward pump	282 302 02	28-22 TASK 815
• DC fuel pump circuit breaker open	282 303 00	28-25 TASK 803
• unwanted fuel transfer from a main tank to the center tank		
- from tank 1	282 100 01	28-21 TASK 803
- from tank 2	282 100 02	28-21 TASK 813
Fuel transfer (migration)		
• Unwanted fuel transfer from the center tank to the No. 1 tank	282 101 00	28-21 TASK 814
• Unwanted fuel transfer from the center tank to the No. 2 tank	282 102 00	28-21 TASK 815
Hydraulic fluid leakage in fuel tank	282 315 00	28-21 TASK 818
LOW PRESSURE light for the fuel pump		
• light comes on, but not in the specified time (15 +/-2 seconds) during boost pump auto-shutoff functional test		
- center tank, left pump	282 312 41	28-22 TASK 820
- center tank, right pump	282 312 42	28-22 TASK 821
• light does not come on during boost pump auto-shutoff functional test		
- center tank, left pump	282 311 41	28-22 TASK 820
- center tank, right pump	282 311 42	28-22 TASK 821

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
28-2 FUEL - DISTRIBUTION (continued)		
• light on		
- center tank, left pump	282 130 43	28-22 TASK 801
- center tank, right pump	282 140 43	28-22 TASK 802
- no. 1 aft fuel pump	282 150 01	28-22 TASK 803
- no. 1 fwd and aft fuel pumps	282 160 01	28-22 TASK 803
- no. 1 fwd fuel pump	282 170 01	28-22 TASK 804
- no. 2 aft fuel pump	282 150 02	28-22 TASK 805
- no. 2 fwd and aft fuel pumps	282 160 02	28-22 TASK 805
- no. 2 fwd fuel pump	282 170 02	28-22 TASK 806
Refuel quantity indicator		
• blank		
- all tanks	282 010 48	28-21 TASK 804
- center tank	282 010 43	28-21 TASK 804
- tank no. 1	282 010 01	28-21 TASK 804
- tank no. 2	282 010 02	28-21 TASK 804
• Display is not correct with switch at TEST GAGES		
- all tanks	282 011 48	28-21 TASK 802
- center tank	282 011 43	28-21 TASK 802
- tank no. 1	282 011 01	28-21 TASK 802
- tank no. 2	282 011 02	28-21 TASK 802
• flashes		
- center tank	282 015 43	28-21 TASK 816
- tank no. 1	282 015 01	28-21 TASK 816
- tank no. 2	282 015 02	28-21 TASK 816
• shows ARINC error message		
- all tanks	282 013 48	28-21 TASK 817
- center tank	282 013 43	28-21 TASK 817
- tank no. 1	282 013 01	28-21 TASK 817
- tank no. 2	282 013 02	28-21 TASK 817
• Shows Id FAIL		
- all tanks	282 012 48	28-21 TASK 805
- center tank	282 012 43	28-21 TASK 805
- tank no. 1	282 012 01	28-21 TASK 805
- tank no. 2	282 012 02	28-21 TASK 805

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
28-2 FUEL - DISTRIBUTION (continued)		
REFUEL VALVE Light		
• light does not come on with valves selected open and refueling manifold pressurized		
- all tanks	282 030 48	28-21 TASK 807
- center tank	282 030 43	28-21 TASK 807
• light does not go off after pressing the press-to-test switch		
- all tanks	282 020 48	28-21 TASK 806
- center tank	282 020 43	28-21 TASK 806
- tank no. 1	282 020 01	28-21 TASK 806
- tank no. 2	282 020 02	28-21 TASK 806
Refuel valve position indicator light does not come on with valves selected open and refueling manifold pressurized		
- tank no. 1	282 030 01	28-21 TASK 807
- tank no. 2	282 030 02	28-21 TASK 807
Refueling		
• fuel spill at surge tank	282 050 00	28-21 TASK 801
• Fuel Tank Auto-Shutoff is inoperative	282 051 00	28-21 TASK 801
• Refueling (all) is prevented	282 040 00	28-21 TASK 808
• Valve does not close with switch at CLOSED		
- all tanks	282 070 48	28-21 TASK 806
- center tank	282 070 43	28-21 TASK 806
- tank no. 1	282 070 01	28-21 TASK 806
- tank no. 2	282 070 02	28-21 TASK 806
Refueling does not stop at the preselected quantity	282 090 00	28-21 TASK 811
Refueling panel light		
• light does not come on with ground power on the airplane	282 080 00	28-21 TASK 810
SPAR VALVE CLOSED light		
• does not come on bright when the valve is in transit		
- engine 1	282 240 51	28-22 TASK 811
- engine 2	282 240 52	28-22 TASK 812

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
28-2 FUEL - DISTRIBUTION (continued)		
• slow to go from Bright to Dim when the Start Lever is moved to CUTOFF		
- engine 1	282 180 51	28-22 TASK 809
- engine 2	282 180 52	28-22 TASK 810
• slow to go from Bright to OFF when the Start Lever is moved to IDLE		
- engine 1	282 190 51	28-22 TASK 809
- engine 2	282 190 52	28-22 TASK 810
• Stays ON bright when the Start Lever is moved to CUTOFF		
- engine 1	282 200 51	28-22 TASK 809
- engine 2	282 200 52	28-22 TASK 810
• Stays ON bright when the Start Lever is moved to IDLE		
- engine 1	282 210 51	28-22 TASK 809
- engine 2	282 210 52	28-22 TASK 810
28-4 FUEL - INDICATING		
FQIS BITE INOP message		
• Shows on CDU	284 101 00	28-41 TASK 819
Fuel quantity indication, flight compartment		
• CONFIG message shows	284 022 00	28-41 TASK 820
• error or blank		
- all tanks	284 020 48	28-41 TASK 813
- center tank	284 020 43	28-41 TASK 813
- no. 1 tank	284 020 01	28-41 TASK 813
- no. 2 tank	284 020 02	28-41 TASK 813
• fluctuates or is too high or too low		
- center tank	284 010 43	28-41 TASK 814
- no. 1 tank	284 010 01	28-41 TASK 814
- no. 2 tank	284 010 02	28-41 TASK 814
• IMBAL message shows	284 023 00	28-41 TASK 820
• LOW message shows	284 024 00	28-41 TASK 820
Fuel temperature indicator		
• does not operate correctly	284 030 00	28-43 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
29-1 HYDRAULIC POWER - MAIN		
Electrical power		
• power to the electric motor-driven pump is interrupted during normal operation		
- system A	291 020 00	29-10 TASK 803
- system B	291 025 00	29-10 TASK 804
ENG 1 LOW PRESSURE light		
• light off when the electric motor-driven pump is operated	291 010 51	29-10 TASK 801
ENG 2 LOW PRESSURE light		
• light off when the electric motor-driven pump is operated	291 010 52	29-10 TASK 802
Fire handle in the pulled position while engine turns		
- engine 1	291 201 51	29-11 TASK 801
- engine 2	291 201 52	29-11 TASK 801
Hydraulic fluid		
• Comes out of the reservoir vent line	291 050 00	29-10 TASK 805
• Comes out of the reservoir vent line drain mast	291 060 00	29-10 TASK 805
• fluid leakage	291 040 00	29-10 TASK 812
• Transfers from system A to system B	291 070 00	29-10 TASK 806
• Transfers from system B to system A	291 080 00	29-10 TASK 807
Hydraulic pressure indication		
• above 3200 psi		
- system A	291 090 00	29-10 TASK 808
- system B	291 100 00	29-10 TASK 809
• Below 2800 psi		
- system A	291 110 00	29-10 TASK 810
- system B	291 120 00	29-10 TASK 811
• momentarily below 2900 psi		
- system A	291 131 00	29-10 TASK 813
- system B	291 132 00	29-10 TASK 813
- systems A and B	291 133 00	29-10 TASK 813

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
29-2 HYDRAULIC POWER - AUXILIARY		
PTU		
• does not operate	292 040 00	29-20 TASK 804
Standby hydraulic pump		
• does not operate	292 010 00	29-20 TASK 801
29-3 HYDRAULIC POWER - INDICATING		
ELEC 1 LOW PRESSURE light		
• light on	293 190 00	29-30 TASK 810
ELEC 1 OVERHEAT light		
• light on	293 030 00	29-30 TASK 805
ELEC 2 LOW PRESSURE light		
• light on	293 200 00	29-30 TASK 811
ELEC 2 OVERHEAT light		
• light on	293 040 00	29-30 TASK 806
ENG 1 LOW PRESSURE light		
• light on	293 210 51	29-30 TASK 812
ENG 2 LOW PRESSURE light		
• light on	293 210 52	29-30 TASK 813
Hydraulic fluid quantity indication		
• does not return to the same level after operation of a "heavy use" system	293 150 00	29-30 TASK 808
• error or blank		
- system A	293 050 00	31-62 TASK 801
- system B	293 060 00	31-62 TASK 801
• flight compartment display and hydraulic reservoir gauge do not read the same		
- system A	293 070 00	31-62 TASK 801
- system B	293 080 00	31-62 TASK 801
• flight compartment display moves erratically or jumps between readings		
- system A	293 110 00	31-62 TASK 801
- system B	293 120 00	31-62 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
29-3 HYDRAULIC POWER - INDICATING (continued)		
• flight compartment display shows zero, reservoir has hydraulic fluid		
- system A	293 090 00	31-62 TASK 801
- system B	293 100 00	31-62 TASK 801
• Shows RF (76%)		
- system A	293 130 00	29-30 TASK 815
- system B	293 140 00	29-30 TASK 815
Hydraulic pressure indication		
• Zero		
- system A	293 020 00	29-30 TASK 803
- system B	293 025 00	29-30 TASK 804
Hydraulic reservoir gauge		
• Shows zero or below, reservoir has hydraulic fluid		
- system A	293 160 00	29-30 TASK 808
- system B	293 170 00	29-30 TASK 808
STANDBY HYD LOW PRESSURE light		
• light on	293 220 00	29-30 TASK 814
STANDBY HYD LOW QUANTITY light		
• light on	293 180 00	29-30 TASK 809
30-1 ICE AND RAIN PROTECTION - AIRFOIL		
ANTI-ICE & RAIN ENG 1 & WING CONT circuit breaker tripped.	301 121 00	30-11 TASK 810
R VALVE OPEN Light for WING ANTI-ICE		
• Does not go bright during transition	301 015 42	30-11 TASK 804
WING ANTI-ICE		
• does not come on	301 080 00	30-11 TASK 805
• Does not go bright during transition	301 015 41	30-11 TASK 804
• L VALVE OPEN Light is slow to go from Bright to Dim when the WING ANTI-ICE Switch is moved to ON	301 010 00	30-11 TASK 801
• L VALVE OPEN Light is slow to go from Bright to OFF when the WING ANTI-ICE Switch is moved to OFF	301 020 00	30-11 TASK 802
• R VALVE OPEN Light is slow to go from Bright to Dim when the WING ANTI-ICE Switch is moved to ON	301 050 00	30-11 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
30-1 ICE AND RAIN PROTECTION - AIRFOIL (continued)		
• R VALVE OPEN Light is slow to go from Bright to OFF when the WING ANTI-ICE Switch is moved to OFF	301 060 00	30-11 TASK 802
• Stays ON bright	301 030 00	30-11 TASK 803
WING ANTI-ICE R VALVE OPEN light		
• does not come on	301 090 00	30-11 TASK 805
• Stays ON bright	301 070 00	30-11 TASK 803
WING ANTI-ICE Switch		
• does not latch in the ON position with the engines not operating	301 100 00	30-11 TASK 806
• Unlatches when the engines are operating	301 110 00	30-11 TASK 807
30-2 ICE AND RAIN PROTECTION - AIR INTAKES		
COWL ANTI-ICE light		
• light comes on at high thrust setting (takeoff or climb) and goes off at reduced thrust		
- ENG ANTI-ICE 1	302 011 51	30-21 TASK 809
- ENG ANTI-ICE 2	302 011 52	30-21 TASK 809
• light comes on independent of engine thrust setting		
- ENG ANTI-ICE 1	302 010 51	30-21 TASK 801
- ENG ANTI-ICE 2	302 010 52	30-21 TASK 801
COWL VALVE OPEN Light		
• slow to go from Bright to Dim when the ENG ANTI-ICE Switch is moved to ON		
- ENG ANTI-ICE 1	302 020 51	30-21 TASK 802
- ENG ANTI-ICE 2	302 020 52	30-21 TASK 802
• slow to go from Bright to OFF when the ENG ANTI-ICE Switch is moved to OFF		
- ENG ANTI-ICE 1	302 030 51	30-21 TASK 803
- ENG ANTI-ICE 2	302 030 52	30-21 TASK 803
• Stays ON bright		
- ENG ANTI-ICE 1	302 040 51	30-21 TASK 804
- ENG ANTI-ICE 2	302 040 52	30-21 TASK 804
• Stays ON bright when the ENG ANTI-ICE Switch is moved to ON		
- ENG-1	302 050 51	30-21 TASK 805
- ENG-2	302 050 52	30-21 TASK 805

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
30-3 ICE AND RAIN PROTECTION - PITOT AND STATIC (AIR DATA SENSORS)		
AUX PITOT light		
• light on	303 010 00	30-31 TASK 801
CAPT PITOT light		
• light on	303 020 00	30-31 TASK 802
F/O PITOT light		
• light on	303 030 00	30-31 TASK 803
L ALPHA VANE light		
• light on	303 040 00	30-31 TASK 804
L ELV PITOT light		
• light on	303 050 00	30-31 TASK 805
Pitot probe		
• Does not get hot	303 060 00	30-31 TASK 806
Probe heater indicator lights		
• do not come on when PITOT STATIC HEAT switches are OFF	303 070 00	30-31 TASK 807
R ALPHA VANE light		
• light on	303 080 00	30-31 TASK 808
R ELV PITOT light		
• light on	303 090 00	30-31 TASK 809
TEMP PROBE light		
• light on	303 100 00	30-31 TASK 810
30-4 ICE AND RAIN PROTECTION - WINDOWS, WINDSHIELD AND DOORS		
Window heat		
• Does not heat correctly		
- side window	304 090 00	30-41 TASK 809
- upper window	304 100 00	30-41 TASK 810
- windshield	304 080 00	30-41 TASK 802
• lights do not operate correctly when the test switch is moved to PWR TEST	304 050 00	30-41 TASK 801
• master caution and OVERHEAT lights do not operate correctly when the test switch is moved to OVHT	304 060 00	30-41 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
30-4 ICE AND RAIN PROTECTION - WINDOWS, WINDSHIELD AND DOORS (continued)		
Window Heat Control		
• No BITE LED Indicators come ON		
- WHCU 1 (Win 1L / 2R)	304 031 41	30-41 TASK 806
- WHCU 2 (Win 1R / 2L)	304 031 42	30-41 TASK 806
WINDOW HEAT OVERHEAT light		
• light on		
- L FWD	304 010 41	30-41 TASK 801
- L SIDE	304 020 41	30-41 TASK 801
- R FWD	304 010 42	30-41 TASK 801
- R SIDE	304 020 42	30-41 TASK 801
WINDOW HEAT Power ON light		
• does not come on		
- L FWD	304 030 41	30-41 TASK 802
- L SIDE	304 040 41	30-41 TASK 809
- R FWD	304 030 42	30-41 TASK 802
- R SIDE	304 040 42	30-41 TASK 809
Windshield wiper		
• does not operate in any switch position		
- left	304 200 41	30-42 TASK 801
- right	304 200 42	30-42 TASK 801
• does not operate in one switch position		
- left	304 210 41	30-42 TASK 802
- right	304 210 42	30-42 TASK 802
• does not park in the correct position		
- left	304 240 41	30-42 TASK 805
- right	304 240 42	30-42 TASK 805
• does not remove water correctly		
- left	304 260 41	30-42 TASK 807
- right	304 260 42	30-42 TASK 807
• does not stop		
- left	304 250 41	30-42 TASK 806
- right	304 250 42	30-42 TASK 806

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
30-4 ICE AND RAIN PROTECTION - WINDOWS, WINDSHIELD AND DOORS (continued)		
• Speed is incorrect		
- left	304 220 41	30-42 TASK 804
- right	304 220 42	30-42 TASK 804
• Sweep is incorrect		
- left	304 230 41	30-42 TASK 803
- right	304 230 42	30-42 TASK 803
• uncommanded motion		
- left	304 262 41	30-42 TASK 808
- right	304 262 42	30-42 TASK 808
30-7 ICE AND RAIN PROTECTION - WATER LINES		
Drain mast		
• Does not heat	307 010 00	30-71 TASK 801
• overheats	307 020 00	30-71 TASK 802
31-2 INDICATING/RECORDING SYSTEMS - INDEPENDENT INSTRUMENTS		
Clock		
• does not operate		
- captain's	312 020 31	31-25 TASK 801
- first officer's	312 020 32	31-25 TASK 802
Landing warning horn		
• does not sound	312 030 00	31-51 TASK 815
• sounds (false warning)	312 035 00	31-51 TASK 815
Takeoff warning horn		
• does not sound	312 010 00	31-51 TASK 803
• sounds (false warning)	312 015 00	31-51 TASK 803
31-3 INDICATING/RECORDING SYSTEMS - RECORDERS		
FLIGHT RECORDER OFF light		
• light on	313 010 00	31-31 TASK 805
Printer (flight deck)		
• FAIL light is on	313 202 00	31-33 TASK 802

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
31-3 INDICATING/RECORDING SYSTEMS - RECORDERS (continued)		
Spoiler		
• does not agree with spoiler position		
- spoiler panel 03	313 015 41	31-31 TASK 877
- spoiler panel 10	313 015 42	31-31 TASK 877
Wireless Quick Access Recorder		
• data does not transmit	313 121 00	31-31 TASK 809
31-5 INDICATING/RECORDING SYSTEMS - CENTRAL WARNING SYSTEM		
MASTER CAUTION light		
• light does not come on during test	315 101 00	31-52 TASK 801
31-6 INDICATING/RECORDING SYSTEMS - CENTRAL DISPLAY SYSTEM		
CDS display unit problem		
- center lower	316 050 47	31-63 TASK 824
- center upper	316 050 46	31-63 TASK 824
- left inboard	316 030 41	31-63 TASK 824
- left outboard	316 040 41	31-63 TASK 824
- right inboard	316 030 42	31-63 TASK 824
- right outboard	316 040 42	31-63 TASK 824
CDS FAULT annunciation shows on pilot's display		
- captain's	316 070 31	31-62 TASK 884
- first officer's	316 070 32	31-62 TASK 884
CDS MAINT annunciation shows on pilot's display		
- captain's	316 060 31	31-62 TASK 884
- first officer's	316 060 32	31-62 TASK 884
Common Display System		
• DEU-1 Restart during an APU Start on Battery Only		
- No. 1	316 082 01	31-63 TASK 828
• Display Units are blanking during an APU Start on Battery Only	316 081 00	31-63 TASK 828
• Landing Altitude Indication on the Primary Flight Display (PFD)		
- reference bar does not operate correctly	316 601 48	31-62 TASK 887

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
31-6 INDICATING/RECORDING SYSTEMS - CENTRAL DISPLAY SYSTEM (continued)		
DISPLAYS CONTROL PANEL annunciation shows on pilot's display		
- captain's	316 026 31	31-62 TASK 801
- first officer's	316 026 32	31-62 TASK 801
DSPLY SOURCE 1 annunciation shows on display		
• captains's and first officer's	316 083 41	31-63 TASK 820
DSPLY SOURCE 2 annunciation shows on display		
• captains's and first officer's	316 083 42	31-63 TASK 820
DSPLY SOURCE annunciation shows on pilot's display		
- captain's	316 080 31	31-63 TASK 820
- first officer's	316 080 32	31-63 TASK 820
EFIS control panel problem		
- captain's	316 020 31	31-63 TASK 819
- first officer's	316 020 32	31-63 TASK 821
Flap Maneuvering Speed Cursor		
• Does Not Show on the PFD	316 084 00	31-63 TASK 829
32-0 LANDING GEAR - GENERAL		
Air mode		
• Shows with the airplane on the ground	320 020 00	32-09 TASK 801
Ground mode		
• Shows with airplane in the air	320 030 00	32-09 TASK 801
PSEU		
• BITE display is blank	320 040 00	32-09 TASK 811
PSEU light		
• light does not come on during test	320 060 00	33-10 TASK 801
• light on	320 050 00	32-09 TASK 801
32-2 LANDING GEAR - NOSE GEAR AND DOORS		
Nose landing gear shock strut		
• deflated or pressure is low	322 010 00	32-21 TASK 801
32-3 LANDING GEAR - EXTENSION AND RETRACTION		
Landing gear lever		
• does not move to the UP position in flight, is free to move to the UP position when the lock override is used	323 010 00	32-30 TASK 813

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
32-3 LANDING GEAR - EXTENSION AND RETRACTION (continued)		
Main landing gear		
• slow to extend		
- left	323 090 41	32-32 TASK 804
- left and right	323 090 48	32-32 TASK 803
- right	323 090 42	32-32 TASK 804
• Slow to retract		
- left	323 080 41	32-32 TASK 804
- left and right	323 080 48	32-32 TASK 803
- right	323 080 42	32-32 TASK 804
Nose landing gear		
• NOSE GEAR red light on, airplane on ground	323 140 00	32-30 TASK 814
• slow to extend	323 120 00	32-30 TASK 806
• Slow to retract	323 130 00	32-30 TASK 806
32-4 LANDING GEAR - WHEELS AND BRAKES		
ANTISKID INOP light		
• light on	324 070 00	32-42 TASK 829
AUTO BRAKE DISARM light		
• light on	324 080 00	32-42 TASK 828
Autobrakes		
• AUTO BRAKE DISARM light comes on during landing	324 097 00	32-42 TASK 833
• brakes grab during landing when using autobrakes	324 095 00	32-42 TASK 832
• deceleration rate is not correct	324 090 00	32-42 TASK 807
• Wheel continues to spin in the Main Gear Wheel Well after Gear Retraction	324 098 00	32-42 TASK 834
Brake pressure indicator		
• decreases faster than specified during parking brake hold check		
- parking brake released	324 161 00	32-44 TASK 802
- parking brake set	324 160 00	32-44 TASK 801
• does not operate	324 020 00	32-44 TASK 806
• low/zero with parking brake released	324 010 00	32-44 TASK 805
• low/zero with parking brake set	324 110 00	32-44 TASK 805

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
32-4 LANDING GEAR - WHEELS AND BRAKES (continued)		
Brakes		
• Abnormal Noise or Vibration	324 172 00	32-44 TASK 808
• grab, drag, or lock	324 030 00	32-42 TASK 816
• pull to the left	324 040 00	32-42 TASK 817
• pull to the right	324 050 00	32-42 TASK 817
Parking Brake		
• lever does not release	324 120 00	32-44 TASK 807
• lever does not set	324 130 00	32-44 TASK 807
• PARK BRAKE Light on the Control Stand stays OFF when the Parking Brake is set	324 141 00	32-44 TASK 803
• PARK BRAKE Light on the Control Stand stays ON when the Parking Brake is released	324 142 00	32-44 TASK 804
Tire problem		
- main gear left inboard	324 150 02	32-42 TASK 820
- main gear left outboard	324 150 01	32-42 TASK 820
- main gear right inboard	324 150 03	32-42 TASK 820
- main gear right outboard	324 150 04	32-42 TASK 820
- nose gear left	324 150 05	32-42 TASK 820
- nose gear right	324 150 06	32-42 TASK 820
32-5 LANDING GEAR - STEERING		
Main landing gear		
• Shimmy or Vibrate at Taxi, Takeoff, or Landing	325 140 00	32-11 TASK 802
Nose wheel		
• makes a loud noise in the wheel well	325 010 00	32-51 TASK 801
• Shimmy or Vibrate at Landing	325 040 00	32-51 TASK 804
• Shimmy or Vibrate at takeoff	325 050 00	32-51 TASK 804
• Shimmy or Vibrate during taxi	325 045 00	32-51 TASK 804
• Strut bottoms during taxi	325 020 00	32-51 TASK 802
• Vibrates at gear retraction	325 030 00	32-51 TASK 803
Rudder pedal steering		
• does not operate, tiller steering normal	325 060 00	32-51 TASK 805
• does not steer straight	325 061 00	32-51 TASK 810

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
32-5 LANDING GEAR - STEERING (continued)		
Tiller steering		
• does not operate	325 070 00	32-51 TASK 806
• response is sluggish	325 080 00	32-51 TASK 807
• Steers in left direction only	325 090 00	32-51 TASK 808
• Steers in right direction only	325 100 00	32-51 TASK 808
32-6 LANDING GEAR - POSITION AND WARNING		
Landing Gear		
• LEFT GEAR, RIGHT GEAR, and NOSE GEAR Red and Green Lights (ALL) are ON at the same time		
- Gear Commanded DN	326 072 02	32-30 TASK 816
- Gear Commanded UP	326 072 01	32-30 TASK 815
Landing gear position lights		
• lights not correct	326 010 00	32-09 TASK 801
Landing gear, main and nose		
• Does not extend when landing gear lever moved to DN position	326 076 00	32-30 TASK 816
• does not retract when landing gear lever moved to UP position	326 075 00	32-30 TASK 815
• Gears (all) extends with landing gear lever at OFF, NOSE GEAR, RIGHT GEAR, and LEFT GEAR green lights on	326 070 00	32-30 TASK 809
Main landing gear		
• LEFT GEAR green light does not come on with landing gear lever at DN, LEFT GEAR red light on, alternate gear extension was attempted	326 040 41	32-32 TASK 805
• LEFT GEAR green light does not come on with landing gear lever at DN, LEFT GEAR red light on, indications normal after alternate gear extension	326 050 41	32-32 TASK 802
• LEFT GEAR green light does not go off with landing gear lever at UP, LEFT GEAR red light on	326 060 41	32-32 TASK 801
• RIGHT GEAR green light does not come on with landing gear lever at DN, RIGHT GEAR red light on, alternate gear extension was attempted	326 040 42	32-32 TASK 805
• RIGHT GEAR green light does not come on with landing gear lever at DN, RIGHT GEAR red light on, indications normal after alternate gear extension	326 050 42	32-32 TASK 802

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
32-6 LANDING GEAR - POSITION AND WARNING (continued)		
• RIGHT GEAR green light does not go off with landing gear lever at UP, RIGHT GEAR red light on	326 060 42	32-32 TASK 801
Nose landing gear		
• NOSE GEAR green light does not come on with landing gear lever at DN, NOSE GEAR red light on	326 110 00	32-30 TASK 812
• NOSE GEAR green light does not come on with landing gear lever at DN, NOSE GEAR red light on, alternate gear extension was attempted	326 080 00	32-30 TASK 807
• NOSE GEAR green light does not go off with landing gear lever at UP, NOSE GEAR red light on	326 090 00	32-30 TASK 810
• NOSE GEAR green light off with landing gear lever at UP, NOSE GEAR red light on	326 115 00	32-30 TASK 811
33-1 LIGHTS - FLIGHT COMPARTMENT		
Chart light		
• does not come on correctly		
- captain's	331 150 31	33-10 TASK 801
- first officer's	331 150 32	33-10 TASK 801
• Does not go off		
- captain's	331 151 31	33-10 TASK 801
- first officer's	331 151 32	33-10 TASK 801
Circuit breaker panel light		
• does not come on	331 040 00	33-10 TASK 801
• Does not go off	331 041 00	33-10 TASK 801
Control stand floodlight		
• does not come on correctly	331 090 00	33-10 TASK 801
• Does not go off	331 091 00	33-10 TASK 801
Dome light		
• does not come on correctly	331 050 00	33-10 TASK 801
• Does not go off	331 051 00	33-10 TASK 801
Flight kit light		
• does not come on correctly		
- captain's	331 110 31	33-10 TASK 801
- first officer's	331 110 32	33-10 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
33-1 LIGHTS - FLIGHT COMPARTMENT (continued)		
• Does not go off		
- captain's	331 111 31	33-10 TASK 801
- first officer's	331 111 32	33-10 TASK 801
Glareshield (AFCS) Floodlight		
• does not come on correctly	331 070 00	33-10 TASK 801
• Does not go off	331 071 00	33-10 TASK 801
Indicator light		
• does not come on correctly	331 010 00	33-10 TASK 801
• Does not go off	331 011 00	33-10 TASK 801
LCD segment		
• does not operate correctly	331 060 00	33-10 TASK 801
Lighted pushbutton switch		
• does not come on correctly	331 020 00	33-10 TASK 801
• Does not go off	331 021 00	33-10 TASK 801
Lightplate		
• does not come on	331 030 00	33-10 TASK 801
• Does not go off	331 031 00	33-10 TASK 801
Map light		
• does not come on correctly		
- captain's	331 120 31	33-10 TASK 801
- first officer's	331 120 32	33-10 TASK 801
• Does not go off		
- captain's	331 121 31	33-10 TASK 801
- first officer's	331 121 32	33-10 TASK 801
Master dim and test system		
• does not operate correctly	331 160 00	33-10 TASK 801
Oxygen mask floodlight		
• does not come on	331 140 00	33-10 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
33-1 LIGHTS - FLIGHT COMPARTMENT (continued)		
Panel floodlight		
• does not come on correctly		
- captain's	331 080 31	33-10 TASK 801
- center	331 080 43	33-10 TASK 801
- first officer's	331 080 32	33-10 TASK 801
• Does not go off		
- captain's	331 081 31	33-10 TASK 801
- center	331 081 43	33-10 TASK 801
- first officer's	331 081 32	33-10 TASK 801
Reading light, observer's		
• does not come on correctly	331 130 00	33-10 TASK 801
• Does not go off	331 131 00	33-10 TASK 801
Standby compass light		
• does not come on	331 100 00	34-23 TASK 802
• Does not go off	331 101 00	34-23 TASK 802
33-2 LIGHTS - PASSENGER COMPARTMENTS		
Lighting, Boeing Sky Interior (BSI)		
• a sequence of BSI Lights does not respond to ACP Signal	332 026 00	33-20 TASK 805
• Ceiling Cross Bin Light does not come ON	332 003 00	33-20 TASK 808
• Ceiling Cross Bin Light stays in BOOTLOADER (Warm White) Mode	332 022 00	33-20 TASK 820
• Ceiling Cross Bin Lights do not come ON		
- ALL LEFT AFT	332 006 00	33-20 TASK 816
- ALL LEFT FWD	332 004 00	33-20 TASK 814
- ALL RIGHT AFT	332 007 00	33-20 TASK 815
- ALL RIGHT FWD	332 005 00	33-20 TASK 813
• Ceiling Wash Light does not come ON	332 008 00	33-20 TASK 808
• Ceiling Wash Light stays in BOOTLOADER (Warm White) Mode	332 023 00	33-20 TASK 820

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
33-2 LIGHTS - PASSENGER COMPARTMENTS (continued)		
• Ceiling Wash Lights do not come ON		
- ALL LEFT AFT	332 011 00	33-20 TASK 816
- ALL LEFT FWD	332 009 00	33-20 TASK 814
- ALL RIGHT AFT	332 012 00	33-20 TASK 815
- ALL RIGHT FWD	332 010 00	33-20 TASK 813
• Center Overhead Stowage (COS) Light does not come ON	332 013 00	33-20 TASK 808
• Center Overhead Stowage (COS) Light stays in BOOTLOADER (Warm White) Mode	332 024 00	33-20 TASK 820
• Center Overhead Stowage (COS) Lights do not come ON		
- ALL LEFT FWD	332 014 00	33-20 TASK 814
- ALL RIGHT AFT	332 017 00	33-20 TASK 815
- ALL RIGHT FWD	332 015 00	33-20 TASK 813
- LEFT AFT	332 016 00	33-20 TASK 816
• Cove and Direct Lights do not come ON		
- ALL	332 002 00	33-20 TASK 810
• Direct Light does not come ON	332 018 00	33-20 TASK 808
• Direct Light stays in BOOTLOADER (Warm White) Mode	332 025 00	33-20 TASK 820
• Light at the end of the Data Bus does not fully respond to ACP Signal	332 027 00	33-20 TASK 804
• Light at the end of the Data Bus does not partially respond to ACP Signal	332 028 00	33-20 TASK 804
• Light does not fully respond to ACP Signal	332 029 00	33-20 TASK 803
• Light does not partially respond to ACP Signal	332 030 00	33-20 TASK 803
• Light flashes	332 031 00	33-20 TASK 821
• Lights do not come ON		
- ALL	332 001 00	33-20 TASK 809
• Window Light does not come ON	332 019 00	33-20 TASK 806
• Window Lights do not come ON		
- ALL LEFT SIDE	332 020 00	33-20 TASK 812
- ALL RIGHT SIDE	332 021 00	33-20 TASK 811

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
33-3 LIGHTS - CARGO AND SERVICE COMPARTMENT LIGHTS		
Accessory compartment light		
• does not come on	333 050 00	33-30 TASK 801
• Does not go off	333 051 00	33-30 TASK 801
Air conditioning compartment light		
• does not come on		
- left	333 030 41	33-30 TASK 801
- right	333 030 42	33-30 TASK 801
• Does not go off		
- left	333 031 41	33-30 TASK 801
- right	333 031 42	33-30 TASK 801
APU service light		
• does not come on	333 060 00	33-30 TASK 801
• Does not go off	333 061 00	33-30 TASK 801
Cargo compartment light		
• does not come on		
- aft	333 080 45	33-30 TASK 801
- forward	333 080 44	33-30 TASK 801
• Does not go off		
- aft	333 081 45	33-30 TASK 801
- forward	333 081 44	33-30 TASK 801
Cargo Door (Main Deck) Threshold Light		
• does not turn OFF	333 091 00	33-35 TASK 801
• does not turn ON	333 092 00	33-35 TASK 801
Electronic equipment compartment light		
• does not come on	333 040 00	33-30 TASK 801
• Does not go off	333 041 00	33-30 TASK 801
Tailcone light		
• does not come on	333 070 00	33-30 TASK 801
• Does not go off	333 071 00	33-30 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
33-3 LIGHTS - CARGO AND SERVICE COMPARTMENT LIGHTS (continued)		
Wheel well light		
• does not come on		
- main landing gear	333 010 00	33-30 TASK 801
- nose landing gear	333 020 00	33-30 TASK 801
• does not go off		
- main landing gear	333 011 00	33-30 TASK 801
- nose landing gear	333 021 00	33-30 TASK 801
33-4 LIGHTS - EXTERIOR LIGHTS		
Airstair tread light		
• does not come on	334 290 00	33-40 TASK 801
• Does not go off	334 291 00	33-40 TASK 801
Anti-collision (strobe) light		
• Does not go off		
- left wing	334 250 41	33-44 TASK 801
- right wing	334 250 42	33-44 TASK 801
- tail	334 260 00	33-44 TASK 801
Anti-collision light		
• does not come on correctly		
- left wing	334 230 41	33-44 TASK 801
- lower	334 270 47	33-44 TASK 801
- right wing	334 230 42	33-44 TASK 801
- tail	334 240 00	33-44 TASK 801
- upper	334 270 46	33-44 TASK 801
• Does not go off		
- lower	334 280 47	33-44 TASK 801
- upper	334 280 46	33-44 TASK 801
Landing light		
• does not come on		
- left fixed	334 030 41	33-40 TASK 801
- left retractable	334 040 41	33-40 TASK 801
- right fixed	334 030 42	33-40 TASK 801
- right retractable	334 040 42	33-40 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
33-4 LIGHTS - EXTERIOR LIGHTS (continued)		
• Does not extend		
- left retractable	334 060 41	33-40 TASK 801
- right retractable	334 060 42	33-40 TASK 801
• Does not go off		
- left fixed	334 070 41	33-40 TASK 801
- left retractable	334 080 41	33-40 TASK 801
- right fixed	334 070 42	33-40 TASK 801
- right retractable	334 080 42	33-40 TASK 801
• does not retract		
- left retractable	334 100 41	33-40 TASK 801
- right retractable	334 100 42	33-40 TASK 801
Logo light		
• does not come on		
- left	334 340 41	33-40 TASK 801
- right	334 340 42	33-40 TASK 801
• Does not go off		
- left	334 350 41	33-40 TASK 801
- right	334 350 42	33-40 TASK 801
Position (NAV) light		
• does not come on		
- left wing aft	334 120 41	33-40 TASK 801
- left wing forward	334 110 41	33-40 TASK 801
- right wing aft	334 120 42	33-40 TASK 801
- right wing forward	334 130 42	33-40 TASK 801
• Does not go off		
- left wing aft	334 200 41	33-40 TASK 801
- left wing forward	334 190 41	33-40 TASK 801
- right wing aft	334 200 42	33-40 TASK 801
- right wing forward	334 210 42	33-40 TASK 801
Runway turnoff light		
• does not come on		
- left	334 300 41	33-40 TASK 801
- right	334 300 42	33-40 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
33-4 LIGHTS - EXTERIOR LIGHTS (continued)		
• Does not go off		
- left	334 310 41	33-40 TASK 801
- right	334 310 42	33-40 TASK 801
Taxi light		
• does not come on	334 320 00	33-40 TASK 801
• Does not go off	334 330 00	33-40 TASK 801
Wing illumination light		
• does not come on		
- left	334 010 41	33-40 TASK 801
- right	334 010 42	33-40 TASK 801
• Does not go off		
- left	334 020 41	33-40 TASK 801
- right	334 020 42	33-40 TASK 801
34-1 NAVIGATION - FLIGHT ENVIRONMENT DATA		
Mach airspeed warning		
• does not sound when MACH AIRSPEED WARNING TEST switch is pushed		
- NO 1	341 030 01	34-16 TASK 801
- NO 2	341 030 02	34-16 TASK 801
Standby airspeed indicator problem	341 020 00	34-13 TASK 802
Standby altimeter problem	341 010 00	34-13 TASK 801
34-2 NAVIGATION - ATTITUDE AND DIRECTION		
Airspeed display		
• does not show		
- captain's	342 045 31	31-63 TASK 809
- first officer's	342 045 32	31-63 TASK 809
• minimum manuever speed or minimum speed on captain's PFD disagrees with first officer's PFD	342 044 00	34-21 TASK 830
ALIGN lights for the L and R IRS		
• lights on flashing	342 230 00	34-21 TASK 805
ALT DISAGREE message shows on airpseed display		
- captain's	342 091 31	31-62 TASK 875
- first officer's	342 091 32	31-62 TASK 875

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
34-2 NAVIGATION - ATTITUDE AND DIRECTION (continued)		
ALT flag shows on the EFIS display		
- captain's	342 080 31	34-21 TASK 827
- first officer's	342 080 32	34-21 TASK 828
Altitude display		
• is blank		
- captain's	342 090 31	31-63 TASK 809
- first officer's	342 090 32	31-63 TASK 809
Angle of attack (AOA) indication on PFD		
• captain's and first officer's indicators do not agree	342 151 00	34-21 TASK 834
ATT flag shows on the EFIS display		
- captain's	342 010 31	34-21 TASK 825
- first officer's	342 010 32	34-21 TASK 826
Attitude display		
• does not show		
- captain's	342 015 31	31-63 TASK 809
- first officer's	342 015 32	31-63 TASK 809
Call horn		
• Sounds, ADIRU power problem, ON DC light on		
- left	342 200 41	34-21 TASK 829
- right	342 200 42	34-21 TASK 829
• Sounds, equipment cooling problem	342 190 00	34-21 TASK 829
DC FAIL light for the IRS on		
- left	342 060 41	34-21 TASK 842
- right	342 060 42	34-21 TASK 842
FAULT light for the IRS		
• light on		
- left	342 070 41	34-21 TASK 803
- right	342 070 42	34-21 TASK 803
HDG/TRK flag shows on the EFIS display		
- captain's	342 130 31	34-21 TASK 825
- first officer's	342 130 32	34-21 TASK 826

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
34-2 NAVIGATION - ATTITUDE AND DIRECTION (continued)		
Heading/track display		
• does not show		
- captain's	342 140 31	34-21 TASK 825
- first officer's	342 140 32	34-21 TASK 826
IAS DISAGREE message shows on airpseed display		
- captain's	342 046 31	31-62 TASK 876
- first officer's	342 046 32	31-62 TASK 876
Integrated standby flight display		
• airspeed indication is different than common display system	342 614 00	34-24 TASK 816
• ALT flag shows	342 602 00	34-24 TASK 805
• altitude indication is different than common display system	342 612 00	34-24 TASK 813
• ATT flag shows	342 603 00	34-24 TASK 806
• attitude display disagrees with primary display; no flag shows	342 611 00	34-24 TASK 814
• dedicated battery system, front panel fault light is on	342 613 00	34-24 TASK 815
• display blank	342 601 00	34-24 TASK 804
• G/S flag shows	342 604 00	34-24 TASK 808
• HDG flag shows	342 605 00	34-24 TASK 809
• LOC flag shows	342 606 00	34-24 TASK 808
• OUT OF ORDER flag shows	342 607 00	34-24 TASK 810
• PROGRAM PIN ERROR flag shows	342 608 00	34-24 TASK 811
• SPD flag shows	342 609 00	34-24 TASK 812
• WAIT ATT flag shows	342 610 00	34-24 TASK 807
IRS display unit (ISDU)		
• maintenance code shows in right window when HDG/STS mode selected	342 220 00	34-21 TASK 835
Pitch limit indication		
• does not agree between the captain's and the first officer's display	342 025 00	34-21 TASK 854
PITCH message shows on the attitude display		
- captain's	342 020 31	34-21 TASK 825
- first officer's	342 020 32	34-21 TASK 826

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
34-2 NAVIGATION - ATTITUDE AND DIRECTION (continued)		
Radio magnetic indicator		
• ADF flag shows	342 430 00	34-22 TASK 803
• HDG flag shows	342 410 00	34-22 TASK 801
• VOR flag shows	342 440 00	34-22 TASK 802
ROLL message shows on the attitude display		
- captain's	342 030 31	34-21 TASK 825
- first officer's	342 030 32	34-21 TASK 826
SPD flag shows on the EFIS display		
- captain's	342 040 31	34-21 TASK 827
- first officer's	342 040 32	34-21 TASK 828
Standby Attitude Indicator		
• G/S flag shows	342 650 00	34-24 TASK 802
• glideslope deviation pointer out of view	342 630 00	34-24 TASK 802
• GYRO flag shows	342 670 00	34-24 TASK 801
• LOC flag shows	342 660 00	34-24 TASK 802
• localizer deviation pointer out of view	342 620 00	34-24 TASK 802
Standby magnetic compass error	342 510 00	34-23 TASK 801
TAS data		
• does not show on the navigation display		
- captain's	342 120 31	34-21 TASK 827
- first officer's	342 120 32	34-21 TASK 828
TAT data		
• does not show on the engine display	342 050 00	34-21 TASK 813
Unreliable Airspeed	342 065 00	31-62 TASK 876
Unreliable Altitude	342 095 00	31-62 TASK 875
VERIFY POSITION message shows on CDU and POS SHIFT page shows large IRS drift	342 225 00	34-21 TASK 836
Vertical speed data		
• does not show		
- captain's	342 180 31	31-63 TASK 809
- first officer's	342 180 32	31-63 TASK 809

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
34-2 NAVIGATION - ATTITUDE AND DIRECTION (continued)		
Vertical speed pointer		
• does not show		
- captain's	342 185 31	34-21 TASK 825
- first officer's	342 185 32	34-21 TASK 826
VSI flag shows		
- captain's	342 175 31	34-21 TASK 825
- first officer's	342 175 32	34-21 TASK 826
34-3 NAVIGATION - LANDING AND TAXIING AIDS		
G/S flag shows on the EFIS display		
- captain's	343 030 31	34-31 TASK 806
- first officer's	343 030 32	34-31 TASK 807
ILS		
• Audio tone does not occur or is weak		
- captain's	343 070 31	34-31 TASK 811
- first officer's	343 070 32	34-31 TASK 811
• frequency shows dashes		
- ILS 1	343 060 01	34-31 TASK 810
- ILS 2	343 060 02	34-31 TASK 810
• test problem when you push the TEST switch on the navigation control panel		
- captain's	343 020 31	34-31 TASK 801
- first officer's	343 020 32	34-31 TASK 801
LOC flag shows on the EFIS display		
- captain's	343 010 31	34-31 TASK 806
- first officer's	343 010 32	34-31 TASK 807
Localizer and glideslope pointers		
• do not show, LOC and G/S flags do not show		
- captain's	343 050 31	34-31 TASK 809
- first officer's	343 050 32	34-31 TASK 809
Marker beacon		
• Audio tone does not occur or is weak when passing marker, indications are normal	343 110 00	34-32 TASK 801
• FT does not show on the display when you push the TEST switch on the navigation control panel	343 150 00	34-32 TASK 803

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
34-3 NAVIGATION - LANDING AND TAXIING AIDS (continued)		
• indication does not show on the display when passing marker, audio tone does not occur or is weak	343 120 00	34-32 TASK 802
• indication does not show on the display when passing marker, audio tone is normal	343 130 00	34-32 TASK 803
• test problem when you push the TEST switch on the navigation control panel	343 140 00	34-51 TASK 801
Multi-mode receiver		
• does not respond when TEST button pushed	343 330 00	34-31 TASK 818
Navigation control panel		
• panel problem	343 040 00	34-31 TASK 808
RA flag shows on the display		
- captain's	343 210 31	34-33 TASK 801
- first officer's	343 210 32	34-33 TASK 801
Radio Altimeter		
• problem near 5G base	343 601 00	34-33 TASK 809
Radio altitude		
• altitude indication blank and RA flag does not show		
- captain's	343 220 31	34-33 TASK 805
- first officer's	343 220 32	34-33 TASK 805
• disagrees with other radio or barometric altitude indications, and RA flag does not show		
- captain's	343 221 31	34-33 TASK 801
- first officer's	343 221 32	34-33 TASK 801
34-4 NAVIGATION - INDEPENDENT POSITION DETERMINING		
GPWS		
• BITE display is blank	344 420 00	34-46 TASK 821
GPWS INOP light		
• light on	344 410 00	34-46 TASK 801
Ground proximity		
• Terrain display does not show		
- captain's	344 480 31	34-46 TASK 853
- captain's and first officer's	344 480 48	34-46 TASK 853
- first officer's	344 480 32	34-46 TASK 853
MAP/TERR RANGE DISAGREE message shows	344 470 00	34-46 TASK 858

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
34-4 NAVIGATION - INDEPENDENT POSITION DETERMINING (continued)		
MAP/WXR RANGE DISAGREE message shows		
- captain's	344 020 31	34-43 TASK 810
- first officer's	344 020 32	34-43 TASK 811
PWS FAIL message shows	344 010 00	34-43 TASK 815
TCAS		
• display blank		
- captain's	344 310 31	34-45 TASK 817
- captain's and first officer's	344 310 48	34-45 TASK 817
- first officer's	344 310 32	34-45 TASK 817
• intruder symbol stays directly in front of the airplane symbol on the navigation display	344 350 00	34-45 TASK 814
• intruder symbols do not show on the navigation display	344 380 00	34-45 TASK 814
• intruder symbols show when the airplane is on the ground	344 320 00	34-45 TASK 820
• navigation display shows TCAS OFF with the control panel selector switch at TA	344 330 00	34-45 TASK 815
• navigation display shows TCAS OFF with the control panel selector switch at TA/RA	344 340 00	34-45 TASK 815
• system test does not start when the TEST switch is pushed	344 390 00	34-45 TASK 819
• system test problem	344 395 00	34-45 TASK 818
• voice annunciation (aural) problem	344 360 00	34-45 TASK 816
TCAS FAIL Flag on Navigation Display		
• Shows with ATC transponder selector at TA and does not show with selector at TA/RA	344 371 00	34-45 TASK 821
• Shows with ATC transponder selector at TA and shows with selector at TA/RA	344 370 00	34-45 TASK 821
• Shows with ATC transponder selector at TA/RA and does not show with selector at TA	344 372 00	34-45 TASK 823
TERR FAIL message shows	344 450 00	34-46 TASK 856
TERR POS message shows	344 430 00	34-46 TASK 856
TERR RANGE DISAGREE message shows	344 460 00	34-46 TASK 857
Vertical Situation Display problem		
- captain's	344 501 31	34-46 TASK 801
- first officer's	344 501 32	34-46 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
34-4 NAVIGATION - INDEPENDENT POSITION DETERMINING (continued)		
VSD flag shows		
- captain's	344 502 31	34-46 TASK 860
- first officer's	344 502 32	34-46 TASK 861
Weather radar		
• +1 tilt angle shows during system displays test (predictive windshear)	344 161 00	34-43 TASK 806
• +2 tilt angle shows during system displays test (predictive windshear)	344 166 00	34-43 TASK 807
• +3 tilt angle shows during system displays test (predictive windshear)	344 171 00	34-43 TASK 806
• +4 tilt angle shows during system displays test (predictive windshear)	344 176 00	34-43 TASK 816
• -1 tilt angle shows during system displays test (predictive windshear)	344 160 00	34-43 TASK 806
• -2 tilt angle shows during system displays test (predictive windshear)	344 165 00	34-43 TASK 807
• -3 tilt angle shows during system displays test (predictive windshear)	344 170 00	34-43 TASK 806
• -4 tilt angle shows during system displays test (predictive windshear)	344 175 00	34-43 TASK 816
• -5 tilt angle shows during system displays test (predictive windshear)	344 180 00	34-43 TASK 817
• -6 tilt angle shows during system displays test (predictive windshear)	344 185 00	34-43 TASK 818
• -7 tilt angle shows during system displays test (predictive windshear)	344 186 00	34-43 TASK 819
• -8 tilt angle shows during system displays test (predictive windshear)	344 190 00	34-43 TASK 821
• display blank		
- captain's	344 090 31	34-43 TASK 814
- first officer's	344 090 32	34-43 TASK 814
• gain control problem		
- left	344 100 41	34-43 TASK 814
- right	344 100 42	34-43 TASK 814

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
34-4 NAVIGATION - INDEPENDENT POSITION DETERMINING (continued)		
• mode selector problem		
- left	344 110 41	34-43 TASK 804
- right	344 110 42	34-43 TASK 804
• no aural warnings during system displays test (predictive windshear)	344 140 00	34-43 TASK 820
• returns weak or incorrect colors on CDS		
- captain's	344 120 31	34-43 TASK 802
- first officer's	344 120 32	34-43 TASK 802
• Tilt control problem		
- left	344 130 41	34-43 TASK 814
- right	344 130 42	34-43 TASK 814
• WINDSHEAR does not show during system displays test (predictive windshear)	344 150 00	34-43 TASK 802
WXR ATT message shows		
- captain's	344 030 31	34-43 TASK 806
- first officer's	344 030 32	34-43 TASK 806
WXR DSPY message shows		
- captain's	344 040 31	34-43 TASK 812
- first officer's	344 040 32	34-43 TASK 813
WXR FAIL message shows		
- captain's	344 050 31	34-43 TASK 801
- first officer's	344 050 32	34-43 TASK 801
WXR RANGE DISAGREE message shows		
- captain's	344 060 31	34-43 TASK 808
- first officer's	344 060 32	34-43 TASK 809
WXR STAB message shows		
- captain's	344 070 31	34-43 TASK 822
- first officer's	344 070 32	34-43 TASK 822
WXR WEAK message shows		
- captain's	344 080 31	34-43 TASK 802
- first officer's	344 080 32	34-43 TASK 802

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
34-5 NAVIGATION - DEPENDENT POSITION DETERMINING		
ADF		
• Audio problem		
- no. 1	345 310 01	34-57 TASK 806
- no. 2	345 310 02	34-57 TASK 807
• Bearing pointer 1 does not show, ADF flag does not show		
- no. 1	345 370 01	34-57 TASK 820
• Bearing pointer 2 does not show, ADF flag does not show		
- no. 2	345 370 02	34-57 TASK 821
• indication blank		
- no. 1 captain's	345 320 31	34-57 TASK 808
- no. 1 captain's and first officer's	345 320 48	34-57 TASK 810
- no. 1 first officer's	345 320 32	34-57 TASK 809
- no. 2 captain's	345 330 31	34-57 TASK 811
- no. 2 captain's and first officer's	345 330 48	34-57 TASK 813
- no. 2 first officer's	345 330 32	34-57 TASK 812
• Tone problem		
- no. 1	345 340 01	34-57 TASK 814
- no. 2	345 340 02	34-57 TASK 815
ADF control panel problem	345 380 00	34-57 TASK 822
ADF flag shows on the display		
- no. 1 captain's	345 350 31	34-57 TASK 816
- no. 1 first officer's	345 350 32	34-57 TASK 817
- no. 2 captain's	345 360 31	34-57 TASK 818
- no. 2 first officer's	345 360 32	34-57 TASK 819
ATC		
• Altitude reporting does not operate		
- no. 1	345 110 01	34-53 TASK 801
- no. 1 and no. 2	345 110 48	34-53 TASK 801
- no. 2	345 110 02	34-53 TASK 801
• code indicator does not respond to selector movement	345 120 00	34-53 TASK 814

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
34-5 NAVIGATION - DEPENDENT POSITION DETERMINING (continued)		
• Transmission weak or intermittent		
- no. 1	345 130 01	34-53 TASK 802
- no. 1 and no. 2	345 130 48	34-53 TASK 801
- no. 2	345 130 02	34-53 TASK 803
• Transponder fail light on	345 140 00	34-53 TASK 801
ATC System		
• XPNDR FAIL light on the ATC Control Panel is on	345 113 00	34-53 TASK 817
DME		
• distance shows dashes		
- DME1	345 230 01	34-55 TASK 801
- DME2	345 230 02	34-55 TASK 801
• test problem when you push the TEST switch on the navigation control panel		
- captain's	345 210 31	34-55 TASK 801
- first officer's	345 210 32	34-55 TASK 801
DME1 shows on the display	345 220 01	34-55 TASK 802
DME2 shows on the display	345 220 02	34-55 TASK 802
GPS Receiver		
• GPS-L and GPS-R position not available	345 641 48	34-58 TASK 810
• GPS-L position not available	345 641 41	34-58 TASK 811
• GPS-R position not available	345 641 42	34-58 TASK 812
• position, date, and/or time are not correct	345 641 00	34-58 TASK 809
IRS mode select unit		
• GPS light comes on when Master Caution pushed	345 411 00	34-58 TASK 802
• GPS light stays on continuously	345 410 00	34-58 TASK 801
VOR		
• Audio tone does not occur or is weak		
- captain's	345 010 31	34-51 TASK 809
- first officer's	345 010 32	34-51 TASK 809
• Bearing pointer 1 does not show, VOR1 flag does not show	345 030 01	34-51 TASK 805
• Bearing pointer 2 does not show, VOR2 flag does not show	345 030 02	34-51 TASK 805

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
34-5 NAVIGATION - DEPENDENT POSITION DETERMINING (continued)		
• deviation bar does not show on the navigation display		
- VOR1	345 050 01	34-51 TASK 806
- VOR2	345 050 02	34-51 TASK 806
• test problem when you push the TEST switch on the navigation control panel		
- captain's	345 020 31	34-51 TASK 801
- first officer's	345 020 32	34-51 TASK 801
• TO/FROM indication does not show on the navigation display		
- VOR1	345 060 01	34-51 TASK 810
- VOR2	345 060 02	34-51 TASK 810
VOR frequency		
• shows dashes		
- VOR1	345 070 01	34-51 TASK 807
- VOR2	345 070 02	34-51 TASK 807
VOR1 flag shows on the display	345 040 01	34-51 TASK 801
VOR2 flag shows on the display	345 040 02	34-51 TASK 801
34-6 NAVIGATION - FLIGHT MANAGEMENT COMPUTING		
CDU		
• 429 HARDWARE CDU message shows		
- captain's	346 635 31	34-61 TASK 850
- first officer's	346 635 32	34-61 TASK 850
• ANALOG FAULT CDU message shows		
- captain's	346 642 31	34-61 TASK 854
- first officer's	346 642 32	34-61 TASK 854
• ANNUC FAULT CDU message shows		
- captain's	346 636 31	34-61 TASK 851
- first officer's	346 636 32	34-61 TASK 851
• ARINC RA message shows		
- captain's	346 637 31	34-61 TASK 852
- first officer's	346 637 32	34-61 TASK 852
• ATN DATA BASE INVALID Message shows on the CDU Scratchpad	346 145 00	34-61 TASK 846

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
34-6 NAVIGATION - FLIGHT MANAGEMENT COMPUTING (continued)		
• brightness control problem		
- captain's	346 020 31	34-61 TASK 803
- first officer's	346 020 32	34-61 TASK 803
• CDU USER 1 message shows		
- captain's	346 639 31	34-61 TASK 853
- first officer's	346 639 32	34-61 TASK 853
• CDU USER 2 message shows		
- captain's	346 640 31	34-61 TASK 853
- first officer's	346 640 32	34-61 TASK 853
• CDU USER 3 message shows		
- captain's	346 641 31	34-61 TASK 853
- first officer's	346 641 32	34-61 TASK 853
• CRT CONTROL CDU message shows		
- captain's	346 643 31	34-61 TASK 854
- first officer's	346 643 32	34-61 TASK 854
• DATA BASE INVALID message shows	346 360 00	34-61 TASK 818
• DATALINK FAIL message shows		
- captain's	346 365 31	23-27 TASK 801
- first officer's	346 365 32	23-27 TASK 801
• DATALINK FULL message shows	346 150 00	34-61 TASK 848
• display blank		
- captain's	346 040 31	34-61 TASK 804
- first officer's	346 040 32	34-61 TASK 804
• display is dim or out of focus		
- captain's	346 050 31	34-61 TASK 803
- first officer's	346 050 32	34-61 TASK 803
• DME data on NAV STATUS display shows FAIL	346 510 00	34-61 TASK 801
• EXEC key does not operate when pushed		
- captain's	346 060 31	34-61 TASK 805
- first officer's	346 060 32	34-61 TASK 805
• EXEC key light bar does not come on		
- captain's	346 065 31	34-61 TASK 806
- first officer's	346 065 32	34-61 TASK 806

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
34-6 NAVIGATION - FLIGHT MANAGEMENT COMPUTING (continued)		
• FAIL light is on	346 080 00	34-61 TASK 807
• FMC shows in the middle of the display	346 070 00	34-61 TASK 807
• GPS-L data on POS REF display is missing	346 460 00	34-61 TASK 801
• GPS-R data on POS REF display is missing	346 470 00	34-61 TASK 801
• GS data on POS REF display is missing	346 480 00	34-61 TASK 801
• ILS data on NAV STATUS display shows FAIL	346 500 00	34-61 TASK 801
• IRS-L data on POS REF display is missing	346 440 00	34-61 TASK 801
• IRS-R data on POS REF display is missing	346 450 00	34-61 TASK 801
• key does not operate when pushed		
- captain's	346 010 31	34-61 TASK 802
- first officer's	346 010 32	34-61 TASK 802
• MODEL/ENG DATA INVALID message shows	346 380 00	34-61 TASK 819
• MSG light does not come on		
- captain's	346 270 31	34-61 TASK 810
- first officer's	346 270 32	34-61 TASK 810
• NO INTERRUPT RA ARINC message shows		
- captain's	346 644 31	34-61 TASK 854
- first officer's	346 644 32	34-61 TASK 854
• OAT DISAGREE - DELETED Message shows on the CDU Scratchpad	346 141 00	34-61 TASK 842
• OFST light does not come on		
- captain's	346 280 31	34-61 TASK 810
- first officer's	346 280 32	34-61 TASK 810
• OP PROGRAM INVALID shows in the middle of the display	346 260 00	34-61 TASK 811
• P ARINC message shows		
- captain's	346 638 31	34-61 TASK 852
- first officer's	346 638 32	34-61 TASK 852
• PRINTER FAIL message shows	346 375 00	31-33 TASK 804
• PROCESSOR CDU message shows		
- captain's	346 645 31	34-61 TASK 854
- first officer's	346 645 32	34-61 TASK 854
• PROGRAM PIN ERROR message shows	346 390 00	34-61 TASK 820

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
34-6 NAVIGATION - FLIGHT MANAGEMENT COMPUTING (continued)		
• PROGRAM PIN NOT IN DB message shows	346 400 00	34-61 TASK 821
• SCANNING DME FAIL message shows	346 350 00	34-61 TASK 801
• SERVICE BACKLIGHT SOON shows on CDU Scratchpad		
- captain's	346 051 31	34-61 TASK 841
- first officer's	346 051 32	34-61 TASK 841
• SINGLE FMC OPERATION message shows	346 370 00	34-61 TASK 807
• VOR data on NAV STATUS display shows FAIL	346 490 00	34-61 TASK 801
• WATCHDOG TIMER CDU message shows		
- captain's	346 646 31	34-61 TASK 854
- first officer's	346 646 32	34-61 TASK 854
FMC DISAGREE message shows on CDU	346 075 00	34-61 TASK 835
FMC DISAGREE message shows on the PFD	346 076 00	34-61 TASK 835
FMC menu prompt flashes or is slow to respond	346 131 00	34-61 TASK 838
FMC Nav data crossloading problem	346 120 00	34-61 TASK 832
FMC software load		
• CHECK DBL OR INTERFACE message shows on CDU	346 290 00	34-61 TASK 812
• CHECK MEDIA message shows on CDU	346 330 00	34-61 TASK 816
• DB EXCEEDS FMC MEMORY message shows on CDU	346 300 00	34-61 TASK 813
• DB-OFP INCOMPATIBLE message shows on CDU	346 320 00	34-61 TASK 815
• INCORRECT DISK INSERTED message shows on CDU	346 340 00	34-61 TASK 817
• RESET COUNT EXCEEDED message shows on CDU	346 310 00	34-61 TASK 814
FMCS		
• LNAV disengages during flight	346 101 00	34-61 TASK 844
• VNAV disengages during flight	346 102 00	34-61 TASK 845
MAP flag shows on CDS		
- captain's	346 090 31	34-61 TASK 801
- first officer's	346 090 32	34-61 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
34-6 NAVIGATION - FLIGHT MANAGEMENT COMPUTING (continued)		
MAP RANGE DISAGREE message shows		
- captain's	346 100 31	34-61 TASK 830
- first officer's	346 100 32	34-61 TASK 830
NAV DATA OUT OF DATE message shows on CDU	346 160 00	34-61 TASK 808
RESYNC FAIL, SINGLE FMC OP/SINGLE FMC OP message shows on CDU	346 180 00	34-61 TASK 832
Thrust mode		
• does not show on the engine display	346 230 00	34-61 TASK 809
VTK flag shows		
- captain's	346 200 31	34-61 TASK 801
- first officer's	346 200 32	34-61 TASK 801
35-1 OXYGEN - CREW		
Crew oxygen pressure indicator		
• does not agree with bottle pressure	351 010 00	35-12 TASK 801
• pressure decreases	351 020 00	35-12 TASK 802
• pressure low	351 030 00	35-12 TASK 803
• Pressure zero	351 040 00	35-12 TASK 804
Oxygen mask, flight crew		
• damaged		
- captain's	351 050 31	35-12 TASK 805
- first officer's	351 050 32	35-12 TASK 805
- observer's	351 050 33	35-12 TASK 805
• difficult to release from stowage		
- captain's	351 060 31	35-12 TASK 806
- first observer's	351 060 33	35-12 TASK 806
- first officer's	351 060 32	35-12 TASK 806
• harness fails to deflate		
- captain's	351 070 31	35-12 TASK 805
- first observer's	351 070 33	35-12 TASK 805
- first officer's	351 070 32	35-12 TASK 805

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
35-1 OXYGEN - CREW (continued)		
• harness fails to inflate		
- captain's	351 080 31	35-12 TASK 805
- first observer's	351 080 33	35-12 TASK 805
- first officer's	351 080 32	35-12 TASK 805
• harness leaking		
- captain's	351 090 31	35-12 TASK 805
- first observer's	351 090 33	35-12 TASK 805
- first officer's	351 090 32	35-12 TASK 805
• hose problem		
- captain's	351 100 31	35-12 TASK 805
- first officer's	351 100 32	35-12 TASK 805
- observer's	351 100 33	35-12 TASK 805
• panel (door, pin, etc.) damaged		
- captain's	351 110 31	35-12 TASK 807
- first officer's	351 110 32	35-12 TASK 807
- observer's	351 110 33	35-12 TASK 807
Oxygen regulator operation		
• Difficult to exhale		
- captain's	351 120 31	35-12 TASK 805
- first observer's	351 120 33	35-12 TASK 805
- first officer's	351 120 32	35-12 TASK 805
• leaking		
- captain's	351 130 31	35-12 TASK 805
- first observer's	351 130 33	35-12 TASK 805
- first officer's	351 130 32	35-12 TASK 805
• no pressure breathing available		
- captain's	351 140 31	35-12 TASK 805
- first observer's	351 140 33	35-12 TASK 805
- first officer's	351 140 32	35-12 TASK 805
35-2 OXYGEN - PASSENGER		
Oxygen masks, passenger		
• Masks (all) do not drop when PASS OXYGEN switch manually set to ON	352 030 00	35-22 TASK 803

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
35-2 OXYGEN - PASSENGER (continued)		
PASS OXY ON light		
• light does not come on during automatic oxygen system deployment	352 050 00	35-22 TASK 806
• light does not come on during manual oxygen system deployment	352 040 00	35-22 TASK 805
• light on, all masks dropped automatically, switch was not moved, cabin pressure was normal	352 010 00	35-22 TASK 801
• light on, all masks failed to drop automatically, masks dropped after PASS OXY switch was moved	352 020 00	35-22 TASK 802
35-3 OXYGEN - PORTABLE		
Crew portable oxygen		
• damaged	353 010 00	35-99 TASK 801
• pressure low	353 020 00	35-99 TASK 801
• was used	353 030 00	35-99 TASK 801
36-1 PNEUMATIC - DISTRIBUTION		
BLEED TRIP OFF Light comes ON		
• during climb		
- light No. 1	361 012 01	36-10 TASK 809
- light No. 2	361 012 02	36-10 TASK 809
• during cruise		
- light No. 1	361 013 01	36-10 TASK 809
- light No. 2	361 013 02	36-10 TASK 809
• during idle descent		
- light No. 1	361 014 01	36-10 TASK 809
- light No. 2	361 014 02	36-10 TASK 809
• during takeoff		
- light No. 1	361 011 01	36-10 TASK 809
- light No. 2	361 011 02	36-10 TASK 809
Bleed valve		
• does not close when the bleed switches are moved to off, the engine is the bleed source	361 020 00	36-10 TASK 802
Duct Pressure Indication		
• high, the engine is the bleed source	361 030 00	36-10 TASK 803

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
36-1 PNEUMATIC - DISTRIBUTION (continued)		
• L and R pointers not the same (split), the APU is the bleed source	361 080 00	36-10 TASK 808
• L and R pointers not the same (split), with either pointer below 18 psig during takeoff, climb and cruise; the engine is the bleed source	361 070 00	36-10 TASK 807
• low (below 18 psig) during takeoff, climb and cruise; the engine is the bleed source	361 040 00	36-10 TASK 810
Isolation valve		
• does not operate correctly	361 060 00	36-10 TASK 806
38-1 WATER/WASTE - POTABLE WATER		
Faucet water flow not sufficient	381 021 00	38-10 TASK 806
Faucet water pressure too high	381 022 00	38-10 TASK 809
Faucet water too hot	381 024 00	38-10 TASK 808
Galley faucet leaks or faucet damaged	381 045 00	38-10 TASK 805
Lavatory		
• Lavatory Water (specify location) is cold. The Heater Power Switch is ON, and the Heater Pilot Light is not ON	381 051 00	38-10 TASK 828
Lavatory faucet leak	381 023 00	38-10 TASK 807
No hot water at faucet	381 025 00	38-10 TASK 811
Potable water		
• auxiliary tank (40-gallon) leaks	381 042 00	25-99 TASK 801
• contaminated	381 026 00	38-10 TASK 810
• indicator on service panel shows level of zero	381 010 00	38-10 TASK 813
• level not accurate at attendant's panel	381 011 00	38-10 TASK 812
• main tank (60-gallon) leaks	381 041 00	25-99 TASK 801
• System does not pressurize	381 020 00	38-10 TASK 803
• tank does not fill	381 030 00	38-10 TASK 801
• tank leaks	381 040 00	38-10 TASK 802
Water leakage		
- aft cargo compartment ceiling	381 050 45	38-10 TASK 804
- forward cargo compartment ceiling	381 050 44	38-10 TASK 804
38-3 WATER/WASTE - WASTE DISPOSAL		
Lavatory sink drain stopper inoperative	383 031 00	38-30 TASK 818

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
38-3 WATER/WASTE - WASTE DISPOSAL (continued)		
Single toilet inoperative	383 028 00	38-30 TASK 820
Sink drain plugged	383 032 00	38-30 TASK 819
Toilet		
• overflows	383 024 00	38-30 TASK 814
• plugged	383 025 00	38-30 TASK 815
Toilet flush system		
• does not flush		
- all toilets	383 121 48	38-30 TASK 811
• does not turn off	383 026 00	38-30 TASK 816
• plugged/blocked	383 027 00	38-30 TASK 817
Toilet flush valve assembly		
• blocked	383 029 00	38-30 TASK 830
Vacuum blower inoperative	383 033 00	38-30 TASK 821
Waste quantity indicator		
• Shows tank is empty when tank is full		
- attendant's panel	383 050 00	38-30 TASK 810
• Shows tank is full when tank is not full		
- attendant's panel	383 040 00	38-30 TASK 810
Waste tank		
• does not precharge	383 020 00	38-30 TASK 812
• full indication	383 023 00	38-30 TASK 809
• sensor J1/J2	383 021 00	38-30 TASK 803
• sensor J3	383 022 00	38-30 TASK 808
Waste tank drain valve handle		
• Does not drain tank when pulled	383 030 00	38-30 TASK 813
46-1 INFORMATION SYSTEMS - AIRPLANE GENERAL INFORMATION SYSTEMS		
Onboard Network System		
• shows "System dataload state is currently disabled"	461 801 00	46-13 TASK 856
47-0 INERT GAS SYSTEM - INERT GAS SYSTEM		
Nitrogen generation system		
• operability indicator DEGRADED (blue) light is on	470 813 00	47-31 TASK 840
• operability indicator has all lights off	470 812 00	47-31 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
47-0 INERT GAS SYSTEM - INERT GAS SYSTEM (continued)		
• operability indicator INOPERATIVE (amber) light is on . .	470 811 00	47-31 TASK 801
49-1 AUXILIARY POWER UNIT - POWER PLANT		
APU		
• Air Inlet Door does not fully open or fully close	491 010 00	49-60 TASK 801
• Operates with hydraulic contaminated fuel	491 040 00	49-10 TASK 811
• Vibration is excessive	491 020 00	49-15 TASK 807
APU starter-generator		
• noisy during APU start	491 030 00	49-45 TASK 803
49-2 AUXILIARY POWER UNIT - ENGINE		
Abnormal noise during APU system operation	492 162 00	49-55 TASK 809
APU		
• does not start, FAULT light ON	492 100 00	49-60 TASK 801
• does not start, MAINT light ON	492 110 00	49-60 TASK 801
• does not start, no APU indication lights ON	492 130 00	49-15 TASK 805
• does not start, OVER SPEED light ON	492 120 00	49-60 TASK 801
• oil consumption high	492 140 00	49-95 TASK 801
APU FAULT light		
• light on, APU had a protective shutdown	492 010 00	49-60 TASK 801
• light on, APU operates without a protective shutdown . . .	492 020 00	49-15 TASK 801
APU GEN OFF BUS light		
• light not on, APU speed at 95%	492 050 00	49-15 TASK 804
APU LOW OIL PRESSURE light		
• light on, APU had a protective shutdown	492 060 00	49-60 TASK 801
• light on, APU operates with no protective shutdown	492 030 00	49-15 TASK 802
APU MAINT light		
• light on	492 070 00	49-60 TASK 801
APU OVER SPEED light		
• light on during APU shutdown	492 080 00	49-60 TASK 801
• light on, APU had a protective shutdown	492 090 00	49-60 TASK 801
• light on, APU operates with no protective shutdown	492 040 00	49-15 TASK 803
Smoke or flame in APU exhaust	492 150 00	49-55 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
49-2 AUXILIARY POWER UNIT - ENGINE (continued)		
Surge of APU during ECS operation	492 161 00	49-55 TASK 810
Surge of APU during main engine start	492 160 00	49-55 TASK 808
49-3 AUXILIARY POWER UNIT - ENGINE FUEL AND CONTROL		
APU		
• fuel valve does not fully open or fully close	493 010 00	49-60 TASK 801
49-4 AUXILIARY POWER UNIT - IGNITION/STARTING		
Battery voltage		
• less than 22 volts with BAT switch at ON and no AC power on the charger	494 010 00	49-45 TASK 801
• less than 26 volts with AC power on the charger	494 020 00	49-45 TASK 802
49-5 AUXILIARY POWER UNIT - AIR		
DUAL BLEED light		
• light on, APU BLEED switch at OFF	495 010 00	49-55 TASK 803
Duct Pressure Indication		
• low or not constant during main engine start, the APU is the bleed source	495 031 00	49-55 TASK 807
• low or not constant during pack operation, the APU is the bleed source	495 032 00	49-55 TASK 806
• Zero, the APU is the bleed source	495 050 00	49-55 TASK 804
49-6 AUXILIARY POWER UNIT - ENGINE CONTROLS		
APU BITE INOP message shows on the CDU	496 010 00	49-65 TASK 801
49-7 AUXILIARY POWER UNIT - INDICATING		
APU EGT indicator		
• does not operate correctly	497 010 00	49-75 TASK 801
49-9 AUXILIARY POWER UNIT - OIL		
Fumes or Smoke in Cabin		
• Pneumatic Power supplied by APU	499 010 00	49-55 TASK 802
52-1 DOORS - PASSENGER/CREW		
Aft entry door		
• Difficult to operate between cocked and fully open position		
- door jamming or binding	521 015 45	52-10 TASK 813

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
52-1 DOORS - PASSENGER/CREW (continued)		
Door warning annunciator is on		
- AFT ENTRY	521 611 45	52-10 TASK 801
- FWD ENTRY	521 611 44	52-10 TASK 801
Entry Door		
• Handle Movement		
- forward	521 011 44	52-10 TASK 815
Entry door exterior handle		
• Difficult to operate		
- aft	521 010 45	52-10 TASK 811
- forward	521 010 44	52-10 TASK 811
52-3 DOORS - CARGO		
Cargo Door		
• Difficult to open/close	523 010 00	52-30 TASK 801
• does not unlatch/latch	523 020 00	52-30 TASK 802
Cargo Door (Main Deck)		
• does not latch	523 283 00	52-32 TASK 817
• does not lock	523 284 00	52-32 TASK 816
• does not raise	523 220 00	52-32 TASK 805
• does not stop at canopy position when lowered	523 230 00	52-32 TASK 806
• does not stop at canopy position when raised	523 240 00	52-32 TASK 804
• does not unlatch	523 285 00	52-32 TASK 815
• does not unlock	523 286 00	52-32 TASK 814
Door warning annunciator is on		
- AFT CARGO	523 611 45	52-30 TASK 803
- FWD CARGO	523 611 44	52-30 TASK 803
52-4 DOORS - SERVICE		
Aft galley door		
• Difficult to operate between cocked and fully open position		
- door jamming or binding	524 015 45	52-10 TASK 814

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
52-4 DOORS - SERVICE (continued)		
Door warning annunciator is on		
- AFT SERVICE	524 611 45	52-10 TASK 801
- EQUIP	524 612 00	52-40 TASK 801 or 52-40 TASK 802
- FWD SERVICE	524 611 44	52-10 TASK 801
Galley service door exterior handle		
• Difficult to operate	524 010 00	52-10 TASK 811
52-5 DOORS - FIXED INTERIOR		
Control Cabin Door		
• CAB DOOR UNLOCKED light does not come on when the door is unlocked	525 010 00	52-50 TASK 801
• Difficult to open/close	525 020 00	52-50 TASK 802
• does not release electrically	525 040 00	52-50 TASK 803
• key is damaged	525 032 00	52-99 TASK 801
• key is missing	525 030 00	52-99 TASK 801
Flight deck door (enhanced security door)		
• chime does not sound with switch set to AUTO and correct code in keypad	525 121 00	52-50 TASK 808
• chime sounds with switch set to DENY	525 131 00	52-50 TASK 807
• does not lock with switch set to AUTO	525 141 00	52-50 TASK 804
• does not unlock with switch set to AUTO and correct code in keypad	525 151 00	52-50 TASK 806
• does not unlock with switch set to UNLKD	525 161 00	52-50 TASK 805
• LOCK FAIL light is on	525 171 00	52-50 TASK 809
• unlocks with switch set to DENY	525 181 00	52-50 TASK 807
52-6 DOORS - ENTRANCE STAIRS		
Airstair, forward		
• uncommanded motion	526 560 00	Reference Not Currently Available

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
56-1 WINDOWS - FLIGHT COMPARTMENT		
Window, flight compartment		
• delaminated, cracked, chipped, crazed, scratched, or has bubbles		
- no. 1 left	561 010 41	56-11 TASK 802
- no. 1 right	561 010 42	56-11 TASK 802
- no. 2 left	561 020 41	56-11 TASK 802
- no. 2 right	561 020 42	56-11 TASK 802
- no. 3 left	561 030 41	56-11 TASK 802
- no. 3 right	561 030 42	56-11 TASK 802
- no. 4 left	561 040 41	56-11 TASK 803
- no. 4 right	561 040 42	56-11 TASK 803
- no. 5 left	561 050 41	56-11 TASK 804
- no. 5 right	561 050 42	56-11 TASK 804
• Sliding difficult to operate		
- no. 2 left	561 070 41	56-11 TASK 801
- no. 2 right	561 070 42	56-11 TASK 801
• Sliding has air leak		
- no. 2 left	561 080 41	56-11 TASK 801
- no. 2 right	561 080 42	56-11 TASK 801
• windows need cleaning	561 060 00	56-11 TASK 805
71-0 POWER PLANT - GENERAL		
Birdstrike/FOD		
• in engine, engine had a surge/stall		
- engine 1	710 030 51	71-05 TASK 805
- engine 2	710 030 52	71-05 TASK 805
• in engine, engine parameters normal		
- engine 1	710 010 51	71-05 TASK 801
- engine 2	710 010 52	71-05 TASK 801
• in engine, engine parameters not normal or unknown		
- engine 1	710 020 51	71-05 TASK 801
- engine 2	710 020 52	71-05 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
71-0 POWER PLANT - GENERAL (continued)		
EGT, FF, oil pressure, and oil temperature indications		
• continue to show after engine shutdown		
- left engine	710 135 51	71-06 TASK 808
- right engine	710 135 52	71-06 TASK 808
Engine		
• slow to accelerate		
- left engine	710 260 51	73-05 TASK 814
- right engine	710 260 52	73-05 TASK 814
• slow to decelerate		
- left engine	710 270 51	73-05 TASK 816
- right engine	710 270 52	73-05 TASK 816
Engine Fire, Flames or Smoke		
• Flames or Smoke from the Engine Exhaust or Center Plug		
- engine 1	710 040 51	71-05 TASK 811
- engine 2	710 040 52	71-05 TASK 811
Engine overspeed		
• N1 over redline		
- engine 1	710 060 51	71-06 TASK 801
- engine 2	710 060 52	71-06 TASK 801
• N2 over redline		
- engine 1	710 070 51	71-06 TASK 802
- engine 2	710 070 52	71-06 TASK 802
• reverse thrust (N1) over limit, write maximum N1		
- engine 1	710 080 51	71-06 TASK 803
- engine 2	710 080 52	71-06 TASK 803
Engine overtemperature (except starting)		
• EGT over amber band limit due to surge/stall		
- engine 1	710 100 51	71-05 TASK 804
- engine 2	710 100 52	71-05 TASK 804
• EGT over amber band limit, no surge/stall		
- engine 1	710 090 51	71-06 TASK 804
- engine 2	710 090 52	71-06 TASK 804

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
71-0 POWER PLANT - GENERAL (continued)		
• EGT over redline due to surge/stall		
- engine 1	710 115 51	71-06 TASK 806
- engine 2	710 115 52	71-06 TASK 806
• EGT over redline, no surge/stall		
- engine 1	710 110 51	71-06 TASK 805
- engine 2	710 110 52	71-06 TASK 805
Engine parameters		
• EGT fluctuates at all power settings		
- engine 1	710 140 51	71-06 TASK 807
- engine 2	710 140 52	71-06 TASK 807
• EGT high		
- engine 1	710 150 51	71-06 TASK 807
- engine 2	710 150 52	71-06 TASK 807
• EGT low		
- engine 1	710 160 51	71-06 TASK 807
- engine 2	710 160 52	71-06 TASK 807
• N1, N2, EGT, and FF read low or fluctuate		
- engine 1	710 130 51	73-06 TASK 809
- engine 2	710 130 52	73-06 TASK 809
Engine surge/stall		
• Surge/stall during acceleration or deceleration, engine operation normal after thrust was decreased to idle, engine shutdown		
- engine 1	710 180 51	71-05 TASK 804
- engine 2	710 180 52	71-05 TASK 804
• Surge/stall during acceleration or deceleration, engine operation not normal after thrust was decreased to idle, engine shutdown		
- engine 1	710 190 51	71-05 TASK 804
- engine 2	710 190 52	71-05 TASK 804
• Surge/stall during reverse thrust, engine operation normal after thrust was decreased to idle		
- engine 1	710 240 51	71-05 TASK 804
- engine 2	710 240 52	71-05 TASK 804

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
71-0 POWER PLANT - GENERAL (continued)		
• Surge/stall during reverse thrust, engine operation not normal after thrust was decreased to idle		
- engine 1	710 250 51	71-05 TASK 804
- engine 2	710 250 52	71-05 TASK 804
• Surge/stall during takeoff, engine operation normal after surge		
- engine 1	710 200 51	71-05 TASK 804
- engine 2	710 200 52	71-05 TASK 804
• Surge/stall during takeoff, engine operation not normal after surge, engine shutdown		
- engine 1	710 210 51	71-05 TASK 804
- engine 2	710 210 52	71-05 TASK 804
Engine vibration		
• Vibration high		
- engine 1	710 232 51	71-05 TASK 808
- engine 2	710 232 52	71-05 TASK 808
Fumes or Smoke in Cabin		
• Pneumatic Power supplied by Engine		
- engine 1	710 300 51	71-05 TASK 807
- engine 2	710 300 52	71-05 TASK 807
Oil leakage or fuel leakage from drain at engine		
- left engine	710 811 51	71-05 TASK 810
- right engine	710 811 52	71-05 TASK 810
73-0 ENGINE FUEL AND CONTROL - GENERAL		
ALTN mode light for the EEC		
• light does not come ON during the EEC Test		
- engine 1	730 350 51	73-05 TASK 810
- engine 2	730 350 52	73-05 TASK 810
• light on		
- engine 1	730 080 51	73-05 TASK 811
- engine 2	730 080 52	73-05 TASK 811

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
73-0 ENGINE FUEL AND CONTROL - GENERAL (continued)		
EEC		
• does not power-up		
- engine 1	730 430 51	73-05 TASK 804
- engine 2	730 430 52	73-05 TASK 804
ENG FAIL message shows over EGT indication		
- engine 1	730 020 51	73-05 TASK 805
- engine 2	730 020 52	73-05 TASK 805
ENG VALVE CLOSED light		
• slow to go from Bright to Dim when the Start Lever is moved to CUTOFF		
- engine 1	730 030 51	73-06 TASK 802
- engine 2	730 030 52	73-06 TASK 802
• slow to go from Bright to OFF when the Start Lever is moved to IDLE		
- engine 1	730 040 51	73-06 TASK 803
- engine 2	730 040 52	73-06 TASK 803
• Stays off for all start lever positions		
- engine 1	730 061 51	73-06 TASK 815
- engine 2	730 061 52	73-06 TASK 815
• Stays off or bright when start lever moved to CUTOFF		
- engine 1	730 050 51	73-06 TASK 804
- engine 2	730 050 52	73-06 TASK 804
• Stays ON bright when the Start Lever is moved to IDLE; Engine start is normal		
- engine 1	730 060 51	73-06 TASK 805
- engine 2	730 060 52	73-06 TASK 805
Engine		
• Slow to shut down when start lever moved to CUTOFF		
- left engine	730 035 51	73-06 TASK 804
- right engine	730 035 52	73-06 TASK 804
Engine automatic acceleration with no thrust lever movement		
- engine 1	730 070 51	73-06 TASK 806
- engine 2	730 070 52	73-06 TASK 806

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
73-0 ENGINE FUEL AND CONTROL - GENERAL (continued)		
Engine BITE		
• BITE INOP shows on the CDU		
- engine 1	730 420 51	73-05 TASK 802
- engine 2	730 420 52	73-05 TASK 802
• CH A EEC DATA NOT AVAILABLE shows on the CDU		
- engine 1	730 400 51	73-05 TASK 803
- engine 2	730 400 52	73-05 TASK 803
• CH B EEC DATA NOT AVAILABLE shows on the CDU		
- engine 1	730 410 51	73-05 TASK 803
- engine 2	730 410 52	73-05 TASK 803
• ENGINE MAINTENANCE CAN NOT BE ACCESSED - THE ENGINE'S FLIGHT INDICATOR SHOWS FLIGHT shows on the CDU, airplane is on the ground		
- engine 1	730 440 51	73-05 TASK 813
- engine 2	730 440 52	73-05 TASK 813
• FLIGHT LEGS BETWEEN CHANNEL A AND CHANNEL B ARE NOT SYNCHRONIZED shows on Recent Faults page or Fault History page		
- engine 1	730 456 51	73-05 TASK 815
- engine 2	730 456 52	73-05 TASK 815
• maintenance message does not erase		
- engine 1	730 450 51	73-06 TASK 814
- engine 2	730 450 52	73-06 TASK 814
ENGINE CONTROL light		
• light does not come ON during the EEC Test		
- engine 1	730 330 51	73-06 TASK 813
- engine 2	730 330 52	73-06 TASK 813
• light on		
- engine 1	730 010 51	73-06 TASK 801
- engine 2	730 010 52	73-06 TASK 801
Engine flameout		
• engine restart not attempted; record engine condition		
- engine 1	730 150 51	73-06 TASK 808
- engine 2	730 150 52	73-06 TASK 808

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
73-0 ENGINE FUEL AND CONTROL - GENERAL (continued)		
• engine restart not OK, F/F low		
- engine 1	730 100 51	73-06 TASK 808
- engine 2	730 100 52	73-06 TASK 808
• engine restart not OK, F/F zero		
- engine 1	730 110 51	73-06 TASK 808
- engine 2	730 110 52	73-06 TASK 808
• engine restart not OK, low windmill N2		
- engine 1	730 130 51	73-06 TASK 808
- engine 2	730 130 52	73-06 TASK 808
• engine restart not OK, unknown/other reasons		
- engine 1	730 140 51	73-06 TASK 808
- engine 2	730 140 52	73-06 TASK 808
• engine restart not OK, VIB high		
- engine 1	730 120 51	71-05 TASK 808
- engine 2	730 120 52	71-05 TASK 808
• engine restart OK; record suspected cause of flameout		
- engine 1	730 090 51	73-06 TASK 807
- engine 2	730 090 52	73-06 TASK 807
Engine fuel indication		
• FF, N1, N2, and EGT read low or fluctuate		
- engine 1	730 160 51	73-06 TASK 809
- engine 2	730 160 52	73-06 TASK 809
• fuel flow is high, engine parameters (EGT, N1, N2) normal		
- engine 1	730 170 51	73-07 TASK 802
- engine 2	730 170 52	73-07 TASK 802
• fuel flow is intermittent or blank, engine parameters (EGT, N1, N2, and fuel used) normal		
- engine 1	730 180 51	73-07 TASK 802
- engine 2	730 180 52	73-07 TASK 802
• fuel flow is zero or low, engine parameters (EGT, N1, N2) not normal and fuel used is low		
- engine 1	730 200 51	73-06 TASK 809
- engine 2	730 200 52	73-06 TASK 809

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
73-0 ENGINE FUEL AND CONTROL - GENERAL (continued)		
• fuel flow is zero or low, engine parameters (EGT, N1, N2, and fuel used) normal		
- engine 1	730 190 51	73-07 TASK 802
- engine 2	730 190 52	73-07 TASK 802
• fuel used indication not normal, fuel flow normal		
- engine 1	730 210 51	73-07 TASK 801
- engine 2	730 210 52	73-07 TASK 801
Engine idle speed		
• Approach idle speed high		
- engine 1	730 220 51	73-05 TASK 806
- engine 2	730 220 52	73-05 TASK 806
• Approach idle speed low, ENG ANTI-ICE switch at ON		
- engine 1	730 230 51	73-07 TASK 803
- engine 2	730 230 52	73-07 TASK 803
• Approach idle speed low, landing flaps selected		
- engine 1	730 240 51	73-07 TASK 804
- engine 2	730 240 52	73-07 TASK 804
• Approach idle speed low, landing flaps selected and ENG ANTI-ICE switch at ON		
- engine 1	730 250 51	73-07 TASK 803
- engine 2	730 250 52	73-07 TASK 803
• minimum idle speed high		
- engine 1	730 260 51	73-05 TASK 807
- engine 2	730 260 52	73-05 TASK 807
• minimum idle speed low		
- engine 1	730 270 51	73-05 TASK 807
- engine 2	730 270 52	73-05 TASK 807
Engine takeoff thrust		
• low		
- engine 1	730 280 51	73-05 TASK 808
- engine 2	730 280 52	73-05 TASK 808

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
73-0 ENGINE FUEL AND CONTROL - GENERAL (continued)		
Engine thrust loss (automatic deceleration)		
• With no movement of thrust levers, engine parameters normal		
- engine 1	730 300 51	73-06 TASK 812
- engine 2	730 300 52	73-06 TASK 812
• With no movement of thrust levers, engine parameters not normal (VIB high)		
- engine 1	730 310 51	71-05 TASK 808
- engine 2	730 310 52	71-05 TASK 808
FILTER BYPASS light		
• light does not come ON during the EEC Test		
- engine 1	730 340 51	73-05 TASK 812
- engine 2	730 340 52	73-05 TASK 812
• light on		
- engine 1	730 320 51	73-05 TASK 801
- engine 2	730 320 52	73-05 TASK 801
76-0 ENGINE CONTROLS - GENERAL		
Forward thrust lever		
• Difficult to move in forward thrust		
- engine 1	760 020 51	76-05 TASK 802
- engine 2	760 020 52	76-05 TASK 802
• has lost motion, no engine response to thrust lever movement		
- engine 1	760 030 51	76-05 TASK 803
- engine 2	760 030 52	76-05 TASK 803
• jammed in forward thrust (no movement)		
- engine 1	760 025 51	76-05 TASK 804
- engine 2	760 025 52	76-05 TASK 804
• levers not aligned (staggered) for same N1 on both engines	760 010 00	76-05 TASK 801
Reverse thrust lever		
• Difficult to move in Reverse Thrust		
- engine 1	760 060 51	76-05 TASK 805
- engine 2	760 060 52	76-05 TASK 805

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
76-0 ENGINE CONTROLS - GENERAL (continued)		
• has lost motion, no engine response to Thrust Lever movement; Thrust Reverser operates normally		
- engine 1	760 080 51	76-05 TASK 806
- engine 2	760 080 52	76-05 TASK 806
• has lost motion, no Thrust Reverser operation		
- engine 1	760 070 51	76-05 TASK 807
- engine 2	760 070 52	76-05 TASK 807
• jammed in reverse thrust (no movement)		
- engine 1	760 065 51	76-05 TASK 808
- engine 2	760 065 52	76-05 TASK 808
Start Lever LED Light		
• does not come ON when the TEST Switch is set to the OVHT/FIRE position		
- engine 1	760 081 51	76-11 TASK 803
- engine 2	760 081 52	76-11 TASK 803
77-0 ENGINE INDICATION - GENERAL		
AVM signal conditioner		
• display blank	770 061 00	77-05 TASK 809
• flight history shows "00" for two of the vibration indications		
- engine 1	770 062 51	77-05 TASK 808
- engine 2	770 062 52	77-05 TASK 808
Engine EGT indication		
• blank		
- engine 1	770 010 51	73-05 TASK 804
- engine 2	770 010 52	73-05 TASK 804
• Zero or fluctuates		
- engine 1	770 015 51	77-05 TASK 801
- engine 2	770 015 52	77-05 TASK 801
Engine N1 indication		
• blank		
- engine 1	770 020 51	77-05 TASK 802
- engine 2	770 020 52	77-05 TASK 802

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
77-0 ENGINE INDICATION - GENERAL (continued)		
• fluctuates		
- engine 1	770 025 51	77-05 TASK 806
- engine 2	770 025 52	77-05 TASK 806
Engine N2 indication		
• blank		
- engine 1	770 030 51	77-05 TASK 803
- engine 2	770 030 52	77-05 TASK 803
• fluctuates		
- engine 1	770 035 51	77-05 TASK 807
- engine 2	770 035 52	77-05 TASK 807
Engine VIB indication		
• blank		
- engine 1	770 040 51	77-05 TASK 805
- engine 2	770 040 52	77-05 TASK 805
• Zero or fluctuates		
- engine 1	770 050 51	77-05 TASK 804
- engine 2	770 050 52	77-05 TASK 804
77-1 ENGINE INDICATION - ENGINE TACHOMETER SYSTEM		
Engine Tachometer System		
• Thrust Targets Do Not Agree Between ENG-1 and ENG-2	771 101 00	77-11 TASK 804
78-0 EXHAUST - GENERAL		
EAU BITE		
• Lights (all) do not come on during the BITE procedure	780 200 00	78-34 TASK 809
REVERSER light		
• light ON, Thrust Reverser operates normally		
- engine 1	780 020 51	78-34 TASK 801
- engine 2	780 020 52	78-34 TASK 801
Thrust Reverser Deploy		
• REV message does not show, thrust reverser does not deploy, and reverse thrust lever does not move to full reverse thrust		
- engine 1	780 030 51	78-34 TASK 807
- engine 2	780 030 52	78-34 TASK 807

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
78-0 EXHAUST - GENERAL (continued)		
• REV message shows amber, reverse thrust lever does not move to full reverse thrust		
- engine 1	780 050 51	78-34 TASK 802
- engine 2	780 050 52	78-34 TASK 802
• REV message shows amber, reverse thrust lever moves to full reverse thrust but engine does not go to full reverse thrust		
- engine 1	780 040 51	78-34 TASK 802
- engine 2	780 040 52	78-34 TASK 802
• REV message shows green, reverse thrust lever does not move to full reverse thrust		
- engine 1	780 060 51	78-34 TASK 803
- engine 2	780 060 52	78-34 TASK 803
• REV message shows green, reverse thrust lever moves to full reverse thrust but engine does not go to full reverse thrust		
- engine 1	780 065 51	78-34 TASK 804
- engine 2	780 065 52	78-34 TASK 804
• Reverse Thrust Levers set to Full Reverse Thrust, but ENG-1 and ENG-2 T/R Sleeves do not deploy		
- engine 1 and engine 2	780 201 48	78-34 TASK 810
• time to extend thrust reverser too slow (more than 3 seconds)		
- engine 1	780 070 51	78-34 TASK 805
- engine 2	780 070 52	78-34 TASK 805
Thrust Reverser Stow		
• REV message shows amber or green, ENG CONTROL light off, REVERSER light on		
- engine 1	780 090 51	78-34 TASK 806
- engine 2	780 090 52	78-34 TASK 806
• REV message shows amber or green, ENG CONTROL light on, REVERSER light off		
- engine 1	780 080 51	78-36 TASK 806
- engine 2	780 080 52	78-36 TASK 806

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
78-0 EXHAUST - GENERAL (continued)		
• REV message shows green, ENG CONTROL light off, REVERSER light on		
- engine 1	780 105 51	78-34 TASK 806
- engine 2	780 105 52	78-34 TASK 806
• REVERSER Light does not come ON momentarily during stow; Thrust Reverser operates normally		
- engine 1	780 100 51	78-34 TASK 808
- engine 2	780 100 52	78-34 TASK 808
• time to retract thrust reverser too slow (more than 5 seconds)		
- engine 1	780 110 51	78-34 TASK 805
- engine 2	780 110 52	78-34 TASK 805
79-0 OIL - GENERAL		
Engine oil consumption		
• high (oil quantity decreases at a quick rate)		
- engine 1	790 010 51	79-05 TASK 801
- engine 2	790 010 52	79-05 TASK 801
Engine oil pressure indication		
• high		
- engine 1	790 015 51	79-05 TASK 802
- engine 2	790 015 52	79-05 TASK 802
• intermittent or blank		
- engine 1	790 050 51	79-05 TASK 807
- engine 2	790 050 52	79-05 TASK 807
• low or zero (red)		
- engine 1	790 045 51	79-05 TASK 803
- engine 2	790 045 52	79-05 TASK 803
• red bar shows on oil pressure indication scale/bar		
- left engine	790 055 51	31-63 TASK 827
- right engine	790 055 52	31-63 TASK 827
Engine oil quantity indication		
• high		
- engine 1	790 060 51	79-05 TASK 808
- engine 2	790 060 52	79-05 TASK 808

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
79-0 OIL - GENERAL (continued)		
• inaccurate, intermittent, remains constant, or blank		
- engine 1	790 080 51	79-05 TASK 810
- engine 2	790 080 52	79-05 TASK 810
• low		
- engine 1	790 070 51	79-05 TASK 809
- engine 2	790 070 52	79-05 TASK 809
Engine oil temperature indication		
• high (amber)		
- engine 1	790 085 51	79-05 TASK 811
- engine 2	790 085 52	79-05 TASK 811
• high (red)		
- engine 1	790 090 51	79-05 TASK 812
- engine 2	790 090 52	79-05 TASK 812
• intermittent or blank		
- engine 1	790 100 51	79-05 TASK 815
- engine 2	790 100 52	79-05 TASK 815
• red bar shows on oil temperature indication scale/bar		
- left engine	790 095 51	31-63 TASK 827
- right engine	790 095 52	31-63 TASK 827
OIL FILTER BYPASS Message		
• does not show on the Engine Display during the EEC Test		
- ENG 1	790 120 51	79-05 TASK 818
- ENG 2	790 120 52	79-05 TASK 818
• shows on the Engine Display		
- ENG 1	790 110 51	79-05 TASK 817
- ENG 2	790 110 52	79-05 TASK 817
80-0 STARTING - GENERAL		
Engine motoring		
• no or low maximum dry motor speed (N2 low), duct pressure low (less than 30 psi), START VLV OPEN message shows on the engine display		
- engine 1	800 010 51	80-07 TASK 801
- engine 2	800 010 52	80-07 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
80-0 STARTING - GENERAL (continued)		
• no or low maximum dry motor speed (N2 low), duct pressure normal, START VLV OPEN message shows on the engine display		
- engine 1	800 020 51	80-07 TASK 802
- engine 2	800 020 52	80-07 TASK 802
Engine start		
• EGT increase and lightoff not normal (impending hot start), fuel flow and duct pressure normal		
- engine 1	800 030 51	80-05 TASK 801
- engine 2	800 030 52	80-05 TASK 801
• engine overtemperature, EGT red, engine did not have an automatic shutdown		
- engine 1	800 270 51	80-05 TASK 807
- engine 2	800 270 52	80-05 TASK 807
• engine overtemperature, EGT red, engine had an automatic shutdown		
- engine 1	800 070 51	80-05 TASK 802
- engine 2	800 070 52	80-05 TASK 802
• fuel flow high, EGT high, engine started		
- engine 1	800 080 51	80-05 TASK 803
- engine 2	800 080 52	80-05 TASK 803
• fuel flow low, high, or zero, EGT and N2 increase normal, engine started		
- engine 1	800 090 51	80-05 TASK 804
- engine 2	800 090 52	80-05 TASK 804
• No EGT Rise (no Lightoff) during L (R) Engine start attempt and Zero Fuel Flow indicated; ENG VALVE CLOSED and SPAR VALVE CLOSED Lights are OFF		
- engine 1	800 200 51	80-06 TASK 805
- engine 2	800 200 52	80-06 TASK 805
• No EGT Rise (no Lightoff) during L (R) Engine start attempt; Duct Pressure and N2 Normal and SPAR VALVE CLOSED Light is ON		
- engine 1	800 150 51	80-06 TASK 802
- engine 2	800 150 52	80-06 TASK 802

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
80-0 STARTING - GENERAL (continued)		
• no lightoff, duct pressure and N2 normal, ENG VALVE CLOSED light on		
- engine 1	800 140 51	80-06 TASK 801
- engine 2	800 140 52	80-06 TASK 801
• no lightoff, fuel flow normal, ignition switch at IGN L, engine start normal with ignition switch at IGN R or BOTH		
- engine 1	800 180 51	80-06 TASK 803
- engine 2	800 180 52	80-06 TASK 803
• no lightoff, fuel flow normal, ignition switch at IGN R, engine start normal with ignition switch at IGN L or BOTH		
- engine 1	800 190 51	80-06 TASK 804
- engine 2	800 190 52	80-06 TASK 804
• no N1 rotation, EGT and N2 increase normal, engine started		
- engine 1	800 110 51	80-05 TASK 805
- engine 2	800 110 52	80-05 TASK 805
• slow N2 acceleration to idle or hung start		
- engine 1	800 220 51	80-05 TASK 806
- engine 2	800 220 52	80-05 TASK 806
• START VLV OPEN message does not show on the engine display, N2 rotation normal		
- engine 1	800 050 51	80-07 TASK 803
- engine 2	800 050 52	80-07 TASK 803
• START VLV OPEN message does not show on the engine display, no N2 rotation		
- engine 1	800 060 51	80-07 TASK 804
- engine 2	800 060 52	80-07 TASK 804
• START VLV OPEN message flashes (for up to 10 seconds) and then stays on during engine engine operation		
- engine 1	800 062 51	80-07 TASK 809
- engine 2	800 062 52	80-07 TASK 809

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE	GO TO FIM TASK
80-0 STARTING - GENERAL (continued)		
Engine start switch		
• switch does not hold in GRD position, switch manually held in GRD position, N2 rotation normal		
- engine 1	800 230 51	80-07 TASK 805
- engine 2	800 230 52	80-07 TASK 805
• switch does not hold in GRD position, switch manually held in GRD position, no N2 rotation		
- engine 1	800 240 51	80-07 TASK 806
- engine 2	800 240 52	80-07 TASK 806
• Switch moves from GRD to OFF before N2 is at 55%, engine started		
- engine 1	800 250 51	80-07 TASK 807
- engine 2	800 250 52	80-07 TASK 807
• Switch stays at GRD after N2 is more than 55%, engine started		
- engine 1	800 260 51	80-07 TASK 808
- engine 2	800 260 52	80-07 TASK 808
99-9 SELF DEFENSE SYSTEM - ELECTRONIC WARFARE - ALL		
No faults occurred during the flight leg	999 999 99	31-98 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
COMMUNICATIONS/PUBLIC ADDRESS		
Boarding music:		
• distorted	C11 20 ---	23-31 TASK 807
• inoperative	C11 33 ---	23-31 TASK 807
• volume problem	C11 65 ---	23-31 TASK 807
Cabin attendant handset:		
• damaged	C12 12 ---	AIRLINE METHOD
• distorted	C12 20 ---	23-41 TASK 804
• inoperative	C12 33 ---	23-41 TASK 804
• volume problem	C12 65 ---	23-41 TASK 804
Chimes:		
• does not turn off	C14 83 ---	23-31 TASK 803
• does not turn on	C14 84 ---	23-31 TASK 804
• volume problem	C14 65 ---	23-31 TASK 802
Chimes light:		
• does not turn off	C18 83 ---	33-20 TASK 801
• does not turn on	C18 84 ---	33-20 TASK 801
Passenger address system:		
• distorted	C16 20 ---	23-31 TASK 805
• inoperative	C16 33 ---	23-31 TASK 805
• intermittent	C16 34 ---	23-31 TASK 805
• volume problem	C16 65 ---	23-31 TASK 802
Speaker:		
• inoperative	C17 33 ---	23-31 TASK 806
• intermittent	C17 34 ---	23-31 TASK 806
• noisy	C17 42 ---	23-31 TASK 806
• volume problem	C17 65 ---	23-31 TASK 806

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
DOORS/EXITS/WINDOWS		
Cabin window:		
• cracked	D11 15 ---	AIRLINE METHOD
• dirty	D11 17 ---	AIRLINE METHOD
• fogged/moisture between panes	D11 24 ---	56-21 TASK 801
• leaking	D11 36 ---	AIRLINE METHOD
• noisy	D11 42 ---	AIRLINE METHOD
• scratched	D11 51 ---	AIRLINE METHOD
Cabin window shade:		
• damaged	D12 12 ---	AIRLINE METHOD
• hard to operate	D12 29 ---	25-21 TASK 803
• loose	D12 37 ---	25-21 TASK 803
• missing	D12 39 ---	AIRLINE METHOD
• stuck	D12 58 ---	25-21 TASK 803
Door:		
• hard to close	D13 27 ---	52-10 TASK 807
• hard to open	D13 28 ---	52-10 TASK 807
Door grab handle:		
• damaged	D26 12 ---	AIRLINE METHOD
• missing	D26 39 ---	AIRLINE METHOD
Door handle:		
• does not stay upright	D16 81 ---	52-10 TASK 808
Door hold-open mechanism:		
• hard to operate	D18 29 ---	52-10 TASK 809
Door latch mechanism:		
• hard to operate	D19 29 ---	52-10 TASK 810
Door seal:		
• leaking	D22 36 ---	AIRLINE METHOD
• noisy	D22 42 ---	AIRLINE METHOD
• torn	D22 60 ---	AIRLINE METHOD

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
DOORS/EXITS/WINDOWS (continued)		
Door window:		
• cracked	D23 15 ---	AIRLINE METHOD
• dirty	D23 17 ---	AIRLINE METHOD
• fogged/moisture between panes	D23 24 ---	AIRLINE METHOD
• leaking	D23 36 ---	AIRLINE METHOD
• noisy	D23 42 ---	AIRLINE METHOD
• scratched	D23 51 ---	AIRLINE METHOD
Door window shade:		
• damaged	D24 12 ---	AIRLINE METHOD
• hard to operate	D24 29 ---	25-21 TASK 804
• loose	D24 37 ---	25-21 TASK 804
• missing	D24 39 ---	AIRLINE METHOD
• stuck	D24 58 ---	25-21 TASK 804

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
EMERGENCY EQUIPMENT		
Emergency area light:		
• does not turn off	E32 83 ---	33-50 TASK 801
• does not turn on	E32 84 ---	33-50 TASK 801
Emergency exit sign:		
• does not turn off	E12 83 ---	33-50 TASK 801
• does not turn on	E12 84 ---	33-50 TASK 801
Emergency floor proximity light:		
• does not turn off	E27 83 ---	33-50 TASK 801
• does not turn on	E27 84 ---	33-50 TASK 801
Escape slide pack bustle:		
• damaged	E13 12 ---	AIRLINE METHOD
• loose	E13 37 ---	AIRLINE METHOD
Escape slide pack pressure gauge:		
• damaged	E14 12 ---	AIRLINE METHOD
• hard to read	E14 94 ---	AIRLINE METHOD
• low pressure/quantity	E14 38 ---	AIRLINE METHOD
Escape strap:		
• damaged	E49 12 ---	AIRLINE METHOD
• does not stow	E49 82 ---	25-61 TASK 805
Extension seat belt:		
• damaged	E38 12 ---	AIRLINE METHOD
• missing	E38 39 ---	AIRLINE METHOD
Fire extinguisher:		
• missing	E15 39 ---	AIRLINE METHOD
• seal broken/missing	E15 96 ---	AIRLINE METHOD
• used	E15 64 ---	AIRLINE METHOD
First aid kit:		
• missing	E16 39 ---	AIRLINE METHOD
• seal broken/missing	E16 96 ---	AIRLINE METHOD
• used	E16 64 ---	AIRLINE METHOD

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
EMERGENCY EQUIPMENT (continued)		
Flashlight:		
• damaged	E17 12 ---	AIRLINE METHOD
• does not turn off	E17 83 ---	25-99 TASK 801
• does not turn on	E17 84 ---	25-99 TASK 801
• missing	E17 39 ---	AIRLINE METHOD
• needs service	E17 41 ---	AIRLINE METHOD
Flashlight LED:		
• does not turn on	E37 84 ---	25-99 TASK 801
Life vest, child:		
• damaged	E18 12 ---	AIRLINE METHOD
• missing	E18 39 ---	AIRLINE METHOD
Life vest, crew:		
• damaged	E19 12 ---	AIRLINE METHOD
• missing	E19 39 ---	AIRLINE METHOD
Life vest, demo:		
• damaged	E29 12 ---	AIRLINE METHOD
• missing	E29 39 ---	AIRLINE METHOD
Life vest, passenger:		
• damaged	E20 12 ---	AIRLINE METHOD
• missing	E20 39 ---	AIRLINE METHOD
Oxygen demo mask:		
• damaged	E21 12 ---	AIRLINE METHOD
• missing	E21 39 ---	AIRLINE METHOD
Oxygen mask door on PSU:		
• does not stay upright	E51 81 ---	35-22 TASK 804
Portable oxygen bottle:		
• low pressure/quantity	E22 38 ---	AIRLINE METHOD
• missing	E22 39 ---	AIRLINE METHOD
• used	E22 64 ---	AIRLINE METHOD
Portable oxygen mask:		
• damaged	E23 12 ---	AIRLINE METHOD
• missing	E23 39 ---	AIRLINE METHOD
• used	E23 64 ---	AIRLINE METHOD

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
EMERGENCY EQUIPMENT (continued)		
Therapeutic oxygen bottle:		
• low pressure/quantity	E55 38 ---	AIRLINE METHOD
• missing	E55 39 ---	AIRLINE METHOD
• used	E55 64 ---	AIRLINE METHOD
Therapeutic oxygen mask:		
• damaged	E56 12 ---	AIRLINE METHOD
• missing	E56 39 ---	AIRLINE METHOD
• used	E56 64 ---	AIRLINE METHOD

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
GALLEYS		
Cart restraint quarter turn:		
• missing	G24 39 ---	AIRLINE METHOD
• needs adjustment	G24 40 ---	AIRLINE METHOD
Coffee maker:		
• circuit breaker opens	G12 48 ---	AIRLINE METHOD
• damaged	G12 12 ---	AIRLINE METHOD
• inoperative	G12 33 ---	AIRLINE METHOD
• leaking	G12 36 ---	AIRLINE METHOD
• light does not come on	G12 21 ---	AIRLINE METHOD
• overflows	G12 44 ---	AIRLINE METHOD
• smoking or sparking	G12 55 ---	AIRLINE METHOD
Counter/shelf:		
• damaged	G26 12 ---	AIRLINE METHOD
• stuck	G26 58 ---	AIRLINE METHOD
Faucet in galley:		
• damaged	G13 12 ---	AIRLINE METHOD
• does not turn off	G13 83 ---	38-10 TASK 805
• does not turn on	G13 84 ---	38-10 TASK 806
• high pressure	G13 86 ---	38-10 TASK 809
• leaking	G13 36 ---	38-10 TASK 805
• low pressure/quantity	G13 38 ---	38-10 TASK 806
• no hot water	G13 87 ---	38-10 TASK 811
• no water	G13 43 ---	38-10 TASK 806
• overheats	G13 46 ---	38-10 TASK 808
Floor in galley:		
• damaged	G14 12 ---	AIRLINE METHOD
• dirty	G14 17 ---	AIRLINE METHOD
• loose	G14 37 ---	AIRLINE METHOD
• torn	G14 60 ---	AIRLINE METHOD
• weak/spongy	G14 66 ---	AIRLINE METHOD
• wet	G14 67 ---	AIRLINE METHOD

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
GALLEYS (continued)		
Folding cart:		
• damaged	G23 12 ---	AIRLINE METHOD
• latch or lock broken	G23 35 ---	AIRLINE METHOD
Galley power:		
• inoperative	G55 33 ---	25-31 TASK 801
Oven:		
• damaged	G16 12 ---	AIRLINE METHOD
• dirty	G16 17 ---	AIRLINE METHOD
• does not close/fasten	G16 71 ---	AIRLINE METHOD
• does not heat enough	G16 76 ---	AIRLINE METHOD
• does not open	G16 77 ---	AIRLINE METHOD
• inoperative	G16 33 ---	AIRLINE METHOD
• overheats	G16 46 ---	AIRLINE METHOD
• smells bad	G16 54 ---	AIRLINE METHOD
• smoking or sparking	G16 55 ---	AIRLINE METHOD
Sink in galley:		
• dirty	G17 17 ---	AIRLINE METHOD
• overflows	G17 44 ---	38-30 TASK 819
• plugged	G17 47 ---	38-30 TASK 819
• smells bad	G17 54 ---	AIRLINE METHOD
Warming oven:		
• damaged	G27 12 ---	AIRLINE METHOD
• dirty	G27 17 ---	AIRLINE METHOD
• does not close/fasten	G27 71 ---	AIRLINE METHOD
• does not heat enough	G27 76 ---	AIRLINE METHOD
• does not open	G27 77 ---	AIRLINE METHOD
• inoperative	G27 33 ---	AIRLINE METHOD
• overheats	G27 46 ---	AIRLINE METHOD
• smells bad	G27 54 ---	AIRLINE METHOD
• smoking or sparking	G27 55 ---	AIRLINE METHOD
Waste container door in galley:		
• does not close/fasten	G20 71 ---	AIRLINE METHOD
• missing	G20 39 ---	AIRLINE METHOD

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
GALLEYS (continued)		
Water supply in galley:		
• leaking	G52 36 ---	38-10 TASK 804
• poor quality	G52 49 ---	38-10 TASK 810
• smells bad	G52 54 ---	38-10 TASK 810
Work table in galley:		
• damaged	G21 12 ---	AIRLINE METHOD
• does not stay upright	G21 81 ---	AIRLINE METHOD

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
IN-FLIGHT ENTERTAINMENT SYSTEM		
Airshow:		
• inoperative	I34 33 ---	23-32 TASK 806
Audio entertainment player:		
• damaged	I28 12 ---	23-34 TASK 804
• does not turn off	I28 83 ---	23-34 TASK 803
• does not turn on	I28 84 ---	23-34 TASK 805
• inoperative	I28 33 ---	23-34 TASK 805
Seat audio:		
• does not turn off	I27 83 ---	23-34 TASK 803
• does not turn on	I27 84 ---	23-34 TASK 802
• inoperative	I27 33 ---	23-34 TASK 802
• intermittent	I27 34 ---	23-34 TASK 802
• poor audio quality	I27 98 ---	23-34 TASK 802
• volume problem	I27 65 ---	23-34 TASK 802
Seat audio channel select:		
• damaged	I31 12 ---	23-34 TASK 801
• inoperative	I31 33 ---	23-34 TASK 801
Seat audio jack:		
• loose	I29 37 ---	23-34 TASK 801
• plugged	I29 47 ---	23-34 TASK 801
Seat audio volume control:		
• damaged	I22 12 ---	23-34 TASK 801
• inoperative	I22 33 ---	23-34 TASK 801
Video monitor:		
• damaged	I11 12 ---	23-32 TASK 801
• inoperative	I11 33 ---	23-32 TASK 802
• poor picture quality	I11 97 ---	23-32 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
IN-FLIGHT ENTERTAINMENT SYSTEM (continued)		
Video tape reproducer:		
• does not eject	I26 72 ---	23-32 TASK 803
• does not rewind	I26 79 ---	23-32 TASK 803
• does not turn off	I26 83 ---	23-32 TASK 803
• inoperative	I26 33 ---	23-32 TASK 803
• poor audio quality	I26 98 ---	23-32 TASK 805
• poor picture quality	I26 97 ---	23-32 TASK 804
• shuts off	I26 52 ---	23-32 TASK 803

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
LIGHTS		
Attendant work light:		
• does not turn off	L31 83 ---	33-20 TASK 801
• does not turn on	L31 84 ---	33-20 TASK 801
Call light above passenger seat:		
• does not turn off	L11 83 ---	33-20 TASK 801
• does not turn on	L11 84 ---	33-20 TASK 801
Ceiling light, bin mounted:		
• does not turn off	L13 83 ---	33-20 TASK 801
• does not turn on	L13 84 ---	33-20 TASK 801
Ceiling light, recessed:		
• does not turn off	L30 83 ---	33-20 TASK 801
• does not turn on	L30 84 ---	33-20 TASK 801
Closet light:		
• does not turn off	L16 83 ---	33-20 TASK 801
• does not turn on	L16 84 ---	33-20 TASK 801
Entry light:		
• does not turn off	L17 83 ---	33-20 TASK 801
• does not turn on	L17 84 ---	33-20 TASK 801
Galley ceiling light:		
• does not turn off	L18 83 ---	33-20 TASK 801
• does not turn on	L18 84 ---	33-20 TASK 801
Galley work light:		
• does not turn off	L20 83 ---	33-20 TASK 801
• does not turn on	L20 84 ---	33-20 TASK 801
Lavatory light:		
• does not turn off	L19 83 ---	33-20 TASK 801
• does not turn on	L19 84 ---	33-20 TASK 801
Night light:		
• does not turn off	L21 83 ---	33-20 TASK 801
• does not turn on	L21 84 ---	33-20 TASK 801
Reading light:		
• does not turn off	L23 83 ---	33-20 TASK 801
• does not turn on	L23 84 ---	33-20 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
LIGHTS (continued)		
Window light:		
• does not turn off	L25 83 ---	33-20 TASK 801
• does not turn on	L25 84 ---	33-20 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
MISCELLANEOUS/CABIN GENERAL		
Area heater in door:		
• inoperative	M22 33 ---	21-45 TASK 801
Attendant control panel:		
• light comes on	M74 93 ---	23-42 TASK 839
• touch screen inoperative	M74 U5 ---	23-42 TASK 840
Bump strip in cabin:		
• damaged	M46 12 ---	AIRLINE METHOD
• missing	M46 39 ---	AIRLINE METHOD
CLEAN/CHECK SENSORS light on the attendant's panel:		
• light comes on	M63 93 ---	38-30 TASK 802
Carpet:		
• dirty	M11 17 ---	AIRLINE METHOD
• torn	M11 60 ---	AIRLINE METHOD
• wet	M11 67 ---	AIRLINE METHOD
Ceiling panel:		
• damaged	M12 12 ---	AIRLINE METHOD
• dirty	M12 17 ---	AIRLINE METHOD
• loose	M12 37 ---	AIRLINE METHOD
• missing	M12 39 ---	AIRLINE METHOD
• wet	M12 67 ---	38-10 TASK 804
Closet door:		
• damaged	M13 12 ---	AIRLINE METHOD
• hard to close	M13 27 ---	AIRLINE METHOD
• hard to open	M13 28 ---	AIRLINE METHOD
• latch or lock broken	M13 35 ---	AIRLINE METHOD
Compartment handle:		
• latch or lock broken	M28 35 ---	AIRLINE METHOD
Curtain:		
• dirty	M14 17 ---	AIRLINE METHOD
• missing	M14 39 ---	AIRLINE METHOD
• torn	M14 60 ---	AIRLINE METHOD

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
MISCELLANEOUS/CABIN GENERAL (continued)		
Curtain rails/hooks:		
• damaged	M48 12 ---	AIRLINE METHOD
• missing	M48 39 ---	AIRLINE METHOD
Curtain tie backs:		
• damaged	M15 12 ---	AIRLINE METHOD
• dirty	M15 17 ---	AIRLINE METHOD
• does not lock in place	M15 85 ---	AIRLINE METHOD
• missing	M15 39 ---	AIRLINE METHOD
• torn	M15 60 ---	AIRLINE METHOD
Door entry mats:		
• damaged	M49 12 ---	AIRLINE METHOD
• dirty	M49 17 ---	AIRLINE METHOD
• loose	M49 37 ---	AIRLINE METHOD
• missing	M49 39 ---	AIRLINE METHOD
Emergency exit door area:		
• too cold	M62 14 ---	21-45 TASK 802
Fasten-seat-belt sign:		
• does not turn off	M23 83 ---	33-20 TASK 801
• does not turn on	M23 84 ---	33-20 TASK 801
Floor in cabin:		
• weak/spongy	M47 66 ---	AIRLINE METHOD
Insects:		
• detected on airplane	M55 99 ---	AIRLINE METHOD
LAVS INOP light on the attendant's panel:		
• light comes on	M64 93 ---	38-30 TASK 802
Lavatory-occupied sign:		
• does not turn off	M17 83 ---	33-20 TASK 801
• does not turn on	M17 84 ---	33-20 TASK 801
No-smoking sign:		
• does not turn off	M19 83 ---	33-20 TASK 801
• does not turn on	M19 84 ---	33-20 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
MISCELLANEOUS/CABIN GENERAL (continued)		
Overhead stowage bin:		
• damaged	M20 12 ---	AIRLINE METHOD
• dirty	M20 17 ---	AIRLINE METHOD
• does not close/fasten	M20 71 ---	25-24 TASK 801
• does not open	M20 77 ---	25-24 TASK 801
• latch or lock broken	M20 35 ---	AIRLINE METHOD
• needs adjustment	M20 40 ---	25-24 TASK 801
• wet	M20 67 ---	AIRLINE METHOD
Placard/decal in cabin:		
• damaged	M50 12 ---	AIRLINE METHOD
• incorrect	M50 32 ---	AIRLINE METHOD
• missing	M50 39 ---	AIRLINE METHOD
Potable water indicator:		
• low pressure/quantity	M60 38 ---	38-10 TASK 812
Rodent:		
• detected on airplane	M54 99 ---	AIRLINE METHOD
Sidewall panel:		
• damaged	M24 12 ---	AIRLINE METHOD
• dirty	M24 17 ---	AIRLINE METHOD
• loose	M24 37 ---	AIRLINE METHOD
Stowage compartment door:		
• damaged	M59 12 ---	AIRLINE METHOD
• hard to close	M59 27 ---	AIRLINE METHOD
• hard to open	M59 28 ---	AIRLINE METHOD
• latch or lock broken	M59 35 ---	AIRLINE METHOD

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
SEATS		
Flight attendant seat:		
• damaged	S15 12 ---	AIRLINE METHOD
• dirty	S15 17 ---	AIRLINE METHOD
• does not close/fasten	S15 71 ---	AIRLINE METHOD
• does not open	S15 77 ---	AIRLINE METHOD
• hard to operate	S15 29 ---	AIRLINE METHOD
• loose	S15 37 ---	AIRLINE METHOD
• torn	S15 60 ---	AIRLINE METHOD
• wet	S15 67 ---	AIRLINE METHOD
Flight attendant seat harness:		
• damaged	S16 12 ---	AIRLINE METHOD
• hard to operate	S16 29 ---	AIRLINE METHOD
• needs adjustment	S16 40 ---	AIRLINE METHOD
Passenger service unit air outlet:		
• inoperative	S35 33 ---	25-23 TASK 801
Passenger service unit panel:		
• does not close/fasten	S34 71 ---	25-23 TASK 801
• loose	S34 37 ---	25-23 TASK 801
Seat aisle trim:		
• damaged	S20 12 ---	AIRLINE METHOD
• loose	S20 37 ---	AIRLINE METHOD
Seat armrest:		
• damaged	S11 12 ---	AIRLINE METHOD
• does not extend/lower	S11 73 ---	AIRLINE METHOD
• needs adjustment	S11 40 ---	AIRLINE METHOD
Seat ashtray:		
• damaged	S12 12 ---	AIRLINE METHOD
• does not close/fasten	S12 71 ---	AIRLINE METHOD
• does not open	S12 77 ---	AIRLINE METHOD
• missing	S12 39 ---	AIRLINE METHOD
• needs adjustment	S12 40 ---	AIRLINE METHOD
Seat assembly:		
• loose	S21 37 ---	AIRLINE METHOD

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
SEATS (continued)		
Seat back:		
• damaged	S22 12 ---	25-22 TASK 801
• dirty	S22 17 ---	AIRLINE METHOD
• does not recline	S22 78 ---	25-22 TASK 801
• does not stay upright	S22 81 ---	25-22 TASK 801
• loose	S22 37 ---	AIRLINE METHOD
• torn	S22 60 ---	AIRLINE METHOD
• wet	S22 67 ---	AIRLINE METHOD
Seat back pocket:		
• damaged	S23 12 ---	AIRLINE METHOD
• dirty	S23 17 ---	AIRLINE METHOD
• torn	S23 60 ---	AIRLINE METHOD
• wet	S23 67 ---	AIRLINE METHOD
Seat belt:		
• damaged	S24 12 ---	AIRLINE METHOD
• dirty	S24 17 ---	AIRLINE METHOD
• inoperative	S24 33 ---	AIRLINE METHOD
• missing	S24 39 ---	AIRLINE METHOD
Seat bottom cushion:		
• dirty	S25 17 ---	AIRLINE METHOD
• smells bad	S25 54 ---	AIRLINE METHOD
• stained	S25 57 ---	AIRLINE METHOD
• torn	S25 60 ---	AIRLINE METHOD
• wet	S25 67 ---	AIRLINE METHOD
Seat footrest:		
• damaged	S13 12 ---	AIRLINE METHOD
• dirty	S13 17 ---	AIRLINE METHOD
• hard to operate	S13 29 ---	AIRLINE METHOD
• inoperative	S13 33 ---	AIRLINE METHOD
• torn	S13 60 ---	AIRLINE METHOD
• wet	S13 67 ---	AIRLINE METHOD

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
SEATS (continued)		
Seat headrest:		
• damaged	S14 12 ---	AIRLINE METHOD
• dirty	S14 17 ---	AIRLINE METHOD
• hard to operate	S14 29 ---	AIRLINE METHOD
• inoperative	S14 33 ---	AIRLINE METHOD
• loose	S14 37 ---	AIRLINE METHOD
• torn	S14 60 ---	AIRLINE METHOD
• wet	S14 67 ---	AIRLINE METHOD
Seat legrest:		
• damaged	S29 12 ---	AIRLINE METHOD
• dirty	S29 17 ---	AIRLINE METHOD
• does not stow	S29 82 ---	AIRLINE METHOD
• hard to operate	S29 29 ---	AIRLINE METHOD
• inoperative	S29 33 ---	AIRLINE METHOD
• torn	S29 60 ---	AIRLINE METHOD
• wet	S29 67 ---	AIRLINE METHOD
Seat safety card:		
• damaged	S19 12 ---	AIRLINE METHOD
• incorrect	S19 32 ---	AIRLINE METHOD
• missing	S19 39 ---	AIRLINE METHOD
Seat track insert:		
• damaged	S26 12 ---	AIRLINE METHOD
• loose	S26 37 ---	AIRLINE METHOD
• missing	S26 39 ---	AIRLINE METHOD
Seat tray table:		
• damaged	S27 12 ---	AIRLINE METHOD
• dirty	S27 17 ---	AIRLINE METHOD
• does not stow	S27 82 ---	AIRLINE METHOD
• latch or lock broken	S27 35 ---	AIRLINE METHOD
• needs adjustment	S27 40 ---	AIRLINE METHOD

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
TOILETS/LAVATORIES		
Countertop in lavatory:		
• damaged	T12 12 ---	AIRLINE METHOD
• dirty	T12 17 ---	AIRLINE METHOD
Door to lavatory:		
• damaged	T13 12 ---	AIRLINE METHOD
• does not close/fasten	T13 71 ---	AIRLINE METHOD
• does not open	T13 77 ---	AIRLINE METHOD
• latch or lock broken	T13 35 ---	AIRLINE METHOD
Faucet in lavatory:		
• damaged	T14 12 ---	AIRLINE METHOD
• does not turn off	T14 83 ---	38-10 TASK 807
• does not turn on	T14 84 ---	38-10 TASK 806
• high pressure	T14 86 ---	38-10 TASK 809
• leaking	T14 36 ---	38-10 TASK 807
• low pressure/quantity	T14 38 ---	38-10 TASK 806
• no hot water	T14 87 ---	38-10 TASK 811
• no water	T14 43 ---	38-10 TASK 806
• overheats	T14 46 ---	38-10 TASK 808
Floor in lavatory:		
• dirty	T31 17 ---	AIRLINE METHOD
Grab handle in lavatory:		
• damaged	T15 12 ---	AIRLINE METHOD
• dirty	T15 17 ---	AIRLINE METHOD
Mirror in lavatory:		
• damaged	T16 12 ---	AIRLINE METHOD
• dirty	T16 17 ---	AIRLINE METHOD
• loose	T16 37 ---	AIRLINE METHOD
Return-to-seat sign in lavatory:		
• does not turn off	T18 83 ---	33-20 TASK 801
• does not turn on	T18 84 ---	33-20 TASK 801
Sink drain stopper in lavatory:		
• inoperative	T20 33 ---	38-30 TASK 818


ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
TOILETS/LAVATORIES (continued)		
Sink in lavatory:		
• dirty	T32 17 ---	AIRLINE METHOD
• plugged	T32 47 ---	38-30 TASK 819
Smoke detector:		
• damaged	T21 12 ---	AIRLINE METHOD
• disconnected	T21 19 ---	AIRLINE METHOD
• does not turn off	T21 83 ---	26-14 TASK 801
• inoperative	T21 33 ---	AIRLINE METHOD
• loose	T21 37 ---	AIRLINE METHOD
• missing	T21 39 ---	AIRLINE METHOD
Soap dispenser:		
• damaged	T22 12 ---	AIRLINE METHOD
• empty	T22 22 ---	AIRLINE METHOD
• hard to operate	T22 29 ---	AIRLINE METHOD
• inoperative	T22 33 ---	AIRLINE METHOD
• leaking	T22 36 ---	AIRLINE METHOD
Toilet bowl:		
• damaged	T23 12 ---	AIRLINE METHOD
• dirty	T23 17 ---	AIRLINE METHOD
• overflows	T23 44 ---	38-30 TASK 814
• plugged	T23 47 ---	38-30 TASK 815
• smells bad	T23 54 ---	AIRLINE METHOD
Toilet flush button:		
• damaged	T24 12 ---	AIRLINE METHOD
• dirty	T24 17 ---	AIRLINE METHOD
Toilet flush system:		
• does not flush	T25 74 ---	38-30 TASK 811
• does not turn off	T25 83 ---	38-30 TASK 816
• plugged	T25 47 ---	38-30 TASK 817
Toilet roll holder:		
• damaged	T39 12 ---	AIRLINE METHOD
• missing	T39 39 ---	AIRLINE METHOD

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT DESCRIPTION	FAULT CODE (location ---)	GO TO FIM TASK
TOILETS/LAVATORIES (continued)		
Toilet seat:		
• damaged	T26 12 ---	AIRLINE METHOD
• dirty	T26 17 ---	AIRLINE METHOD
• missing	T26 39 ---	AIRLINE METHOD
Toilet seat lid:		
• damaged	T27 12 ---	AIRLINE METHOD
• dirty	T27 17 ---	AIRLINE METHOD
• missing	T27 39 ---	AIRLINE METHOD
Waste chute door in lavatory:		
• damaged	T28 12 ---	AIRLINE METHOD
• needs adjustment	T28 40 ---	25-40 TASK 801
• plugged	T28 47 ---	AIRLINE METHOD
Water supply in lavatory:		
• poor quality	T41 49 ---	38-10 TASK 810
• smells bad	T41 54 ---	38-10 TASK 810

ECCN 9E991 BOEING PROPRIETARY - See title page for details

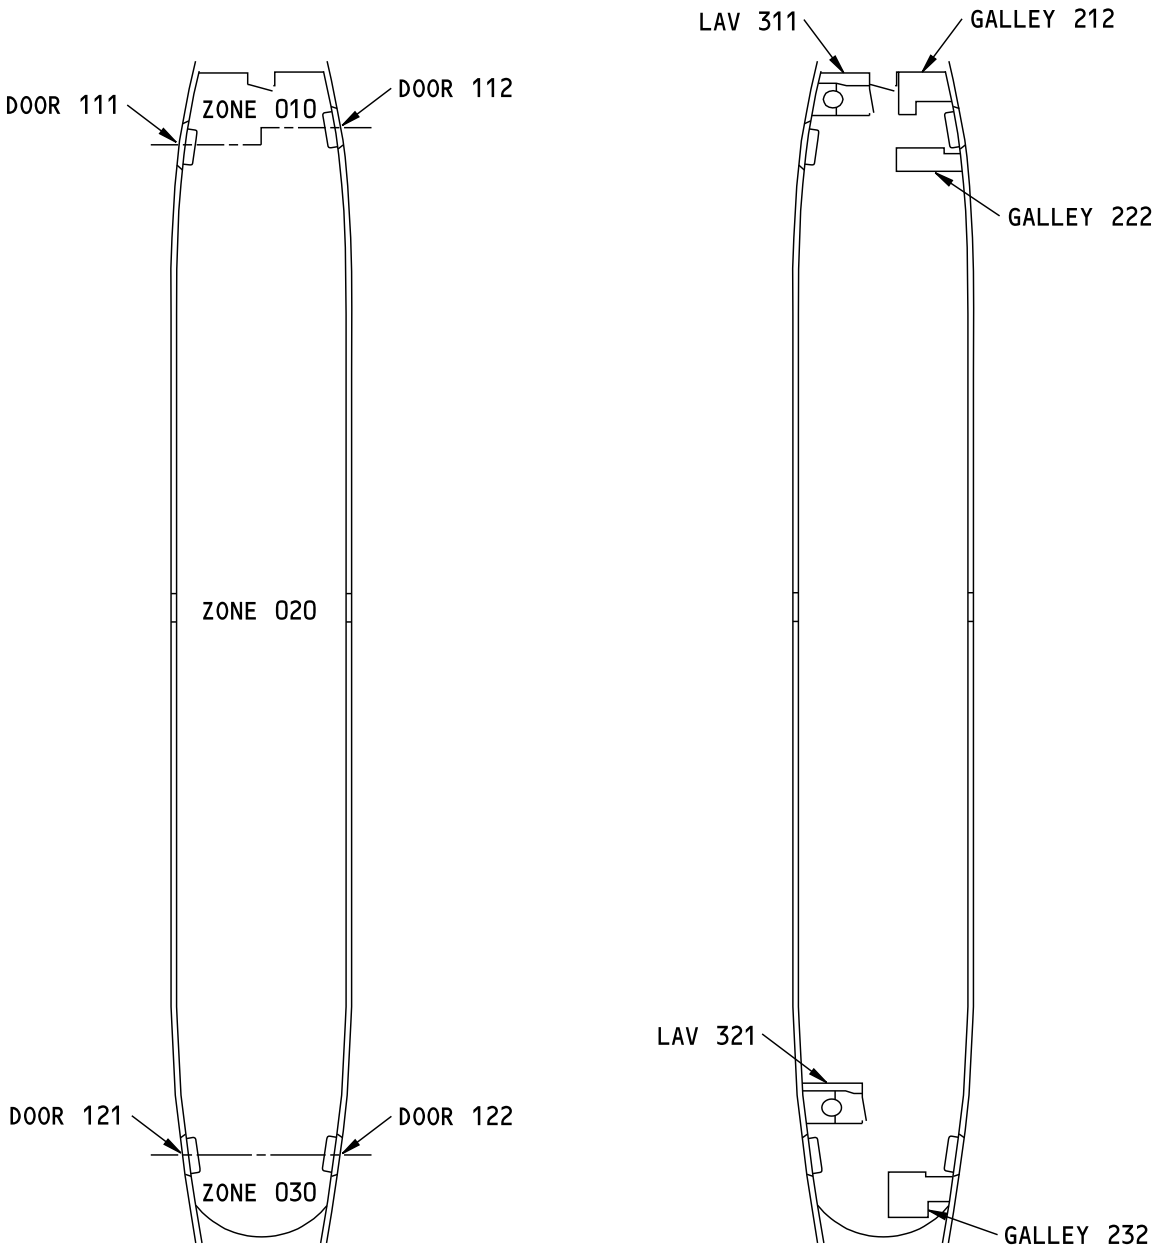

NOTE:
- Use seat number of nearest seat if you do not find a location code here.
- Use location code of the applicable zone if fault occurs in entire zone.
- Use location code "000" if fault occurs in entire cabin.


G52538 S0000153099_V1

Location Codes - Doors, Zones, Galleys, and Lavatories
Figure 1 (Sheet 1 of 2)

EFFECTIVITY
OMR 701-799, 802, 805, 809, 810, 812, 813, 815, 816, 818-826, 901-999

CABIN FAULT LOCATOR

ECCN 9E991 BOEING PROPRIETARY - See title page for details

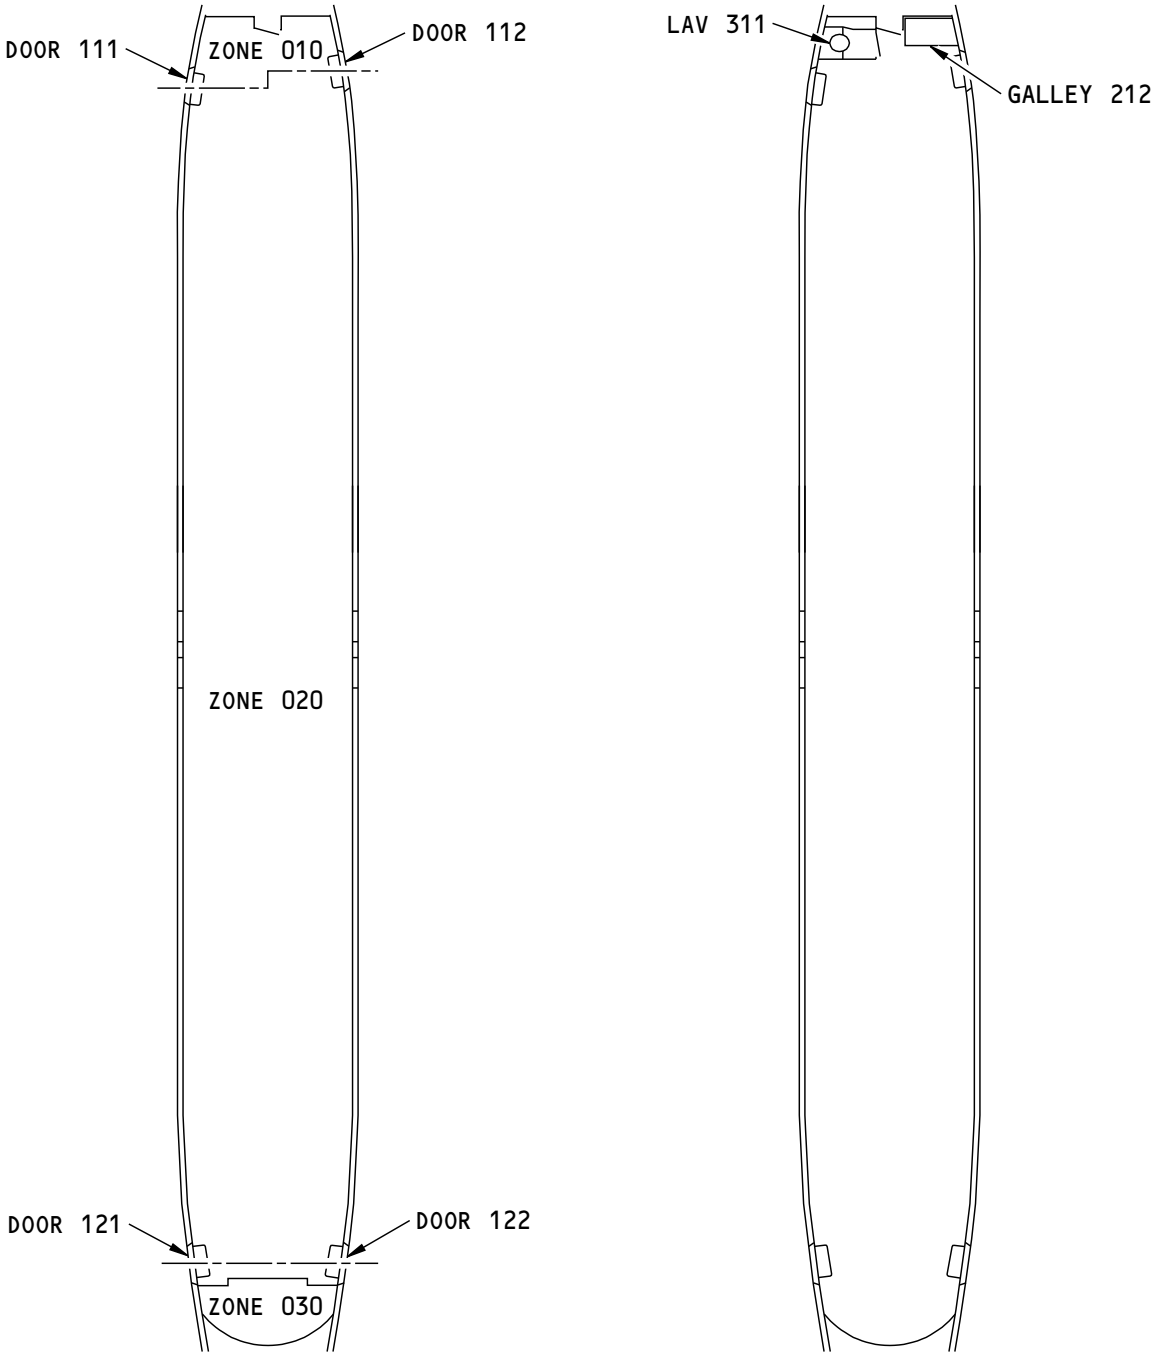


NOTE: • USE SEAT NUMBER OF NEAREST SEAT IF YOU DO NOT FIND A LOCATION CODE HERE.
• USE LOCATION CODE OF THE APPLICABLE ZONE IF FAULT OCCURS IN ENTIRE ZONE.
• USE LOCATION CODE "OOO" IF FAULT OCCURS IN ENTIRE CABIN.

2789648 S0000634386_V1

Location Codes - Doors, Zones, Galleys, and Lavatories
Figure 1 (Sheet 2 of 2)

ECCN 9E991 BOEING PROPRIETARY - See title page for details

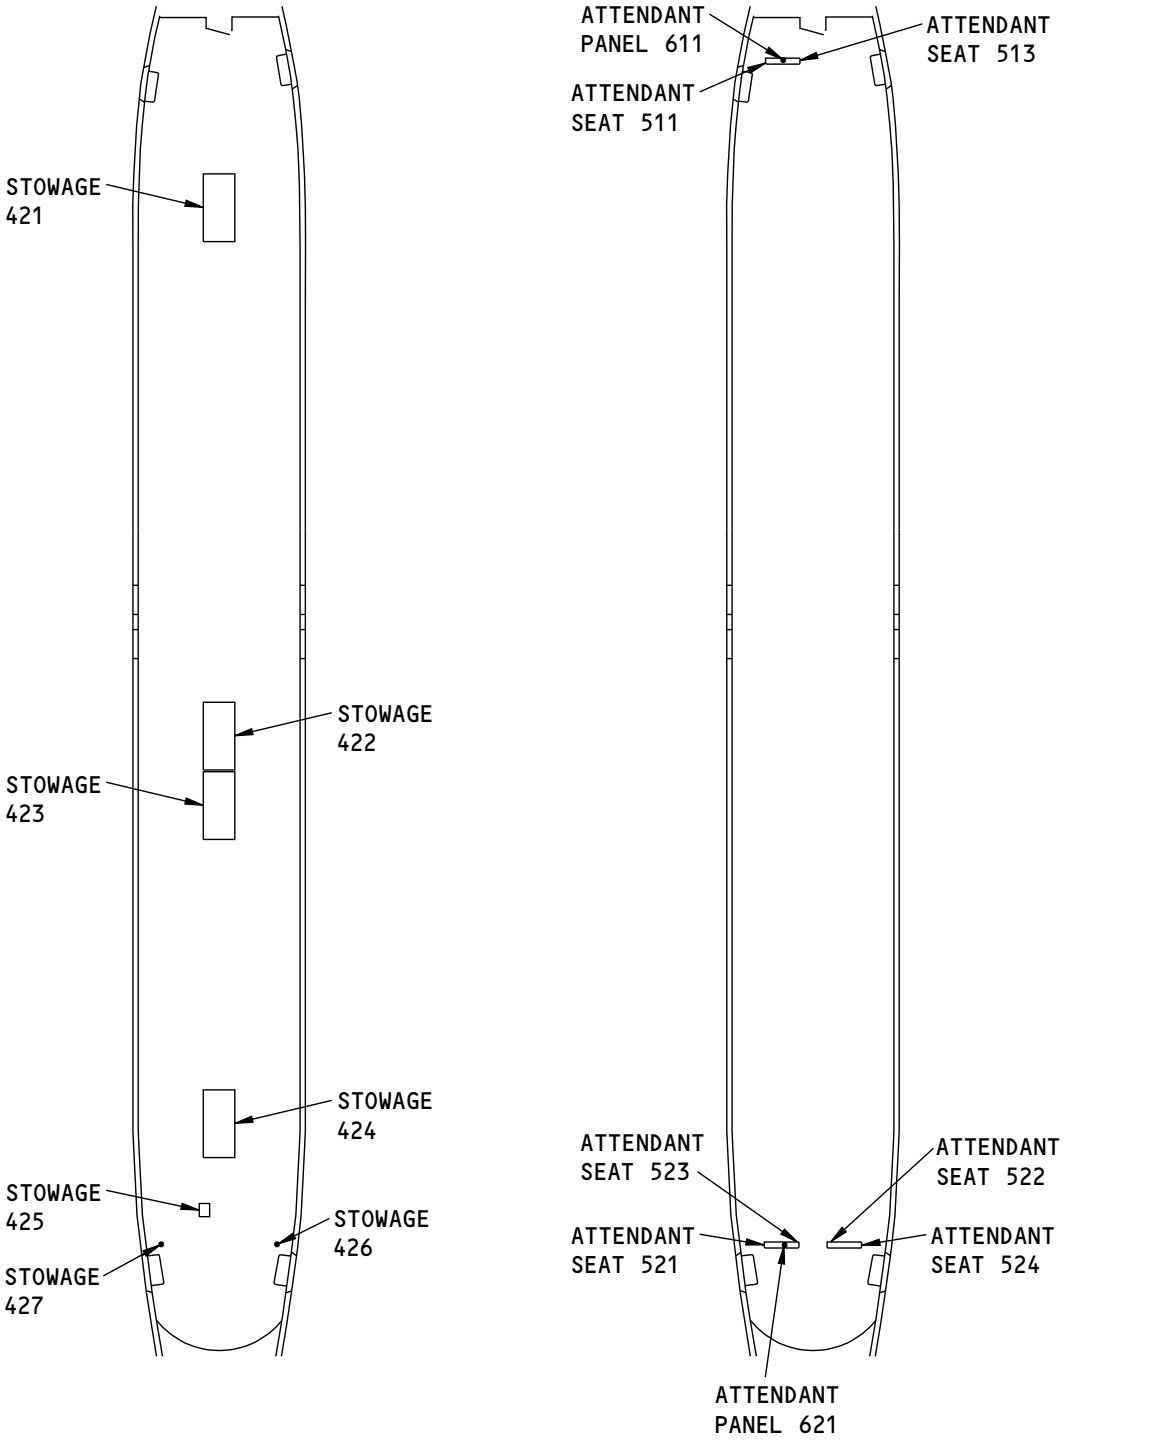


Location Codes - Closets, Stowage, Attendant Seats and Panels
Figure 2 (Sheet 1 of 2)

EFFECTIVITY
OMR 701-799, 802, 805, 809, 810, 812, 813, 815, 816, 818-826, 901-999

CABIN FAULT LOCATOR

ECCN 9E991 BOEING PROPRIETARY - See title page for details

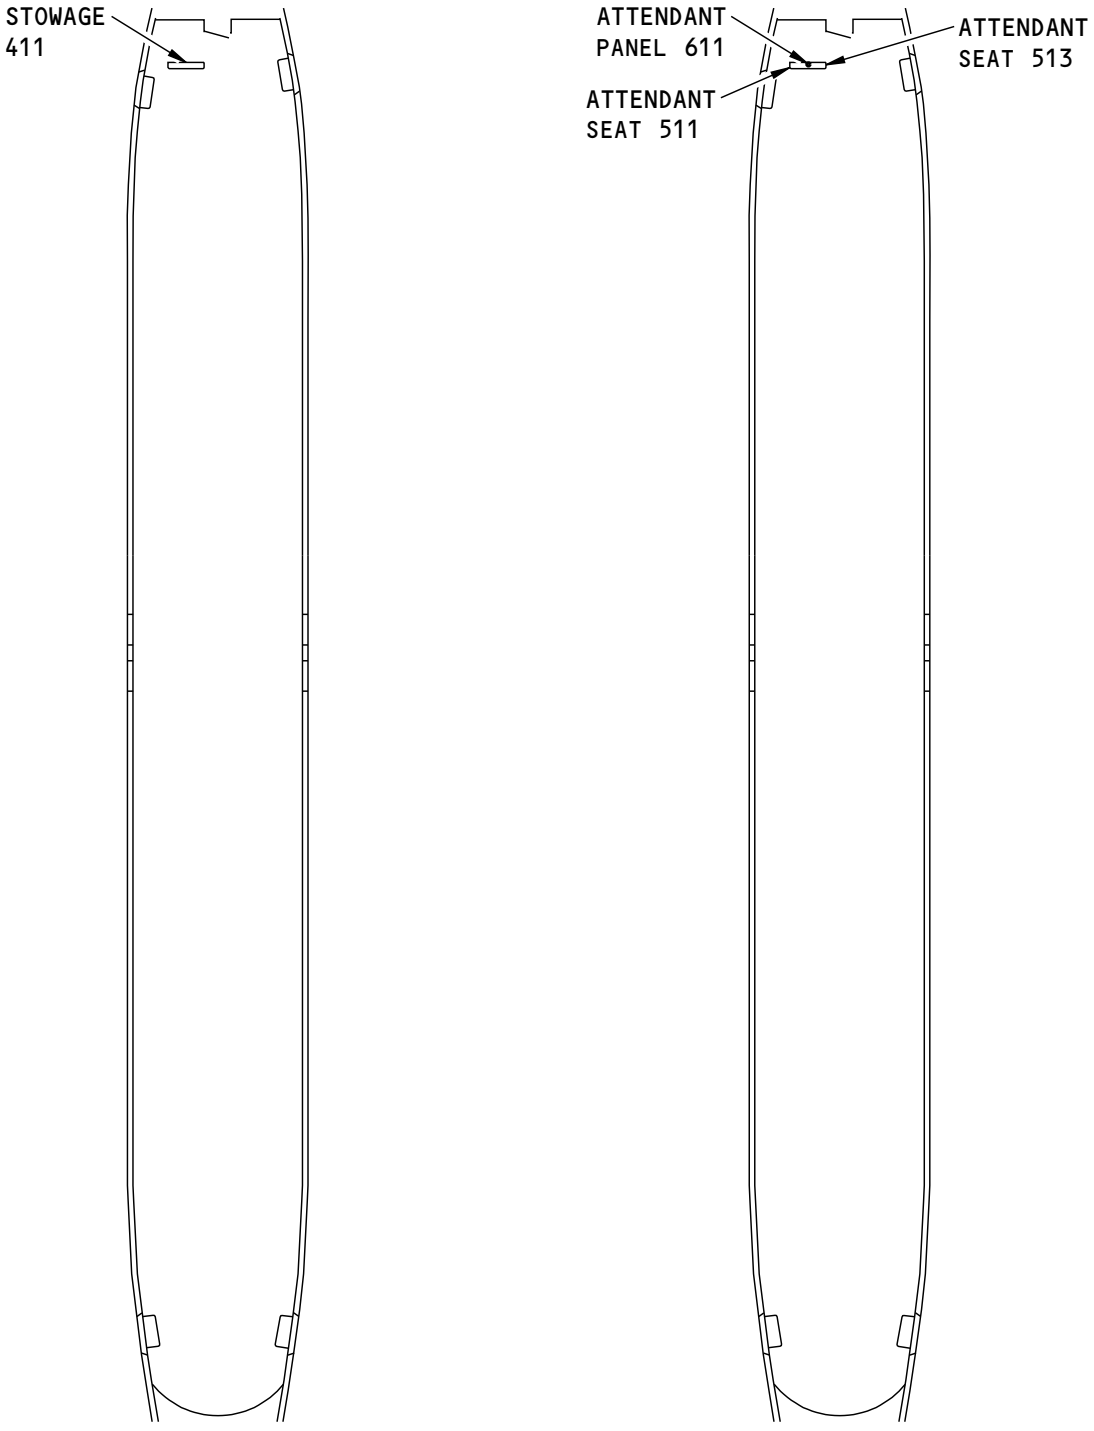

3023339 S0000795440_V1

Location Codes - Closets, Stowage, Attendant Seats and Panels
Figure 2 (Sheet 2 of 2)

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT CODE	FAULT DESCRIPTION	GO TO FIM TASK
C11 20 ---	Boarding music: distorted.	23-31 TASK 807
C11 33 ---	Boarding music: inoperative.	23-31 TASK 807
C11 65 ---	Boarding music: volume problem.	23-31 TASK 807
C12 12 ---	Cabin attendant handset: damaged.	AIRLINE METHOD
C12 20 ---	Cabin attendant handset: distorted.	23-41 TASK 804
C12 33 ---	Cabin attendant handset: inoperative.	23-41 TASK 804
C12 65 ---	Cabin attendant handset: volume problem.	23-41 TASK 804
C14 65 ---	Chimes: volume problem.	23-31 TASK 802
C14 83 ---	Chimes: does not turn off.	23-31 TASK 803
C14 84 ---	Chimes: does not turn on.	23-31 TASK 804
C16 20 ---	Passenger address system: distorted.	23-31 TASK 805
C16 33 ---	Passenger address system: inoperative.	23-31 TASK 805
C16 34 ---	Passenger address system: intermittent.	23-31 TASK 805
C16 65 ---	Passenger address system: volume problem.	23-31 TASK 802
C17 33 ---	Speaker: inoperative.	23-31 TASK 806
C17 34 ---	Speaker: intermittent.	23-31 TASK 806
C17 42 ---	Speaker: noisy.	23-31 TASK 806
C17 65 ---	Speaker: volume problem.	23-31 TASK 806
C18 83 ---	Chimes light: does not turn off.	33-20 TASK 801
C18 84 ---	Chimes light: does not turn on.	33-20 TASK 801
D11 15 ---	Cabin window: cracked.	AIRLINE METHOD
D11 17 ---	Cabin window: dirty.	AIRLINE METHOD
D11 24 ---	Cabin window: fogged/moisture between panes.	56-21 TASK 801
D11 36 ---	Cabin window: leaking.	AIRLINE METHOD
D11 42 ---	Cabin window: noisy.	AIRLINE METHOD
D11 51 ---	Cabin window: scratched.	AIRLINE METHOD
D12 12 ---	Cabin window shade: damaged.	AIRLINE METHOD
D12 29 ---	Cabin window shade: hard to operate.	25-21 TASK 803
D12 37 ---	Cabin window shade: loose.	25-21 TASK 803
D12 39 ---	Cabin window shade: missing.	AIRLINE METHOD
D12 58 ---	Cabin window shade: stuck.	25-21 TASK 803
D13 27 ---	Door: hard to close.	52-10 TASK 807
D13 28 ---	Door: hard to open.	52-10 TASK 807
D16 81 ---	Door handle: does not stay upright.	52-10 TASK 808
D18 29 ---	Door hold-open mechanism: hard to operate.	52-10 TASK 809

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT CODE	FAULT DESCRIPTION	GO TO FIM TASK
D19 29 ---	Door latch mechanism: hard to operate.	52-10 TASK 810
D22 36 ---	Door seal: leaking.	AIRLINE METHOD
D22 42 ---	Door seal: noisy.	AIRLINE METHOD
D22 60 ---	Door seal: torn.	AIRLINE METHOD
D23 15 ---	Door window: cracked.	AIRLINE METHOD
D23 17 ---	Door window: dirty.	AIRLINE METHOD
D23 24 ---	Door window: fogged/moisture between panes.	AIRLINE METHOD
D23 36 ---	Door window: leaking.	AIRLINE METHOD
D23 42 ---	Door window: noisy.	AIRLINE METHOD
D23 51 ---	Door window: scratched.	AIRLINE METHOD
D24 12 ---	Door window shade: damaged.	AIRLINE METHOD
D24 29 ---	Door window shade: hard to operate.	25-21 TASK 804
D24 37 ---	Door window shade: loose.	25-21 TASK 804
D24 39 ---	Door window shade: missing.	AIRLINE METHOD
D24 58 ---	Door window shade: stuck.	25-21 TASK 804
D26 12 ---	Door grab handle: damaged.	AIRLINE METHOD
D26 39 ---	Door grab handle: missing.	AIRLINE METHOD
E12 83 ---	Emergency exit sign: does not turn off.	33-50 TASK 801
E12 84 ---	Emergency exit sign: does not turn on.	33-50 TASK 801
E13 12 ---	Escape slide pack bustle: damaged.	AIRLINE METHOD
E13 37 ---	Escape slide pack bustle: loose.	AIRLINE METHOD
E14 12 ---	Escape slide pack pressure gauge: damaged.	AIRLINE METHOD
E14 38 ---	Escape slide pack pressure gauge: low pressure/quantity.	AIRLINE METHOD
E14 94 ---	Escape slide pack pressure gauge: hard to read.	AIRLINE METHOD
E15 39 ---	Fire extinguisher: missing.	AIRLINE METHOD
E15 64 ---	Fire extinguisher: used.	AIRLINE METHOD
E15 96 ---	Fire extinguisher: seal broken/missing.	AIRLINE METHOD
E16 39 ---	First aid kit: missing.	AIRLINE METHOD
E16 64 ---	First aid kit: used.	AIRLINE METHOD
E16 96 ---	First aid kit: seal broken/missing.	AIRLINE METHOD
E17 12 ---	Flashlight: damaged.	AIRLINE METHOD
E17 39 ---	Flashlight: missing.	AIRLINE METHOD
E17 41 ---	Flashlight: needs service.	AIRLINE METHOD
E17 83 ---	Flashlight: does not turn off.	25-99 TASK 801
E17 84 ---	Flashlight: does not turn on.	25-99 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT CODE	FAULT DESCRIPTION	GO TO FIM TASK
E18 12 ---	Life vest, child: damaged.	AIRLINE METHOD
E18 39 ---	Life vest, child: missing.	AIRLINE METHOD
E19 12 ---	Life vest, crew: damaged.	AIRLINE METHOD
E19 39 ---	Life vest, crew: missing.	AIRLINE METHOD
E20 12 ---	Life vest, passenger: damaged.	AIRLINE METHOD
E20 39 ---	Life vest, passenger: missing.	AIRLINE METHOD
E21 12 ---	Oxygen demo mask: damaged.	AIRLINE METHOD
E21 39 ---	Oxygen demo mask: missing.	AIRLINE METHOD
E22 38 ---	Portable oxygen bottle: low pressure/quantity.	AIRLINE METHOD
E22 39 ---	Portable oxygen bottle: missing.	AIRLINE METHOD
E22 64 ---	Portable oxygen bottle: used.	AIRLINE METHOD
E23 12 ---	Portable oxygen mask: damaged.	AIRLINE METHOD
E23 39 ---	Portable oxygen mask: missing.	AIRLINE METHOD
E23 64 ---	Portable oxygen mask: used.	AIRLINE METHOD
E27 83 ---	Emergency floor proximity light: does not turn off.	33-50 TASK 801
E27 84 ---	Emergency floor proximity light: does not turn on.	33-50 TASK 801
E29 12 ---	Life vest, demo: damaged.	AIRLINE METHOD
E29 39 ---	Life vest, demo: missing.	AIRLINE METHOD
E32 83 ---	Emergency area light: does not turn off.	33-50 TASK 801
E32 84 ---	Emergency area light: does not turn on.	33-50 TASK 801
E37 84 ---	Flashlight LED: does not turn on.	25-99 TASK 801
E38 12 ---	Extension seat belt: damaged.	AIRLINE METHOD
E38 39 ---	Extension seat belt: missing.	AIRLINE METHOD
E49 12 ---	Escape strap: damaged.	AIRLINE METHOD
E49 82 ---	Escape strap: does not stow.	25-61 TASK 805
E51 81 ---	Oxygen mask door on PSU: does not stay upright.	35-22 TASK 804
E55 38 ---	Therapeutic oxygen bottle: low pressure/quantity.	AIRLINE METHOD
E55 39 ---	Therapeutic oxygen bottle: missing.	AIRLINE METHOD
E55 64 ---	Therapeutic oxygen bottle: used.	AIRLINE METHOD
E56 12 ---	Therapeutic oxygen mask: damaged.	AIRLINE METHOD
E56 39 ---	Therapeutic oxygen mask: missing.	AIRLINE METHOD
E56 64 ---	Therapeutic oxygen mask: used.	AIRLINE METHOD
G12 12 ---	Coffee maker: damaged.	AIRLINE METHOD
G12 21 ---	Coffee maker: light does not come on.	AIRLINE METHOD
G12 33 ---	Coffee maker: inoperative.	AIRLINE METHOD

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT CODE	FAULT DESCRIPTION	GO TO FIM TASK
G12 36 ---	Coffee maker: leaking.	AIRLINE METHOD
G12 44 ---	Coffee maker: overflows.	AIRLINE METHOD
G12 48 ---	Coffee maker: circuit breaker opens.	AIRLINE METHOD
G12 55 ---	Coffee maker: smoking or sparking.	AIRLINE METHOD
G13 12 ---	Faucet in galley: damaged.	AIRLINE METHOD
G13 36 ---	Faucet in galley: leaking.	38-10 TASK 805
G13 38 ---	Faucet in galley: low pressure/quantity.	38-10 TASK 806
G13 43 ---	Faucet in galley: no water.	38-10 TASK 806
G13 46 ---	Faucet in galley: overheats.	38-10 TASK 808
G13 83 ---	Faucet in galley: does not turn off.	38-10 TASK 805
G13 84 ---	Faucet in galley: does not turn on.	38-10 TASK 806
G13 86 ---	Faucet in galley: high pressure.	38-10 TASK 809
G13 87 ---	Faucet in galley: no hot water.	38-10 TASK 811
G14 12 ---	Floor in galley: damaged.	AIRLINE METHOD
G14 17 ---	Floor in galley: dirty.	AIRLINE METHOD
G14 37 ---	Floor in galley: loose.	AIRLINE METHOD
G14 60 ---	Floor in galley: torn.	AIRLINE METHOD
G14 66 ---	Floor in galley: weak/spongy.	AIRLINE METHOD
G14 67 ---	Floor in galley: wet.	AIRLINE METHOD
G16 12 ---	Oven: damaged.	AIRLINE METHOD
G16 17 ---	Oven: dirty.	AIRLINE METHOD
G16 33 ---	Oven: inoperative.	AIRLINE METHOD
G16 46 ---	Oven: overheats.	AIRLINE METHOD
G16 54 ---	Oven: smells bad.	AIRLINE METHOD
G16 55 ---	Oven: smoking or sparking.	AIRLINE METHOD
G16 71 ---	Oven: does not close/fasten.	AIRLINE METHOD
G16 76 ---	Oven: does not heat enough.	AIRLINE METHOD
G16 77 ---	Oven: does not open.	AIRLINE METHOD
G17 17 ---	Sink in galley: dirty.	AIRLINE METHOD
G17 44 ---	Sink in galley: overflows.	38-30 TASK 819
G17 47 ---	Sink in galley: plugged.	38-30 TASK 819
G17 54 ---	Sink in galley: smells bad.	AIRLINE METHOD
G20 39 ---	Waste container door in galley: missing.	AIRLINE METHOD
G20 71 ---	Waste container door in galley: does not close/fasten.	AIRLINE METHOD
G21 12 ---	Work table in galley: damaged.	AIRLINE METHOD

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT CODE	FAULT DESCRIPTION	GO TO FIM TASK
G21 81 ---	Work table in galley: does not stay upright.	AIRLINE METHOD
G23 12 ---	Folding cart: damaged.	AIRLINE METHOD
G23 35 ---	Folding cart: latch or lock broken.	AIRLINE METHOD
G24 39 ---	Cart restraint quarter turn: missing.	AIRLINE METHOD
G24 40 ---	Cart restraint quarter turn: needs adjustment.	AIRLINE METHOD
G26 12 ---	Counter/shelf: damaged.	AIRLINE METHOD
G26 58 ---	Counter/shelf: stuck.	AIRLINE METHOD
G27 12 ---	Warming oven: damaged.	AIRLINE METHOD
G27 17 ---	Warming oven: dirty.	AIRLINE METHOD
G27 33 ---	Warming oven: inoperative.	AIRLINE METHOD
G27 46 ---	Warming oven: overheats.	AIRLINE METHOD
G27 54 ---	Warming oven: smells bad.	AIRLINE METHOD
G27 55 ---	Warming oven: smoking or sparking.	AIRLINE METHOD
G27 71 ---	Warming oven: does not close/fasten.	AIRLINE METHOD
G27 76 ---	Warming oven: does not heat enough.	AIRLINE METHOD
G27 77 ---	Warming oven: does not open.	AIRLINE METHOD
G52 36 ---	Water supply in galley: leaking.	38-10 TASK 804
G52 49 ---	Water supply in galley: poor quality.	38-10 TASK 810
G52 54 ---	Water supply in galley: smells bad.	38-10 TASK 810
G55 33 ---	Galley power: inoperative.	25-31 TASK 801
I11 12 ---	Video monitor: damaged.	23-32 TASK 801
I11 33 ---	Video monitor: inoperative.	23-32 TASK 802
I11 97 ---	Video monitor: poor picture quality.	23-32 TASK 801
I22 12 ---	Seat audio volume control: damaged.	23-34 TASK 801
I22 33 ---	Seat audio volume control: inoperative.	23-34 TASK 801
I26 33 ---	Video tape reproducer: inoperative.	23-32 TASK 803
I26 52 ---	Video tape reproducer: shuts off.	23-32 TASK 803
I26 72 ---	Video tape reproducer: does not eject.	23-32 TASK 803
I26 79 ---	Video tape reproducer: does not rewind.	23-32 TASK 803
I26 83 ---	Video tape reproducer: does not turn off.	23-32 TASK 803
I26 97 ---	Video tape reproducer: poor picture quality.	23-32 TASK 804
I26 98 ---	Video tape reproducer: poor audio quality.	23-32 TASK 805
I27 33 ---	Seat audio: inoperative.	23-34 TASK 802
I27 34 ---	Seat audio: intermittent.	23-34 TASK 802
I27 65 ---	Seat audio: volume problem.	23-34 TASK 802

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT CODE	FAULT DESCRIPTION	GO TO FIM TASK
I27 83 ---	Seat audio: does not turn off.	23-34 TASK 803
I27 84 ---	Seat audio: does not turn on.	23-34 TASK 802
I27 98 ---	Seat audio: poor audio quality.	23-34 TASK 802
I28 12 ---	Audio entertainment player: damaged.	23-34 TASK 804
I28 33 ---	Audio entertainment player: inoperative.	23-34 TASK 805
I28 83 ---	Audio entertainment player: does not turn off.	23-34 TASK 803
I28 84 ---	Audio entertainment player: does not turn on.	23-34 TASK 805
I29 37 ---	Seat audio jack: loose.	23-34 TASK 801
I29 47 ---	Seat audio jack: plugged.	23-34 TASK 801
I31 12 ---	Seat audio channel select: damaged.	23-34 TASK 801
I31 33 ---	Seat audio channel select: inoperative.	23-34 TASK 801
I34 33 ---	Airshow: inoperative.	23-32 TASK 806
L11 83 ---	Call light above passenger seat: does not turn off.	33-20 TASK 801
L11 84 ---	Call light above passenger seat: does not turn on.	33-20 TASK 801
L13 83 ---	Ceiling light, bin mounted: does not turn off.	33-20 TASK 801
L13 84 ---	Ceiling light, bin mounted: does not turn on.	33-20 TASK 801
L16 83 ---	Closet light: does not turn off.	33-20 TASK 801
L16 84 ---	Closet light: does not turn on.	33-20 TASK 801
L17 83 ---	Entry light: does not turn off.	33-20 TASK 801
L17 84 ---	Entry light: does not turn on.	33-20 TASK 801
L18 83 ---	Galley ceiling light: does not turn off.	33-20 TASK 801
L18 84 ---	Galley ceiling light: does not turn on.	33-20 TASK 801
L19 83 ---	Lavatory light: does not turn off.	33-20 TASK 801
L19 84 ---	Lavatory light: does not turn on.	33-20 TASK 801
L20 83 ---	Galley work light: does not turn off.	33-20 TASK 801
L20 84 ---	Galley work light: does not turn on.	33-20 TASK 801
L21 83 ---	Night light: does not turn off.	33-20 TASK 801
L21 84 ---	Night light: does not turn on.	33-20 TASK 801
L23 83 ---	Reading light: does not turn off.	33-20 TASK 801
L23 84 ---	Reading light: does not turn on.	33-20 TASK 801
L25 83 ---	Window light: does not turn off.	33-20 TASK 801
L25 84 ---	Window light: does not turn on.	33-20 TASK 801
L30 83 ---	Ceiling light, recessed: does not turn off.	33-20 TASK 801
L30 84 ---	Ceiling light, recessed: does not turn on.	33-20 TASK 801
L31 83 ---	Attendant work light: does not turn off.	33-20 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT CODE	FAULT DESCRIPTION	GO TO FIM TASK
L31 84 ---	Attendant work light: does not turn on.	33-20 TASK 801
M11 17 ---	Carpet: dirty.	AIRLINE METHOD
M11 60 ---	Carpet: torn.	AIRLINE METHOD
M11 67 ---	Carpet: wet.	AIRLINE METHOD
M12 12 ---	Ceiling panel: damaged.	AIRLINE METHOD
M12 17 ---	Ceiling panel: dirty.	AIRLINE METHOD
M12 37 ---	Ceiling panel: loose.	AIRLINE METHOD
M12 39 ---	Ceiling panel: missing.	AIRLINE METHOD
M12 67 ---	Ceiling panel: wet.	38-10 TASK 804
M13 12 ---	Closet door: damaged.	AIRLINE METHOD
M13 27 ---	Closet door: hard to close.	AIRLINE METHOD
M13 28 ---	Closet door: hard to open.	AIRLINE METHOD
M13 35 ---	Closet door: latch or lock broken.	AIRLINE METHOD
M14 17 ---	Curtain: dirty.	AIRLINE METHOD
M14 39 ---	Curtain: missing.	AIRLINE METHOD
M14 60 ---	Curtain: torn.	AIRLINE METHOD
M15 12 ---	Curtain tie backs: damaged.	AIRLINE METHOD
M15 17 ---	Curtain tie backs: dirty.	AIRLINE METHOD
M15 39 ---	Curtain tie backs: missing.	AIRLINE METHOD
M15 60 ---	Curtain tie backs: torn.	AIRLINE METHOD
M15 85 ---	Curtain tie backs: does not lock in place.	AIRLINE METHOD
M17 83 ---	Lavatory-occupied sign: does not turn off.	33-20 TASK 801
M17 84 ---	Lavatory-occupied sign: does not turn on.	33-20 TASK 801
M19 83 ---	No-smoking sign: does not turn off.	33-20 TASK 801
M19 84 ---	No-smoking sign: does not turn on.	33-20 TASK 801
M20 12 ---	Overhead stowage bin: damaged.	AIRLINE METHOD
M20 17 ---	Overhead stowage bin: dirty.	AIRLINE METHOD
M20 35 ---	Overhead stowage bin: latch or lock broken.	AIRLINE METHOD
M20 40 ---	Overhead stowage bin: needs adjustment.	25-24 TASK 801
M20 67 ---	Overhead stowage bin: wet.	AIRLINE METHOD
M20 71 ---	Overhead stowage bin: does not close/fasten.	25-24 TASK 801
M20 77 ---	Overhead stowage bin: does not open.	25-24 TASK 801
M22 33 ---	Area heater in door: inoperative.	21-45 TASK 801
M23 83 ---	Fasten-seat-belt sign: does not turn off.	33-20 TASK 801
M23 84 ---	Fasten-seat-belt sign: does not turn on.	33-20 TASK 801

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT CODE	FAULT DESCRIPTION	GO TO FIM TASK
M24 12 ---	Sidewall panel: damaged.	AIRLINE METHOD
M24 17 ---	Sidewall panel: dirty.	AIRLINE METHOD
M24 37 ---	Sidewall panel: loose.	AIRLINE METHOD
M28 35 ---	Compartment handle: latch or lock broken.	AIRLINE METHOD
M46 12 ---	Bump strip in cabin: damaged.	AIRLINE METHOD
M46 39 ---	Bump strip in cabin: missing.	AIRLINE METHOD
M47 66 ---	Floor in cabin: weak/spongy.	AIRLINE METHOD
M48 12 ---	Curtain rails/hooks: damaged.	AIRLINE METHOD
M48 39 ---	Curtain rails/hooks: missing.	AIRLINE METHOD
M49 12 ---	Door entry mats: damaged.	AIRLINE METHOD
M49 17 ---	Door entry mats: dirty.	AIRLINE METHOD
M49 37 ---	Door entry mats: loose.	AIRLINE METHOD
M49 39 ---	Door entry mats: missing.	AIRLINE METHOD
M50 12 ---	Placard/decal in cabin: damaged.	AIRLINE METHOD
M50 32 ---	Placard/decal in cabin: incorrect.	AIRLINE METHOD
M50 39 ---	Placard/decal in cabin: missing.	AIRLINE METHOD
M54 99 ---	Rodent: detected on airplane.	AIRLINE METHOD
M55 99 ---	Insects: detected on airplane.	AIRLINE METHOD
M59 12 ---	Stowage compartment door: damaged.	AIRLINE METHOD
M59 27 ---	Stowage compartment door: hard to close.	AIRLINE METHOD
M59 28 ---	Stowage compartment door: hard to open.	AIRLINE METHOD
M59 35 ---	Stowage compartment door: latch or lock broken.	AIRLINE METHOD
M60 38 ---	Potable water indicator: low pressure/quantity.	38-10 TASK 812
M62 14 ---	Emergency exit door area: too cold.	21-45 TASK 802
M63 93 ---	CLEAN/CHECK SENSORS light on the attendant's panel: light comes on.	38-30 TASK 802
M64 93 ---	LAVS INOP light on the attendant's panel: light comes on.	38-30 TASK 802
M74 93 ---	Attendant control panel: light comes on.	23-42 TASK 839
M74 U5 ---	Attendant control panel: touch screen inoperative.	23-42 TASK 840
S11 12 ---	Seat armrest: damaged.	AIRLINE METHOD
S11 40 ---	Seat armrest: needs adjustment.	AIRLINE METHOD
S11 73 ---	Seat armrest: does not extend/lower.	AIRLINE METHOD
S12 12 ---	Seat ashtray: damaged.	AIRLINE METHOD
S12 39 ---	Seat ashtray: missing.	AIRLINE METHOD
S12 40 ---	Seat ashtray: needs adjustment.	AIRLINE METHOD
S12 71 ---	Seat ashtray: does not close/fasten.	AIRLINE METHOD

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT CODE	FAULT DESCRIPTION	GO TO FIM TASK
S12 77 ---	Seat ashtray: does not open.	AIRLINE METHOD
S13 12 ---	Seat footrest: damaged.	AIRLINE METHOD
S13 17 ---	Seat footrest: dirty.	AIRLINE METHOD
S13 29 ---	Seat footrest: hard to operate.	AIRLINE METHOD
S13 33 ---	Seat footrest: inoperative.	AIRLINE METHOD
S13 60 ---	Seat footrest: torn.	AIRLINE METHOD
S13 67 ---	Seat footrest: wet.	AIRLINE METHOD
S14 12 ---	Seat headrest: damaged.	AIRLINE METHOD
S14 17 ---	Seat headrest: dirty.	AIRLINE METHOD
S14 29 ---	Seat headrest: hard to operate.	AIRLINE METHOD
S14 33 ---	Seat headrest: inoperative.	AIRLINE METHOD
S14 37 ---	Seat headrest: loose.	AIRLINE METHOD
S14 60 ---	Seat headrest: torn.	AIRLINE METHOD
S14 67 ---	Seat headrest: wet.	AIRLINE METHOD
S15 12 ---	Flight attendant seat: damaged.	AIRLINE METHOD
S15 17 ---	Flight attendant seat: dirty.	AIRLINE METHOD
S15 29 ---	Flight attendant seat: hard to operate.	AIRLINE METHOD
S15 37 ---	Flight attendant seat: loose.	AIRLINE METHOD
S15 60 ---	Flight attendant seat: torn.	AIRLINE METHOD
S15 67 ---	Flight attendant seat: wet.	AIRLINE METHOD
S15 71 ---	Flight attendant seat: does not close/fasten.	AIRLINE METHOD
S15 77 ---	Flight attendant seat: does not open.	AIRLINE METHOD
S16 12 ---	Flight attendant seat harness: damaged.	AIRLINE METHOD
S16 29 ---	Flight attendant seat harness: hard to operate.	AIRLINE METHOD
S16 40 ---	Flight attendant seat harness: needs adjustment.	AIRLINE METHOD
S19 12 ---	Seat safety card: damaged.	AIRLINE METHOD
S19 32 ---	Seat safety card: incorrect.	AIRLINE METHOD
S19 39 ---	Seat safety card: missing.	AIRLINE METHOD
S20 12 ---	Seat aisle trim: damaged.	AIRLINE METHOD
S20 37 ---	Seat aisle trim: loose.	AIRLINE METHOD
S21 37 ---	Seat assembly: loose.	AIRLINE METHOD
S22 12 ---	Seat back: damaged.	25-22 TASK 801
S22 17 ---	Seat back: dirty.	AIRLINE METHOD
S22 37 ---	Seat back: loose.	AIRLINE METHOD
S22 60 ---	Seat back: torn.	AIRLINE METHOD

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT CODE	FAULT DESCRIPTION	GO TO FIM TASK
S22 67 ---	Seat back: wet.	AIRLINE METHOD
S22 78 ---	Seat back: does not recline.	25-22 TASK 801
S22 81 ---	Seat back: does not stay upright.	25-22 TASK 801
S23 12 ---	Seat back pocket: damaged.	AIRLINE METHOD
S23 17 ---	Seat back pocket: dirty.	AIRLINE METHOD
S23 60 ---	Seat back pocket: torn.	AIRLINE METHOD
S23 67 ---	Seat back pocket: wet.	AIRLINE METHOD
S24 12 ---	Seat belt: damaged.	AIRLINE METHOD
S24 17 ---	Seat belt: dirty.	AIRLINE METHOD
S24 33 ---	Seat belt: inoperative.	AIRLINE METHOD
S24 39 ---	Seat belt: missing.	AIRLINE METHOD
S25 17 ---	Seat bottom cushion: dirty.	AIRLINE METHOD
S25 54 ---	Seat bottom cushion: smells bad.	AIRLINE METHOD
S25 57 ---	Seat bottom cushion: stained.	AIRLINE METHOD
S25 60 ---	Seat bottom cushion: torn.	AIRLINE METHOD
S25 67 ---	Seat bottom cushion: wet.	AIRLINE METHOD
S26 12 ---	Seat track insert: damaged.	AIRLINE METHOD
S26 37 ---	Seat track insert: loose.	AIRLINE METHOD
S26 39 ---	Seat track insert: missing.	AIRLINE METHOD
S27 12 ---	Seat tray table: damaged.	AIRLINE METHOD
S27 17 ---	Seat tray table: dirty.	AIRLINE METHOD
S27 35 ---	Seat tray table: latch or lock broken.	AIRLINE METHOD
S27 40 ---	Seat tray table: needs adjustment.	AIRLINE METHOD
S27 82 ---	Seat tray table: does not stow.	AIRLINE METHOD
S29 12 ---	Seat legrest: damaged.	AIRLINE METHOD
S29 17 ---	Seat legrest: dirty.	AIRLINE METHOD
S29 29 ---	Seat legrest: hard to operate.	AIRLINE METHOD
S29 33 ---	Seat legrest: inoperative.	AIRLINE METHOD
S29 60 ---	Seat legrest: torn.	AIRLINE METHOD
S29 67 ---	Seat legrest: wet.	AIRLINE METHOD
S29 82 ---	Seat legrest: does not stow.	AIRLINE METHOD
S34 37 ---	Passenger service unit panel: loose.	25-23 TASK 801
S34 71 ---	Passenger service unit panel: does not close/fasten.	25-23 TASK 801
S35 33 ---	Passenger service unit air outlet: inoperative.	25-23 TASK 801
T12 12 ---	Countertop in lavatory: damaged.	AIRLINE METHOD

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT CODE	FAULT DESCRIPTION	GO TO FIM TASK
T12 17 ---	Countertop in lavatory: dirty.	AIRLINE METHOD
T13 12 ---	Door to lavatory: damaged.	AIRLINE METHOD
T13 35 ---	Door to lavatory: latch or lock broken.	AIRLINE METHOD
T13 71 ---	Door to lavatory: does not close/fasten.	AIRLINE METHOD
T13 77 ---	Door to lavatory: does not open.	AIRLINE METHOD
T14 12 ---	Faucet in lavatory: damaged.	AIRLINE METHOD
T14 36 ---	Faucet in lavatory: leaking.	38-10 TASK 807
T14 38 ---	Faucet in lavatory: low pressure/quantity.	38-10 TASK 806
T14 43 ---	Faucet in lavatory: no water.	38-10 TASK 806
T14 46 ---	Faucet in lavatory: overheats.	38-10 TASK 808
T14 83 ---	Faucet in lavatory: does not turn off.	38-10 TASK 807
T14 84 ---	Faucet in lavatory: does not turn on.	38-10 TASK 806
T14 86 ---	Faucet in lavatory: high pressure.	38-10 TASK 809
T14 87 ---	Faucet in lavatory: no hot water.	38-10 TASK 811
T15 12 ---	Grab handle in lavatory: damaged.	AIRLINE METHOD
T15 17 ---	Grab handle in lavatory: dirty.	AIRLINE METHOD
T16 12 ---	Mirror in lavatory: damaged.	AIRLINE METHOD
T16 17 ---	Mirror in lavatory: dirty.	AIRLINE METHOD
T16 37 ---	Mirror in lavatory: loose.	AIRLINE METHOD
T18 83 ---	Return-to-seat sign in lavatory: does not turn off.	33-20 TASK 801
T18 84 ---	Return-to-seat sign in lavatory: does not turn on.	33-20 TASK 801
T20 33 ---	Sink drain stopper in lavatory: inoperative.	38-30 TASK 818
T21 12 ---	Smoke detector: damaged.	AIRLINE METHOD
T21 19 ---	Smoke detector: disconnected.	AIRLINE METHOD
T21 33 ---	Smoke detector: inoperative.	AIRLINE METHOD
T21 37 ---	Smoke detector: loose.	AIRLINE METHOD
T21 39 ---	Smoke detector: missing.	AIRLINE METHOD
T21 83 ---	Smoke detector: does not turn off.	26-14 TASK 801
T22 12 ---	Soap dispenser: damaged.	AIRLINE METHOD
T22 22 ---	Soap dispenser: empty.	AIRLINE METHOD
T22 29 ---	Soap dispenser: hard to operate.	AIRLINE METHOD
T22 33 ---	Soap dispenser: inoperative.	AIRLINE METHOD
T22 36 ---	Soap dispenser: leaking.	AIRLINE METHOD
T23 12 ---	Toilet bowl: damaged.	AIRLINE METHOD
T23 17 ---	Toilet bowl: dirty.	AIRLINE METHOD

ECCN 9E991 BOEING PROPRIETARY - See title page for details

FAULT CODE	FAULT DESCRIPTION	GO TO FIM TASK
T23 44 ---	Toilet bowl: overflows.	38-30 TASK 814
T23 47 ---	Toilet bowl: plugged.	38-30 TASK 815
T23 54 ---	Toilet bowl: smells bad.	AIRLINE METHOD
T24 12 ---	Toilet flush button: damaged.	AIRLINE METHOD
T24 17 ---	Toilet flush button: dirty.	AIRLINE METHOD
T25 47 ---	Toilet flush system: plugged.	38-30 TASK 817
T25 74 ---	Toilet flush system: does not flush.	38-30 TASK 811
T25 83 ---	Toilet flush system: does not turn off.	38-30 TASK 816
T26 12 ---	Toilet seat: damaged.	AIRLINE METHOD
T26 17 ---	Toilet seat: dirty.	AIRLINE METHOD
T26 39 ---	Toilet seat: missing.	AIRLINE METHOD
T27 12 ---	Toilet seat lid: damaged.	AIRLINE METHOD
T27 17 ---	Toilet seat lid: dirty.	AIRLINE METHOD
T27 39 ---	Toilet seat lid: missing.	AIRLINE METHOD
T28 12 ---	Waste chute door in lavatory: damaged.	AIRLINE METHOD
T28 40 ---	Waste chute door in lavatory: needs adjustment.	25-40 TASK 801
T28 47 ---	Waste chute door in lavatory: plugged.	AIRLINE METHOD
T31 17 ---	Floor in lavatory: dirty.	AIRLINE METHOD
T32 17 ---	Sink in lavatory: dirty.	AIRLINE METHOD
T32 47 ---	Sink in lavatory: plugged.	38-30 TASK 819
T39 12 ---	Toilet roll holder: damaged.	AIRLINE METHOD
T39 39 ---	Toilet roll holder: missing.	AIRLINE METHOD
T41 49 ---	Water supply in lavatory: poor quality.	38-10 TASK 810
T41 54 ---	Water supply in lavatory: smells bad.	38-10 TASK 810

ECCN 9E991 BOEING PROPRIETARY - See title page for details